



Vehicle History Summary



Fleet #	TLS1204
Registration	XB84OF
Make	Kenworth
Model	T610
VIN / Chassis #	6F5000000PA481807
Build Date	2023

Date	Reading / Units	Type / Repairer Notes	Repairer
15/07/2026	484,470 kms	Battery, Door Hinge, Engine Oil, Ignition Switch - Key, Low Coolant R-7826 1. Isolated truck, removed battery cradle, disconnected removed and replaced batteries, installed battery cradle. 2. Remove R/H dash panels, loosened nut on key barrel, turned anti clock wise till suited position tightened lock nut and put dash panels back together 3. Filled coolant 2.5L 4. Filled engine oil 2.5L 5. Sprayed hinge with white spray grease, did not take up any play	Tasman workshop QLD
06/07/2026	482,299 kms	Mirrors R-7746 1. Driver side mirror smashed - Mirror smashed due to something hitting the Mirror. Rear chrome cover has minor damage. Took off rear cover, unbolted smashed mirror, unplugged mirror, plugged in new mirror, bolted new mirror in. Tested to make sure everything works - all ok, put chrome backing on mirror. (J.S 06/07/26)	Tasman workshop QLD
17/06/2026	475,053 kms	Alternator, Breakdown R-7585 Organise BDSM to attend site to assess damage and diagnose cause of fault. Remove and replace parts as required. *See attached invoice for further details*	BDSM - Breakdown Diesel Service And Maintenance
05/06/2026	471,781 kms	Taillights R-7550 1. LH taillight assembly - Replaced taillight assembly to match RH side	Tasman workshop QLD
30/05/2026	471,741 kms	ACCIDENT, Body General R-6843 Organise Recar Brisbane to assess, quote and repair accident damage as required. *See attached invoice for further details*	Knights Towing, Recar
11/05/2026		Breakdown R-7386 **Job 1. Tow — Port of Brisbane Depot, Whimbrel St to Recar Brisbane, Colebard St East, Acacia Ridge.	Knight's Towing
08/04/2026		Registration O-1104	
07/04/2026		ACCIDENT, Body General, Bonnet R-6843 1. Organise Knights towing to attend site and carry out accident recovery after hours to return unit to POB workshop.	Knights Towing
31/03/2026	471,342 kms	Speed Limiter Inspection I-456 Organise Brown and Hurley Hemmant to carry out speed limiter calibration as per requirements.	Brown and Hurley - Hemmant
31/03/2026	471,354 kms	Fault List R-6763 1. Inspected 1st diff found there was a slight leak so retension diff head bolts and clean breathers- to be monitored (MA 31/3/26) 2. 3rd axle brakes worn - inspected 3rd axle brake shoes and drums and found they were worn so replaced RH Brake Shoes and Drum (KH 31/03/26) and LH Brake shoes and Drum (MA 31/3/26) 3. Inspected 2nd axle LH s cam tube found it wasn't leaking badly- to be monitored next service (MA 31/3/26) 4. Looked at Trailer low air switch on dash and I found no moisture in air tanks- to be monitored (MA 31/3/26) 5. Inspected 3rd axle mudguards and found no serious damage- to be monitored next service (MA 31/3/26) 6. Inspect injector number 2 and 5 had a slight wheep of tube nothing to serious - to be monitored next service (MA 31/3/26) 7. Inspected exhaust manifold cyl 1 and found slight wheep nothing to serious- to be monitored next service (MA 31/3/26) 8. Inspected front engine mounts and found that they weren't badly spilt and they were loose so retension them- to be monitored next service (MA 31/3/26) 9. Inspected rear engine mounts and found that they were not badly spilt. - monitored next service (MA 31/3/26)	Tasman workshop QLD
30/03/2026	471,347 kms	C - 150k/Annual Service S-5154	Brown and Hurley - Hemmant

Date	Reading / Units	Type / Repairer Notes	Repairer
		Carry out C service as per Paclease service sheet Faults Found: 1. Leak at 1st diff area - wash and inspect further 2. 3rd axle brakes worn - require replacement 2. 2nd axle LH s cam tube seal leaking - requires replacement Faults to be monitored: 1. Trailer low air switch fault on dash - monitor for moisture in air system 2. 3rd axle mudguards showing damage - monitor at next service 3. Weep at injector tubes into head @ 2 and 5 - monitor at next service 4. Weep at exhaust manifold cyl 1 - monitor at next service 5. Front engine mount starting to split - monitor at next service 6. LH and RH rear engine mounts starting to split - monitor at next service	
27/03/2026	471,342 kms	NHVR-Annual Inspection-HV I-455	Brown and Hurley - Hemmant
		Organise Brown and Hurley Hemmant to carry out NHVR inspection at time of service as per attached check sheet.	
12/03/2026		Electrical R-6881	Tasman workshop QLD
		1. Carried out EBS socket check - all ok. Carried out continuity test from truck to trailer - all ok. checked EBS fuse - all ok. 2. Removed and Replaced 7 pin socket on truck at trailer end, tested - all ok.	
12/03/2026		ABS/EBS R-6629	Tasman workshop QLD
		1. Test EBS socket for continuity from truck to trailer - ok. Check all EBS fuses - ok. 2. Remove and replace 7 pin trailer plug on trailer end of suzi cable. Test - ok.	
11/03/2026	462,169 kms	Air Dryer, Air Leak, Trailer Low Air Warning R-6494	Brown and Hurley - Hemmant
		Rectify faults found on S-5086 2. Remove and replace faulty trailer low air switch. 3. Diagnose and replace faulty TP5 valve to rectify air fault in suzi line. 6 + 10. Remove and replace air dryer filter and breather.	
04/03/2026	462,191 kms	295/80R22.5, Balance, Pressure Check, Rotation T-4379	Tasman workshop QLD
		Remove and replace 2 x 295/80r22.5 kumho krs03+ on position 1,2 due to shaking issue within case Criss cross rotation with position 3-10 Pressure check position 3-10	
03/03/2026	462,191 kms	Air Systems, Brakes, Engine, Fault List, Lights R-6494	Tasman workshop QLD
		Carry out repairs/inspections from S-5086 1. Rear axle brakes getting low - monitor at next service. 4. Loading lights have some internal LED's not working - monitor at next service. 5. LH and RH rear guards minor cracking - monitor at next service. 7. Front RH tyre has slash in sidewall - repaired on T-4397. 8. Unit slow to build air - rectified on R-6494 at Brown and Hurley. 9. Cam sensor fault - remove and replace failed sensor. Clear all codes from ECU and test. (L.P) 10. Drivers seatbelt buckle faulty - remove and replace buckle assembly and wire in existing plug. Test - ok. L.P)	
27/02/2026	462,169 kms	A - 25k Km Service S-5086	Brown and Hurley - Hemmant
		Carry out "A" service as per Paclease service sheet. Faults rectified as part of service: 1. Loose chassis brace - Tightened up on service. 2. Excessive moisture in tanks - drained. 3. Steer axle hub oil low - topped up. 4. Cab filter blocked - replaced. Faults Found: 1. Rear axle brakes getting low - monitor at next service. 2. Trailer low air warning active. 3. Air leaking from blue suzi coil when brake applied. 4. Loading lights have some internal LED's not working 5. LH and RH rear guards minor cracking - monitor. 6. Suspect air dryer breather blocked - replacement required. 7. Front RH tyre has slash in sidewall - requires replacement. 8. Unit slow to build air - requires further inspection. 9. Cam sensor fault - requires replacement. 10. Air dryer filter contaminated with moisture - requires replacement.	
16/01/2026	448,879 kms	Wiper Blades R-6550	Tasman workshop QLD
		1. Remove and replace worn wiper blades.	
30/12/2025	446,029 kms	Air Leak R-6058	Tasman workshop QLD
		1. Remove and replace male and female trailer couplings	
11/12/2025	445,061 kms	Defect List R-5648	Tasman workshop QLD
		1. Test and check weigh scales as per F-1541 - found unit in good working condition. (Luke) 2. Make access to and remove alternator (check bearing play - ok), remove fan and a/c belts and tensioners. Remove fan blade and remove Horton fan assembly. Drill out and remove snapped mounting bolt for the Horton. Refit Horton assembly with new high tensile mounting bolts. Refit fan blade and fit new fan/ac belts and tensioners. Test operation - ok. (Kobi + Jess + Luke) 3. Remove and weld repair crack in alternator bracket. Paint and refit bracket. (Jess) 4. Make access to and remove prop shaft at 1st diff output. Remove yoke nut and use puller to remove 1st diff output yoke from spline. Remove bearing carrier assembly and clean all sealing surfaces. Remove and replace old seal and remove seal runner fitted to yoke. Clean all parts and refit bearing carrier assembly to 1st diff output housing with new silicone and tension bolts. Refit output yoke with new nut and washer kit. Refit prop shaft end with new bolt kit and tension. (Luke + Kobi) 5. Drain 1st and 2nd drive diff oils due to oil being burnt/contaminated. Ensure breathers are clean and free from blockages. Remove gauze filter in 1st diff and clean. Fit new filter to 1st diff and fill both diffs with new oil. (Jess) 6. Top up coolant and tension all cooling system hose clamps. (Kobi) 7. Wash down oil residue at rocker cover gasket. (Luke) 8. Top up auto-greaser (Kobi) 9. Reset grease interval with Cando. (Kobi) 10. Replace coolant drop down pipe "P" clamps. (Jess) **need to add tensioners and belts to parts**	
05/12/2025	440,807 kms	B - 50k Km Service S-4992	Brown and Hurley - Hemmant

Date	Reading / Units	Type / Repairer Notes	Repairer
		Carried out: - B service Faults Found: 1. Belts due next service 2. 1st diff thrushaft seal leak 3. Engine valve cover leak - done under warranty *See attached service sheet for further details*	
04/12/2025	440,799 kms	New T-4223 2x 295/80R22.5 steers changed due to wearing badly	Tasman workshop QLD
03/12/2025	440,463 kms	New T-4222 Changed all drives due to low tread	Tasman workshop QLD
14/11/2025	422,572 kms	Puncture Repair T-4034 1. Remove, strip and repair nail puncture on RH 2nd axle inside position tyre. (Dave)	Tasman workshop QLD
29/10/2025	410,096 kms	Air Systems R-5698 Truck struggles to build air and has had the air guvnor valve changed	Brown and Hurley - Toowoomba
13/10/2025	299,476 kms	Run Out T-3916 2x Run Out Drives fitted due to puncture	Tasman workshop QLD
02/10/2025	395,572 kms	Air Systems R-5516 Trailer air warning. R&R air pressure sensor.	Brown and Hurley - Yatala
02/09/2025	385,430 kms	B - 40k Km Service S-4678 - Carry out B Service	Tasman workshop QLD
21/08/2025	371,609 kms	Cooling System, Rear Hub R-4901 - Replaced steer axle R/H hub seal - Replaced all 3-coolant drawdown hose clamps	Tasman workshop QLD
11/08/2025	371,609 kms	A - 20k Km Check S-4558 - Carry out A Service - Front Drive R/H Hub seal leak Refer R-4901 - Coolant draw down hose P clamp broken Refer R-4901	Tasman workshop QLD
23/07/2025	355,930 kms	Brakes, Electrical R-4699 - Repaired hand brake dash valve - Relaced broken Aerial - Replaced broken side indicator	Tasman workshop QLD
08/07/2025	344,563 kms	B - 40k Km Service S-4427 - Carry out B Service. (Luke carried out services and repairs) Found on service - Front L/H Hub seal leak (replaced) - Replaced intercooler hose - Tightened up belly bar bolts - Replaced all torque rods out of specs Monitor next service - R/H rear of front drive axle air bag minor weep - R/H Front of Rear axle air bag minor weep - Ad blue tank rubbers - Turntable wear pads next service - Fuel tank rubbers	Tasman workshop QLD
12/06/2025	325,718 kms	Hub Leak R-4352 -Replace R/H steer hub seal (Luke carried out) - Removed Wheel drum and hub nuts - Removed wheel bearings cleaned check for wear. - oiled bearing reassembled hub - torqued nuts to specs - Filled with hub oil	Tasman workshop QLD
10/06/2025		295/80R22.5 T-3621 Supply & fit - 2 x 295/80R22.5	Black Rubber Pty Ltd (Tyrright Lytton)
09/06/2025	325,718 kms	A - 20k Km Check S-4311 - Carry out A Service (Luke and Kobi) - Repairs found on service Refer R-4352 - Monitor next service - L/H Front Drive torque rod bush. - two 20mm cracks in windscreen. - minor coolant weep near rear heater tap.	Tasman workshop QLD
09/06/2025	325,718 kms	Speed Limiter Inspection I-220 Hooked up scan tool checked speed limiter and changed cruise control from 93-98 and top speed from 95-98 as per company polices road tested to confirm correct speed limiting	Tasman workshop QLD
06/06/2025	323,818 kms	HEADLIGHT R-4402 Repaired RH low beam headlight.	Brown and Hurley - Toowoomba
11/04/2025	311,706 kms	REPAIRS & MAINTENANCE, Warranty R-4265 Major engine damage. Warranty Repairs/Service At No Charge. Refer to invoice.	Brown and Hurley - Yatala
27/03/2025	301,731 kms	NHVR-Annual Inspection-HV I-148 - Carried out NHVR COI	Tasman workshop QLD

Date	Reading / Units	Type / Repairer Notes	Repairer
24/03/2025	301,731 kms	C - 120k/Annual Service S-3950 - Carry out C Service (Chris Carried out) - Kit Horton fan (Jess Carried out) - Replace water pump and Oring (Jess carried out)	Tasman workshop QLD
21/01/2025	278,518 kms	A - 20k Km Check S-3829 1. Carried out A service as per service sheet. Found on service Horton fan will need a kit next service	Tasman workshop QLD
09/01/2025		Suzie Coils R-3388 R&R all Suzi coils	Tasman workshop QLD
20/12/2024	267,194 kms	11R22.5, 295/80R22.5 T-2922 8 x Supply & fit. - 11R22.5. - 2 X supply * FIT - 295/80r22.5. - Balance	Black Rubber Pty Ltd (Tyreight Lytton)
10/12/2024	259,965 kms	B - 40k Km Service S-3692 1. Carried out B service as per service sheet. (Chris carried out service) Found on service Monitor front L/H torque rod bush. Horton fan will require a kit next oil change.	Tasman workshop QLD
18/11/2024	242,481 kms	A - 20k Km Check S-3580 1. Carried out A service as per service sheet. (Chris and Indy Carried out)	Tasman workshop QLD
04/11/2024	232,058 kms	Battery R-2979 1. loaded tested batteries found 2 out of 4 to have dropped cells and the other two very average. 2. R&R batteries	Tasman workshop QLD
01/11/2024	231,838 kms	Damage, Wiper Blades R-2971 Removed and replaced wiper blades	Tasman workshop QLD
03/10/2024	218,754 kms	B - 40k Km Service S-3416 1. Carried out B service as per service sheet. Monitor rear shock rubbers next service.	Tasman workshop QLD
16/09/2024		11R22.5, New T-2327	Tyre Evolution - Eagle Farm
03/09/2024	200,028 kms	A - 20k Km Check S-3298 1. Carried out A service as per service sheet. 2. Adjusted Turntable.	Tasman workshop QLD
03/09/2024	200,028 kms	Damage R-2615 Removed and replaced driver's side window switch	Tasman workshop QLD
02/08/2024	177,035 kms	C - 120k/Annual Service S-3128 1. Carried out C service as per service sheet. (Chris and Jess carried out)	Tasman workshop QLD
28/06/2024	158,571 kms	REPAIRS & MAINTENANCE R-2148 Stu filled auto greaser.	Tasman workshop QLD
14/06/2024		TMA - Telematics Monitoring O-774 Certificate of Enrolment TMA XB84OF 14-06-2024	MTData
13/06/2024		Windscreen R-2032 The Fixer replaced windscreen.	The Fixer Windscreens
23/05/2024	127,459 kms	New T-1750 10 x supply & fit. inspected found Tyres require replacement.	Michelin Australia Pty Ltd
23/05/2024	131,514 kms	A - Service 30,000 km S-2798 1. Carry out B service. 2. Replaced Cabin filter. 3. Filled up auto greaser.	Brown and Hurley - Yatala, Tasman workshop QLD
10/05/2024		REPAIRS & MAINTENANCE R-1820 Weight measurement calibration	Tramanco Pty Ltd
10/04/2024		Registration O-578 Registration transferred to TasLog. Registration changed from XW53JJ to XB84OF	

Date	Reading / Units	Type / Repairer Notes	Repairer
31/03/2024		C.O.I / R.W.C O-431 QLD_31871064_CERTIFICATE_OF_INSPECTION_FIRST_XQ53JJ	
24/02/2024		C.O.I / R.W.C O-348 QLD_HVRAS_XW53JJ QLD_Vehicle_Details_Inspection_XW53JJ	
01/02/2024	59,401 kms	A - Service 30,000 km S-2404 KW First Service ISXe5 Parts	Brown and Hurley - Toowoomba

Signed: _____

Name: _____

Date: _____