



Vehicle History Summary



Fleet #	TLS1206
Registration	XB21MX
Make	Kenworth
Model	T610
VIN / Chassis #	6F5000000PA484957
Build Date	2023

Date	Reading / Units	Type / Repairer Notes	Repairer
05/06/2026	483,388 kms	ABS/EBS R-7549 TRAINING AND TESTING on XB26NP 1. EBS/ABS Fault - Explained to Kobi on how to check for faults on voltage output at EBS/ABS Socket and cable continuity. Once Satisfied Kobi understood the testing procedure we went to Prime Mover T610 to find out if Kobi could carry out testing and understood explanation. (S.G 05/06/26) 2. EBS/ABS Fault - Found Fault with 24v red wire and Luke found blown fuse, replaced fuse but red wire still had fluctuating voltage, upon further inspection found faulty inverter. Ordered inverter, Kobi fitted new Inverter and carried out testing to ensure fault rectified. (K.H, S.G & L.P 05/06/26) 3. Test Drive - whilst waiting for inverter to show up, bypassed inverter and took prime mover for test drive to make sure no other problems (S.G 05/06/26)	Tasman workshop QLD
05/06/2026	483,372 kms	Fault List R-7423 1. Thru shaft seal leaking - replaced thru shaft seal, pinion nut and washer, and jack shaft bolts (KH 04/06/26) 2. Trans splitter valve misting - monitor at next service (KH 04/06/26) 3. Turbo oil return hose weeping - monitor at next service (KH 04/06/26) 4. Both diff oils contaminated - replaced on service and will wait on oil sample (KH 04/06/26) 5. Rear engine mounts starting to split - monitor at next service (KH 04/06/26) 6. Trailer low air warning and fault - Replaced trailer low/high pressure sensor and flush system (KH 05/06/26) 7. Drive shock bushes worn - monitor at next service (KH 04/06/26) 8. Slight bonnet rubbing on steering box - monitor at next service (KH 05/06/26) 9. Replaced air dryer unloaded valve kit (KH 04/06/26)	Tasman workshop QLD
01/06/2026	483,372 kms	C - 150k/Annual Service S-5333 Organise Brown and Hurley Hemmant to carry out "C" service as per Paclease service sheet. Faults Found: 1. Thru shaft seal leaking 2. Trans splitter valve misting - monitor at next service 3. Turbo oil return hose weeping - monitor at next service 4. Both diff oils contaminated - replaced and will wait on oil sample 5. Rear engine mounts starting to split - monitor at next service 6. Trailer low air warning and fault - further inspection required 7. Drive shock bushes worn - further inspection required 8. Slight bonnet rubbing on steering box - inspect bonnet bushes	Brown and Hurley - Hemmant
01/06/2026	483,372 kms	NHVR-Annual Inspection-HV I-565 Organise Brown and Hurley to carry out NHVR inspection as per attached check sheet at time of service.	Brown and Hurley - Hemmant
26/05/2026	483,372 kms	Speed Limiter Inspection I-566	Brown and Hurley - Hemmant
16/04/2026	473,995 kms	Door, Horton, Steering Shaft, Thru-shaft, Torque Rod Bushes R-6784 1. Driver's side door missing holding latch - Replaced bolts and used rivet nut insert on top thread. (KH 10/04/26) 2. Trailer low air warning on dash - monitor next service (KH 10/04/26) 3. No reverse lights or buzzer - reset fuse (KH 02/04/26) 4. Missing 2 LED's out of loading light - monitor next service (KH 10/04/26) 5. Wiper blades worn - requires a new replacement - Replaced wiper blades (KH 07/04/26) 6. Fuel tank strap rubbers and AdBlue tank strap rubbers bulging - Replaced all Fuel tank and AdBlue tank rubbers (KH 07/04/26) 7. Turntable skid plates worn - require replacement - Replaced turntable wear pads (KH 07/04/26) 8. Minor weep at cab shock - remove and replace cab shock. (J.R 16/04/26) 9. Excessive movement in steering column - Replaced steering shaft (KH 07/04/26) 10. CAC bushes - Replaced bushes and bolts (KH 07/04/26) 11. Turbo drain weeping - needs wash down and monitor next service. 12. Horton fan down to rivets - requires re-kit - Removed, Re-kitted, and installed. Replaced Horton fan solenoid. (KH 07/04/26) 13. Cracking on Air bags - monitor next service (KH 10/04/26) 14. Front diff output leaking - Replaced Thru-shaft seal. (KH 08/04/26) 15. All drive tyres low 16. All shock absorber bushes cracked/ split - Due next service. (KH 10/04/26) 17. Front engine mounts been moving - replaced both front engine mount bushes. (KH 09/04/25) 18. Rear engine mounts starting to crack - Monitor for next service. (KH 09/04/26) 19. Front right torque rod starting to split - Replaced both front torque rods. (KH 10/04/26) 20. RH Headlight protector has damage - Replaced RH Headlight Protector (KH 07/04/26) 21. Replaced both air couplings fittings (KH 08/04/26) 22. Remove and replace upper and lower RH door hinges. (KH 10/04/26) 23. Remove and replace indicator stalk due to fault. (KH 14/04/26) 24. Organise Fixer windscreens to attend site and replace cracked windscreen.	Tasman workshop QLD
13/04/2026		REPAIRS & MAINTENANCE R-7286	The Fixer Windscreens

Date	Reading / Units	Type / Repairer Notes	Repairer
**Job 1. R&R windscreen - Kenworth T610 2023			
10/04/2026	473,995 kms	11R22.5, Drive tyres, Pressure Check T-4502 Remove and replace 8 x 11r22.5 Haulmax att307 due to low tread on position 3-10 Pressure check position 1,2	Tasman workshop QLD
31/03/2026	473,985 kms	B - 50k Km Service S-5155 Organise Brown and Hurley Hemmant to carry out "C" as per Paclease service sheet: Faults Found: 1. Driver's side door missing holding latch 2. Trailer low air warning on dash 3. No reverse lights or buzzer 4. Missing 2 LED's out of loading light 5. Wiper blades worn 6. Fuel tank strap rubbers and AdBlue tank strap rubbers bulging 7. Turntable skid plates worn 8. Minor weep at cab shock 9. Excessive movement in steering column 10. CAC bushes 11. Turbo drain weeping 12. Horton fan down to rivets 13. Cracking on Air bags 14. Front diff output leaking 15. All drive tyres low 16. All shock absorber bushes cracked/ split 17. Front engine mounts been moving 18. Rear engine mounts starting to crack 19. Front right torque rod starting to split 20. RH Headlight protector has damage	Brown and Hurley - Hemmant
31/03/2026	473,985 kms	NHVR-Annual Inspection-HV I-457 Organise Brown and Hurley to carry out NHVR inspection as per attached check sheet at time of service.	Brown and Hurley - Hemmant
20/12/2025	460,372 kms	A - 25k Km Service S-4982 Carried out: - A service Faults Found: 1. rear mudguards have damage 2. 1st diff thrushaft seal leak 3. Trailer low air warning active on dash 4. Auto grease has minor leak *See attached service sheet for further details*	Brown and Hurley - Toowoomba
10/12/2025	460,372 kms	Trailer Low Air Warning, Warning lights on dash R-6152 Diagnose and repair fault in trailer low air warning circuit.	Brown and Hurley - Toowoomba
18/11/2025		New T-4046 1. Supply, fit and balance 2 x 295/80r22.5 tyres to positions 1 and 2 due to low tread. *Yokohama RY023 tyres fitted*	Wise's Mobile Tyres
04/11/2025		Windscreen R-5846 Supplied and installed Front windshield + moulding	Garden City Auto Glass - Toowoomba
28/10/2025	419,589 kms	B - 40k Km Service S-4854 Carried out B service (Kobi + Jess) Requires: Windscreen replacement Monitor: Horton fan 5mm + Fuel tank rubbers bulging + Rear mud guards minor damage + turntable jaw play Repairs: Replace 1 x "P" Clamp at coolant heater drop pipe.	Tasman workshop QLD
28/10/2025		Electrical R-5559 To be changed at next service. .	Tasman workshop QLD
16/10/2025	411,488 kms	REPAIRS & MAINTENANCE R-5520 Front diff movement. Removed front sway bar, pressed out bushes pressed in new bushes, refitted sway bar to vehicle, replaced all nuts	
19/09/2025	405,577 kms	Puncture Repair T-3948 1 x Puncture Repair	
25/08/2025	387,991 kms	B - 40k Km Service S-4651 - Carry out B Service - L/H Steer hub seal leak - Replaced both steer axle shoes and drums - R/H Fuel tank straps replaced - Coolant draw down hose clamp broken	Tasman workshop QLD
28/07/2025	367,511 kms	A - 20k Km Check S-4509 - Carry out A Service	BDS Mechanical - Toowoomba
18/06/2025		295/80R22.5 T-3636 Supply & fit - 2 x 295/80R22.5	Black Rubber Pty Ltd (Tyreright Lytton)
12/06/2025	341,967 kms	Speed Limiter Inspection I-222 Hooked up scan tool checked speed limiter and changed cruise control from 93-98 and top speed from 95-98 as per company polices road tested to confirm correct speed limiting	Tasman workshop QLD
12/06/2025	341,967 kms	C - 120k/Annual Service S-4315	Tasman workshop QLD

Date	Reading / Units	Type / Repairer Notes	Repairer
		- Carry out C Service - Found R/H steer hub seal blown (repair) - Replaced batteries all low on Cranking amps - Tightened up exhaust downpipe bush bolts - Replaced coolant draw down hose P clamps Monitor next service - Fuel tank straps next service - L/H front drive track rod bushes - Minor weep at sump gasket - First drive output shaft seal weep	
06/05/2025	328,718 kms	A - 20k Km Check S-4177	Trailer Works - Toowoomba
		- Carry out A service . Replaced RHF steer hub seal, washed bearings, brakes, dust covers and rims. >> OD Estimated. <<	
05/03/2025	299,239 kms	NHVR-Annual Inspection-HV I-112	Tasman workshop QLD
		- Carried out NHVR COI	
05/03/2025	299,239 kms	Alternator R-3737	Tasman workshop QLD
		Stu Replaced Alternator	
03/03/2025	299,239 kms	B - 40k Km Service S-3981	Tasman workshop QLD
		- Carry out B service	
21/01/2025		Air Systems R-3402	Tasman workshop QLD
		Removed and replaced trailer low/high pressure switch	
24/12/2024	277,400 kms	A - 20k Km Check S-3765	Tasman workshop QLD
		1. Carried out A service as per service sheet. (Chris Auroa and Indy carried out service) Found on service -Replaced 3 P clamps on coolant drawdown hose - Front fuel tank strap rubbers replace next service - R/H Intercooler bushes U/S replace next service.	
12/11/2024	257,255 kms	B - 40k Km Service S-3565	Tasman workshop QLD
		1. Carried out B service as per service sheet. (Chris and Jess carried out service)	
02/10/2024	240,664 kms	A - 20k Km Check S-3413	Tasman workshop QLD
		1. Carried out A service as per service sheet. Next service. requires 4 tank rubbers.	
26/09/2024		New T-2547	Wise's Mobile Tyres
		Balance. - 10 x Supply & Fit - New	
11/09/2024	226,334 kms	Oil Leak R-2667	Brown and Hurley - Toowoomba
		Brown and hurley covered drain gasket under warranty oil and filter not covered under warranty.	
29/08/2024	217,625 kms	C - 120k/Annual Service S-3273	Tasman workshop QLD
		1. Carried out C service as per service sheet.	
28/08/2024	217,625 kms	Windscreen R-2571	The Fixer Windscreens
		Replaced windscreen.	
14/06/2024		TMA - Telematics Monitoring O-777	MTData
		Certificate of Enrolment TMA XB21MX 14-06-2024	
13/06/2024	164,950 kms	B - 40k Km Service S-2901	Trailer Works - Toowoomba
		1. Carried out B service	
03/05/2024	135,215 kms	Battery R-1683	BDS Mechanical - Toowoomba
		BDS went to Toowoomba depot and R&R batteries.	
17/04/2024		New T-1531	Michelin Australia Pty Ltd
		Ross McGlone called Michelin active assist; they phoned back to go outside the Michelin network this was approved by Chris Horsfall Tyres were replaced as required.	
05/04/2024	124,932 kms	Wiper Blades R-1516	Tasman workshop QLD
		tightened up nut	
03/04/2024		REPAIRS & MAINTENANCE R-1569	MTData
		Installed GPS sim	

Date	Reading / Units	Type / Repairer Notes	Repairer
05/03/2024		Battery R-1417 Battery - Charge and check.	Smith Diesel Fitting Pty Ltd
29/02/2024		CTP O-248 registration was changed from XW52JJ to XB21MX	
29/02/2024		Call Out, Puncture Repair T-1087 POS 2	Victoria Wide Tyre Services Pty Ltd (VWTS)
22/02/2024		C.O.I / R.W.C O-89 QLD_Cert. of Inspection_XW52JJ	QLD Government
19/02/2024		Roadworthy R-1248 Wiper Blades	Smith Diesel Fitting Pty Ltd
10/02/2024		C.O.I / R.W.C O-123 QLD_HVRAS_XW52JJ QLD_Vehicle_Details_Inspection_XW52JJ	QLD Government
21/01/2024		Run Out T-1178 Supply & fit - 1 x Second Hand Tyre 11R22.5 - Other Repair puncture	Wise's Mobile Tyres
12/01/2024	116,531 kms	295/80R22.5 T-1074 Supply, fit & balance 2 x 295/80R22.5 Double Coin Rr202 152/149M 5-18	Wise's Mobile Tyres
12/01/2024	116,520 kms	B - 40k Km Service S-2324 Carry out Paclease B Service.	Brown and Hurley - Toowoomba
28/12/2023	111,349 kms	Balance, Rotate T-1022 Rotate and balance	Wise's Mobile Tyres

Signed: _____

Name: _____

Date: _____