



Vehicle History Summary



Fleet #	TLS1208
Registration	XB26NT
Make	Kenworth
Model	T610
VIN / Chassis #	6F5000000PA484955
Build Date	2023

Date	Reading / Units	Type / Repairer Notes	Repairer
29/07/2026	561,558 kms	Hub Leak R-7933 1. Degrease, wash. Remove axle, clean up surfaces, clean studs, replaced gasket, torqued nuts to 200ftlb inspected and cleaned breather, inspect diff oil.	Tasman workshop QLD
15/07/2026	556,568 kms	Balance, Fault, Rotation, Steer Tyres T-4795 Remove position 1,2 off 206 (Michelin) to swap with position 1 and 2 off 189 monitor further wear patterns as Michelin test tyres	Tasman workshop QLD
15/07/2026	556,574 kms	Fault List R-7829 Faults Found: 1. Steering shaft rubbing on turbo housing - unbolted air box and loosened intake piping. Adjusted turbocharger intake housing away from steering shaft, moved air box away from intake piping. Tightened all loose hose clamps and air box mounting clamps (J.R 15/07/26) 2. Rear left guard twisted - Repositioned mudguard pole. Loosened clamps on mudguard and adjusted position to best of ability. Tightened all loosened nuts (J.R 15/07/26) 3. Drive shock bushes cracking and splaying - monitor at next service. (J.R 15/07/26) 4. Bonnet touching bumper - monitor at next service (J.R 15/07/26) 5. Crankcase breather misting on rocker cover - tightened crankcase breather as required (J.R 15/07/26) 6. RH teflon turntable pad damaged - Removed damaged wear pad, installed new RH turntable wear pad and torqued as required (J.R 15/07/26) 7. Diff filter leaking - removed diff oil filter, tightened 1-1/8 locking nut. Installed new diff filter and cleaned down area (J.R 15/07/26) 8. Gearbox housing seal weep - monitor at next service. (J.R 15/07/26) 9. Exhaust clamp/gasket before DPF leaking - tightened hose clamps on as needed (J.R 15/07/26) 10. Gearbox upper stabiliser mount loose - ensured all mounting bolts are tight (J.R 15/07/26) 11. Jackshaft slipjoint cap weeping - monitor at next service. (J.R 15/07/26) 12. 1st diff output seal weep - monitor at next service. (J.R 15/07/26) 13. 2nd diff input seal weep - monitor at next service. (J.R 15/07/26) 14. Excessive soot on front diff - loosened exhaust tip and angled down lower towards the ground. Tightened hose clamp (J.R 15/07/26) 15. Diff oil contaminated - change next service (J.R 15/07/26) 16. Rear engine mounts cracking - monitor at next service. (J.R 15/07/26) 17. Exhaust flex coming apart - outer wire coming apart, monitor at next service (J.R 15/07/26) 18. Drivers door hinge creaking - securing pin on cab, monitor at next service (J.R 15/07/26) 19. Passenger seatbelt not retracting - safety triangles stopping retracting moved, all okay (J.R 15/06/26)	Tasman workshop QLD
14/07/2026	556,559 kms	B - 50k Km Service S-5503 Organise Brown and Hurley Hemmant to carry out "B" service as per Paclease service sheet. Faults Found: 1. Steering shaft rubbing on turbo housing - repair required. 2. Rear left guard twisted - further inspection required. 3. Drive shock bushes cracking and splaying - monitor at next service. 4. Bonnet touching bumper - monitor at next service. 5. Crankcase breather misting on rocker cover - tension and wash 6. RH teflon turntable pad damaged - further inspection required. 7. Diff filter leaking - repair required. 8. Gearbox housing seal weep - monitor at next service. 9. Exhaust clamp/gasket before DPF leaking - repair required. 10. Gearbox upper stabiliser mount loose - requires repair. 11. Jackshaft slipjoint cap weeping - monitor at next service. 12. 1st diff output seal weep - monitor at next service. 13. 2nd diff input seal weep - monito at next service. 14. Excessive soot on front diff - further inspection required. 15. Diff oil contaminated - replacement required. 16. Rear engine mounts cracking - monitor at next service. 17. Exhaust flex coming apart - further inspection required. 18. Drivers door hinge creaking - further inspection required. 19. Passenger seatbelt not retracting - further inspection required.	Brown and Hurley - Hemmant
26/06/2026	547,739 kms	Fault R-7568 1. Remove and replace LH front headlight protector. Repair nutsert in bezel housing and epoxy. Fit new headlight bezel *painted to match cab*. Refit all parts. (L.P 26/06/2026) 2. Inspect all mudguards and mudflap to find all within spec. No further action required. (L.P 26/06/2026)	Tasman workshop QLD
10/06/2026	541,141 kms	Battery, Fault R-7502 1. Vehicle was hard to start - Fit 4 new batteries MFULD31R and clean all battery terminals. (C.j 10-6-26) 2. Passenger wiper blade not working properly - Checked wiper blade assembly and found wiper arm was loose, tightened the wiper blade arm and is now working properly. (C.j 10-6-26)	Tasman workshop QLD

Date	Reading / Units	Type / Repairer Notes	Repairer
21/04/2026		REPAIRS & MAINTENANCE R-7344	Big Wheels Truck Alignment
		**Job 1. Complete wheel alignment large truck — front alignment, axle setback, drive alignment	
20/04/2026	522,646 kms	Fault List R-6865	Tasman workshop QLD
		Faults Found at time of service: 1. Tank strap rubbers bulged - Removed bulged fuel tank rubbers and installed new rubbers to the straps (J.R 16/04/26) 2. Loading light faulty - Removed faulty loading light and installed a new light (J.R 16/04/26) 3. 1st drive brakes - Removed and replaced 1st drive brake shoes and drums (J.R 16/04/26) 4. Steering shaft - Removed worn steering shaft and installed a new shaft (J.R 17/04/26) 5. Front engine mounts worn - Removed worn out and split front engine mounts and replaced with new ones (J.R 20/04/26) 6. Scalping on 1st and 2nd drive axle tyres - replaced as per T-4503 (D.G 17/04/26) 7. Turbo dump pipe bushings - Removed old and worn out turbo dump pipe bushings, installed new rubber bushing to the exhaust dump pipe (J.R 17/04/26) 8. U-bolts loose - Retorqued the front u-bolts to the manufacturers specifications (J.R 20/04/26) 9. Battery box cover damaged - Removed battery box lid and bent back into correct shape, installed back onto truck (J.R 15/04/26) 10. Steer hub oil low - Topped up both steer hub oils to the correct level (J.R 16/04/26) 11. Mudguard cracked - Secured the crack in the lower section of the mudguard with a zip tie (J.R 17/04/26) 12. Missing tyre valve extensions - removed for purpose (J.R 15/04/26) 13. Rubber catchers between mudguards - Removed rubber catchers between the drive mudguards (J.R 15/04/26) 14. Cab shock is leaking - Removed leaking cab shock and replaced with a new shock (J.R 16/04/26) 15. Unit has severe vibration - Organise Big Wheels to carry out wheel alignment and balance. Faults to be monitored: 1. All torque rod bushings - monitor at next service (J.R 20/04/26) 2. Exhaust manifold gasket cylinder 1 leaking - monitor at next service (J.R 20/04/26) 3. Dipstick tube leaking - monitor at next service (J.R 20/04/26) 4. 2nd and 3rd axle diff seal leaks - clean breathers and monitor next service (J.R 20/04/26) 5. 2nd axle diff filter leaks - wash and monitor next service (J.R 20/04/26) 6. Chevron damaged LHS - slight bend monitor at next service (J.R 20/04/26) 7. Rear engine mounts - monitor at next service (J.R 20/04/26)	
17/04/2026	522,646 kms	11R22.5, Drive tyres, Pressure Check T-4503	Tasman workshop QLD
		Remove and replace 8 x 11r22.5 Haulmax ATT312 on position 3-10 due to wear and tear Pressure check position 1,2	
13/04/2026	522,569 kms	A - 25k Km Service S-5163	Brown and Hurley - Hemmant
		Carry out A service as per Paclease service sheet. Faults Found at time of service: 1. Tank strap rubbers bulged - will require 8 to be replaced 2. Loading light faulty - requires replacement, Removed faulty loading light 3. 1st drive brakes - require replacement 4. Steering shaft - requires replacement 5. Rear engine mounts split - requires replacement 6. Front engine mounts worn - requires replacement 7. Scalping on 1st and 2nd drive axle tyres - 8. Turbo dump pipe bushings - requires replacement 9. U-bolts loose - requires tightening 10. Battery box cover damaged - Removed battery box lid and bent back into correct shape, installed back onto truck 11. Steer hub oil low - requires topping up 12. Mudguard cracked - requires rescuing 13. Missing tyre valve extensions - removed for purpose (J.R 15/04/26) 14. Rubber catchers between mudguards - Removed rubber catchers between the drive mudguards (J.R 15/04/26) 15. Cab shock is leaking - requires replacement Faults to be monitored: 1. All torque rod bushings - monitor at next service 2. Exhaust manifold gasket cylinder 1 leaking - monitor at next service 3. Dipstick tube leaking - monitor at next service 4. 2nd and 3rd axle diff seal leaks - clean breathers and monitor next service 5. 2nd axle diff filter leaks - wash and monitor next service 6. Chevron damaged LHS - slight bend monitor at next service	
13/04/2026	522,589 kms	NHVR-Annual Inspection-HV I-464	Brown and Hurley - Hemmant
		Organise Brown and Hurley to carry out NHVR inspection as per attached check sheet at time of service.	
08/04/2026		Registration O-1103	
30/01/2026	513,555 kms	Defect List R-6146	Tasman workshop QLD

Date	Reading / Units	Type / Repairer Notes	Repairer
		Check all reported faults: 1. Checked unit for reported dash faults - clear all inactive codes and test run - no further faults. (J.S) 2. Check engine mounts - within spec - monitor at next inspection. (J.S) 3. Adjust turbo shaft - check and found no adjustment required. (J.S) 4. Over belly bar loose - tension loose mounting bolts. (J.S) 5. Transmission fault - scanned trans and found no active/inactive/history faults. (J.S) 6. Fan belt squeal - check Horton and found all measurements and bearing play within spec. Remove and replace slow Horton solenoid valve and test - ok. (J.S) 7. Service fault light - scan and found no faults. (J.S) 8. Turntable - inspect all turntable components and found no faults. (J.S) 9. Sway bar bushes need checking - inspected and found actually rear trailing arm bushes worn. Remove rear trailer arm assembly and press out worn bushes. Clean housings and press new bushes into housing. Refit assembly to truck with new bolts and sway bar centre bushes. Tension all bolts. (J.S + K.H) 10. Turntable needs adjust - inspected and found within spec. (J.S) 11. Trailer low air fault - inspected and found no active warning. (J.S) 12. Continuous airflow from suzi coils - inspected and found unit working as required. (J.S) 13. Air tanks full of water - drain tanks and found no water residue. (J.S) 14. General check over - carry out general check over and advised of further faults found to be rectified below. (J.S) 15. EGR bypass hose leaking at rear of water pump housing. Make access to and remove alternator assembly, and all belts. Found water pump has play in main bearing. Remove and replace water pump assembly with new mounting o-ring. Remove EGR bypass hose and clean all sealing surfaces. Fit hose assembly pieces back together with new orings where required. Refit alternator assembly and all belts. Tension all bolts. Refill cooling system and run up to temperature. Found heater hose leaking near clamp, cut line back and refit with new hose clamp. Top up cooling system and leave pressure tester overnight - all ok. (J.S) 16. Pitman arm loose - reseal and tension arm into place. (J.S) 17. Radiator full of dust residue - blow out using shop air as much as possible. (J.S) 18. Remove damaged underrun bar. Straighten and refit. (J.S) 19. All drive shock bushes worn - remove and replace all bushes upper and lower. Tension all shocks. (K.H) 20. Bug deflector damaged - remove and replace with 2nd hand unit. (K.H) 21. Cabin filter blocked - remove and replace with new filter. (K.H) 22. Pogo stick missing - fit new pogo stick and route cables. (S.G)	
14/01/2026	502,167 kms	Pressure Check, Run Out T-4269 1. fitted 3x 11R22.5 runouts 2. Pressure test and pump up	Tasman workshop QLD
16/12/2025		Windscreen R-5949 1. Replace cracked windscreen. *See attached invoice for further details*	Garden City Auto Glass - Toowoomba
03/12/2025	502,167 kms	Air Dryer, Air Leak, Oil Leak, Overheat, Radiator Flush, Trailer Low Air Warning R-6154 1. Flush to remove blockage from radiator. 2. Replace trailer low air sensor. 3. Replace tp5 valve. 4. Drain all tanks and replace air dryer filter and fit new silencer. 5. Replace leaking thrushaft seal. *See attached invoice for further details*	Brown and Hurley - Toowoomba
03/12/2025	502,167 kms	B - 50k Km Service S-5000 Carried out: - B service - 1L coolant topped up Faults Found: 1. Cab shocks misting 2. Exhaust dump pipe bushes worn 3. Slight movement in LH kingpin 4. LED at rear of cab partially faulty 5. Rear engine mount clunking under load *See attached service sheet for further details*	Brown and Hurley - Toowoomba
17/10/2025	469,821 kms	Drivers Seat R-5461 BDSM attending site to inspect and/or rectify multiple faults: 1. Inspect and replace drivers seatbelt. 2. Report of headlights cutting out when hitting bumps - diagnose and repair electrical fault.	BDS Mechanical - Toowoomba
15/10/2025	467,204 kms	Strip T-4002 2x Strip and fit 2x Wheel Balance. >> Closed by Compliance. Invoice / documentation not to hand. <<	Wise's Mobile Tyres
07/10/2025	460,503 kms	C - 120k/Annual Service S-4795 Carried out C service (Katie, Koby and Jess) Monitor - Moisture in tanks - Chip in R/H headlight Protector - Chip in windscreen x2 - Weep at rear of transmission Repair - Replaced 1x P clamp	Tasman workshop QLD
07/10/2025	460,503 kms	fuel tank R-5400 Replaced all 8 tank strap rubbers	Tasman workshop QLD
07/10/2025	460,503 kms	Airbags R-5400 Replaced all 8 airbags	Tasman workshop QLD
11/09/2025	447,203 kms	A - 20k Km Check S-4726 - Carry out A Service - Found front diff oil to be burnt replaced both diff oils	Tasman workshop QLD
26/08/2025	436,320 kms	Air Systems R-5038 Removed D/S kick panel located switch replaced tested all ok	Tasman workshop QLD
11/08/2025	422,488 kms	Breakdown R-4816 Breakdwon: Overheating. Tech bolted fan together _ Horton Fan	Brown and Hurley - Darra

Date	Reading / Units	Type / Repairer Notes	Repairer
11/08/2025	420,299 kms	New T-3676 David Fitted some Trial Tyres from Michelin	Tasman workshop QLD
11/08/2025	426,312 kms 7,243 hrs	Speed Limiter Inspection I-266 - Carry out Speed limiter check.	Tasman workshop QLD
29/07/2025	420,299 kms	B - 40k Km Service S-4530 - A Service carried out in Toowoomba just needed to carry out engine service	Tasman workshop QLD
24/07/2025	417,363 kms	A - 20k Km Check S-4507 - Carry out A Service	BDS Mechanical - Toowoomba
23/05/2025	378,041 kms	B - 40k Km Service S-4233 - Carry out B Service	Trailer Works - Toowoomba
14/04/2025	356,171 kms	A - 20k Km Check S-4122 - Carry out A Service (Complete waiting on paperwork)	Trailer Works - Toowoomba
26/02/2025	332,541 kms	NHVR-Annual Inspection-HV I-111 - Carried out NHVR COI	Tasman workshop QLD
26/02/2025		11R22.5 T-3167 8 x Supply & fit. - 11R22.5.	Black Rubber Pty Ltd (Tyeright Lytton)
26/02/2025	332,541 kms	Marker Plates R-3658 Marker plates did not require replacing.	Tasman workshop QLD
25/02/2025	332,541 kms	C - 120k/Annual Service S-3939 - Carry out C service. (Chris Serviced) - Removed and replaced water pump and Oring (Jess replaced) - Carried out Tune up (Jess carried out) - Removed and inspected all wheel bearings (Jess carried out) - Replaced all fan belts and tensioners (Jess replaced)	Tasman workshop QLD
04/12/2024	304,752 kms	A - 20k Km Check S-3663 1. Carried out A service as per service sheet. (Chris and Indy carried out service)	Tasman workshop QLD
25/11/2024	297,638 kms	REPAIRS & MAINTENANCE R-3158 Repaired cigarette lighter by replacing fuse. Further work required. Possibly warranty.	Trailer Works - Toowoomba
31/10/2024	283,548 kms	Brakes R-2926 R&R Rear drive brakes and drums.	Tasman workshop QLD
28/10/2024	283,548 kms	B - 40k Km Service S-3503 1. Carried out B service as per service sheet. Found on service. Rear brake shoes extremely low Refer R-2926	Tasman workshop QLD
23/09/2024	266,131 kms	A - 20k Km Check S-3381 1. Carried out A service as per service sheet. (Jess carried out service) Replaced all 3 P clamps for coolant drawdown hose. Found on service. 1. Rear drive brake shoes and drums next service. 2. Rear axle shocker bushes starting to split monitor next service. 3. Jost wear pads next service. 4. Ad blue tank straps cracked replace next service.	Tasman workshop QLD
09/09/2024	247,864 kms	Suzie Coils R-2662 Call out. Brown and Hurley in Toowoomba went to yard and repaired suzi coil.	Brown and Hurley - Toowoomba
20/08/2024	242,684 kms	B - 40k Km Service S-3239 1. Carried out B service as per service sheet.	Tasman workshop QLD
09/08/2024		Engine R-2380 Phoned B&H after hours number relayed all the information for breakdown, Found fan belt tensioner faulty replaced.	Brown and Hurley - Darra
24/07/2024		Windscreen R-2220 Trailer works in Toowoomba sub-letted this repair out	Trailer Works - Toowoomba

Date	Reading / Units	Type / Repairer Notes	Repairer
18/07/2024	211,554 kms	295/80R22.5, New T-1993 Tyre Right Lytton replaced Steer Tyres.	Michelin Australia Pty Ltd
10/07/2024	211,554 kms	C - 120k/Annual Service S-3020 1. Carried out C service as per service sheet.	Tasman workshop QLD
10/07/2024	221,554 kms	Battery R-2201 Jess replaced batteries.	Tasman workshop QLD
02/07/2024	206,110 kms	295/80R22.5 T-2203 Call Out. 1 x supply & fit, balance.	Wise's Mobile Tyres
14/06/2024		TMA - Telematics Monitoring O-779 Certificate of Enrolment TMA XB26NT 14-06-2024	MTData
10/06/2024		Run Out T-2003 1 x strip & fit.	Wise's Mobile Tyres
10/05/2024		Electrical R-1697 have speed recalibrated.	Brown and Hurley - Toowoomba
23/04/2024	149,112 kms	A - Service 30,000 km S-2645 Carry out B service. As per invoice	BDS Mechanical - Toowoomba
16/04/2024		Puncture Repair T-1555 Call out. 1 x repair	Michelin Australia Pty Ltd
10/04/2024		Registration O-573 Registration transferred to TasLog. Registration changed from XW43KP to XB26NT	
04/04/2024		C.O.I / R.W.C O-462 QLD_31873133_CERTIFICATE_OF_INSPECTION_FIRST_XW43KP	
09/03/2024		C.O.I / R.W.C O-470 QLD_Vehicle_Details_Inspection_XW43KP QLD_HVRAS_XW43KP	
29/02/2024	19,538 kms	A - Service 30,000 km S-2511 1st Service - parts only	Smith Diesel Fitting Pty Ltd
16/01/2024	95,535 kms	295/80R22.5 T-1065 Supply, fit & balance - 2 x 295/80R22.5 DOUBLE COIN RR202 152/149M 5-18 (STEER)	Wise's Mobile Tyres

Signed: _____

Name: _____

Date: _____