

ADAPT-A-LIFT GROUP PTY LTD

Service History Listing Active Units

For Equipment Code From: H13460 To: H13460
For Date Posted From: All To: All
Don't Show Cost

For Customer Code From: All To: All
For Branch Code From: All To: All

Date: 7/08/2026
Time: 10:11:53AM

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001 Equip. Code: H13460 Description: HYSTER H2.5XT Make: HYSTER Model: H2.5XT Serial No.: D466R04837R							
1836755	Condition report	NWILLIAMS	24/06/2026	Internal	6944.0	\$0.00	Carry out equipment condition assessment
1673344	Make good repairs Inspection - Quote Submitted	RABINAL	15/11/2024	Cap Prep	6944.0	\$0.00	Replace Battery, Carry out equipment condition assessment Check and visual inspection Remove rear tyre the damage to inspect the inside Carry out Inspection and Diagnosis of Brake System Remove ancillary items and Wheel/s, Inspect and report, Remove wheel/s, Remove Brake drum/s, Replace Brake adjuster/s, Carry out Inspection and Diagnosis of Electrical System Replace Timing Cover Seal as required, Carry our valve clearence adjustments Repair Horn Diagnose for brake and try running if brake is good but brake is uneven Remove tyre and axle shaft then brake drun left and right Check and adjust brake and clean Fit brake drum,axle shaft and tyre Diagnosing for knocking sound Remove hose and accesories for access to remove valve cover Top dead center top no.1 and then start valve setting Repair horn Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Find parts lists and make a report

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13460		Description: HYSTER H2.5XT					
Make: HYSTER		Model: H2.5XT		Serial No.: D466R04837R			
1601540	Green Tag Inspection	ODEMERIN	19/02/2024	Internal	6944.0	\$0.00	Carry out equipment condition assessment
1601315	De-Hire: Clean Unit. Replace Replace Rear Rim.	ALLOCATE	16/02/2024	External	6944.0	\$69.20	Steam clean equipment as necessary. Carry out equipment condition assessment
1597816	rear tyre has fallen off - has slid down the axcel. PTKT 651878	REASTWOOD	2/02/2024	Internal	6944.0	\$0.00	1. missing load guard 2. left rear wheel damage 3. drawings on unit Travel to site, Carry out Inspection and Diagnosis of Wheel travel to site, locate unit at wh4. complaint: rear tyre has fallen off - has slid down the axcel. PTKT 651878 cause: rim snapped. correction: inspect rear tyre. half of the rim has snapped. rim is going to need to be replaced. tyre has been damaged and need replacing too. Labour Carry out equipment condition assessment travel to wp to look for spare rim to use tto get unit operational. unable to get one
1588750	FW 1548347 - AUX HOSES TO SIDESHIFT SPLIT COVER NEEDS REPLACING and STEERING ORBITAL IS LEAKING AND CAVATATING NEEDS REPLACING	REASTWOOD	19/12/2023	Internal	6831.0	\$0.00	Carry out equipment condition assessment complaint: FW 1548347 - AUX HOSES TO SIDESHIFT SPLIT COVER NEEDS REPLACING and STEERING ORBITAL IS LEAKING AND CAVATATING NEEDS REPLACING cause: wear & tear. correction: source part number from SI. order part aand hoses will be taken to pirtek and made to pattern when orbital is replaced. Labour travel to drop point to collect parts. organise/sort parts i drop point. Travel to site, Replace Steering Box, travel to site, look around whole site with Mark looking for unit - hidden in wh2. complaint: steering orbital leaking cause: steering orbital correction: remove panels, remove steering orbital transfer fitting re-fit. check fir leaks and safety and function checks of steering. re-fit panels.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13460		Description: HYSTER H2.5XT					
Make: HYSTER		Model: H2.5XT		Serial No.: D466R04837R			
1584760	Replace damaged rear wheel and rim, Replace front tyres , Replace worn forks	REASTWOOD	5/12/2023	External	6814.0	\$2,687.77	Replace Forks/Tynes, Carry out equipment condition assessment locate unit at wh6 aand move to safe area. locate tynes and fit new tynes. store old tynes. front tyres have been changed by ineterfit. left hand rear rim still damaged aand not changed. RIM USED ON OTHER UNIT H13458 discuss with mark about what happened about rim and tyre.
1548347	Scheduled Service - KM IC 1000hr SM - 7000hrs .1000 Hour Service	REASTWOOD	1/12/2023	Internal	6798.0	\$0.00	1000hr Service Adjust Lift Chain to correct specification, loocate unit & move to safe area carry out 1000hr service as per service matrix grease & lube safety & function chevks lift chains within wear limit.adjust chains to remove slack. FORK AT WEAR LIMIT PLEASE QUOTE CUSTOMER REAR WHEEL HAS DAMAGE AS PER PHOTOS PLEASE QUOTE RIM & TRELLEBORG TO SWSP TYRE. FRONT TYRES UNEVENLY WORN AUX HOSES TO SIDESHIFT SPLIT COVER NEEDS REPLACING - WEAR & TEAR STEERING ORBITAL IS LEAKING AND CAVATATING NEEDS REPLACING - WEAR & TEAR
1548199	Issue with the hoses on the mast, look worn-Pic to SC-ETKT-467747	SMCALLISTER	10/07/2023	Internal	6638.0	\$0.00	Carry out equipment condition assessment travel to site locate complaint Issue with the hoses on the mast correction Ive already fix this issue the job must have been called in twice
1548196	Hydraulic Hose issue	SMCALLISTER	10/07/2023	Internal	6633.0	\$0.00	Carry out equipment condition assessment locate unit move to safe area complaint Hydraulic Hose issue correction hyd hose bracket has come loose reroute hose back into carriage find suitable bolts refit bracket onto cariage test unit check for leaks all good

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13460		Description: HYSTER H2.5XT					
Make: HYSTER		Model: H2.5XT		Serial No.: D466R04837R			
1530948	Seatbelt issues	SMCALLISTER	28/04/2023	Internal	6530.0	\$0.00	Carry out equipment condition assessment Replace Seat, locate unit move to safe area complaint Seatbelt issues cause wear & tear correction carry out inspection on seat belt found seat belt ratchet faulty. source and order parts. free up ratchet to keep unit operational Repair Seat as necessary, locate unit wait on unit be be available move to safe area complaint Seatbelt issues cause wear & tear correction seat belt ratchet faulty. remove, replace, rewire seat belt carry out safety & function checks
1514968	FW 1501591 - FREE LIFT CHAINS NEED REPLACING AT WEAR LIMIT.	REASTWOOD	20/02/2023	Internal	6442.0	\$0.00	Replace Lift Chain, Adjust Lift Chain to correct specification, locate unit & wait 10 minutes for unit to be available. remove free lift chains. cut new chains to length & fit. adjust chains so heels are off the floor. test unit. locate unit wait for unit to be available complaint : FREE LIFT CHAINS NEED REPLACING AT WEAR LIMIT. cause : wear and tear correction : removed and replaced free lift chains carried out adjustment safety function checks
1501591	Scheduled Service - KM IC 500hr SM - 6500hrs .0500 Hour Service	REASTWOOD	17/02/2023	Internal	6403.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Replace Light/s Adjust Throttle Cable to correct specification, travel to site locate unit at wh6. move unit to safe area. carry out 500hr service as per service matrix. grease & lube unit. safety & function checks remove shrink wrap from hubs. replace front right LED light & re-wire. remove & lube throttle cable & adjust. fork wear is good. FREE LIFT CHAINS NEED REPLACING AT WEAR LIMIT. PART NUMBER; RP 3402 - 2 X 10ft boxes required.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13460		Description: HYSTER H2.5XT					
Make: HYSTER		Model: H2.5XT		Serial No.: D466R04837R			
1504488	To replace anti static strips	REASTWOOD	30/12/2022	Internal	6321.0	\$0.00	Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,
1484315	Scheduled Service - KM IC 2000hr SM - 6000hrs .2000 Hour Service	AMADDOX	22/10/2022	Internal	6146.0	\$0.00	locate unit replace antistatic strip 2000hr Service carried out 2000hr service and inspection. unit needs load gaurd and two new mirrors please quote customer
1482573	Faulty head lights and rear light. Etkk 221239	AMADDOX	29/09/2022	Internal	6087.0	\$0.00	Carry out equipment condition assessment Replace Light/s Check/Inspect/Diagnose Hydraulic Oil Leak and test operation, Labour Travel to site, Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, COMPLAINT: Faulty head lights and rear light. CAUSE:headlight lense smashed, rear beacon smashed off, also found a big oil leak coming from quick connect line on carrige, inspected and found hardline rubbed through. CORRECTION:replaced headlights with leds, replaced rear beacon light, got hard hard line repaired at pritek. Remove and replace 1 blown hose
1468035	Leaking Hydrolic hose ETKT 180242 Site:WH6	201SUBC	28/07/2022	Internal	5629.0	\$0.00	
1450262	Left light not working. ETKT 129872	AZMODA	12/05/2022	Internal	5629.0	\$0.00	Repair Light/s Customer report that head lamp blown - Locate unit / inspect head lamp , blown globe . Cause :- Fatigue . Correction :- Remove and replace blown head lamp globe - general inspection .
1437781	Replace Steer Tyres & Steer Rim - 6.00-9 White, Non-Marking	ALLOCATE	17/03/2022	External	4691.0	\$1,039.37	
1404917	Tyres needed - 2 x 700-12 and 2x 600-9 non marking	201SUBC	30/09/2021	Internal	4691.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13460		Description: HYSTER H2.5XT					
Make: HYSTER		Model: H2.5XT		Serial No.: D466R04837R			
1400430	Scheduled Service - 4000hr SM - 4000hrs .4000 Hour Service	AZMODA	29/09/2021	Internal	4691.0	\$0.00	Travel to site, 4000hr Service, Repair Inching Valve as necessary, Travel to site - locate and carry out 4000hrs service /clean unit / remove seized inching cable and repair , reassemble unit and adjust cable as required . Carry out appraisal . Note :- # Urgent , unit requires (700-12 drive tyres / left hand tyres worn to soft compound & 600-9 steer tyres worn) Customer Repair - right hand dust cap missing from outer bearing cap / wheel hub , outer bearing to be cleaned and inspected . Quote Customer . Check/Inspect/Diagnose Cylinder
1401805	Attachment oil leak	AZMODA	14/09/2021	Internal	4625.0	\$0.00	Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Repair Distributor as required, Labour Replace Battery, Powercrank - NS40ZL / 863514.(Ashfield) - Customer reports that unit has a hydraulic oil leak from attachment (side shift) - Cause :- Inspect unit for oil leak / found that steel piping leaking at free lift cylinder base / Remove hose check fittings , reassemble and check all fittings are not leaking - Replace blown right hand hesd lamp globe (replace burnt terminal to globe) - Unit running rough as well / service disributor cap and rotor / adjust idle . Found that battery was not holding charge (faulty / failed load test) head to power crank , Ashfield and pick up replacement battery . Return to site fit new battery / carry out general inspection . Note :- drive tyres are worn 700-12 non marking (urgent replacement required) see attached photo's .

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001 Equip. Code: H13460 Description: HYSTER H2.5XT Make: HYSTER Model: H2.5XT Serial No.: D466R04837R							
1370122	No horn	AZMODA	20/04/2021	Internal	4005.0	\$0.00	Replace Horn Customer reports that horn is not working - Cause :- Faulty horn assembly - Correction :- remove dash panels to access horn / test wiring circuit (ok) - swap out horn from another unit (horn operational) arrange parts . Part number 2090881 (parts varification required).
1365882	PARTS ORDERED FW 1362845 - Replace Tynes - 1070x100x40 CL2	AZMODA	9/04/2021	External	3950.0	\$376.30	Returned to site - fit new horn and check operation . Mechanic AZMODA replaced order number PO#ACFS3103213-130JH with PO#ACFS3103213 Replace Forks/Tynes,
1367012	blown head lamp, firt tyne latch pin kit	AZMODA	29/03/2021	Internal	3901.0	\$0.00	Picked up parts - Locate unit - fit new tynes as quoted to customer . Carry out Inspection and Diagnosis of Wheel Repair Light/s Replace Tyne Latch,
1364982	brake inspection	AZMODA	19/03/2021	Internal	3874.0	\$0.00	Inspected unit - found that right hand tyre needed to be replaced (uneven wear) fitted spare drive wheel 700-12 non marking . Replaced blown head lamp globes - replaced right hand tyne latch pin (missing handle) - tightened shift shift hoses / fittings . Carry out Inspection and Diagnosis of Brake System Replace brake shoe/s, Labour Overhaul Brakes components as required, Replace Brake hub seal/s, Bleed Brake System Block up unit, Adjust brakes and handbrake, Picked up parts - return in morning to overhaul brakes (wheel cylinder leaking and brake dhoes contaminated) . Replace brake drum seals / repack wheel bearings / flush and bleed brake system / sdjust brakes and bed in shoes - check operation and return back into service .

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13460		Description: HYSTER H2.5XT					
Make: HYSTER		Model: H2.5XT		Serial No.: D466R04837R			
1362845	Scheduled Service - 500 Hour Service .0500 Hour Service	AZMODA	18/03/2021	Internal	3873.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Locate unit and carry out 500hr service / clean unit and general inspection . Note :- brake inspection needed , possible that wheel cylinders are leaking . Customer repair / please quote - heels of tynes are worn (1070x 100x 40) class 2 .
1364085	Steer tyre to be replaced - Photo sent to SC -SF EMAIL	201SUBC	15/03/2021	Internal	3693.0	\$0.00	
1356001	FW 1355564 - Replace Accelerator Pedal Assy	901QUOTE SENT01	4/02/2021	External	3693.0	\$0.00	
1355564	Unit will not start	AZMODA	3/02/2021	Internal	3693.0	\$0.00	Carry out Repairs to Jump Start Plug , Inspect unit - jump start unit / check alternator voltage (14.13 volts) . Customer reported had to start . Cause :- vacuum leak / intake system . (repair vacuum leak from air horn) Check operation . Note :- Customer damage - accelerator pedal assembly damaged (see attached photo's) . 2000hr Service
1325129	H13460 SIMBLEST - Scheduled Service - 2000 Hour Service	GGUERRERO	14/09/2020	Internal	3067.0	\$0.00	Travel from B30 to Simblast Port Botany. Find machine and placed to safe place. Performed machine inspection. Performed 2000 hrs servicing. Lubricated/Greased machine. Cleaned radiator. Top-up coolant.Top-up water on battery. Repaired tynes lock. Test machine performance. Labour
1322374	H13460 - SIMBLEST - Hydraulic leak	GGUERRERO	25/08/2020	Internal	3026.0	\$0.00	Travel to site, Replace Hydraulic Hose/s and ancillary items, Leaking side shift hose. Travel to pictek for new hose. Replaced leaking hose. Test machine performance.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13460		Description: HYSTER H2.5XT					
Make: HYSTER		Model: H2.5XT		Serial No.: D466R04837R			
1312971	Left light not working, seat belt stuck, breaks not working properly	DMCDONALD	10/07/2020	Internal	2856.0	\$0.00	Travel to site, Repair Light/s Carry out Inspection and Diagnosis of Brake System Remove wheel/s, Remove Brake drum/s, Confirmed LH headlight out, replaced globe... checked seat belt, found operator has jammed clip in seat belt reel causing belt to not retract.. removed clip, all ok.. Checked brakes not working properly.. Checked fluid for any pressure loss... all ok at time of test. Checked braking operation, found very noisy under braking... Removed wheels, axles and drums to check braking components... found large build up of dust in drums causing noise.. cleaned drums and de glazed shoe liners and drum surface... re fitted drums, adjusted bearings and re sealed axles.. adjusted brakes and tested.. all ok after repairs.. Remaining brake material approx 60% Block up unit, Adjust brakes and handbrake, Removed wheels, Brake drum, Inspect and cleaned Internal parts. Adjust brakes and test machine. Travel to site, Carry out equipment condition assessment Travel to site from PN. Machine servicing reschedule as I have to cover breakdown at Qube Yennora. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. performed 500hrs service.
1295421	Scheduled Service - 500hr service	APATRIMONIO	18/05/2020	Internal	2652.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13460		Description: HYSTER H2.5XT					
Make: HYSTER		Model: H2.5XT		Serial No.: D466R04837R			
1276616	H13460 -SIMBLEST - Accelerator pedal to hard to press	PUMINYAD	29/04/2020	Internal	2652.0	\$0.00	Adjust Throttle Cable to correct specification , Adjust Throttle Pedal to correct specification , Labour Travel to site, travel to parts pick up parts. travel to site. intalled new cap to the unit. Replace Light/s
1292019	H13460 - Headlights not working LHS	PUMINYAD	27/04/2020	Internal	2160.0	\$0.00	
1284301	Replace steer tyres - 1st FREE SET for the year	211 Planning B	16/03/2020	Internal	2112.0	\$0.00	
1279482	H13460 - LHS work light not working, unusual sound on the sideshift	ASTOKES	25/02/2020	Internal	2112.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System Replace Light/s
1279481	H13460 - Damaged mirror - EXTERNAL	ASTOKES	25/02/2020	External	2112.0	\$94.75	R+R LIGHT GLOBE REMOVED BROKEN MIRROR AND REPLACED WITH NEW, ALL OK.
1262721	Repair horn steering column contactors	PUMINYAD	10/12/2019	Internal	2112.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System Strip and Repair Contactor, Reassemble, Repair Light/s Check horn electrical system. Found no ground. Open steering column covers. Found that contactor on the sttering has big gap. Repair contactor and test grounding now its good. Refit all covers and tested horn system all working. Replace light RHS. Carry out equipment condition assessment
1244588	Scheduled Service - 1000 Hour (Service HD1.5-3.5TX). 1000 Hour Service	TARTHUR	9/12/2019	Internal	2101.0	\$0.00	1000hr Service Locate unit and move to safe work area. Carry out 1000hr service. Pack up tools and equipment. Return unit to service. Obtain customers signature.
1239757	Replace drive tyres 7*12 non-marking - 1st FREE SET for the year	BIG TRUCKS NSW SUB	11/09/2019	Internal	1457.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13460		Description: HYSTER H2.5XT					
Make: HYSTER		Model: H2.5XT		Serial No.: D466R04837R			
1210744	Inspect drive tyres and mirrors missing	PUMINYAD	16/08/2019	External	1457.0	\$170.00	Inspect drive tyres and mirrors missing Carry out Inspection and Diagnosis of Wheel Carry out Inspection and Diagnosis of Attachment checked requires new drive tyres. 7x12 white non marking pictures on job. ordered new mirrors as they were damaged. ordered mirrors.
1161255	Scheduled Service - 0500 Hour (Service HD1.5-3.5TX). 0500 Hour Service	PUMINYAD	24/05/2019	Internal	1397.0	\$0.00	Remove ancillary items and Mirror and Replace, Refit Mirror and ancillary items, Scheduled Service - Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Performed 500hrs service. Realigned chain and hose guide. Need to replace RHS and LHS side mirror. Need to replace drive tyres size 7.00-12/5.00 2pcs machine no loadguard. Repalce steer tyres
1186972	Repalce steer tyres	BIG TRUCKS NSW SUB	20/02/2019	Internal	2.0	\$0.00	Repalce steer tyres
1021698	Prep for rental - ACFS	CSHANNON	6/10/2017	Cap Prep	2.0	\$0.00	Carry out New Equipment Predelivery to correct specification.
Equipment Total:						\$4,437.39	
Customer Total:						\$4,437.39	