

ADAPT-A-LIFT GROUP PTY LTD

Service History Listing Active Units

Date: 7/08/2026
Time: 10:10:54AM

For Equipment Code From: H11597 To: H11597
For Date Posted From: All To: All
Don't Show Cost
For Customer Code From: All To: All
For Branch Code From: All To: All

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11597		Description: HYSTER H2.5FT WITH WHITE GOOD CLAMP					
Make: HYSTER		Model: H2.5FT		Serial No.: N177B01926M			
1836753	Condition report	NWILLIAMS	24/06/2026	Internal	2722.0	\$0.00	Carry out equipment condition assessment
1831219	Prep for auction	NWILLIAMS	3/06/2026	Internal	2722.0	\$0.00	Refit Battery to unit, Refit ancillary items, Carry out equipment condition assessment Prepare For Sale - Workshop
1698066	JOB NOT DONE Scheduled Service - BB IC 2000HR SM .2000 Hour Service	JLOPEZ	28/08/2025	Internal	2720.0	\$0.00	Preped for auction unit starts and runs 2000hr Service spoke to nathan on site and called his boss about this machine and confirmed the machine transfered to quensland report to pavalika Labour Travel to site, travel to site report to site personnel locate machine machine couldn't find on site checked equipment history, machine located to workshop. ring sam workshop tech to check unit. waiting for call back CONFIRMED THAT THE MACHINE IS NOW IN THE WORKSHOP report to pavalika will return service kit to spare parts or workshop soon travel to workshop returned service to workshop van restocking, empty used oil and rubbish

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11597		Description: HYSTER H2.5FT WITH WHITE GOOD CLAMP					
Make: HYSTER		Model: H2.5FT		Serial No.: N177B01926M			
1715543	It is very noisy during operation – loud Exhaust noise. etkt # 1097925	GSINGH	7/05/2025	Internal	2905.0	\$0.00	Carry out equipment condition assessment access truck to safe work area, check noise.exhaust system, order new muffler, inform customer [nadan], Labour pickup parts, Remove ancillary items and Counterweight, Replace Muffler, Replace Exhaust pipe, Refit Counterweight and ancillary items, Assist Gulab, access truck to safe work area, remove gas cradle and hise assy, remove counter weight, remove replace muffler, replace mounts, assy weight and gas cradle, ooperate and check ok.
1713166	Transmission issue - might be blown - Ptk 1088332	GSINGH	28/04/2025	Internal	2807.0	\$0.00	Travel to site, Carry out equipment condition assessment Carry out Inspection and Diagnosis of Transmission Check/Inspect/Diagnose Hydraulic Oil Leak and test operation, Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, travel to site, contact customer [alex] access truck to safe work area,check tranny, found breather loose and weeping, ,secure, oil level ok, secure tranny filter , check secure other hyd fittings, operate and check ok,
1711072	hydraulic oil leak from front area as they were closing clamps. tagged out. ptk #1081059	BEGREEN	16/04/2025	Internal	2792.0	\$0.00	Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, travelled to site for oil leak. found clamp hose fitting to have come loose. retentioned and tested tested okay. inspected oil level level perfect.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11597		Description: HYSTER H2.5FT WITH WHITE GOOD CLAMP					
Make: HYSTER		Model: H2.5FT		Serial No.: N177B01926M			
1710189	smoke comig out of engine area. tagged out. ptk # 1078130	BEGREEN	14/04/2025	Internal	2792.0	\$0.00	Travel to site, Carry out Inspection and Diagnosis of Transmission Replace Transmission Oil as Required travelled to site carried rechecked after 3 days of use and found no faults. trans oil condition is perfect and oil level is perfect. returned unit to customer.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11597		Description: HYSTER H2.5FT WITH WHITE GOOD CLAMP					
Make: HYSTER		Model: H2.5FT		Serial No.: N177B01926M			
1707047	Please swap attachment from unit H18818 to H11597 and hose up. As per Stas. etkt #1066773	REASTWOOD	2/04/2025	Internal	2785.0	\$0.00	Remove ancillary items and Attachment, Strip, Inspect and report, Fit Attachment and ancillary items, assist tech [richard] swap attachment , Travel to site, Refit Hydraulic Hose/s and ancillary items, travel to site, locate unit delivered to site & unit with attachment. remove undo hydraulic hoses & remove attachment. plug hoses and fit forks. fit hyd valve to unit & put attachment on pallet. inform Hai that pirtek needs to attend & i neec to return to show where hoses need to be connectef too. tidy work area and inform customer. Repair Hydraulic Hose/s as necessary, Refit Attachment and ancillary items, Repair LPG Bottle bracket as required, Carry out equipment condition assessment Replace Seat, travel to site, sign in. wait for pirtek assist pirtek with hyd hoses. change fittings. attach all hoses and test. refit attachment and secure tidy work area. talk with operator about smaller gas bottle as small gas bottle holder fitted to unit. modify holder to fit bottle. have operator test unit. Brett. happy with clamp functions. forktrack will need to be activated and set up by forktrack. unit in service. asked by brett to swap seats with 122 which had heavy duty seat rewire seats on both units as wiring different with different seat. test unut. travel. Carry out equipment condition assessment
1704415	Green Tag	DDEJESUS	24/03/2025	Internal	2784.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11597		Description: HYSTER H2.5FT WITH WHITE GOOD CLAMP					
Make: HYSTER		Model: H2.5FT		Serial No.: N177B01926M			
1701392	Prep for Rheem	DDEJESUS	12/03/2025	Internal	2784.0	\$0.00	Carry out equipment condition assessment Carry out Inspection and Diagnosis of Electrical System Repair Hydraulic Hose/s as necessary, Repair Hydraulic Control Valve as necessary , Check/Inspect/Diagnose Cylinder Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, Remove ancillary items, prepare and Paint unit as required, Repair Light/s Repair Fleet Management System as required, Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,
1699339	Dehire Inspection - Check for damages	201WORKSHOP	3/03/2025	Internal	2784.0	\$0.00	
1699298	remove the clamp from H11597 and put it on H13474	JPrinitis	3/03/2025	Internal	2784.0	\$0.00	Travel to site, Remove ancillary items and Attachment, Strip, Inspect and report, Fit Attachment and ancillary items, travel to site from dp, locate unit, remove clamp attachment, wait for unit H13474 to be delivered, fit attachment to unit, had pirtek attened to plumb up attachment and secured piping and hoses for attachment, tested unit ok. Note advised Naomi that unit H11597 and loadgaurd and tynes from H13474 are ready for collection
1698218	Hydraulic fluid leaking from on mast - Ptk 1032368	AMADDOX	27/02/2025	Internal	2784.0	\$0.00	Travel to site, Check/Inspect/Diagnose Hydraulic Oil Leak and test operation, COMPLAINT: Hydraulic fluid leaking from on mast CAUSE:found hyd solenoid had blown out of hyd lift valve bank braking the bolts, i can not get to the bolts as there is no access for a dill to fit CORRECTION:organised unit to be swapped out

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11597		Description: HYSTER H2.5FT WITH WHITE GOOD CLAMP					
Make: HYSTER		Model: H2.5FT		Serial No.: N177B01926M			
1695770	Hydraulic leak coming from hose where the clamp is - ptk#1023006	SUBC-RNT20102	18/02/2025	Internal	2720.0	\$0.00	
1689568	Over heating – Ptk 999472	MPERIA	28/01/2025	Internal	2720.0	\$0.00	Travel to site, Blow out radiator core, Top up cooling system, Travel to site Look fo jordan Locate machine Carry out equipment condition assesment Carry out inspection and Diagnose of cooling system CONCERN-Overheating Check coolant,top up coolant Check hoses Blow out radiator core Test drive machine

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11597		Description: HYSTER H2.5FT WITH WHITE GOOD CLAMP					
Make: HYSTER		Model: H2.5FT		Serial No.: N177B01926M			
1683963	Brakes have failed completely. tagged out . etkt #978488	MPERIA	6/01/2025	Internal	2720.0	\$0.00	Travel to site, Carry out Inspection and Diagnosis of Brake System travel to site locate unit and assess brakes found master cylinder no good order new master cylinder and advise customer Replace Brake master cylinder, pickup parts travel to site locate unit and remove master cylinder bench bleed new master cylinder fit to unit and bleed brakes found master cylinder not working order an other master cylinder Labour pickup new master cylinder travel to site locate unit replace faulty master cylinder bleed brakes assemble and test ok Bleed Brake System Travel to Site, Complaint : Brakes have failed completely. Cause : Stock up master cylinder. Correction : Bleed the brake system. Ok Test Drive. Ok Test drive by forklift operator. Ok Locate machine Carry out equipment condition assesment Carry out inspection and Diagnose of brake system CONCERN-Brakes have failed completely Check brake system Adjust brakes Bleed brake system Check brake fluid level Test drive machine ok

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11597		Description: HYSTER H2.5FT WITH WHITE GOOD CLAMP					
Make: HYSTER		Model: H2.5FT		Serial No.: N177B01926M			
1652794	Scheduled Service - SF 500HR IC SM .0500 Hour Service	MPERIA	17/09/2024	Internal	2593.0	\$0.00	Travel to site, Carry out equipment condition assessment For resched of service Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Travel to site Inform customer Locate machine 500hr service Carry out peventive maintenance service and safety inspection in the line with agreed scope of works Report on condition of equipment and additional works requirement Grease all point
1611654	URGENT! FW broken off a brake fluid reservoir cap. top up, repair brake fluid reservoir temperally.Need replcing a broken off brake fluid reservoir a.s.a.p..	CZARIS	28/03/2024	Internal	2315.0	\$0.00	Note For return of wrong kit and excess oil Replace Brake Wheel Cylinders, Labour remove wheels and brake drums check brakes wheel cylinders leaking pick up parts fit wheel cylinders clean brakes fit drums adjust brakes and bleed test unit
1611560	CANCELLED - Replace torn off seat.	901QUOTE SENT01	28/03/2024	Internal	2311.0	\$0.00	No approval provided to proceed with damage quote - to be reviewed at a later date or time of de-hire
1611235	FW 1594161-Need replacing 2 worn out steering tyres.(solid black 6.00-9).	SUBC-RNT20101	27/03/2024	Internal	2311.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11597		Description: HYSTER H2.5FT WITH WHITE GOOD CLAMP					
Make: HYSTER		Model: H2.5FT		Serial No.: N177B01926M			
1594161	Scheduled Service - TC IC 1000HR SM - 5000hrs .1000 Hour Service	ALI	25/03/2024	Internal	2311.0	\$0.00	Travel to site, Carry out equipment condition assessment 1000hr Service Top up Brake fluid as required, Remove ancillary items and Mirror and Replace, Refit Mirror and ancillary items, Labour to newton rd, no no.179 street sign. ring customer mick, says no one on site untill 11:45 am because they don't known- adaplift is comming. drive throw no. 177 drive way, find site. wait for open. locate unit. got a wrong kit. will return unused parts to store. broken off a brake fluid reservoir cap. top up, repair brake fluid reservoir temperally. secure 2 loosen mirrors. top up an empty coolant reservoir.. need replcing a broken off brake fluid reservoir a.s.a.p.. need replcing 2 worn out steering tyres. (solid black 6.00-9). torn off seat. see photos. to base, drop off waste oil. return unused parts to store. complaint none. cause sm. correction report.
1607021	Urgent. Tech to assess - mast has come away from unit. Pic to SC. Etkk 688505	GSINGH	11/03/2024	Internal	2074.0	\$0.00	Travel to site, Carry out equipment condition assessment Carry out Inspection and Diagnosis of Mast/Carriage Repair Hydraulic Tilt Cylinder as required, Remove ancillary items and Hydraulic Tilt Cylinder , Strip, Inspect and report, travel to site, access truck , inspect mast and carriage found both tilt rods have come off [unscrewd] from knuckle, was able to clean thread on left cyl and assy, remove right cyl, inform customer [jay], tag out truck, deliver cyl to repairer [city hydraulics] Labour pickup cylinder from repairer, Refit Hydraulic Tilt Cylinder and ancillary items , Adjust Hydraulic Tilt Cylinder to correct specification , replace tilt cyl and adjust, operate snd check ok, blow clean unit, operate and check ok,

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11597		Description: HYSTER H2.5FT WITH WHITE GOOD CLAMP					
Make: HYSTER		Model: H2.5FT		Serial No.: N177B01926M			
1595729	All lights turn on, brand new gas bottle but there is no crank and the unit will not start-he has palletts that he needs to lift today-Tagged Out-URGENT-PTKT-643548	BEGREEN	24/01/2024	Internal	2074.0	\$0.00	Travel to site, Carry out Inspection and Diagnosis of Electrical System Labour Replace Starter Motor, Travelled to site. Carried out diagnosis. Ordered starter motor. Travelled to parts picked up starter motor. Travelled to site and fitted. tested ok

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11597		Description: HYSTER H2.5FT WITH WHITE GOOD CLAMP					
Make: HYSTER		Model: H2.5FT		Serial No.: N177B01926M			
1552300	Scheduled Service Job. 0500 Hour Service	AMARONEY	15/07/2023	Internal	2063.0	\$0.00	Change Engine Oil as required, Replace Engine Oil Filter, Carry out equipment condition assessment Repair Steering as necessary, Replace Battery, Replace Stickers, Remove ancillary items and Dashboard, inspect and report, Refit Dashboard and ancillary items, Repair Switch/es Carry out Inspection and Diagnosis of Telemetry System Steam clean equipment as necessary. Top up Hydraulic Oil to correct level, Top up Transmission Oil to correct level,, Repair Attachment as necessary, Grease All Points on Unit, Repair Hydraulic Hose/s as necessary, Remove ancillary items, prepare and Paint unit as required, Regroove tyres as necessary. steering adjustment wont lock. (corrected) fork track always on. issue with seat sensor.(corrected) hydruatic leak from hose attachment. (corrected and topped up) steer wheels low on thread , regrooved . needs replacement soon.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11597		Description: HYSTER H2.5FT WITH WHITE GOOD CLAMP					
Make: HYSTER		Model: H2.5FT		Serial No.: N177B01926M			
1517174	Repair engine low RPM	DDEJESUS	28/02/2023	Internal	2061.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System Steam clean equipment as necessary. Repair LPG Converter as necessary, Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, Adjust Distributor to correct specifications, Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Repair Main Electrical Control Panel as necessary, Repair Light Circuit as required, Replace Hydraulic Hose/s and ancillary items, Carry out equipment condition assessment Carry out equipment condition assessment
1517172	Green tag inspection	DDEJESUS	28/02/2023	Internal	2061.0	\$0.00	Steam clean equipment as necessary. Carry out equipment condition assessment
1516119	DEHIRE INSPECTION - CHECK FOR DAMAGES	MSEGHABI	23/02/2023	Internal	2060.0	\$0.00	unit not starting 4000hr Service,
1495864	Scheduled Service - NKA 4000HR SM 4000 Hour Service	GSINGH	16/01/2023	Internal	2060.0	\$0.00	
1507230	PO RECTIFICATION	201QUOTE	13/01/2023	Internal	2058.0	\$0.00	
1506849	WKS - Showing an error code 51-7 ptkt #303050	201WSHOP-ALLOCATOIN	12/01/2023	Internal	2060.0	\$0.00	Carry out equipment condition assessment Carry out Inspection and Diagnosis of Telemetry System Carry out Inspection and Diagnosis of Electrical System Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, Adjust Switch/es remove unit from wareouse/isle to safe work area, complain - wont go, check forktrak and electrics, analyse codes, check ad perform tests as per oem, diagnose tps thrlttle body, order parts Travel to site, travel to site, look for unit, was informed by customer truck has been dehiired, inform vera

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11597		Description: HYSTER H2.5FT WITH WHITE GOOD CLAMP					
Make: HYSTER		Model: H2.5FT		Serial No.: N177B01926M			
1459002	Replace Carriage (Parts Ordered for DON MACKAY 15/09/2022)	DMackay	19/09/2022	External	1847.0	\$2,989.55	Labour Collect part from WP Remove ancillary items and Attachment, Strip, Inspect and report, Remove ancillary items and Carriage, Strip, Inspect and report, Replace Carriage, travel to site, access truck, assist don with carriage repair, Travel to site, Travel to site (incident on M7), sign in on tablet & locate machine. Assess scope of task - carriage frame bent. Source LPG tank to operate machine & pallet to rest clamp attachment assembly on. Disconnect clamp hydraulic lines, unlock clamp lower fixtures & remove clamp attachment onto pallet. Remove carriage lower mounts, fit new carriage frame & refit mounts. Fit new grease nipples to new carriage from van stock & grease. Measure up clamp & carriage to rehang clamp attachment centrally on carriage. Relock clamp attachment lower fixtures, refit clamp hydraulic lines & test - ok. Lubricate clamp slides, clean up worksite & gain authorised signature.
1462442	Scheduled Service - NKA- 4000Hr IC SM-Check mirrors and tyres. .4000 Hour Service	GSINGH	1/07/2022	Internal	2060.0	\$0.00	4000hr Service, access truck, found already serviced with different jb - 1495864
1453606	The unit has a hydraulic oil leak. Tagged Out.	GSINGH	25/05/2022	Internal	1847.0	\$0.00	Carry out equipment condition assessment Carry out Inspection and Diagnosis of Mast/Carriage travel to site, access truck, check mast/carriage, found carriage bent/impact damaged, inform customer [clint], inform ryan and cara who will organise customer quote and repair,

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11597		Description: HYSTER H2.5FT WITH WHITE GOOD CLAMP					
Make: HYSTER		Model: H2.5FT		Serial No.: N177B01926M			
1451934	The unit needs an oil top up. ETKT-134358	GSINGH	18/05/2022	Internal	1814.0	\$0.00	Carry out equipment condition assessment Carry out Inspection and Diagnosis of Electrical System Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, travel to site, access truck to safe work area, check engine light, check and secure connections to epr, top up fluids, operate and check ok, Travel to site,
1422160	Key will only go half way into the barrel.	GSINGH	21/12/2021	Internal	1048.0	\$0.00	Carry out equipment condition assessment Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, travel to site, signin, locate and access truck to safe work area, check ignition switch , secure dash steer column covers, operate and check ok.
1415526	Replace Overmast hydraulic hose	201WORKSHOP	18/11/2021	Internal	791.0	\$0.00	open Carry out equipment condition assessment Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1411990	Scheduled Service Job. 0500 Hour Service	GGUERRERO	3/11/2021	Internal	790.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11597		Description: HYSTER H2.5FT WITH WHITE GOOD CLAMP					
Make: HYSTER		Model: H2.5FT		Serial No.: N177B01926M			
1411989	Green Tag Inspection	GGUERRERO	2/11/2021	Internal	791.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System Carry out equipment condition assessment Steam clean equipment as necessary. Replace LPG Hose as required, Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Remove ancillary items and Hydraulic Hose/s, inspect and report, Replace Attachment, Repair Attachment as necessary, Replace Seat, Remove ancillary items, prepare and Paint unit as required, Replace Battery, Replace Hydraulic Hose/s and ancillary items, Swap attachment to test the other attachmentt before sending to queensland. Grease All Points on Unit, Prepare For Hire - Workshop

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11597		Description: HYSTER H2.5FT WITH WHITE GOOD CLAMP					
Make: HYSTER		Model: H2.5FT		Serial No.: N177B01926M			
1310221	INSPECTION	CESPINOZA	29/06/2020	Internal	701.0	\$0.00	Carry out equipment condition assessment Top up Hydraulic Oil to correct level, Steam clean equipment as necessary. - Locate and moved unit to working bay, carried-out machine inspection, checked all function and fluid level. - Top-up hydraulic oil and coolant. - Steam-cleaned and dried the unit thoroughly. Grease All Points on Unit, Adjust fan belt as required - Greased and lubed all points. - Adjusted fan belt to eliminate unusual noise.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11597		Description: HYSTER H2.5FT WITH WHITE GOOD CLAMP					
Make: HYSTER		Model: H2.5FT		Serial No.: N177B01926M			
1268846	Scheduled Service - 2000 Hour Service 2000 Hour Service. 2000 Hour Service	JMCSHANNON	13/01/2020	Internal	617.0	\$0.00	Travel to site, on site located company down end of site as multiple companys are on same address found units needing serving and will have to start with second unit as this one due was in use at time of arrival. customer was busy with unit and could let it be taken for servicing. job placed on hold. waiting for truck to be available for servicing 2000hr Service on site located unit unit due for 2000HR service as per Job description. carried out service as per check sheet handled out at tool box talk. unit only has 617 HR so is in good condtion and well kept. change air filter spark plugs battery test (99%) transmission filter diff oil adjusted mini levers and calibrated increased down speed for mast as it was set to 3 greased attachment blew out engine bay area topped up coolant overflow tank.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11597		Description: HYSTER H2.5FT WITH WHITE GOOD CLAMP					
Make: HYSTER		Model: H2.5FT		Serial No.: N177B01926M			
1252662	INSPECT AND PREP	ABALONGOY	4/11/2019	Internal	574.0	\$0.00	Carry out equipment condition assessment Steam clean equipment as necessary. Grease All Points on Unit, Replace Stickers, Remove ancillary items, prepare and Paint unit as required, Remove, clean and refit Air filter, Prepare For Hire - Workshop Locate machine, assess machine condition, blow out air cleaner dust, blow out engine and transmission dust, steam cleaned unit, cleaned radiatir fins, grease and lube all points, touch up paint body, replaced hire sticker, Repair Attachment as necessary, Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Cleaned and shine machine body, lubricate mast chains and attachment wear slide bushings. Travel to site, Carry out equipment condition assessment TRAVEL TO SITE,carry out dehire ,clean and touch up paint Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. carry out service, oil and filter diddnt need doing,hours 338
1243883	De-Hire by the 04/10/2019. Please report on all damages and provide photos	GPOULTON	26/09/2019	Internal	573.0	\$0.00	Cleaned and shine machine body, lubricate mast chains and attachment wear slide bushings. Travel to site, Carry out equipment condition assessment TRAVEL TO SITE,carry out dehire ,clean and touch up paint Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. carry out service, oil and filter diddnt need doing,hours 338
1192802	Scheduled Service Job. 0500 Hour Service	GPOULTON	14/03/2019	Internal	338.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. carry out service, oil and filter diddnt need doing,hours 338

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001 Equip. Code: H11597 Description: HYSTER H2.5FT WITH WHITE GOOD CLAMP Make: HYSTER Model: H2.5FT Serial No.: N177B01926M							
1192309	Unit will not start intermittently	GPOULTON	13/03/2019	Internal	338.0	\$0.00	Unit will not start intermittently Labour Travel to site, Carry out Inspection and Diagnosis of Electrical System Replace Starter Motor, Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, travel to parts ,travel to site ,sign in,locate unit and check over unit,found faultt with starter,replace starter ,remove battery and battery box and battery box wiring to fit starter,test unit ,test ok Working fine & all of sudden the unit stopped. Will not turn back on. Believes its because he maybe driving rough, not sure. Need tech out asap, unit is stuck in the middle of the yard. Carry out Inspection and Diagnosis of Attachment Travelled to site found the unit had had an impact of 31g talked to operator and he was moving a bin of some sort and then shut down..removed lock out and parked up inside.got out of config menue and came up again with contact service..so unit is still in lock out mode... Carry out Inspection and Diagnosis of Telemetry System Replace Fleet Management System as required, Adjust Fleet Management System as required, locate unit ,and check over for Impact,fork track screen locked,clear screen ,after 2 minutes ,unit has logged impact again,clear screen ,Impact has logged again ,impact sensor is damaged by Impact ,sensor wont stop logging impact,replace sensor,test unit,impact sensor in working order,customer charge ,unit has been checked on site for damaged,all in working order ,return to service
1165409	31G impact	GPOULTON	27/11/2018	External	230.0	\$728.75	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11597		Description: HYSTER H2.5FT WITH WHITE GOOD CLAMP					
Make: HYSTER		Model: H2.5FT		Serial No.: N177B01926M			
1120535	CCA Safety Inspection Program	JMCSHANNON	15/06/2018	Internal	72.0	\$0.00	CCA Safety Inspection Program Carry out Inspection and Diagnosis of Telemetry System Carry out equipment condition assessment Steam clean equipment as necessary. on site located unit carried out CCA inspection as per check list. completed check list and had paper work signed off. unit in good condition and is new, only 72hr on dash just gave unit a quick once over and double checked settings found forklift swipe card is not on and not working, tried turning on but nothing happens when driver tries to swipe on.
1108362	New forklift is now showing a temp fault. Still waiting on blue light install and forklift setup	JSKOBEL	4/05/2018	Internal	34.0	\$0.00	returned unit to work all ok at time of inspection. New forklift is now showing a temp fault. Still waiting on blue light install and forklift setup Carry out Inspection and Diagnosis of Electrical System Non warranty issue - unit wasn't calibrated before it went to site or fitted with blue light or forklift setup. inspected unit for error code 522801-13 which is calibrate hydraulic mini levers and a fork track problem of coolant temp. have ordered a blue light so i can fitted. Install Light/s REMOVE PLASTIC COVER MOUNT BLUE LIGHT AND TAP INTO STROBE LIGHT POWER THEN REFIT PLASTIC COVER THEN TEST BLUE LIGHT.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11597		Description: HYSTER H2.5FT WITH WHITE GOOD CLAMP					
Make: HYSTER		Model: H2.5FT		Serial No.: N177B01926M			
1107129	Our new forklift was delivered yesterday, the unit won't start. Seems to be either a battery or alternator issue, can this please be attended ASAP site contact Cody 0439287115	JMANLEY	1/05/2018	Internal	21.0	\$0.00	Our new forklift was delivered yesterday, the unit won't start. Seems to be either a battery or alternator issue, can this please be attended ASAP site contact Cody 0439287115 Travel to site, Refit Battery to unit, Refit ancillary items, Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, Travelled to site. located unit. found battery flat, got unit outside by jumpstarting. tested charge rate 11.2v - found wire on back of alt dislodged, connected wire now charging 13.9v - good. Ran unit to charge battery, reset dash clock/date. Unit it not speed limited andd lowering load too fast, adjusyed lower speed, confugured dash to metric, adjusted speed limit to 10kph. NOTE - LOGGING CDE 522801-13 - TRANS CALIBRATION, suspect due to low batt voltage, calibrated trans and run unit, no code re appeared, ok.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11597		Description: HYSTER H2.5FT WITH WHITE GOOD CLAMP					
Make: HYSTER		Model: H2.5FT		Serial No.: N177B01926M			
1084623	New Contract Rental - CCA Rocklea (replace rollover unit)	PTARRANT	7/02/2018	Cap Prep	18.0	\$0.00	- Fit Cascade Carton Clamp (on order) - Remove fork track from the CCA rollover unit if possible & fit to H11597 (3G upgrade required) - New rating plate (Deb) - Stencil hire number H11597 to mast and clamp - Fit wire mesh screen - New unit PDI, clean, test, ensure full function - Touch up paint if required - Remove ancillary items and Forks/Tynes, Inspect and report, Remove ancillary items and Load Guard, inspect and report, Fit Attachment and ancillary items, Remove ancillary items and Remove Battery from unit and Inspect and report, Remove ancillary items and Attachment, Strip, Inspect and report, Refit Battery to unit, Refit ancillary items, Carry out New Equipment Predelivery to correct specification. Fit Hydraulic Valve Section and ancillary items, Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Prepare For Hire - Workshop Gas Inspection Blown hose at gauge block and leak at gauge itself. Repair Overhead Guard as necessary, Repair Charging Circuit as required, Fit wire mesh Front screen Remove ancillary items and Repair Wiring as necessary,

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001 Equip. Code: H11597 Description: HYSTER H2.5FT WITH WHITE GOOD CLAMP Make: HYSTER Model: H2.5FT Serial No.: N177B01926M							
1024730	Demo - Laminex	PTARRANT	19/06/2017	Cap Prep	10.0	\$0.00	Refit ancillary items, Replace Main Electrical Panel, - Prepare for demo - Clean, test, check all functions - Fit a full gas bottle Refit Load Guard and ancillary items, Repair Hydraulic Hose/s as necessary, Steam clean equipment as necessary. Adjust Fleet Management System as required, Remove ancillary items, prepare and Paint unit as required, Prepare For Sale - Workshop - mast, and valve swap was done with unit H10916 for Inex Forktrack module fault Check/Inspect/Diagnose Fleet Management System and test operation, Traced to DCA module Repair Fleet Management System as required, Replace Fleet Management System as required, travel to site locate unit wont stert check fork track wiring ,check unit wiring ,locate fault with dca module order new dca module ,.return turn to work fit new dca module ,not starting recheck fork track wiring ,locate fault to new dca module ,fit spare unit and test ,remove fault codes and retest
891031	Forktrack module fault	GPOULTON	2/02/2016	Internal	9.0	\$0.00	
888159	Demo - Toll NQX Rail	JNAUMANN	20/01/2016	Internal	2.0	\$0.00	- Clean, test, ensure full function - Check fluids - Touch up paint if required.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11597		Description: HYSTER H2.5FT WITH WHITE GOOD CLAMP					
Make: HYSTER		Model: H2.5FT		Serial No.: N177B01926M			
867591	Demo - Toll Safety Show	JRODGER	2/11/2015	Internal	2.0	\$0.00	- Clean, test, ensure full function - Fit spare fork track kit (see Brett) - Touch up paint if required Fit Fleet Management System as required, Adjust Fleet Management System as required, Carry out New Equipment Predelivery to correct specification. Remove ancillary items, prepare and Paint unit as required,
Equipment Total:						\$3,718.30	
Customer Total:						\$3,718.30	