

ADAPT-A-LIFT GROUP PTY LTD

Service History Listing Active Units

Date: 19/06/2026

Time: 11:07:48AM

For Equipment Code From: H0460N To: H0460N

For Customer Code From: All To: All

For Date Posted From: All To: All

For Branch Code From: All To: All

Don't Show Cost

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001 Equip. Code: H0460N Description: HYSTER H2.5TX Make: HYSTER Model: H2.5TX Serial No.: B466R12658L							
1825220	Prep for Auction	NWILLIAMS	12/05/2026	Internal	5372.7	\$0.00	Prepare For Hire - Workshop Carry out equipment condition assessment Steam clean equipment as necessary. Equipment Transport, Unit starts and runs checked all hydraulic functions and checked fluids unit pressure washed for better presentation (had to refill gas bottle) included in labour time
1816651	Scheduled Service Job. KM IC 4000hr SM - 4000hrs. 4000 Hour Service	RBLACKMORE	10/04/2026	Internal	5371.0	\$0.00	First labour entry was to help rhys with prep for hire Carry out equipment condition assessment Gas Inspection -Test machine -50 point check -4000hr service parts being quoted to send to Ben -NEEDS- -Replacment tyres -Carriage loose - Tighten or replace -Top up radiator - check for -Seatbelt does not retract - new Carry out Inspection and Diagnosis of Attachment Looked for second hand wheels ordered parts and sent email for quote. Unit went to Auction
1816650	Green tag	RBLACKMORE	10/04/2026	Internal	4283.0	\$0.00	
51660	Pre Hire Inspection	201WORKSHOP	9/04/2026	Inspection	5390.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H0460N		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R12658L			
1806888	Replace Seatbelt	BVALIENTE	5/03/2026	Internal	4283.0	\$0.00	Carry out equipment condition assessment identified machine and discussed fault with operator, inspected seat and confirm seat belt unable to retract. ordered new seatbelt as required. Fit Seat Belt, collected parts from drop point, located machine and set up exclusion zone. removed and replaced seat belt component as required.
1767978	Tynes have jumped off the mast. Can someone please check the locking mechanism	BIG TRUCKS NSW	27/11/2025	Internal	5264.0	\$0.00	
1745966	500hr Service	BIG TRUCKS NSW	20/09/2025	Internal	5264.0	\$0.00	
1688803	1000hr Service	BIG TRUCK VIC	3/03/2025	Internal	5264.0	\$0.00	1000hr Service picked parts from tainer and drovebariund park 2 to locate machine, once found set up safe work exclusion zone, removed gas bottle/negativevterminal to 'isolate' machine. prepped parts and tooling, then carried out 1000hr svc as per maintenance schedule: changed engine oil anf filter, changed trans oil (wrong filter supplied, will need changing asap), changed air filter, cleaned debris from cooler, checked hydraulic oil, replaced spark plugsgreased all machine grease points, lubricated chains, and checked all machine functions/electrics. fit service sticker, submitted furtherworks for steer axle tyres, cleaned work area and tooling, then transported old oils and parts to safe disposal point.
1642627	500hr Service	211 Planning A	21/08/2024	Internal	5157.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Carried out 500 hour service and inspection. Replaced engine oil, oil filter, and drain plug washer. Check fluid levels. Checked mast, carraige, and forks for possible cracks and bends. Did adjust lift chains due to loose. Greasing. All good and operational.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H0460N		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R12658L			
1556634	1000hr Service	TARTHUR	16/02/2024	Internal	4936.0	\$0.00	1000hr Service Locate parts. Locate unit. Arrange for safe work area in warehouse in yard 2. Carry out 1000 hr service. Return unit to customer. Carry out Inspection and Diagnosis of Electrical System
1567332	H0460N - flat battery located park 2 warehouse	TARTHUR	25/09/2023	Internal	4777.0	\$0.00	Labour Travel to site, Replace Starter Motor, Carry out Inspection and Diagnosis of Attachment
1545964	Damaged Load Guard	211 Planning A	30/06/2023	External	4665.0	\$1,360.60	REMOVE AND REPLACE LOAD GUARD
1530983	Replace Belt	BIG TRUCKS NSW	28/04/2023	Internal	4594.0	\$0.00	On service note tynes worn and need replacement Order replacement set Travel to collect Return to site Replace tynes Test operation return to site operation
1530911	Replace Tynes	RLE	28/04/2023	External	4594.0	\$954.25	
1518408	1000hr Service	AFLOWERS	28/04/2023	Internal	4594.0	\$0.00	1000hr Service Replace Brake adjuster/s, carry out 1000hr service, also adjust brakes shoes and handbrake cable, NOTE tagged unit out tynes under size
1501857	The unit is running rough. Need the hdyraulic oils topped up. PTKT-287282	REASTWOOD	15/12/2022	Internal	4351.0	\$0.00	Labour collect hydraulic oil from pirtek ready to take to site. Carry out equipment condition assessment arrive at site, sign in. locate unit. complaint: truck running rough cause: noissue with truck spoke with operator no issue with unit. discuss issue with controller and spoke with manager. correction: no issue with unit. hydraulic oil at correct level.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H0460N		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R12658L			
1490351	Green tag inspection	ODEMERIN	2/11/2022	Internal	4303.0	\$0.00	<p>Carry out equipment condition assessment</p> <p>Steam clean equipment as necessary.</p> <p>Blow out radiator core,</p> <p>Install Light/s</p> <p>Repair Light Bracket as required,</p> <p>Grease All Points on Unit,</p> <p>Remove ancillary items, prepare and Paint unit as required,</p> <p>Check Diff oil level, top up oil level as required,</p> <p>Prepare For Hire - Workshop</p> <p>Locate the machine and park it on the working bay,performed machine inspection, repaired light bracket bent (RHS), replaced light broken (LHS), top up diff. oil, greased the grease point,touch up paint,cleaned the machine, blew radiator core, replaced old stickers, test the machine performance,prep for hire.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H0460N		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R12658L			
1461731	The unit is not starting, they change the gas line properly, just won't tick over. Tagged Out. PTKT-161611	GSINGH	6/07/2022	Internal	4051.0	\$0.00	<p>Travel to site,</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Labour</p> <p>Replace Battery,</p> <p>travel to site, access truck , check for starting, found battery flat, order and pickup, travel to site, access truck, rsmove and replace battery, could not start,,engine spinning, dip stick shows no oil in engine, further work needed, request customer [michael] to movve truck to safer location outside warehouse before further work can be done safely, inform cara.</p> <p>Carry out equipment condition assessment</p> <p>Check/Inspect/Diagnose Engine compression and perform compression test and report.</p> <p>Adjust Ignition timing to correct specification,</p> <p>Adjust Carburettor to correct specification,</p> <p>Repair Carburettor as necessary,</p> <p>Replace Ignition Spark Plugs as required,</p> <p>Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>travel to site, remove unit from warehouse to safe work area, check for root starting, chec and aadjustt tappets, spraay oil in cylinder and spin to build compression, replace spark plugs, clean throttle body, Replaced all tyres as required</p>
1449905	All tyres to be replaced. Drive 7.00-12, Steers 6.00-9 white solid. Ptkk 129111	201SUBC	10/05/2022	Internal	3745.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H0460N		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R12658L			
1449614	The load back rest is missing 2 bolts - Tech to assess	DPhangnalay	9/05/2022	Internal	3745.0	\$0.00	Carry out Inspection and Diagnosis of Mast/Carriage Labour Repair Load Guard as necessary, Carried out inspection on mast found one broken bolt and another missing. carried out removing broken bolt. travelled to workshop to pick up bolts. Refit mast and check ok. All four wheels need replacin see photos for reference. Drive 7.00-12, Steers 6.00-9 white solid. Travel to site,
1434468	Loose wire in seating sensor. Tagged Out.	DPhangnalay	23/02/2022	Internal	3284.0	\$0.00	Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, Complaint - Loose seat wiring Cause - Seat belt wiring connection broke Correction - Repaired broken connection. Install Light/s
1388712	PARTS ORDERED BY RB - Supply and fit blue lights tro front and back	DPhangnalay	13/07/2021	External	2689.0	\$869.37	Carried out fitting blue light as requied. assist Denny fitting blue lights

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H0460N		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R12658L			
1377345	Green Tag Inspection/ Prep for Hire	TRAZ	18/05/2021	Internal	2458.0	\$0.00	<p>Carry out equipment condition assessment</p> <p>Steam clean equipment as necessary.</p> <p>Remove ancillary items and Remove Drive Wheel from unit,</p> <p>Remove ancillary items and Steering Wheel, Strip, Inspect and report,</p> <p>Refit Wheel/s and ancillary items,</p> <p>Repair Wheel/s as necessary,</p> <p>Repair Light Bracket as required,</p> <p>Install Light/s</p> <p>Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>Replace Seat,</p>
1375073	Green tag Inspection	GGUERRERO	7/05/2021	Internal	2458.0	\$0.00	<p>Prepare For Hire - Workshop</p> <p>Prepare For Hire - Workshop</p> <p>Carry out equipment condition assessment</p> <p>Steam clean equipment as necessary.</p> <p>Replace Forks/Tynes,</p> <p>Blow out radiator core,</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>Remove ancillary items, prepare and Paint unit as required,</p> <p>Grease All Points on Unit,</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H0460N		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R12658L			
1358622	Green Tag Inspection	DDEJESUS	16/02/2021	Internal	2321.0	\$0.00	Steam clean equipment as necessary. steam cleaning Repair Light/s Repair Light Bracket as required, Remove ancillary items, prepare and Paint unit as required, Carry out equipment condition assessment inspection of machine adjust lift chain adjust hydraulic hose saging repair ligths and bracket touch up paint Prepare For Hire - Workshop
1332604	Prep for Think Global	CALABA	8/10/2020	Internal	2238.0	\$0.00	Prepare For Hire - Workshop
1314082	PREP FOR HIRE NUTRIEN AG	MLUMAY	16/07/2020	Internal	2238.0	\$0.00	Steam clean equipment as necessary. Grease All Points on Unit, Prepare For Hire - Workshop Install Stickers, Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, repair headlamp braket lh cleaned wash machine touch up paint lubricated and greased machine prep for hire fit hire stickers
1306973	prep for hire	SMALONISIO	16/06/2020	Internal	2227.0	\$0.00	Steam clean equipment as necessary. Prepare For Hire - Workshop Cleaning of very dirty machine.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H0460N		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R12658L			
1301525	prep for hire	MLUMAY	27/05/2020	Internal	2185.0	\$0.00	<p>Steam clean equipment as necessary.</p> <p>Carry out equipment condition assessment</p> <p>Replace Battery,</p> <p>Grease All Points on Unit,</p>
1266720	Scheduled Service - 1000 Hour Service 1000 Hour Service. 1000 Hour Service	MLAM	6/01/2020	Internal	2084.0	\$0.00	<p>Prepare For Hire - Workshop 1000hr Service</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Travel to site, Sign in, Wait for unit, Carry out 1000hr service, Check unit operation/function/components/lights, Customer complained that unit idle is abnormal, Blow out dusty radiator core and components, Lubricate and check chains, Lubricate slide points, Grease all points, Jack up and check wheels, Clean unit, Complaint: unit idle abnormal, Cause: checked throttle and idle operation and found unit hunting, check sensors and components, Correction: adjusted idle configuration and found unit idlind satisfactory (advised customer to monitor), Service item: monitor lh light bracket - minor bend, Dump waste oils, Clean work area and Van, Update notes and diary, Take signature, Sign out. Call up and liase with parts, Assess charger for h13141 - battery charger has fault. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p>
1220439	Scheduled Service - 0500 Hour (Service HD1.5-3.5TX). 0500 Hour Service	ALI	2/07/2019	Internal	1941.0	\$0.00	<p>Replace Switch/es</p> <p>locate unit. brake lights are not working. trouble shooting. trace down to a faulty switch. fit a new stop switch. test ok. bent a mounting bracket for a lh head lamp. see photo.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H0460N		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R12658L			
1191554	Replace tyres all round - and the bonnet strut	GSINGH	11/03/2019	Internal	1854.0	\$0.00	<p>Replace tyres all round</p> <p>Labour</p> <p>pick up parts</p> <p>Travel to site,</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>travel to site, access truck to safe working area, remove and replace strut,repair and adjust bonnet hinges</p> <p>Scheduled Service - 500hr IC</p>
1179342	Scheduled Service - 500hr IC 500hr IC. 0500 Hour Service	GSINGH	25/01/2019	Internal	1840.0	\$0.00	<p>Travel to site,</p> <p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p> <p>travel to site, access truck to safe working area,perform scheduled pm service</p> <p>ps; tyres worn, drives - 700 x 12, steer - 600 x 9 [black solids]</p> <p>bonnet strut needs replacement</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H0460N		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R12658L			
1055131	Pipe has come away from muffler, Site contact Colin 0401376601	ALI	16/10/2017	Internal	1474.0	\$0.00	<p>Pipe has come away from muffler, Site contact Colin 0401376601</p> <p>Travel to site,</p> <p>Carry out Inspection and Diagnosis of Wheel</p> <p>Replace Muffler,</p> <p>check unit. heaps of holes on muffler. also exhaust pipe mounting part is off the muffler(welding bids cracked). need a new muffler. also find worn out 4 tyres. see pictures. can not go over the humper. Need replace 4 tyres A.S.A.P. check hypas,possible p/n:2081918. ring spare parts Aldo to order in a muffler,u bolts, mounting rubbers e.t.c.(need approve first). ring jade to orgnize a tyre man.</p> <p>Labour</p> <p>pick up parts in drop point.</p> <p>Remove ancillary items and Counterweight,</p> <p>Repair Exhaust pipe as required,</p> <p>Refit Counterweight and ancillary items,</p> <p>travel to site. set up a safe working zone.remove counterweight to remove broken muffler. remove a stuck muffler part from tail pipe. install a new muffler, atail pipe. secure. install counterweiht back. test ok.</p>
1038028	Damaged Load guard cpotts@callington.com	GDEAN	9/08/2017	External	1416.0	\$1,264.73	<p>Labour</p> <p>Travel to site,</p> <p>Replace Load Guard,</p> <p>Pick up loadguard travel to site remove and replace loadgaurd</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H0460N		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R12658L			
1028880	Scheduled Service -	ALI	4/07/2017	Internal	1381.0	\$0.00	<p>Scheduled Service -</p> <p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p> <p>Repair Governor as necessary,</p> <p>rh drive tyre worn out, lh worn, uneven(solid black 7.00-12/5.00); worn out 2 steering tyres(solid black 6.0-9/4.00), need replace all 4 tyres .a.s.a.p. ring jade to orgnize tyreman. engine surging, sto sometime when steering. tune up, test ok.</p> <p>heaps of big&small holes in muffler, engine sound like diesel, need replace muffler. damaged load guard(w1020m,h1120mm, 4 bolts 350mm gap), damaged bonnet stay gas strut, need replace.</p>
984386	Scheduled Service -	ALI	10/01/2017	Internal	1243.0	\$0.00	<p>-Emailed further works to jade KR 14/7</p> <p>Scheduled Service -</p> <p>Travel to site,</p> <p>250hr Service</p>
933748	KW - SCHEDULED SERVICE	ALI	5/07/2016	Internal	1106.0	\$0.00	<p>worn in all tyres.</p> <p>KW - SCHEDULED SERVICE</p> <p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p>
921691	KW - JOB RAISED FOR PARTS	201OFFICE	24/05/2016	Internal	911.0	\$0.00	<p>worn in steering tyres. check spark plugs(none in stock).</p> <p>KW - JOB RAISED FOR PARTS</p>
883810	LM- EDFS Scheduled Service	ALI	5/01/2016	Internal	911.0	\$0.00	<p>LM- EDFS Scheduled Service</p> <p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p> <p>travel to site, locate unit.</p> <p>broken of a gas strut for bonnet</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H0460N		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R12658L			
864300	LM- Damaged LHS H/lamp wiring.	PWEBSTER	21/10/2015	External	820.0	\$86.00	LM- Damaged LHS H/lamp wiring Repair Light Circuit as required, Traced, located and repaired open circuit in left headlamp wiring. Insulated and secured wiring. Checked headlamp operation-all ok at time of test.
862910	LM- EDFs Scheduled Service	PWEBSTER	15/10/2015	Internal	819.0	\$0.00	LM- EDFs Scheduled Service Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
837639	LM-Scheduled Service -Colin 0401 376601. Any day except Mon and Fri.- PART Requested 14/7/15- Parts in stock- see Matt B.	PWEBSTER	14/07/2015	Internal	703.0	\$0.00	LM-Scheduled Service -Colin 0401 376601. Any day except Mon and Fri.- PART Requested 14/7/15- Parts in stock- see Matt B. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
818185	DML - Scheduled Service	ALI	1/05/2015	Internal	608.0	\$0.00	DML - Scheduled Service Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
793642	Damaged load gaurd at Callington Haven Rydalmere	201OFFICE	28/01/2015	External	0.0	\$625.00	Damaged load gaurd at Callington Haven Rydalmere Travel to site and picked up damaged load guard . Proceed and tried to straightened the damaged load guard. Legs on load badly twisted and could not be straightened properly. Reported. Proceed to AAL workshop and picked up load guard located in yard. Travel to site and fitted.
683517	PREP FOR SALE	201WORKSHOP	25/11/2013	Cap Prep	0.0	\$0.00	Customer PO. 20-ST00137 Hyster H2.5TX Plant No. C52317 Serial No. B466R12658L
Equipment Total:						\$5,159.95	
Customer Total:						\$5,159.95	