



Plant History

Model: VOLVO A45G

Serial No: VCEO45GC00322149

Registration No: 61215C

Plant No.: AT458

Date/Hours	Description
29.01.18 - 3hrs	Turn top tail gate pins in the other way to get machine under 3.5m
30.01.18	Register machine. Fit number plates and conduct pre hire inspection. Fit machine with First aid kit, mine call stickers and all relevant paperwork.
08.03.18 - 67hrs	Check out fault with new 2-way radio. Found radio transmits and receives normally but LCD display on hand piece is erratic and hard to read. Order handpiece.
06.04.18 - 82hrs	Full wash and detail. Pre hire inspection conducted. All levels checked ok.
10.04.18 - 84hrs	Travel to site. Replace radio hand piece.
08.06.18 - 367hrs	Wormald fitted fire suppression system.
09.06.18 - 367hrs	Aces did full energy isolation. Fitted door alarms and mine radios. Wired in fire suppression panel.
11.06.18 - 367hrs <u>500hr service</u>	Carry out 500hr service including all oil samples, engine oil and filters, fuel filters, cabin filters and air cleaners. Fit triangle to roof with call sign stickers. Extend flashing light bracket and fit blue flashing light. Put sheathing around hydraulic lines and turbo feed lines. Fit handrails. Fit tail gate and test ok. Ocean tyres provided rim register. Fit height stickers.
14.06.18 - 367hrs	Pre hire inspection. Full wash and detail. Assemble and fit tail gate to truck.
13.10.18 - 727hrs	Return Inspection Carried out.
17.10.18 - 727hrs	Full wash and detail. Pre hire inspection. Check all levels ok.
31.10.18 - 727hrs	ACES - BMA mine spec install. Fit mine radio and remove battery cables. Fit battery terminal protectors and insulated cables. Mount up and wire up handbrake alarm and test. Refit all removed panels.

10.01.19 - 756hrs	REO – Replaced bonnet strut pump switch (Warranty)
17.01.19 - 805hrs	REO – Replaced leaking front diff brake cooling temperature sensor (Warranty)
29.01.19 - 855hrs <u>1000hr service</u>	REO - Carry our 1000hr service. SOS samples. Top up transmission oil.
30.01.19 - 888hrs	Check transmission fault at site. Low oil fault – moved machine to level ground and OK. Report of truck derating later in day. Tested machine with operator and no fault found.
22.02.19 - 970hrs	Fire suppression serviced at site by Chubb.
12.06.19 - 1215hrs	CQ Diesel – Fit fire extinguisher bracket.
19.06.19 - 1215hrs	REO – Carried out HRL 50 Campaign (Warranty)
02.07.19	Fit turbo heat shield over turbo. Fit exhaust wrapping over exhaust stack.
02.07.19 - 1215hrs	ACES – Extend wiring, mount and wire up blue beacon. Fit and wire up electric horn to operate when truck has no air.
25.07.19	Butler Fabrication – Modify handrails
29.07.19 - 1215hrs	REO – Replaced leaking pinion seal and temp sender block (Warranty)
06.08.19 - 1215hrs	Fit mine compliant call signs on side of bowl and on rear of truck, fit step extensions, modify handrails to suit AS, full wash and detail. Pre-hire conducted
05-06.08.19	CQ Diesel – Modify handrails, repair broken weld
06.08.19	CQ Diesel – Fit handrails, wash machine, loan on truck
07.08.19	CQ Diesel Moranbah – Unload truck, remove handrails from tub. Move machine into yard. Noticed LH headlight out. Check bulb, bulb okay. Found no power at plug. Check harness and remove plug at bonnet pivot. Clean all terminals. Replace blown fuse. Tested operation.
08.08.19	CQ Diesel Moranbah – Inspect machine with BMA
09.08.19	CQ Diesel Moranbah – Load float ready to send to site
16.08.19 - 1223hrs	CQ Diesel – check slope limits. adjust Lat inclination to 7% from 4%
19.08.19 - 1223hrs	CQ Diesel Moranbah – Free up LH tail gate bearing not taking grease and purge

31.08.19 - 1233hrs	CQ Diesel Moranbah – Inspect glass damage
06.09.19 - 1241hrs	CQ Diesel Moranbah – Pump hydraulic oil through tail gate bearings to clear blockage and grease bearings and body
07.09.19 - 1241hrs	CQ Diesel Moranbah – Repair logged defects, mine radio transmit fault, repair aerial connection
16.09.19 - 1271hrs	CQ Diesel Moranbah – Purge tail gate bearings that weren't taking grease
17.09.19 - 1284hrs	CQ Diesel Moranbah – Reposition number plate
18.09.19 - 1285hrs	CQ Diesel Moranbah – Remove and replace quarter glass that was cracked
19.09.19 - 1285hrs	CQ Diesel Moranbah – Remove tape from new glass and clean
21.09.19 - 1258hrs <u>500hr service</u>	CQ Diesel Moranbah – Carry out 500-hour service, replace dowdy washer on oil filter housing piping, give machine good wash
06.10.19 - 1372hrs	CQ Diesel Moranbah – Investigate oil leak on oil hoses, remove hose, clean fittings, apply glue 577 and reassemble
09.10.19 - 1397hrs	CQ Diesel Moranbah – check a/c fault, system working. Hook up gauged and test pressures. Pressures within specs, operating as it should. Monitor
29.10.19 - 1513hrs	CQ Diesel Moranbah – investigate faulty UHF. Tested operation, okay.
30.10.19 - 1514hrs	CQ Diesel Moranbah – tighten loose handrail bolts
03.11.19 - 1544hrs	CQ Diesel Moranbah – tighten loose handrail mounts, change UHF functions to take off silent mode
17.11.19	CQ Diesel Moranbah – repaired oil leak at filter housing, tightened r/h mirror frame bolts
24.11.19 - 1666hrs	CQ Diesel Moranbah – charge fire system and check for leaks, no leaks found, escort Chubb off site
07.12.19 - 1762hrs	CQ Diesel Moranbah – load and secure truck to float on site. Travel back.
08.12.19 - 1762hrs <u>2000hr service</u>	CQ Diesel Moranbah – 2000-hour service
09.12.19 - 1762hrs	CQ Diesel Moranbah – finish service, move kick panel out away from battery box seal, wash down from service and load
17.01.20 - 1967hrs	CQ Diesel Moranbah – investigate reported low fire suppression pressures, not quite in red on gauge send back to work

21.01.20 - 1996hrs	CQ Diesel Moranbah – low pressure fault, working with Chubb
23.01.20 - 1997hrs	CQ Diesel Moranbah – brake fault, pumped off brake, started and watched build up pressure, did brake test pass, took for drive and could not fault brakes
30.01.20 - 2019hrs	CQ Diesel Moranbah – investigate truck not starting, operator had park brake off and e-stop in
24.02.20 - 2209hrs	CQ Diesel Moranbah – carry out off-hire inspection
04.03.20 - 2210hrs <u>500hr service</u>	CQ Diesel – carry out service. Change out flashing light from blue to orange, order dash parts, repaired ash tray, found rear number plate poorly mounted, made new mount, paint and mount. Return hire inspection completed. Found ash tray handle broken, and gear select panel cracked – replacement parts ordered. 500hr service completed. Full wash and detail. Pre hire inspection completed. Check all oil levels – ok.
20.03.20	CQ Diesel Moranbah – re-calibrate load sensor, clean out plugs on sensor
08.04.20 - 2640hrs	CQ Diesel – remove handrail, repaired, place back on, found starter solenoid fault, remove starter, replace with new solenoid, place machine back together, tested okay
18.04.20 <u>500hr service</u>	CQ Diesel – service as per service sheet
22.04.20	ACES – Travel to site, inspect UHF crackly when talking, found top of aerial broken off, replaces aerial and tested UHF
05.05.20 - 2978hrs	CQ Diesel – checked faults, found body up fault, reset body limits switch, tested okay
09.07.20	CQ Diesel – free up battery box lid
13.08.20	CQ Diesel – fabricate bracket, relocate fuel tank breather to rear of cab
17.08.20	CQ Diesel – start service
18.08.20 - 3640hrs <u>500hr service</u>	CQ Diesel – finish off service, top up hydraulic oil, top up drop box oil, swap camera off AT410, clean out belly plates, fit new A/C knob, adjust all tyre pressures
19.08.20	CQ Diesel – fabricate exhaust cover, fit, fit manifold cover, replace fire extinguisher
19.08.20	ACES – remove old mine radio system and fit and wire up new unit with antenna, test operation

20.08.20 - 3640hrs	CQ Diesel Moranbah – install mine radio
23.09.20 - 3787hrs	CQ Diesel Moranbah – grease and check over, blow out filters
16.11.20 - 3942hrs	CQ Diesel Moranbah – inspect hydraulic cutting out faults, found and rectified lateral sensor fault, checked cam bus faults and data link faults, put machine back to work, no faults occurred
18.11.20 - 3951hrs	CQ Diesel Moranbah – removed seat cover and attempt to adjust seat weight sensors, run truck, issue resolved
26.11.20	Chubb – service on fire suppression system
11.12.20 - 4019hrs 4000hr service	CQ Diesel Moranbah – carry out 4000-hour service and inspection
08.01.21 - 4052hrs	CQ Diesel Moranbah – repair connection in beacon wiring
18.01.21	CQ Diesel Moranbah – unload machine from float. Brake test and off-hire inspection
31.01.21 - 4095hrs	CQ Diesel Moranbah – replace front, centre and rear diff and drop box oils.
01.02.21	CQ Diesel Moranbah – clean cab, begin to wash down machine
02-03.02.21	CQ Diesel Moranbah – clean machine and check over
08.02.21	CQ Diesel Moranbah – fix oil leak and box up machine
09.03.21	CQ Diesel Moranbah – wash down machine and detail
11.03.21	CQ Diesel Moranbah – complete BMA pre-hire inspection, clean cab
12.03.21	CQ Diesel Moranbah – complete cab detail, continue with machine wash
14.03.21	CQ Diesel Moranbah – Travel into town and repair Pos 4. Load onto float.
15.03.21	CQ Diesel Moranbah – complete washing and site preparation, load to float
16.03.21	CQ Diesel – Install aerials. Check VHF needs programming. Replace beacon.
17.03.21	CQ Diesel Moranbah – fit mine radio and aerials
18.03.21	CQ Diesel Moranbah – carry out pre-hire inspection
28.03.21 - 4107hrs	CQ Diesel Moranbah – secure body lock. Inspect machine after roll-over.

29.03.21	CQ Diesel Moranbah – inspect roll over damage
30.03.21 - 4116hrs	CQ Diesel Moranbah – develop recovery plan, set up for recovery, recover machine, carry out visual inspection.
09.04.21	CQ Diesel Moranbah – load machine, travel and unload
12.4.21	CQ Diesel Moranbah - Repair pos 6 flat. Jack up and block chassis for Pos 4.
27.04.21	Assist with fitting P and transport s, 4, 6
29.04.21	CQ Diesel- Peel off old sticker, clean surface and fit new sticker.
27.04.21	Cameron Black – fit reverse camera to AT458
05.05.21 - 4119hrs	CQ Diesel Moranbah – low coolant alarm sticky sensor
07.05.21 - 4138 hrs	Diagnose faulty taillights secure body safety prop.
14.05.21 - 4178hrs	CQ Diesel Moranbah – tighten loose L/H mirror inspect seat air valve.
23.05.21 - 4209hrs	CQ Diesel Moranbah – replace seat valve.
26.05.21 - 4209hrs	CQ Diesel Moranbah – Replace Park brake solenoid and coil, rum up test check over truck replace head light bulb tighten loose tail gate bolt.
06.06.21 - 4209hrs	CQ Diesel Moranbah – Replace LH Park light.
08.06.21 - 4215hrs	CQ Diesel Moranbah – diagnose fault in wiring harness from cab rear frame. Remove harness pinpoint break, repair harness and install and test.
09.07.21	ASG Diesel – inspect & look over machine.
13.07.21 - 4384hrs	CQ Diesel Moranbah – move voltage reducer (radio static)
01-02.08.21 - 4450hrs <u>500hr service</u>	CQ Diesel Moranbah – carry out 500hr service.
05.08.21 - 4458hrs	CQ Diesel Moranbah – clean out wiper jets.
16.09.21	CQ Diesel Moranbah – body pos sensor fault re positioned nylon bush and sensor plate, reset sensor run up and test.
18.10.21 - 4827hrs	CQ Diesel Moranbah – repair oil leak, dowdy washer steering pressure sensor.
22.10.21 - 4855hrs	CQ Diesel Moranbah – investigate reported knock in artic hitch. Pink up timber blocks, build pad, jack hitch and check for

	movement in artic bearings with dial indicator. No movement found. Check steering pins. Check body pivot pins and find excessive movement.
01.11.21 - 4863hrs	CQ Diesel – full check over of machine. Fit new body lock pin. Straighten steps. Fit new nipple to RH steer cylinder. Blow out air filters. Remove and replace dash panel. Fit new UHF mic. Remove dirt deflector and descale.
02.11.21	CQ Diesel – finish descaling dirt deflector. Rust cover, prime and paint. Mask up, paint handrails.
03.11.21	CQ Diesel – fit new gear select decal. Fit dirt deflector. Fit clamp to remote oil filter line. Top up engine oil. Grease machine. Remove and replace drop box seal.
03.11.21	Remove LH side windscreen, install new. Remove front output yoke of drop box, cleaned, filled up drop box.
03.11.21	DMS Fire Services – 6 monthly fire suppression service
04.11.21	CQ Diesel – fit drive shaft. Top up hydraulic oil.
04.11.21	Cleaned up silicone around window.
10.02.22	Heavy Duty Welding – cut and move handrail and kick plate to clear door opening
01.03.22	Aces – wire up cab pressuriser system and mount monitor. Fit mine radio and modify mounting and wiring. Change over beacon to green. Change lockouts on isolators. Tested operations.
02.03.22	replace beacon mount, done oil change
10.05.22	DMS – carried out fire suppression service.
15.08.22 - 5053hrs <u>1000hr service</u>	Carry out 1000hr service.
23.09.22	ASG Diesel – repaired broken track number frame on top of cab.
31.01.23	Modify step extension. Swap out fire extinguisher.
02.02.23	Full wash and detail. Pre hire inspection completed.
20.03.23	BMA compliance inspection completed. Fit mine radio to machine.
16.10.23	DMS – Carry out 6 monthly fire suppression service and repairs.
07.02.24	Sand and paint machine.
10.02.24 - 6168hrs <u>6000 hr service.</u>	Carry out and complete 6000 HR Service and inspection.

11.02.24	Complete service, Defects, repair L/H step and step treads on top level, reseal windscreen. Repair A/C filter housing where ducting hose connects. Repair R/H access lid. Fit tailgate bolt, Fit missing wheel nut covers. Investigate cabin pressuriser fault. Repair cover on Hyd. tank
12.02.24	Repairs, Sticker removal and sanding. Reseal windscreen, fit cabin pressurise hose, glue anti-shield material onto dash. Repair console crack, replace L/H park bulb. Investigate R/H lid (breathe safe), investigate minor fault.
13.02.24	Sand prep and paint, remove stickers, fit RH box lid and mechanism, Paint wheels. Sanding and Sticker Removal.
14.02.24	Painting Bucket, Rims and Back.
15.02.24	Sticker Installation and Repairs. Started removing belts tensioners and idler. Found to have wrong parts supplied. Drain brake oil and refill, drain hydraulic oil and refill. Fit high vis stickers paint tub.
16.02.24	Fit remaining stickers to cab
20.02.24	Finished installing parts on belt and pressed new bearings. Workshop, Housekeeping (Sweeping Bays), (Empty bins). Remove and replace belts. Replace bearings in tensioner, carry out pre-hire, found ECU fault on machine, plug in computer and diagnose fault put machine on wash pad.
21.02.24 - 6168hrs	Replaced POS 5 tyre. Brake accumulator pre charge pressure below spec, have tested ok. Repair/replace drop box breather housing cracked, right hand console cracked, left hand side park light bulb blown, battery box cover grip lifted, water pump belt split, idler noisy, a/c alternator belt split/perished tensioner has minor movement, LH & RH electric mirrors not working, RH side cab access door latch unserviceable, oil leaks from bottom of PTO housing/pump mounts, drop box input/output seals have minor leaks, RH side tail gate bolt missing, brake cooling tank over full, RH side tans belly guard missing clip, rubber boot has come off steering rack/steering has minor movement. Detailed, washed, and greased machine. Carry out and complete pre hire inspection. Remove A/C belt and tensioner, fit new tensioner and belt. Remove and replace mirrors. Installed new tensioner on aircon belt and re-installed belt and covers.



Service History Customer Report Equipment No. AT458

Description: 45T ARTICULATED DUMP TRUCK - DIESEL

Serial No.: VCE0A45GC00322149

Make: VOLVO

Registration: 61215C

Model: A45G

Registration Expiry: 30/04/2026

Date	Job Number	Eng. Hours	Job Description
11/03/2024	73	6176.00	Mine Radio Program and Install
			Comment: PROGRAMMED MINE RADIO AND INSTALLED.
11/04/2024	283	6711.00	ECM Fault
			Comment: RECTIFIED ECM FAULT.
11/04/2024	285	6711.00	Investigate Body Position Sensor Issue
			Comment: Investigated body position sensor fault - Adjusted sensor and tested - Ok.
15/04/2024	321	6711.00	Investigate Fault Light on Dash
			Comment: Investigated fault light on dash - Found to be traction control light on. Turned traction control off with switch on dash - Tested ok.
15/04/2024	326	6711.00	Remove and Replace Damaged Exhaust
			Comment: Found exhaust to be rusting out behind cab. Removed old exhaust and replaced with new.
19/04/2024	366	6711.00	Scheduled Service - Inspection Initiated Service job COMPLIANCEFIRESUPPRESSION 12M AND FIRE EXTINGUISHE
02/05/2024	425	6304.00	BMA Compliance Repairs
			Comment: Carried out BMA Compliance repairs - Replaced faulty reverse alarm, cleaned/stamped/painted red all rim ID numbers. Washed and detailed truck.
18/05/2024	540	6304.00	Pre Hire Inspection
			Comment: Completed machine pre hire inspection and photos.
19/05/2024	557	6337.00	Missing Bolts and Thread Plate from Boggie Anchorage Plate
			Comment: 21.05.24 6337hrs Found missing thread plate and bolts from bogie anchorage plate - Truck required urgently for job so parts removed from AT455 to get truck going. Ordered replacement parts for AT455.
21/05/2024	575	6337.00	Off Hire Inspection
			Comment: 21.05.24 Off Hire inspection completed 6337hrs Washed, detailed and greased machine. Completed on hire inspection.
29/05/2024	627	6337.00	Pre Hire Inspection
			Comment: 26.06.24 Cleaned cab interior, completed on hire inspection, and loaded machine onto float.
06/07/2024	1037	6337.00	Replace Intake Heater



Service History Customer Report Equipment No. AT458

Description: 45T ARTICULATED DUMP TRUCK - DIESEL

Serial No.: VCE0A45GC00322149

Make: VOLVO

Registration: 61215C

Model: A45G

Registration Expiry: 30/04/2026

			Comment: 25.06.24 Removed intake heater from AT407 and installed into AT458. Ran and tested ok.
21/07/2024	2179	6337.00	INSTALL DRIVER MONITORING CAMERA
			Comment: 22.09.24 Installed driver monitor camera.
22/07/2024	2206	6337.00	REPROGRAM MINE RADIO TO SARAJI
			Comment: TRAVELLED TO SITE AND INSTALLED MINE RADIO.
30/08/2024	2703	6897.00	Accelerator Pedal Not Working
			Comment: 30.08.24 6291hrs - Investigated no throttle fault. Inspected throttle position sensor, harness, ECU, body sensors. Unable to fault. Possible software failure. Engaged CJD fitter to inspect. 25.09.24 CJD - M/H 6291 - Travelled to and from site. Diagnosed machine not revving, connected tech tool. Found software reverted back to version 5. Updated software to version 24. Programming failed at VECU4. Talked to product support and started full trace on can bus wiring. Found high resistance from OBD plug to VECU. Service Report - M/H 6291 - Travelled to and from site. Removed panels from inside cab, cut and removed splices from S1708 system and soldered wires together x 3. Checked resistance between wires after repairs, ok. Connected tech tool and reprogrammed machine and updated to version 24, ok. Tested machine to see if it would rev up. Spoke to customer found they had swapped throttle sensors on machine. Service Report - M/H 6291 - Travelled to and from site. Tidied up wiring, fit cab panels and removed accelerator throttle sensor. Wait for customer to bring out original sensor, fit sensor to test, ok. Machine operating normally, tidied cab.
12/09/2024	2933	6290.00	Pre Hire Inspection
			Comment: REPAIRED AM/FM RADIO. WASHED, DETAILED AND GREASED MACHINE. COMPLETED ON HIRE INSPECTION.
11/10/2024	3281	6357.00	Scheduled Service Job. COMPLIANCE FIRE SUPPRESSION6M AND FIRE EXTINGUISHE
			Comment: ARA FIRE MINING TECHNICIAN COMPLETED 6 MONTHLY FIRE SUPPRESSION AND FIRE EXTINGUISHER SERVICES.
14/10/2024	3295	6459.00	AM/FM not working, replace head unit.
			Comment: 15.10.24 6459hrs - Replaced am/fm head unit and tested operation - All Ok.
14/10/2024	3311	6451.00	Replace Reverse Camera



Service History Customer Report Equipment No. AT458

Description: 45T ARTICULATED DUMP TRUCK - DIESEL

Serial No.: VCE0A45GC00322149

Make: VOLVO

Registration: 61215C

Model: A45G

Registration Expiry: 30/04/2026

			Comment: 12.10.24 6451hrs - Replaced l/h headlight bulb. Replaced windscreen washer motor and cleaned washer jets. Resecured bonnet rubber step. Removed and repaired skirt off driver seat and lubricated all pivot points.
21/10/2024	3426	6570.00	500HR Service
			Comment: 20.10.24 6480hrs - Checked over machine, all radios working, reverse camera working, sprayed underneath seat, fire extinguishers and suppression all in date. 02.11.24 6570hrs - Loaded up service kit and travelled to Saraji. Completed 500HR service. Checked over machine and put a bar over all undercarriage bolts. Sprayed operator seat with CRC to stop squeak. Adjusted bottom driver monitor camera.
21/11/2024	3840	6512.00	A/C issues/Broken Handrail Bolt
			Comment: 15.10.24 6459hrs - Repaired a/c fault and gas system. Removed broken bolt from handrail, tapped out hole and installed new bolt.
26/11/2024	3903	6512.00	Replace Pressuriser Fan
			Comment: 29.11.24 6704hrs - Head to tyre bay and replaced cab pressuriser fan motor. Tested operation - All Ok.
16/12/2024	4204	6704.00	INSPECT DAMAGED TYRE AND ORGANISE REPLACEMENT
			Comment: 26.11.24 6704HRS Inspect tyre damage to AT458 - tread depth measures at 30mm, locate suitable runout tyre and deliver to site. New Tread Depth - 48mm Damaged Tyre Tread Depth - 30mm Tread Depth at Scrap - 10mm Calculation for remaining tread depth = 20mm
03/02/2025	4623	6799.00	FEBRUARY ON SITE REPAIRS AT SARAJI MINE
			Comment: JUMP STARTED MACHINE TO CHARGE BATTERIES, BATTERIES U/S, REMOVED AND REPLACED BATTERIES. REMOVED AND REPLACE A/C CONTROL PANEL.
28/02/2025	4888	6911.00	MARCH ON SITE REPAIRS AT SARAJI MINE
			Comment: TY - 05/03/25 TRAVEL FROM MORANBAH TO SARAJI, WAIT FOR ESCORT. REPAIR BROKEN UHF SPEAKER. TY - 16/03/25 LOOK THROUGH FAULT CODES, CONFIRM NO FAULTS, SENT BACK TO WORK.



Service History Customer Report Equipment No. AT458

Description: 45T ARTICULATED DUMP TRUCK - DIESEL

Serial No.: VCE0A45GC00322149

Make: VOLVO

Registration: 61215C

Model: A45G

Registration Expiry: 30/04/2026

			AARON - 21/03/25 TRAVEL TO SARAJI, CHECK OVER MACHINE FOR DEFECTS.
12/03/2025	4970	7002.00	AT458 1000HR Service @ 7000HRS
			Comment: COMPLETED 1000HR SERVICE
28/03/2025	5134	7096.00	APRIL ON SITE REPAIRS AT SARAJI MINE
			Comment: NIC - 05/04/25 INVESTIGATE NO ACCELERATOR, PICK UP LAPTOP FROM JACK, CARRY OUT DIAGNOSING, FOUND CHEWING GUM INSIDE ECM PLUG, REMOVE AND TEST - OK. CLEAN UP WIRING UNDER DASH. TRAVEL TO MORANBAH. NIC - 19/04/25 TRAVEL FROM MORANBAH TO SARAJI. GO FOR LAP WITH OPERATOR TO SEE BODY POSITION FAULT, RESET POSITION SENSOR - TEST OK. AARON - 18/04/25 TRAVEL TO GOLDINGS, CHECK OVER MACHINE- STRANGE NOISE IN CAB. TRAVEL TO MORANBAH. TY - 30/04/25 CHECK HORN, CHECK TYRES, CHECK HYD LEVEL. TRAVEL FROM SARAJI TO MORANBAH.
14/04/2025	5300	7096.00	Scheduled Service Job. COMPLIANCE FIRESUPPRESSION 12M AND FIRE EXTINGUISHER
			Comment: ARA FIRE TECHNICIAN COMPLETED 12 MONTHLY FIRE SUPPRESSION AND FIRE EXTINGUISHER SERVICES.
29/04/2025	5370	7260.00	Scheduled Service Job. COMPLIANCE BMA INSPECTION AND BRAKE TEST
			Comment: CQ COMPLIANCE TECHNICIAN COMPLETED 12 MONTHLY BMA COMPLIANCE INSPECTION AND BRAKE TEST.
30/04/2025	5392	7260.00	MAY ON SITE REPAIRS AT SARAJI MINE
			Comment: 18.5.25 ASG DIESEL - COREY BELLA CHECK OVER COOLANT ALARM. REPLACE HEADER TANK. DAYNE - 08/05/25 STRIP AND FIT TYRES. DROP RUN OUT TYRES TO SARAJI. DAYNE - 09/05/25 STRIP AND FIT TYRES. REMOVE POS 4 FOR DUO SEAL REPAIRS. DAYNE - 11/05/25 POS 4 DUO SEAL REPAIR. SOURCE REPAIR INFO FOR SPENCE, ASSIST WITH REMOVAL POS 4 WHEEL AND HUBS, OPERATE FORKLIFT. ASSIST WITH PRESSING BEARINGS OUT, ASSIST WITH DUO INSTALLATION/REASSEMBLY OF HUB AND FITTING WHEEL ASSEMBLY.
24/05/2025	5747	7400.00	500HR Service @ 7500HRS



Service History Customer Report Equipment No. AT458

Description: 45T ARTICULATED DUMP TRUCK - DIESEL

Serial No.: VCE0A45GC00322149

Make: VOLVO

Registration: 61215C

Model: A45G

Registration Expiry: 30/04/2026

30/05/2025	5880	7429.00	JUNE ON SITE REPAIRS AT SARAJI MINE
09/06/2025	6010	7429.00	ACC Broken Door Glass
			Comment: AT458 - BROKEN DOOR GLASS ORGANISED REPLACEMENT DOOR GLASS AND URGENT PARTS RUN TO CJD IN MACKAY TO COLLECT DOOR GLASS TO TAKE BACK TO MORANBAH. TRAVELLED TO SITE, REMOVED BROKEN DOOR GLASS, PREPARED SURFACES AND INSTALLED NEW DOOR GLASS. PACKED UP TOOLS AND RETURNED TO MORANBAH.
17/06/2025	6104	7429.00	50% COST SHARE TO REPLACE TYRES ON AT458
			Comment: AT458 - COST SHARE OF REPLACEMENT TYRES TO OFFSET PREVIOUS TYRE DAMAGE REPAIRS. REMOVE 3 X WORN OUT TYRES AND REFIT NEW TYRES TO RIMS, INFLATE AND CHECK TO ENSURE NO AIR LEAKS PRESENT AFTER INFLATION.
30/06/2025	6362	7675.00	JULY ON SITE REPAIRS AT SARAJI MINE
04/08/2025	6749	7940.00	8000Hr Service @ 8000Hrs
06/08/2025	6785	7940.00	AUGUST ON SITE REPAIRS AT SARAJI MINE
02/09/2025	7305	8202.00	SEPTEMBER ON SITE REPAIRS AT SARAJI MINE
			Comment: SEPTEMBER WORKS INCLUDED. - CHANGING OUT SEALS IN DROP BOX FLANGE. - REPLACED BONNET LATCH - GREASED BODY OF TRUCK & TAIL GATE PINS. - REMOVED/ REPAIRED & REPLACED DRIVE SHARFT YOKE
30/09/2025	7883	8403.00	DECOMMISSION
			Comment: COMPLETED OFF HIRE INSPECTION DECOMMISSIONED TRUCK READY FOR SALE, REMOVED. * CALL SIGN TRIANGLE & CALL SIGNS * MINE RADIO & INSTALL KIT * DRIVER MONITOR CAMERA, BRACKETS & WIRING * ALL AG DOCUMENTATION * FIRST AID KIT WASH, DETAIL & GREASE MACHINE
02/10/2025	7972	8322.00	Scheduled Service Job. COMPLIANCE FIRE SUPPRESSION6M AND FIRE EXTINGUISHE



Service History Customer Report Equipment No. AT458

Description: 45T ARTICULATED DUMP TRUCK - DIESEL

Make: VOLVO

Model: A45G

Serial No.: VCE0A45GC00322149

Registration: 61215C

Registration Expiry: 30/04/2026