

Plant History

Model: Komatsu PC300 Excavator Serial No: KMTPC247CJC081706

Registration No: 78227C Plant No: EXC31

Date/Hours	Description			
31.05.19	Purchase Machine with Wormald Fire suppression already fitted.			
02.07.19 14hrs	Register Machine. Fit Plates			
03.07.19 14hrs	Fit call sign triangle and brackets to cab roof.			
20.07.19	ACES – Wire in fire suppression and engine shut down. Fit and wire up jump start receptacle. Inspect for mine compliance (electrically). Mount and wire up door alarm when hydraulics is on with light in dash. Fit mine radio and aerial. Refit all removed panels. Wire up blue flashing light to top of triangle on roof.			
24.07.19	SITEC – Fit Trimble ready system to machine			
26.07.19	Wrap exhaust and tip with lagging.			
26.07.19	Wash and detail machine ready for transport to Moranbah			
29.07.19 14hrs	CQ Diesel Moranbah – Make up brackets for mine radio, make brackets and mount fire extinguisher in cab and on rear of machine platform, check over machine and mount number plates			
01.08.19 14 hrs	CQ Diesel Moranbah – BMA inspection			
03.08.19	CQ Diesel – Hard face tilt bucket and GP Bucket. Inspect machine with BMA			
04.08.19 14 hrs	CQ Diesel Moranbah – Inspect machine with BMA. Hard face tilt bucket and GP bucket			
05.08.19 14 hrs	CQ Diesel Moranbah – Load and secure machine to float. Weld choc bat to GP and tilt buckets			
06.08.19 14hrs	CQ Diesel Moranbah – Finish hard facing buckets. Load buckets and ripper attachment to tilt tray			

10.08.19 37 hrs	CQ Diesel Moranbah -Repair hydraulic leak on stick, loose fit on aux line. Replaced o ring and tightened. Remove damage bucket hose – take to town, get new one made and refit			
12.08.19 59hrs	CQ Diesel – Modify tilt hitch cylinder guard to prevent it catching on cylinder clan nut.			
18.08.19 89hrs	CQ Diesel – Measure track adjustment and adjust R/H side.			
24.08.19 131 hrs	CQ Diesel Moranbah – Accident damage, remove busted hose, take to town, get new hose made, refit to machine			
30.08.19 167hrs	CQ Diesel Moranbah – Remove GPS mushrooms and computers. Resecure steps.			
31.08.19 175hrs	CQ Diesel Moranbah – Remove tilt bucket			
07.09.19 220hrs	CQ Diesel Moranbah – Repair logged defect, straighten and replace bolts on RH track frame step extension			
11.09.19 244hrs	CQ Diesel Moranbah – Travel to site, inspect, clean and retension loose compaction wheel cap bolts			
18.09.19 284hrs 250hr service	CQ Diesel Moranbah – Carry out 250-hour service			
06.11.19 522hrs	CQ Diesel Moranbah – inspect for oil leak			
11.11.19	CQ Diesel Moranbah – unload trailer			
12.11.19 570hrs 500hr service	CQ Diesel Moranbah – carry out 500-hour service and load			
17.01.20	CQ Diesel Moranbah – quick hitch not taking grease, remove all grease nipples, clean holes to fins, fit, grease, got operator to move bucket, got more grease to pins			
18.01.20	CQ Diesel Moranbah – grease quick hitch, remove all nipples, clean grease holes, clean nipples, fit back to quick hitch			
01.02.20 1025hrs	CQ Diesel Moranbah – engine fault light was service light coming on, checked fire extinguisher date December 2019			
03.02.20 1042hrs 1000hr service	CQ Diesel Moranbah – unload from float, carry out 1000-hour service			
04.02.20 1042hrs	CQ Diesel Moranbah – running checks, wash machine, load on float			

15.03.20 1307hrs	CQ Diesel Moranbah – inspect reported cracked GPS post			
18.03.20	CQ Diesel Moranbah – weld / repair cracked GPS post mount			
22.03.20 1351hrs	CQ Diesel Moranbah – investigate oil leak, replaced oring on tilt bucket fitting, tighten fitting on slew pump, clean excessive oil, test, okay			
23.03.20 1360hrs	CQ Diesel Moranbah – replace left-hand side front light bulb			
31.03.20 1430hrs	CQ Diesel Moranbah – remove damaged tilt bucket hoses and fittings, get new hoses made			
01.04.20 1430hrs	CQ Diesel Moranbah – install new hoses to tilt bucket, remove damaged GPS cable			
20.04.20 1547hrs	CQ Diesel Moranbah – remove blown return hose from stick cylinder cranage valve			
21.04.20 1547hrs 500hr service	CQ Diesel Moranbah – replace stick cylinder cranage valve return hose. Carry out 500-hour service and inspection			
06.06.20 1773hrs	CQ Diesel Moranbah – reposition access steps, install stauff clamp for GPS cable			
09.06.20	CQ Diesel Moranbah – unblock grease points on tilt bucket			
16.07.20	CQ Diesel Moranbah – escort float on to site, load, escort float or site			
30.07.20 1870hrs	CQ Diesel Moranbah – remove windscreen, load into Ute and secure, pick-up nitrogen			
13.08.20	Full wash and detail. Pre hire inspection completed. Top up coolant. Check all oil levels – ok.			
14.08.20	CQ Diesel – remove green beacon, mark out and drill holes, fit orange beacon, wire in, test all machine			
09.09.20	Check over machine, complete defect list			
10.09.20	Straighten up steps, replace warning stickers, fire suppression recharged, resecured wires to triangle, topped up engine oil, reshim bucket / stick, tighten up cylinder			
15.09.20	CQ Diesel – fabricate exhaust guard			
16.09.20	CQ Diesel –paint exhaust guard			
19.09.20 1907hrs	Full wash and detail. Carry out pre hire inspection			

25.09.20 1908hrs	CQ Diesel Moranbah – remove front glass from cab, check over machine, change orientation of tilt bucket hose at hitch, fit service sticker. Check fault codes. Install 10mm thick windscreen			
09.12.20	CQ Diesel Moranbah – load and secure machine. Load GP bucket. Wash down cab and windows			
04.01.21 1996hrs	Carry out off-hire inspection			
05-06.01.21 1996hrs 2000hr service	CQ Diesel – carry out 2000-hour service and inspection			
06.01.21	Full wash and detail. Pre hire inspection completed.			
06.01.21 1997hrs	CQ Diesel – replace tilt bucket fitting.			
20.01.21	Carry out off-hire inspection.			
22.01.21	DMS – fire suppression 6 monthly service			
27.01.21	Tighten a/c belt, repair e-stop, tighten seat, remove Trimble			
27.01.21	CQ Diesel – fit steps and locator pins. Remove green beacon, fit orange beacon.			
02.03.21	Isolated oil leak at bucket.			
03.03.21	B Inman – replace left-hand tilt cylinder			
04.03.21	Fit tilt bucket, filled hydraulic oil			
16.03.21	Hydraulic Solutions – inspect cylinder with broken feeder tube. Strip, cut off head gland boss, machine piece of heavy wall tube weld, reassemble, test and paint.			
30.07.21	Full wash and detail. Pre hire inspection completed.			
23.08.21	ACES – service call to site to inspect starting faulty on digger. Attended site and machine started, unable to make fault. Travelled to Red Mud Dam and inspect starting fault, carried out tests and found faulty earth, removed all earths and power cable refit and tested operations.			
10.09.21	ACES – inspect not starting. Found e-stop near isolators pushed in. reset e-stop and tested okay.			
27.09.21	ACES – inspect starting fault. Carried out tests and found batteries with 2 volts. Sourced charger and charged batteries.			

05-06.10.21	Carry out 500hr service.			
500hr service	Change out buckets and teeth. Remove cutting edge.			
06.10.21	Full wash and detail. Pre hire inspection completed.			
06.40.04	1055			
06.10.21	ACES – dropping out of power. Open engine wiring harness from batteries to fuse panel. Found corroded wiring. Repaired faulty wiring harness. Charged up batteries, refit and tested operations. Refit all removed panels.			
08.11.21 2629hrs	Found Trimble cable crushed, remove Trimble cable and box on bucket.			
18.11.21	Fit new Trimble cable.			
03.12.21	Sitech – adjust machine file setting to suit correct blade			
	measurements. Rectified blade and had GPS position /			
	corrections moved, machine and Trimble system not working.			
00.01.22	They live having weeting weld and live have haved him haved for			
09.01.22	Ikon Line boring – realign, weld and line bore barrel pin bored for tilt bucket cylinders			
	,			
01.02.22	found in tilt bucket starting to perform on I/h side			
04.02.22	DMS – carried out 6-month fire suppression service			
<u> </u>	2 cannot care a monator a capp. caster care a			
09.02.22	turned cutting edge			
15.2.22	Found right hand inner pin tilt cylinder pin was missing. Place new pin back in with new bolt.			
03.03.22 3015hrs 1000hr service	1000hr service completed			
08.03.22	Hard face bucket and repair cracks.			
09.03.22	Full wash and detail. Pre hire inspection completed.			
13.03.22	ASG Diesel – refit tilt pin into bucket, shim hitch, replace retainer bolt, grease and inspect. Replace broken bolts in access steps.			
25.03.22	ASG Diesel – quick hitch fault, inspect and found wire pulled from plug on solenoid.			
03.04.22	ASG Diesel – remove and replace broken tilt sensor wire. Investigate sensor not picking up damaged sensor.			
14.04.22	ASG Diesel - inspect leaking tilt bucket seals.			

20.05.22 3329hrs	ASG Diesel – inspect and repair gps harness fault. Strip and r crushed harness.			
28.05.22 3369hrs	ASG Diesel – repair oil leak on hydraulic pump.			
14.06.22 3445hrs 500hr Service	ASG Diesel – complete 500hr service and inspection. Repair engine oil leak, straighten access steps and replace bolts.			
1.7.22	ASG Diesel - Loose key barrel tighten key surrounding.			
7.7.22	ASG Diesel - latch front windscreen in. Glass too thick on seals.			
21.7.22	ASG Diesel - all fire inspection completed, repairs to bucket to be completed			
25.7.22	ASG Diesel - attempt to start, inspect start fault. Dry out plugs test battery, jumpstart new battery required			
28. 7. 22	ASG Diesel - remove and replace batteries fit GPS screen bracket			
11.8.22	ASG Diesel - replace cutting edge			
14.8.22	ASG Diesel – Unblock all tilt bucket grease nipples.			
16.8.22	Remove blown hydraulic hose.			
17.8.22	ASG Diesel – fit new hydraulic hose.			
24.8.22	ASG Diesel -repair GPS harness for tilt bucket			
29.8.22	ASG Diesel - repair grease nipples and remove pin on bucket that was seized			
23.10.22	ASG Diesel – removed blown hitch oil lines, fitted new hose.			
28.10.22	ASG Diesel – repair bent steps, replace busted step bolts			
28.1.23 4059hrs	ASG Diesel – Investigate wear in tilt bucket pins.			
25.02.23 1000 hr service completed 4221 hrs	1000hr service completed. Replaced r/h mirror and straightened bent steps			
22.3.23 4346hrs	ASG Diesel – Inspect unserviceable alternator belt. Change out idler pulleys.			
27.3.23	ASG Diesel – Fit air conditioner belt, fan belt and alternators belts.			
28.3.23 4351hrs	ASG Diesel – Refit swivel bucket pin. Check seat fault.			

6.4.23 4382hrs	ASG Diesel – Fit swivel bucket retainer bolt. Fit grease nipple extensions.				
10.4.23 4422hrs	ASG Diesel – Repair GPS cable.				
4.5.23 4528hrs	ASG Diesel – remove seat and fit seat damper.				
22.5.23 4615 hrs 500 hr service	ASG Diesel – Carry out 500hr service. Carry out inspection and repairs.				
01.06.23	ASG Diesel – inspect GPS fault. Bucket tilt sensor harness unserviceable.				
07.06.23 4699hrs	ASG Diesel – repair GPS cable				
15.06.23 4717hrs	ASG Diesel – repair damaged GPS harness. Repair hydraulic leak on fitting on hitch				
19.06.23 4755hrs	ASG Diesel – fit new GPS harness				
28.06.23 4778hrs	ASG Diesel – inspect a/c fault, found and repaired fuse and wiring				
15.08.23	ASG Diesel – investigate auto greaser not working				
16.08.23	ASG Diesel – repair auto greaser not pumping				
24.08.23 5005hrs 1000hr service	ASG Diesel – carry out 1000-hour service				
25.08.23 5005hrs	ASG Diesel – remove excessive grease clean and start washing machine.				
27.08.23 5005hrs	ASG Diesel – shim tilt bucket. Wash stick and bucket.				
29.08.23	ASG Diesel – washed machine. Fit undercarriage plates x2. Repaired suction line on hydraulic system. Replaced front work light globe. Cleaned out cab. Removed final drive covers and removed mud and dirt from final drive motors. Adjusted rubbed hoses on hydraulic system.				
30.08.23	ASG Diesel – removed bucket tilt fittings due to leaking oil. Obtained new fittings. Fit new fittings for tilt bucket. Greased main shaft on bucket, adjusted tracks on machine.				
07.09.23 5009 hr	Un-seize tilt bucket pin and carry out repairs. Remove and replace parts from Followmont. ASG – 5009hrs, used porta po on bucket, greased bucket found dirt built up in nipple holes ok, painted hitch points, replaced first aid kit, prestart book,				

	cleaned windows, check radio channels for south walker and ok, prestart.			
08.09.23	ASG - Painted access steps on machine, original Anderson plug.			
09.09.23 5005hrs	DMS Fire Services – Carry out 12 monthly fire suppression service and repairs.			
13.09.23	ASG - Source equipment for cab pressuriser fit out. Fit new cab pressuriser, made brackets for fan motor, picked up parts from Exceed for fan motor (piping to fit on back of cab) wired in fan and monitor in cab, mounted fire extinguisher onto top deck, reassembled top deck and panels on side of hyd. tank. Test system and okay.			
14.09.23	ASG - Finish off cab pressuriser – find and seal leaks in cab, clean down after repairs.			
15.9.23	Rowes Welding & Fabrication – Fabricate and weld excavator steps and repair crack on bucket.			
19.09.23 5005hrs	Heavy Maintenance - Diagnose and repair mine radio, not turning on. Renew stickers and sand rear counterweights, bog deep scratches.			
20.09.23	Titan IND – Wire up breathes safe system. Heavy Maintenance – Complete paperwork, mask up machine and paint. Carry out another coat of paint and remove masking tape and drop sheets.			
21.09.23 5005hrs	Heavy maintenance – Install new stickers onto counterweight. Gathered buckets and sit in tilt bucket on machine. 5005hrs.			
14.10.23	ASG – Cleaned, prepped and painted track frames.			
27.11.23	Carry out pre hire inspection. Full wash and detail.			
09.05.24	DMS fire system service and inspection			
18.06.24	Pre Hire compliance work for Bravus Specs, Fit 2x new 9kg Fire extinguishers, Fit Amber Beacon etc			
12.07.24	Fit Seat Belt Alarm for Bravus Compliance			