Barrello Barta Galarrata			C
Repair Date Odometer 18/06/2025 526491	JOHNSTONE, ROB	Service Agent Description Remove the CB and the old phone system. Graham painted the wheels. Move the audio buttons across to 7859.	Completed Y
	JOHNSTONE, ROB	Replace both of the reverse light globes.	Y
	JOHNSTONE, ROB	Retention front wheels after tyre fitment.	Υ
29/01/2025 525083 04/11/2024 523391		COLD TREAD (N Cold tread swapped the front tyres left to right. hopefully this will even the tyre wear up. O/S Windscreen washer weak, Tested pump etc and found the suction for the pump to be cracked. Fit new pump and test.	Y
22/10/2024 523391		O/s windsdeen washer weak, resided pumpleted and doubt the suction for the pump to be cracked. Fit new pump and test. Refit the seat bet buckle.	Y
17/10/2024 523391		Rob drivers seat belt buckle to keep 7859 on the road.	Υ
23/07/2024 158	SHEPHERD, GLENN	TYRE REPAIR	Υ
23/05/2024 520971		Had new screen fitted by Whites windscreens \$2000 Had new screen fitted by Whites windscreens \$2000 Had new screen fitted by Whites windscreens \$2000	Y
23/04/2024 519529 27/03/2024 518731	RUFF, STEVEN RUFF, STEVEN	Had new guide wheel made for door mechanism. put door back together. Tom Woodhams Engineering \$100 Fitted new 1 battery \$350	Y
26/02/2024 517466	DAVIS, KANE	REMOVE BOTH NEW MICHELIN TYRES OFF RH REAR AND FIT 2 MICHELIN CAPS. TYRES NEEDED FOR STEER ON 6954-AO ALSO MEASURE BRAKE ROTORS, IN SPEC. TEST DRIVE AND RETENSION WHEEL NUTS.	Y
	DAVIS, KANE	BLOW OUT AND WASH OUT RADIATOR AND INTERCOOLER.	Υ
20/10/2023 513497	DAVIS, KANE	TOP UP ENGINE COOLANT. BUZZER HAS STOPPED GOING OFF INTERMITTENTLY. CHECK WIRING AND SENSORS	Y
11/10/2023 513104 12/09/2023 512490	SHEPHERD, GLENN DAVIS, KANE	CHECK WINING AND SENSORS REMOVE AND REPLACE LOW AIR SENSOR ON AIR TANK. TEST OKAY.	N Y
05/09/2023 511913		REMOVE ALL REAR LIGHT LENSES AND CLEAN OUT. REPLACE SCREWS THAT WERE RUSTED OFF. REMOVE AND REPLACE SCHOOL SIGN. FIT NEW RED REFLECTIVE DECAL TO DO NOT OVERTAKE SIGNS.	Y
	DAVIS, KANE	DIESEL LEAKING DOWN THE RH SIDE OF ENGINE. FAULT FIND AND FOUND A PIN HOLE IN THE PVC RETURN LINE. REMOVE AND REPLACE SECTION WITH HOLE IN IT. TEST DRIVE OKAY.	Υ
14/07/2023 509556	DAVIS, KANE DAVIS, KANE	REPLACE DIFF OIL. WITH PENRITE 140W REMOVE AND REPLACE RH REAR HUB SEAL.	Y
20/06/2023 508026 16/05/2023 506716	SHEPHERD, GLENN	REMOVE AND REPURLE AN REAR HOUS SEAL. REPOSITION SCHOOL BUS SIGN TO NEAR IGHTS AND REMOVE OLD SIGN	Y
	DAVIS, KANE	CLEAN OUT AIR CON FILTER AND CLEAN OUT EVAP FINS IN ROOF, FULL OF DUST.	Υ
., ,	DAVIS, KANE	FOUND C CLIP HAD COME OUT OF BUSH ON RH LOWER DIFF TORQUE ROD. REMOVE TORQUE ROD AND PUT IN PRESS TO REASSEMBLE. REFIT OKAY. FOUND AIR LEAKING AT DOOR REGULATOR AIR LINE FITTING, REPLACE FITTING FIXED AIR LEAK. HAVE SPARE KEY CUT AS WE DIDN'T HAVE ONE.	Υ
	DAVIS, KANE DAVIS, KANE	FOUND BROKEN BOLT IN FRONT TOP RH FUEL TANK TO CHASSIS MOUNTING BRACKET. NO ACCESS TO BOLT EXCEPT TO CUT A HOLE INSIDE LUGGAGE BIN. REMOVE BROKEN BOLT AND REPLACE. MAKE UP NEW COVER FOR INSPECTION HOLE. REMOVE AND REPLACE LH FRONT STEERING DAMPER. REPLACE RH REAR LOWER STOP LIGHT GLOBE.	Y
09/11/2022 499207	SHEPHERD, GLENN	ENGINE AND ACTUACE LITHOUT STEELING CONTINUE ACTUACES. ACTUACE OF THE BLOCK. ENGINE AND ELEMENT INTER PIPE HAD BROKEN OUT OF REAR ENGINE BAY PROOF PANEL. REVIEWED PIPE BACK INTO PANEL.	Y
15/09/2022 497306	DAVIS, KANE	REPLACE BLOWN RH REAR TAIL LIGHT/ STOP LIGHT. TEST OKAY.	Υ
., ,	DAVIS, KANE	REPLACE IH TOP TAIL LIGHT LENS. REPLACE TOP REAR RH INDICATOR LENS AND REPLACE RUSTED AND BROKEN SCREWS. WASH OUT ALL TOP LENS AND TEST OKAY. REMOVE AND REPLACE RH INSIDE REAR EMERGENCY EXIT LED LIGHT. REMOVE AND REPLACE TOP IH FRONT LED CLEARANCE LIGHT.	Υ
14/06/2022 493871 01/06/2022 493214		REPLACE BLOWN GLOBE IN RH REAR TAIL LIGHT. TEST OKAY. REMOVE AND REPLACE RH STEERING TIE ROD END. GLUE NEW VINYL OVER TORN BITS INSIDE BUS IN BETWEEN SIDE WINDOWS. FIT NEW INSIDE RH REAR EMERGENCY EXIT DECAL. ORDER NEW STEERING DRAG LINK. TEST DRIVE AND RETENSION WHEEL NUTS.	Y
18/05/2022 493214		REMOVE AND REPLACE AND SECRIFICAL TO SECRIFICATION TRAIL PIECE AND REPLACE AND REPLACE AND RELEASED THE NOTION TRAIL PIECE AND RELEASED TO WHITE OVER TORN OF IS INSIDE BUS IN BETWEEN SIDE WINDOWS. FIT IN EVEN INSIDE AN REPLACE AND SECRIFICATION TRAIL PIECE AND REPLACE AND REPLACE.	Y
26/04/2022 490839	DAVIS, KANE	BLOW OUT AND WASH OUT RADIATOR AND INTERCOOLER. CLEAN OFF ENGINE AND AROUND REAR CHASSIS.	Υ
	DAVIS, KANE	CLEAN OUT WIPER WASHER SYSTEM. REPLACE WASHER PUMP. REPLACE RUBBER ON RADIATOR HOSE HOLDING CLAMPS.	Υ
	DAVIS, KANE DAVIS, KANE	REPLACE LOW AIR SENSOR ON REAR AIR TANK. TEST OKAY. HARD WIRE FAN CLUTCH TO STAY IN ALL THE TIME.	Y
19/10/2021 482332		REPAIR FRONT BUMPER DAMAGE FROM WALABY GRIND BACK RHS BAR FIBRE GLASS AND SHAPE BAR PRIME AND PAINT	Y
08/09/2021 480290	DAVIS, KANE	REMOVE AND REPLACE BOTH BATTERIES.	Υ
08/09/2021 480290	DAVIS, KANE	NEW ECU FITTED TO TRANSMISSION BY BEN WEIR FROM ZF. TEST DRIVE AND TEST ALL OKAY.	Υ
01/09/2021 480173 06/08/2021 478404	DAVIS, KANE DAVIS, KANE	DROPPING OUT OF GEAR. CLEAN AUTO ECU PLUGS IN ELECTRICAL BOX AND TIDY UP WIRING LOOM. TEST DRIVE AND DIDN'T FAULT. REMOVE AND REPLACE LH TIE ROD END. TEST DRIVE AND RETENSION WHEELNUTS.	Y
	JOHNSTONE, ROB	REPUISE AND REPUISE OF THE ROU END. LEST DAIVE AND RELEVISION WREELINGS. REPUISE THE REAR TRACK ROOD BUSHES BOTH UPPER AND LOWER ROOS. TRAVEL TO COLAC TO USE THEIR PRESS.	Y
27/05/2021 475879		REPLACE THE THERMOSTATS LOOKING FOR HEATING ISSUE.	Υ
	JOHNSTONE, ROB	REMOVE O/S REAR WHEELS, REGROOVE INNER TYRE AND REFIT. TENSION WHEELS.	Υ
	JOHNSTONE, ROB JOHNSTONE, ROB	REPLACE THE HEADER TANK AND ADD NEW COOLANT TO TOP UP. REPLACE THE BATTERY ISOLATOR. FIT NEW AIR BAGS ALL ROUND. FIT NEW INNER AND OUT AIR CLEANER.	Y
08/12/2020 468733	JOHNSTONE, NOD	INSTANT WIND: HAVE NEW SCREEN FITTED	N.
	JOHNSTONE, ROB	REMOVE THE DOOR LOCK STOPPER AND FILE DOWN TO ALLOW THE LOCK TO WORK.	Υ
28/10/2020 467737		REMOVE AND REFIT THE N/S REAR BRAKE BOOSTER. TAKE BOOSTER TO ABS AND HAVE A NEW DIPHRAM FITTED TO THE BOOSTER.	Υ
27/10/2020 467737 11/08/2020 467667	JOHNSTONE, ROB	HAVE BEN WARE ATTEND BUS, FOUND FAULT IN THE ECU, HAVE SAM RESOLDER POOR CONTACTS AT THE CIRCUIT BOARD. CLEAN ALL EARTHS AND CHECK WIRING, RUN TO TEST. ANDREW REATTACHED THE LOOSE SEAT BASE. N/S WINDOW REAR SEAT.	Y V
	JOHNSTONE, ROB	REPLACE THE OS REVERSE LIGHT GLOBE.	Y
	JOHNSTONE, ROB	REPLACED THE NS HEALDLIGHT GLOBE AS IT HAD EXPLODED TAINTING THE REFLECTOR AND LENSE.	Υ
19/11/2019 459844		COLD TREAD (IN N/S REAR TYRES REQUIRE REPLACEMENT. TOURTH AGO PRINTED THE PROPERTY OF THE PRO	Y
11/10/2019 456017 08/10/2019 455741		TIGHTEN LOOSE BLIND, ATTACH O/S FRONT SCHOOL LIGHT TO WINDSCREEN, REPLACE BOTH MIRRORS WITH HEATED MIRRORS AND HOOK UP, REPLACE THE WATER SEPERATOR FUEL FILTER. REPLACE THE O/S TOP TAIL LIGHT ASSEMBLY. REVERSE BEEPER NOT OPERATING, REPLACE WITH NEW, REAR TAIL LIGHTS FULL OF DIRT, REMOVE THE LENSES AND CLEAN OUT DIRT.	Y
07/10/2019 455636	JOHNSTONE, ROB	O/S REAR MUD FLAP TEARING AWAY. REMOVE MUD FLAP AND CUT THE TOP INCH OFF, REDRILL HOLES AND THEN REFIT.	Y
, ,	JOHNSTONE, ROB	REPLACE THE O/S FRONT PARK LIGHT GLOBE, FIX A POOR CONTACT IN THE N/S REAR CLEARENCE LIGHT.	Υ
22/07/2019 448922		REPLACE THE O/S HEAD LIGHT GLOBE AND CLEAN UP THE DAMAGE FROM BEING HIT BY A CAR. STARTER MOTOR NOT ENGAGING CORRECTLY, REMOVED THE STARTER MOTOR TO INSPECT. FOUND SHAFT WORN AND THE GEAR DAMAGED. REPLACE WITH NEW STARTER MOTOR.	Y
	JOHNSTONE, ROB	SHARLER WOLDON ON WHILE DRIVING. FOUND THE ALTERNATORS TO HAVE FAILED, REPLACED BOTH OF THEM. I ALSO CHECKED THE WIRING, CLEANED THE BATTERY TERMINALS, CLEANED THE TERMINALS AT THE ISOLATOR. I ADDED CONDIT TO THE ALTERNATOR WIRES AND INSULATED WIRES THAT HAD BEEN RUB	ı IY
	JOHNSTONE, ROB	NS LOW BEAM HEADLIGHT NOT WORKING UNLESS TAPPED. REPLACE THE GLOBE.	Υ
	JOHNSTONE, ROB	COOLANT LEAKING FROM THE THERMOSTAT HOUSING ABOVE THE WATER PUMP. LOOSENED THE HOSE CLAMPS AND LUBRICATED THEM BEFORE RETIGHTENING THEM. WILL MONITOR. REMOVE THE LH REAR SEAT BELT AND CLEAN TO ALLOW IT TO RETRACT AGAIN. REMOVE THE DASH AND SWAP THE GLOBES TO HAVING TIL	Y
01/05/2019 441858 30/04/2019 441685	JOHNSTONE, ROB JOHNSTONE, ROB	REPLACE ALL OF THE TEMP LIGHTS TO HAVE THEM THE SAME AMPERAGE, WHEN THE HEAD LIGHTS ARE ON IN THE MORNING THE HEAT WARNING LIGHT FLASHES WITH A BUZZER, THIS HAS ONLY HAPPENED SINCE THE BLUE GLOBE WAS REPLACED. REPLACE THE STERNING DAMPERS AND TIGHTEN THE LODGE COUNIEN GOSE ON THE RIGHT HAND SIDE OF THE ENGINE.	Y
08/04/2019 441074		GAVIN FITTED MISSING SCREWS IN REAR SEATS, ARRANGED FOR THE RH OUTER CUSHION TO BE STITCHED, REPLACED A SEATBELT THAT WAS TO LONG. I TESTED THE WARING LAMP FOR THE ENGINE THAT WHEN THE HEADLIGHTS ARE ON COMES ON, TURNING THE HEAD LIGHTS OFF FIXES THE PROBLEM.	Y
20/03/2019 439463	JOHNSTONE, ROB	REPLACE BLOWN DASH GLOBES, TIGHTEN THE FAN BELTS FOR THE AC COMPRESSOR. THERE WERE A NUMBER OFF LOOSE BOLTS IN THE ENGINE BAY, 1 FOR THE FAN LOCK UP, 1 FOR THE TENSIONER FOR THE FAN BELT.	Υ
20/12/2018 434334	-, - , ,	CHANGE COOLANT ADD INHIBITOR	Υ
23/10/2018 428307 14/09/2018 424832	KING, GAVIN (T) SHEPHERD, GLENN	CHECK WATTER LOSS. LEAKING AT WATTER PUMP REPLACE WATTER PUMP CHECK WINTER IN FIVE BOX LEARN FLEX AND PUSE CONNECTIONS REPLACE RELAY CHECK GEAR SELECTOR AND REPLACE GLOBE CHECK EARTHS ALL OK	Y
11/09/2018 424832		REPAIR WITH NEW GLOBE - BURSONS 537.18	Y
24/08/2018 422210	SHEPHERD, GLENN	REMOVE DRYER FILTER AND DISMANTLE VALVE BODY FIND METAL REMOVE METAL PIECES FROM VALVE REMOVE COMPRESSOR REKIT HEAD ASSEMBLY REFIT (KIT FROM ABS EQUIP) REPLACE DRYER ASSEMBLY (ABS EQUIP) REMOVE MUFFLER ASSEMBLY AND REPLACE ALL 4 MOUNTS	Υ
20/07/2018 420115		REPLACE RH SIDE BLINKER GLOBE REPAIR LH REAR MUD FLAP	Y
24/04/2018 412116 05/02/2018 405857		REPLACE INNER & OUTER AIR FILTER ELEMENTS FIT 2 NEW BATTERYS SUPPLIED BY R&J BATTERYS SN 150 \$537.94 INC	T Y
01/12/2017 403371		RI & RAN ASS & WELD UP LOCK TABS HIT NEW HEATER HOSES FROM REAR OF DIFF TO ENGINE FLUSH COOLING SYSTEM & ADD COOLANT REMOUNT FRONT MUD FLAPS REPAIR DASH LIGHTS REPLACE LH WIPER INSERT FIT UHF RADIO GLUE FLOOR RH REAR	Y
13/11/2017 402060	KING, GAVIN (T)	REPLACE AIR BRAKE DRIER FILTER	Υ
	KING, GAVIN (T)	FIT 2 FRONT VERTICAL SWAY 9A RUNNS AND FAS EVERY METALONING METALON CERCITATION OF THE PROPERTY OF THE PROPERT	Y
23/08/2016 363701 01/08/2016 362369		AIR LEAK FIXED WITH JOINER IN STOCK CHECK REAR SCHOOL LIGHTS OUT FOUND 2 BLOWN GLOBES REPLACE GLOBES & TEST OK 899-912-5 X2 GLOBES	Y Y
18/01/2016 347389		FIT NEW STEERING SHAFT	Υ
09/09/2015 338104	KING, GAVIN (T)	FITTED 2 NEW FAN BELTS & FREE UP IDLER PULLEY PIVOT	Υ
15/08/2014 283654	KING CALLET	22 DEGREES CE INSPECT UNIT FOR NOT COOLING, FOUND NO GAS IN SYSTEM. PRESSURE TEST UNIT AND LOCATE LEAK AT SHAFT SEAL UNIT HAS HAD 2 PREVIOUS SEALS REPLACEMENTS, RECOMMEND COMPRESSOR CHANGE. RETURN TO UNIT REMOVE AND REPLACE COMPRESSOR USING BOCK TO BITZER. CHANGE DRIES.	Y
10/04/2013 254010 07/04/2011	KING, GAVIN (T) KING, GAVIN (T)	FIT STEERING SHAFT 'U' JOINT STEERING BOX END REPLACE LH WHEEL HUB AND SEAL AND 2 RIMS. FIT NEW W/STUDS - NUTS. HAVE SUSP COMPUTER REPAIRED	Y
	KING, GAVIN (T)	DIFF REPLACED AT MIBENZ. NEW WATER LIFT PUMP FOR AC SYSTEM	Υ
01/09/2006	KING, GAVIN (T)	DIFF REMOVED AND CHECKED AT M/B	Υ