

ADAPT-A-LIFT GROUP PTY LTD

Service History Listing Active Units

Date: 19/06/2026

Time: 11:29:14AM

For Equipment Code From: H10532 To: H10532

For Customer Code From: All To: All

For Date Posted From: All To: All

For Branch Code From: All To: All

Don't Show Cost

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001 Equip. Code: H10532 Description: HYSTER H2.5FT Make: HYSTER Model: H2.5FT Serial No.: L177B40898M							
1831213	Prep for auction	ODEMERIN	10/06/2026	Internal	6449.0	\$0.00	Refit Battery to unit, Refit ancillary items, Carry out Inspection and Diagnosis of Attachment Carry out Inspection and Diagnosis of Electrical System Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, Remove Fleet Management System as required, Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Installed new battery (missed) Diagnosed machine doesn't turn on., found some wiring disconnected and missed. Disconnected fork track. Machine prep for auction.
1677381	Dehire Inspection - Check for damages	901QUOTE02	2/12/2024	Internal	6430.0	\$0.00	Carry out equipment condition assessment unit returned without 1800mm slippers. unit at seven hills
1670771	Scheduled Service Job. Hyster L177_0500Hr SvKit_LPG_Maz_H2.0-3.5FT. 0500 Hour Service	RLE	7/11/2024	Internal	6429.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Located unit.Waited for parts.Carry out 500 hr service.Drained and refilled the engine.Removed and replaced engine oil filter.Checked all fluid levels.Greased the whole unit. Measure the chain wear at 1%. Adjust Lift Chain to correct specification, Steam clean equipment as necessary. Lube the chain and was the unit.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H10532		Description: HYSTER H2.5FT					
Make: HYSTER		Model: H2.5FT		Serial No.: L177B40898M			
1668236	Prep for STR - Circus	RLE	28/10/2024	Internal	6429.0	\$0.00	<p>Prepare For Hire - Workshop</p> <p>Carry out Inspection and Diagnosis of Attachment</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>Carry out Inspection and Diagnosis of Mast/Carriage</p> <p>Adjust Lift Chain to correct specification,</p> <p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p> <p>Steam clean equipment as necessary.</p>
1667493	STR IC - Green tag inspection	BAQUILINA	24/10/2024	Internal	6428.0	\$0.00	<p>Carry out gren tag inspection. To AALG agree works.</p> <p>Carry out equipment condition assessment</p> <p>Steam clean equipment as necessary.</p> <p>Inspection of unit, testing and clean, prep unit for hire and acquire attatchment details for load rating plate as requested, severe vibrations from engine idle causing loud rattle noise on overhead gaurd/roof making repairs to dampen noise.</p>
1666944	RENTAL RETURN - CHECK FOR DAMAGES	MSEGHABI	23/10/2024	Internal	6428.0	\$0.00	<p>Carry out equipment condition assessment</p> <p>good</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H10532		Description: HYSTER H2.5FT					
Make: HYSTER		Model: H2.5FT		Serial No.: L177B40898M			
1661761	STR IC Green Tag	AMARONEY	3/10/2024	Internal	6426.0	\$0.00	<p>Carry out equipment condition assessment</p> <p>Steam clean equipment as necessary.</p> <p>Repair Seat as necessary,</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>Replace Stickers,</p> <p>Inspect and test unit/ functions.</p> <p>Clean unit (very dirty)</p> <p>Repair Seat</p> <p>Repair roof rattle</p> <p>Repair mud guards</p> <p>Repair steering wheel</p> <p>waiting hose change</p> <p>Change stickers</p>
1657658	RENTAL RETURN - CHECK FOR DAMAGES	MSEGHABI	18/09/2024	Internal	6425.0	\$0.00	<p>Replace Hydraulic Hose/s and ancillary items,</p> <p>Carry out equipment condition assessment</p>
1600942	Scheduled Service - KM IC 1000hr SM - 7000hrs .1000 Hour Service	ALI	14/06/2024	Internal	6258.0	\$0.00	<p>no damage</p> <p>Labour</p> <p>pick up kit in DP.</p> <p>Carry out equipment condition assessment</p> <p>excessive travel, walk around , search unit. wait for accessing in wh3 (in meeting). move unit to work area. then burst a lift hose.. tag out. notify pavalika. nearly worn out 2 drive tyres.</p> <p>1000hr Service</p> <p>after cleaning oil leak. find out wrong kit again. will return wrong parts. waiting for hoseman.</p> <p>Travel to site,</p> <p>travel to site via traffic. locate unit. complaint none.. cause sm. correction report.</p>
1631983	FW 1600942 nearly worn out 2 drive tyres.	SUBC-RNT20101	13/06/2024	Internal	6257.0	\$0.00	
1631979	URGENT 1600942 Need replacing a lift hose	REASTWOOD	13/06/2024	Internal	6257.0	\$0.00	<p>Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,</p> <p>Replace Hydraulic Hose/s and ancillary items,</p> <p>assist pirtek with replacing hyd hose.</p> <p>test unit function all good.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H10532		Description: HYSTER H2.5FT					
Make: HYSTER		Model: H2.5FT		Serial No.: L177B40898M			
1631854	Oil Leak Inspection	ALI	13/06/2024	Internal	6257.0	\$0.00	Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, main lift hose burst out when lift to fully height. clean oil mess.notify pavalika to send pirtek. tag out unit. Travel to site,
1622060	Unit will not start - has gone thru all pre-checks - maybe battery. Pkt 745155	REASTWOOD	9/05/2024	Internal	6185.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System Replace Starter Motor, Travel to site,locate unit & safe work area. complaint: Unit will not start - has gone thru all pre-checks - maybe battery. Pkt 745155 cause: starter motor correction: investigate no start starter motor clicks. check battery voltage. 12.7V check wires to starter, check engine wasnt siezed. remove starter. bench test - not working. use van stock, replace starter test unit starts.
1563532	Scheduled Service - TC IC 500HR SM - 6500hrs .0500 Hour Service	SMCALLISTER	21/09/2023	Internal	5747.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. locate unitt move to safe area complaint 500hr service correction carry out 500hr service as per service matrix lube & greace unit carry out safety & function checks Carry out Inspection and Diagnosis of Electrical System
1560176	Decelerates and accelerates frequently, etkt 516360	SMCALLISTER	30/08/2023	Internal	5706.0	\$0.00	travel to site locate unit move to safe area complaint Decelerates and accelerates frequently, correction carry out inspection & test on unit no fault found
1514044	Scheduled Service - KM IC 2000hr SM - 6000hrs .2000 Hour Service	SMCALLISTER	24/04/2023	Internal	5456.0	\$0.00	2000hr Service LOCATE UNUT MOVE TO SAFE AREA COMPLAINT 2000HR SERVICE CORRECTION CARRY OUT 2000HR SRECIVE AS PER SERVICE MATRIX WITH PARTS AVAILABLE. GREASE AND LUBE UNIT CARRY OUT SAFETY AND FUNCTION CHECKS CHAINE AND TYNES WITH IN LIMIT

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H10532		Description: HYSTER H2.5FT					
Make: HYSTER		Model: H2.5FT		Serial No.: L177B40898M			
1483400	Not completed, customer cannot locate unit on Site at Port Botany - Scheduled Service - KM IC 1000hr SM - 5000hrs .1000 Hour Service	AMADDOX	16/10/2022	Internal	4840.0	\$0.00	Travel to site, Carry out equipment condition assessment could not locate unit.
1461878	The unit won't start, it has lights but won't tick over. Tagged Out. ETKT-162151	DMackay	30/06/2022	Internal	4840.0	\$0.00	customer could not find unit again Travel to site, Carry out equipment condition assessment Carry out Inspection and Diagnosis of Electrical System Replace Battery, Travel to site & complete induction to gain boomgate entry. Phone onsite contact & meet up. Locate machine & assess - battery failed load test (dropped to 7V) so renewed. Starts good now so checked charge rate (13.9V is good) starter current draw & alternator belt tension - both ok. REPAIRS REQUIRED: -Some hydraulic hoses outer rubber layer peeling off Labour
1444114	PARTS ORDERED FOR AZ - 13/4 Replace Tynes, Both Lower Side Panels	AZMODA	5/05/2022	External	4743.0	\$880.22	Replace Forks/Tynes, Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Pickmup parts / workshop - return to site . As per quote / remove and place tynes / remove amd replace side damaged side panels / straighten mounting brackets / refit LPG compliance plate to new right hand side panel . ATTEND SITE AND LOCATE MACHINE. CLEAN AND TEST MACHINE AND NO LEAK FOUND THEN ADVISED ALREADY FIXED.
1443971	Have side shift hoses replaced (carriage and across free lift cylinder fatiged hoses interal repair .	201SUBC	8/04/2022	Internal	4939.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H10532		Description: HYSTER H2.5FT					
Make: HYSTER		Model: H2.5FT		Serial No.: L177B40898M			
1424982	KIT ORDERED AZ - Scheduled Service - 500hr SM - 4500hrs .0500 Hour Service	AZMODA	7/04/2022	Internal	4939.0	\$0.00	Travel to site, Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Travel to warehouse - Locate unit / locate safe area to work (rain making it difficult to find suitable service area . Carry out 500hr service / clean unit / adjust brakes / general inspection . Note :- heels of tynes worn - 1070mm x 120mm x 40mm Class 2 . both lower side panels damaged - Right hand side panel 1527946. Left hand side panel 1527940 (LPG) Please quote . # Further work - have side shift hoses replaced (carriage and across free lift cylinder) see attached photo's - Sub contractor / Pirtek , fatigued hoses interal repair . Carry out Inspection and Diagnosis of Electrical System
1437153	The unit has a seatbelt issue, the whole seatbelt has to be changed.	AZMODA	9/03/2022	Internal	4614.0	\$0.00	Faulty seat belt assembly , Belt housing (will not draw out) - Cause :- detent failure . Correction :- Replace belt assembly with spare (old stock) . Travel to site, Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, travelled to site checked hydro leak found side shift cylinder leaking removed cylinder removed end cap replaced oring refitted cap refitted cylinder tested unit
1406944	Hydraulic leak at the front of the unit. Tagged out.	NCLARKE	11/10/2021	Internal	4249.0	\$0.00	
1399284	Replace Mud Guards	901QUOTE SENT01	15/09/2021	External	4093.0	\$0.00	
1401395	FW - 1401168 - Unit requires steer tyres / 600-9 non marking	201QUOTE	10/09/2021	Internal	4152.0	\$0.00	
1401168	This unit will not start	AZMODA	10/09/2021	Internal	4152.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System Replace Starter Motor, Customer reports that unit will not start - Cause :- starter motor - Correction :- carry out diagnoses / remove and replace starter motor - check operation . # Note - have emailed spare parts for muffler assembly and attaching parts (still waiting on parts) job number 1397253 . Unit requires steer tyres / 600-9 non marking - see attached photo's

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H10532		Description: HYSTER H2.5FT					
Make: HYSTER		Model: H2.5FT		Serial No.: L177B40898M			
1397253	Muffler to be replaced	AZMODA	20/08/2021	Internal	4248.0	\$0.00	<p>Carry out equipment condition assessment</p> <p>Order new muffler (1x) 4613003 and (4x) insulators 1650766 . Requires (3x) vibration mounts for LPG convertor</p> <p>Labour</p> <p>Replace Muffler,</p> <p>Arrange additional parts for muffler repair .</p> <p>Travel to site,</p> <p>Remove ancillary items and Counterweight,</p> <p>Refit Counterweight and ancillary items,</p> <p>Repair LPG Convertor as necessary,</p> <p>Travel to site - locate unit and safe working area - remove counterweight and replace muffler / burnt out / replace LPG vibration dampeners . General inspection . # Note :- steer tyres required 600-9 non marking / have reported once before . - see attached photo's .</p> <p>Labour</p>
1387182	Scheduled Service - 4000hr SM - 4000hrs .4000 Hour Service	AZMODA	20/08/2021	Internal	4093.0	\$0.00	<p>Pick up service kit at drop point - return to site - incorrect service kit / check unit and taken photo's of engine (LPG) notify spare parts and correct issue .</p> <p>Travel to site,</p> <p>4000hr Service,</p> <p>Carry out equipment condition assessment</p> <p>Complete 4000hr service / clean unit . # Note :- Further work- Requires steer tyres , 600-9 non marking .</p> <p>Customer Repair - both mud guards damaged (2x) 2069008 . # see attached photo's .</p> <p>1000hr Service</p>
1353264	KIT ORDERED - Scheduled Service - 1000 Hour Service .1000 Hour Service	AZMODA	22/01/2021	Internal	3629.0	\$0.00	<p>Locate unit (difficult to locate) - Carry out 1000hr service and clean unit . General inspection . Note :- have reported that unit requires muffler and mounting rubber pads .</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H10532		Description: HYSTER H2.5FT					
Make: HYSTER		Model: H2.5FT		Serial No.: L177B40898M			
1353239	Seat Sensor is faulty Located Gate B53 warehouse 3. SF EMAIL	AZMODA	21/01/2021	Internal	3614.0	\$0.00	Travel to site, Carry out Inspection and Diagnosis of Electrical System Repair Seat as necessary, Repair Hydraulic Hose/s as necessary, Travel to site - stop off at drop point / Padstow pick up parts . Locate unot at shed four Customer reports that has issue with seat switch (lose of drive) Cause:- intermittent fault . Correction :- Carry out diagnostics - Site contact :- 0450009270 Jason .Hannon . Found fault to be seat buckle / replace seat belt assembly and test unit . Inspect unit / attachment hoses have come off - lower clamp fallen apart (repair and readjust hoses) Note :- muffler has cracked at right hand mounting bracket - requires new muffler assembly and replace rubber mountings pads (full set)
1325423	H10532 - slow to lower attachment	PUMINYAD	8/09/2020	Internal	3374.0	\$0.00	Repair Attachment as necessary, Calibrate lift and lower9ng fuction.
1324144	PREP UNIT FOR HIRE TO ACFS	CALABA	1/09/2020	Internal	3361.0	\$0.00	
1293398	prep for hire	SMALONISIO	24/04/2020	Internal	3361.0	\$0.00	Prepare For Hire - Workshop
1260714	green tag inspection	MLUMAY	3/12/2019	Internal	3361.0	\$0.00	Finding this machine all over the yard two times, couldn't found. Carry out equipment condition assessment Steam clean equipment as necessary. Remove ancillary items, prepare and Paint unit as required, Prepare For Hire - Workshop Replace Seat, Grease All Points on Unit, Replaced seat base Replaced bonnet cylinder strut Prep for hire touch up paint

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H10532		Description: HYSTER H2.5FT					
Make: HYSTER		Model: H2.5FT		Serial No.: L177B40898M			
1196391	Scheduled Service - 0500 Hour (Service HD2-3.5FT). 0500 Hour Service	MLAM	2/05/2019	Internal	3162.0	\$0.00	Scheduled Service - Travel to site, Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Traveled to drop point, Pick up parcels, Travel to site, Wait for security to open door, Organise work area, Carry out 500hr service, Recheck tynes next service - wear on bottom due to dragging, Rear muffler cracked on bracket side, Rear tyres getting close to wear marks - still legal, Note: minor cracking on hydraulic hoses, Return unit, Find authorised signature, Neville offsite, Took signature from Chris Newton from toll office in the same building.
1154142	Scheduled Service - 1000 Hour (Service HD2-3.5FT). 1000 Hour Service	GSTARK	18/10/2018	Internal	2877.0	\$0.00	Scheduled Service - Travel to site, 1000hr Service
1131818	Check Forktrack connectivity - last connection as of 16/07/18 was: 13/07/2018 Checklist: ON Flagged Reason: Impact	GSTARK	25/07/2018	Internal	2815.0	\$0.00	carried out 1000hr service. hyd hoses on mast cracked. Check Forktrack connectivity - last connection as of 16/07/18 was: 13/07/2018 Checklist: ON Flagged Reason: Impact Travel to site, Carry out Inspection and Diagnosis of Telemetry System
1109649	Scheduled Service - 500hr IC 500hr IC. Level B Service	SCOLEIRO	9/05/2018	Internal	2650.0	\$0.00	checked fork track unit. saying it connected today. checked unit is connecting. spoke to fork track connecting fine Scheduled Service - 500hr IC Travel to site, Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. SC 11/5 -travel to site, wait for contact to open and sign in, setup safe work area -carry out 500hr service

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H10532		Description: HYSTER H2.5FT					
Make: HYSTER		Model: H2.5FT		Serial No.: L177B40898M			
1108106	CCA hydraulic hosing inspection FT model	SCOLEIRO	3/05/2018	Internal	2637.0	\$0.00	CCA hydraulic hosing inspection FT model Carry out equipment condition assessment Travel to site, SC 4/5 -travel to site, sign in at reception, organise to view unit -carried out Hydraulic Hose Inspection and Report as per 021 Product Technical Support Bulletin -attached photo of inspection form to job card
1068145	Forklift not starting at all. Site contact Neville 0409 573 797	GBANKS	29/11/2017	Internal	2395.0	\$0.00	Forklift not starting at all. Site contact Neville 0409 573 797 Carry out Inspection and Diagnosis of Electrical System Remove ancillary items and Remove Battery from unit and Inspect and report, Replace Battery, DIAGNOSIS UNIT,JUMP START ,CHECK CHARGE RATE. REMOVE & REPLACE BATTERY.CHECK UNIT.GB30/11/17.
1061853	Scheduled Service - 1000hrs	GBANKS	7/11/2017	Internal	2369.0	\$0.00	Scheduled Service - 1000hrs Travel to site, 1000hr Service Bleed cooling system and remove air locks
1016350	Scheduled Service	ALI	16/05/2017	Internal	2122.0	\$0.00	CARRY OUT PM SERVICE,PRESSURE TEST COOLING SYSTEM FOR WATER LEAK.GB10/11/17. Scheduled Service NEVILLE - 0409 573 797 Travel to site, Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. top up cooling system

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H10532		Description: HYSTER H2.5FT					
Make: HYSTER		Model: H2.5FT		Serial No.: L177B40898M			
985753	KW - ForkTrack 2G Modem Swap Unit Located: Coca Cola Alexandria 1-3 Burrows Rd ALEXANDRIA NSW 1435	PWEBSTER	13/01/2017	External	1929.0	\$512.75	KW - ForkTrack 2G Modem Swap Unit Located: Coca Cola Alexandria 1-3 Burrows Rd ALEXANDRIA NSW 1435 Travel to site, Repair Fleet Management System as required, Files where very old so it took over an hour to complete the download. Force connect was a very long process as the aerial connection had an intermittent fault. Extra time was needed !!
952609	RML - LOOSE HYDRAULIC FITTING LEAKING V - 0409573797 CALLED BJ TO INSPECT POSS WARRANTY	201SUBC	9/09/2016	Internal	1443.0	\$0.00	RML - LOOSE HYDRAULIC FITTING LEAKING V - 0409573797 CALLED BJ TO INSPECT POSS WARRANTY
946330	KW - HYD HOSE BLOWN NEVILLE - 0409 573 797	201SUBC	18/08/2016	Internal	1443.0	\$0.00	KW - HYD HOSE BLOWN NEVILLE - 0409 573 797 18/08- Organised BJ Hydraulics
911434	LM- Scheduled Service	TCONDITISI	15/04/2016	Internal	1443.0	\$0.00	R & R 1 BLOWN HOSE. LM- Scheduled Service Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
895392	LM- NO POWER- BEN- 0400 488 471	TCONDITISI	17/02/2016	Internal	1328.0	\$0.00	LM- NO POWER- BEN- 0400 488 471 Carry out Check Over of unit in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
872436	RML- UNIT CUTS OUT WHEN MACHINE IN USE (SEAT BELT DOES NOT RECOGNISE)	TCONDITISI	19/11/2015	Internal	1150.0	\$0.00	RML- UNIT CUTS OUT WHEN MACHINE IN USE (SEAT BELT DOES NOT RECOGNISE) Check/Inspect/Diagnose Seat,
858014	LM- Scheduled Service- from EDFs	NCLARKE	28/09/2015	Internal	1057.0	\$0.00	Repair Seat as necessary, LM- Scheduled Service- from EDFs Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H10532		Description: HYSTER H2.5FT					
Make: HYSTER		Model: H2.5FT		Serial No.: L177B40898M			
783792	Scheduled Service	TCONDITISI	11/12/2014	Internal	415.0	\$0.00	Scheduled Service
750544	Gas bottle doesn't seem to seal 100%- Neville, 0409573797	DSAY	7/08/2014	Internal	151.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Gas bottle doesn't seem to seal 100%- Neville, 0409573797
749955	Gas smell - Neville, 0409 573 797	SPETERSON	5/08/2014	Internal	142.0	\$0.00	Check/Inspect/Diagnose LPG Bottle, check and test gas bottle and coupling, change seals refit test ok Gas smell - Neville, 0409 573 797
732102	Modify Load Guard	201WORKSHOP	2/06/2014	Internal	0.0	\$0.00	Remove ancillary items and Repair Gas Leak as necessary, Refit ancillary items, Modify Load Guard
731148	Check Over Unit being delivered to site. Loadgaurd requires to be cut down. Contact - Neville Dixon	STSIANDARL	28/05/2014	Internal	54.0	\$0.00	Check Over Unit being delivered to site. Loadgaurd requires to be cut down. Contact - Neville Dixon
647866	Prep for Hire (Alexandria) CCA	201WORKSHOP	25/07/2013	Cap Prep	0.0	\$0.00	Check/Inspect/Diagnose Fleet Management System and test operation, Check/Inspect/Diagnose Load Guard, Replace Load Guard, go pick up loadgaurd and fit . ForkTrack Full Reporting Bissalloy 400 Tyne Heel Plate Transport to and from site Lexan Roof
Equipment Total:						\$1,392.97	
Customer Total:						\$1,392.97	