

ADAPT-A-LIFT GROUP PTY LTD

Service History Listing Active Units

Date: 19/06/2026

Time: 11:05:09AM

For Equipment Code From: H11103 To: H11103

For Customer Code From: All To: All

For Date Posted From: All To: All

For Branch Code From: All To: All

Don't Show Cost

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|---|---|------------|--------------------------------|----------|----------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H11103 | | Description: HYSTER H3.5TX Diesel Forklift | | | | | |
| Make: HYSTER | | Model: H3.5TX | | Serial No.: B466R13633L | | | |
| 1825221 | Prep for Auction | NWILLIAMS | 12/05/2026 | Internal | 4384.0 | \$0.00 | Carry out equipment condition assessment Steam clean equipment as necessary. test units Hydraulic functions chekced fluid levels and topped up coolant Pressure washed unit |
| 1810190 | UE Photoshoot - Steam clean and retake photos | 201WORKSHOP | 17/03/2026 | Cap Prep | 4384.0 | \$500.00 | |
| 1768422 | advertise online - used | DDEJESUS | 1/12/2025 | Internal | 4384.0 | \$0.00 | Carry out equipment condition assessment Steam clean equipment as necessary. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|---|------------|--------------------------------|----------|--------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H11103 | | Description: HYSTER H3.5TX Diesel Forklift | | | | | |
| Make: HYSTER | | Model: H3.5TX | | Serial No.: B466R13633L | | | |
| 1720299 | Green Tag | ODEMERIN | 26/05/2025 | Internal | 4383.0 | \$0.00 | <p>Carry out equipment condition assessment</p> <p>Steam clean equipment as necessary.</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Replace Visual display unit,</p> <p>Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,</p> <p>Remove ancillary items and Remove Drive Wheel from unit,</p> <p>Refit Drive Wheel, Refit ancillary items,</p> <p>Adjust Switch/es</p> <p>Remove ancillary items, prepare and Paint unit as required,</p> <p>Repair Hard Labels,</p> <p>Prepare For Hire - Workshop</p> <p>Carry out machine assessment condition. Swap tyre worn out to the used machine.(front and rear both side) Swap display monitor to the used machine. diagnosed the machine horn not working, found the switch and relay broken.(fixed) Removed cement sticky onthe frame of the machine. Removed load rating plate blurred, cleaned and reinstalled. Cleaned the machine and prep for hire.</p> |
| 1702167 | Scheduled Service - BB IC 1000HR SM .1000 Hour Service | MLUMAY | 1/04/2025 | Internal | 7549.0 | \$0.00 | <p>Travel to site, 1000hr Service Travel to site Locate machine Carry out equipment condition and assessment Performed 1000 hours service maintenance Replace all parts supplied on this job Lubricate and greased machine Replace busted lh working lamp bulb Test run machibe and all function</p> <p>NOTE ; Load rating plate not visible blurry subject for replacement see images taken</p> |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|---|------------|--------------------------------|----------|--------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H11103 | | Description: HYSTER H3.5TX Diesel Forklift | | | | | |
| Make: HYSTER | | Model: H3.5TX | | Serial No.: B466R13633L | | | |
| 1675588 | CANCELLED - Replace Broken wiring harness on trail sensor | 901QUOTE SENT01 | 25/11/2024 | External | 7356.0 | \$0.00 | |
| 1672930 | Please see photos of attached leak. etkt # 936486 | System Planning | 14/11/2024 | Internal | 7356.0 | \$0.00 | Technician notes: Arrived onsite. Identified leak from hose on side shift cylinder. Removed hose and made new same as sample. . Test machine tested okay. Checked oil. Cleaned up left site |
| 1671502 | will not start - Etkk 930633 ** URGENT ** | SUBC-RTL20101 | 8/11/2024 | Internal | 7356.0 | \$0.00 | Travel to site, Carry out equipment condition assessment Travel to site Carry out equipment condition and assessment Complaint - Machine not starting Causes - Faulty starter motor Correction - Need to replace starter motor assembly Unit is not operational Need to ring parts on monday morning to replace starter motor when have a stock on TVH Labour Replace Starter Motor, Repair Starter Circuit as required, Travel to site Carry out equipment condition and assessment Removed stater motor assembly Travel to pick up,parts to TVH Refit new stater Test machine Unit is operational |
| 1661896 | FW 1657557 Found error code 0019 Defective Trail sensor in steering axle need to replace see photo, wear and tear. | DPhangnalay | 3/10/2024 | Internal | 7540.0 | \$0.00 | NOTE: Broken wiring harness on trail sensor see images taken Carry out equipment condition assessment Carried out inspection on axle sensor and found the wiring and connction is damaged as well. Need to order the wiring, parets ordered. see photos for refs. Labour Remove ancillary items and Potentiometer, Replace Potentiometer and Refit to unit, Refit ancillary items, Carried out removing and replacing steer sensor and wiring as required. Test check function. Return to service. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|---|---|------------|--------------------------------|----------|----------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H11103 | | Description: HYSTER H3.5TX Diesel Forklift | | | | | |
| Make: HYSTER | | Model: H3.5TX | | Serial No.: B466R13633L | | | |
| 1657557 | Scheduled Service - KM IC 500hr SM - 6500hrs .0500 Hour Service | AGUTIERREZ | 3/10/2024 | Internal | 7265.0 | \$0.00 | Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Service 500hr, Carry out preventive maintainance service and safety inspection in the line with agreed scope of work. Report on condition of equipment and additional work requirements. Lubricate all grease point mast and chain. Replace Engine oil, oil filter and fuel filter. Test all function. Ok Found error code 0019 Defective Trail sensor in steering axle need to replace see photo, wear and tear. |
| 1647681 | Replace trail sensor & RH Headlight assembly | ALLOCATE | 12/08/2024 | External | 7322.0 | \$648.78 | Travel to site, Carry out equipment condition assessment truck not available due to workload,[sam], Labour Replace Light/s travel to site, contact customer [alico], prepare safe work area, access truck,, replaced sensor and lights tested ok |
| 1647393 | FW- 1646821 Need to Replace Relay at horn 1pc wear and tear. | TRICHARDS | 9/08/2024 | Internal | 7144.0 | \$0.00 | |
| 1646821 | KM IC 250hr SM - Andrea Vanger 0498 316 941 | AGUTIERREZ | 8/08/2024 | External | 7144.0 | \$295.70 | Travel to site, 250hr Service Travel to site, Sign in, Service 250hr, Carry out preventive maintainance service and safety inspection in the line with agreed scope of work. Report on condition of equipment and additional work requirements. Lubricate all grease point mast and chain. Test All function. Ok Need to Replace Relay at horn 1pc wear and tear. Found Damage Headlighth Assy see photo 1pc RH Please Qoute |
| 1642978 | Struggling to start and when it does a lot of dark smoke comes out. Etkk 819208 | System Planning | 24/07/2024 | Internal | 6882.0 | \$0.00 | |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|---|------------|--------------------------------|----------|--------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H11103 | | Description: HYSTER H3.5TX Diesel Forklift | | | | | |
| Make: HYSTER | | Model: H3.5TX | | Serial No.: B466R13633L | | | |
| 1642957 | Unit struggling to start, Dark smoke coming out of the exhaust. | 901QUOTE04 | 24/07/2024 | Internal | 7140.0 | \$0.00 | <p>Carry out equipment condition assessment Labour Replace Battery, Replace Ignition Spark Plugs as required, locate unit and inspect found battery no good return to spare parts pickup new battery return to site fit battery and test found glow plugs to be faulty order parts Remove ancillary items and glow plug/s and replace glow plug/s as required, Refit ancillary items, pickup parts and travel to site locate unit and replace glow plugs test unit for starting ok Travel to site, Travel to site Carry out equipment condition and assessment condition Machine is bit struggling to start No Dark smoke coming out to the exhaust</p> <p>Note : Machine was error code ErrC019 - Trail sensor open Need to replace trail sensor 2000hr Service</p> |
| 1608749 | Scheduled Service - GS IC 2000Hr SM - 6000Hrs .2000 Hour Service | MPERIA | 8/04/2024 | Internal | 6882.0 | \$0.00 | <p>Sign in onsite Locate machine 2000hr service Carry out preventive Maintenance Service and safety inspection in the line with agreed scope of works Report on condition of Equipment and additional works requirement Grease all point and clean ,machine</p> |
| 1587233 | Units wheel has pulled away from unit-Tagged Out-See photos-Pics to SC-ETKT-613741 | SUBC-RNT20101 | 13/12/2023 | Internal | 6741.0 | \$0.00 | <p>Note I signed the report the tablet has no signal Travel to site, Carry out Inspection and Diagnosis of Wheel checked wheels found rim failure need two rims and tyres steer 6.50-10 asap rang vera to get replaced asap</p> |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|---|------------|--------------------------------|----------|--------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H11103 | | Description: HYSTER H3.5TX Diesel Forklift | | | | | |
| Make: HYSTER | | Model: H3.5TX | | Serial No.: B466R13633L | | | |
| 1548436 | Scheduled Service - KM IC 500hr SM - 5500hrs .0500 Hour Service | MPERIA | 19/10/2023 | Internal | 6661.0 | \$0.00 | Travel to site, Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Travel to site Sign in onsite Locate machine 500hr service Carry out Preventive Maintenance Service and safety inspection in the line with agreed scope of works Report on condition of Equipment and additional works requirement Labour |
| 1548197 | Unit needs a new fire extinguisher.Etk 468294 | DPhangnalay | 10/07/2023 | Internal | 6542.0 | \$0.00 | Fit Attachment and ancillary items, |
| 1545511 | Fit new load rating plate - at WP workshop etkt #458514 | NCLARKE | 29/06/2023 | Internal | 6634.0 | \$0.00 | Fit fire exstinguisher as required. Travel to site, Install Hard Labels, |
| 1537451 | Load Rating Plate + Anderson plug for cleanaway Hire | ODEMERIN | 26/05/2023 | Internal | 6508.0 | \$0.00 | ffitted load rating plate Carry out equipment condition assessment Steam clean equipment as necessary. Grease All Points on Unit, Remove ancillary items, prepare and Paint unit as required, Prepare For Hire - Workshop Locate the machine and park it on the working bay. Performed machine inspection. Installed load rating plate. Test the anderson plug, cleaned the connector for corrosion. Greased the grease point. Touch up paint. Cleaned the machine. Test the machine performance and prep for hire . |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|------------------|---|------------|--------------------------------|----------|--------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H11103 | | Description: HYSTER H3.5TX Diesel Forklift | | | | | |
| Make: HYSTER | | Model: H3.5TX | | Serial No.: B466R13633L | | | |
| 1529786 | inspection | ABALONGOY | 24/04/2023 | Internal | 6505.0 | \$0.00 | Prepare For Hire - Workshop Steam clean equipment as necessary. Carry out equipment condition assessment Grease All Points on Unit, Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, - Locate unit. - Steam cleaned unit. - Carried out machine condition assessment. - Checked all fluid and functions. - Inspected machine for oil leaks. - Checked weight gauge calibration - ok. - Greased all functions. - Took photos, peer audit completed. Carry out equipment condition assessment |
| 1529656 | STR DEHIRE CHECK | JFOSTER | 21/04/2023 | Internal | 6505.0 | \$0.00 | Carry out equipment condition assessment no damage |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|---|------------|--------------------------------|----------|--------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H11103 | | Description: HYSTER H3.5TX Diesel Forklift | | | | | |
| Make: HYSTER | | Model: H3.5TX | | Serial No.: B466R13633L | | | |
| 1517939 | Scheduled Service Job. Hyster B466_1000 Hour Service Kit_Petrol & LPG. 1000 Hour Service | NGEDERTS | 2/03/2023 | Internal | 6488.0 | \$0.00 | Carry out equipment condition assessment 1000hr Service Steam clean equipment as necessary. Replace Forks/Tynes, Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Grease All Points on Unit, Prepare For Hire - Workshop 1000hr service; oil and oil filter only as advised by manager. New service sticker fitted Appraisal of unit found tynes out of spec. Replaced both Repaired side shift indicator, as it had snapped off Steam cleaned unit Battery terminal loose. Retightened Rating plate had no ivets and was loose. Re-riveted Greased all points NOTE; lift chains nearly out of adjustment, tynes still hit floor. Believed to be a combination of worn tires and lift chain |
| 1517938 | inspection | 401WORKSHOP | 2/03/2023 | Internal | 6482.0 | \$0.00 | |
| 1517702 | STR DEHIRE CHECK | JRODGER | 1/03/2023 | Internal | 6487.0 | \$0.00 | Carry out equipment condition assessment no damage |
| 1509712 | INSPECTION | ABALONGOY | 25/01/2023 | Internal | 6482.0 | \$0.00 | Carry out equipment condition assessment Steam clean equipment as necessary. Prepare For Hire - Workshop - Carried out machine condtion assessment. - Checked all functions and fluid levels. - Top up engine oil. - Steam cleaned unit. Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, - Locate unit, carried out machine condtion assessment, checked fluid levels and tested all functions - ok, cleaned, greased, removed faded plastic roof. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|---|------------|--------------------------------|----------|--------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H11103 | | Description: HYSTER H3.5TX Diesel Forklift | | | | | |
| Make: HYSTER | | Model: H3.5TX | | Serial No.: B466R13633L | | | |
| 1509433 | STR DEHIRE CHECK | JFOSTER | 24/01/2023 | Internal | 6482.0 | \$0.00 | Carry out equipment condition assessment |
| 1503848 | INSPECTION | DROELLIN | 23/12/2022 | Internal | 6978.4 | \$0.00 | no damage Steam clean equipment as necessary. Prepare For Hire - Workshop cleaned greased/lubed unit checked fluids checked functions topped up diesel Carry out equipment condition assessment |
| 1502243 | STR DEHIRE CHECK | 901QUOTE02 | 16/12/2022 | Internal | 6477.0 | \$0.00 | customer damage chuncks out of front right wheel Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. |
| 1503849 | Scheduled Service Job. NKA 0500HR SM. 0500 Hour Service | DROELLIN | 11/10/2022 | Internal | 6978.0 | \$0.00 | 500hr service changed engine oil, oil filter, fuel filter, air filter checked fluids checked functions greased/lubed unit topped up diesel Prepare For Hire - Workshop |
| 1474247 | inspection | YTSIGE | 23/08/2022 | Internal | 6363.6 | \$0.00 | Grease All Points on Unit, Carry out equipment condition assessment Steam clean equipment as necessary. Repair Horn Repair Light/s Adjust Lift Chain to correct specification, Top up fluids Adjust lift chain's Test all function, steam clean equipment as necessary Grease all point Prepare For hire Repair light's |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|---|---|------------|--------------------------------|----------|--------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H11103 | | Description: HYSTER H3.5TX Diesel Forklift | | | | | |
| Make: HYSTER | | Model: H3.5TX | | Serial No.: B466R13633L | | | |
| 1474102 | STR DEHIRE CHECK | LRODGER | 23/08/2022 | Internal | 6362.1 | \$0.00 | Carry out equipment condition assessment |
| 1429493 | INSPECTION | 401WORKSHOP | 4/02/2022 | Internal | 5875.0 | \$0.00 | NO DAMAGE FOUND |
| 1429494 | Scheduled Service Job. 4000hr SM - 4000hrs. 4000 Hour Service | ABALONGOY | 24/01/2022 | Internal | 5982.0 | \$0.00 | Prepare For Hire - Workshop 4000hr Service, 2000hr Service Load software as required to calibrate the unit, Adjust Handbrake Cable to correct specifications, Adjust Handbrake/Park Brake - Locate machine, Conducted 4000 hrs servicing, replaced engine oil, engine oil filter, air filter, transmission oil, trans filter, diff oil, coolant and brake fluid and greased all points. - Calibrated built-in load weight gauge, cleaned and adjusted inching brake cable and parking brake lever, cleaned brake drums, Remove ancillary items and Mirror and Replace, Refit Mirror and ancillary items, Fit Seat Belt, Repair Seat Switch Wiring, Steam clean equipment as necessary. Grease All Points on Unit, - 0 stock of fuel filter, fuel filter need replacing. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|------------------------------|---|------------|--------------------------------|----------|--------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H11103 | | Description: HYSTER H3.5TX Diesel Forklift | | | | | |
| Make: HYSTER | | Model: H3.5TX | | Serial No.: B466R13633L | | | |
| 1385976 | REPAIR AS PER 20 POINT CHECK | CESPINOZA | 30/06/2021 | Internal | 5875.0 | \$0.00 | <p>Repair Linkage/Lever as required,</p> <p>Replace Linkage/Lever as required,</p> <p>Remove ancillary items and Remove Drive Wheel from unit,</p> <p>Replace Brake Wheel Cylinders,</p> <p>Replace Brake master cylinder,</p> <p>Refit Drive Wheel, Refit ancillary items,</p> <p>Top up Brake fluid as required,</p> <p>- Replaced hydraulic lever pins, linkages and bushings. - Replaced brake wheel cylinders and master brake cylinder, bleed air on brake circuit, adjusted brakes to correct specification, top-up brake fluid and differential oil.</p> <p>Replace Load Guard,</p> <p>Adjust fan belt as required</p> <p>Grease All Points on Unit,</p> <p>Remove ancillary items, prepare and Paint unit as required,</p> <p>- Replaced load guard. - Adjusted fan belt to correct specification. - Greased and lubed all points. - Touched-up repainted black on counterweight and tynes, stencil hire number.</p> |
| 1385777 | INSPECTION | CESPINOZA | 29/06/2021 | Internal | 5875.0 | \$0.00 | <p>Carry out equipment condition assessment</p> <p>Steam clean equipment as necessary.</p> <p>- Locate unit, carried-out machine inspection, checked all function and fluid level, reported defects and abnormalities. - Cleaned the unit thoroughly as required.</p> |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|---|------------|--------------------------------|----------|--------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H11103 | | Description: HYSTER H3.5TX Diesel Forklift | | | | | |
| Make: HYSTER | | Model: H3.5TX | | Serial No.: B466R13633L | | | |
| 1365597 | Broken accelerator pedal. Delivered today. URGENT via Peter Holloway | WFENNELL | 22/03/2021 | Internal | 9735.0 | \$0.00 | <p>Travel to site,</p> <p>Carry out Inspection and Diagnosis of Attachment</p> <p>travel to site inspect broken accelerator pedal log in to trd look up parts and order new pedal check and top up engine oil check over unit</p> <p>travel to site inspect broken accelerator pedal log in to trd look up parts and order new pedal check and top up engine oil check over unit</p> <p>Labour</p> <p>Remove ancillary items and Throttle Pedal and Replace, Refit Throttle Pedal and ancillary items, Prepare For Hire - Workshop</p> |
| 1354421 | INSPECTION | ABALONGOY | 28/01/2021 | Internal | 5733.0 | \$0.00 | <p>Carry out equipment condition assessment</p> <p>-Locate unit, carried-out machine condition assessment, checked all fluid levels - diff oil need to be replace, dusty engine body, radiator fins and air clener, excessive play noticed on hydraulic control lever - control lever pins and bushings need to be replace, steering wheel already worn out - subject for replacement, grease points were dry and needs to lubricate, low level brake oil fluid, for further evaluation and possible oil leak on brake system, built in weight guage found not responding when lifting a load - for further evaluation/possible faulty pressure sensor, tynes on ground, lift chains need adjustment.</p> <p>Steam clean equipment as necessary.</p> <p>Carry out Inspection and Diagnosis of Steering System</p> <p>-Crack on plastic accel pedal, need replacing, horn switch is not working, possible faulty contact, Steering pivot rubber bush has a play, Additional work required : Blow dust out on engine body, air cleaner and radiator fins, steam cleaned unit. Cant calibrate weight guage due to not responding to its load.</p> |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|---|------------|--------------------------------|----------|--------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H11103 | | Description: HYSTER H3.5TX Diesel Forklift | | | | | |
| Make: HYSTER | | Model: H3.5TX | | Serial No.: B466R13633L | | | |
| 1290461 | Fan belt has snapped and unit is inoperable. Tagged out. Urgent. Requesting ETA | DTOM | 14/04/2020 | Internal | 5414.0 | \$0.00 | Travel to site, Carry out Inspection and Diagnosis of Electrical System Labour Flush and Replace Cooling System Coolant Replace Battery, Replace Fan Belt, Replaced fan belt Replaced battery Refilled coolant Labour |
| 1281085 | FW: steer pins worn & horn inop on steering wheel. | DTOM | 3/03/2020 | Internal | 5421.0 | \$0.00 | Travel to site, Overhaul Steering as required, Remove ancillary items and Mirror and Replace, Refit Mirror and ancillary items, Remove ancillary items and Horn from unit. Replace and refit Horn Button, Refit ancillary items, Travel to site Overhaul steer pins and bushes Grease and adjust steer axle Replace all horn contacts Replace mirror due to worn rotational mount Test unit Unit in full service |
| 1279025 | Scheduled Service - JDB - 24/2/20 500 Hr IC Service JDB - 24/2/20 500 Hr IC Service. 0500 Hour Service | RNESBIT | 24/02/2020 | Internal | 5359.0 | \$0.00 | Travel to site, Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. carried out pm5 service checked lights,horn,beeper, blew dust off unitt, changed engine oil and filter,topped up levels, checked wheel bearings and steer pins, lubed mast and chains,checked chains and tines, Note; steer pins worn horn inop on steering wheel. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|---|---|------------|--------------------------------|----------|--------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H11103 | | Description: HYSTER H3.5TX Diesel Forklift | | | | | |
| Make: HYSTER | | Model: H3.5TX | | Serial No.: B466R13633L | | | |
| 1239028 | De-Hire inspection to be done 12/09 or 13/09, please advise once done - SF Email. | RNESBIT | 9/09/2019 | Internal | 5190.0 | \$0.00 | Travel to site, Carry out equipment condition assessment dehire inspection, horn works intermittently, rear horn button inop. Labour |
| 1223188 | Seat Replacement | DTOM | 10/07/2019 | Internal | 5095.0 | \$0.00 | Travel to site, Replace Seat, Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, Replace seat and repair fatiuged wiring Travel to site, Carry out Inspection and Diagnosis of Attachment 1000hr Service Quote on tynes 1070 class 3 and load guard Job opened on replacement seat Conduct service and safety audit Changed engine oil and filter Changed fuel filter and bleed system Changed air filter Greased and lubercated all points Inspected all safety items Repaired sideshift Adjusted brakes and repaired park brake Inspected transmission and load tested Inspected chains and hoses Inspected tynes and tyres Inspect steer axle Test lights Inspected coolant level and cooling system Inspected fan belt Induction done prior to work comencment |
| 1221041 | PARTS ORDERED: Scheduled Service 1000 Hour Service - Taukiei 0408 778 037 | DTOM | 5/07/2019 | Internal | 5095.0 | \$0.00 | |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|---|------------|--------------------------------|----------|--------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H11103 | | Description: HYSTER H3.5TX Diesel Forklift | | | | | |
| Make: HYSTER | | Model: H3.5TX | | Serial No.: B466R13633L | | | |
| 1221035 | issue with the brakes being a bit soft - Sf Email | RNESBIT | 3/07/2019 | Internal | 5084.0 | \$0.00 | Travel to site, Block up unit, Adjust brakes and handbrake, signed in and completed induction tested brakes,soft pedal and brakes squeal in wet weather. raised drive wheels,removed wheels and axles.removed drums, lots of brake dust evident. cleaned dust from brakes/drums,checked brake shoes-ok,cylinders ok, refitted drums to find very under adjusted. adjusted brakes and handbrake,tested ok,returned unit to service. Fire extinguisher to be tested and safe. (SF email) |
| 1187273 | Fire extinguisher to be tested and safe. (SF email) | AJOHNS | 21/02/2019 | Internal | 4925.0 | \$0.00 | Carry out equipment condition assessment Inspected fire extinguisher found that braket had broken off and inspection tag is missing recommmed re[lacing with new Labour Travel to site, Replace Fire Extinguisher, picked up fire extinguisher, travelled to site, replaced extinguisher bracket had to retap hole as bolt rusted off I would like to request for an oil change for the above forklift at ELGAS Pinkenba depot. This is an issue that requires urgent attention. Taukiel 07 3260 1147 |
| 1173143 | I would like to request for an oil change for the above forklift at ELGAS Pinkenba depot. This is an issue that requires urgent attention. Taukiel 07 3260 1147 0500 Hour (Service HD1.5-3.5TX). 0500 Hour Service | WFENNELL | 31/12/2018 | Internal | 4870.0 | \$0.00 | Travel to site, Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. travel to site carry pm service replace oil ,filter check fluid levels ,lights top up coolant lubricate machine return to base |
| 1172854 | Hydraulic hose has split | 401SUBC | 27/12/2018 | Internal | 4661.0 | \$0.00 | Hydraulic hose has split |
| 1163678 | Drive tyres: 250x15x7.0 Solids | 401SUBC | 21/11/2018 | Internal | 4661.0 | \$0.00 | 27/12 RS Pirtek organised 687722 Drive tyres: 250x15x7.0 Solids Fitters organised 685121 |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|---|------------|--------------------------------|----------|----------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H11103 | | Description: HYSTER H3.5TX Diesel Forklift | | | | | |
| Make: HYSTER | | Model: H3.5TX | | Serial No.: B466R13633L | | | |
| 1134583 | Steer Tyres 6.50-10/5.00 solids Site Contact: Simon 0408 778 037 | 401SUBC | 3/08/2018 | Internal | 4661.0 | \$0.00 | Wear and tear to the rear right tyre please inspect and replace Travel to site, Repair Steer Tyre/s as necessary, Travel to site to sign in & organise to have unit brought out to car park to assess tyres to find unit needs new steer tyres size 6.50-10/5.00 solids steer tyres not damaged just worn to limit & drive tyres are ok 7/8 3:52PM RS OBC Left voice message advising Simon fitters being organised. |
| 1121064 | repairs to the right hand side front blinker. As it is not functioning and requires repairs. Pls contact Simon with ETA | ASINGLETON | 18/06/2018 | External | 4598.0 | \$194.60 | 8/8 TWS organised 660578 repairs to the right hand side front blinker. As it is not functioning and requires repairs. Pls contact Simon with ETA Travel to site, Repair Light/s |
| 1108427 | Require repairs to the the forks of the forklift as the pin that helps readjust the forks requires replacement. As the fork may have a risk of movement. | RWILSON | 4/05/2018 | External | 4523.0 | \$459.20 | Travelled to site found indicator bulb blown replaced with new test ok. Unit back in service. Require repairs to the the forks of the forklift as the pin that helps readjust the forks requires replacement. As the fork may have a risk of movement. Travel to site, Carry out Inspection and Diagnosis of Attachment Travel to site to sigh in & check unit & take pictures & order new parts Replace Tyne Latch, Travel site to organise to have unit & replace tyne locking pin |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|---|---|-----------|--------------------------------|----------|--------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H11103 | | Description: HYSTER H3.5TX Diesel Forklift | | | | | |
| Make: HYSTER | | Model: H3.5TX | | Serial No.: B466R13633L | | | |
| 1092345 | Scheduled Service Level B Service | JGENTRYPIKE | 6/03/2018 | Internal | 4418.0 | \$0.00 | <p>Scheduled Service</p> <p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p> <p>carried out pm service & inspection. adjusted coolant/water level, adjusted fan belt/brakes/park brake & inching. tensioned loose loadguard bolts. (drive/steer tyres low approx 15-20 % left, 1 x round/rotate type tyne latch missing, fire extinguisher requires current test/tag). returned unit to service & sign out.</p> |
| 1092212 | Horn not working correctly and Seatbelt connection sicking when trying to release seatbelt. | JGENTRYPIKE | 6/03/2018 | Internal | 4417.0 | \$0.00 | <p>Horn not working correctly and Seatbelt connection sicking when trying to release seatbelt.</p> <p>Travel to site,</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Repair Switch/es</p> <p>travel to site, locate/wait for unit to be taken out to carpark. carried out site induction. horn found to be intermittent, removed steer wheel/cover & cleaned contacts/slip rings. cleaned rust from contact plates, re-fit wheel assy/cover & test horn operation, ok. lubricated sticking belt catch/buckle, check/test belt/catch operation, ok.</p> |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|---|---|------------|--------------------------------|----------|------------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H11103 | | Description: HYSTER H3.5TX Diesel Forklift | | | | | |
| Make: HYSTER | | Model: H3.5TX | | Serial No.: B466R13633L | | | |
| 1047532 | Repairs to Forklift #H11103 for the Seat Bonnet. Simon Hayward 0408 778 037 | JGENTRYPIKE | 18/09/2017 | External | 4214.0 | \$3,085.52 | <p>repairs to Forklift #H11103 for the Seat Bonnet, stand in will be required. Simon Hayward 0408 778 037</p> <p>Travel to site,</p> <p>Carry out equipment condition assessment</p> <p>travel to site & wait for unit to be removed from site to carpark. bonnet frame hinge plate cracked/damaged. photo's taken for appraisal/qoute ?. replacement bonnet required. return unit to service.</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,</p> <p>travel to site & wait approx 20 minutes for unit to be made available. removed I.D/load plates & secure to new bonnet, disconnect seat/belt switch wiring & removed seat assy. removed bonnet/pinch weld-seal/catch/hood liner etc. install/secure new bonnet/strut, change over seat/belt switch harness/secure, fit/secure hood liner/seat assy & re-connect/shield seat/belt switch wiring. fit bonnet catch/hood & test operation, ok. test safety switch's & all operations, ok. return unit to service.</p> |
| 1036784 | Scheduled Service - Service next week anytime between tuesday - thursday | DPALITOC | 3/08/2017 | Internal | 4178.0 | \$0.00 | <p>Scheduled Service - Service next week anytime between tuesday - thursday</p> <p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p> <p>obtained machine and carry out pm service to unit, check to battery fan belt and charging system ok, check to brakes and fluid level full, check to damage bonnet mounting, photo taken check to cracks to seat ass'y. greasing lube mast channels and lift chains, cleaning to radiator and mavhine.</p> |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|---|------------|--------------------------------|----------|----------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H11103 | | Description: HYSTER H3.5TX Diesel Forklift | | | | | |
| Make: HYSTER | | Model: H3.5TX | | Serial No.: B466R13633L | | | |
| 1032400 | hydraulic arm for forklift bonnet to be repaired/replaced due to cust damage Site contact Simon Hayward 0408 778 037 | WFENNELL | 18/07/2017 | External | 4095.0 | \$443.80 | <p>hydraulic arm for forklift bonnet to be repaired/replaced due to cust damage Site contact Simon Hayward 0408 778 037</p> <p>Travel to site,</p> <p>Carry out Inspection and Diagnosis of Attachment</p> <p>travel to site inspect bent bonnet strut and order parts</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>pick up parts travel to site replace damaged bonnet strut return to base</p> |
| 1026784 | Seatbelt jamming, extinguisher cradle rusted, needs replacing. horn intermittent. M - F 14:00 - 16:00 attendance. | AFLOWERS | 27/06/2017 | Internal | 4049.0 | \$0.00 | <p>Seatbelt jamming, extinguisher cradle rusted, needs replacing. horn intermittent. M - F 14:00 - 16:00 attendance.</p> <p>Travel to site,</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>Repair Seat as necessary,</p> <p>Remove ancillary items and Horn from unit. Replace and refit Horn Button, Refit ancillary items,</p> <p>Replace Horn</p> <p>Travel to site, test horn, clean horn contacts and test, replace horn retest all ok, test and replace faulty seat belt and wire up switch, carry out repairs on fire extinguisher bracket. NOTE BONNET STRUT BROKEN AND NEEDS REPLACING CUSTOMER TO PAY</p> |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|-----------------------|---|------------|--------------------------------|----------|--------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H11103 | | Description: HYSTER H3.5TX Diesel Forklift | | | | | |
| Make: HYSTER | | Model: H3.5TX | | Serial No.: B466R13633L | | | |
| 1009015 | Check brakes | JGENTRYPIKE | 13/04/2017 | Internal | 3945.0 | \$0.00 | <p>Check brakes</p> <p>Travel to site,</p> <p>Carry out Inspection and Diagnosis of Brake System</p> <p>Block up unit, Adjust brakes and handbrake,</p> <p>drive to site, sign in/minor induction & sign on to work permit. raise block & chock unit, witch's hats around unit/van. adjust brake shoes/park brake & inching, check brake fluid level & pedal clearances. test brakes/park brake & inching control. OK. sign out & off work permit. Seatbelt sensor fault</p> |
| 996720 | Seatbelt sensor fault | DPALITOC | 24/02/2017 | Internal | 3876.0 | \$0.00 | <p>Travel to site,</p> <p>Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,</p> <p>travel to site obtained machine check to unit report to faulty seat belt. chec to loose connection to wirings repair to wirings and secure with ties test ok.</p> |
| 991014 | Replace lift chain | DPALITOC | 6/02/2017 | Internal | 3850.0 | \$0.00 | <p>Replace lift chain</p> <p>parts ordered from jason, will be at drop point in the morning</p> <p>Travel to site,</p> <p>Replace Lift Chain,</p> <p>travel to site obtained machine check remove and replace to worn out lift chains, note; seized up anchor bolts, rusted, check adjust to lift chains and hydraulic hoses test machine and clean.</p> |
| 991012 | Replace steering pin | DPALITOC | 6/02/2017 | Internal | 3843.0 | \$0.00 | <p>Replace steering pin</p> <p>Repair Steering as necessary,</p> <p>check and repair to steering pin and bushes coming off , both side ,replace bushes to left hand side exchange and repair to pin. reassemble and refit to locking screws.</p> |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|---|---|------------|--------------------------------|----------|----------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H11103 | | Description: HYSTER H3.5TX Diesel Forklift | | | | | |
| Make: HYSTER | | Model: H3.5TX | | Serial No.: B466R13633L | | | |
| 990816 | Scheduled Service - | DPALITOC | 3/02/2017 | Internal | 3843.0 | \$0.00 | <p>Scheduled Service -</p> <p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p> <p>obtained machine and carry out pm service to unit, change engine oil and oil filter, change fuel filter, check to battery , fan belt and charging system, check to cooling system brake system and light system, check to worn out lift chains bl834 20 ft long, check to steering link pins coming ,greasing , lube mast channels lift chains to be replace. clean radiator and machine</p> |
| 959748 | Replace Bonnet strut & Repair / Replace Damaged Load Guard Order Number Required - Wesley Harper or Adam Finlay onsite 32601147 | AFLOWERS | 6/10/2016 | External | 3503.0 | \$741.76 | <p>Replace Bonnet strut & Repair / Replace Damaged Load Guard Wesley Harper or Adam Finlay onsite 32601147</p> <p>Drive and pick up exchange load guard then travel to site and fit onto unit. also fit bonnet strut. check fluid levels, check and find broken working lamp right side, replace and check operation. test unit all ok</p> |
| 945578 | Brake inspection | DPALITOC | 16/08/2016 | Internal | 3434.0 | \$0.00 | <p>Brake inspection</p> <p>Block up unit, Adjust brakes and handbrake,</p> <p>travel to site obtained machine and check to brake, adjust brake, pedal is high , fluid level full , brake is working ok , except squealing due to shabby brake drum</p> <p>Overhaul Brakes components as required,</p> <p>obtained machine and remove to both sides drive wheel, seized up wheel nuts, dismanle brakes and check drums needs machining, travel to deliver drums for machining.</p> <p>Remove wheel/s, Remove brake drum/s, Remove brake shoe/s, Inspect and report,</p> <p>refit bearing caps to drums and deliver to truck clutch and brake for machining</p> <p>travel to pick up drums and travel back to site and assemble brakes fit new brake shoes and oil seals , refit to drive tyres , adjust brakes and bleeding the system test to unit ok.</p> |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|-----------------------------|---|------------|--------------------------------|----------|--------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H11103 | | Description: HYSTER H3.5TX Diesel Forklift | | | | | |
| Make: HYSTER | | Model: H3.5TX | | Serial No.: B466R13633L | | | |
| 927047 | Hard starting faults | AFLOWERS | 10/06/2016 | Internal | 3400.0 | \$0.00 | Hard starting faults Replace Battery, |
| 926269 | Scheduled Service - | AFLOWERS | 10/06/2016 | Internal | 3399.0 | \$0.00 | Replace battery test operation, check charging all good. Scheduled Service - carry out service replace engine oil and filter, clean air filter, grease unit, adjust brakes. test all functions all ok. NOTE unit hard to start first thing in morning suspect battery on it way out need to replace. |
| 912741 | CHECK BRAKES AND STEER AXLE | AFLOWERS | 21/04/2016 | Internal | 3355.0 | \$0.00 | Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. CHECK BRAKES AND STEER AXLE Repair Steering as necessary, obtained machine and check to unit report to loose steering and brakes squealing,remove steer tyres and check worn out steering pin and bushes, remove steering pin and bushes, Check/Inspect/Diagnose Steer Axle and test operation, Replace Steer Axle Trunnion Bushes/Bearings, Check/Inspect/Diagnose Brake drum/s, Carry out 1st Fass service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Remove steer axle and fit new trunnion rubbers replaced steering pins and bushes Stripped drum brakes and inspected Cleaned and refit Adjusted brakes Cleaned machine Greased and lubed chains |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|---|---|------------|--------------------------------|----------|----------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H11103 | | Description: HYSTER H3.5TX Diesel Forklift | | | | | |
| Make: HYSTER | | Model: H3.5TX | | Serial No.: B466R13633L | | | |
| 910125 | No Brakes on H11103 Contact Wesley | THIGGINS | 12/04/2016 | Internal | 3354.0 | \$0.00 | No Brakes on H11103 Contact Wesley Block up unit, Adjust brakes and handbrake, travel to site externally dedust and adjust brakeslube pivotpoints,check lights,levels lube mast,,check steer axle mount rear broken mount and bolts,retaining plate missing,will req unit swap,then could inspect brakes,service unit and carryout steer mount repairs in w/shop |
| 906405 | Replace Steer Tyres on H11103 | 401SUBC | 30/03/2016 | Internal | 3349.0 | \$0.00 | Replace Steer Tyres on H11103 |
| 904682 | Faulty release switch & check tyres | THIGGINS | 21/03/2016 | Internal | 3335.0 | \$0.00 | Faulty release switch & check tyres Repair Seat as necessary, travel to site gain access locate unit replaceseatbelt buckle and rewire and secure test ok,inspect steer tyres 650x10 black p/proof reqd |
| 889038 | Drive tyres: 250x15x7.0 Solids - mark 3260 1147 | 401SUBC | 25/01/2016 | Internal | 3138.0 | \$0.00 | |
| 880193 | Scheduled Service on H11103 | SN AIR | 15/12/2015 | Internal | 3138.0 | \$0.00 | Scheduled Service on H11103 Carry out scheduled maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. carry out schedule maintence service, replaced service parts as required. drice tyres required. lubricated and greased. test operations. returned unit to operators. |
| 842693 | Scheduled Service. | SN AIR | 4/09/2015 | Internal | 2905.0 | \$0.00 | Scheduled Service. Carry out scheduled maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. traveled to site. located only unit onsite, couldnt start service as to many vehicles onsite to unload. traveled to site and waitedfor site access. carry out schedule maintence service. replaced service parts as required, lubricated and greased, adjusted brakes. test operations. |
| 846721 | Replace steer tyres. | 401SUBC | 18/08/2015 | External | 2793.0 | \$847.80 | Replace steer tyres. Quoted \$847.80 ex GST. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--------------------------------------|---|------------|--------------------------------|----------|----------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H11103 | | Description: HYSTER H3.5TX Diesel Forklift | | | | | |
| Make: HYSTER | | Model: H3.5TX | | Serial No.: B466R13633L | | | |
| 841850 | Brakes noisy. | THIGGINS | 30/07/2015 | Internal | 4260.0 | \$0.00 | Brakes noisy. Shane 3866 7522 |
| 814106 | Scheduled Service. | THIGGINS | 16/04/2015 | Internal | 2490.0 | \$0.00 | travel to site gain access blowout brake drums[externally] adjust,retest ok,lube sideshift,check lights Scheduled Service. |
| 806773 | Check steer tyres. | 401SUBC | 18/03/2015 | Internal | 2456.0 | \$0.00 | Carry out scheduled maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. |
| 796174 | Replace bonnet strut. | THIGGINS | 6/02/2015 | External | 2326.0 | \$448.24 | travel and gain access to site,change oil ,oil and fuel filters,lube all pivot points,check lights,tyres,tynes,levels blow out rad and engine bay.adjust lift chains[free up] Check steer tyres. Quoted \$847.80 ex GST. Replace bonnet strut. J1034527 |
| 793920 | Broken accelerator pedal. | WFENNELL | 29/01/2015 | External | 2271.0 | \$194.23 | travel to site inspect engine cover,damaged ,order part pik up part return t site replace strut[damaged] Broken accelerator pedal. Work order: J1017460 |
| 793540 | Replace tine lock knob (Round type). | WFENNELL | 28/01/2015 | Internal | 2771.0 | \$0.00 | travel to site replace broken accelerator pedal Replace tine lock knob (Round type). |
| 787167 | Scheduled Service. | WFENNELL | 28/01/2015 | Internal | 2222.0 | \$0.00 | replace missing tine lock knob Scheduled Service. |
| 791283 | Replace full set of tyres. | 401SUBC | 16/01/2015 | Internal | 2143.0 | \$0.00 | Carry out scheduled maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. |
| 789985 | Broken gear shift lever. | THIGGINS | 13/01/2015 | External | 2126.0 | \$697.01 | carry out pm service replace oil and filter ,air filter trans filter check lights lubricate machine 1 requires tine lock knob round type Replace full set of tyres. Broken gear shift lever. J1008943 |
| | | | | | | | remove steering wheel,strip dash panels,remove lever assy replace forward/reverse lever,reass test |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|---|------------|--------------------------------|----------|------------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H11103 | | Description: HYSTER H3.5TX Diesel Forklift | | | | | |
| Make: HYSTER | | Model: H3.5TX | | Serial No.: B466R13633L | | | |
| 777589 | If accelerator is pressed down it seems to stick on the screw under the pedal. | SNAIR | 18/11/2014 | Internal | 1705.0 | \$0.00 | If accelerator is pressed down it seems to stick on the screw under the pedal. Check/Inspect Diagnose Engine and test operation, traveled to site. inspect pedal with managers and found no fault. operator errors. managers to monitor unit. |
| 775800 | Steer tyres replaced under warranty. | 401SUBC | 11/11/2014 | Internal | 1668.0 | \$0.00 | Steer tyres replaced under warranty. We have replaced these steer tyres 100% warranty, they achieved 603 hours the tyres are worn out but there seems to be an issue with the PSL we are sending information back to the factory to find out. |
| 768775 | Tyres credited from chargeable job | 401WORKSHOP | 15/10/2014 | Internal | 1326.0 | \$0.00 | |
| 768302 | Scheduled Service. | WFENNELL | 14/10/2014 | Internal | 1601.0 | \$0.00 | Scheduled Service. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. |
| 763830 | Replace damaged drive tyres. | 401SUBC | 25/09/2014 | External | 1326.0 | \$1,725.70 | travel to site carry out pm service replace oil ,filterand a/filter check lights and fluid levels lubricate machine |
| 760495 | Replace mirror. | WFENNELL | 12/09/2014 | External | 1232.0 | \$164.87 | Replace damaged drive tyres - 28X9X15 Black Solids Replace mirror. |
| 751852 | Replace steer tyres. | 401SUBC | 12/08/2014 | External | 1065.0 | \$824.00 | replace damaged rhs mirror return to base Replace steer tyres. Quoted \$824.00 ex GST. |
| 749082 | Scheduled Service. | WFENNELL | 1/08/2014 | Internal | 991.0 | \$0.00 | Scheduled Service. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. |
| 748416 | Issues with side shifting to the left - when fully loaded. | WFENNELL | 31/07/2014 | Internal | 884.0 | \$0.00 | carry out pm service change oil,filter fuel and air filters check lights lubricate machine1 both machines will require chains to be shortened next service bl834 con links Issues with side shifting to the left - when fully loaded. Possible warranty. travel to site lubricate side shift top and bottom slides ect due for service |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|----------------------------|---|------------|--------------------------------|----------|------------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H11103 | | Description: HYSTER H3.5TX Diesel Forklift | | | | | |
| Make: HYSTER | | Model: H3.5TX | | Serial No.: B466R13633L | | | |
| 741527 | R/H headlight not working. | THIGGINS | 7/07/2014 | Internal | 716.0 | \$0.00 | R/H headlight not working. Repair Lights as required, travel to site gain access replace headlamp globe [extinguisher bracket top securing plate rusted and missing small fire extinguisher secure temp] |
| 737369 | Replace drive tyres. | 401SUBC | 20/06/2014 | External | 639.0 | \$1,351.00 | Replace drive tyres. Quoted \$1,351.00 ex GST. |
| 735653 | Vibration in the rear end. | 401WORKSHOP | 13/06/2014 | Internal | 601.0 | \$0.00 | Vibration in the rear end. check vibration found drive tyres out of round and worn requires new drive tyres 28 by 9-15/7.00 please ring for order no |
| 730817 | Check oil levels. | JMANLEY | 28/05/2014 | Internal | 518.0 | \$0.00 | Check oil levels. Carry out Check Over of unit in line with the agreed scope of work. Report on condition of equipment and additional work requirements. |
| 728883 | Exhaust issues. | 401WORKSHOP | 21/05/2014 | External | 486.0 | \$2,922.60 | toppedup engine oil as required, ok. Exhaust residue being blown into engine bay and operators complaining of exhaust fumes when reversing. Design of spark arrestor exhaust system blowing exhaust into engine bay. Travel to site and investigate problem with exhaust fumes and residue. Find exhaust is blowing into the engine bay instead of being routed out. Take photographs and raise CM 140512-000127 to Nacco explaining incident. Collect machine and return to workshop for cleaning - no EPA approved washing facilities on site. Remove counterweight and replace muffler and pipe assembly as per Nacco CM. Wash machine inside and out. Test operation. Return machine to site. Job completed - 18/06/2014 |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|---|---|------------|--------------------------------|----------|----------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H11103 | | Description: HYSTER H3.5TX Diesel Forklift | | | | | |
| Make: HYSTER | | Model: H3.5TX | | Serial No.: B466R13633L | | | |
| 726436 | Inspect unit after accident. Replace steer tyres. | THIGGINS | 13/05/2014 | External | 412.0 | \$934.00 | Inspect unit after accident - hit an armaco rail. The fork now seems to have a slight rattle to it. Travel to site. Get unit taken outside. Jack up and inspect steer axle, no damage found. Counterweight scrape. Refer images. |
| 724291 | Reverse beeper faulty | 401SUBC | 6/05/2014 | External | 291.0 | \$228.04 | NOTE: Tyres worn and out of round, report to customer. To be replaced. Reverse beeper not working. Remove and Replace Reverse buzzer, Refit to unit, travel to site replacereverse beeper for louder model at customers request return to base |
| 723002 | Scheduled Service. | WFENNELL | 30/04/2014 | Internal | 387.0 | \$0.00 | Scheduled Service. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. |
| 721851 | Low engine oil. | WFENNELL | 28/04/2014 | Internal | 291.0 | \$0.00 | travel to site carry out 1st service replace oil,filter and blown bulbs blow out air filter lubricate machine Low engine oil. Carry out Check Over of unit in line with the agreed scope of work. Report on condition of equipment and additional work requirements. |
| 720304 | Blown headlight bulb. | WFENNELL | 17/04/2014 | Internal | 231.0 | \$0.00 | check engine oil level top up as required Blown headlight bulb. J952026 |
| 714780 | Record temperature readings on the hood, engine compartment & engine coolant temperature as well as the ambient temperature at time of measurement. | WFENNELL | 28/03/2014 | External | 213.0 | \$0.00 | replace blown h/light bulb Record temperature readings on the hood, engine compartment & engine coolant temperature as well as the ambient temperature at time of measurement. Carry out Check Over of unit in line with the agreed scope of work. Report on condition of equipment and additional work requirements. record temp measurements as directed |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|----------------------------|---|------------|--------------------------------|----------|-------------------------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H11103 | | Description: HYSTER H3.5TX Diesel Forklift | | | | | |
| Make: HYSTER | | Model: H3.5TX | | Serial No.: B466R13633L | | | |
| 712342 | Replace bonnet insulation. | WFENNELL | 20/03/2014 | External | 145.0 | \$373.04 | <p>Bonnet getting excessively hot. No bonnet insulation installed on machine.</p> <p>Travel to site and investigate top of bonnet getting hot. Find bonnet insulation is missing from unit. Report to Nacco Travel to site and install bonnet insulation . Take readings as requested by Jack Lim and Vincent Lee at Nacco. Test operation and return unit to service .</p> <p>~~3/7/14 rc denied nacco for following reason</p> <p>Non-conformance.</p> |
| 675910 | NEW RENTAL KLEAN HEAT | 401WORKSHOP | 29/10/2013 | Cap Prep | 0.0 | \$0.00 | <p>- Supply and fit 2.5kg fire extinguisher - Lockable battery isolator required - 1600mm slippers required (Deb) - Additional rating palte - New unit PDI, clean, test, check, full operation</p> <p>Allocated labour: 5 hours</p> |
| | | | | | | Equipment Total: | \$17,079.89 |
| | | | | | | Customer Total: | \$17,079.89 |