

ADAPT-A-LIFT GROUP PTY LTD

Service History Listing Active Units

Date: 19/06/2026

Time: 11:29:53AM

For Equipment Code From: H11582 To: H11582

For Customer Code From: All To: All

For Date Posted From: All To: All

For Branch Code From: All To: All

Don't Show Cost

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11582		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R14489M			
1832947	Prep for auction	ODEMERIN	10/06/2026	Internal	5452.0	\$0.00	Refit Battery to unit, Refit ancillary items, Carry out Inspection and Diagnosis of Electrical System Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, Installed new battery. Diagnosed machine does not power on, found some wiring missed. Fixed wiring for starting system to make it running the machine. Prep for auction.
1726474	FULL RESPRAY	201WORKSHOP	18/06/2025	Internal	5452.0	\$0.00	
1673335	Make good repairs Inspection	201WORKSHOP	15/11/2024	Cap Prep	5452.0	\$5,000.00	
1587052	green tag inspection	AMARONEY	13/12/2023	Internal	5452.0	\$0.00	
1586849	DE HIRE - Replace Load Guard, Slippers, Carriage Cleaning Mast was Torn	901QUOTESENT03	12/12/2023	External	5452.0	\$30.20	Carry out equipment condition assessment 1. slippers not returned 2. load guard missing 3. carriage torn off mast 4. unit needs x3 hrs cleaning
1578157	FW-1560370- defective Tiller Sensor in Steering. Err C019. and Hand brake cable	AMADDOX	8/11/2023	Internal	5439.0	\$0.00	Travel to site, Adjust Handbrake Cable to correct specifications, Carry out Inspection and Diagnosis of Electrical System found hand brake cable out of adjustment, adjusted handbrake tested unit ok, couldn't find info on code co19 tech support was not picking up

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11582		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R14489M			
1560370	Scheduled Service - TC IC 2000HR SM .2000 Hour Service	AGUTIERREZ	1/11/2023	Internal	5436.0	\$0.00	Travel to site, 2000hr Service Service 2000hr Carry out preventive maintainance service and safety inspection in the line with agreed scope of work. Report on condition of equipment and additional work requirements. Lubricate all grease point mast and chain. Replace engine oil and filters.. Found damage side mirror Left side please Quote. And defective Tiller Sensor in Steering. Err C019. and Hand brake cable Please change address to 152' Elizabeth dr Kemps creek nsw.
1569174	RENTAL RETURN - CHECK FOR DAMAGES	MSEGHABI	2/10/2023	Internal	5294.0	\$0.00	
1493680	replace damged load guard.	901QUOTE01	15/11/2022	Internal	5294.0	\$0.00	Customer rejected the quote- to be reviewed again at the time of dehire
1439161	Scheduled Service - 1000hr-Schedule Service-Guri-0406 126 670. SF EMAIL via Manan .1000 Hour Service	ALI	11/11/2022	Internal	5294.0	\$0.00	Labour Travel to site, 1000hr Service Repair Sideshift as necessary, pick up in DP. to fluscombe rd, no jsi. ring. to 1521 elizabeth dr, kemps creek. locate unit. no start caused by empty bottle. wait for gas bottle. top up brake fluid. top up coolant. missing 3 lower wear pads for side shift. put a wear pad to side shifter as requested. shidu requests fit 4 new wear pads. see photos. a damged load guard. Pls quote. complaint:none.cause:SM.correction:report.
1441264	Replace Load Guard	901QUOTE01	28/03/2022	External	5238.0	\$0.00	
1439957	Carriage is loose & one of the forks bolts has become very loose that holds the fork to the carriage. Load rest guard may be damaged - tech to assess so we can provide quote. URGENT	DPhangnalay	22/03/2022	Internal	5238.0	\$0.00	Travel to site, Carry out Inspection and Diagnosis of Attachment Carried out inspection on unit. Unit has lost its load guard causing one tyne to fall off. Load guard had been damaged and removed by customer. Please quote up customer for a new load guard.
1379321	30DAYGOODWILL After putting the gas bottle, the unti will not start- URGENT	ASTOKES	27/05/2021	Internal	4910.0	\$0.00	Repaired seat belt wiring.
1377558	Prep and supply LRP for 1800mm	MLUMAY	19/05/2021	Internal	4910.0	\$0.00	Carry out equipment condition assessment Prepare For Hire - Workshop Steam clean equipment as necessary.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11582		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R14489M			
1367214	Green Tag Inspection	SMALONISIO	29/03/2021	Internal	4909.0	\$0.00	<p>Carry out equipment condition assessment</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Steam clean equipment as necessary.</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>Repair Light Bracket as required,</p> <p>Block up unit, Adjust brakes and handbrake,</p> <p>Replace Right Steer Tyre,</p> <p>Evaluate tyre, need to replace its pneumatic tyre</p> <p>Replace Wheel/s,</p> <p>Repair Light Circuit as required,</p> <p>Repair Revolving/Flashing/Strobe light as required,</p> <p>Remove ancillary items, prepare and Paint unit as required,</p> <p>Repair Load Guard as necessary,</p> <p>Replace Forks/Tynes,</p> <p>Adjust Lift Chain to correct specification,</p> <p>Prepare For Hire - Workshop</p>
1361435	Scheduled Service - 4000 Hour Service .4000 Hour Service	GDEAN	8/03/2021	Internal	4898.0	\$0.00	
1337000	Fleet Inspection	GGUERRERO	30/10/2020	Internal	4898.0	\$0.00	<p>Carry out equipment condition assessment</p> <p>Steam clean equipment as necessary.</p> <p>Prepare For Hire - Workshop</p>
1298610	De-hire inspection. SF Email via Stuart Thompson.	SPLUMMER	18/05/2020	Internal	4760.0	\$0.00	<p>Travel to site,</p> <p>Prepare For Hire - Field</p> <p>Travel to site, locate unit, move to service area and complete take 5 screen. Perform De-hire inspection and report on condition of unit and of any damage to unit.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11582		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R14489M			
1293871	Cracked RHS mirror. SF Email.	SPLUMMER	28/04/2020	External	4684.0	\$160.55	Remove ancillary items and Mirror and Replace, Refit Mirror and ancillary items, Complete take 5 screen. Removed and replaced RHS mirror. Travel to site,
1293839	Problem with starter motor, idling very slow and stalls continuously. SF Email Requesting Steve or Mal to attend.	SPLUMMER	28/04/2020	Internal	4684.0	\$0.00	Replace Starter Motor, Adjust LPG Mixer to correct specification, Replace Ignition Spark Plugs as required, Travel to site, locate unit, move to service area and complete take 5 screen. Inspect and found starter motor intermittantly will not engage. Removed and replaced starter motor assembly. Check engine tuning and found idling too low, adjust idle and air mixture. Inspect spark plugs and found worn, removed and replaced spark plugs. Function tested unit.
1275285	Rear RHS tyre is flat	202SUBC	7/02/2020	External	4354.0	\$497.00	Notes from tech Lachlan of Beaurepairs Bathurst 600-9 SOLIDEAL TT 1x Other 6.00R9 JS2 (Q+26) 1x 1 business hour spent on job Attended site replace tyre
1259744	Replace fan belt	MMcNAIR	29/11/2019	Internal	4354.0	\$0.00	Replace Fan Belt, remove hyd deive shaft from engine remove and replace fan belt refit drive shaft adjust fan belt test
1259370	Scheduled Service - 1000hr 1000hr. 1000 Hour Service	MMcNAIR	28/11/2019	Internal	4354.0	\$0.00	1000hr Service travel to site locate unit carry out 1000hr service grease and lube replace engine oil and filter replaced air filter as old filter un servicable test all functions lights and alarms found diff piniomn seal leaking blow down machine and radiator check all fluids adjust brakes
1250219	Unit wont start	SPLUMMER	24/10/2019	Internal	4251.0	\$0.00	Travel to site, Carry out Inspection and Diagnosis of Electrical System Labour Replace Battery, Travel to site, locate unit, move to service area and complete take 5 screen. Check and found unit is hard to start, check battery and found failing under load. Source new battery locally, returned to site, removed and replaced battery, check charging rate and function tested.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11582		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R14489M			
1250218	Flat tyre - SF Email.	SPLUMMER	24/10/2019	External	4251.0	\$280.10	Repair Steer Tyre/s as necessary, Labour Complete take 5 screen. Jack up unit and remove RH steer tyre, take tyre to local supplier and have puncture repaired. Returned to site, refit tyre to unit, inflate tyre to recommended pressure. Function tested. Travel to site,
1232517	When sitting on the seat it moves but then it stops	SPLUMMER	14/08/2019	Internal	4085.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System Adjust Switch/es Locate unit, move to service area and complete take 5 screen. Found unit cuts drive when leaning out on seat. Found seat pad switch is not sensitive enough, dismantle seat base and reposition pad switch to be more sensitive, function tested and reassemble seat base. Travel to site,
1231202	Running Rough	SPLUMMER	8/08/2019	Internal	4077.0	\$0.00	Repair LPG Convertor as necessary, Travel to site, locate unit, move to service area and complete take 5 screen. Check and found unit runs rough, check ignition system and found to be ok, check LPG convertor and found filter blocked and excessive wax in convertor, removed convertor and overhaul, refit to unit and function tested.
1227536	Scheduled Service - 0500hr 0500 Hour (Service HD1.5-3.5TX). 0500 Hour Service	SPLUMMER	26/07/2019	Internal	4049.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Complete take 5 screen. Perform PM service as per instruction, clean, lube and full function tested.
1227421	Unit not starting - Parked Up	SPLUMMER	25/07/2019	Internal	4049.0	\$0.00	Travel to site, Carry out Inspection and Diagnosis of Electrical System Repair LPG Convertor as necessary, Travel to site, locate unit, move to service area and complete take 5 screen. Found unit will not start, check ignition system and found to be ok. Check and found no gas going to engine, check solenoid valve and found to be working ok. Remove lpg convertor and dismantled, replaced block filter and clean excessive wax from convertor, reassemble and refit to unit. Function tested ok.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11582		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R14489M			
1229429	Damage to unit - work light guard, LH & RH mirror,LH tail light and guard assembly	SPLUMMER	15/07/2019	External	4075.0	\$438.01	Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Complete take 5 screen. Replaced damaged parts as per quote and function tested.
1210207	Repalce drive tyres	SPLUMMER	22/05/2019	Internal	3923.0	\$0.00	Travel to site, Replace Wheel/s, Travel to site, locate unit, move to service area and complete take 5 screen. Remove and replace drive tyres including rims. Function tested
1209115	Seatbelt isnt working - Still in use	SPLUMMER	20/05/2019	Internal	3918.0	\$0.00	Seatbelt isnt working - Still in use Travel to site, Replace Switch/es Locate unit, move to service area and complete take 5 screen. Check and found unit will not start intermittantly, found seat switch is intermittantly not closing. Removed seat assembly, dismantled seat, removed and replaced seat switch, reassembled seat, wire into harnes and refit seat to unit. Function tested.
1197292	replace both mirrors and led light	202QUOTE	1/04/2019	External	3796.0	\$0.00	
1196950	repairs above pm	SPLUMMER	29/03/2019	Internal	3817.0	\$0.00	Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Inspect and order replacement seat assembly, repaired loose side panel as nut insert has come adrift. Labour Replace Seat, Repair LPG Bottle bracket as required, Pick up part from drop point, travel to site, sign in, locate unit, move to service area and complete take 5 screen. Removed and replaced seat assembly, wire in seat and belt switches, repaired gas bottle bracket due to latch sticking. Function tested.
1187807	lights not working	SPLUMMER	25/02/2019	Internal	3698.0	\$0.00	Sign in to site, locate unit, move to service area and complete take 5 screen. Check and found light fuse blown and both work light globes blown. Replaced fuse and globes, locate and repair wiring short to frame. Function tested.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11582		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R14489M			
1177760	Not Starting - possible starter motor.	SPLUMMER	18/01/2019	Internal	3606.0	\$0.00	Not Starting - possible starter motor. Travel to site, Replace Starter Motor, Travel to site, sign in locate unit, move to service area and complete take 5 screen. Found starter motor will not engage intermittantly. Removed and replaced starter motor, function tested.
1196894	Scheduled Service Job. 0500 Hour (Service HD1.5-3.5TX). 0500 Hour Service	SPLUMMER	16/01/2019	Internal	3796.0	\$0.00	Travel to site, Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Sign in, locate unit, move to service area and complete take 5 screen. Perform PM service as per instruction, clean, lube and full function tested.
1162937	Seat belt buckle / fastener broken. Tagged out due to safety. Darryl - 0407 348 692. Request ETA.	SPLUMMER	19/11/2018	Internal	3471.0	\$0.00	Seat belt buckle / fastener broken. Tagged out due to safety. Darryl - 0407 348 692. Request ETA. Travel to site, Fit Seat Belt, Travel to site, sign in, locate unit, move to service area and complete take 5 screen. Found seat belt buckle not locking in, removed and replaced seat belt assembly. Function tested.
1160604	repair seat	SPLUMMER	12/11/2018	Internal	3450.0	\$0.00	Removed seat, disassemble seat and repaired broken seat base mounts, reassemble seat and refit to unit. Function tested.
1157325	pre cleaner damaged	SPLUMMER	30/10/2018	External	3469.0	\$226.97	Replace Engine Intake Ducting as required, Complete take 5 screen, found pre cleaner damaged by impact. Removed pre cleaner assembly and install inner air filter element instead. Order inlet grill to replace pre cleaner duct.
1114899	service Level B Service	202SUBC	28/05/2018	Internal	3022.0	\$0.00	
1102655	service Level B Service	202SUBC	13/04/2018	Internal	2925.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11582		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R14489M			
1093609	Fork tynes have fallen off, the brackets broken - Customer says he doesnt know how this happened, I asked if there was any impact but he says this is all he has been told - James 0499 111 550	SPLUMMER	12/03/2018	Internal	3022.0	\$0.00	<p>Fork tynes have fallen off, the brackets broken - Customer says he doesnt know how this happened, I asked if there was any impact but he says this is all he has been told - James 0499 111 550</p> <p>Travel to site,</p> <p>Carry out Inspection and Diagnosis of Mast/Carriage</p> <p>Travel to site, locate unit, move to service area and complete take 5 screen. Found fork carriage hanger has come adrift from carriage due to operator abuse. Remove carriage and associated parts, inspect and prepare quote.</p> <p>Remove ancillary items and Carriage, Strip, Inspect and report,</p> <p>Labour</p> <p>Travel to site, move to service area and complete take 5 screen. Removed damaged fork carriage and take to local supplier to have repaired due to frame hook mounts worn away.</p> <p>Repair Carriage as necessary,</p> <p>Repair Mast as necessary,</p> <p>Locate unit, move to service area and complete take 5 screen. Refit fork carriage, frame, side shift cylinder, forks and load guard. Grease mast and chains, check for leaks and function tested.</p> <p>Mechanic SPLUMMER replaced order number quote with No charge ref W</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11582		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R14489M			
1078330	damage - load guard & tail gate	SPLUMMER	15/01/2018	External	2925.0	\$1,997.93	<p>Travel to site,</p> <p>Repair Load Guard as necessary,</p> <p>Replace Engine Intake Ducting as required,</p> <p>Replace Light/s</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>Locate unit, move to service area and complete take 5 screen. Found damage to load guard, pre air cleaner, RH tail light and RH engine cover. Have load guard welded back together by local engineer. Replaced pre air cleaner and duct, replaced broken tail light. Remove engine cover and rework back into correct shape, refit to unit.</p>
1078138	seat belt jamming	SPLUMMER	12/01/2018	Internal	2880.0	\$0.00	<p>Travel to site,</p> <p>Fit Seat Belt,</p> <p>Repair Seat as necessary,</p> <p>Locate unit, move to service area and complete take 5 screen. Replaced seat belt buckle due to jamming and not releasing belt intermittently. Also found seat base loose on seat assembly, removed seat assembly and replaced missing bolt and retightened all other bolts. Refit seat to unit and function test.</p>
1040860	starter motor faulty - Mark Bennett 0439 374 833	SPLUMMER	21/08/2017	Internal	2474.0	\$0.00	<p>starter motor faulty - Mark Bennett 0439 374 833</p> <p>Travel to site,</p> <p>Replace Starter Motor,</p> <p>Travel to site, locate unit and move to service area. Found starter motor intermittantly does not engage. Replaced starter motor and function tested.</p>
1026504	side shift issue	SPLUMMER	26/06/2017	Internal	2309.0	\$0.00	<p>Repair Sideshift as necessary,</p> <p>Found lower fork carriage hanger bolts loose or broken. Tightened and replaced bolts, function tested.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11582		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R14489M			
1022515	seat and side shift repairs	SPLUMMER	9/06/2017	Internal	2273.0	\$0.00	Travel to site, Replace Seat, Replace Sideshift Bushes/Bearings, Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Travel to site from Orange. Replaced worn seat assembly and wire in seat belt switch, replaced side shift liners and retaining bolts, replaced leaking hydraulic fittings on sideshift cylinder. Function tested.
1020979	gas leak	SPLUMMER	5/06/2017	Internal	2257.0	\$0.00	Remove ancillary items and Repair Gas Leak as necessary, Refit ancillary items, Replace Revolving/Flashing/Strobe light, Found gas bottle supply hose has a hole. Removed hose and have new hose made locally. Returned to site fit new hose and check for leaks. Also found strobe light not working, replaced strobe and function tested.
999440	broken fork tyne	SPLUMMER	7/03/2017	Internal	1994.0	\$0.00	Replace Sideshift Bushes/Bearings,
998626	SERVICE	SPLUMMER	3/03/2017	Internal	1986.0	\$0.00	Check and found sideshift pads fallen out, Replaced wear strips and liners and function tested. 2000hr Service
960151	KW - PM SERVICE	SPLUMMER	7/10/2016	Internal	1640.0	\$0.00	Perform PM service as per instruction, clean, lube and full function tested. KW - PM SERVICE
929869	wont start	SPLUMMER	22/06/2016	Internal	1372.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Perform PM service as per instruction, clean, lube and full function tested. Replace Battery, Replace Starter Motor, Found battery and starter have failed, replaced battery and starter motor and function tested.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11582		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R14489M			
900191	Repairs above PM	SPLUMMER	4/03/2016	Internal	1083.0	\$0.00	Check/Inspect/Diagnose Switches and test operation, Remove ancillary items and Switches and Replace components as required, Refit Switches and ancillary items and adjust to correct specification, Adjust LPG Convertor to correct specification, Replaced faulty combi switch, and adjust engine idle and fuel mixture, function tested.
891216	Scheduled Service -	SPLUMMER	4/03/2016	Internal	1038.0	\$0.00	Scheduled Service - Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Perform PM service as per instruction, clean, lube and full function tested.
879805	Repairs above PM	SPLUMMER	14/12/2015	Internal	761.0	\$0.00	Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Replaced faulty seat belt and hood strut, function tested.
867456	Scheduled Service -	SPLUMMER	13/11/2015	Internal	761.0	\$0.00	Scheduled Service - Perform PM service as per instruction, clean, lube and full function tested.
855533	No start	SPLUMMER	18/09/2015	Internal	568.0	\$0.00	Replace Starter Motor, Replaced faulty starter motor and function tested.
843979	Scheduled service	SPLUMMER	7/08/2015	Internal	459.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Perform PM service as per instruction, clean, lube and full function tested.
801807	Scheduled Service	SPLUMMER	27/02/2015	Internal	107.0	\$0.00	Scheduled Service Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Perform PM service as per instruction, clean, lube and full function tested.
791113	Load Rating Plate Lever lockout system Pins for safety cage	201WORKSHOP	16/01/2015	Internal	0.0	\$0.00	Load Rating Plate Lever lockout system Pins for safety cage

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H11582		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R14489M			
790689	Load rating plate	SPLUMMER	15/01/2015	Internal	172.0	\$0.00	Load rating plate Check/Inspect/Diagnose Attachment and test operation, Fit Attachment and ancillary items, Will be fitted Friday 27/3/15
739694	PREP FOR HIRE	201WORKSHOP	30/06/2014	Cap Prep	0.0	\$0.00	Supply and fit load rating plate for work platform. Supply and fit tilt/sideshift lock out device. Function tested. * Mast Hydraulic Accumulator should be fitted from factory * Rating Plate should be supplied from factory for factory ordered attachment * PDI
						Equipment Total:	\$8,630.76
						Customer Total:	\$8,630.76