

ADAPT-A-LIFT GROUP PTY LTD

Service History Listing Active Units

Date: 19/06/2026

Time: 11:28:28AM

For Equipment Code From: H12554 To: H12554

For Customer Code From: All To: All

For Date Posted From: All To: All

For Branch Code From: All To: All

Don't Show Cost

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001 Equip. Code: H12554 Description: HYSTER H2.5TX Make: HYSTER Model: H2.5TX Serial No.: D466R02016P							
1833269	Prep for auction	ODEMERIN	11/06/2026	Internal	3307.0	\$0.00	Replace Battery, Carry out Inspection and Diagnosis of Electrical System Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, Replace Wheel/s, Remove Fleet Management System as required, Replaced battery. (not holding charge) Diagnosed machine does not turn on. (some wiring cut) Swap tyres rear (damaged) Removed fork track.
1749081	prep for transport	NMORAN	15/09/2025	Internal	3307.0	\$0.00	Replace Battery, Carry out Inspection and Diagnosis of Electrical System Adjust LPG Convertor to correct specification, replace battery unit wouldnt crank, found broken wire in forktrack harnes repaired wire unit ran rough adjust mixture all good
1690086	Good unit - Raise jobs and prep for sale - Advertise	203WORKSHOP	29/01/2025	Cap Prep	3307.0	\$0.00	
1572927	Green tag inspection	NMAISTRY	17/10/2023	Internal	3307.0	\$0.00	Carry out equipment condition assessment Prepare For Hire - Workshop
1572266	RENTAL RETURN - CHECK FOR DAMAGES	MSEGHABI	13/10/2023	Internal	3306.0	\$0.00	Install Stickers, Carry out equipment condition assessment

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H12554		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: D466R02016P			
1509018	Replace missing parts and repair for STR	BAQUILINA	23/01/2023	Internal	3293.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System Carry out Inspection and Diagnosis of Attachment Refit Battery to unit, Refit ancillary items, Replace Fuel Line, Remove ancillary items and Solenoid from unit. Replace Solenoid and Refit to unit. Refit ancillary items, Replace LPG Mixer,
1500872	Assess not working STR machine	BAQUILINA	12/12/2022	Internal	3293.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System Replace LPG Hose Coupling as required, Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, Replace Battery, Check/Inspect/Diagnose Engine compression and perform compression test and report. Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,
1500557	Green tag inspection	BAQUILINA	12/12/2022	Internal	3293.0	\$0.00	Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,
1492445	Repco invoice refer job # 1464641	201QUOTE	10/11/2022	Internal	3293.0	\$0.00	Steam clean equipment as necessary.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H12554		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: D466R02016P			
1570784	Scheduled Service Job. Hyster D466_4000HrSrvKit_LPG_Nis_H2.0 -3.5XT. 4000 Hour Service	NMAISTRY	15/09/2022	Internal	3307.0	\$0.00	VR IC 4000HRS SM-4000 Replace Hydraulic Oil as Required Remove ancillary items and Hydraulic Filter and Replace, Refit Hydraulic Filter and ancillary items, Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Check/Inspect/Diagnose Hydraulic Oil Leak and test operation, Change Engine Oil as required, Replace Engine Oil Filter, Top up Engine Oil as required, Flush and Replace Cooling System Coolant Replace Light Bracket as required, Replace Transmission Oil as Required Fit Seat Belt, Drain and refill differential oil, Block up unit, Adjust brakes and handbrake, Top up Brake fluid as required, Steam clean equipment as necessary.
1468851	Scheduled Service Job. Hyster C466_0500 Hour Service Kit_ Petrol & LPG. 0500 Hour Service	ODEMERIN	2/08/2022	Internal	3293.0	\$0.00	
1468850	Green Tag Inspection	MLOGAN	2/08/2022	Internal	3293.0	\$0.00	Carry out equipment condition assessment

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H12554		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: D466R02016P			
1464641	Unable to start the machine, it has a coolant sensor, the light has lit up, transmission sensor is coming up. Tagged Out. - PTCK 170080	MCLARKE	12/07/2022	Internal	3293.0	\$0.00	Travel to site, Carry out Inspection and Diagnosis of Electrical System Labour Repair LPG Safety Switch and wiring as necessary, Travelled to site. Located unit. Unable to start the machine it has a coolant sensor the light has lit up. Inspected unit. Tried starting unit wont start coming up with error code C100 rang around and found out it has engine problems but doesnt tell me what it is. Rang around a few techs nothing rang louie he said i need a obd2 reader went to repco got one went back to site obd2 wont read the codes on this unit. Back to basics checked fuses and relays checked for broken wires and plugs all ok. Checked all coil packs are sparking all ok. Checked unit is getting gas unit lpg lock off wont open and let gas through has power and earth. Ordered part 1000hr Service
1451908	Scheduled Service Job. Hyster C466_1000 Hour Service Kit_Petrol & LPG. 1000 Hour Service	ODEMERIN	31/05/2022	Internal	3293.0	\$0.00	1000hr Service

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H12554		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: D466R02016P			
1453352	STR Repairs - fit new attachment	ODEMERIN	24/05/2022	Internal	3293.0	\$0.00	<p>Replace LPG Hose Coupling as required,</p> <p>Replace LPG Hose as required,</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Steam clean equipment as necessary.</p> <p>Blow out radiator core,</p> <p>Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,</p> <p>Refit Carriage and ancillary items,</p> <p>Repair Load Guard as necessary,</p> <p>Refit Forks/Tynes and ancillary items,</p> <p>Remove ancillary items and Hydraulic Hose/s, inspect and report,</p> <p>Adjust Lift Chain to correct specification,</p> <p>Repair Horn</p> <p>Replace Stickers,</p> <p>Adjust Distributor to correct specifications,</p> <p>Repair Wet Weather Gear as necessary ,</p> <p>Carry out Inspection and Diagnosis of Brake System</p> <p>Adjust Handbrake/Park Brake</p> <p>Grease All Points on Unit,</p> <p>Remove ancillary items, prepare and Paint unit as required,</p> <p>Remove ancillary items and Mirror and Replace, Refit Mirror and ancillary items,</p> <p>Prepare For Hire - Workshop</p> <p>Locate machine and park to work bay,performed machine inspection,isntalled sideshift positioner (carriage),repair</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H12554		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: D466R02016P			
							load guard,refit tynes,removed hydraulic hoses,adjust lift chain,adjust and cleaned distributor,repleced side mirror(RH)troubleshoot brake unusual sound,repair wet weather,adjust horn,repair/replaced LPG line and fitting,blew radiator core,tidy up wiring, touch up paint, greasing grease point, installed sticker,cleaned machine,test machine performance
1451905	Green Tag Inspection	ODEMERIN	18/05/2022	Internal	3293.0	\$0.00	Carry out equipment condition assessment
1435881	Inspect and repair the Rotator forklift Tines locking mechanism. See notes for more details. SF EMAIL.	AZMODA	3/03/2022	Internal	3201.0	\$0.00	Repair Forks/Tynes as necessary, Repair Load Guard as necessary,
1428313	Unit has a heavy oil leak. Tagged out. SF EMAIL	RMILNE	4/02/2022	Internal	3058.0	\$0.00	Customer reports that tyne lock pins are worn / rotator attachment fitted - Cause:- worn tyne lock pins due to rotation . Correction :- replace tyne lock pins / tighten load guard bolts / Tighten free lift cylinder mounting bolts . Travel to site, Check/Inspect/Diagnose Hydraulic Oil Leak and test operation, Labour Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, unit has a oil leak oil leaking from ydraulic fitting inspected. tested operation. found leak from fitting at valve block. removed hoses and fitting. travel to pick up new fitting. replaced fitting. refitted hoses. tested operation. cleaned unit. ok Remove ancillary items and Hydraulic Hose/s, inspect and report, Replace Hydraulic Hose/s and ancillary items, oil leak leak from split hose on hydraulic pump inspected. tested operation. confirtmed. found split hose in hydraulic hose from pump. removed hose. travel to pirtek to get new hose made up. replaced hose. tesed operation. ok
1425661	Replace tyres. (2x) 600-9 , black - Urgent .	201SUBC	17/01/2022	Internal	3025.0	\$0.00	
1486869	FOR PO PURPOSES ONLY	201SUBC	13/01/2022	Internal	3293.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H12554		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: D466R02016P			
1424563	Unit will not start - SF EMAIL	AZMODA	13/01/2022	Internal	3025.0	\$0.00	Travel to site, Carry out Inspection and Diagnosis of Electrical System Labour Customer has reported that unit will not start - Cause :- flat battery / no jumper leads in spare van - pick up replacement battery / start unit and test charging system , found that alternator has failed (charging at 12.34volts) Part required 1720588 / have part varified # E controll system fitted - parts available in Wetherill Park NotifyJess to contact Stas to arrange drop point . Replace alternator, Carry out Inspection and Diagnosis of Wheel Pick up parts at drop point / return to site - fit new alternator and test unit (charging at 14.23 volts) Check oils and water / top up as required - general inspection . Note :- Further work , requires steer tyres black / (2x) 600-9 solids) # see attached photo's .
1415458	Request for battery to be replaced. SF EMAIL	AZMODA	19/11/2021	Internal	2899.0	\$0.00	Travel to site, Replace Battery, Customer report unit has flat battery - Cause:- faulty battery - Correction :- remove and replace battery / tighten fan belt . Note :- Urgently unit requires steer tyres (2x) 600-9 black tyres - replace fan belt / further work .
1370912	Check/replace safety seatbelt as not latching in. Tech to assess. SF EMAIL	GBANKS	19/04/2021	Internal	2038.0	\$0.00	TRAVEL TO SITE,FIND UNIT ,FOUND SEAT BELT NOT CLIPPING IN .FIT A NEW SEAT BELT AND WIRE UP.GB19/4/21. Travel to site,
1346969	PARTS ORDERED - Replace LHS Tyne Latch Lever	AZMODA	15/03/2021	External	1925.0	\$258.50	Fit Seat Belt, Labour Repair Tyne Latch as necessary , Locate unit - Customer reports that right hand tyne latch pin , has missing handle - Cause :- roll pin sheared / handle fallen off and missing - Correction:- fit new latch handle , general inspection .

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H12554		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: D466R02016P			
1345008	Scheduled Service - 50 Hour Service .0500 Hour Service	AZMODA	11/12/2020	Internal	1640.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Sign in at office - locate unit - Carry out 500hr service / clean unit . Note :- Further work - Missing left hand side tyne latch lever (see attached photo's) Requires Replace spinner Knob / steering wheel - replace inner and outer steer axle link pins / bushes (inner bushes - 4608044 x2) replace fan belt .
1330947	Replace Tynes	901QUOTE SENT01	30/09/2020	External	1291.0	\$0.00	Carry out equipment condition assessment Carry out Inspection and Diagnosis of Mast/Carriage Adjust Attachment to correct specification , access truck to safe working area, check tynes and attachment,tynes worn beyond limit, lock pins worn and not seating square causing it to slide, correction - needs new tynes, inform maggy refer to images for tyne id, [length- 1060mm, wide - 120mm, thick - 40mm, carriage 410mm wide] Travel to site,
1325252	Tynes are sliding out of position when using the rotator. SF Email.	GSINGH	8/09/2020	Internal	1291.0	\$0.00	
1307569	Scheduled Service - 1000 Hour Service .1000 Hour Service	AZMODA	18/06/2020	Internal	994.0	\$0.00	1000hr Service Carry out 1000hrs service and clean unit - clean service area / sign out at office . Further work:- worn spinner knob / steering wheel and missing locking bolt and nut / left hand mirror .
1288098	INVOICING ONLY - PO relating to job 1271469	201SUBC	31/03/2020	Internal	854.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H12554		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: D466R02016P			
1286895	Repair/ replace locking mechanism holding the tynes. SF Email.	AZMODA	26/03/2020	Internal	886.0	\$0.00	<p>Repair Tyne Latch as necessary,</p> <p>Repair Attachment as necessary,</p> <p>Customer reports that right hand tyne falls off rotater attachment - caused by tyne lock pin bent , as well as worn - this has also caused the outer stopper bolt to shear off in carriage . Remove tyne and straighten locking pin . Drill out broken bolt and replace .Reassemble unit and check operation . Order new tyne lock pin kits .</p> <p>Note :- photo's of tyne lock pins taken / class 2 tynes - 1070x120x40 mm . (2x) tyne lock pin kits required .</p> <p>Replace Tyne Latch,</p> <p>Sign in at maintenance office - locate unit in factory (site shut down for maintenance) move unit to safe working area / remove tynes and replace worn tyne latch pins . Check opertaion and return unit to its location .</p>
1277684	Replace tynes - CH1250x500 5503214 1511106	901QUOTE02	18/02/2020	External	607.0	\$0.00	
1275870	Replace drive tyres	201SUBC	10/02/2020	Internal	607.0	\$0.00	
1274965	REPCO INVOICING ONLY	201SUBC	6/02/2020	Internal	607.0	\$0.00	
1261831	Scheduled Service - 500 Hour Service 500 Hour Service. 0500 Hour Service	SKHAN	1/12/2019	Internal	607.0	\$0.00	<p>Labour</p> <p>Pick up parts from D\I\ (No parts at D\I\ for this job</p> <p>Pick up parts from D\I\</p> <p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p> <ol style="list-style-type: none"> 1. Front tyres split with chunks missing. Ref pics 1 to 6 (Dunlop trukush DG 7.00-12 cushion industrial) 2. O\S motor cover slightly impact damaged. Ref pics 7 to 9 3. Floor mat distorted\worn out. Ref pics 10 and 12 4. Tynes worn out. Ref pics 13 to 17 (CH1250x500 5503214 1511106) Cascade Lx002 <p>*General scrapes and scratches. Ref pics 22 to 24 *Topped up 5L hydraulic fluid</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H12554		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: D466R02016P			
1257821	Leaking hydraulic oil. SF Email.	GBANKS	22/11/2019	Internal	557.0	\$0.00	<p>Travel to site, Check/Inspect/Diagnose Cylinder Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Top up Engine Oil as required, TRAVEL TO SITE,DO A SITE INDUCTION.DIAGNOSIS OIL LEAK.HOSES AT ROTATOR.CLEAN ,TIGHTEN AND TEST.SEAT,LIFT CHAINSAND INCHING CABLE NEED REPLACING .I WILL ORDER.TOP UP ENG OIL.GB22/11/19. Replace Seat, ORDER PARTS.25/11/19. Replace Lift Chain, Repair Inching Valve as necessary , Remove ancillary items and Carriage, Strip, Inspect and report, Refit Carriage and ancillary items, Repair Hydraulic Hose/s as necessary, TRAVEL TO SITE.GET HOT WORK PERMIT AND UNIT.REMOVE CARRIAGE AND FREE LIFT CHAINS.GRIND OLD CHAINS AND CUT NEW CHAINS TO LENGH.FIT NEW CHAINS AND CARRIAGE.ADJUST CHAINS AND HOSES .REPAIR CHAIN COVER AND CLEAN AREA.GB6/12/19.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H12554		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: D466R02016P			
1229805	Flat battery. Won't start. (SF email)	SKHAN	5/08/2019	Internal	41.0	\$0.00	<p>Travel to site, Remove ancillary items and Remove Battery from unit and Inspect and report, Labour Replace Battery, Diagnosed issue Flat battery. Travel to repco to pick up part Replace battery, ref to pics Alternator tested at 12.5v, ref to pics Alternator requires replacing, unit tagged out. Part has been ordered and should arrive overnight from QLD Travel to D\P to pick up part, not at D\P Travel to W\P to Drain old oil, Pick up uniforms Drop off part #4642561 to Mathew To enquire further about alternator, part should arrive at D\P tomorrow. Replace alternator, Carry out Inspection and Diagnosis of Electrical System Travel to D\P to pick up part Travel to site Replace alternator. Retest alternator and battery working as designed Ref pics 4, 5 and 6 Hours on dash are displaying 42?</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H12554		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: D466R02016P			
1214811	Scheduled Service - Peter Guerrero 02 8337 1277 Peter Guerrero 02 8337 1277. 4000 Hour Service	JWEIR	13/06/2019	Internal	110.0	\$0.00	<p>Scheduled Service - Peter Guerrero 02 8337 1277</p> <p>JW Travel to workshops. Order and pick service parts. Travel to site. Peter indicates no work scheduled to be done today, was still nice enough to let me have a unit to service, calendar provided with dates circled, see pictures attached. Locate unit H12552 scheduled for a 2000hr service, unit previously serviced 6/19 not due until 12/19, return unit to service. Locate unit H12554, move to and establish safe work area. Remove panels and fan shroud and clean unit. 4000hr service as per task card. Faults found: Seat cushion damaged. Seat frame damaged. Seat belt freyed. LHS tyne heel worn, RHS tyne not far off spec. Centre lift chains worn. RHS load guard bent. Floor mat bubbling. LHS work light bent. Pictures attached. 30Aug19</p> <p>Carry out equipment condition assessment</p> <p>Steam clean equipment as necessary.</p> <p>4000hr Service,</p> <p>JW Outstanding tasks for 4000hr service: Coolant change. Hydraulic oil change. 30Aug19 Replace headlamp smashed during service</p> <p>Travel to site,</p> <p>Replace Light/s</p> <p>Travel to site. Replace headlight. Replace steer tyres</p> <p>06/02 - CMC sent off to trelleborg</p>
1183668	Replace headlamp smashed during service	SKHAN	11/02/2019	Internal	3653.0	\$0.00	<p>Travel to site,</p> <p>Replace Light/s</p> <p>Travel to site. Replace headlight. Replace steer tyres</p> <p>06/02 - CMC sent off to trelleborg</p>
1182310	Replace steer tyres	201SUBC	5/02/2019	Internal	3652.0	\$0.00	<p>06/02 - CMC sent off to trelleborg</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H12554		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: D466R02016P			
1178165	Customer requested for the 25th Jan due to RDO Call Jeff 02 8337 1229 to confirm date and time 0500 Hour (Service HD1.5-3.5TX). 0500 Hour Service	SKHAN	25/01/2019	Internal	3652.0	\$0.00	<p>Customer requested for the 25th Jan due to RDO Call Jeff 02 8337 1229 to confirm date and time</p> <p>Travel to site,</p> <p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p> <p>Unit required additional cleaning (Ref to pic 1, 2 and 3) 1)Both headlight globes blown. 12v (requires restocking and replacing) 2)Replace fork tyne locking pins x2 + one locking knob @ customers request(Ref to pic 4 and 5) 3)Both rear steer wheel tyres requires replacing (Ref to pic 6 and 7) Tyre size 6.00-9 Rim size 4.00 cushion tyres 4)Seat slightly damaged.(Ref to pic 8 and 9)</p> <p>Labour</p> <p>Replace Light/s</p> <p>Replaced H3 Headlight globes x2 O\S\F headlight lens had broken whilst replacing globes. Orderd part from spare parts Ref to pics. Replace tyne locking pins, locking knob and damaged seat</p>
1183876	Replace tyne locking pins, locking knob and damaged seat	201SUBC	23/11/2018	Internal	3653.0	\$0.00	<p>11/02 - Cmc sent off request for parts 14/02 - Customer has now cancelled his job and PO number. Request sent to parts to put parts in Shaak Van Stock 19/02 - Sent to rob to flip to internal</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001 Equip. Code: H12554 Description: HYSTER H2.5TX Make: HYSTER Model: H2.5TX Serial No.: D466R02016P							
1144525	Doesn't start as battery is dead.	SKHAN	12/09/2018	Internal	3530.0	\$0.00	Doesn't start as battery is dead. Travel to site, Carry out Inspection and Diagnosis of Attachment Labour Replace Battery, Jump started unit for customer. Battery tested negative. Alternator tested positive.e Customer requested an immediate battery change as it will die by the afternoon. Source, order and pick up battery. Ref to pics for terminal position, size and location. Cross refrence battery. Order and picked up part from Repco Mascot. Returned to site. Fit new battery. Test battery. Test starter motor. Reset computer system. Test drove unit multiple times. Unit is now working as designed. Battery: 55D23L Scheduled Service -
1143321	Scheduled Service - 0500 Hour (Service HD1.5-3.5TX). 0500 Hour Service	MLAM	10/09/2018	Internal	3633.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Wait unit 500hr service plus air filter Rear tyres worn replace - size - 6.00-9, rim 4.0 Note - van air compressor intermittent - blow out Tightened drive belt - excessive slack Minor tears in seat cushion - monitor Minor exterior/age scratches and markings Note : floor mat swelling - replace next service No headlight - globe busted - Site Contact: Jeff 02 8337 1229
1143676	No headlight - globe busted - Site Contact: Jeff 02 8337 1229	SKHAN	7/09/2018	Internal	3530.0	\$0.00	No headlight - globe busted - Site Contact: Jeff 02 8337 1229 Replace Light/s

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H12554		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: D466R02016P			
1142838	plate that supports the engine has come off and is using unit but is becoming unusable it will be parked	MLAM	5/09/2018	Internal	3652.0	\$0.00	<p>plate that supports the engine has come off and is using unit but is becoming unusable it will be parked</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>Wait unit (customer fitted bracket and bolts) Jack up unit and inspect fitment and tension Retension bolts to satisfactory standard order genuine plate and bolts - natalie</p> <p>Travel to site, excess travel - traffic, wait for unit, note rainy weather, prepare work area away from rain, jack unit, support with safety blocks, support steering assembly and replace bracket and bolts, signed job as unable to find supervisor</p>
1128922	FIT CUSTOMER SUPLIED BLUE LIGHTS AND WIRE INTO FOWARD DIRECTION	GSINGH	13/07/2018	External	3403.0	\$725.57	<p>FIT CUSTOMER SUPLIED BLUE LIGHTS AND WIRE INTO FOWARD DIRECTION</p> <p>Travel to site,</p> <p>Install Light/s</p> <p>travel to site, access truck to safe working area, prepare for light installation, drill hole fo bracket, prepare wireing harness and solder connections, install light and hook up, adjust and test ok.</p>
1108854	Scheduled Service - 500hr IC 500hr IC. Level B Service	ZKHAN	7/05/2018	Internal	3000.0	\$0.00	<p>Scheduled Service - 500hr IC</p> <p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p>
1081058	Unit has no brakes - Peter 02 8337 1277	GBANKS	24/01/2018	Internal	2424.0	\$0.00	<p>Unit has no brakes - Peter 02 8337 1277</p> <p>Carry out Inspection and Diagnosis of Wheel</p> <p>Block up unit, Adjust brakes and handbrake,</p> <p>INSPECT STEER TYRES & ADJ BRAKES.GB24/1/18.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H12554		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: D466R02016P			
1052587	Scheduled Service - 1000HRS	GBANKS	6/10/2017	Internal	1998.0	\$0.00	Scheduled Service - 1000HRS 1000hr Service Remove ancillary items and Repair Gas Leak as necessary, Refit ancillary items, Travel to site, Replace Ignition Spark Plugs as required, RELACE SPARK PLUGS.GB.19/10/17.
1041176	BLUE LIGHT INSTALATION	201QUOTE	22/08/2017	External	1625.0	\$0.00	
1029581	Unit leaks when the rotator is used - Site Contact: Peter 02 8337 1277	GBANKS	6/07/2017	Internal	1625.0	\$0.00	Unit leaks when the rotator is used - Site Contact: Peter 02 8337 1277 Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Repair Light/s CARRY OUT SITE INDUCTION.CHECK UNIT ,CLEAN OFF OIL,FOUND LEAK AT HOSE FITTINGS,REPAIRED & TEST.REPAIR LIGHTS.TOP UP OILS&WATER.GREASE ROTATOR,LUB CHAINS.GB10/7/2017
1010132	Centre mast bolts are missing Site contact Peter 8337 1277	GDEAN	20/04/2017	Internal	1311.0	\$0.00	Centre mast bolts are missing Site contact Peter 8337 1277 Travel to site, Repair Free Lift Cylinder as necessary, Attend site check unit for bolts missing in mast found two bolts in van replace bolts replace mirror as mirror keeps moving socket worn
991233	Seat couldnt be adjusted.	DSAY	6/02/2017	Internal	1061.0	\$0.00	Seat couldnt be adjusted. Repair Seat as necessary, remove seat and repair suspension replace some missing bolts straighten runner as required refit and test ok

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H12554		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: D466R02016P			
949638	KW - LIGHTS ARE FLICKERING / NUTS ARE LOOSE ON ALL FORKLIFTS PETER - 02 8337 1277	TCONDITISI	30/08/2016	Internal	490.0	\$0.00	KW - LIGHTS ARE FLICKERING / NUTS ARE LOOSE ON ALL FORKLIFTS PETER - 02 8337 1277 Repair Lights as required, REPLACE BLOWN GLOVE AND FIT MISSING BOLTS IN SEAT , TIGHTEN ALL LOAD GUARD BOLTS LM- Headlight not working- night shift complaining.
938574	LM- Headlight not working- night shift complaining.	Gcini	20/07/2016	Internal	477.0	\$0.00	Replace Lights, travelled to site in heavy traffic and located unit . checked unit for head light not working. replaced globe and tested. unit ok
935502	RML - MACHINE LEAKING OIL PETER - 83371277	Gcini	11/07/2016	Internal	280.0	\$0.00	RML - MACHINE LEAKING OIL PETER - 83371277 Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, travelled to site and located unit.checked unit for oil leak and found that there was a slight leak from suction hose. tightened hose clamp and cleaned hose. tested unit. unit ok
909328	RML - SWAP BLUE LIGHTS FROM OLD UNIT H11010 AND FIT TO NEW UNIT	ALI	8/04/2016	Internal	5.0	\$0.00	RML - SWAP BLUE LIGHTS FROM OLD UNIT H11010 AND FIT TO NEW UNIT Fit Attachment and ancillary items, travel to site via heavy traffic. Check/Inspect/Diagnose Load Guard, no load guard.measure size. pick cards. Refit Load Guard and ancillary items, Refit Lights to unit, refit ancillary items, travel to site, swap old load guard. swap blue light& harness from h2808. test ok. requested a new load guard.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H12554		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: D466R02016P			
866365	Prep for Rental - Monroe	DMCDONALD	28/10/2015	Cap Prep	1.0	\$0.00	<p>Fork Track Blue Light Swap Rotator RRN KF2 025 Attollo Quick match pricing cost</p> <p>H2.5TX - LPG Forklift (EL Engine) Nominal Capacity-2500 kg HTU (1 Fun) Without Quick Coupling - E Mast Basic Light With LH Shift Lever - RH Light Switch LED Rear Combination Lights LED Strobe Light Hyd. Control Valve - 3 Fun - Lever With Interlock Forks - CL2 STD 40x122x1070 Load Backrest - CL2 1020x1070 Drive Tire: 7.00-12 - Solid With Split Wheel 6.00-9 - Solid With Split Wheel Sequential Seat Belt Interlock Mast - 3 Stg FFL 2120 / 4545 (BOF) Separate Inch/Brake Pedal Lexan Top Covers For Rain Protection Load Weight Meter - With Load Alarm Rear Drive Handle with Horn Button NMHG Added Disc Tenneco 29592 EFI Engine Upgrade</p> <p>Prepare equipment for hire to requested specification</p> <p>Fit Fleet Management System as required,</p> <p>Adjust Fleet Management System as required,</p> <p>Fit Attachment and ancillary items,</p> <p>Repair Forks/Tynes as necessary,</p> <p>Note... Tine modification was required at fit rotator and counterweight paint repairs done.</p>
Equipment Total:						\$984.07	
Customer Total:						\$984.07	