

ADAPT-A-LIFT GROUP PTY LTD

Service History Listing Active Units

Date: 19/06/2026

Time: 11:25:23AM

For Equipment Code From: H13148 To: H13148

For Customer Code From: All To: All

For Date Posted From: All To: All

For Branch Code From: All To: All

Don't Show Cost

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13148		Description: HYSTER H2.5XT					
Make: HYSTER		Model: H2.5XT		Serial No.: D466R02671P			
1810196	UE Photoshoot - Repaint	201WORKSHOP	17/03/2026	Cap Prep	4052.0	\$0.00	
1756515	advertise online - used	DDEJESUS	14/10/2025	Internal	4052.0	\$0.00	Carry out equipment condition assessment
1750095	Prep for transport	NMORAN	18/09/2025	Internal	4052.0	\$0.00	Replace LPG Hose as required, Replace LPG Hose Coupling as required, Carry out Inspection and Diagnosis of Electrical System Repair LPG Safety Switch and wiring as necessary, found gas hose split and leaking, replaced hose found gas coupling crushed, replaced coupling diagnose no crank no start issue found broken wire on ignition barrel, found seat switch wiring crushed under seat repair ignition barrel wiring repair seat switch wiring. unit would crank and still not run, diagnose gas issue found sticky gas shut off valve, remove n clean valve refit to unit unit now runs.
1513436	DEHIRE INSPECTIO - CHECK FOR DAMAGES	MSEGHABI	13/02/2023	Internal	4052.0	\$0.00	Carry out equipment condition assessment
1498582	Seat sensor is not working it will not more - PTCK 276008	NBULL	1/12/2022	Internal	4120.0	\$0.00	returned in fair condition Repair Seat Switch Wiring, complaint seat sensor not working cause seatbelt wiring broken correction replaced plug where wires have snapped, taped up wiring and moved out of the way, tested all ok

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13148		Description: HYSTER H2.5XT					
Make: HYSTER		Model: H2.5XT		Serial No.: D466R02671P			
1488556	Something has happened to wires causing it not to start. Brakes not working all the time & seatbelt sensor failing causing fork to lock up. Etkk 23939	NBULL	25/10/2022	Internal	3891.0	\$0.00	<p>Travel to site,</p> <p>Repair Seat Switch Wiring,</p> <p>Bleed Brake System</p> <p>Top up Brake fluid as required,</p> <p>complaint wont start and brakes sometimes dont work</p> <p>cause found seatbelt to be completely broken and wiring not connected and brake i found fluid to be low, no leaks found,</p> <p>correction, replaced seatbelt and rerouted wiring, topped up brake fluid checked for leaks and bled the system, got gas bottle and tested unit, brake still intermittantly not working, further inspected and found faulty brake master cylinder, bypassing internally, ordered part 26/10/22</p> <p>Replace Brake master cylinder,</p> <p>Flush brakes,</p> <p>Block up unit, Adjust brakes and handbrake,</p> <p>complaint brakes sometimes not working</p> <p>cause brake master cylinder</p> <p>correction replaced master cylinder, flushed brake fluid and replaced, adjusted brakes and topped up brake fluid, tested all ok</p> <p>assist nick replacing new master cylinder, replace and flush fluid & adjust brakes</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13148		Description: HYSTER H2.5XT					
Make: HYSTER		Model: H2.5XT		Serial No.: D466R02671P			
1449583	Scheduled Service - 2000hr-Scheduled Service-Site Contact-Riley Prosser-02 8335 1204 .2000 Hour Service	NBULL	9/05/2022	Internal	3429.0	\$0.00	2000hr Service located unit, completed 2000hr service, replaced engine oil and oil filter, replaced air filter, checked and tested coolant, sulphur levels good aand ph levels good, replaced spark plugs and adjusted dizzy to get a smoother idle, checks drive belts no freying or cracking, checkec battery voltage and charge voltaage both good, replaced transmission filter, checked hydraulic oil level and condition of the oil, checkd brake fluid, adjusted brakes, greased all greasable points, chain lubed chain and mast and checked chain for stretch [still in spec] aand checked tines for wear [still in spec], checked over unit for any noticeable damage, carried out operational testing.
1445017	FOR PO PURPOSES ONLY	201SUBC	13/04/2022	Internal	3399.0	\$0.00	
1441913	Replace Sideshift Cylinder Rod	901QUOTE SENT01	30/03/2022	External	3399.0	\$0.00	
1436435	Hydraulic Oil leak from underneath the mast	DMackay	21/03/2022	Internal	3399.0	\$0.00	Travel to site, Carry out equipment condition assessment Travel to site, locate onsite contact & machine. Assess oil leak - found SIDESHIFT CYLINDER ROD BENT allowing oil to leak past seal - sent email to request quote as CUSTOMER DAMAGE. Tagged out machine. Please update customer email address to iso@stockwells.com.au if not already
1374532	Tyres require replacing. Non marking 6.00 - 9 & 7.00 - 12	201SUBC	5/05/2021	Internal	2898.0	\$0.00	
1374315	Scheduled Service - 500 Hour Servcie .0500 Hour Service	GDEAN	5/05/2021	Internal	2898.0	\$0.00	Travel to site, Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Travel to site carry out pm service change oil and filters check levels and lube, Tyres are worn non markers 700x12 and 600 x 9 NOTE TYNNES ARE BADLY WORN UNIT IS DANGEROUS TO USE, will tag out Spoke to Daneil Will require replacing tynnes and tyres and then adjust ift chains Tynne are 1170mm long and chamfered inside edge
1339893	Replace Tynes & Mirror	901QUOTE SENT01	12/11/2020	External	2569.0	\$0.00	
1331129	THURSDAY/FRIDAY 8th 9th - 1000 Hour Service .1000 Hour Service	GBANKS	9/10/2020	Internal	2569.0	\$0.00	CARRY OUT 1000PM SERVICE,CLEAN RADIATOR,UNIT,BATTERY TERMINALS.DRILL AND TAPE BROKEN GREASE NIPPLE,FIT NEW ONE.REPAIR LIGHTS. QUOTE NEEDED FOR WORN OUT TYNES PREVISABLELY SENTAND 1 X MIRROR.GB9/10/2020.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13148		Description: HYSTER H2.5XT					
Make: HYSTER		Model: H2.5XT		Serial No.: D466R02671P			
1312458	Bolt missing in the mast and possible exhaust leak - Tagged out	AZMODA	8/07/2020	Internal	2480.0	\$0.00	<p>Travel to site, Repair Seat Switch Wiring, Carry out Inspection and Diagnosis of Mast/Carriage Labour Repair Load Guard as necessary, Replace Muffler, Travel to site - locate unit - Customer reports that seat belt warning lamp on dash (locking out drive intermittently) Exshhaust leak / missing load guard bolt (Cam tyne spteader attachment with integral load guard - model LP21020YA1127 / Serial 07050) Inspect unit and repair seat belt harness / poor earth crimp (replace terminal in harness loom) Found that muffler has tail pipe section cracked away from rear of muffler (see photo's) Unable to access TRD -Hyster portal / contact Nattalie in spare parts .Remove load guard bolt and locate supplier locally (pick up parts) return to site and fit new load guard bolts . Note :- Steering column adjuster has handle and locating bolt missing (bolt has dropped out and handle now missing / fatigue) Remove ancillary items and Counterweight, Refit Counterweight and ancillary items, Picked up muffler and rubber mounts from Nacco / Milperra - return to site - remove counter weight - remove blown muffler assembly and replace / replace vibration rubber mounts for muffler - Refit counter weight and run unit , to burn in muffler (paint to blister) Note :- steering column handle on order (overseas order - awaiting parts) .</p> <p>Repair Steering Column as required,</p> <p>Travel to site - locate unit - remove dash covers / fit steering column adjuster handle and spindle . General inspection .</p>
1309802	Seatbelt is not connecting and working. Tagged out.	NCLARKE	26/06/2020	Internal	2438.0	\$0.00	<p>Travel to site, Labour Replace Switch/es no start found seat beltswitch inop travelled to base for parts return to site fitteed tested</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13148		Description: HYSTER H2.5XT					
Make: HYSTER		Model: H2.5XT		Serial No.: D466R02671P			
1300182	Sticky accelerator pedal. Tagged out.	GBANKS	22/05/2020	Internal	2363.0	\$0.00	Travel to site, Adjust Throttle Cable to correct specification, Repair Carburettor as necessary, Carry out equipment condition assessment TRAVEL TO SITE,FIND UNIT AND2ND LUB CR DIAGNOSIS ACCELERATOR STICKING PROBLEM.REMOVE CABLE AND LUBRICATE ,CLEAN AND LUB CARBY CROSSHAFT.CHECK UNITTOP UP HYD OIL.GB22/5/2020.TABLET TROUBLE.
1283832	CW - Hydraulic hose keeps slipping off the pully	RTOPIC	13/03/2020	Internal	2297.0	\$0.00	Travel to site, Check/Inspect/Diagnose Cylinder Labour Replace Hydraulic Hose/s and ancillary items, Concern; Hyd hoses keep coming off hose roller . Cause; Hoses outer casing is breaking up and won't track straight. Correction; Supply and fit new quality hoses.
1282225	Replace tynes CLASS2 X 1170 X 120 X 40 INSIDE SHAMFER	901QUOTE SENT02	6/03/2020	External	2284.0	\$0.00	
1281794	Side shift hose sheeves required	GBANKS	5/03/2020	Internal	2301.0	\$0.00	Check/Inspect/Diagnose Cylinder CHECK SIDESHIFT HOSES COMING OFF HOSE SHEAVES,FOUND SHEAVES WERE JUST NYLON AND WERE WORN ON THE SHAFT.LOOK UP AND ORDER NEW SHEAVES.GB5/3/2020. Replace Chain Sheave, Carry out Inspection and Diagnosis of Mast/Carriage PICK UP PARTS,REMOVE HOSE SHEAVES AND FIT NEW ONES.MEASURE UP TYNES FOR A QUOTE.TABLET PLAYING UP.GB17/3/2020.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13148		Description: HYSTER H2.5XT					
Make: HYSTER		Model: H2.5XT		Serial No.: D466R02671P			
1274584	THURSDAY 5TH - PARTS ON PICK UP SHELF. - Scheduled Service - 2000 Hour Service	GBANKS	10/02/2020	Internal	2284.0	\$0.00	Labour PICK UP PARTS FOR SERVICES.GB4/3/2020. 2000hr Service Blow out radiator core, GET UNIT INTO A SAFE WORK AREA,CARRY OUT 2000PM SERVICE.ADJ BRAKES ,HOSES.CLEAN RADIATOR.SIDESHIFT HOSE SHEAVES NEED REPLACING WORN OUT.QUOTE TYNES WORN OUT SPECIAL CLASS2 X 1170 X 120 X 40 INSIDE SHAMFER.2X HEADLAMP BRACKETS BENT,LOADGAURD BENT,STEER COLUMBE ADJ LEVER AND BOLT MISSING.PHOTOS.GB5/3/2020.
1259622	Friday 3rd - Replace 4 x Load Guard Bolts - meet Owen on site	NCLARKE	28/11/2019	External	2100.0	\$412.00	Travel to site, Repair Load Guard as necessary, travelled to site remove load gaurd bolts counter sunk holes and modifide load gaurd fitted countrr sunk bolts
1246763	Right front light is broken - SF Email + Pics	DSAY	9/10/2019	External	2025.0	\$272.85	Travel to site, Replace Light/s
1243308	please check attachment performance as discussed	RTOPIC	25/09/2019	Internal	1997.0	\$0.00	arrive on site but have to queue up with trucks to access yard. locate unit and replace headlight. test ok. Carry out Inspection and Diagnosis of Attachment Repair Attachment as necessary,

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13148		Description: HYSTER H2.5XT					
Make: HYSTER		Model: H2.5XT		Serial No.: D466R02671P			
1227814	Radiator leak - tagged out	JWEIR	26/07/2019	Internal	1825.0	\$0.00	<p>JW Travel to wokshops to get cooling system pressure tester. Travel to site. Site sign in procedure. Locate unit online. Operator indicates unit leaking coolant after 30minutes of use. Remove panels. Inspect raditor fluid full. Pressure test radiator, no leaks visible. Inspect overflow tank empty not correctly mounted. Mount overflow tank and refill. Inspect overflow tank leaking. Order new overflow tank. 29Jul19</p> <p>Labour</p> <p>Travel to site,</p> <p>Carry out equipment condition assessment</p> <p>Carry out Inspection and Diagnosis of Attachment</p> <p>Repair Radiator as required,</p> <p>Top up cooling system,</p> <p>Steam clean equipment as necessary.</p> <p>JW Travel to NACCO to pick up parts. Travel to site. Loading trucks obstructing entrance, wait for access. Remove and replace overflow tank. Top up coolant. Clean excess coolant. Pressure test system, no visible leaks. Run unit and check no visible leaks. Return unit to service. Clean work area. Return pressure tester to workshops. 29Jul19</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13148		Description: HYSTER H2.5XT					
Make: HYSTER		Model: H2.5XT		Serial No.: D466R02671P			
1227454	Seat sensor not registering the weight, unit stopped in the middle of no where.	DSAY	25/07/2019	Internal	1825.0	\$0.00	Travel to site, Carry out Inspection and Diagnosis of Electrical System Labour Replace Main Electrical Panel, Fit Seat Belt, travel to site, locate unit and diagnose fault, travel to supplier to collect parts. return to site. install parts as required test unit as reported issue was intermittant. test ok.
1220619	Scheduled Service - 500Hr service 500Hr service. 0500 Hour Service	GBANKS	2/07/2019	Internal	1753.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. CARRY OUT PM SERVICE,ADJ BRAKES,PHOTOS TAKEN.GB27/19.
1219154	Smashed front light - Still in use	GBANKS	26/06/2019	External	1753.0	\$358.72	Carry out equipment condition assessment INSPECT DAMAGE,R/H HEADLAMP AND BRACKET,BLINKER LIGHT ASSY.ORDER PARTS.GB27/6/19. Travel to site, Replace Light/s REPLACE BROKEN HEADLAMP AND BRACKET,BLINKER ASSEMBLY.GB27/19.
1214514	Seat belt is jamming cant be used - Tagged out	GSINGH	11/06/2019	Internal	1681.0	\$0.00	Seat belt is jamming cant be used - Tagged out Travel to site, Carry out Inspection and Diagnosis of Electrical System Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Repair Seat Switch Wiring, travel to site, access truck to safe working area, check and rrepair seat mounts and belt issues

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13148		Description: HYSTER H2.5XT					
Make: HYSTER		Model: H2.5XT		Serial No.: D466R02671P			
1212323	Tynes are not side shifting - tagged out.	GSINGH	31/05/2019	Internal	1644.0	\$0.00	<p>Tynes are not side shifting - tagged out.</p> <p>Carry out equipment condition assessment</p> <p>Carry out Inspection and Diagnosis of Attachment</p> <p>Adjust Attachment to correct specification ,</p> <p>access truck to safe working area, check attachment, clean, lube and adjust, retighten fittings and retension hoses,</p> <p>hydraulic leak - from bottom of unit - Tagged out</p>
1205710	hydraulic leak - from bottom of unit - Tagged out	201SUBC	7/05/2019	Internal	1495.0	\$0.00	<p>07/05 - CMc sent job to BJ Hydraulics</p> <p>Carriage is so dry the tine does not want to travel in on the right side.</p> <p>Unit not locked out but it is inconvenient & impacts efficiencies for use. (SF email)</p> <p>Carry out Inspection and Diagnosis of Mast/Carriage</p> <p>Carry out Inspection and Diagnosis of Attachment</p> <p>Adjust Attachment to correct specification ,</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>travel to site, access truck to safe working area, inspect truck concerns, modify tyne positioner retainer mounts , clean and lube carriage and attachment, retension hose, operate and check ok.</p> <p>Replace steer tyres</p>
1200620	Carriage is so dry the tine does not want to travel in on the right side. Unit not locked out but it is inconvenient & impacts efficiencies for use. (SF email)	GSINGH	11/04/2019	Internal	1495.0	\$0.00	<p>Carry out Inspection and Diagnosis of Mast/Carriage</p> <p>Carry out Inspection and Diagnosis of Attachment</p> <p>Adjust Attachment to correct specification ,</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>travel to site, access truck to safe working area, inspect truck concerns, modify tyne positioner retainer mounts , clean and lube carriage and attachment, retension hose, operate and check ok.</p> <p>Replace steer tyres</p>
1180983	Replace steer tyres	201SUBC	31/01/2019	Internal	1261.0	\$0.00	<p>Fit parts not allocated to pervious service</p> <p>Travel to site,</p> <p>Replace Ignition Spark Plugs as required,</p> <p>B.W.-Travel to site.Go through security gates.Sign in.Cone off designated work area.Locate unit move to work area.Remove and replace spark plugs as required. Test units operation ok at time of test.Return to service. 15.1.19.</p>
1173974	Fit parts not allocated to pervious service	BWEBSTER	7/01/2019	Internal	1261.0	\$0.00	<p>Fit parts not allocated to pervious service</p> <p>Travel to site,</p> <p>Replace Ignition Spark Plugs as required,</p> <p>B.W.-Travel to site.Go through security gates.Sign in.Cone off designated work area.Locate unit move to work area.Remove and replace spark plugs as required. Test units operation ok at time of test.Return to service. 15.1.19.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13148		Description: HYSTER H2.5XT					
Make: HYSTER		Model: H2.5XT		Serial No.: D466R02671P			
1172881	Scheduled Service - 1000hr 1000hr. 1000 Hour Service	BWEBSTER	2/01/2019	Internal	1236.0	\$0.00	Scheduled Service - 1000hr 1000hr Service Steam clean equipment as necessary. B.W.-Locate unit moved to work area.Carried out service as required.Used van stock.Could not change sparkplugs due to did not have correct plugs in van stock.Sprayed and wiped down dash.Chunk missing from RR tyre see photos please quote. 6x9 white non marking. Test unit ok at time of test return unit to service.Clean up work area. 2.1.19.
1158960	Hose come off pulleys on mast. Maybe the pulleys shims are worn out. Repeat issue. Load guard plate missing off left hand side, this allows the tynes to move left/right - tagged - Craig 0488 578 706	AZMODA	5/11/2018	Internal	1134.0	\$0.00	Hose come off pulleys on mast. Maybe the pulleys shims are worn out. Repeat issue. Load guard plate missing off left hand side, this allows the tynes to move left/right - tagged - Craig 0488 578 706 Travel to site, Repair Attachment as necessary, Travel to site - Drill out / side plate retainer (tyne guide rail) - refill attachment hoses Must manufacture retainer guards for pulley to prevent hoses coming off . Replace blown head light globe and tighten load guard bolts . hydraulic hose has fallen off mast and wont stay there . Is using unit
1157284	hydraulic hose has fallen off mast and wont stay there. Is using unit	ALI	30/10/2018	Internal	1124.0	\$0.00	Travel to site, Repair Hydraulic Hose/s as necessary, travel to site. find unit. double check fork position & height before operate. adjust hose tensions. test ok.
1111491	Scheduled Service - Level B Service	MLAM	15/05/2018	Internal	737.0	\$0.00	Scheduled Service - Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. b service 500hr. Age scratches/marks. Tyne positioner not sliding, lubricated all relevant points. no complaints - possible cylinder valve - monitor

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13148		Description: HYSTER H2.5XT					
Make: HYSTER		Model: H2.5XT		Serial No.: D466R02671P			
1102397	Plate on the edge of the forklift right guard has snapped off - Craig 0488 578 706 - Please call with ETA.	ZKHAN	12/04/2018	External	680.0	\$221.00	Plate on the edge of the forklift right guard has snapped off - Craig 0488 578 706 - Please call with ETA. Repair Sideshift as necessary,
1092307	Pls quote as left headlight are not working (Knocked by operator) pls send to : crylands@stockwells.com.au	GDEAN	6/03/2018	Internal	581.0	\$0.00	repair broken bolt on side shift Pls quote as left headlight are not working (Knocked by operator) pls send to : crylands@stockwells.com.au Repair Light/s Attend site check unit for lights found lights out take to work area repair lights.
1078912	Tynes have jumped off carriage, Site contact Ray 0431 451 194	GBANKS	16/01/2018	Internal	540.0	\$0.00	16/04 KM - req P Barber to flip to internal as no damage found. Replaced bulb Tynes have jumped off carriage, Site contact Ray 0431 451 194 Travel to site, Carry out Inspection and Diagnosis of Attachment TYNE POSITIONER CYLINDER ROD BENT& BRACKET BROKEN OFF TYNE CRADLE. QUOTE FOR REPAIR. Labour Repair Attachment as necessary, Pick up parts at work shop travel to site remove and replace tynne positioner cylinder CK UP PARTS,TRAVEL TO SITE.REMOVE DAMAGED CYLINDER&TYNE POSITIONER BRACKET.WELD DAMAGED BRACKET.FIT NEW CYLINDER& BRACKET. LUBRICATE & TES.GB22/2/18. 23/2/2018 = P Barber As agreed B Gleeson and J Ackland customer not to be charged for repair. Refer attached email. Scheduled Service - 1000hrs
1062155	Scheduled Service - 1000hrs	GDEAN	8/11/2017	Internal	412.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Blow out radiator core, Carty out pmp service clean radiator

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13148		Description: HYSTER H2.5XT					
Make: HYSTER		Model: H2.5XT		Serial No.: D466R02671P			
1054564	Has a gas smell coming from the hose, not near the gas bottle, they would just like it looked at please - Contact Craig 0488 578 706	GBANKS	13/10/2017	Internal	362.0	\$0.00	<p>Has a gas smell coming from the hose, not near the gas bottle, they would just like it looked at please - Contact Craig 0488 578 706</p> <p>Travel to site,</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Remove ancillary items and Repair Gas Leak as necessary, Refit ancillary items,</p> <p>DIAGNOSIS UNIT,FOUND GAS LEAK AT FITTINGS ON JUNCTION BLOCK. REMOVE AND SEAL.FIT &TEST, TOP UP OIL & COOLANT.GB13/10/17.</p>
1049762	reverse beeper is not beeping site contact Craigh 0488 578 706	GDEAN	26/09/2017	Internal	349.0	\$0.00	<p>reverse beeper is not beeping site contact Craigh 0488 578 706</p> <p>Travel to site,</p> <p>Remove and Replace Reverse buzzer, Refit to unit,</p> <p>Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,</p>
1034193	Hydraulic hose has fallen off the pulley on the mast. Site contact Craig 0488 578 706	GDEAN	25/07/2017	Internal	252.0	\$0.00	<p>Attend site locate unit remove and replace reverse beeper wire to suit test ok. Hydraulic hose has fallen off the pulley on the mast. Site contact Craig 0488 578 706</p> <p>Repair Hydraulic Hose/s as necessary,</p> <p>Refit Hydraulic Hose/s and ancillary items,</p> <p>Attend site and refit hoses on pulley adjust and retension hoses, test ok, NOTE, Both units do not have bracket over pulleys to prevent hoses coming off if happens again both units need to have brackets made and welded on.</p> <p>31/7/17 T Cullen - adjustment / retensioning hoses not covered under warranty</p> <p>4/8 SM - emailed PB for clarification</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13148		Description: HYSTER H2.5XT					
Make: HYSTER		Model: H2.5XT		Serial No.: D466R02671P			
1012845	Supply and fit set of tynes \$890 each + combined \$183 labour less \$157 each Credit = \$1649 ex GST	GDEAN	3/05/2017	External	148.0	\$1,817.15	Supply and fit set of tynes \$890 each + combined \$183 labour less \$157 each Credit = \$1649 ex GST Replace Forks/Tynes, Remove tynne positioner and remove and replce tynnes refit positioner and test
1008488	FOORK TYNES REPLACEMENT	201QUOTE	11/04/2017	External	0.0	\$0.00	
1007661	UNIT NEEDS TO BE SLOWED DOWN TO 16 - 12K'S ANDREW 0447 188 255	SCOLEIRO	7/04/2017	External	115.0	\$93.00	UNIT NEEDS TO BE SLOWED DOWN TO 16 - 12K'S ANDREW 0447 188 255 ***PARTS REQUEST SENT TO SPARES FOR # 463 3774 - LC 7/4/17 Carry out Inspection and Diagnosis of Attachment 1/5 SC -located unit, inspected and found unit fitted with carburetor style intake/fuel system -advised customer no speed limiting adjustments available/possible for this model of unit -carried out safety and function test
1023779	REJECTED INVOICE - NO JOB /PO RAISED	201SUBC	6/03/2017	Internal	23.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13148		Description: HYSTER H2.5XT					
Make: HYSTER		Model: H2.5XT		Serial No.: D466R02671P			
988432	PREP FOR LTR - STOCKWELL INTERNATIONAL	201WORKSHOP	25/01/2017	Cap Prep	3.0	\$0.00	<p>H2.5XT - AL - LPG Engine Nominal Capacity-2500 kg LED Rotating Beacon - Ignition Switch Operated LPG Hoses For Australia (Must Be Selected For LPG/ Basic Light-2HD,2Turn,2Rear LED Rear Combination Lights Hyd. Control Valve - 4 Fun - Lever With Interlock Forks - CL2 STD 40x122x1070 Load Backrest - CL2 1020x1070 7.00-12 - Solid With Split Wheel 6.00-9 - Solid With Split Wheel Full Suspension With Seq Buckle I/L Mast - 3 Stg FFL 2120 / 4545 (BOF) Separate Inch/Brake Pedal Lexan Top Covers For Rain Protection ISS Carriage Including HTU - E Mast Load Weight Meter - With Load Alarm Rear Drive Handle With Horn Button Attachment Fit Up - Fork Positioner Pre Delivery Inspection - 0 - 5.5 Ton Rating Plate for Non Factory Ordered Attachments Fork Positioner - K Series 1020mm (Includes Fitup) Non Marking Tyres Hosing to Carriage Hydraulic Lift Lockout Hyster 3 Year Warranty - Standard XT</p> <p>Carry out New Equipment Predelivery to correct specification.</p> <p>Fit Attachment and ancillary items,</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>fabricate lockout for all levers except lift and lower</p>
976862	PREP FOR DEMO, HEATCRAFT	DMCDONALD	5/12/2016	Internal	3.0	\$0.00	<p>Repair Mast as necessary, PREP FOR DEMO, HEATCRAFT</p> <p>Carry out New Equipment Predelivery to correct specification.</p>
Equipment Total:						\$3,174.72	
Customer Total:						\$3,174.72	