

ADAPT-A-LIFT GROUP PTY LTD

Service History Listing Active Units

Date: 19/06/2026

Time: 11:26:59AM

For Equipment Code From: H13285 To: H13285

For Customer Code From: All To: All

For Date Posted From: All To: All

For Branch Code From: All To: All

Don't Show Cost

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1818295	Prep unit for auction	CMILLAR	16/04/2026	Internal	4467.0	\$0.00	Travel to site, Prepare For Sale - Field
1459724	DISMANTLE AND REMOVAL OF UNIT FROM ST MARYS	BIG TRUCKS NSW	29/06/2022	External	4467.0	\$19,509.61	Gathered all parts of machine. Prepared for transport and assisted with loading. Dismantle and removal of unit from St. Marys
1444054	Unit Tagged Out - Unit cracking - structural beam - major issues	DMCDONALD	13/04/2022	Internal	4467.0	\$0.00	Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,
1441281	Parts Ordered 1.4.22 - Scheduled Service - 4750 II 250hr service .0250 Hour Service	DMCDONALD	8/04/2022	Internal	4353.0	\$0.00	Labour Travel to site,
1421528	Scheduled Service - 4500hr service.	DMCDONALD	11/01/2022	Internal	4467.0	\$0.00	250hr Service Travel to site, Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Collect EWP and travel to site. Performed machine 500hr service. Lubricate ropes and all greasing points. Checked frame for any cracks. Replaced engine oil and filters. Replaced hydraulic filters. Labour Replace Engine Oil Filter, Carried out 500 hr service.. performed checks, found 4 bolts missing from rope rollers.. further diagnosis required for bolt replacement

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1402723	Booked 06.10.21 at 7.00am Scheduled Service - 250HR SERVICE	PUMINYAD	6/10/2021	Internal	4296.0	\$0.00	250hr Service Labour Travel to site, Top up cooling system, performed 250 hrs service. grease and lube unit. do safety inspection. travel to parts to pick up coolant and air filter travel to site . fit filter and top up coolant. test run unit. all good unit is back in service.
1393856	Collect spare spreader bar from site and transfer to PK	211 Planning A	4/08/2021	Internal	4054.0	\$0.00	
1303255	Unit wont start. Engine turns once and then cuts out. Possible rework of job # 1302854 - Requesting ETA via email -	ASTOKES	4/06/2020	Internal	4054.0	\$0.00	
1302854	Unit wont start. Engine turns once and then cuts out. Email. Requesting ETA	ASTOKES	3/06/2020	Internal	4054.0	\$0.00	Travel to site, Carry out Inspection and Diagnosis of Electrical System Labour
1285661	Hydraulic oil leak. Still in use. Requesting for attendance 23/03.	AMABBOTT	20/03/2020	Internal	4054.0	\$0.00	Replace Battery, Remove ancillary items and Hydraulic Hose/s, inspect and report, Labour Travel to site, Replace Hydraulic Hose/s and ancillary items, steer orbital to rear steer cylinder hose leaking. removed hose took to pirtek to get replacement made refitted new hose, tested all ok Travel to site,
1281372	Working lights to be repaired	AMABBOTT	6/03/2020	Internal	4046.0	\$0.00	Travel to site, Repair Light/s Labour Replace Light/s

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1237729	CUT DOWN CHAIN LINKS	SBHAN	3/09/2019	Internal	3298.0	\$0.00	
1237576	REPLACE BATTERY	SBHAN	3/09/2019	Internal	3298.0	\$0.00	Labour Travel to site, Replace Battery, Flat Battery . Alternator replaced but battery is N/S. Replace battery and check charging rate. Ok.
1232996	Internal repairs - Onesteel - 10-38 Forrester rd, St Marys NSW 2760	AMABBOTT	26/08/2019	Internal	3298.0	\$0.00	Travel to site, Carry out equipment condition assessment Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Labour Replace alternator, Replace Light/s Replace Lift Chain, altenator not charging 12.2v sourced alternator, replaced tested 14.2v ok work lights not working front LHS sourced work lights and repaired strobe light broken LHR sourced strobe light and replaced. oil level guage leaking. replaced repaired LHF adjusting puck threads. adjusted all pucks. sourced chains/ bolts/ weights and lugs for ropes. fitted to unit. Adjust Lift Chain to correct specification, Replace Fan Belt, Re-adjust lift chains with Combi sale rep. Measure dimensions and insure they meet customers specific requested requirements. Test lift height, Ok.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1234097	ASSEMBLE & COMMISSION UNIT AT ST. MARYS	AMABBOTT	21/08/2019	External	3298.0	\$20,372.94	Prepare For Hire - Field Mechanic AMABBOTT replaced order number AGREED STR CONTRACT with AGREED STR CONT Labour Travel to site,
1222861	Scheduled Service - 4250hr service II 250hr type.	511 Planning S	16/08/2019	Internal	3928.0	\$0.00	
1228840	DISMANTLE AND REMOVAL OF UNIT	WHILL	31/07/2019	External	3298.0	\$21,767.20	Labour Travel to qube to collect stands, blocks, lock pins and straps for dismantle of straddle following morning. Prepare For Sale - Field Prepare For Hire - Field Mechanic WHILL replaced order number SIGNED STR QUOTE with . Travelled to site. Setup work area. Carried out dehire inspection. Dismantled unit and got ready for transport. Carry out equipment condition assessment
1228187	DE-HIRE AND TYRE INSPECTION	AGALE	31/07/2019	Internal	3928.0	\$0.00	Tyre condition average, low on tread but still servicable. Photos attached to job. Cab condition good - requires cleaning. Sideshift marker bent - damage photographed. Hydraulic tank sight glass leaking oil. Noted cabin side of machine not sitting square to top of machine - damage noted to telescopic sections - puck adjusting bolts have been forced out of housings stripping threads. Will require tapping out bolt holes, new bolts, lock nuts, pucks. Also crack testing of telescopic sections when disassembled. This is customer damage due to site conditions - unit getting bogged and being dragged out by trucks. Multiple photos attached. Engine serpentine belt tensioner required. Cracking in cross member mounting brackets - multiple loose bolt stretched from excess force.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1214408	Unit is overheating. Tagged out. URGENT	AGALE	11/06/2019	Internal	3915.0	\$0.00	Unit is overheating. Tagged out. URGENT Blow out radiator core, Carry out equipment condition assessment Proceed to site, inspect machine - coolant level ok, belt tensioner needs replacement as previously reported. Radiator found to be blocked by mud as photographed. Cleaned out radiator and intercooler. Ran unit until operating temperature reached - engine no longer over-heating.
1201038	Scheduled Service - 4000hr service- INCLUDING ROPES	WHILL	23/05/2019	Internal	3928.0	\$0.00	Scheduled Service - 4000hr service- INCLUDING ROPES 4000hr Service, Labour Travel to site, Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1208097	Hydraulic oil leak	WHILL	15/05/2019	Internal	3827.0	\$0.00	Hydraulic oil leak Check/Inspect/Diagnose Hydraulic Oil Leak and test operation, Labour Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,
1208091	Repair camera - inoperable	WHILL	15/05/2019	Internal	3827.0	\$0.00	Repair camera - inoperable Travel to site, Carry out Inspection and Diagnosis of Electrical System Labour
1207480	Broken inside mirror	WHILL	13/05/2019	External	3827.0	\$101.50	Broken inside mirror Travel to site, Remove ancillary items and Mirror and Replace, Refit Mirror and ancillary items, Repleaced broken mirror

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1202233	Hydraulic fluid is running low - Still in use	PCHUNG	18/04/2019	Internal	3751.0	\$0.00	Hydraulic fluid is running low - Still in use Travel to site, Top up Hydraulic Oil to correct level,
1200728	Airconditioning in cab not working. Door is hanging on one hindge. Mirror inside cab broken. Still in use. ETA requested.	WHILL	12/04/2019	External	3827.0	\$1,277.08	TRAVEL TO SITE,CHECK & TOP UP HYD.OIL Airconditioning in cab not working. Door is hanging on one hindge. Mirror inside cab broken. Still in use. ETA requested. Travel to site, Repair Air Conditioner as necessary, Labour NOT CHARGEABLE. Travelled to site and located unit. Found all doors intact. Inspected and confirmed a/c fault. Removed and cleaned panel filter. Removed covers and found ducting had rotted through. Sourced new parts and returned to site. Repaced all front a/c ducting. Refitted all parts and rechecked operation. Scheduled Service - 3750hr service II 250hr type
1191208	Scheduled Service - 3750hr service II 250hr type. Level A Service	511 Planning S	29/03/2019	Internal	3624.0	\$0.00	
1193729	AFTER HOURS CALL OUT	WHILL	19/03/2019	External	3659.0	\$377.00	TECHNICIAN INITIATED JOB Travel to site, Repair Attachment as necessary, FRONT TWISTLOCKS LOCKED ON. Travelled to site and located unit. Confirmed fault. Front twistlocks locked on and overridden landing locks. Spurred clamps and returned to site. Fitted clamps and released twistlocks. Removed end covers and inspected landing locks. Unable to fault. Refitted all parts and got customer to unload multiple boxes. Unable to repleat fault.
1190873	2 front twist lock are locked on - call Gary first on 0408 860 400	DBARNARD	7/03/2019	Internal	3624.0	\$0.00	2 front twist lock are locked on - call Gary first on 0408 860 400 Carry out Inspection and Diagnosis of Attachment Repair Attachment as necessary,

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1190391	AFTER HOURS CALL OUT	DBARNARD	6/03/2019	External	3624.0	\$152.00	<p>TECHNICIAN INITIATED JOB</p> <p>Repair Attachment as necessary,</p> <p>called in 11pm 5-3-18 on site 11:15</p> <p>travel tosite,located unit and inspect. Twistlocks locked at one end ,have overridden landing locks. inspect attachment, fit clamps to all landing pins to simulate landing on container. unlock all twistlocks, remove clamps and refit end beam cover plate. get customer to begin unloading containers. customer carried out load/unload on 4 containers. ok.</p>
1186609	REPAIR HYDRAULIC OIL LEAK AT PUMP	WHILL	19/02/2019	Internal	3567.0	\$0.00	<p>REPAIR HYDRAULIC OIL LEAK AT PUMP</p>
1186425	hydraulic leak	WHILL	19/02/2019	Internal	3584.0	\$0.00	<p>Duplicate - refer to 1186425 hydraulic leak</p> <p>Travel to site,</p> <p>Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,</p> <p>Remove ancillary items and Hydraulic Hose/s, inspect and report,</p> <p>Labour</p> <p>Replace Hydraulic Hose/s and ancillary items,</p> <p>Travelled to site and located unit. Traced 2 hoses from hydraulic control valve going to bulk head. Removed all panelling and removed hoses. Got hoses made up and returned to site. Returned to site and fitted. Rechecked unit and found a steering hose leaking past the crimps. Reemoved paneling and fitted new hose. Routed and refitted all parts. Cleaned up extensive leakage and refitted all parts.</p> <p>Repair Hydraulic Hose/s as necessary,</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1181957	UNABLE TO CHECK HYDRAULIC LEVEL.. POSSIBLE STEERING ISSUE, OIL LEAK.	CCLARKE	5/02/2019	Internal	3567.0	\$0.00	<p>UNABLE TO CHECK HYDRAULIC LEVEL.. POSSIBLE STEERING ISSUE, OIL LEAK.</p> <p>Labour</p> <p>Travel to site,</p> <p>Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,</p> <p>Top up Hydraulic Oil to correct level,</p> <p>travelled to site topped up hydraulic oil diagnosed hydraulic leak organised a time to do it ordered sight glass</p> <p>Replace Hydraulic Hose/s and ancillary items,</p> <p>further inspect unit to get correct hose. return at nominated time, removed steer hose from valve to hyd control valve, have new hose made. returned to site, fit new hose, and tested ok.</p> <p>Check/Inspect/Diagnose Cylinder</p> <p>removed old sight glass installed new one tested</p> <p>Carry out Inspection and Diagnosis of Attachment</p> <p>customer complained about hydraulic oil level travelled to site inspected oil level is fine showed correct way to check TECHNICIAN INITIATED JOB</p>
1180198	AFTER HOURS CALL OUT	DBARNARD	29/01/2019	External	3526.0	\$195.00	<p>Repair Ignition Circuit as required,</p> <p>travel to site located unit and inspect. after checking several items, found issue with plugs to injector pump. remove all loom plugs, clean and refit. tested unit ok. Outstanding Scissor Lift Invoice - Ref Job #1152525</p>
1178886	Outstanding Scissor Lift Invoice - Ref Job #1152525	BIG TRUCK VIC	23/01/2019	Internal	3496.0	\$0.00	<p>Outstanding Scissor Lift Invoice - Ref Job #1152525</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1175271	CAMERA INTERMITTANTLY NOT WORKING & HORN NOT LOUD ENOUGH	CCLARKE	10/01/2019	Internal	3496.0	\$0.00	<p>CAMERA INTERMITTANTLY NOT WORKING & HORN NOT LOUD ENOUGH</p> <p>Travel to site,</p> <p>Carry out Inspection and Diagnosis of Attachment</p> <p>Fit Speakers to Equipment,</p> <p>travelled to site had to wait for unit replaced horn camera is working fine maybe operator is accidentally changing settings, will show them how to fix</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1173981	Scheduled Service - Level B Service	CCLARKE	7/01/2019	Internal	3491.0	\$0.00	<p>Scheduled Service -</p> <p>Travel to site,</p> <p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p> <p>carried out 500 hour service greased adjusted legs needs new proximity sensor needs cab fan</p> <p>Repair Air Conditioner as necessary,</p> <p>Repair Attachment as necessary,</p> <p>Labour</p> <p>Carried out pm service. Repaired twisted hydraulic fihose to top loader. Repaired adrift a/c switches and cleaned clogged panel filter.</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>Replace Switch/es</p> <p>installed container guides travelled to parts to get new height limiting proximity switch returned installed switch and tested adjusted seat switch camera is now working also</p>
1168250	air con is leaking water from the vent to his head . Is using unit still	ANAI DU	6/12/2018	Internal	3469.0	\$0.00	<p>air con is leaking water from the vent to his head . Is using unit still</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Repair Air Conditioner as necessary,</p> <p>- Reseal top glass and air con frame . - Tested all ok</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1167094	Repair Damaged items	ANAIDU	4/12/2018	Internal	3496.0	\$0.00	Quote for damaged items. Replace damaged Side, front, and rear guide plates. Replace damaged work lights. Replace damaged Strobe lights. Straighten beny side shift guides. Replace damaged and broken PUK bolts. Repair Light/s Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Travel to site, Replace Light/s Labour Repair Attachment as necessary,
1167059	Repairs to unit for new rental	ANAIDU	3/12/2018	Internal	3469.0	\$0.00	Repair Light Circuit as required, Reolace all 4 tyres. Steam clean unit Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Asssisted Arune with puck bolt repairs and adjustment - Remove and replace damagee puk bolts . Drill andRetap bolt holes - Adjust puk bolts -Tested All ok

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1167058	Cost for Straddle Transport and installation	ANAI DU	3/12/2018	External	3491.0	\$34,754.02	<p>Cost for Straddle Transport and installation</p> <p>JCB have quoted teh transport.</p> <p>Hydralift is booked for teh Pull down at Target at 7am on teh 17th.</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>Repair Attachment as necessary,</p> <p>Prepare For Hire - Field</p> <p>Prepare For Sale - Field</p> <p>Travel to site,</p> <p>Labour</p> <p>Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,</p> <p>Travelled to site and setup work area. Assembled straddle acarrier and fitted top loader assembly. Repaired wiring to top loader and ftightened loose twistlock fittings. Cleaned up unit and fitted guide plates. .</p>
1164872	twist lock is on and locked on cannot use unit . The contact is Peter 0435 667 599	ANAI DU	26/11/2018	Internal	3420.0	\$0.00	<p>twist lock is on and locked on cannot use unit . The contact is Peter 0435 667 599</p> <p>Carry out Inspection and Diagnosis of Attachment</p> <p>Repair Attachment as necessary,</p> <p>- lub and grease twist lock</p> <p>- Check operation , Tested all ok.</p>
1164836	Drivers side window shattered during normal operation - unknown cause. John - 0431 239 880. Still in use.	ANAI DU	26/11/2018	Internal	3402.0	\$0.00	<p>Drivers side window shattered during normal operation - unknown cause. John - 0431 239 880. Still in use.</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>- ordered new window (Darren trug) 27/11</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1163711	Unit did not click over. We changed the battery & the alternator, this did not fix it - not operational.	SMAUGER	21/11/2018	Internal	3405.0	\$0.00	<p>Unit did not click over. We changed the battery & the alternator, this did not fix it - not operational.</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,</p> <p>- Check unit , unit was in operation . Check Alternator and battery . Alternator charging ok . - unable to fault the issue</p> <p>unit requires new starter</p> <p>Labour</p>
1162189	Container not disengaging / engaging properly. Still in use. Steve - 0438 498 610.	GHORNE	16/11/2018	Internal	3343.0	\$0.00	<p>started borrowed from seaway. Container not disengaging / engaging properly. Still in use. Steve - 0438 498 610.</p> <p>Travel to site,</p> <p>Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,</p> <p>Checked & found connection for sensors loose. Fixed connection & tested all good. TECHNICIAN INITIATED JOB</p>
1162064	Machine not starting	GHORNE	16/11/2018	Internal	3402.0	\$0.00	<p>Travel to site,</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Labour</p> <p>Replace alternator,</p> <p>Checked battery all ok. Checked altinator & found it was putting out only 12.4 volts. Went to Seaways & removed Altinator from Dehired Straddle & bought back & fitted to Target Straddle. Tested all good.</p> <p>Fitted new Altinator & tested all good. Ran machine to charge battery as machine has been moved since Altinator was removed.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1161630	Battery is not working	PBORG	15/11/2018	Internal	3335.0	\$0.00	<p>Battery is not working</p> <p>Remove ancillary items and Remove Battery from unit and Inspect and report,</p> <p>Repair Battery terminal/s as required,</p> <p>Labour</p> <p>Replace Battery,</p> <p>Travel to site carry out site induction locate unit inspect unit for flat battery jump start unit check charging system found charging 13.7 volts check unit for draining battery found unit ok travel to pick up parts return to sire supply and fit new battery tested unit and returned unit back to customer.</p>
1160310	TECHNICIAN INITIATED JOB	SWILSON	12/11/2018	Internal	3299.0	\$0.00	<p>TECHNICIAN INITIATED JOB</p> <p>Travel to site,</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Repair Starter Circuit as required,</p> <p>sign in , induction,customer reported that it struggled to start and had to jumpstart unit, investigate fault unit was running when located starts good check alternator input 13.7v which is good. check amps with unit off and isolater out found unit still drawing power investigate further found isolator cables loose and touching each other re route tidy and secured, also secured battery as was loose, terminals close to chassis put thick cardboard to avoid contact. tested good return to service.</p>
1159439	speed is idiling and not effecient also noise coming from unit like its sluggish and on ts last legs. The contact is Peter 0435 667 599 please call Steve Douglas	SMAUGER	7/11/2018	Internal	3102.0	\$0.00	<p>speed is idiling and not effecient also noise coming from unit like its sluggish and on ts last legs. The contact is Peter 0435 667 599 please call Steve Douglas</p> <p>Travel to site,</p> <p>Repair Diesel injectors as required,</p> <p>unit has eratic idle and is producing a lot of soot.requires new injectors.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1158580	Service Call Out	GHORNE	3/11/2018	External	3240.0	\$302.00	Service Call Out Travel to site, Repair Attachment as necessary,
1154122	Fuel Issue	GHORNE	18/10/2018	Internal	3102.0	\$0.00	Locks jammed . Freed up locks & tested all good. Fuel Issue Labour Travel to site,
1152525	Hydraulic arm has been bent. Pls assess. Diesel guage is stuck on empty	ANAIDU	12/10/2018	External	2995.0	\$5,728.25	Refuel Unit Hydraulic arm has been bent. Travel to site, Carry out Inspection and Diagnosis of Attachment Labour Repair Attachment as necessary, replace 20/40 cylinder. clean unit. Remove ancillary items and Attachment Cylinder , Strip, Inspect and report, Replace Attachment Cylinder , Repair Attachment Cylinder as necessary ,

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1152261	schedule service Level B Service	ANAIDU	11/10/2018	Internal	3069.0	\$0.00	<p>schedule service</p> <p>Travel to site,</p> <p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>- Cabin side tyres on wear limit , needs new tyres - puk needs readjustment , and replace broken bolts -</p> <p>carry out pm svc. replace 5 broken frame bolts all ok.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1149089	Not starting	ANAIDU	1/10/2018	External	2995.0	\$9,915.37	<p>Not starting</p> <p>Travel to site,</p> <p>Replace Battery,</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>- travel back to site with new battery, customer claimed to be too busy. - Have to fit battery another day</p> <p>Remove ancillary items and Fuel Filter and Replace, Refit Fuel Filter and ancillary items,</p> <p>Check/Inspect/Diagnose Fuel system, bleed Fuel system to remove air,</p> <p>- Replace battery -</p> <p>-Unit still has fuel issue . - Replace both fuel filters - Add fuel Additive in diesel tank to prevent from microbial growth in tank . - Replace fuel filter Again 3/10 /18 found filters bit cleaner than before.</p> <p>take fuel sample. fill filters with clean fuel bleed ok</p> <p>Replace Primary Diesel Filter as necessary,</p> <p>Replace Secondary Diesel Filter as necessary,</p> <p>- Remove both diesel filters and inspect , found still lot of contaminates in the Tank . - Replace both primary and secondary diesel filters on 4/10 /18 - Diesel tank needs to be removed and clean with pressure wash</p> <p>Clean Diesel Tank as required,</p> <p>Flush Fuel System and lines as required,</p> <p>- Drain and remove diesel tank .</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001 Equip. Code: H13285 Description: COMBILIFT SC3T - CHAINLIFT Make: COMBILIFT Model: SC3T Serial No.: 26036							
							- Took the diesel tank trug workshop and clean the tank high pressure wash . - found jerry can filler nozzle inside tank, remove filler nozzle - refitted tank - replace new diesel filters - Refuel unit with diesel whatever they had onsite . added fuel treatment - Tested unit , all ok . - - Bleed Fuel Pump to remove air, Bleed Fuel System to remove air, - check and inspect unit , unit runs ok ,, had no issue with starting . - ordered new fuel sender unit . 8/10 Repair Main Electrical Control Panel as necessary, - Remove and Replace new fuel sender gauge . - Tested all ok Losing power when lifting - Unit not workikng - seems like fuel issue again - Site Contact: Steve 0407 498 610
1148274	Losing power when lifting - Unit not workikng - seems like fuel issue again - Site Contact: Steve 0407 498 610	ANAI DU	26/09/2018	Internal	2905.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1147477	URGENT - Fuel doesn't appear to be going through - won't start - Production has stopped - Site Contact: Steve 0407 498 610	ANAIDU	24/09/2018	External	2995.0	\$4,354.22	<p>URGENT - Fuel doesn't appear to be going through - won't start - Production has stopped - Site Contact: Steve 0407 498 610</p> <p>Travel to site,</p> <p>Check/Inspect/Diagnose Fuel system, bleed Fuel system to remove air,</p> <p>Rebled fuel sysytem & cleaned fuel cap. Ran machine under load for 20 min with no problems.- Will order new fuel cap for machine.</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Remove ancillary items and Fuel Filter and Replace, Refit Fuel Filter and ancillary items,</p> <p>Bleed Fuel System to remove air,</p> <p>- Replace fuel filter , found fuel filter clogged up with dirt . - Need to drain fuel and remove tank and clean the tank . - customer has previously putting contaminated fuel in the unit which is causing all the fuel issue .</p> <p>Mechanic ANAIDU replaced order number Ed to supply with 921 patrick</p> <p>Clean Diesel Tank as required,</p> <p>Refuel Unit</p> <p>- Drain fuel from the tank and flush with clean diesel . Notice lots of contimians and found marble in the tank . REFER IMAGE attached to job - Replace both fuel filters and blew out fuel line - Customer supplier Diesel - Tested unit , All ok .</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1146451	Warning light coming on - overheating again - Site Contact: Steve 0407 498 610	SMAUGER	19/09/2018	Internal	2905.0	\$0.00	<p>Warning light coming on - overheating again - Site Contact: Steve 0407 498 610</p> <p>Repair Radiator as required,</p> <p>radiator is internally blocked need to remove and reco or get new radiator. radiator part number is spk00133. have flushed again again and refilled.</p> <p>Labour</p> <p>Travel to site,</p> <p>Remove ancillary items and remove Radiator from unit, Inspect and report,</p> <p>Replace Radiator,</p> <p>Bleed cooling system and remove air locks</p> <p>- Replace new radiator , bleed cooling system - Tested unit , all ok</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1143573	leaking hydraulic fluid - tagged out- steve 0407 498 610	SMAUGER	7/09/2018	Internal	2012.0	\$0.00	leaking hydraulic fluid - tagged out- steve 0407 498 610 Travel to site, Check/Inspect/Diagnose Cylinder Repair Steering Cylinder as necessary, carry out site induction run and test for oil leaks found rope cylinder leaking (advise marsha) NOTE this cylinder was repaired on the 26/7/18 job number 1132365 Site Contact is Patrick Lee 0447 599 429 Scissorlift and crane being organised for Monday Check/Inspect/Diagnose Hydraulic Oil Leak and test operation, Replace Left Lift Cylinder, Remove ancillary items and Lift Cylinder, Strip, Inspect and report, remove upper rope cylinder and replace with repaired rope cylinder. repair carried out by finer hydrauliccs. fault is the same spot they repaired approx eight weeks ago.
1143360	Overheating and cutting out multiple times - contact Patrick Lee 0447 599 429 once on site	SMAUGER	6/09/2018	Internal	2802.0	\$0.00	Labour Overheating and cutting out multiple times - contact Patrick Lee 0447 599 429 once on site Replace Thermostat, replace thermostat. flush cooling system test ok.
1133269	Scissorlift hire for Job 1102018	921SUBC	31/07/2018	Internal	2323.0	\$0.00	Scissorlift hire for Job 1102018

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1132701	500 hour service Level B Service	SMAUGER	27/07/2018	Internal	2522.0	\$0.00	500 hour service Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1132365	Oil leak	SMAUGER	26/07/2018	Internal	2522.0	\$0.00	carry out svc Oil leak Check/Inspect/Diagnose Hydraulic Oil Leak and test operation, drivers side oil leak on rope cylinder at external manifold. need to remove cylinder and have repaired. cylinder will require a crane to lift off due to weight. Crane is booked for 8am on the 1st Finner Hydraulics booked to pick up cylinder at 9am on the 1st. Scissor lift is booked for the 1st. rh rope cylinder has cracked/porous weld. Travel to site, Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, remove leaking rope pulley. instal repaired rope cylinder
1122285	Attachmaent is stuck in a box	ANAIDU	21/06/2018	Internal	2313.0	\$0.00	Dont post:awaiting crane and scissor hire cost Attachmaent is stuck in a box Carry out Inspection and Diagnosis of Attachment Repair Attachment as necessary, - Unable to fault any issues with the attachment . All twist locks working ok . - Tested all ok - Operator Error

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1120377	Bolt come off	ANAIDU	14/06/2018	Internal	1996.0	\$0.00	<p>Bolt come off</p> <p>Carry out Inspection and Diagnosis of Attachment</p> <p>Have to make a time with site , and also need EWP for repair</p> <p>All tested ok</p>
1122314	Scissor lift hiire for job number 1116399	921SUBC	1/06/2018	Internal	1996.0	\$0.00	
1116399	Twist lock not working at all and unit made a massive bang and they cannot work out where its coming from.	SMAUGER	1/06/2018	Internal	1996.0	\$0.00	<p>Twist lock not working at all and unit made a massive bang and they cannot work out where its coming from.</p> <p>Travel to site,</p> <p>Repair Attachment as necessary,</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>twist locks not working. remove hyd cylinder from front twist lock. manually hold pins up to put unlocked position. place on container and retract hys cylinder and reattach cylinder to twist lock assy. test ok. re attach top window with sikaflex. could not reproduce fault with banging on lowering. suspect att guide lug hooked up on upper cross member due to att not being horizontal. this is operator error. check all chassis fastening bolts.</p> <p>Carry out Inspection and Diagnosis of Attachment</p> <p>Repair Overhead Guard as necessary,</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1110340	When bring load down unit vibrating and consequently right hand side window shattered	ANAIDU	11/05/2018	External	2323.0	\$3,796.40	<p>When bring load down unit vibrating and consequently right hand side window shattered</p> <p>Travel to site,</p> <p>Check/Inspect/Diagnose Cylinder</p> <p>Carry out Inspection and Diagnosis of Attachment</p> <p>Do not post until we get a PO from the customer. This window was broken due to driver error.</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>take top glass template to a1 windscreens</p> <p>replace broken side window.</p> <p>top window not replaced as it was unable to be removed.</p> <p>This damage was caused due to the operator raising one end of the attachment all the way to the top and then the other end. Attachment would then slip under the top frame causing a huge vibration.</p> <p>14/8/2018 Dt has sent an email to Edwin for a PO number.</p> <p>Requested PO from Edwin - BM 31/08/2018</p> <p>Edwin has not supplied a PO so jon to be invoice with Edwins name.</p>
1121474	Scissor Lift Hire for job number 1109502	921SUBC	9/05/2018	Internal	1996.0	\$0.00	
1109506	Saturday Service costs	ANAIDU	9/05/2018	External	1978.0	\$2,582.00	<p>Saturday Service costs</p> <p>- Carried out 500hrs service as required Complted a full service as required.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1109502	Service 500 hours Level B Service	SMAUGER	9/05/2018	Internal	1981.0	\$0.00	<p>Service 500 hours</p> <p>- Carried out 500 hrs service as required. - unable to grease and lub on attachment , pulleys etc , due to scissor lift broken down . - Need to re schedule with customer for another day to finish the service .</p> <p>Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,</p> <p>carry out pm svc.</p> <p>Travel to site,</p> <p>Replace Steering Cylinder,</p> <p>Repair Steering Cylinder as necessary,</p> <p>- Replace rear steer cylinder . - Bleed steer cylinder - Tested all ok .</p> <p>Repair Steering as necessary,</p>
1107653	Tynes wont release load, Steve 0407 498 610	SMAUGER	2/05/2018	Internal	1976.0	\$0.00	<p>replace damaged steer cylinder Tynes wont release load, Steve 0407 498 610</p> <p>Travel to site,</p> <p>Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,</p> <p>Scissor lift invoice still to come in. DT 9/5/2018</p>
1106927	Arms locked onto a container and won't release. Site contact Steve 0407 498 610	SMAUGER	1/05/2018	Internal	1870.0	\$0.00	<p>No Scissorlift used on this job - BM 09/05/2018 Arms locked onto a container and won't release. Site contact Steve 0407 498 610</p> <p>Travel to site,</p> <p>Repair Attachment as necessary,</p> <p>twist locks at front jammed at 45 degrees. disassemble and lube twist locks. reassemble test ok</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1106330	URGENT - Won't start - Unit is critical and needed for the weekend - Site Contact: Edwin Lee 0419 973 738 - Please callback with an ETA	ANAIDU	27/04/2018	External	1965.0	\$1,715.00	<p>URGENT - Won't start - Unit is critical and needed for the weekend - Site Contact: Edwin Lee 0419 973 738 - Please call back with an ETA</p> <p>Travel to site,</p> <p>Check/Inspect/Diagnose Fuel system, bleed Fuel system to remove air,</p> <p>unit had blocked fuel filters due to contaminated diesel . has possible fuel pump issue. all ok now.</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Remove ancillary items and Fuel Filter and Replace, Refit Fuel Filter and ancillary items,</p> <ul style="list-style-type: none"> - Replace both fuel filters , - Tested all ok . - If unit still having issues , need to call john Deere to diagnose the engine side . <p>This was completed outside of normal working hours as requested by Edwin.</p> <p>Emailed Edwin asking for a PO number 22/5/2018. DT Emailed Edwin asking for a PO number 30/5/2018. DT</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1102018	Exposed wires on lifting table and loose bolts at top of it . Please check for damage	ANAIDU	11/04/2018	Internal	1859.0	\$0.00	<p>Exposed wires on lifting table and loose bolts at top of it . Please check for damage</p> <p>Carry out Inspection and Diagnosis of Attachment</p> <p>Travel to site,</p> <p>Repair Attachment as necessary,</p> <p>Assisted Arun with replacement of ropes .</p> <p>Labour</p> <ul style="list-style-type: none"> - Remove and Replace all four frayed Ropes . - Horizontal rope pulley pins seized . Free and lubricate pins . - Adjusted front proximity sensor on attachment for soft landing - Tested all ok - Front and rear tyres close to wear limit - pucks bolts broken , need to adjust pucks, got excessive ply
1097977	Broken right rear light	ANAIDU	27/03/2018	External	1507.0	\$314.00	<p>Broken right rear light</p> <p>Travel to site,</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Replace the two rear damaged work lights with new. We will do this at the same time as other repairs so that we can utilize the scissor lift.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1097976	No green light to indicate container is locked in. at max height contrainer dops on one side, still leaking hyd. fluid, fuel gauge playing up - getting difficult to start each morning	ANAI DU	27/03/2018	Internal	1862.0	\$0.00	<p>No green light to indicate container is locked in. at max height contrainer dops on one side, still leaking hyd. fluid, fuel gauge playing up - getting difficult to start each morning</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Remove ancillary items and Fuel Filter and Replace, Refit Fuel Filter and ancillary items,</p> <p>Carry out Inspection and Diagnosis of Mast/Carriage</p> <p>- need to organise scissor lift to repair oil leak . Parts have arrived in spare part .</p> <p>- Replace fuel filters which should solves starting issue. Found lots of dirts in filter. Could be dirty fuel tank which is stored on site.</p> <p>Travel to site,</p> <p>Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,</p> <p>replace inner rear proxy and bracket for twistlocks due to not seeing twistlocks moving. bracker brocken and proxy badly damaged. test ok. grren light working.</p>
1112608	Replace damaged guide plates	921QUOTE	9/03/2018	External	1979.0	\$0.00	<p>Replace damaged side and rear guid plates.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1093260	Inspect damage to back brackets on attachment	ANAIDU	9/03/2018	External	1507.0	\$7,374.98	<p>Inspect damage to back brackets on attachment</p> <p>Carry out Inspection and Diagnosis of Attachment</p> <ul style="list-style-type: none"> - Inspected attachment , found guide plate damage (L/H/R) , need to order new guide plate. - Tele puk bolts damage and bent , need to re-tap next size up and replace damage bolts . Lot of ply between inner and outer tele tube . All 4 tele post needs readjustment . - L/H/R steering cylinder oil leak , chrome rod damage . needs new steer cylinder - 2 x rear working light damage , needs new light <p>This quote has been raised for the following.</p> <ul style="list-style-type: none"> 2 x side guide plates. (damaged) 3 x end guide plates. (damaged) 2 x work lights (damaged) 1 x rear steer cylinder (damaged) 20 x puk bolts. They need to be removed and larger ones fitted as holes have been damaged. <p>Edwin has asked that we put teh damaged container guides onto another quote to be done at a later date.</p> <p>Labour</p> <p>Travel to site,</p> <p>Replace Hydraulic Control Valve,</p> <p>Repair Attachment as necessary,</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>adjust pucks and repair puck bolts. replace broken lights</p> <p>repair broken bolts and adjust all pucks test ok</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1092039	overheating hydraulics	ANAI DU	5/03/2018	Internal	1507.0	\$0.00	overheating hydraulics Carry out Inspection and Diagnosis of Electrical System Check/Inspect/Diagnose Cylinder Blow out radiator core, - Blow off hydraulic cooler , Tested operation - check wiring and loose connectins - Unable to fault unit overheating hydraulics . all ok Quote for guide rollers repair
1090789	Quote for repair to side and rear container guides	921QUOTE	28/02/2018	External	1496.0	\$0.00	28/02/2018 - Berg Quote send and awaiting approval/ PO Leaks over engine bay and another at drive wheel, TV working intermittently, window wipers not working, AC requires inspection and giudes on lift mechanism have bent bolts - Contact Wallena 408 613 3
1089135	Leaks over engine bay and another at drive wheel, TV working intermittently, window wipers not working, AC requires inspection and giudes on lift mechanism have bent bolts - Contact Wallena 408 613 3	ANAI DU	23/02/2018	Internal	1496.0	\$0.00	Check/Inspect/Diagnose Hydraulic Oil Leak and test operation, Replace Fan Belt, Carry out Inspection and Diagnosis of Attachment Carry out Inspection and Diagnosis of Electrical System Repair Windscreen Wiper as necessary, Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Scheduled service
1084680	Scheduled service Level B Service	ANAI DU	7/02/2018	Internal	1496.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Repair Windscreen Wiper as necessary, Repair Light/s
1082185	Sub Con Charges for 1066245 and 1071904	921SUBC	30/01/2018	Internal	1248.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1073226	Still leaking oil	SMAUGER	18/12/2017	Internal	1248.0	\$0.00	<p>Still leaking oil</p> <p>Travel to site,</p> <p>Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,</p> <p>repair oil leak</p> <p>Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,</p> <p>requires hose repair</p> <p>Labour</p> <p>Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,</p> <p>repair oil leak athyd return line fitting on big wheel hyd motor</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1071904	Unit is leaking fuel from the fuel filter. Air Con in not working again. Sub contractor has been booked	GHORNE	12/12/2017	Internal	1169.0	\$0.00	<p>Unit is leaking fuel from the fuel filter. Air Con in not working again. Sub contractor has been booked</p> <p>Travel to site,</p> <p>Remove ancillary items and repair Engine Oil Leaks as required, Refit ancillary items,</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Carry out Inspection and Diagnosis of Attachment</p> <p>Tightened up all filters. Found oil coming from side of motor where return line goes in. Tightened up plate. Tightened up bolts on drive motor left rear. Checked twist locks no fault found. Drive motor right side hose has broken & needs to be replaced. Also found out that machine put a container into a Rollershutter damaging the shutter quite badly.</p> <p>Remove ancillary items and Hydraulic Hose/s, inspect and report,</p> <p>Replace Hydraulic Hose/s and ancillary items,</p> <p>Stripped down hydraulic hose & fitting ready for hose to repair. Hose repaired & new fittings supplied. Fitted up & tested all good.</p>
1067753	Replace to Right hand rear rope pully	ANAIDU	28/11/2017	Internal	1086.0	\$0.00	<p>Replace to Right hand rear rope pully</p> <p>Repair Carriage as necessary,</p> <p>instal new rope roller. lube att.</p>
1066245	1000 Hour Service	ANAIDU	22/11/2017	Internal	1086.0	\$0.00	<p>Repair Mast as necessary, 1000 Hour Service</p> <p>Travel to site,</p> <p>1000hr Service</p> <p>Carry out Inspection and Diagnosis of Attachment</p> <p>Repair Attachment as necessary,</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1066243	Replace damaged Strobe and Work light	ANAI DU	22/11/2017	External	1086.0	\$1,167.00	<p>Replace damaged strobe lights x 2 Replace damaged work lights x 4 Half price scissor lift hire</p> <p>Travel to site,</p> <p>Replace Revolving/Flashing/Strobe light,</p>
1066143	guide Rollers need to be taken off to access container and then be put back on site contact Wallena Matoe - 03 5246 3454	ANAI DU	21/11/2017	External	888.0	\$1,599.50	<p>Repair Light/s guide Rollers need to be taken off to access container and then be put back on site contact Wallena Matoe - 03 5246 3454</p> <p>Travel to site,</p> <p>Carry out Inspection and Diagnosis of Attachment</p> <p>Repair Attachment as necessary,</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <ul style="list-style-type: none"> - customer Notice few bearing on ground , suspect rope pulley bearing . - Puk bolts bent - 4 x Led light damage and broken - 1 x strobe light damage - oil leak from drive wheel R/H S - Air con not working -Front guide plate bent x2 and 2 missing .
1056912	TECHNICIAN INITIATED JOB	AMACNEIL	20/10/2017	External	746.0	\$632.00	<p>job posted as per confirmation from D.T - THIS NOTE HAS BEEN ADDED AFTER THE JOB HAS BEEN POSTED TECHNICIAN INITIATED JOB</p> <p>Repair Mast as necessary,</p> <p>travel to site for brakedown. left side container lock not operating. located unit. found lock rod pin broken. rod had jumped off container lock. fit rod back fit bolt instead of pin to get unit operational. will need pin replaced monday also customer complained lights dont work some times air con not working sideshift still not working finish off service to unit. PO number 201017WM</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1055682	Air conditioner not working - One of the LED light on the back not working - Site Contact: Wallena 0408 613 322	SMAUGER	17/10/2017	Internal	628.0	\$0.00	Air conditioner not working - One of the LED light on the back not working - Site Contact: Wallena 0408 613 322
1053777	Boom pins wont release container, Site contact Chris 0401 195 646 pls call prior to visit	SMAUGER	11/10/2017	External	882.0	\$6,974.25	<p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <ul style="list-style-type: none"> Went to site to inspect unit that was not unlocking from a box. Found attachment was locked in to a box due to the side shift cylinder being damaged. Unlocked attachment from box. Blocked off side shift cylinder so that the unit can operate. The side shift cylinder pipe have been hit and damaged . Replace the side shift cylinder with new. Replace 4 x broken work lights. Hire of Scissor lift so that we can get to the cylinder. Cylinder will need to be ordered in from SA once we receive a PO. At this stage the straddle is working however there is no side shift on the front that may cause an issue in lining up boxes. <p>We would appreciate if you could supply a PO number at your earliest convenience so that we can order the parts and have the unit repaired.</p> <p>PO was supplied on te 16/10/2017. Emailed Spare Parts to order the parts on 17/10/2017</p> <p>Replace Sideshift Cylinder,</p> <p>Replace Light/s</p> <p>Repair Light Circuit as required,</p> <p>Replace sideshift cylinder and repair light . -Tested all ok . - 2 x Strobe light damaged and broken and 1x headlight damaged .</p> <p>posted as per confirmation from D.T - this note has been added after the job has been posted.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1049722	hydraulic arm has come out of front mask. Site Contact Chris 0401195646	ANAIDU	26/09/2017	Internal	628.0	\$0.00	hydraulic arm has come out of front mask. Site Contact Chris 0401195646 Travel to site, Check/Inspect/Diagnose Cylinder Repair Attachment Cylinder as necessary, - Repair attachment cylinder . - Repair light swicht . - Lub attachment , very dry . - oil leak from drive wheel , need to clean and check . - Drives slow with telescopic cylinder up .
1049070	Damaged light	ANAIDU	22/09/2017	External	618.0	\$933.00	Damaged light Travel to site, Carry out Inspection and Diagnosis of Electrical System Repair Light/s Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, Repair and replace light . Repair light bracket .
1040028	250 Hour Service	ANAIDU	17/08/2017	Internal	500.0	\$0.00	tested All ok 250 Hour Service 250hr Service Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1023909	Scheduled 250 hour service and clean unit down	SMAUGER	15/06/2017	Internal	356.0	\$0.00	Scheduled 250 hour service and clean unit down 250hr Service Prepare For Hire - Field clean and service straddle carrier. Travel to site, Labour Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, instal new door window assy Quote for damage Replace damaged work lights x 3 Replace damaged strobe light x 1 Replace damaged lower glass in door Replace damaged fitting on side shift cylinder. Emailed Paul Yeoman for a PO on the 19/6/2017 and 26/6/2017. DT 27/7/2017 = P Barber Reverted to internal per D Trounson request. Refer to attached email from P Whiffen requesting to close internally
1023908	Quote for damage	921QUOTE	15/06/2017	Internal	300.0	\$0.00	
1054875	Crane hire for teh 8/6/2017	921SUBC	5/06/2017	Internal	628.0	\$0.00	
1020948	Remove unit from Silk in QLD and transport to Target in VIC	JROSENTERETER	5/06/2017	External	300.0	\$41,782.75	This invoice is for the complete installation and Freight cost of the Straddle. Cost includes: <ul style="list-style-type: none"> Strip down of unit on site in QLD and prepare for transport (labour, 70T crane hire, scissor lift hire, etc). Transit (freight charges) from QLD to VIC. Assembly of unit on site in Vic (labour, 70T crane hire, scissor lift hire, etc). Make unit ready for hire and test all functions.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1020137	Complete a full inspection before we move unit to Vic	JROSENTERETER	31/05/2017	Internal	336.0	\$0.00	Complete a full inspection before we move unit to Vic Carry out equipment condition assessment new door window ac not working lube spreadr 10 puck bolts need replacing and tapping loose camera wire broken light switch brakes squeeling, need motor replacement Unit is stuck in a box
1016534	Unit is stuck in a box	JROSENTERETER	17/05/2017	Internal	290.0	\$0.00	Travel to site, Adjust Attachment Cylinder to correct specification , front right proxy sensor cut due to retaining pin in container locking ram coming out causing the linkage to come off and jam. soldered proxy wiring together and replaced 5amp fuse in attachment. refit linkage and tested all ok. Right hand rear side shift hydraulic line has come off ram Paul: 39 17 38 03
1013645	Right hand rear side shift hydraulic line has come off ram Paul: 39 17 38 03		5/05/2017	Internal	191.0	\$0.00	Travel to site, Replace Sideshift Cylinder, Repair Light/s Travel to site Inspect machine Rear side shift cylinder broken off male jic fitting welded on cylinder- customer damage Swap cylinder with one from customers machine to keep running. Lights not working- switch u/s - installed temporary toggle switch until new part arrives. Door glass smashed- customer damage- pictures attached for part matching reference Ordered cylinder, light switch and door glass.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
1010445	Screen has gone blank. Called in by Paul	JROBERTON	21/04/2017	Internal	191.0	\$0.00	Screen has gone blank. Called in by Paul Travel to site, Repair Visual display unit as necessary, Travel to site Inspect machine Use forklift and man cage to check camera harness along top of machine Rejoin loose connection Tension fwd/rev drive lever in cab. Hydraulic oil leak under the cabin
1008376	Hydraulic oil leak under the cabin	JROBERTON	11/04/2017	Internal	148.0	\$0.00	Travel to site, Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Travel to site Inspect machine Replace dowty washer on control valve chest. Checked remaining fittings for tightness Clean oil and hand over Unit is starting to overheat
1005106	Unit is starting to overheat	JROSENTERETER	29/03/2017	Internal	105.0	\$0.00	Repair Turbo as necessary, repaired boos leaks checked over engine
1003020	Prep for str - Paint number on unit	401WORKSHOP	21/03/2017	Cap Prep	60.0	\$0.00	This job has been raised to book out the FM1 kit that was not booked to job number 999658
1001943	Parts for job number 999658	921QUOTE	16/03/2017	Internal	60.0	\$0.00	
999950	Brake noise	JROBERTON	8/03/2017	Internal	60.0	\$0.00	Brake noise Carry out Inspection and Diagnosis of Brake System Inspect brakes Right hub squeeling loudly when brakes applied Bled brake valve Bled brake lines Took video and machine details for warranty Fit forktrack
999658	Fit forktrack	JROBERTON	8/03/2017	Internal	60.0	\$0.00	
1018527	Adjustment for jon number 992074	921SUBC	8/02/2017	Internal	290.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H13285		Description: COMBILIFT SC3T - CHAINLIFT					
Make: COMBILIFT		Model: SC3T		Serial No.: 26036			
992074	Prep and transport for stand in	JROSENTERETER	8/02/2017	Internal	50.0	\$0.00	<p>Prepare For Hire - Workshop</p> <p>Disassemble machine and prepare for transport</p> <p>Prepare For Hire - Field</p> <p>dissemble machine load on trucks an move to silk an rebuild onsite</p> <p>hook up hoses an electrical take photos an test machine</p> <p>Carry out New Equipment Predelivery to correct specification.</p> <p>dissasmbled machine and resembled machine on site tested and ready for use</p> <p>complete machine clean re test on 40 foot container.</p> <p>Labour</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p>
809143	Replace Backing Plate.	SCOOK	26/03/2015	External	10.0	\$777.00	<p>Travel to pick up parts</p> <p>Repair top lift attachment guides/locators</p> <p>Oil leak from R/H wheel</p> <p>Locate unit and check for oil leak at R/H wheel.</p> <p>Travel to workshop and pick up chains and parts</p> <p>Organise tyre contractor to remove wheel.</p> <p>Remove hub</p> <p>Remove and replace O ring on plate</p> <p>Reassemble</p> <p>Fit wheel and test for leaks - OK</p> <p>Assist with Straddle Carrier Assembly as required.</p>
796654	Assemble Straddle.	401SUBC	9/02/2015	External	3.0	\$1,804.05	<p>Carry out New Equipment Predelivery to correct specification.</p>
						Equipment Total:	\$190,258.12
						Customer Total:	\$190,258.12