

# ADAPT-A-LIFT GROUP PTY LTD

## Service History Listing Active Units

Date: 19/06/2026

Time: 10:49:52AM

For Equipment Code From: H13885 To: H13885

For Customer Code From: All To: All

For Date Posted From: All To: All

For Branch Code From: All To: All

Don't Show Cost

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H13885		<b>Description:</b> YALE GDP280DB					
<b>Make:</b> YALE		<b>Model:</b> GDP280DB		<b>Serial No.:</b> D876E01643G			
1825738	NOT STARTING	AGAERLAN	14/05/2026	Internal	23026.0	\$0.00	<p>Carry out equipment condition assessment</p> <p>Remove ancillary items and Remove Battery from unit and Inspect and report,</p> <p>Replace Battery,</p> <p>Replace Battery Cable/s</p> <p>Locate Assets around Whop (L/Hand didnt give location info on Machine) appraisal labour counts                      Found Assets in the Middle of 16Ton machine 4X                      Located Jumperpack which is Not in its proper charging area and found in Welding bay                      Location of machine and it Park toggther with other 16tonner make it Hard to reach machine with jumperpack                      Move some machine firts before can use jumper pack                      As jump dropps it voltage and cant Start machine                      Have a conversation with L/Hand to make a call to replace battery on machine or jumper pack (Myles CAN'T give decide)                      Talked to manager been told to replace 2X batteries of Machine                      Removed/Replaced Faulty/Flat batteries with new batteries2X                      Repaired faulty cable and terminals bolts and nuts</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H13885		<b>Description:</b> YALE GDP280DB					
<b>Make:</b> YALE		<b>Model:</b> GDP280DB		<b>Serial No.:</b> D876E01643G			
1685348	FW - Fork-positioner cylinders leak need reasling Hyd oil need top up didn't have hyd oil in van	DPREGELJ	10/01/2025	Internal	23026.0	\$0.00	<p>Carry out Inspection and Diagnosis of Attachment Travel to site and inspect unit. Topped up hydraulic oil. Sideshift cylinder leaking. Ordered parts. Remove ancillary items and Sideshift Cylinder, Strip, Inspect and report, Travel to site, remove 2x fork positioner cylinders and drop to ozmac after trying to remove gland nuts. Vice in van too small.</p> <p>Labour</p> <p>4-4-25 Travel to pick up cylinders from ozmac.</p> <p>Replace Sideshift Cylinder,</p> <p>Travel to pick up cylinders from golden circle. Travel to pirtek and replace missing fitting. Travel to site and fit cyinders to unit. Refit hydraulic hoses and secure. Unit tested, all ok.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H13885		<b>Description:</b> YALE GDP280DB					
<b>Make:</b> YALE		<b>Model:</b> GDP280DB		<b>Serial No.:</b> D876E01643G			
1683552	Hydraulic hose which controls side shift/fork positioner fail, leaking significant oil. Open 7am-3pm. Etkk 976675	YTSIGE	30/12/2024	Internal	22994.0	\$0.00	<p>Travel to site,  Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,  Travel to site  Locate unit  Set up safe work area  Inspected the hydraulic system for potential oil leaks.  Found that the hose connected to the fork positioner control valve leading to the fork positioner cylinder was blown. This requires a new hose. Discovered that the right-hand (RH) fork positioner cylinder needed resealing to prevent further leakage. Informed the customer that the machine requires new hoses and resealing of the RH fork positioner cylinder to resolve the hydraulic oil leak.  Remove ancillary items and Hydraulic Hose/s, inspect and report,  Labour  Refit Hydraulic Hose/s and ancillary items,  Carry out equipment condition assessment  Travel to Site:  signed in.  Locate Unit:  Established a safe work area to ensure proper safety protocols.  Diagnose Hydraulic Oil Leaks:  Removed the damaged hoses from the unit.  Went to Pirtech to get new replacement hoses.  Waited for the parts to be prepared and ready for pickup  Collected the new hoses once they were available.  Returned to the site with the new hoses.  Started refitting the new hoses and test function ok  Return unit to serivece</p> <p>NOTE  Fork-positioner cylinders leak need reasling  Hyd oil need top up didn't have hyd oil in van</p>
1616917	Scheduled Service - SF 500HR IC SM .0500 Hour Service	MFERREIRA	2/05/2024	Internal	22991.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H13885		<b>Description:</b> YALE GDP280DB					
<b>Make:</b> YALE		<b>Model:</b> GDP280DB		<b>Serial No.:</b> D876E01643G			
1499040	Scheduled Service - 2000hr SM IC DG .2000 Hour Service	SWILSON	12/08/2023	Internal	22991.0	\$0.00	<p>Travel to site,</p> <p>Carry out equipment condition assessment</p> <p>Blow out radiator core,</p> <p>2000hr Service</p> <ul style="list-style-type: none"> <li>- travel to site</li> <li>- set up work area and obtain unit</li> <li>- blow out unit</li> <li>- carry out 2000 hrs service</li> <li>- check all operations and functions</li> <li>- check and top up oil levels</li> <li>- replace engine oil+ filter</li> <li>- replace 2x fuel filters</li> <li>- replace trans filter</li> <li>- replace air filters outer + inner</li> <li>- lube unit</li> <li>- check safety limits on tynes, chains and brakes</li> </ul> <p>report</p> <ul style="list-style-type: none"> <li>- had horn constantly sounding suspect switch or wiring as tested horn itself was good had constant power feed disconnect horn further investigation required</li> <li>- rear top RH light not working had no power further investigation required</li> <li>- front rh side light not working needs new bulb had none on van 24v h3</li> <li>- alternator 1x plug disconnected check inputs into battery 27v so good still alternator charging</li> </ul> <p>Carry out Inspection and Diagnosis of Electrical System</p> <ul style="list-style-type: none"> <li>- both fork positioners weeping</li> <li>- steer column wont adjust or lock</li> <li>- front wiper not working</li> <li>- topped hydraulic oil could not get to oil to register on glass gauge tested unit went through all hydraulic functions with out cavitation occuring before adding 15L</li> <li>- had error codes and engine light on at dash + 4 x red lights on steer column as well found alot of containminates in fuel filter but after the service all codes and lights have gone</li> </ul> <p>further work</p> <ul style="list-style-type: none"> <li>- initial checks on horn and lights issues</li> </ul>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H13885		<b>Description:</b> YALE GDP280DB					
<b>Make:</b> YALE		<b>Model:</b> GDP280DB		<b>Serial No.:</b> D876E01643G			
1506599	Machine on site, has a failed tilt ram seal that requires attention and has considerable leak.Etk 302027	M Birch	11/01/2023	Internal	23100.0	\$0.00	<p>- travel to workshop  - dump waste and oil in correct bins  Travel to site,  Carry out equipment condition assessment  Check/Inspect/Diagnose Cylinder  Remove ancillary items and Hydraulic Tilt Cylinder , Strip,  Inspect and report,  travelled to site located unit and secured workarea  inspected the unit and found the right tilt cylinder had blown the seal  removed the tilt cylined and did not have the correct tools to remove the glan nut  advised site and will get big trucks out to complete</p> <p>note will need the left one done as well  Labour  travelled to site located unit and seucred workarea  removed the tilt cylinders and took them to ozmac to get rebuilt  Replace Left Hydraulic Tilt Cylinder,  travelled to ozmac and picked up the cylinders  travelled to site located unit and secured workarea  installed the cylinders  bleed the sytem and topped up the fluids  tested and all ok  returned to service</p>
1499041	Scheduled Service - DG CNG INSP .CNG Inspection 1 Year	DPREGILJ	5/12/2022	Internal	22980.0	\$0.00	
1491385	the battery charge has just become too low to start. could he bring a 24 volt jumper pack so we can start this machine and move it closer to an electrical outlet - ETCK 249984	M Birch	7/11/2022	Internal	23021.0	\$0.00	<p>this job will need to be sent to big trucks</p> <p>Carry out equipment condition assessment</p> <p>travelled to site located unit and secured workarea  they no longer need the batteries  returned the batteries to the stores</p>
1350445	FW: Steer Alignment required.	System Planning	8/01/2021	Internal	22971.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H13885		<b>Description:</b> YALE GDP280DB					
<b>Make:</b> YALE		<b>Model:</b> GDP280DB		<b>Serial No.:</b> D876E01643G			
1350444	FW: Replace Batteries, bonnet struts, seat belt, seat base and hydraulic site glass	DTOM	8/01/2021	Internal	22980.0	\$0.00	Labour Order all required parts for unit Travel to site, Carry out Inspection and Diagnosis of Electrical System Replace Battery, Carry out equipment condition assessment Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Adjust Steering to correct specification, Collect parts and travel to site Replace both bonnet struts Inspect and adjust steering Check/Inspect/Diagnose Cylinder Replaced battery clamp Replaced hydraulic site glass Awaiting seat to complete task Travel to site and retrieve info on seat Order parts to convert from vynal to fabric due to nil stock  Replace Seat,  Replaced seat base Replaced bonnet struts Replaced hydraulic site glass Replaced batteries

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H13885		<b>Description:</b> YALE GDP280DB					
<b>Make:</b> YALE		<b>Model:</b> GDP280DB		<b>Serial No.:</b> D876E01643G			
1304821	Scheduled Service - JDB - LPG Inspection .CNG Inspection 1 Year	JMCSHANNON	9/09/2020	Internal	22971.0	\$0.00	<p>technician ran out of time today to complete gas certificate, will organise to return to site and completed the following day Labour Travel to site, Carry out equipment condition assessment couldnt find untiy on site and had to confirmed with coordinator ,</p> <p>checked in with site contacts and only had 2 smaller 2.5 tonnes and a 5tonne one. suspect this unti may be a big truck.</p> <p>will have to go back and check at a later stage due to other break downs around that technician needed to attend to.</p> <p>Check/Inspect/Diagnose Exhaust emissions and test operation,</p> <p>returned to site signed in located unit and found unit does not required gas inspection as this unit is diesel and not an LPG truck.</p>
1304806	Scheduled Service - JDB - 4000Hr IC Service .4000 Hour Service	DTOM	7/06/2020	Internal	22974.0	\$0.00	<p>hour meter taken and job completed. Travel to site,</p> <p>Labour</p> <p>4000hr Service,</p> <p>NOTE Seat base requires changing New seatbelt required Both side bonnet struts required 2x AAB019 battries required Hydraulic site glass required Steering alignment required Wiper blades required No battery clamp on uniit</p> <p>Carry out equipment condition assessment</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H13885		<b>Description:</b> YALE GDP280DB					
<b>Make:</b> YALE		<b>Model:</b> GDP280DB		<b>Serial No.:</b> D876E01643G			
1150937	Jump start unit and check charge rate	AJOHNS	5/10/2018	Internal	22951.0	\$0.00	<p>Replace Tie rod ends</p> <p>signed into site, located machine had to jump start unit as handbrake had not been put on allowing the machine to run the battery down started unit inspected tie rods found that supplied tie rods were excessively longer than on unit, checked with parts correct part number for unit, checked measurements tie rod found that tie rod is too long possible wrong part number on tie rod</p>
1148878	Scheduled Service Level B Service	DSLOAN	27/09/2018	Internal	22950.0	\$0.00	<p>Jump started unit and checked charge rate all ok Scheduled Service</p> <p>Travel to site,</p> <p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p> <p>travel to site, assist david on completion of service.</p> <p>carried out 500hr service, changed oil, &amp; diesel cartridges x2, greased unit. Blew out air filters and radiator. Found +-60ml of water in diesel separator filter. Reset check engine code.</p> <p>Unit condition is not great. Chains are rusted, drivers seat is in poor condition, fair amount of rust on body, steering axle has deep grooves worn from wheels rubbing on it.</p> <p>See pictures for faults.</p>
1148841	1562- unit has a warning light illuminated – would appreciate it if you would please arrange for someone to check.	DSLOAN	27/09/2018	Internal	22908.0	\$0.00	<p>1562- unit has a warning light illuminated – would appreciate it if you would please arrange for someone to check.</p> <p>Labour</p> <p>Travel to site,</p> <p>Changed diesel water separator, reset codes unit test okay.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H13885		<b>Description:</b> YALE GDP280DB					
<b>Make:</b> YALE		<b>Model:</b> GDP280DB		<b>Serial No.:</b> D876E01643G			
1071210	Steer axle Bolts sheared off.	AJOHNS	8/12/2017	External	22951.0	\$862.33	Steer axle Bolts sheared off. - Amanda 07 3826 3333  Travel to site,  Carry out Inspection and Diagnosis of Attachment  Travel to site from w/shop & sign in to find customer not knowing about job & inspect unit to find steer axle damaged stops broken & report & leave site due to customer not wanting job to be done  Repair Steer Axle as necessary,  Labour  diagnosed rim hitting steering axle, straightend wheels tried to weld nut on broken bump stops to remove bolts unable to, drilled out broken off bump stops travelled to obtain bolts, picked up replacement bolts and tap, repaired threads fitted bump stop bolts tested all ok, rim is no longer contacting axle Schedule Service - Cameron Brooks – 0432 018 977
1052603	Schedule Service - Cameron Brooks – 0432 018 977 Level B Service	RWILSON	6/10/2017	Internal	22908.0	\$0.00	100Hr Service  check over & grease unit & report faults  Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.  order & pickup parts from store  Travel to site,  250hr Service  Overhaul Steer Axle as required,  Travel to site to replace fuel filters to find water in fuel & report to Camron & drain water from fuel tank & replace filters
						<b>Equipment Total:</b>	<b>\$862.33</b>
						<b>Customer Total:</b>	<b>\$862.33</b>