

ADAPT-A-LIFT GROUP PTY LTD

Service History Listing Active Units

Date: 19/06/2026

Time: 11:06:07AM

For Equipment Code From: H14832 To: H14832

For Customer Code From: All To: All

For Date Posted From: All To: All

For Branch Code From: All To: All

Don't Show Cost

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H14832		Description: HYSTER H3.5XT TWIN PALLET TYNES					
Make: HYSTER		Model: H3.5XT		Serial No.: D466R04315R			
1825222	Prep for Auction	NWILLIAMS	12/05/2026	Internal	7358.0	\$0.00	Carry out equipment condition assessment Removed unit from aisle Jump start unit and returned units back ito aisle
1713589	prep for sale - advertise online	RABINAL	29/04/2025	Internal	7357.9	\$0.00	unit has bottom end knock Carry out equipment condition assessment Steam clean equipment as necessary. Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Check and visual inspection washing unit and grease steam clean remove sticker number took a picture on machine The machine no battery and different size on front tire Knocking sound the engine Carry out equipment condition assessment
1662210	STR IC Green Tag	AMARONEY	4/10/2024	Internal	7356.0	\$0.00	Carry out equipment condition assessment Carry out Inspection and Diagnosis of Electrical System Carry out Inspection and Diagnosis of Mast/Carriage Carry out Inspection and Diagnosis of Wheel R/H side drive wheel no thread...Left at 60% Engine knock. Flat/ wrong battery
1662006	RENTAL RETURN - CHECK FOR DAMAGES	MSEGHABI	4/10/2024	Internal	7356.0	\$0.00	Sent to used. Carry out equipment condition assessment not running

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H14832		Description: HYSTER H3.5XT TWIN PALLET TYNES					
Make: HYSTER		Model: H3.5XT		Serial No.: D466R04315R			
1590666	Scheduled Service - GS IC 2000Hr SM - 6000Hrs .2000 Hour Service	AGUTIERREZ	9/09/2024	Internal	7356.0	\$0.00	Travel to site, 2000hr Service Travel to site, Sign in, Locate the machine, Found Tag out(Spanner) Start the unit found knocking at engine check Dip Stick No engine oil tottaly Drain, Top up Engine and travel to safe working area , Check Engine condition still knocking , Open Head cover check & adjust but still knocking. Service 2000hr, Carry out preventive maintainance service and safety inspection in the line with agreed scope of work. Report on condition of equipment and additional work requirements. Note: Engine Knocking subject for repair at work shop, Costumer Damage failure to inspect daily checklist. Carry out Inspection and Diagnosis of Attachment
1622912	Replaced Worn Wear Pads	DPhangnalay	13/05/2024	Internal	6934.0	\$0.00	Carried out inspection on the attachment and found the middle tyne wear pads have worn out causing the tynes to be lower than normal. Need to replace the wear pads. Parts ordered. Repair Forks/Tynes as necessary,
1620127	Replace Rear Rim & Hub	SUBC-RNT20101	1/05/2024	External	6933.0	\$1,333.44	Carried out removing and replacing tyne wear pads as required. Return to service Carry out equipment condition assessment Sign in onsite Locate machine Concern-Technician attendance required to assess damaged wheel where the hub has snapped off. Carry out equipment condition assesment Check tyres The rim came off the tyre,its possible that the rim tyre has a crack thats why this happened,or rim has a crack before replacing with new tyres. Subbie attended site on 03/06/2024 and replaced both wheels on the unit.
1600468	Replace Drive Tyres	ALLOCATE	14/02/2024	External	6435.0	\$1,460.82	
1581801	Replace damaged/worn tynes	NMAISTRY	23/11/2023	Internal	6933.0	\$0.00	Travel to site, Carry out Inspection and Diagnosis of Attachment Carried out inspection on the tynes and found it was not worn out and the reason why the middle tynes were lower is because the bottom rail wear pads are worn out. Tynes have been sent back to workshop.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H14832		Description: HYSTER H3.5XT TWIN PALLET TYNES					
Make: HYSTER		Model: H3.5XT		Serial No.: D466R04315R			
1581307	-Starter motor noisy -switch knob insecure -Oil leak steering column area -Blocked grease point -needs hub & axle seals, bearing repak Needs wheel cylinders & fluid	DMackay	22/11/2023	Internal	6435.0	\$0.00	<p>Carry out equipment condition assessment Research part numbers & order starter motor, wheel cylinders, hub & axle seals Labour Collect parts from droppoint Travel to site, Repair Seat Switch Wiring, Fit Seat Belt, Remove ancillary items and Wheel/s, Inspect and report, Remove and Replace Drive Axle Seal/s</p> <p>Clean and re-pack Drive Wheel Bearings, Replace Brake Wheel Cylinders, Bleed Brake System Block up unit, Adjust brakes and handbrake, Travel to site, sign in at security gate to gain access, locate machine & travel to it. Operator says presence system intermittent - seatbelt connector terminal bent & plug won't clip in so rewire & fit s/hand seatbelt reel as webbing worn. R&R LEFT front wheel to back off brake shoes to enable drum removal. R&R axle & drum, remove LEFT hub seals (leaking) & wheel bearings, clean drum, repack bearings & refit with new hub seals. Strip LEFT side brakes, clean backing plate, renew LEFT leaking wheel cylinder, reassemble brakes lubricating all moving parts. Refit brake drum, adjust wheel bearing preload, refit/reseal axle, readjust shoes & bleed wheel cylinder. ONLY LEFT WHEEL CYLINDER/HUB SEALS/BEARING REPACK DONE SO FAR AS REMOBILISED TO ATTEND BREAKDOWN Replace Brake hub seal/s, Travel to site, sign in at security gate to gain access & travel around to designated work area. Complete online training while waiting for machine to become available. R&R RIGHT front wheel to access brake adjuster. Back off brake shoe adjuster to enable removal of brake drum. R&R RIGHT front axle, wheel bearings & brake drum. Clean drum, repack wheel bearings & renew hub seals. Strip RIGHT brake shoes & clean backing plate. Renew RIGHT brake wheel cylinder, refit brake shoe assembly lubricating all moving parts to rectify screeching noise. Refit brake drum, adjust wheel bearing preload & refit/reseal axle. Bleed & adjust RIGHT side brakes & test - ok. FURTHER WORK NOTED: -Reverse alarm too quiet -Seat track adjuster jammed up</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
---------	-------------	----------	------	----------	----------	--------	-------

Owner: ADAP001

Equip. Code: H14832

Description: HYSTER H3.5XT TWIN PALLET TYNES

Make: HYSTER

Model: H3.5XT

Serial No.: D466R04315R

Replace Starter Motor,

Carry out Inspection and Diagnosis of Steering System

Adjust Reverse buzzer to correct specification,

Repair Seat as necessary,

Repair Steer Axle as necessary,

Repair Switch/es

Travel to site, sign in at security gate & travel around site. Locate machine, move to safe work area & barricade. Renew starter motor & test - ok. Inspect steering orbital for leaks (previously replaced) - all ok so cleaned oil from dash panels. Blow more dust out of reverse buzzer to make it louder. Lubricate jamming seat tracks until it becomes adjustable again. R&R right outer steering grease fitting & dig out solidified grease until it can flow again. Rework travel switch lever knob to secure it

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H14832		Description: HYSTER H3.5XT TWIN PALLET TYNES					
Make: HYSTER		Model: H3.5XT		Serial No.: D466R04315R			
1565936	Scheduled Service - TC IC 500HR SM - 5500hrs .0500 Hour Service	DMackay	21/11/2023	Internal	6331.0	\$0.00	<p>Labour</p> <p>Travel to WP, organise & collect service kit</p> <p>Travel to site,</p> <p>Carry out equipment condition assessment</p> <p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p> <p>Remove and Replace Air filter,</p> <p>Drain and refill differential oil,</p> <p>Repair Light/s</p> <p>Block up unit, Adjust brakes and handbrake,</p> <p>Carry out Inspection and Diagnosis of Brake System</p> <p>Collect parts. Travel to site, sign in. Locate machine, assess (NEED TO RETURN incorrect parts kit, had filter needed in van) - operator says brakes REALLY noisy.</p> <p>Carry out 500hr type service/safety check.</p> <p>Renew clogged air filter, renew black diff oil. Adjust brakes but still screeching so R&R drums, inspect, report & lube. Lost pedal so bled. Renew right worklight globe.</p> <p>CUSTOMER DAMAGE:</p> <p>- Middle 2 tynes bent (twin tyne) & 3 worn under minimum thickness</p> <p>REPAIRS REQUIRED:</p> <ul style="list-style-type: none"> -Starter motor noisy -Travel switch knob insecure -Oil leak steering column area -Blocked grease point right outer steering joint -Oil in front wheel bearings (needs hub & axle seals, bearing repack) -Needs wheel cylinders & fluid flush <p>Travel to WP, return incorrect service kit parts for credit, discard waste oil & rubbish. PLEASE DON'T POST UNTIL UNALLOCATED PARTS AS PER IMAGE ARE CREDITED</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H14832		Description: HYSTER H3.5XT TWIN PALLET TYNES					
Make: HYSTER		Model: H3.5XT		Serial No.: D466R04315R			
1568958	Squeaky brakes & 1 headlight out. Etk 545713	NBULL	29/09/2023	Internal	4731.0	\$0.00	Travel to site, Carry out Inspection and Diagnosis of Brake System complaint no brakes cause wprn brake shoes correction diagnosed unit and found that the unit requires a brake overhaul, ordered required parts for unit and will return when arrived. Mechanic NBULL replaced order number 1941399 / 9376373 with 1941399 / 93763 rebuild brakes on unit replaced master cylinder bled brakes adjust brakes tested ok.
1547637	Top lift hand lifting chain anchor is broken. Contact: Stephen Barks 0482 934 104	NBULL	7/07/2023	External	5632.0	\$1,443.89	Travel to site, Carry out Inspection and Diagnosis of Mast/Carriage complaint lift chain anchor broken cause two locking nuts have come off correction ordered 20ft of chain and will replace both chains and ordered new chain anchors for unit, will return when parts arrive. Labour Replace Lift Chain Anchors, Replace Lift Chain, Adjust Lift Chain to correct specification, correction replaced chains and anchor point as required, tested unit and all functions working correct, advised customer and returned unit to service.
1539161	All 4 tyres needs replacing-Site CContact-Stephen Barks-02 4648 9321-ETKT-424778	SUBC-RNT20101	2/06/2023	Internal	5349.0	\$0.00	
1536543	All 4 tyres needs replacing-Site CContact-Stephen Barks-02 4648 9321-ETKT-424778	SUBC-RNT20101	23/05/2023	Internal	5349.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H14832		Description: HYSTER H3.5XT TWIN PALLET TYNES					
Make: HYSTER		Model: H3.5XT		Serial No.: D466R04315R			
1529306	The horn is not working and selector on steering column is broken-Site Contact-Stephen Barks-0482 931 104	AGUTIERREZ	20/04/2023	Internal	5349.0	\$0.00	<p>Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,</p> <p>Repair Horn</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>Complaint : Horn is not working and selector column on steering is broken.</p> <p>Action : Remove cover and check where is the leak came from. Test the steering full left & righth. No Leak. Adjust the contact horn .Ok Repair directional Lever. Ok Return to Service. 1000hr Service</p>
1527917	Scheduled Service - KM IC 1000hr SM - 5000hrs .1000 Hour Service	NBULL	14/04/2023	Internal	5339.0	\$0.00	<p>carried out 1000hr service as per service matrix Travel to site,</p>
1526084	Hydraulic leak-Site Contact-Stephen Barks-02 4648 9321-Tagged Out-ETKT-	NBULL	5/04/2023	Internal	5339.0	\$0.00	<p>Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,</p> <p>Carry out Inspection and Diagnosis of Steering System</p> <p>complaint oil leak cause steer motor leaking correction ordered new steer motor for unit cleaned and tightened mounting bolts for steer motor, returned to service as leak isnt major replaced headlight globe aswell.</p> <p>Labour</p> <p>Carry out equipment condition assessment</p> <p>Replace Steering Box,</p> <p>picked up and replaced steering orbital valve as required.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H14832		Description: HYSTER H3.5XT TWIN PALLET TYNES					
Make: HYSTER		Model: H3.5XT		Serial No.: D466R04315R			
1514392	Breaks are locked up.Etkk 333856	NBULL	17/02/2023	Internal	5013.0	\$0.00	<p>Travel to site, Carry out Inspection and Diagnosis of Brake System Block up unit, Adjust brakes and handbrake, Top up Brake fluid as required, complaint brakes lockiung up</p> <p>cause missadjustmenbt of brakes and master cylinder</p> <p>correction re adjusrtd both lh and rh brakes, readjusted the brake master cylinder as rod was adjusted too far down making the pedal too short and making the brakes stick, also topped up brake fluid as resivour was slightly low, no leaks present in the brake system, tested unit and found no faults within the braking system when doing so, adjusted the hand brake and greased truck also lubed chains as was very dry.</p>
1513355	Green tag inspection	DDEJESUS	13/02/2023	Internal	4960.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H14832		Description: HYSTER H3.5XT TWIN PALLET TYNES					
Make: HYSTER		Model: H3.5XT		Serial No.: D466R04315R			
1504689	unit has no breaks. Etkk 296497	JPrinitis	3/01/2023	Internal	4960.0	\$0.00	<p>Travel to site, Carry out equipment condition assessment Remove ancillary items and Repair Gas Leak as necessary, Refit ancillary items, went to jack unit up to inspect brakes, found gas bottle fitting leaking, i have order new fitting Carry out Inspection and Diagnosis of Brake System Remove wheel/s, Remove Brake drum/s, Block up unit, Adjust brakes and handbrake, replaced gas fitting, found gas bottle was empty again, phoned jeremy to get me a new gas bottle, installed new bottle, tested unit, found brakes are out of adjustment, jacked unit, removed drums found drums a little bit glazed cleaned up drums, reinstalled, tested unit, unit tested ok. Replace brake shoe/s, Overhaul Brakes components as required, Refit Brake drum/s and refit Wheel/s, replaced brakes shoes both sides, cleaned brake assembly, cleaned drums, adjusted brakes, bled brakes, replaced inting cable, jeremy tested unit, unit tested ok. non operational.. Replace Brake master cylinder, Bleed Brake System Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, travel to workshop, locate unit, replace masster cylinder and bleed brakes, unit still not stoping correctly, removed drums and found right retainer came off shoe , refitted and cleaned unit down, tested unit ok.</p>
1500251	There is an exhaust leak on this unit. Tagged Out. URGENT. PTKT-282552	NBULL	9/12/2022	Internal	4887.0	\$0.00	<p>Labour</p> <p>Travel to site,</p> <p>Replace Ignition Spark Plugs as required,</p> <p>travelled to parts, then to site, signed in and located unit</p> <p>complaint exhaust loose</p> <p>cause 1st spark plug had come loose and spat out</p> <p>correction replaced spark plug and tested all ok</p>
1479109	Parts return for Job 1435851	201QUOTE	13/09/2022	Internal	4409.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H14832		Description: HYSTER H3.5XT TWIN PALLET TYNES					
Make: HYSTER		Model: H3.5XT		Serial No.: D466R04315R			
1470185	Scheduled Service Job. Hyster B466_0500 Hour Service Kit_ Diesel. 0500 Hour Service	NMAISTRY	8/08/2022	Internal	4409.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Top up Hydraulic Oil to correct level, Top up cooling system, clean engine bay. 50 point check. change engine oil. change oil filter. change air filter. add transmission oil. add hydraulic oil. change spark plugs. add water to radiator. adjusted hoses.
1470184	Green Tag Inspection	NMAISTRY	8/08/2022	Internal	4409.0	\$0.00	Carry out equipment condition assessment Repair Hydraulic Hose/s as necessary, Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Steam clean equipment as necessary. Repair Mast as necessary, Remove ancillary items and Hydraulic Hose/s, inspect and report, Refit Hydraulic Hose/s and ancillary items, Replace Stickers, Repair Attachment as necessary, Steam Clean Unit for Painting, Remove ancillary items, prepare and Paint unit as required, Grease All Points on Unit, Prepare For Hire - Workshop

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H14832		Description: HYSTER H3.5XT TWIN PALLET TYNES					
Make: HYSTER		Model: H3.5XT		Serial No.: D466R04315R			
1485317	Scheduled Service Job. Hyster B466_4000 Hour Service Kit_ Diesel. 4000 Hour Service	ODEMERIN	7/05/2022	Internal	4411.0	\$0.00	Carry out equipment condition assessment Replace Engine Oil Filter, Change Engine Oil as required, Replace Ignition Spark Plugs as required, Grease All Points on Unit, Steam clean equipment as necessary. Remove ancillary items, prepare and Paint unit as required, Prepare For Hire - Workshop Locate the machine and park it on the working bay,performed the schedule maintenance,replace spark plug,oil,oil filter air filter. check the all oil level and coolant, touch up paint, greased grease point, cleaned the machine,test the machine performance,prep for hire.
1443737	Replace Drive Tyres 28x9-15 and Steer Tyres 6.50-10 Solid	201SUBC	21/04/2022	External	3861.0	\$3,047.70	UNABLE TO OBTAIN SIGNATURE DUE TO SUB CONTRACTOR CONDUCTING WORK SITE CONTACT Name: Joel Ellis Phone: 02 4648 9321
1435851	Issue with the muffler making a loud noise, also a headlight not working. Tagged Out.	ALI	2/03/2022	Internal	3861.0	\$0.00	Travel to site, Repair Light/s Repair Exhaust Manifold as required, Travel to site from dp via United servo , sign in, complete Covid RAT , access unit and inspect fault with leaking muffler and headlamp. Replaced headlamp bulb and repaired loose connection in the fuse box circuit and muffler is broken . Ordered muffler and rubber mounts Images attached. Labour Replace Muffler, to base. wait for pick up a muffler. to burson, try to source gasket. to site gate house. wait for an induction number. locate unit. remove muffler. fit a new muffler. test ok. complaint:noise/lights. cause:broken muffler/burnt bulbs. correctiion:replace muffler/repair lights.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H14832		Description: HYSTER H3.5XT TWIN PALLET TYNES					
Make: HYSTER		Model: H3.5XT		Serial No.: D466R04315R			
1425317	Unit is not starting - URGENT	MSHAHEEM	17/01/2022	Internal	3427.0	\$0.00	Travel to site, Carry out Inspection and Diagnosis of Electrical System Repair Seat Switch Wiring, Fill fuel, travel to site, sign in, locate unit and inspect fault with not starting, diagnose fault and repaired seat belt wiring, test, ok.
1422253	Premia - Rim 7.0/15. 28/9/15. Drive tyre to be replaced. Tagged out.	201SUBC	21/12/2021	Internal	3011.0	\$0.00	
1415091	The seat belt does not work - could not provide further info	NCLARKE	17/11/2021	Internal	3011.0	\$0.00	Travel to site, Replace Switch/es travelled to site checked seat belt found faulty removed and replaced seat belt rewired tested Repair Switch/es assisted nathan with repairs. ok
1408056	KIT ORDERED GS - Scheduled Service - 500hr SM - 3500hrs .0500 Hour Service	System Planning	8/11/2021	Internal	2601.0	\$0.00	
1403245	Prep. for hire	CALABA	21/09/2021	Internal	2601.0	\$0.00	Carry out equipment condition assessment Steam clean equipment as necessary. Grease All Points on Unit, Prepare For Hire - Workshop

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H14832		Description: HYSTER H3.5XT TWIN PALLET TYNES					
Make: HYSTER		Model: H3.5XT		Serial No.: D466R04315R			
1376577	Carry out repairs as per job card estimate	ACUNNINGHAM	14/05/2021	Internal	2600.0	\$0.00	<p>L/H headlight n/w Brakes require strip/inspect/report/repair as required Seat frame has movement, worn Tyres undersize Cascade twin Pallet Handler Mast hoses sheathing cracked Attachment wear pads worn Clean out radiator, full of debris Battery U/S failed load test Drive tyres regroove Steer tyres u/s replace Paintwork in poor condition</p> <p>Replace Battery,</p> <p>Repair Light/s</p> <p>Replace Seat,</p> <p>Repair Seat Switch Wiring,</p> <p>Remove ancillary items and Wheel/s, Inspect and report,</p> <p>Remove ancillary items and Remove Drive Axle Assembly from unit,</p> <p>Remove wheel/s, Remove Brake drum/s,</p> <p>Carry out Inspection and Diagnosis of Brake System</p> <p>Refit Brake drum/s and refit Wheel/s,</p> <p>Refit Drive Axle Assembly, refit ancillary items,</p> <p>Refit Wheel/s and ancillary items,</p> <p>Block up unit, Adjust brakes and handbrake,</p> <p>Blow out radiator core,</p> <p>Steam clean equipment as necessary.</p> <p>Bleed Brake System</p> <p>Replace Brake master cylinder,</p> <p>Flush brakes,</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H14832	Description: HYSTER H3.5XT TWIN PALLET TYNES						
Make: HYSTER	Model: H3.5XT			Serial No.: D466R04315R			
							<p>Top up Brake fluid as required,</p> <p>Blocked up unit, removed wheels, axles, brake hubs. Inspected brakes as required, all surfaces glazed & brakes full of dust.</p> <p>Cleaned out brake assys & deglazed all contact surfaces. Refit all items & adjusted brakes to spec.</p> <p>R&R Seat as required, wired in seat & buckle switch & tested ok</p> <p>Rmved fan shroud & cleaned out debris from radiator core.</p> <p>Refit fan shroud, steam cleaned radiator, tested ok. Inspected & bled master cylinder & found pedal still spongy.</p> <p>Replaced master cylinder & flushed complete brake system & replaced brake fluid.</p> <p>Bled system & adjusted brakes, tested all ok</p> <p>Remove ancillary items and Attachment, Strip, Inspect and report,</p> <p>Carry out equipment condition assessment</p> <p>Refit Attachment and ancillary items,</p> <p>Replace Lift Chain,</p> <p>Adjust Lift Chain to correct specification,</p> <p>Install Stickers,</p> <p>Remove ancillary items, prepare and Paint unit as required,</p> <p>Adjust Attachment to correct specification ,</p> <p>Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,</p> <p>Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,</p> <p>Install Hard Labels,</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H14832		Description: HYSTER H3.5XT TWIN PALLET TYNES					
Make: HYSTER		Model: H3.5XT		Serial No.: D466R04315R			
1375682	1000 hour service Hyster B466_1000 Hour Service Kit_ Diesel. 1000 Hour Service	ACUNNINGHAM	11/05/2021	Internal	2597.0	\$0.00	<p>Carry out 1000 hour service fill in Audit form take photos with tablet check fan belt and battery</p> <p>Change Engine Oil as required, Replace Engine Oil Filter, Remove and Replace Air filter, Replace Ignition Spark Plugs as required, Grease All Points on Unit, Top up cooling system, adjust Exhaust emissions to correct specification, 1000hr Service</p>
1375679	STR De hire inspection	ACUNNINGHAM	11/05/2021	Internal	2597.0	\$0.00	<p>Carried out service & checkover as required Carry out STR De hire inspection Document any damages that will need to be quoted check over unit fill in 20 point inspection take photos of unit as it is ensure the rating plate reflects the mast and attachment attached to the unit</p> <p>Carry out equipment condition assessment Steam clean equipment as necessary.</p> <p>Dehire inspection L/H headlight n/w Brakes require strip/inspect/report/repair as required Seat frame has movement, worn Tynes undersize Mast hoses sheathing cracked Attachment wear pads worn Clean out radiator, full of debris Battery U/S failed load test Steer tyres u/s Paintwork in poor condition</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H14832		Description: HYSTER H3.5XT TWIN PALLET TYNES					
Make: HYSTER		Model: H3.5XT		Serial No.: D466R04315R			
1363563	De hire inspection	JELSWORTH	11/03/2021	Internal	2583.0	\$0.00	Travel to site, Carry out equipment condition assessment travel to site carried out de-hire inspection inline with scope 2000hr Service
1316342	Scheduled Service - JULY 2000 Hour Service - Please contact Taha Taouti 0427 141 895 to book in for Service .2000 Hour Service	DHOANG	24/07/2020	Internal	1884.0	\$0.00	Repair Light Circuit as required, carry out pm service 2000hr service lube grease adjusted. repair stobelight not working repair wire .report require all four tynes qouted as it is on wear limit please qoute urgent before it go undersize.attactement detai,l.model 28G1830220 serial 199296.
1258088	Hydraulic fluid leak when forks extend. SF Email.	AWEBBER	25/11/2019	Internal	1099.0	\$0.00	Travel to site, Check/Inspect/Diagnose Hydraulic Oil Leak and test operation, Remove ancillary items and Attachment, Strip, Inspect and report, Remove ancillary items and Hydraulic Hose/s, inspect and report, Labour Replace Hydraulic Hose/s and ancillary items, Travel to site and do induction. Inspect unit. Remove attachment. Remove leaking and damaged hoses. Get new hoses made at Pirtek. Return to site to start to assemble unit. Refit Attachment and ancillary items, Travel to site. Fit all hoses and secure. Fit attachment and test. Clean area.
1234195	Prep for Hire	302WORKSHOP	20/08/2019	Internal	899.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H14832		Description: HYSTER H3.5XT TWIN PALLET TYNES					
Make: HYSTER		Model: H3.5XT		Serial No.: D466R04315R			
1223051	DE-HIRE	ASIBUGON	9/07/2019	Internal	899.0	\$0.00	<p>Carry out equipment condition assessment</p> <p>Remove ancillary items and Wheel/s, Inspect and report,</p> <p>Remove ancillary items and Remove Drive Axle Assembly from unit,</p> <p>Remove wheel/s, Remove Brake drum/s,</p> <p>Carry out Inspection and Diagnosis of Brake System</p> <p>Clean and re-pack Drive Wheel Bearings,</p> <p>Refit Brake drum/s and refit Wheel/s,</p> <p>Refit Drive Axle Assembly, refit ancillary items,</p> <p>Block up unit, Adjust brakes and handbrake,</p> <p>Steam clean equipment as necessary.</p> <p>Adjust Inching Valve to correct specification ,</p> <p>Remove ancillary items, prepare and Paint unit as required,</p> <p>conduct unit assessment, removed front wheel, axle shaft, brake drum, check wheel cylinder for possible leaks, clean the brake shoe and brake drum removed dirt, repacked the bearing then refit brake drum, axle shaft and wheel... adjust the brake, brake pedal and inching valve, steam clean the unit, paint the tynes removed REGO plate...</p> <p>Grease All Points on Unit,</p>
1211210	PREP FOR HIRE FIT TPH AND SUPPLY NEW DATA PLATE AS REQ	302WORKSHOP	27/05/2019	Internal	868.0	\$0.00	<p>continue greasing, and touch-up paint, wipe the unit..</p> <p>PREP FOR HIRE AS REQ</p> <p>SWAP OVER TWIN PALLET MOVER WITH OTHER UNIT</p> <p>SWAP OVER MAST 4TH VALVE HOSING</p> <p>REPAIR CARRIGE</p> <p>LOCK OUT ISS CARRIAGE</p> <p>CARRY OUT ALL ADJUSTMENTS AS REQ</p> <p>STEAM CLEAN UNIT</p> <p>CHEACK OVER ATTACHMENT AND LUBE</p> <p>TEST UNIT OK</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H14832		Description: HYSTER H3.5XT TWIN PALLET TYNES					
Make: HYSTER		Model: H3.5XT		Serial No.: D466R04315R			
1204272	str inspection unit is in truganina	AMANCHANAY	30/04/2019	Internal	868.0	\$0.00	Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Carry out equipment condition assessment Repair Distributor as required, Blow out radiator core, Steam clean equipment as necessary. Removed all covers,checked for safety.Cleaned inside of disy,outside of radiator.Steam cleaned. Installed all covers,repaired number plate & secured.Painted all scratches.
1200086	Replace Tyres. PN8151514-T900	301SUBC	10/04/2019	Internal	801.0	\$0.00	Replace Tyres. PN8151514-T900
1200085	Replace Steer Tyres 6.50 - 10	301SUBC	10/04/2019	Internal	801.0	\$0.00	Replace Steer Tyres 6.50 - 10
1191907	Scheduled Service - 1000 Hour (Service HD1.5-3.5TX). 1000 Hour Service	LEIGH WAGHORNE	8/03/2019	Internal	801.0	\$0.00	Scheduled Service - Travel to site, 1000hr Service travel to site, locate for and move to work area. change oil and filter. oil looked clean. check service history. has been serviced 2 weeks ago. no further action required.
1187831	1000 hr service	JTINAO	25/02/2019	Internal	787.0	\$0.00	1000 hr service Labour Travel to site, Blow out radiator core, Grease All Points on Unit, 1000hr Service carried out SM 1000hr.service blow out unit with airas it was dusty blow out radiator core replaced engine oil and filter replaced air filter element,clean air intake ducting replaced spark plugs grease/lubricate unit test unit,good job done

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H14832		Description: HYSTER H3.5XT TWIN PALLET TYNES					
Make: HYSTER		Model: H3.5XT		Serial No.: D466R04315R			
1164521	Registration Renewal	301SUBC	23/11/2018	Internal	460.0	\$0.00	
1164520	Reversal for PO 680912	301SUBC	23/11/2018	Internal	460.0	\$0.00	
1163569	Registration	301SUBC	21/11/2018	Internal	460.0	\$0.00	Registration
1137092	Scheduled Service - Level B Service	CSYDALL	12/09/2018	Internal	460.0	\$0.00	Scheduled Service - Travel to site, 250hr Service Adjust Throttle Cable to correct specification, carry out service reroute accelerator cable and ceck over unit
1174718	Scheduled Service - 0500 Hour (Service HD1.5-3.5TX). 0500 Hour Service	LEIGH WAGHORNE	9/09/2018	Internal	730.0	\$0.00	Scheduled Service - Travel to site, Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. carry out service change oil and filter. replace air filter. check lights levels, chains and tynes. lube chains grease unit. blow out radiator and engine bay. adjust handbrake.
1133031	steer 6.50X10 pneumatic drive 28X9X15 pneumatic - Drive tyres low	301QUOTE	30/07/2018	External	467.0	\$1,496.70	steer 6.50X10 pneumatic drive 28X9X15 pneumatic - Drive tyres low
1132890	steer 6.50X10 pneumatic drive 28X9X15 pneumatic need replacement	301QUOTE	30/07/2018	External	467.0	\$0.00	steer 6.50X10 pneumatic drive 28X9X15 pneumatic need replacement
1129765	Seatbelt sensor playing up - Check tyres - Site Contact: Jeff 03 5261 3855	CSYDALL	17/07/2018	Internal	467.0	\$0.00	Seatbelt sensor playing up - Check tyres - Site Contact: Jeff 03 5261 3855 Carry out Inspection and Diagnosis of Wheel Repair Seat as necessary, lube seat belt stalk switch and replace air filter check tyres found steer tyres need replacing and drive tyres low refer to photos steer 6.50X10 pneumatic drive 28X9X15 pneumatic

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H14832		Description: HYSTER H3.5XT TWIN PALLET TYNES					
Make: HYSTER		Model: H3.5XT		Serial No.: D466R04315R			
1093968	Level B service Level B Service	Aairey	13/03/2018	Internal	716.0	\$0.00	Level B service Travel to site, service completed Labour Replace Mast Hanger Bushes, replace mast pivot bearings pick up parts from drop point travel to trquey fit bearings and test
1093055	Big bracket from the bottom of the mast has come off - Jeff 5261 3855	Aairey	8/03/2018	Internal	178.0	\$0.00	Mast hanger bushes on job 1093055 Big bracket from the bottom of the mast has come off - Jeff 5261 3855 Travel to site, Labour Carry out Inspection and Diagnosis of Mast/Carriage Replace Mast Hanger Bushes, rightside mast pivot bearing cap fallen off missing bolt travel to ggelong to get 2xnew bolts and a 16mm tap and corrct loctite tap out threads clean rough edges of bearing cap reassemble and try and retorque bolts left side bolts were loose also same proceeedure and grease bearing when finished replace pivot bearing on mast bracket replaced and new bushes fitted tos h both sides bolts havs been loctited and torqued up
1055454	Prep For STR - Faggs Mitre 10	301WORKSHOP	17/10/2017	Internal	3.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H14832		Description: HYSTER H3.5XT TWIN PALLET TYNES					
Make: HYSTER		Model: H3.5XT		Serial No.: D466R04315R			
1055449	Waiting on further PO# from customer - Sue to close off - Prep For STR - Faggs Mitre 10	301WORKSHOP	17/10/2017	Internal	4.0	\$0.00	Replace Forks/Tynes, Exchanged tynes Prepare For Hire - Workshop assemble unit carry out prehire as required repair paint waiting on tyres and id plate ordered rating plate Install Hard Labels,
1048501	Fit Mast	AHARNES	20/09/2017	Cap Prep	3.0	\$0.00	Fitted correct load rating plate to unit. Fit mast to unit. Refit Mast and ancillary items, Refit Forks/Tynes and ancillary items,
						Equipment Total:	\$8,782.55
						Customer Total:	\$8,782.55