

# ADAPT-A-LIFT GROUP PTY LTD

## Service History Listing Active Units

Date: 19/06/2026

Time: 11:24:31AM

For Equipment Code From: H15411 To: H15411

For Customer Code From: All To: All

For Date Posted From: All To: All

For Branch Code From: All To: All

Don't Show Cost

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15411		<b>Description:</b> HYSTER H2.5XT					
<b>Make:</b> HYSTER		<b>Model:</b> H2.5XT		<b>Serial No.:</b> D466R06432S			
1699003	Green tag	DDEJESUS	3/03/2025	Internal	3561.0	\$0.00	Carry out equipment condition assessment
1698602	green tag	201WORKSHOP	28/02/2025	Internal	3561.0	\$0.00	
1698600	green tag	201WORKSHOP	28/02/2025	Internal	3561.0	\$0.00	
1686173	Green tag	JDITCHBURN	14/01/2025	Internal	3561.0	\$0.00	Carry out equipment condition assessment
							Steam clean equipment as necessary.
							Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,
							Prepare For Hire - Workshop
							green tag, hand cleaned machine (no wash bay), repair seat wiring
1686171	Dehire - check for damages	AMARONEY	14/01/2025	Internal	3561.0	\$0.00	Carry out equipment condition assessment
1671705	Scheduled Service Job. Hyster D466_2000Hr SvKit_LPG_Nis_H2.0-3.5XT. 2000 Hour Service	AMARONEY	11/11/2024	Internal	3494.0	\$0.00	Change Engine Oil as required,
							Replace Engine Oil Filter,
							Replace Transmission Oil as Required
							Replace Transmission Filter,
							Remove ancillary items and Hydraulic Filter and Replace, Refit Hydraulic Filter and ancillary items,
							Replace Ignition Spark Plugs as required,
							Replace Fan Belt,
							Top up Brake fluid as required,
							Drain and refill differential oil,
							Steam clean equipment as necessary.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15411		<b>Description:</b> HYSTER H2.5XT					
<b>Make:</b> HYSTER		<b>Model:</b> H2.5XT		<b>Serial No.:</b> D466R06432S			
1671596	Green tag inspection	AMARONEY	11/11/2024	Internal	3494.0	\$0.00	Carry out equipment condition assessment  Prepare For Hire - Workshop  Steam clean equipment as necessary.  Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,  Test all functions and inspect unit. Deep clean with mud all under guards. Replace stickers. Touch up paint. Carry out equipment condition assessment
1671423	RENTAL RETURN - CHECK FOR DAMAGES	MSEGHABI	8/11/2024	Internal	3494.0	\$0.00	good Carry out Inspection and Diagnosis of Electrical System
1662041	STR IC - Green tag inspection	AMARONEY	4/10/2024	Internal	3490.0	\$0.00	Carry out equipment condition assessment  Steam clean equipment as necessary.  Prepare For Hire - Workshop  Diagnose fault code err038.(no start) -Test battery, starter motor and alternator (Battery not up to full operation, starter motor recieving full voltage) -Remove and recharger batteries to full operation. -Refit battery re-calibrate forktrack weight guage ( cutting out machine when full load with overload sensor) *corrected weight so doesnt cut off unit unless overloaded. Test and inspect unit / functions. Clean unit (invested with spider) Replace engine oil / filter. Clean air filter. grease unit. Replace stickers.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15411		<b>Description:</b> HYSTER H2.5XT					
<b>Make:</b> HYSTER		<b>Model:</b> H2.5XT		<b>Serial No.:</b> D466R06432S			
1644755	JUAN PARTS READY Scheduled Service - SF 500HR IC SM .0500 Hour Service	AMARONEY	4/10/2024	Internal	3488.0	\$0.00	Change Engine Oil as required, Replace Engine Oil Filter, Remove, clean and refit Air filter, Remove ancillary items and Remove Battery from unit and Inspect and report, Refit Battery to unit, Refit ancillary items, Adjust Fleet Management System as required, Grease All Points on Unit, Steam clean equipment as necessary. Diagnose fault code err038.(no start) -Test battery, starter motor and alternator (Battery not up to full operation, starter motor recieving full voltage) -Remove and recharger batteries to full operation. -Refit battery re-calibrate fortrack weight guage ( cutting out machine when full load with overload sensor) *cor rected weight so doesnt cut off unit unless overloaded . Test and inspect unit / functions. Clean unit (invested with spider) Replace engine oil / filter. CLean air filter. grease unit. Replace stickers. Carry out equipment condition assessment
1661300	RENTAL RETURN - CHECK FOR DAMAGES	MSEGHABI	1/10/2024	Internal	3488.0	\$0.00	no damageable Travel to site,  Carry out Inspection and Diagnosis of Electrical System  Labour  Replace Battery,
1612481	Unit will not turn on. Completely flat. PTKT 710002	JPrinitis	3/04/2024	Internal	3842.0	\$0.00	travel to site, locate unit, check for no start, found unit has flat battery, jump started unit and checked alternator is charging just battery needs replacing, sourced new battery, returned to site and fitted battery and tested unit ok.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15411		<b>Description:</b> HYSTER H2.5XT					
<b>Make:</b> HYSTER		<b>Model:</b> H2.5XT		<b>Serial No.:</b> D466R06432S			
1558089	Scheduled Service - TC IC 1000HR SM .1000 Hour Service	MPERIA	2/02/2024	Internal	3480.0	\$0.00	Labour  1000hr Service  Locate machine 1000hr service Carry out preventive Maintenance Service and safety inspection in the line with agreed scope of works Report on condition of Equipment and additional works requirement Grease all point and clean machine
1516653	Unit has a flat battery , Tagged out . ETKT 343546	NCLARKE	27/02/2023	Internal	3469.0	\$0.00	Labour  Travel to site,  Replace Battery,  travel to parts picked up battery travel to site replaced battery unit doesnt get used often noticed no gas going to conveertor checked bottle conection not fitted correctly removed lubed fitting refitted started unit unable to locate customer
1473304	Scheduled Service - KM IC 4000hr SM - 4000hrs .4000 Hour Service	GSINGH	5/10/2022	Internal	3464.0	\$0.00	Labour  Travel to site,  4000hr Service,
1458574	The unit has a flat battery. Tagged Out. ETKT-152396 via Guy P.	NCLARKE	15/06/2022	Internal	3561.0	\$0.00	Labour  pickup parts, travel to site, access truck to safe work area, perform scheduled pm service,  Travel to site,  Replace Battery,  Adjust LPG Convertor to correct specification,  replaced battery tuned gas system ajusted fan belt

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15411		<b>Description:</b> HYSTER H2.5XT					
<b>Make:</b> HYSTER		<b>Model:</b> H2.5XT		<b>Serial No.:</b> D466R06432S			
1428145	Unit will not move, could be a collision fault - After picking up something heavy the fault came in	AKALANJ	3/02/2022	Internal	3420.0	\$0.00	Carry out Inspection and Diagnosis of Telemetry System  Adjust Fleet Management System as required,  Repair Seat Switch Wiring,  Locate broken down unit on site. Complete take 5 safety screen. Diagnose fleet management impact fault. Clear fault and reprogram parameters in smart trak system. Remove seat and repair wiring to switch. Tidy up wiring for seat wiring harness in and around battery. Reassemble seat to unit and test operation. Test smart trak system by driving around site on harsh surface and impacting on to other unit. No shut down fault logged. System is operating correctly. Return unit to work area. Travel to site,
1414800	Unit has locked it self out. Tagged out.	GSINGH	16/11/2021	Internal	3363.0	\$0.00	Carry out equipment condition assessment  Carry out Inspection and Diagnosis of Electrical System  Carry out Inspection and Diagnosis of Telemetry System  Adjust Fleet Management System as required,  travel to site, find contact person, locate unit, check fortrack system, remove lockout, secure impact sensor, operate and check ok, lube carriage . Travel to site,
1410186	Tines are in the air and can't be lowered because of fault. Tagged Out.	RMLNE	25/10/2021	Internal	3334.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System  Repair Fleet Management System as required,  tynes in the air and cant be lowered because of fault fortrack locked out inspected. tested operation. confirmed. spoke with speedshield. removed lockout on fortrack. tested operation. found seatbelt light flashing on dash. repaired wiring on seatbelt sensor. tested operation. ok

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15411		<b>Description:</b> HYSTER H2.5XT					
<b>Make:</b> HYSTER		<b>Model:</b> H2.5XT		<b>Serial No.:</b> D466R06432S			
1379665	Leaking gas. SF Email.	ASTOKES	4/06/2021	Internal	3254.0	\$0.00	Travel to site,  Carry out Inspection and Diagnosis of Electrical System  COMPLAINT: UNIT LEAKING GAS. CAUSE: GAS CONVERTER INTERNAL FAULT. CORRECTION: REPLACE CONVERTER.  Remove ancillary items and Repair Gas Leak as necessary, Refit ancillary items,  COMPLAINT: UNIT LEAKING GAS. CAUSE: FOUND THROTTLE BODY O-RING SPLIT. CORRECTION: REPLACED O-RING AND CLEANED THROTTLE BODY.
1365876	FW 1363581 - Replace RH & LHS Mirror	GSINGH	14/04/2021	External	3179.0	\$401.00	Travel to site,  Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,
1363581	Scheduled Service - 2000 Hour Service .2000 Hour Service	GSINGH	18/03/2021	Internal	3137.0	\$0.00	travel to site, wccess truck to safe work area, remove and replace broken mirrors, 2000hr Service access truck to created safe work area, perform scheduled pm service, ps; right side mirror missing and left side cracked.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15411		<b>Description:</b> HYSTER H2.5XT					
<b>Make:</b> HYSTER		<b>Model:</b> H2.5XT		<b>Serial No.:</b> D466R06432S			
1342150	Unit will not start.Urgent SF EMAIL	MSHAHEEM	24/11/2020	Internal	2988.0	\$0.00	<p>Travel to site,</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Carry out Inspection and Diagnosis of Telemetry System</p> <p>Travel to site, locate unit and inspect fault with intermittent seat sensor issue. Diagnose fault with the electrical and forklift system, check all related components, reboot forklift system. Could not get the unit to fault but through the information described by the customer and the symptoms FM1 module seems to be at fault as all the required signals are received by the module but intermittently the FM1 module seems to trip out and fails to send output signals. FM1 module will require replacement. Ordered parts.</p> <p>Repair Fleet Management System as required,</p> <p>Remove ancillary items and Repair Gas Leak as necessary, Refit ancillary items,</p> <p>Travel to site, wait for unit and replaced FM1 module, configure settings and test, ok. Customer complained about gas smell as well, diagnose for gas leak and repaired gas pipe fitting at the LPG convertor, test, ok. Correction - replaced FM1 module and repaired gas leak</p> <p>Travel to site,</p> <p>Adjust Switch/es</p>
1334851	CW - Fork will not start at all - Urgent - SF Email.	NCLARKE	20/10/2020	Internal	2955.0	\$0.00	
1327396	CW - All tyres need to be replaced - Could not advise size - SF Email.	201SUBC	16/09/2020	Internal	2883.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15411		<b>Description:</b> HYSTER H2.5XT					
<b>Make:</b> HYSTER		<b>Model:</b> H2.5XT		<b>Serial No.:</b> D466R06432S			
1327017	CW - Staff saying not starting due to sensor in seat - SF Email.	ALI	15/09/2020	Internal	2883.0	\$0.00	<p>Travel to site,</p> <p>Carry out Inspection and Diagnosis of Telemetry System</p> <p>Repair Switch/es</p> <p>to site. locate unit. check. engine oil pressure warning on dash display. adjust seat /fork track settings. check oil pressure switch.</p> <p>Labour</p> <p>Replace Switch/es</p> <p>Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,</p> <p>to nacco,pick up. to site. locate unit. replace a faulty oil pressure switch, correct wiring. test, no more oil pressure warning . explain start sequence to driver. test for a while, start is always ok. broken off a mirror.</p> <p>c1:no start. c2: fork track setting/not sit on to seat sensor/card is away from reader/too rush in steps.c3:check/adjust. explain. fix engine oil pressure warning.</p>
1325150	MONDAY 14TH - Scheduled Service - 500 Hour Service .0500 Hour Service	DPhangnalay	14/09/2020	Internal	2867.0	\$0.00	<p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p> <p>Carried out 500hr service as required.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15411		<b>Description:</b> HYSTER H2.5XT					
<b>Make:</b> HYSTER		<b>Model:</b> H2.5XT		<b>Serial No.:</b> D466R06432S			
1320742	CW-Issue with seatbelt, unit wont start. SF Email.	DPhangnalay	17/08/2020	Internal	2767.0	\$0.00	<p>Travel to site,</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,</p> <p>Carried out diagnosis on ignition system. When sitting on seat relay started buzzing. Further inspection found burnt out wiring under bonnet for seat wiring. Repaired wiring and check. Unit started but wiring is getting hot. Suspect short circuit. Need to find the short. Further inspection is needed.</p> <p>Carried out diagnosis on seat issue. Found electrical fault coming from seat sensor. Repaired all burnt wiring. Seat sensor on order.</p> <p>Replace Switch/es</p> <p>Adjust Switch/es</p> <p>Carried out removing and replacing seat switch. Had troubles getting switch set up. Repaired wiring from seat to seat module. Test check function ok. Wiring not getting hot anymore. Return unit to service.</p>
1314930	Brake pedal pad needs replacing as it has broke. SF Email.	GSINGH	20/07/2020	External	2673.0	\$510.80	<p>Carry out equipment condition assessment</p> <p>travel to site, sign in, access truck to safe work area, check pedals and rubbers, found throttle pedal broken [not brake pedal rubber as mentioned on job], order parts,</p> <p>Travel to site,</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>Repair LPG Bottle bracket as required,</p> <p>travel to site , wait for truck, access to safe working area, replace accelerator pedal, secure lpg bracket base and adjust, operate and check ok.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15411		<b>Description:</b> HYSTER H2.5XT					
<b>Make:</b> HYSTER		<b>Model:</b> H2.5XT		<b>Serial No.:</b> D466R06432S			
1310998	Seat to be replaced	GSINGH	1/07/2020	Internal	2600.0	\$0.00	Labour  Travel to site,  Replace Seat,  Repair Seat Switch Wiring,  pickup seat , travel to site, [ ps - excess travel time accident traffic], access truck to safe work area, remove and replace seat,make connectors and hook uo wiring, operate and check ok. Travel to site,
1310785	CW-Breaking down whist operating. SF Email.	GSINGH	1/07/2020	Internal	2599.0	\$0.00	Travel to site,  Carry out equipment condition assessment  Carry out Inspection and Diagnosis of Electrical System  Carry out Inspection and Diagnosis of Telemetry System  Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,  travel to site, access truck to safe working area, check for stalling, check forktrack system, check fuel and electrics, secure lockoff harness and connections , operate and check ok, Travel to site,
1300448	CW-Unit was leaking gas and shut down. SF Email.	GBANKS	25/05/2020	Internal	2478.0	\$0.00	Travel to site,  Carry out Inspection and Diagnosis of Electrical System  Repair LPG Mixer as necessary,  Refit Battery to unit, Refit ancillary items,  TRAVEL TO SITE FIND UNIT.DIAGNOSIS GAS SMELL,CHECK FOR LEAKS.FOUND UNIT RUNNING ROUGH RICH.CLEAN CARBY ,INJECTOR,MAP SENCER AND O2 SENCER.UNIT RUNNING GOOD.TOP UP OILS AND COOLANT.TIGHTEN BATTERY HOLD DOWN STRAP.GB25/5/2020.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15411		<b>Description:</b> HYSTER H2.5XT					
<b>Make:</b> HYSTER		<b>Model:</b> H2.5XT		<b>Serial No.:</b> D466R06432S			
1299410	CW-Unit had a very strong smell of gas then shut down. SF Email.	JPrinitis	20/05/2020	Internal	2464.0	\$0.00	<p>Travel to site,</p> <p>Carry out equipment condition assessment</p> <p>Remove ancillary items and Repair Gas Leak as necessary, Refit ancillary items,</p> <p>travel to site, sign in, locate unit, checked over unit for gas leak, checked all gas fittings and found gas block on rear pillar has leaking fittings, removed gas block and removed leaking fittings, refitted fittings with fresh gas tape and refitted to unit, tested unit for leaks tested ok, tested unit ok not shutting down.</p>
1295701	CW - Staff think its the battery thats dead - SF Email.	GSINGH	5/05/2020	Internal	2426.0	\$0.00	<p>Labour</p> <p>Travel to site,</p> <p>Carry out equipment condition assessment</p> <p>Replace Battery,</p> <p>travel to base, wait to be served, pickup battery, travel to site, wait for customer to organise entry into dock to access truck, access truck, check battery, remove and replace, check charging ok,</p>
1290555	CW - Unit will not start, possibly the battery - SF Email.	MSHAHEEM	14/04/2020	Internal	2410.0	\$0.00	<p>Travel to site,</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Repair LPG Mixer as necessary,</p> <p>Carry out Inspection and Diagnosis of Telemetry System</p> <p>Repair Fleet Management System as required,</p> <p>Travel to site, locate contact, unit and inspect fault with unit cutting out when on idle. Diagnose fault, check electrical and gas system. Check forktrack system. Call Speedshield and recalibrate forktrack system settings. Trace forktrack wiring system to ensure installed correctly, test,ok.</p> <p>Complain - unit cutting out</p> <p>Cause - forktrack system</p> <p>Correction - repair forktrack system</p>
1288886	Replace LHS Rear View Mirror	901QUOTE01	2/04/2020	Internal	2386.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15411		<b>Description:</b> HYSTER H2.5XT					
<b>Make:</b> HYSTER		<b>Model:</b> H2.5XT		<b>Serial No.:</b> D466R06432S			
1287288	TUESDAY 31ST - KIT ORDERED - Scheduled Service - 500 Hour Service 500 Hour Service. 0500 Hour Service	DPhangnalay	31/03/2020	Internal	2386.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.  Carried out 500hr service as required. Left hand rear view mirror broken. Seat worn. See photos for refs.
1261145	Unit: 3 - Worn steer non-marking tyres. (SF email via Andrew Fitzhenry).	201SUBC	4/12/2019	Internal	1932.0	\$0.00	
1248806	CW-Screen has gone blank & unit is unactive. SF Email.	DPhangnalay	18/10/2019	Internal	1967.0	\$0.00	Travel to site, Repair Fleet Management System as required, Carry out equipment condition assessment Carried out diagnosis on ignition system. Found forktrack screen on but blank screen. Removed forktrack and open unit on and removed faulty screen. Found spare screen in the van. Removed and replaced screen. Refit for track and test. Forktrack was locked out. Entered configuration and removed lockout. Test function ok. Carried out inspection on condition on unit found left hand rear view mirror cracked see photo. Return unit to customer
1244403	PARTS ORDERED - Friday 4th - Scheduled Service - 500 Hour Service 500 Hour Service. 0500 Hour Service	GSINGH	4/10/2019	Internal	1923.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.  Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,  access truck to safe working area, perform scheduled pm seervice, repair oil leak.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15411		<b>Description:</b> HYSTER H2.5XT					
<b>Make:</b> HYSTER		<b>Model:</b> H2.5XT		<b>Serial No.:</b> D466R06432S			
1238033	CW-Unit is inactive & non visible screen. SF Email	SKHAN	4/09/2019	Internal	1785.0	\$0.00	<p>Travel to site,</p> <p>Carry out Inspection and Diagnosis of Telemetry System</p> <p>Labour</p> <p>*Blank forktrack screen</p> <p>*Possible wear and tear (no damage to outer casing, crack on LCD screen) ref pics</p> <p>*Order and pick up from Nacho</p> <p>Further diagnosis if required only once the forktrack display screen is replaced.</p> <p>*Incorrect part @ Nacho, reorder part</p> <p>*Organised to pick up and return part from W/P tomorrow morning</p> <p>Repair Fleet Management System as required,</p> <p>Adjust Fleet Management System as required,</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,</p> <p>*Display screen damaged internally</p> <p>*No signs of external damage, wear and tear item</p> <p>Ref pics 1, 3 and 4</p> <p>*Replaced screen, ref pic 5</p> <p>Working as designed</p> <p>Operator complaint</p> <p>*Unit not starting (intermittent)</p> <p>*possible Faulty seat switch sensor</p> <p>Seems to have been previously repaired, ref pic 6</p> <p>*Repaired, ref pic 7, 8 and 9</p> <p>Customer to monitor</p> <p>Labour</p>
1229095	PARTS ORDERED - Replce Forktrack Screen	GSINGH	5/08/2019	External	1702.0	\$551.60	<p>Travel to site,</p> <p>Repair Fleet Management System as required,</p> <p>pickup parts,travel to site,signin, access truck to safe working area,remove and replace damaged fm2 enclosure,</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15411		<b>Description:</b> HYSTER H2.5XT					
<b>Make:</b> HYSTER		<b>Model:</b> H2.5XT		<b>Serial No.:</b> D466R06432S			
1198716	Scheduled Service - 1000 Hour (Service HD1.5-3.5TX). 1000 Hour Service	GSINGH	5/04/2019	Internal	1244.0	\$0.00	Scheduled Service -  Labour  Travel to site,  1000hr Service  travel to site,signin, access truck to safe working area, perform scheduled pm service, Front tyres require replacement (sf) - please advise tyres sizes
1193035	Front tyres require replacement (sf) - please advise tyres sizes	DPhangnalay	15/03/2019	Internal	1184.0	\$0.00	Travel to site,  Carry out Inspection and Diagnosis of Attachment  Travelled to site. located unit. carried inspection on wheels. Front left wore. drive wheels have uneven wear and need replacing. see photos. wheel spec: 7.00-12/5.00 solid white  22/03 - CMC sent request for quote to Trelleborg 29/03 nsz, advised not chargeable, following up with TWS.
1177341	Drivers side back the tyre deflated. (Salesforce email)	MLAM	17/01/2019	Internal	612.0	\$0.00	Drivers side back the tyre deflated. (Salesforce email)  Travel to site,  Carry out equipment condition assessment  Travel to site, Site induction/sign in, Wait for site contact Sue hand, Escorted to unit, Customer requested i have a quick visual of all the tyres on site - all other units satisfactory, Rear steer tyres x 2 worn to limit - size 6.00-9/4.00 solid - refer to pics, Sue hand requested information on eta please, sign out.  Replaced steer tyres as required

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15411		<b>Description:</b> HYSTER H2.5XT					
<b>Make:</b> HYSTER		<b>Model:</b> H2.5XT		<b>Serial No.:</b> D466R06432S			
1171639	Have tech assess starter mechanism, its playing up. Unit will not start. Broken down with tynes elevated. (salesforce email)	SKHAN	18/12/2018	Internal	604.0	\$0.00	<p>Have tech assess starter mechanism, its playing up. Unit will not start. Broken down with tynes elevated. (salesforce email)</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Diagnosed issue. Problem with strat up due to all 3 sensors not in sync. Removed, fixed and replaced sensors. Re callibrated system. Function is working as designed.</p>
1161522	Tynes dont move - tagged out. (salesforce email)	GSINGH	14/11/2018	Internal	598.0	\$0.00	<p>Tynes dont move - tagged out. (salesforce email)</p> <p>Carry out equipment condition assessment</p> <p>Carry out Inspection and Diagnosis of Attachment</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,</p> <p>Adjust Switch/es</p> <p>travel to site, signin, locate truck and access to safe working area,iinspect attachment,check hydraulics and electrics, test solenoid,check wiring circuits and harnesses and repair</p>
1155421	Carry out welding of the bin hook	GSTARK	23/10/2018	Internal	423.0	\$0.00	<p>Carry out welding of the bin hook</p> <p>Travel to site,</p> <p>Carry out Inspection and Diagnosis of Attachment</p> <p>checked unit found to need an enginer to come out and weld d shackle to carage. took photos of d clamp and where hook should be welded to back of.</p>
1154067	Claiming gas leak	GDEAN	17/10/2018	Internal	356.0	\$0.00	<p>Claiming gas leak</p> <p>Remove ancillary items and Repair Gas Leak as necessary, Refit ancillary items,</p> <p>Travel to site,</p> <p>Check unit for gas leak locate bottle and get gas start unit test for gas leak tighten vapour line to mixer check lock off all test ok,</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15411		<b>Description:</b> HYSTER H2.5XT					
<b>Make:</b> HYSTER		<b>Model:</b> H2.5XT		<b>Serial No.:</b> D466R06432S			
1153167	ForkTrack install to be checked - it is not registering drive motor and hydraulic hours as per Darren Butler from Speedshield	CLEONARD	15/10/2018	Internal	332.0	\$0.00	<p>ForkTrack install to be checked - it is not registering drive motor and hydraulic hours as per Darren Butler from Speedshield</p> <p>Repair Fleet Management System as required,</p> <p>diagnose fault in forktrack not monitoring engine time,found unit not displaying engine rpm due to an internal fault,re allocated input and speedshield reprogrammed module to suit,tested unit ok</p>
1142727	Unit not reporting engine or hydraulic meters as per Dale Hedley.	CLEONARD	5/09/2018	Internal	202.0	\$0.00	<p>Unit not reporting engine or hydraulic meters as per Dale Hedley.</p> <p>Carry out Inspection and Diagnosis of Telemetry System</p> <p>Repair Ignition Circuit as required,</p> <p>inspect non reporting of various timers on fm1,data is enabled in dash but not reading on fm1,poss can issue,could not contact speedshield due to public holiday,removed timed shutdown relay in unit to stop unit cutting out when alighting from unit.speedshield to follow up</p> <p>Repair Fleet Management System as required,</p> <p>diagnose faults in both units on site at fairfax re:glen gilbert</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15411		<b>Description:</b> HYSTER H2.5XT					
<b>Make:</b> HYSTER		<b>Model:</b> H2.5XT		<b>Serial No.:</b> D466R06432S			
1133294	PREP FOR LTR - FAIRFAX MEDIA	CGITTOES	31/07/2018	Cap Prep	0.0	\$0.00	<p>"Description"</p> <p>"Model H2.5XT - AL - LPG Engine"</p> <p>"Nominal Capacity - 2500kg"</p> <p>"LED Rotating Beacon - Ignition Switch Operated"</p> <p>"2130mm Overhead Guard"</p> <p>"LPG Quick Coupling With Relief Valve"</p> <p>"6 LED Headlight"</p> <p>"LED Rear Combination Lights"</p> <p>"Reversing Alarm"</p> <p>"Mechanical Lever Hydraulic Controls"</p> <p>"4 Function (2 Aux) Hydraulic Valve"</p> <p>"40 X 122 X 1070mm Hook Type Std Taper Forks"</p> <p>"Load Backrest 1070MM High"</p> <p>"Std 7.00 x 12 Pneumatic Shaped Solid Drive Tyres"</p> <p>"6.00 x 9 - Pneumatic Shaped Solid Dunlop"</p> <p>"Full Suspension With Seq Buckle I/L (Australia)"</p> <p>"4510mm 2 Stage LFL Mast (2870mm Lowered Height)"</p> <p>"Dual Pedal Inch Brake"</p> <p>"Rear Drive Handle W Horn Button"</p> <p>"Lexan Overhead Guard Cover"</p> <p>"Directional Lever Left Hand Side"</p> <p>"ISS + 4th HTU W/O QC V-Mast"</p> <p>"Load Weight Display"</p> <p>"Rear View Mirror""Description"</p> <p>"Attachment Fit Up - Fork Positioner"</p> <p>"Pre Delivery Inspection - 0 - 5.5 Ton"</p> <p>"Rating Plate for Non Factory Ordered Attachments"</p> <p>"Load Guard Fork Positioner - Class 2 (100)"</p> <p>"Non Marking Tyres"</p> <p>"Lexan Roof"</p> <p>"Reflective tape down the mast"</p> <p>"18Kg gas bottle bracket"</p> <p>"6 degree tilt in both directions"</p> <p>"Hyster 3 Year Warranty - Standard"</p> <p>Refit Mast and ancillary items,</p> <p>Carry out New Equipment Predelivery to correct specification.</p> <p>Replace LPG Bottle bracket as required,</p> <p>Fit Attachment and ancillary items,</p> <p>Fit Fleet Management System as required,</p> <p>Repair Mast as necessary,</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001 <b>Equip. Code:</b> H15411 <b>Description:</b> HYSTER H2.5XT <b>Make:</b> HYSTER <b>Model:</b> H2.5XT <b>Serial No.:</b> D466R06432S							
							Prepare For Sale - Workshop
							Steam clean equipment as necessary.
							Remove ancillary items, prepare and Paint unit as required,
							Install Hi-Vis Tape,
1102075	Prep for Sale Bunnings Mornington TAS	301WORKSHOP	11/07/2018	Cap Prep	0.0	\$0.00	
						<b>Equipment Total:</b>	<b>\$1,463.40</b>
						<b>Customer Total:</b>	<b>\$1,463.40</b>