

# ADAPT-A-LIFT GROUP PTY LTD

## Service History Listing Active Units

Date: 19/06/2026

Time: 10:46:14AM

For Equipment Code From: H15946 To: H15946

For Customer Code From: All To: All

For Date Posted From: All To: All

For Branch Code From: All To: All

Don't Show Cost

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1827712	Oversee transport off site	GOSMOND	21/05/2026	Internal	23223.0	\$0.00	Carry out equipment condition assessment
1787449	Dehire and Demobilisation	GOSMOND	15/04/2026	External	23223.0	\$1,503.30	Assist with loading truck and masts. Travel to site Cap off unit hydraulics and prep the day before demobilisation  Travel to site Create an exclusion zone and isolate the machine Replace damaged cabin air louver Liaise with Franna to remove mast and carriage from unit Load unit for transport. Transport unit offsite. Please delete. Truck has been dehire and has a failed transmission.
1762005	21250hr II 250hr Service	BIG TRUCK SA	8/11/2025	Internal	21305.0	\$0.00	Truck dehire due to transmission failing.
1762559	alarm E0197	GOSMOND	7/11/2025	Internal	21304.0	\$0.00	Steam clean equipment as necessary.
1759050	Dehire Inspection	GOSMOND	23/10/2025	Internal	21305.0	\$0.00	Carry out equipment condition assessment
1754650	21000hr II 500hr Service	GOSMOND	19/10/2025	Internal	21015.0	\$0.00	Clean truck and perform dehire inspection. Steam clean equipment as necessary.  Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.  Clean truck. Perform 21000hr pm. NOTE only did a 500hr service due to nearly off hire. Replaced broken steer wheel stud. Stud booked from previous job. Chains 0.0% Tynes 78mm. Put back online.
1754568	blue reverse light not working	GOSMOND	7/10/2025	Internal	10848.0	\$0.00	Replace Light/s  Diagnose no blue light. Light has failed. Replace with new one and test ok. Swap door striker post left to right as was worn. Adjust door ok. Repair wiring to lhs lower cab worklight. Test ok. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1749175	20750hr II 250hr Service	GOSMOND	2/10/2025	Internal	20737.0	\$0.00	Steam clean equipment as necessary.  250hr Service  Clean truck. Perform 20750hr pm service. Tynes 78mm. Chains 1.95%(Chains waiting to do the job). Put back online.
1748938	FW - Oil leaking from transmission cooler core	GOSMOND	15/09/2025	External	20716.0	\$5,372.17	Collect parts and travel to site Replace and reseal leaking transmission cooler Top up transmission oil.  Steam clean equipment as necessary.  Remove ancillary items and Transmission Oil Cooler, Inspect and report,  Refit Transmission Oil Cooler and ancillary items,  Clean truck. Remove leaking transmission cooler and fit new one. Check for leaks ok. Top up trans and hyd oil. Put back online. Cleanup and packup.
1748917	H15946 - repair greaser	GOSMOND	15/09/2025	Internal	20911.0	\$0.00	Grease All Points on Unit,  Error cde E12. B side not getting to cutoff pressure. Perform all tests in manual. No fault found. Bleed system as air in system is a cause. Put back online and see.  Bleed system again. Run many cycles all good. Put back online.
1745480	20500hr II 500hr Service	GOSMOND	12/09/2025	Internal	20471.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.  Steam clean equipment as necessary.  Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,  Clean truck. Perform 20500hr pm service. Chains are being replaced. Tynes 78.7mm. Transmission cooler weeping. Will do further work. Repair forktrack keypad and display mount.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1743433	20250hr II 250hr Service	GOSMOND	1/09/2025	Internal	20290.0	\$0.00	Steam clean equipment as necessary.  250hr Service  Clean truck. Perform 20250hr pm service. Chains up for replacement, tynes 78.7mm. put back online. Replace Lift Chain,
1744266	Lift Chain Replacement	GOSMOND	28/08/2025	External	20909.0	\$6,089.80	Steam clean equipment as necessary.  Clean truck. Remove old lift chains. Split new chains to length. Fit new chains and pins. Adjust to correct length. Adjust hoses and loom. Lubricate and put back online. 5000hr Service
1738464	20000hr II 5000hr Service	GOSMOND	25/08/2025	Internal	20198.0	\$0.00	Engine service only.  Changed Transmission oil and filter. Performed valve clearance adjustment. Greased truck.  Steam clean equipment as necessary.  Finished 20000hr pm service. Cleaned truck. Replaced broken drive wheel stud lhs drive. Tynes 78.7mm Chains 1.95%. Will get further work job opened to replace chains. Replace Light/s
1739146	H15946 - blue light on back of fork is not working	GOSMOND	7/08/2025	Internal	19830.0	\$0.00	Rear blue light failed. Replace with new unit. Test ok. Put back online.
1734787	19750hr II 250hr Service	GOSMOND	6/08/2025	Internal	19780.0	\$0.00	Steam clean equipment as necessary.  250hr Service
1738301	H15946 - replace broken wheel stud and replace hoses under cab	GOSMOND	4/08/2025	Internal	20175.0	\$0.00	Clean truck. Perform 19750hr pm service. Top up coolant. Repair Hub/s as necessary,  Replace Hydraulic Hose/s and ancillary items,  Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,  Replace leaking hoses under cab and replace broken wheel stud rhs drive. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1729803	19500hr II 500hr Service	GOSMOND	16/07/2025	Internal	19488.0	\$0.00	Steam clean equipment as necessary.  Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.  Clean truck. Perform 19500hr pm service. Replace rear wiper blade. Replace missing wheel nut flags. Leak from transmission cooler. Chains 1.5% Tynes 78.4mm. Put back online. Supply only.
1728879	Replace fuel cap	GOSMOND	1/07/2025	External	19350.0	\$163.19	
1724048	19250hr II 250hr Service	GOSMOND	26/06/2025	Internal	19264.0	\$0.00	Steam clean equipment as necessary.  250hr Service  Clean truck. Perform 19250hr pm service. Chains at 1.5% Tynes 78.4mm. Put back online. Repair Hydraulic Control Valve as necessary,
1725507	Hard steering	GOSMOND	16/06/2025	Internal	19094.0	\$0.00	Dignose hard steering and brake pressure alarm on. Remove brake manifold and reseal. Blow out orifices but ok. Remove orifice R. Found to be blocked. Clean and refit to truck. Refit brake manifold. Test ok. Put back online. Steam clean equipment as necessary.
1710670	19000hr II 1000hr Service	GOSMOND	6/06/2025	Internal	19023.0	\$0.00	1000hr Service  Clean truck. Perform 19000hr pm service. Replace grease nipple on tailshaft. Adjust lhs steer wheel bearings. Chains 1.5% Tynes 78.3mm. Put back online. Repair Tyne Latch as necessary,
1720816	L/H Tyne retainer pin has come out	GOSMOND	28/05/2025	Internal	18908.0	\$0.00	Remove tyne securing pin. Cut and weld new stop on end of pin. Refit and test. ok. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1711478	Intermittent brake alarm	GOSMOND	28/05/2025	Internal	18900.0	\$0.00	Adjust Hydraulic Pressure Settings to correct specification,  Order Parts for repair.  Carry out Inspection and Diagnosis of Brake System  Diagnose low brake pressure alarm on. Pressure readings similar to issue with H15960 recently. Replace charging valve. Test ok. Put back online.  Check/Inspect/Diagnose Hydraulic Tilt Valve Section and test operation,
1701470	18750hr II 250hr Service	GOSMOND	11/04/2025	Internal	18741.0	\$0.00	Test ok after many shifts. Problem solved. Steam clean equipment as necessary.  250hr Service  Clean truck. Perform 18750hr pm service. Top up coolant. Put back online.
1700957	Alarms coming up	GOSMOND	11/04/2025	Internal	18741.0	\$0.00	Remove and Replace Coolant Hose/s  Diagnose codes E235 and E197. Both relate to coolant level. Hole in heater hose. Also coolant tank discoloured. Replace hose and tank. Fill with coolant and bleed. Ok. Put back online.
1708767	Coolant leak	GOSMOND	8/04/2025	Internal	18691.0	\$0.00	Check for leaks. ok. put back online. Shane did job.  Replace Water Pump,
1699782	18500hr II 500hr Service	GOSMOND	11/03/2025	Internal	18550.0	\$0.00	replace water pump,bleed cooling system Steam clean equipment as necessary.  Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1696140	Inspect & replace blue reverse light	GOSMOND	11/03/2025	Internal	18550.0	\$0.00	Clean truck. Perform 18500hr pm service. Chains at 1.75%. Put back online. Replace Light/s  Replace blue reverse light. Test ok and adjust. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1698029	Reverse camera not working	GOSMOND	28/02/2025	Internal	18399.0	\$0.00	Fit Full Camera Kit,  Checked camera and working fine. Park job for a week to see if the problem reappears.
1696106	18250hr II 250hr Service	SPitman	26/02/2025	Internal	18399.0	\$0.00	250hr Service  carry out 250hr service
1695296	Replace worn seat base / cushion	GOSMOND	19/02/2025	Internal	18308.0	\$0.00	Job performed by SP. Only to me to book parts. Repair Seat as necessary,  Order part  Replace worn lower seat cushion. Test ok. Put back online.
1695170	Park brake not holding	GOSMOND	17/02/2025	Internal	18267.0	\$0.00	Block up unit, Adjust brakes and handbrake,  Park brake not holding. Adjust park brake. Test ok. Put back online.
1693782	Chain inspection & sheeve roller assessment	GOSMOND	12/02/2025	Internal	18180.0	\$0.00	Carry out Inspection and Diagnosis of Mast/Carriage  Perform sheave and chain inspection. Sheave visual inspection ok. Chains 50% worn. Put back online.
1693708	A/C Not working	GOSMOND	12/02/2025	Internal	18180.0	\$0.00	Repair Air Conditioner as necessary,  Diagnose intermittant cooling. System operating great. Outlet temp 10degrees. Found clutch not reliably cutting in due to increased clearance. Remove shims from clutch and reassemble. Test ok. Put back online.
1692400	A/C Freezing up	GOSMOND	6/02/2025	Internal	18080.0	\$0.00	Diagnose A/C freezing up. Drop box and wash out cores and drains. Replace thermostat. Reassemble. Test ok. Put back online.
1681743	18000 II 3000hr Service	GOSMOND	6/02/2025	Internal	18078.0	\$0.00	Repair Air Conditioner as necessary, Steam clean equipment as necessary.  2000hr Service  Clean truck. Perform 18000hr pm service. Change diff and final drive oil. Change hydraulic oil and filter. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1684003	Reseal RHS Tilt Cylinder (Job 1604259 closed prematurely)	GOSMOND	6/01/2025	Internal	17766.0	\$0.00	Labour  Travel to site,  Repair Hydraulic Tilt Cylinder as required,  Pickup part from repairer. Travel to site. Refit rhs tilt cylinder assembly to barrel. Reconnect and adjust stroke length. Test ok. Top up hydraulic oil. Fault with seat switch so changed out for new one. Put back online.
1678658	RHS mudflap ripped off	GOSMOND	5/12/2024	External	17755.0	\$222.15	Carry out Repairs to Mud Flaps,  Drill out broken bolts and tap new threads. Refit mudflap and put back online.
1674448	17750hr II 250hr Service	GOSMOND	5/12/2024	Internal	17749.0	\$0.00	Steam clean equipment as necessary.  250hr Service
1672430	AC Fault	GOSMOND	13/11/2024	Internal	17720.0	\$0.00	Clean truck. Perform 17750hr pm service. Replace one worklight. Put back online. Repair Air Conditioner as necessary, Check operation. Seems ok but not putting out super cold air and operator says when it gets hotter it gives up. Suspect low on gas and needing a service. Re-gas Air Conditioner to correct specification, Assist A/C contractor servicing system and regas. Test ok put back online.
1667375	17500hr II 500hr Service	GOSMOND	12/11/2024	Internal	17562.0	\$0.00	Steam clean equipment as necessary.  Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1665779	Oil Leak	GOSMOND	18/10/2024	Internal	17332.0	\$0.00	Clean truck. Perform 17500 hr pm service. Put back online. Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,  Diagnose oil leak. Unable to find one? Put back online to see if it shows itself.
1664235	replace worn seat cushion	GOSMOND	14/10/2024	Internal	17230.0	\$0.00	Checked ok. No oil leak found Repair Seat as necessary,  Replace worn out seat lower cushion. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1655399	17250hr II 250hr Service	GOSMOND	14/10/2024	Internal	17230.0	\$0.00	Steam clean equipment as necessary.  250hr Service
1663394	air con not working	GOSMOND	9/10/2024	Internal	17224.0	\$0.00	Clean truck. Perform 17250hr pm service. Put back online. Repair Air Conditioner as necessary,  Diagnose a/c. Wash out condensor. Unable to finish as spare was used changing tyres.
1659020	seat leaking down	GOSMOND	24/09/2024	Internal	17074.0	\$0.00	Wash out evapotator and test fan. ok. Put back online. Repair Seat as necessary,  Diagnose seat leaking down. Found leak at air line tee piece. Repaired leak and test. OK. Put back online.
1648436	17000hr II 1000hr Service	BIG TRUCK SA	2/09/2024	Internal	16978.0	\$0.00	Steam clean equipment as necessary.  1000hr Service
1651789	Reverse light fault	GOSMOND	28/08/2024	Internal	16970.0	\$0.00	Clean truck. Perform 17000hr pm service. Put back online. Replace Light/s  Diagnose reverse light failure. Small led light failed. Stole one from H15960 to get back online. Ordered new part.  Labour
1639045	16750hr II 250hr Service	BIG TRUCK SA	30/07/2024	Internal	16802.0	\$0.00	Pickup parts. Fit new light to truck. Test ok. Put back online. Steam clean equipment as necessary.  250hr Service  Clean truck. Perform 16750hr pm service. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1619384	Replace Lift Chains	GOSMOND	26/07/2024	Internal	16654.0	\$0.00	<p>Replace Lift Chain,</p> <p>Checked chains on service. Need replacing. Order parts</p> <p>Top up cooling system,</p> <p>Replace weeping coolant tank. Top up coolant. Run and test ok. Put back online.</p> <p>Replace Light/s</p>
1637762	operator has reported that the seat in forklift H15946 keeps going down and requires to be constantly pumped up	GOSMOND	4/07/2024	Internal	16500.0	\$0.00	<p>Clean truck. Replace worn lift chains. Adjust hoses. Replace two blown worklights. Put back online. Repair Seat as necessary,</p> <p>Pressure tested all lines switches and connections with soapy water. Could not get it to leak down. Must be leaking inside the pumping assembly. Will need to replace the suspension assembly if the problem persists. Put back online.</p>
1629576	16500hr II 500hr Service	BIG TRUCK SA	3/07/2024	Internal	16491.0	\$0.00	<p>Steam clean equipment as necessary.</p> <p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p>
1636901	Broken wheel stud on LHS drive	GOSMOND	2/07/2024	Internal	16474.0	\$0.00	<p>Clean truck. Perform 16500hr pm service. Put back online. Repair Hub/s as necessary,</p>
1630727	Repair wipers	GOSMOND	7/06/2024	Internal	16318.0	\$0.00	<p>Replace broken lhs drive wheel stud. Tension and put back online.</p> <p>Repair Windscreen Wiper as necessary,</p> <p>Repair front wiper as pivot came apart. Test ok Put back online.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1623519	16250hr II 250hr Service	BIG TRUCK SA	30/05/2024	Internal	16230.0	\$0.00	Steam clean equipment as necessary.  250hr Service  Labour  Repair Air Conditioner as necessary ,  Manufacture Mud flaps,  Clean ruck. Perform 16250hr pm service. Had to go into town to get a a/c belt. Replaced a/c belt. Made a template for the rear mudflaps and cut one. Fit to truck and stich up the other one. Put back online. Steam clean equipment as necessary.
1615881	16000hr II 2000hr Service	GOSMOND	29/04/2024	Internal	16039.0	\$0.00	2000hr Service  Clean truck. Peform 16000hr pm service. Calibrate transmission. Replace work light. Adjust Inching Valve to correct specification ,
1618133	Inspect machine for reported slipping transmission	GOSMOND	23/04/2024	Internal	15983.0	\$0.00	Investigate report of transmission slipping. Found ajustment bolt for inching loose. Adjust inching to spec and calibrate. Test ok. Put back online. Steam clean equipment as necessary.
1610096	15750hr II 250hr Service	GOSMOND	15/04/2024	Internal	15894.0	\$0.00	250hr Service  Clean truck. Perform 15750hr pm service. Topup coolant. Adjust a/c belt. Steam clean equipment as necessary.
1605294	15500hr II 500hr Service	GOSMOND	20/03/2024	Internal	15574.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1604828	Replace camera system	BIG TRUCK SA	1/03/2024	Internal	15241.0	\$0.00	Clean truck. Perform15500hr pm service. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1604259	Reseal rhs tilt cylinder	GOSMOND	28/02/2024	Internal	15004.0	\$0.00	Check/Inspect/Diagnose Cylinder  Oil leak from Rhs tilt cylinder. Coolant weeping from recovery tank. Order parts  Repair Hydraulic Tilt Cylinder as required,  Remove ancillary items and Hydraulic Tilt Cylinder , Strip, Inspect and report,  Labour Steam clean equipment as necessary.
1601978	15250hr II 250hr Service	GOSMOND	28/02/2024	Internal	15241.0	\$0.00	250hr Service  Clean truck. Perform 15250hr pm service. Adjust a/c belt. Put back online.
1603233	Complete mast swap	BIG TRUCK SA	23/02/2024	Internal	15004.0	\$0.00	
1588664	15000hr II 5000hr Service	GOSMOND	6/02/2024	Internal	15004.0	\$0.00	Steam clean equipment as necessary.  5000hr Service  Clean truck. Perform 15000hr pm service.  Adjust valves. Adjust belts and finish off 15000hr pm. Put back online.
1593287	NO START	GOSMOND	16/01/2024	Internal	14775.0	\$0.00	Replace alternator,  No crank. Batteries flat. Alternator failed. Replaced alternator. Check charge rate ok. Put back online after charging up batteries.
1593146	check aircon	GOSMOND	15/01/2024	Internal	14775.0	\$0.00	Repair Air Conditioner as necessary,  Diagnose air con performing poorly. Due to alternator failing battery voltage was low causing the performance issue. Replaced alt on j/n 1593287 and a/c working well now. Put back online.
1589000	REPLACE WORKLIGHTS	GOSMOND	20/12/2023	Internal	14739.0	\$0.00	Travel to site,  Replace Light/s
1582814	14750hr II 250hr Service	GOSMOND	18/12/2023	Internal	14720.0	\$0.00	replace both rear worklights, test. Steam clean equipment as necessary.  250hr Service  Clean truck. Perform 14750hr pm service. Tighten lhs drive wheel nuts. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1586888	a/c keeps cutting in and out	GOSMOND	12/12/2023	Internal	14720.0	\$0.00	Repair Air Conditioner as necessary,  Clean all cores. Check operation of a/c system. No faults found. Put back online.
1585352	TURBO TIMER ISSUE & INSPECT CAMERA	GOSMOND	6/12/2023	Internal	14905.0	\$0.00	Fit Full Camera Kit,  Diagnose not functioning cameras. Found rear camera/cable faulty and front camera cable faulty. Ordered parts and put back online.  Carry out Inspection and Diagnosis of Telemetry System  Repair Fleet Management System as required,  diagnose turbo timer not shutting unit down with manual override,checked wiring and conections,checked timer module for dry solder joints,tested swithes,couldn't find any issues,refitted tested and unit is working correctly may have had a bad conection that is now rectified.diagnose camera and rear radar not working,checked display configuration and replaced with known good module,checked cameras with known good camera,checked wiring to dvr,bypassed extention cables and found fault in front extention cable and issue with rear extention cable and rear camera,parts orderded.  Continue diagnisis of cameras.  Finish diagnosing issues. Replace front camera cable and replaced rear camera. Chasing up prices for replacement camera. Put back online.  Replace Battery,  Replaced batteries. Back online. Travel to site,  Steam clean equipment as necessary.  Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.  500hr service.rh tilt cylinder leaking.turbo timer overide not working.
1574240	14500hr II 500hr Service	BIG TRUCK SA	22/11/2023	Internal	14574.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1579445	TECHNICIAN INITIATED JOB	511 Planning A	14/11/2023	Internal	14453.0	\$0.00	Adjust fan belt as required
1579435	possible fan belt	SPitman	14/11/2023	Internal	14453.0	\$0.00	aircon belt squeeling,checked belt and pulleys,tensioned belt. adjusted yesterday on tech raised job
1563703	seat losing air	GOSMOND	2/11/2023	Internal	14288.0	\$0.00	Repair Seat as necessary,  Diagnose air seat leaking down  Attempt to find air leak. Suspect air bag leaking. Part is nss but have 2nd hand one I will try.  Dismantle and harvest spare parts for old seat system.
1576589	replace side step mounts	GOSMOND	1/11/2023	Internal	14277.0	\$0.00	Check for leaks. OK. Put back online. Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,  Replace rhs step mount. Replace with left over mount from previous job. Test ok. Put back online. Steam clean equipment as necessary.
1573715	REPLACE TYNE BUSHES	GOSMOND	19/10/2023	Internal	14239.0	\$0.00	Repair Tyne Latch as necessary ,  Clean truck.  Remove tynes and remove bushes. Fit new bushes and refit tynes to truck. Test ok. Put back online. Steam clean equipment as necessary.
1570345	14250hr II 250hr Service	GOSMOND	19/10/2023	Internal	14238.0	\$0.00	250hr Service  Clean truck. Perform 14250hr pm service. Adjust a/c belt. Put back online. Steam clean equipment as necessary.
1565169	14000hr II 2000hr Service	GOSMOND	4/10/2023	Internal	14013.0	\$0.00	2000hr Service  Clean truck. Perform 14000hr pm service. Replace hyd oil and filter. Replace a/c belt. Replace one worklight. Calibrate trans. Fix coolant leak at heater hose. Put back online.
1564819	AIRCON ISSUE	GOSMOND	15/09/2023	Internal	13741.0	\$0.00	Repair Air Conditioner as necessary, Diagnose poor a/c performance. Blow out coolers and check system Performing well. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1559035	13750hr II 250hr Service	GOSMOND	14/09/2023	Internal	13753.0	\$0.00	Steam clean equipment as necessary.  250hr Service  Clean truck. Perform 13750hr pm service. Put back online.
1562468	loose/missing bolts lhs mudguard	GOSMOND	6/09/2023	External	13660.0	\$439.00	Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Remove sheared bolts and replace with new bolts. Test ok. Put back online.
1561866	H15946 - Further Work - Transmission Cooler Leaking	GOSMOND	5/09/2023	Internal	14030.0	\$0.00	Steam clean equipment as necessary.  Remove ancillary items and Transmission Oil Cooler, Inspect and report,  Refit Transmission Oil Cooler and ancillary items,  Clean truck. Remove failed trans cooler. Fitted new one originally for H15947 but this leak is far worse. Reassemble and top up trans. Test ok. Put back online.
1551616	13500hr II 500hr Service	GOSMOND	24/08/2023	Internal	13577.0	\$0.00	Steam clean equipment as necessary.  Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.  Clean truck. Perform 13500hr pm service. Change diff and final drive oils. Put back online.
1550683	forktrack not reading	GOSMOND	20/07/2023	Internal	13401.0	\$0.00	Repair Attachment as necessary, Diagnose no comms from vam module and not waking up from sleep with seat switch. Replace Attachment, Replace vam unit. Configure and test operation. Still not waking up from deep sleep. Comms working now. Put back online.
1544870	13250hr II 250hr Service	BIG TRUCK SA	20/07/2023	Internal	13230.0	\$0.00	Steam clean equipment as necessary.  250hr Service  Clean truck. Perform 13250hr pm service. Topup hyd oil. Adjust a/c belt. Blow out primary engine filters as air filter restriction light coming on. Test ok. Put back online.
1546785	broken wheel studs	GOSMOND	4/07/2023	Internal	13048.0	\$0.00	Repair Hub/s as necessary,  Replace broken wheel stud lhs drive. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1544121	Further works; tyne bushes need replacing	GOSMOND	23/06/2023	Internal	12761.0	\$0.00	Repair Windscreen Wiper as necessary,  Diagnose wipers. Replace wiper relay. Tyne bushes u/s. Order parts Replace worklights.
1541182	13000hr II 1000hr Service	GOSMOND	23/06/2023	Internal	12998.0	\$0.00	Steam clean equipment as necessary.  1000hr Service
1536833	12750hr II 250hr Service	GOSMOND	6/06/2023	Internal	12761.0	\$0.00	Clean truck. Perform 13000hr pm service. Tighten a/c belt. Calibrate transmission. Put back online. Steam clean equipment as necessary.  250hr Service
1536095	When a driver is out of the seat for more that 4-5 minutes they have to turn off the main isolator and then on so the forktrack system turns on again.	DBARNARD	19/05/2023	Internal	12258.0	\$0.00	Clean truck. Perform 12750hr pm service.Put back online.
1535775	Communicating fault VAM Module	WHILL	18/05/2023	Internal	12258.0	\$0.00	Carry out Inspection and Diagnosis of Telemetry System
1535328	Turbo let go	WHILL	17/05/2023	Internal	12509.0	\$0.00	Repair Fleet Management System as required, Travel to site,  Replace Turbo,  Remove ancillary items and remove Radiator from unit, Inspect and report,  Refit Radiator to unit, Refit ancillary items,  Labour  Travelled to site and located unit. Confirmed turbo failure. Removed rear cover and removed intercooler for cleaning. Packaged and dropped off the intercooler at TNT for transport to COR cooling for cleaning. As advised reomoved the intercooler from 34 and fitted to 46. Steam cleaned out all ducting and refitted. Travelled to town and sourced new turbo. Returned to site and fitted turbo (engine oil, oil fiter and air filters were replaced at the same time but on the current service job as it was all due). Ran unit extensively to burn oil out of the exhaust. Returned unit to service.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1530994	12500hr II 500hr Service	WHILL	17/05/2023	Internal	12258.0	\$0.00	Travel to site,  Steam clean equipment as necessary.  Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Steam clean equipment as necessary.
1526882	12250 II 250hr service	GOSMOND	28/04/2023	Internal	12258.0	\$0.00	250hr Service  Clean truck. Perform 12250hr pm service. Tighten a/c belt. Topup coolant. Put back online.
1530327	Stiffener plate test	WHILL	26/04/2023	Internal	12509.0	\$0.00	Overhaul Drive Axle components as required,  Travel to site,  Sourced and had stiffener plates fitted by the tyre fitters . Replaced 3 broken wheel studs Repair Attachment as necessary,
1526521	VAM module replacement	GOSMOND	6/04/2023	Internal	11998.0	\$0.00	VAM module has stopped communicating . Fit new module and get Mike to setup. Put back online. Steam clean equipment as necessary.
1524175	12000 II 3000hr service Hyster Bladed Truck C236 - 3000hr Service Kit. 3000 Hour Service	GOSMOND	6/04/2023	Internal	11998.0	\$0.00	2000hr Service  Clean truck. Perform 12000hr pm service. Calibrate trans. Refit rhs mudflap. Put back online.
1524653	Oil leak near transmission	GOSMOND	30/03/2023	Internal	11855.0	\$0.00	Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,  Diagnose oil leak. Tilt cab none found. Put truck over pit still unable to find oil leak. Put back online.
1519245	11750 II 250hr service 0250 Hour Service	GOSMOND	24/03/2023	Internal	11836.0	\$0.00	Steam clean equipment as necessary.  250hr Service  Clean truck. Perform 11750hr pm service. Put back online.
1521697	FM1 module- non start	GOSMOND	17/03/2023	Internal	11716.0	\$0.00	No ignition power. Bypass forktrak to diagnose. Ignition power now. Replace fm1 unit with vam module. Get configured. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1510386	11500 II 500hr service Hyster Bladed Truck C236 - 500hr Service Kit. 0500 Hour Service	GOSMOND	27/02/2023	Internal	11550.0	\$0.00	Steam clean equipment as necessary.  Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.  Clean truck. Perform 11500hr pm service. Put back online. Repair Air Conditioner as necessary,
1512341	Repair AC	GOSMOND	7/02/2023	Internal	11367.0	\$0.00	Diagnose no a/c. Compressor running but no air flow. Check wiring to blower fan ok. Order new fan. Pickup part. Remove old fan and fit new one. Test ok. Cleanout heater box. Test a/c ok. Reassemble and put back online. Steam clean equipment as necessary.
1507410	11250 II 250hr service 0250 Hour Service	GOSMOND	25/01/2023	Internal	11251.0	\$0.00	250hr Service  Clean truck. Perform 11250hr pm service. Adjust a/c belt. Put back online.
1503133	Repair auto greaser	GOSMOND	20/12/2022	Internal	11007.0	\$0.00	Grease All Points on Unit,  Diagnose system. Bleed system and run. Fresh grease coming from grease points. Ok. Put back online.
1500651	11000 II 1000hr service	GOSMOND	19/12/2022	Internal	11002.0	\$0.00	Steam clean equipment as necessary.  1000hr Service  Clean truck. Perform 11000hr pm service. Calibrate transmission. Reset inching and calibrate. Put back online.
1501634	Loose hose reel bracket	GOSMOND	14/12/2022	Internal	10941.0	\$0.00	Repair Light Bracket as required,  Replace worn and loose mounting bolts reel bracket. Resize from m12 to m14. Reassemble and test ok. Put back online.
1497658	10750 II 250hr service 0250 Hour Service	GOSMOND	5/12/2022	Internal	10788.0	\$0.00	250hr Service
1493238	H15946 - wheel studs	GOSMOND	14/11/2022	Internal	10522.0	\$0.00	Clean truck. Perform 10750hr pm service. Put back online Repair Hub/s as necessary,  Replace 3 x wheel studs rhs drive.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1489403	10500 II 500hr service Hyster Bladed Truck C236 - 500hr Service Kit. 0500 Hour Service	GOSMOND	14/11/2022	Internal	10522.0	\$0.00	Steam clean equipment as necessary.  Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.  Clean truck. Perform 10500hr pm service. Replce rhs mudgaurd worklight. Put back online.
1489921	Broken wheel studs	GOSMOND	31/10/2022	Internal	10272.0	\$0.00	
1483100	10250 II 250hr service 0250 Hour Service	511 Planning B	19/10/2022	Internal	10272.0	\$0.00	Travel to site,  Steam clean equipment as necessary.  250hr Service
1482719	Change trans oil	GOSMOND	30/09/2022	Internal	10061.0	\$0.00	Travelled to site and located unit. Cleaned unit extensively and carried out 250hr service. Returned unit to service Replace Transmission Oil as Required
1481474	Broken wheel studs	GOSMOND	26/09/2022	Internal	9989.0	\$0.00	Replace trans oil which was not changed at 10,000hr pm due to I had run out of oil. Put back online.
1475607	10000 II 5000hr service Hyster Bladed Truck C236 - 5000hr Service Kit. 5000 Hour Service	GOSMOND	21/09/2022	Internal	9989.0	\$0.00	Replace 3 broken rhs drive wheel studs. Put back online. Steam clean equipment as necessary.  5000hr Service
1475196	Transmission calibration	GOSMOND	26/08/2022	Internal	9750.0	\$0.00	Clean truck. Perform 10000hr pm service. Calibrate transmission. Adjust valve clearances. Replace fan and a/c belts. Put back online. Adjust Transmission Control Valve to correct specification ,
1472898	Wheel stud broken	GOSMOND	18/08/2022	Internal	9729.0	\$0.00	Fit pressure gauge to forwrd clutch of trans and record pressure at full inching. Disable inching and test again. Trans still holding 20psi ish with inching enabled but zero with it disabled. Put back online. Repair Hub/s as necessary,
1472896	Damage to tyne carrier bush	GOSMOND	18/08/2022	External	9729.0	\$734.50	Replace 1 x broken wheel stud rhs drive. Put back online. RHS tynecarrier bush has come out. Remove tyne and carrier from truck. Clean all parts. Repair damage to bush and tyne carrier. Press bush back in with loctite 680. Reassemble truck and put back online.
1468611	9750 II 250hr service 0250 Hour Service	511 Planning A	17/08/2022	Internal	9729.0	\$0.00	Steam clean equipment as necessary.  250hr Service  Clean truck. Perform 9750hr pm service. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1469345	DAMAGE: Repair RHS cab step	GOSMOND	3/08/2022	External	9630.0	\$171.50	Straighten rhs lower cab step bracket. Cleanup and paint. Put step back on. Put back online.
1468990	Repair rear engine cover	GOSMOND	2/08/2022	Internal	9626.0	\$0.00	Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,  Rubber bumpers gone and cover crushing wiring. Repair wiring and make new bumpers for cover. Test ok. Put back online.
1467225	Repair park brake	GOSMOND	25/07/2022	Internal	9568.0	\$0.00	Replace brake shoe/s,  Park brake not holding. Remove caliper and fit new brake pads. Reassemble and adjust. Test ok. Put back online.
1466758	Install Sceen reverse camera detection system	511 Planning D	22/07/2022	External	9630.0	\$5,118.36	Fit SEEN detection kit. Finish fitting kit and test. Put truck online for assesment. This job should have p/o 909278 against it.
1465985	Forklift H15946 feels like the carriage accumulator is not working.	GOSMOND	19/07/2022	Internal	9530.0	\$0.00	Adjust Accumulator Pressure  Adjust pressure to drivers satisfaction. Dropped from 600psi to 400psi. Put back online.
1451363	9500 II 500hr service. Hyster Bladed Truck C236 - 500hr Service Kit. 0500 Hour Service	GOSMOND	29/06/2022	Internal	9454.0	\$0.00	Steam clean equipment as necessary.  Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1460230	Hydraulic tyne positioner does not move	GOSMOND	28/06/2022	Internal	9454.0	\$0.00	Clean truck. Perform 9500hr pm service. Put back online. Check/Inspect/Diagnose Cylinder  Diagnose issue with tyne positioners not working. Suspect fault in acuating module on control valve. Order new valve.  Repair Hydraulic Control Valve as necessary ,
1448035	Electrical fault with tyne positioner	GOSMOND	27/06/2022	Internal	9502.0	\$0.00	Fit new module. Test ok. Put back online. Repair Switch/es Diagnose issue with RHS tyne not moving outboard with individual button. Found switch is faulty. Did temp repair and order new switch.  Fitted switch. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1451186	Replace Transmission	GOSMOND	17/06/2022	Internal	9441.0	\$0.00	Remove transmission. Make and fit blanking plates. Makeup steel frame to mount to pallet.  Travel to site,  Repair Transmission as necessary,  Order parts  Replace Transmission,  Unpack trans and prepare for refitting.  Refit Transmission and ancillary items,  Fit new trans. Fit tailshaft. Fit Hyd pump.  Finish refitting trans. Fill hyd tank. Fill trans.  Adjust Transmission Control Valve to correct specification ,  Fit trans cooler hoses. Start truck and check. ok. Fit carriage and coneect chains and hoses. Calibrate transmission. Adjust inching and calibrate.  Steam clean equipment as necessary.
1450744	Unit over heating	511 Planning A	27/05/2022	Internal	9280.0	\$0.00	Clean truck. Test drive ok. Put online.
1453898	Remove carriage and have ready to put on new unit	WHILL	25/05/2022	Internal	9280.0	\$0.00	Remove and Replace Coolant Hose/s Remove ancillary items and Carriage, Strip, Inspect and report,  Remove ancillary items and Transmission, Strip, Inspect and report,  Remove carriage. Start to remove transmission.
1447717	9250 II 250hr service. 0250 Hour Service	GOSMOND	5/05/2022	Internal	9280.0	\$0.00	Travel to site, Steam clean equipment as necessary.  250hr Service
1448036	Broken fan belt	GOSMOND	2/05/2022	Internal	2999.0	\$0.00	Clean truck. Perform 9250hr pm service. Put back online. Replace Fan Belt,  Replace broken fan belt. Inspect a/c belt ok. Tension both belts and test ok. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1440473	Forklift H15946 has broken down as wont select gears and is tagged out.	GOSMOND	29/04/2022	Internal	8745.0	\$0.00	Repair Transmission Control Lever as necessary ,  Diagnose no forward or reverse direction. Found faulty shift lever. Order new one. Dismantle old one and clean out worn material which was bridging contacts. Reassemble and test ok until new one arrives. Put back online.
1444065	9000 II 3000hr service. Hyster Bladed Truck C236 - 3000hr Service Kit. 3000 Hour Service	GOSMOND	22/04/2022	Internal	9100.0	\$0.00	Steam clean equipment as necessary.  1000hr Service  Clean truck. Perform 9000hr pm service. Change diff and final drive oils. Change Trans oil and filter. Put back online.
1446220	Broken wheel stud	GOSMOND	21/04/2022	Internal	9100.0	\$0.00	Repair Hub/s as necessary,  Replace 1 x broken lhs drive wheel stud. Put back online.NOTE: Pictures on j/n 1444065.
1440556	Broken Wheel Studs	GOSMOND	24/03/2022	Internal	8745.0	\$0.00	Repair Hub/s as necessary,  Replace 2 x lhs drive wheel studs and 1 x rhs drive wheel stud. Put back online.
1440555	Tynes controls playing up	GOSMOND	24/03/2022	Internal	8745.0	\$0.00	Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,  All tyne functions not working. Checked fuses ok. Check wiring ok. Pull plugs apart and clean. Test ok. Put back online.
1439401	8750hr service II 250hr type service 0250 Hour Service	GOSMOND	24/03/2022	Internal	8745.0	\$0.00	Steam clean equipment as necessary.  250hr Service
1437645	Error codes - transmission fault	GOSMOND	9/03/2022	Internal	8539.0	\$0.00	Clean truck. Perform 8750hr pm service. Put back online. Repair Transmission as necessary,  Confirmed code t1110 coming up on the dash. Found code relating to a possible blocked trans filter. Replaced trans filter and returned unit to service  Carry out Inspection and Diagnosis of Transmission
1437315	Broken Wheel Studs	GOSMOND	8/03/2022	Internal	8539.0	\$0.00	Travel to site, Repair Hub/s as necessary,  Replace one lhs drive wheel stud and nut. Put truck back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1435124	Scheduled Service - 8500hr service II 500hr type. .0500 Hour Service	511 Planning D	8/03/2022	Internal	8539.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1427587	Worn steer link pins and bushes	GOSMOND	8/03/2022	Internal	8539.0	\$0.00	Perform 8500hr pm service. Replace Tie Rod End/s,  Assist Wayde with replacing RHS tie rod end and pins. Put back online.  Repair Steer Axle as necessary,  Had contractor remove rh steer wheel . Removed and replaced the steer link and pins. Repaired blocked grease line. Greased up links . Contractor refitted wheel. Returned unit to service Replace Windscreen Wiper,
1436692	Replace front wiper blade	GOSMOND	4/03/2022	Internal	8491.0	\$0.00	Replace one front wiper blade. Put back online. Repair Air Conditioner as necessary,
1436370	H15946 - Reported that the air conditioning is not working in this unit	GOSMOND	3/03/2022	Internal	8491.0	\$0.00	Diagnose a/c issue with blowing hot air. System working correctly. The evaporator has been freezing up. Wash out ice. The drain tubes were blocked with mud and very high humidity causing the problem. Reassemble and put back to work. Travel to site,
1436075	repair windscreen wiper	WBRAZIL	2/03/2022	Internal	7950.0	\$0.00	Repair Windscreen Wiper as necessary, 250hr Service
1429597	Scheduled Service - 8250hr service II 250hr type. .0250 Hour Service	WHILL	17/02/2022	Internal	8282.0	\$0.00	Travelled to site and located unit. Carried out service as per schedule. Cleaned and returned to service Travel to site,
1432260	H15946 requires a new front wiper blade insert as it has worn out.	WHILL	16/02/2022	Internal	8282.0	\$0.00	Replace Windscreen Wiper,
1427585	Belt squealing issue	WHILL	4/02/2022	Internal	8091.0	\$0.00	Repalced both front wiper blades and repaired arms Travel to site,  Replace Fan Belt,  Travelled to site and located unit. Removed fan and replaced the fan pulley, belt tensioner and belt. REfitted all parts and returned unit to service

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1429236	H15946 - broken wheel stud on a drive wheel	WHILL	3/02/2022	Internal	8074.0	\$0.00	Replace Steer Wheel Studs and Nuts,  Confirmed fault. Checked and found 3 broken studs. Replaced studs and retensioned nuts. Returned unit to service
1428458	Air Con not working	WHILL	1/02/2022	Internal	8005.0	\$0.00	Repair Air Conditioner as necessary,  Located unit and connected gauges. Pressures appear to be ok. Tilted cab and dropped heater box. Cleaned out evaporator and heater cores. Checked operation of the thermostat. Refitted all parts. Rechecked and found compressor cycling as normal and vent temps at 7 degrees. Returned unit to service Travel to site,
1420168	Scheduled Service - 8000hr service. .2000 Hour Service	WHILL	27/01/2022	Internal	8005.0	\$0.00	4000hr Service,  Steam clean equipment as necessary.
1426794	Air conditioning reported to not be working	WHILL	21/01/2022	Internal	7950.0	\$0.00	Travelled to site and located unit. Carried out service as per schedule. Cleaned unit and returned to service Repair Air Conditioner as necessary,  Located unit and check operation of the a/c. Vent temperatures, fan speed, and system pressures are all good
1426538	Forklift H15946 is having issues with the A/C not cold. Can this be checked please.	WHILL	20/01/2022	Internal	7938.0	\$0.00	Repair Air Conditioner as necessary,  Located unit and checked operation. Connected gauges and found pressures low. No signs of external leakage. Removed, evacuated and recharged system with tracer dye. Rechecked operation. Vent temp now at 8 degrees.
1422869	Parts to Job #1421095	511 Planning C	23/12/2021	Internal	7784.0	\$0.00	
1422854	Parts to Job #1420165	511 Planning C	23/12/2021	Internal	7784.0	\$0.00	
1420165	Scheduled Service - 7750hr service. .0250 Hour Service	WHILL	23/12/2021	Internal	7784.0	\$0.00	250hr Service
1421095	Broken wheel studs	WHILL	15/12/2021	Internal	7760.0	\$0.00	Carried out service as per schedule. Travel to site,  Overhaul Drive Axle components as required,  Travelled to site and located unit. Confirmed and replaced broken drive wheel stud.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1415683	Scheduled Service - 7500hr service .0500 Hour Service	GOSMOND	7/12/2021	Internal	7550.0	\$0.00	Steam clean equipment as necessary.  Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.  Drain trans, diff, final drive oils and refill. Replace trans filter. Calibrate trans. Put back online. Repair Seat as necessary,
1419027	H15946 the air ride seat is slowly loosing air.	WHILL	6/12/2021	Internal	7550.0	\$0.00	Seat loosing air. Trace leak to ride height switch. Cut line and reseal. Order new switch as still leaking a bit. Put back online.  Labour  Sourced parts Dismantles armrest and replaced switch. Refitted all parts and rechecked operation. Returned unit to service. Repair Hub/s as necessary,
1418381	Broken wheel studs	GOSMOND	2/12/2021	Internal	7482.0	\$0.00	Replace one RHS drive wheel stud and one LHS drive wheel stud. Tension and put back online. Travel to site,  Repair Steer Axle as necessary,
1412670	Parts on Border 17.11.21 - H15946 - 20T fork was tagged out last night with a suspect steer wheel bearing issue.	GOSMOND	30/11/2021	Internal	7037.0	\$0.00	Travelled to site and located unit. Confirmed lh steer wheel bearing noisy and excessive play in lh steer link. Had tyre removed and removed hub assembly. Found inner wheel bearing failed due to failed seal. Ordered new parts. Cleaned out hub and fitted good s/h bearing and cone. Repacked bearing and hub. Refitted all parts and returned to service  Replace Steer Wheel Bearings,
1414976	Scheduled Service - 7250hr service II 250hr type. 0250 Hour Service	GOSMOND	16/11/2021	Internal	7240.0	\$0.00	Replace Tie Rod End/s, 250hr Service
1414740	H15946 - 2 x broken wheel studs	GOSMOND	16/11/2021	Internal	7239.0	\$0.00	Clean truck. Perform 7250hr pm service. Put back online. Steam clean equipment as necessary.  Repair Hub/s as necessary,  Replace 2 broken wheel studs LHS drive wheel, replace 1 broken wheel stud RHS drive. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1395100	Parts in Waiting to complete tynes bushes 28.10.21 - preemptive job for tyne bushes and lift chains	GOSMOND	5/11/2021	Internal	6702.0	\$0.00	<p>Replace Sideshift Bushes/Bearings,</p> <p>Steam clean equipment as necessary.</p> <p>Replace Lift Chain,</p> <p>Clean truck. Remove lift chains and cut new ones to length. Fit new lift chains and adjust hoses. Put back online.</p> <p>Labour</p> <p>Travel to site,</p> <p>Replace Transmission Oil Cooler,</p> <p>Replace Mast Hanger Bushes,</p>
1411722	Broken wheel studs	WHILL	1/11/2021	Internal	7037.0	\$0.00	<p>Refit Forks/Tynes and ancillary items,</p> <p>Replace Steer Wheel Studs and Nuts,</p> <p>Checked and confirmed 3 broken drive wheel studs. Removed and replaced broken studs. Retensioned up nuts</p>
1409802	Scheduled Service - 7000hr service II 1000hr type. .1000 Hour Service	WHILL	1/11/2021	Internal	7037.0	\$0.00	<p>1000hr Service</p> <p>Travel to site,</p> <p>Steam clean equipment as necessary.</p> <p>Located unit and carried out service as per schedule. Repaired steer axle grease line. Found lh steer link has excessive play.Cleaned unit and returned to service.</p>
1405196	Scheduled Service - 6750hr service II 250hr type. 0250 Hour Service	GOSMOND	21/10/2021	Internal	6890.0	\$0.00	<p>Travel to site,</p> <p>250hr Service</p> <p>Carry out 6750 pm service. Put back online</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1408770	Unit has a grinding noise under load in the driveline. URGENT.	GOSMOND	18/10/2021	External	6801.0	\$830.00	Repair Mast as necessary,  *CALLOUT* Travel to site and diagnose noise. Unable to recreate. Get Operator to drive it under load. Came back with noise. Checked steer wheel bearing ok. Check drive wheel bearings and for metal in final drives and diff. Ok. Check drive shaft unis. ok. Grease all mast rollers as suspect noise is from mast as only does it under heavy load. Give back to operator and test. Noise appears to be gone. Put truck back online. Will investigate further at next service.
1407526	2 X Broken wheel studs PHS drive	GOSMOND	12/10/2021	Internal	6702.0	\$0.00	Steam clean equipment as necessary.  Repair Hub/s as necessary,  Clean wheel. Replace 2 broken wheel studs RHS drive wheel. Put back online. Carry out Inspection and Diagnosis of Transmission
1406717	Leaking trans cooler - Seat base worn out	WHILL	8/10/2021	Internal	7137.0	\$0.00	Order parts  Travel to site,  Replace Lift Chain,  Repair Seat as necessary,  Remove ancillary items and Transmission Oil Cooler, Inspect and report,  Replace Transmission Oil Cooler,  Travelled to site and located unit. Removed intercooler, ducting and bonnet. Removed belly plate and removed leaking trans cooler. Noted new unit poorly packaged and had external damage (refer photos). Fitted new cooler and refitted all parts. Topped up oil and rechecked operation. Returned unit to service
1405081	Broken wheel stud LHS drive	GOSMOND	30/09/2021	Internal	6554.0	\$0.00	Repair Hub/s as necessary,
1404306	Right hand side drive wheel stud	GOSMOND	27/09/2021	Internal	6497.0	\$0.00	Replace broken wheel stud LHS drive. Put back online. Repair Hub/s as necessary,  Replace broken wheel stud RHS drive. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1402597	Scheduled Service - 6500hr service II 500hr type. .0500 Hour Service	GOSMOND	27/09/2021	Internal	6497.0	\$0.00	Steam clean equipment as necessary.  Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1402894	Broken Wheel Stud	GOSMOND	20/09/2021	Internal	6395.0	\$0.00	Clean truck. Perform 500hr pm service. Clean up workshop after job. Put back online. Repair Hub/s as necessary,
1401921	Replace broken wheel stud LHS drive	GOSMOND	14/09/2021	Internal	6311.0	\$0.00	Replace broken wheel stud RHS drive. Cleanup workshop after job. Put back online. Repair Hub/s as necessary,
1398457	Scheduled Service - 6250hr service II 250hr type .0250 Hour Service	GOSMOND	14/09/2021	Internal	6311.0	\$0.00	Replace one broken wheel studs LHS drive. Put back online. Steam clean equipment as necessary.
1399266	Broken wheel studs on the LHS drive and unit is parked up	GOSMOND	1/09/2021	Internal	6105.0	\$0.00	250hr Service  Clean truck. Perform 6250hr pm service. Put back online. Steam clean equipment as necessary.  Repair Hub/s as necessary,
1395674	Parts On order as at 20.9.2021 Nacco O/S Scheduled Service - 6000hr service II 3000hr type. Hyster Bladed Truck C236 - 3000hr Service Kit. 3000 Hour Service	GOSMOND	25/08/2021	Internal	6000.0	\$0.00	Clean wheels. Replace 2 x studs on LHS drive and 1 x stud on RHS drive. Cleanup and put back online. Steam clean equipment as necessary. 2000hr Service Clean truck. Perform 6000hr pm service. Replace diff and final drive oils. Replace trans filter and oil. Calibrate transmission. Put back online. Cleanup after job and complete oil sample bottles.
1397813	Broken Wheel Studs	GOSMOND	24/08/2021	Internal	5988.0	\$0.00	Repair Hub/s as necessary,
1395419	Unit has a grinding noise coming from the front	GOSMOND	12/08/2021	Internal	5810.0	\$0.00	Replace two broken wheel studs RHS drive wheel. Put back online. Diagnose noise from driveline. Test drive and noise is there. Check steer wheel bearings ok. Check drive wheel bearings ok. Found wood jammed between tyres on rhs drive. Remove wood and test. Ok. Put back online.
1395099	replacing 4 wheel studs	GOSMOND	10/08/2021	Internal	5774.0	\$0.00	Repair Hub/s as necessary,  Replace 3 broken wheel studs on LHS drive and 1 on RHS drive. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1391004	Scheduled Service - 5750hr service II 250hr type. .0250 Hour Service	GOSMOND	6/08/2021	Internal	5774.0	\$0.00	Steam clean equipment as necessary.  250hr Service
1388066	Scheduled Service - 5500hr service .0500 Hour Service	GOSMOND	22/07/2021	Internal	5487.0	\$0.00	Clean truck. Perform 5750hr pm service. Put back online. Steam clean equipment as necessary.  Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1390203	WHEEL STUDS U/S	GOSMOND	20/07/2021	Internal	5480.0	\$0.00	Clean truck. Perform 5500hr pm service. Replace missing front uni grease nipple. Put back online. Repair Hub/s as necessary,  Clean wheel. Remove 3 broken wheel studs RHS drive. Fit new studs and nuts. Tension nuts and fit flags. Put back online. Adjust fan belt as required
1387955	REPLACE FAN BELT TENTIONER	GOSMOND	8/07/2021	Internal	5650.0	\$0.00	Diagnose noisy drive belts. Adjust a/c belt. Still slipping. Increase tension on fan belt. Still no good. Order new belt tensioner.  Labour  Travel to site,  remove ancillary items and Fan assembly from unit and Replace. Refit Fan assembly to unit, refit ancillary items,  Travel to parts and pickup new tensioner from tnt. Travel to site. Remove belt and tensioner. Fit new tensioner and refit belt. Test noise appears to be gone. Will monitor for a few days and close job if ok. Put back online.
1387052	WHEEL STUDS C/O	GOSMOND	5/07/2021	Internal	5240.0	\$0.00	Check for noisy belt. All ok. Put back to work. Repair Hub/s as necessary,
1385080	Scheduled Service - 5250hr service II 250hr type. .0250 Hour Service	GOSMOND	5/07/2021	Internal	5240.0	\$0.00	Replace one Lhs drive wheel stud. Put back online. Steam clean equipment as necessary.  250hr Service  Clean truck. Perform 5250hr pm service. Put back online

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1386383	tyne positioner pin fell out	GOSMOND	1/07/2021	Internal	5195.0	\$0.00	Repair Tyne Latch as necessary,  Rhs tyne not moving. Clevis pin missing. Found pin in yard and refitted it to truck. Test ok. Put back online. Steam clean equipment as necessary.
1382342	Scheduled Service - 5000hr service II 5000hr type. Hyster Bladed Truck C236 - 5000hr Service Kit. 5000 Hour Service	GOSMOND	21/06/2021	Internal	5018.0	\$0.00	5000hr Service  Replace Fan Belt,  Carry our valve clearence adjustments  Clean truck. Perform 5000hr pm service. Replace fan and a/c belts. Adjust valve clearances. Replace missing grease nipple in diff side uni. Put back online. Steam clean equipment as necessary.
1383879	BROKEN WHEEL STUDS	GOSMOND	18/06/2021	Internal	4993.0	\$0.00	Repair Hub/s as necessary,  Clean truck. Replace one wheel stud on the RHS drive and one on the LHS drive. Tension and put back online. Repair Windscreen Wiper as necessary,
1381637	WIPER BLADE ISSUE	GOSMOND	8/06/2021	Internal	5297.0	\$0.00	Diagnose issue with wiper blades falling apart. Found blades supplied in my stock were incorrect.(too long). Make temp repair and order correct ones. Put back online.  Replace Windscreen Wiper,
1379364	Scheduled Service - 4750hr service II 250hr type. .0250 Hour Service	GOSMOND	7/06/2021	Internal	4818.0	\$0.00	Fit correct wiper blades. Put back online. Steam clean equipment as necessary.  250hr Service
1377235	replace wiper blade	GOSMOND	18/05/2021	Internal	4512.0	\$0.00	Clean truck. Perform 4750hr pm service. Put back online. Replace Windscreen Wiper,  Remove old wiper blades and fit new ones. Stock order replacement blades. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1375022	Scheduled Service - 4500hr service II 500hr type .0500 Hour Service	GOSMOND	17/05/2021	Internal	4527.0	\$0.00	<p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p> <p>Change diff and final drive oils.</p> <p>Steam clean equipment as necessary.</p> <p>Carry out Repairs to Mud Flaps,</p> <p>Repair Main Electrical Control Panel as necessary,</p> <p>Clean truck. Perform 4500hr pm service. Change trans oil and filter. Calibrate trans. Water leaking into main power distribution box. Clean out and tighten gland nuts. Reseal box lid. RHS mudflap worn out. Cut new one and fit to truck. Put back online.</p>
1376479	5 x WHEEL STUDS U/S	GOSMOND	13/05/2021	Internal	4449.0	\$0.00	<p>Repair Hub/s as necessary,</p> <p>Replace 3x wheel studs RHS drive, 2x LHS drive. Tension nuts and put back online.</p>
1376326	Unit has a bent access step to the cabin. Thinks around 1hrs work approx.	GOSMOND	13/05/2021	Internal	6010.0	\$0.00	<p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>Clean truck. Remove LHS lower step. Cut damaged section from step and straighten. Weld new section back in and paint. Refit to truck and test ok. Put back online.</p> <p>Remove RHS step from H15961. Straighten and weld damaged section back in. Paint. Refit to truck. Put back online.</p>
1371919	Scheduled Service - 4250hr service II 250hr type	GOSMOND	3/05/2021	Internal	4276.0	\$0.00	<p>Steam clean equipment as necessary.</p> <p>250hr Service</p> <p>Fit Mud Flaps to Unit,</p> <p>Clean truck. Perform 4250hr pm service. Top up coolant. Replace worn out mudflap (material supplied by customer.) Put back online.</p>
1366717	Scheduled Service - 4000hr service II 2000hr type.	GOSMOND	12/04/2021	Internal	4078.0	\$0.00	<p>Steam clean equipment as necessary.</p> <p>4000hr Service,</p> <p>Clean truck. Perform 4000hr pm service. Put back online</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1365422	Further Works: Replace RHS tail light (not working at all) & shim bearing blocks.	GOSMOND	12/04/2021	Internal	3736.0	\$0.00	Adjust Carriage to correct specification,  Shim up carriage. Test much better and not jamming. Go to fit rearlight but wrong one ordered. Ordered correct part. Put back online Steam clean equipment as necessary.
1369108	CW - Broken wheel stud - LHS Drive wheel - Tech to assess for cust damage	GOSMOND	9/04/2021	Internal	3932.0	\$0.00	Repair Hub/s as necessary,  Clean truck. Replace broken wheel studs 1 x LHS Drive 1 x Rhs Drive. Tension and put back online. Steam clean equipment as necessary.
1365237	Scheduled Service - 3750hr service II 250hr type.	GOSMOND	29/03/2021	Internal	3736.0	\$0.00	250hr Service
1366565	BROKEN WHEEL STUDS	GOSMOND	25/03/2021	Internal	3736.0	\$0.00	Clean truck. Perform 3750hr pm service. Put back online Repair Hub/s as necessary,
1364216	WHEEL STUDS U/S	GOSMOND	15/03/2021	Internal	3565.0	\$0.00	Replace 1 wheel stud rhs drive and 1 on lhs drive. Repair Hub/s as necessary,
1360787	Scheduled Service - 3500hr service II 500hr type .Level B Service	GOSMOND	15/03/2021	Internal	3565.0	\$0.00	Replace 2 broken wheel studs rhs drive. Put back online. Steam clean equipment as necessary.  Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1357835	Scheduled Service - 3250hr service II 250hr type	GOSMOND	26/02/2021	Internal	3262.0	\$0.00	Clean truck. Carry out 3500hr pm service. Adjust a/c belt. Put back online. Steam clean equipment as necessary.  250hr Service  Repair Air Conditioner as necessary,
1360111	CW - Unit has a broken wheel stud LHS front wheel - Tech to assess for cust damage	GOSMOND	23/02/2021	Internal	3262.0	\$0.00	Clean truck. Perform 3250hr pm service. Fill up greaser. Adjust a/c belt. Put back online Repair Hub/s as necessary,  Replace broken wheel stud lhs drive wheel. Check and tension all other studs. OK. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1356589	CW- Air Con not working	GOSMOND	8/02/2021	Internal	2973.0	\$0.00	Re-gas Air Conditioner to correct specification ,  A/c not working. Low gas in system. Pressurize with nitrogen to 150psi. No leaks found. Reclaim whats left of the gas. Vac system down and check for leaks . No loss of vac over 30mins. Regas system and test. Working well now. Put back to work.
1356565	Adjust accumulator	WBRAZIL	8/02/2021	Internal	2974.0	\$0.00	Adjust Accumulator Pressure  Adjust fan belt as required  Repair Air Conditioner as necessary ,  Steam clean equipment as necessary.  Travel to site,  Check and adjust acumulator - test, clean air con condenser, adjust air con belt.
1356265	RH DRIVE WHEEL STUD U/S	GOSMOND	5/02/2021	Internal	2768.0	\$0.00	Repair Hub/s as necessary,  Replace 2 broken wheel studs rhs drive.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1336294	Steer axle spindles smashed after incident on site	GOSMOND	5/02/2021	External	2973.0	\$32,293.15	<p>Steer axle spindles smashed after incident on site</p> <p>Inspect steer axle. Top spindle bearings damaged. Clean truck. Remove tynes and put in shed. Remove ancillary items and Steer Axle, Strip, Inspect and report,</p> <p>Remove steer wheels. Remove hubs. Remove tie rod ends. Remove spindles. Bearings seem ok. Inspect Steer axle. Find axle housing bent - Unable to reclaim. New steer axle assy to be ordered Remove grease lines</p> <p>Remove steer axle. Remove steer cylinder. Clean both spindles and load into van to be dropped off to be crack tested. Pickup.</p> <p>Remove bearing cup from lhs spindle bottom cap. Remove broken bolt from said cap.</p> <p>Clean up and throw away old bearings etc. Go through parts list to ensure correct parts have been supplied. Remove bearing cups and seal runners from spindle lower caps. Clean up surfaces.</p> <p>Fit new cups to both hubs. Grease inner bearings and fit to hubs. Fit wheel seals to hubs. Fit new cups and wear sleeves to lower spindle caps. Pack all bearings with grease. Unpack new steer axle. Clean and fit rhs spindle with new bearings, wear sleeves and seals. Shim up lhs spindle. Fit bearings and wear runner to rhs. Fit wear runner seal and bearings to spindle. Fit to axle. Shim up ok. Clean and fit steering cylinder to steer axle.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001 <b>Equip. Code:</b> H15946 <b>Description:</b> Hyster H20XM-9 <b>Make:</b> HYSTER <b>Model:</b> H20XM-9 <b>Serial No.:</b> C236E03535T							
							Connect tie rod ends.  Fit both sides hubs. Adjust bearings and fit caps. Flip axle over and reinstall in truck with new pivot bushes etc. Fit and tighten retaining caps. Tension pivot caps. Refit all hoses and grease lines. Refit wheels and tension up. Refit tynes. Test drive ok. Put back online. Retension all axle retaining bolts. Check wheel bearing preload and spindle preload. All ok. Retension steer wheel studs and fit indicators. Clean up workshop after job. 1000hr Service
1334224	Scheduled Service - 3000hr service II 3000hr type.	GOSMOND	7/12/2020	Internal	2766.0	\$0.00	Continue with service. Drain trans and change filter.  3000hr Service  Drain diff oil.
1340373	CW-Camera recorder time stamps are out. Not reading correct date/ time ect.	GOSMOND	16/11/2020	Internal	2766.0	\$0.00	Complete 3000hr pm service. Remove sd card and edit in a date file. Refit card and test ok.
1333559	Replace broken wheel studs	GOSMOND	13/10/2020	Internal	2766.0	\$0.00	Repair Hub/s as necessary,  Replace 2 wheel studs on the lhs drive, 1 stud on rhs drive.
1332809	Scheduled Service - 2750hr service II 250hr type.	GOSMOND	12/10/2020	Internal	2745.0	\$0.00	Retension all drive wheel studs. Refit indicators. Steam clean equipment as necessary.  250hr Service
1332065	Replace broken wheel studs	GOSMOND	6/10/2020	Internal	2636.0	\$0.00	Clean truck. Carry out 2750hr pm service. Repair Hub/s as necessary,  Replace 3 broken wheel studs. Retension. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1327798	Scheduled Service - 2500hr service II 500hr type .Level B Service	GOSMOND	28/09/2020	Internal	2545.0	\$0.00	Steam clean equipment as necessary.  Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1324819	Scheduled Service - 2250hr service II 250hr type	GOSMOND	11/09/2020	Internal	2289.0	\$0.00	Carry out pm service Labour  Steam clean equipment as necessary.  250hr Service  Pickup parts. Clean down truck. Carryout 2250hr pm service. Put back online.
1320442	a bush on sideshift pin thats coming out - Parked Up	GOSMOND	9/09/2020	Internal	2310.0	\$0.00	Repair Tyne Latch as necessary, Labour Drill and tap tyne pin to help in removal. Remove pin and clean up circlip groove. Bush has worn down and needs replacing. Cleanup and reassemble ok to use. Order parts to replace bushes. Steam clean equipment as necessary. Clean truck. Remove tyne pins and cut old bushes out with die grinder. Freeze bushes and fit to tyne carriers. Fit tyne carriers to truck and reinstall pins. Put back online. Replace Sideshift Bushes/Bearings, Travel to site, Standard Warranty expired at 2000 hours, failed components is not covered under major components warranty.
1324241	Refer Job 1319156	511 Planning A	2/09/2020	External	2026.0	\$36.01	
1322557	reverse beeper not working - Still in use	GOSMOND	2/09/2020	Internal	2137.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System  Located unit. Confirmed no reverse beeper. Checked for power to beeper. Found beeper (white noise) faulty. Unable to find part number on hypass. Spare parts chasing parts via contact management.  Labour  Remove and Replace Reverse buzzer, Refit to unit,  Fit new bbs87 type reverse buzzer. Test ok. Retension rhs drive wheel nuts. Put back online.
1323072	Broken wheel studs	WHILL	27/08/2020	Internal	2026.0	\$0.00	Replace Steer Wheel Studs and Nuts,  Replaced 3 broken wheel studs and nuts on rh drive axle

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1321931	Scheduled Service - 2000hr service II 2000hr type .Level D Service	WHILL	27/08/2020	Internal	1848.0	\$0.00	Travel to site,  2000hr Service
1322185	CW-Air con belt is slipping and squeeling. Still in use	WHILL	24/08/2020	Internal	2026.0	\$0.00	Travel to site,  Adjust fan belt as required
1319147	Scheduled Service- 1750hr service.	GOSMOND	10/08/2020	Internal	1747.0	\$0.00	Steam clean equipment as necessary.  250hr Service  Drain and refill differential oil,  Clean truck. Perform 1750hr pm service. Change diff and final drive oil.
1319156	CW - Minor oil leak on a side shift cylinder, operational still in use.	GOSMOND	7/08/2020	Internal	1726.0	\$0.00	Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,  Clean truck. Weeping from fitting on tyne positioner cylinder. Replace o ring and test. ok. Grease tyne sliders.
1317182	Door latch jamming up	GOSMOND	29/07/2020	Internal	1570.0	\$0.00	Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,  Door lath jamming with button down. Dismantle and clean/check. Reassemble and lubricate. Test ok.
1309769	Scheduled Service - 1500hr service II 500hr type. Level B Service.	GOSMOND	27/07/2020	Internal	1726.0	\$0.00	Steam clean equipment as necessary.  Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1315271	Rust on the RHS tilt cylinder rod+ seal starting to weep	GOSMOND	21/07/2020	Internal	1437.0	\$0.00	Clean truck. Perform 500hr pm service. Check/Inspect/Diagnose Hydraulic Oil Leak and test operation, Noticed rust and pitting on rhs tilt cylinder rod. Seal head starting to weep as pitting goes under seal head a maximum retraction. Took pics and reported issue
1315265	Mast is loose - to be inspected and tightened	GOSMOND	21/07/2020	Internal	1455.0	\$0.00	Carry out Inspection and Diagnosis of Mast/Carriage  Truck was tagged out with 'mast very loose'. Checked mast pivots for movement, ok. Checked tilt cylinders, OK. Checked mast and carriage rollers, ok. Test drive and nothing noticed. Operator which reported the fault is on night shift. Put back online and will monitor issue.  Ask all operators and no more complaints about the problem.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1313398	Top up hyd oil	GOSMOND	13/07/2020	Internal	1342.0	\$0.00	Top up Hydraulic Oil to correct level,
1312894	Adjust lift chains	GOSMOND	9/07/2020	Internal	1306.0	\$0.00	Top up hydraulic oil. Adjust Lift Chain to correct specification,
1311798	CW-Broken wheel stud on the drive wheel. Tagged out - RHS - CM TO BE RAISED	GOSMOND	6/07/2020	External	1286.0	\$1,605.96	Lock nuts on lift chains loose. Check adjustment and tighten lock nuts. OK. Steam clean equipment as necessary.  Repair Wheel/s as necessary,  Clean truck. Remove rhs drive wheels, studs and buff up mating surfaces. Tyre fitters refitted wheels to truck.  Retension wheel nuts. Nuts came up aproximately 30degrees. Will have to retension again tomorrow.  Recheck tension. Ok. Refit wheel nut indicators. Put back to work. Labour
1308281	Scheduled Service- 1250hr service II 250hr type.	GOSMOND	6/07/2020	Internal	1248.0	\$0.00	Steam clean equipment as necessary.  250hr Service
1302491	Replace broken wheel studs - LHS	GOSMOND	6/07/2020	External	1248.0	\$1,243.52	Clean truck. Perform 250hr pm service. Repair Wheel/s as necessary,  Replace 2 broken wheel studs. Retension nuts.  Steam clean equipment as necessary.  Clean truck. Removed drive wheels by fitters. Remove and replace wheel studs. Buff all mating surfaces. Wheels refitted by tyre fitters.  Remove 2nd hand nuts due to the new nuts were a differnt size and I didn't have the correct socket. Fit new nuts and tension up.
1310000	Retension steer wheel bearings	GOSMOND	26/06/2020	Internal	1070.0	\$0.00	Recheck tension. Ok. Put back online. Adjust and Retention Steer Wheel Bearings  Check tension of steer wheel bearing. Following the procedure in the book the nuts came back to their original positions

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1307819	Scheduled Service - 1000hr service II 1000hr type.	GOSMOND	24/06/2020	Internal	1060.0	\$0.00	Steam clean equipment as necessary.  1000hr Service
1308465	CW - Reverse blue light activated in forward and reverse	GOSMOND	19/06/2020	Internal	1060.0	\$0.00	Steam clean truck. Carry out 1000hr pm service. Repair Light/s
1306410	CW-Front wiper has come apart- tech to assess for customer damage. Tagged out.	GOSMOND	15/06/2020	Internal	1315.0	\$0.00	Check blue light. Working correctly. Check wiring ok. Repair Windscreen Wiper as necessary,  Diagnose issue with wipers not working. Replace blown fuse and now working. Circlip has fallen off pivot point on wiper arm and pivot bush has gone. This caused the pivot to bind and blow the fuse. Make a new bush from nylon and find a clip to get the truck back online. Order parts to repair the issue permanently.  Replace Windscreen Wiper,  Replace front wiper arm with new.
1303423	NEW SET OF TYNES	BIG TRUCK SA	15/06/2020	Internal	618.0	\$0.00	
1305026	CW-Broken wheel stud- tech to assess for customer damage. Tagged out.	GOSMOND	9/06/2020	Internal	806.0	\$0.00	Travel to site,  Repair Wheel/s as necessary,  Travel to site. One broken wheel stud rhs drive wheel. Replace wheel stud and tension all others. This stud next to the failed one failed when retensioning and I replaced that one as well. Paint new studs to see if they fail again. Put back online 250hr Service
1301490	Scheduled Service - 750hr service II 250hr type.	GOSMOND	5/06/2020	Internal	782.0	\$0.00	Adjust Lift Chain to correct specification,  Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,  Carry out 750hr pm service. Tighten loose light bracket. Tighten loose rhs lift chain.
1303332	CW - Oil leaking underneath - Parked up	GOSMOND	4/06/2020	External	765.0	\$187.38	Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,  Clean down. Diagnose oil leak. Blown o ring on check valve. Reseal and refit. Test ok. Put back to work.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1301957	CW-Brakes have gone soft. Tagged out.	GOSMOND	2/06/2020	Internal	724.0	\$0.00	<p>Steam clean equipment as necessary.            Carry out Inspection and Diagnosis of Brake System            Bleed Brake System            Clean truck. Diagnose soft brakes. Bleed brakes but no better.            Block up unit, Adjust brakes and handbrake,            Continue diagnosis of brakes. Check pressures and all ok. Adjust brakes including removing LHS drive wheels.            Refit wheels and test drive. Brakes appear better so instructed operator to use it and see how it goes.            Still no good. Checked pedal travel against known good truck. Both the same. Removed treadle valve and removed shim. Grease valve shaft as was showing signs on rust and galling. Reassemble and test. Ok now put back to work.</p> <p>Adjustments are not covered under warranty            Repair Ignition Circuit as required,</p>
1300351	water running out of the o/head console and in to the cab	GOSMOND	22/05/2020	Internal	618.0	\$0.00	<p>Water dripping out of overhead console and radios cutting out. Silasticed up aerial wire into top of cab. Drop console but found very little water in there. Dry out water and refit. Radios still cutting out. Trace problem to 12v converter failing.</p> <p>Remove ancillary items and Repair Wiring as necessary,            Refit ancillary items,</p> <p>Plug in uhf radio and test. Appears to be working properly now. Give back to operator and worked all day with no complaints.            Labour</p>
1296727	Scheduled Service - 500hr service II 500hr type. Level B Service.	GOSMOND	22/05/2020	Internal	616.0	\$0.00	<p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p> <p>Travel to parts. Clean machine. Carry out 500 hr pm service.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1295815	CW - Oil leak under the cab, Unknown source - Tagged out.	GOSMOND	6/05/2020	External	336.0	\$731.45	Travel to site,  Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,  Labour  Replace Hydraulic Hose/s and ancillary items,  Steam clean equipment as necessary.  Travel to site. Dignose oil leak. Standby line to rear piston pump failed at crimp. Remove and take to repairer. Get new hose made and return to site. Fit new hose and test. Ok. Clean down oil on truck and top up hydraulics. Put back online. 250hr Service
1293745	Scheduled Service - 250hr service II 250hr type.	GOSMOND	30/04/2020	Internal	274.0	\$0.00	Carry out initial 250hr pm service. Replace engine oil and filter. Trans oil and filter. Diff and final drive oils. Replace brake filter. Replace Windscreen,
1293450	CW-Windscreen is starting to pop out	GOSMOND	27/04/2020	External	209.0	\$651.50	Diagnose issue. Windscreen popped out at top and down lhs side. Same as H15960 did previously. Organise sub contractor to investigate issue and refit windscreen. Assist contractor to wedge glass up and glue the windscreen back in. Tight in both upper corners but still loose in top middle of screen. Will leave offline till tomorrow to let the sealant time to set.  Mechanic GOSMOND replaced order number wty with Warrenty Repair Seat as necessary,
1292925	CW - air seat keeps deflating - Parked Up	GOSMOND	23/04/2020	External	197.0	\$302.90	Air seat going down. Find air leak at adjuster valve. Repair leak and test. Ok.
1292776	CW-Lift chain has come loose. Tagged out.	GOSMOND	23/04/2020	Internal	196.0	\$0.00	Travel to site,  Repair Lift Chain Anchors as necessary,  Travel to site. Adjust and tighten loose chain anchor lock nuts. Test ok.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1292080	PART PENDING Repair grease lines	GOSMOND	20/04/2020	External	1070.0	\$628.53	Repair Attachment as necessary,  Remove failed line and fit new one. Incorrect part ordered. (too short) Will order correct part
1291514	CW-Oil leaking from behind the front rhs drive wheel. (cant specify what oil) Tagged out.	GOSMOND	17/04/2020	External	399.0	\$309.64	Remove incorrect line and fit correct one. Test ok. Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,  Diagnose oil leak. Clean machine. Found blown o ring on control valve. Fit substitute o ring and test ok. Order correct part.
1291088	Scheduled Service - 1ST 100HR SERVICE	GOSMOND	16/04/2020	Internal	91.0	\$0.00	Receive new part. 100Hr Service  Replace incorrect spec plate.  Repair Lift Chain Anchors as necessary ,
1290081	Calibrate transmission + fit tynes	GOSMOND	8/04/2020	Internal	16.0	\$0.00	Carry out 100hr pm service. Tighten loose lower chain anchor nuts Repair Transmission as necessary ,  Remove ancillary items and Forks/Tynes, Inspect and report,  Refit Forks/Tynes and ancillary items ,  Steam clean equipment as necessary.  Calibrate speed limiter. Swap tynes from existing truck to this truck. Prep to put online

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H15946		<b>Description:</b> Hyster H20XM-9					
<b>Make:</b> HYSTER		<b>Model:</b> H20XM-9		<b>Serial No.:</b> C236E03535T			
1199996	Prep for Rent; Timberlink	GOSMOND	9/04/2019	Cap Prep	12.0	\$0.00	<p>Carry out equipment condition assessment</p> <p>Install Fleet Management System (Basic),</p> <p>Refit Mast and ancillary items,</p> <p>Fit Fleet Management System as required,</p> <p>Prepare For Sale - Workshop</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Refit Hydraulic Hose/s and ancillary items,</p> <p>Replace Mast Hanger Bushes,</p> <p>Repair Light Bracket as required,</p> <p>Install Radio,</p> <p>Repair Fleet Management System as required,</p> <p>Refit Forks/Tynes and ancillary items,</p> <p>Prepare For Hire - Workshop</p> <p>Repair Engine Intake Ducting as required,</p> <p>Remove ancillary items, prepare and Paint unit as required,</p> <p>Assist Efrain in painting , refit other attachment.</p> <p>Install Hard Labels,</p> <p>Adjust Fleet Management System as required,</p> <p>Install Wheel Nut Indicators,</p> <p>Replace Light Bracket as required,</p> <p>Install Light/s</p> <p>Repair Wheel/s as necessary,</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
---------	-------------	----------	------	----------	----------	--------	-------

Owner: ADAP001

Equip. Code: H15946

Make: HYSTER

Description: Hyster H20XM-9

Model: H20XM-9

Serial No.: C236E03535T

Assit tech on re-torque all wheel nut, and put yellow indicator.

Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,

Carry out New Equipment Predelivery to correct specification.

Remove ancillary items and Forks/Tynes, Inspect and report,

Steam clean equipment as necessary.

Remove ancillary items and Mast, Strip, Inspect and report,

Repair Air Conditioner as necessary,

Found dignostic plug inaccessible. Removed modules and relocated plug. Refitted all parts. Adjusted speeds and trans restrictions. Removed mast and cab pressurizer ready for transport. Travelled to site and refitted mast and replumbed up. Refitted and reconnected pressurizer.

<b>Equipment Total:</b>	<u>\$58,634.01</u>
<b>Customer Total:</b>	<u>\$58,634.01</u>