

ADAPT-A-LIFT GROUP PTY LTD

Service History Listing Active Units

Date: 19/06/2026

Time: 10:45:24AM

For Equipment Code From: H15947 To: H15947

For Customer Code From: All To: All

For Date Posted From: All To: All

For Branch Code From: All To: All

Don't Show Cost

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--------------------------------------|--|------------|--------------------------------|----------|------------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1827374 | Oversee unit being removed from site | GOSMOND | 20/05/2026 | Internal | 23223.0 | \$0.00 | Carry out equipment condition assessment |
| 1787447 | Dehire and Demobilisation | GOSMOND | 21/04/2026 | External | 23223.0 | \$2,146.60 | Assist with loading Truck and carriages. Travel to site Cap off unit hydraulics and prep the day before demobilisation Travel to site Create an exclusion zone and isolate the machine Replace damaged cabin air louver Liaise with Franna to remove mast and carriage from unit Load unit for transport. Transport unit offsite. Timberlink to provide 25t Franna and Dogman. Timberlink to provide scissorlift for 2 days. |
| 1767587 | 250hr Service | BIG TRUCK SA | 3/12/2025 | Internal | 21304.0 | \$0.00 | |
| 1763893 | 250hr Service | GOSMOND | 12/11/2025 | Internal | 23107.0 | \$0.00 | Clean truck. Perform 23000hr pm service. Only did a 250hr pm due to being off hire soon. Chains 0.5 Tynes 81.5mm Put back online. |
| 1759052 | Dehire Inspection | GOSMOND | 23/10/2025 | Internal | 23223.0 | \$0.00 | Steam clean equipment as necessary. Carry out equipment condition assessment |
| 1754651 | 23000hr II 500hr Service | GOSMOND | 16/10/2025 | Internal | 22789.0 | \$0.00 | Clean truck. Perform Dehire inspection. Put back offline. Steam clean equipment as necessary. 250hr Service NOTE 22750hr service. Clean truck. Perform 22750hr pm service. Chains 0.3% Tynes 81.8mm. Put back online. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|---|--|------------|--------------------------------|----------|------------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1748643 | 22500hr II 500hr Service | GOSMOND | 28/09/2025 | Internal | 22494.0 | \$0.00 | Steam clean equipment as necessary. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Clean truck. Perfrom 22500hr pm service. Top up transmission. Topup coolant. Replace missing grease nipple in tailshaft. Tynes 81.6mm Chains 0.3%. Put back online. Replace Battery, |
| 1752201 | No crank | GOSMOND | 26/09/2025 | Internal | 22547.0 | \$0.00 | Labour Refit Battery to unit, Refit ancillary items, Non crank. Batteries have failed. Borrow batteries from H15960 and fit to truck. Starts now. Check charge rate 28.1v ok. Packup and travel to pickup new batteries. Return to site. Swap new batteries into truck and refit borrowed batteries to H15960. Put H15947 back online. Steam clean equipment as necessary. |
| 1750002 | Oil leak from underneath | GOSMOND | 18/09/2025 | Internal | 22446.0 | \$0.00 | Replace Hydraulic Hose/s and ancillary items, Labour Clean truck. Diagnose oil leak. Found leaking ferule on 2nd main pump line. Remove and fit changeover line. Test ok. Check oil level ok. Put back online. Cleanup. Drop hose at repairers for new one to be made up. Steam clean equipment as necessary. |
| 1741986 | 22250hr II 250hr Service | GOSMOND | 3/09/2025 | Internal | 22258.0 | \$0.00 | 250hr Service Clean truck. Perform 22250hr pm service. Top up coolant. Top up Transmission. Tynes 81.6mm Chains 0.3%. Put back online. Replace Hydraulic Hose/s and ancillary items, |
| 1742531 | H15947 - oil leak under the machine somewhere | GOSMOND | 21/08/2025 | Internal | 20084.0 | \$0.00 | Diagnose oil leak. Replaced main hydraulic pump hoses with spares. Test ok. Drop old hoses off at repairer for replacement. |
| 1735458 | FW - Transmission Cooler Leaking | BIG TRUCK SA | 21/08/2025 | External | 22099.0 | \$5,354.74 | Collect parts and travel to site Replace and reseal leaking transmission cooler Top up transmission oil. |
| 1739038 | H15947 - oil leak | GOSMOND | 14/08/2025 | Internal | 22033.0 | \$0.00 | Replace leaking hose with new one. Put back online. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--------------------------------|--|------------|--------------------------------|----------|--------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1737083 | 22000hr II 2000hr Service | GOSMOND | 14/08/2025 | Internal | 22033.0 | \$0.00 | Steam clean equipment as necessary. 2000hr Service Clean truck. Perform 22000hr pm service. Replace lhs bonnet gas spring and adjust. Chains 0.3% Tynes 82.1mm. Put back online. |
| 1738503 | Fault code T0211 | GOSMOND | 5/08/2025 | Internal | 21904.0 | \$0.00 | Remove ancillary items and Potentiometer, Replace Potentiometer and Refit to unit, Refit ancillary items, Diagnose fault code T0211. Inching sensor mismatch. Set pedal to 0.85v by back probing sensor as ZF software license has expired. Calibrate sensor, failed with code tP421(replace sensor). R and I sensor and calibrate. ok. Put back online. |
| 1729805 | 21750hr II 250hr Service | GOSMOND | 23/07/2025 | Internal | 21744.0 | \$0.00 | Steam clean equipment as necessary. 250hr Service Clean truck. Perform 21750hr pm service. Chains 0.3% Tynes 82.4mm. Ordered hood gas spring. Will do further work for Trans cooler. Put back online. |
| 1730116 | Blue reverse light not working | GOSMOND | 3/07/2025 | Internal | 21612.0 | \$0.00 | Repair Light/s Blue light not working. Swap with one from offline truck. Still no worky. Check fuses and wiring. Found the spare light is no good as well. Order new lights and put truck back online until parts arrive. Replace Light/s |
| 1722499 | 21500hr II 500hr Service | GOSMOND | 27/06/2025 | Internal | 21516.0 | \$0.00 | Fitup new blue light. Test ok. Put back online. Steam clean equipment as necessary. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Clean truck. Perform 21500hr pm service. Top up coolant. Bonnet gas spring has failed. Transmission cooler weeping, ok for now. Chains 0.3% Tynes 82.4mm. Put back online |
| 1717421 | 21250hr II 250hr Service | AFOX | 31/05/2025 | Internal | 21279.0 | \$0.00 | 250hr Service Clean truck. Perform 21250hr pm service. Chains 0.3% tynes 81.9mm. Andrew changed leaking undercab hoses on another job. Trans cooler weeping. Put back online. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|---|--|------------|--------------------------------|----------|--------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1720722 | Replace cab hoses | GOSMOND | 27/05/2025 | Internal | 18900.0 | \$0.00 | 250hr Service |
| 1714336 | Non crank | GOSMOND | 1/05/2025 | Internal | 21002.0 | \$0.00 | Replace Hydraulic Hose/s and ancillary items, Replace Starter Motor, Diagnose non crank. Fuses and wiring ok. Power getting to starter motor. R and I starter motor. Test ok. Put back online. |
| 1710658 | 21000hr II 3000hr Service | GOSMOND | 1/05/2025 | Internal | 21002.0 | \$0.00 | 3000hr Service Steam clean equipment as necessary. |
| 1705160 | 18750hr II 250hr Service | GOSMOND | 8/04/2025 | Internal | 20777.0 | \$0.00 | Claen truck. Perform 21000hr pm service. Chains 0.2%. Tynes 82mm. Bellyplate damaged. Getting p and a on replacement. Put back online. 250hr Service Perform pm service. Tighten a/c belt. Put back online |
| 1700549 | Inside door handle not working & trouble starting | GOSMOND | 3/04/2025 | Internal | 18513.0 | \$0.00 | carry out 250hr service, lh step mounting damaged, missing exhaust manifold bolt, lh tilt cylinder leaking. Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Diagnose door handle. All seems ok. Lubricate and test ok. Put back online. |
| 1689306 | 20000hr II 5000hr Service | GOSMOND | 1/04/2025 | Internal | 20162.0 | \$0.00 | Carry out Inspection and Diagnosis of Electrical System Steam clean equipment as necessary. 5000hr Service Travel to site, Overhaul Drive Axle components as required , carry out drive hub retension |
| 1702694 | Replace worn out tyne slide bushes | GOSMOND | 18/03/2025 | Internal | 20530.0 | \$0.00 | broken tool during removal, travel to mtg, purchase new tool, return to site, finish task, reassemble refill oils Repair Tyne Latch as necessary, Steam clean equipment as necessary. Clean truck. Remove both tynes and carries. Found rhs still good as change in november 24. Remove and replace lhs tyne bushes. Reassemble and test ok. Put back online. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|--|------------|--------------------------------|----------|--------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1701473 | 20500hr II 500hr Service | GOSMOND | 17/03/2025 | Internal | 20526.0 | \$0.00 | Steam clean equipment as necessary. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. |
| 1698282 | Replace lift chains | GOSMOND | 17/03/2025 | Internal | 20529.0 | \$0.00 | Clean truck. Perfrom 20500hr pm service. New lift chains fitted on separate job. Replaced tyne bushes on separate job. Rhs lift cylinder weeping, lhs tilt cylinder weeping. Put back online. Replace Lift Chain, Unpack pallet and cut chains to length. Unable to get truck to change chains. |
| 1696142 | Inspect & replace blue reverse light | GOSMOND | 17/03/2025 | Internal | 20529.0 | \$0.00 | Remove old chains and fit new ones. Adjust hoses. Test ok. Put back online. Replace Light/s |
| 1697950 | 20250hr II 250hr Service | SPitman | 26/02/2025 | Internal | 20298.0 | \$0.00 | Replace dull blue light with new unit. Adjust and test. Ok. Put back online. 250hr Service |
| 1695172 | Wont start | GOSMOND | 24/02/2025 | Internal | 20265.0 | \$0.00 | carry out 250hr service,broken lh step mounting,broken exhaust manifold stud,lh tilt cylinder leaking,lift chains need replacing,engine under tray damaged. Replace Battery, Diagnose no start. Batteries failed. Borrow batteries from H15961 and order new ones. Start truck and check charging. OK. Put back online. |
| 1693783 | Chain inspection & sheeve roller assessment | GOSMOND | 13/02/2025 | Internal | 20116.0 | \$0.00 | Fit new batteries. Test ok. Put back online. Carry out Inspection and Diagnosis of Mast/Carriage |
| 1687742 | Wear blocks fallen from tyne carrier & 2 x mast lights not working | GOSMOND | 21/01/2025 | Internal | 19811.0 | \$0.00 | Perform sheave and chain inspection. No noticable movement in sheave. 60% wear in chain. Put back online. Replace Mast Wear Strips, |
| 1687249 | Light on the RHS of the cab not working. | GOSMOND | 20/01/2025 | Internal | 19811.0 | \$0.00 | Cleanup carriage. Refit wear block and weld in packer to stop it falling out again. Put back online. Replace Light/s |
| 1678123 | 19750hr II 250hr Service | GOSMOND | 16/01/2025 | Internal | 19773.0 | \$0.00 | Replace failed worklight. Test ok. Put back online. Steam clean equipment as necessary. 250hr Service |
| | | | | | | | Clean truck. Perform 19750hr pm service. Put back online. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|---------------------------|--|------------|--------------------------------|----------|--------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1674451 | 19500hr II 500hr Service | GOSMOND | 3/12/2024 | Internal | 19514.0 | \$0.00 | Steam clean equipment as necessary. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. |
| 1672438 | Replace tyne bushes | GOSMOND | 13/11/2024 | Internal | 19522.0 | \$0.00 | Clean truck. Perform 19500hr pm service. Change diff and final drive oils. Put back online. Repair Tyne Latch as necessary, Rhs tyne slide bushes worn out. |
| 1668643 | 19250hr II 250hr Service | GOSMOND | 13/11/2024 | Internal | 19256.0 | \$0.00 | Replace rhs tyne bushes. Put back online. Steam clean equipment as necessary. 250hr Service Clean truck. Perform 19250hr pm service. Put back online. |
| 1661724 | 19000hr II 1000hr Service | GOSMOND | 24/10/2024 | Internal | 19031.0 | \$0.00 | Steam clean equipment as necessary. 1000hr Service Clean truck. Perform 19000hr pm service. Put back online. |
| 1661745 | Not Working | GOSMOND | 3/10/2024 | Internal | 18777.0 | \$0.00 | Repair Windscreen Wiper as necessary, Diagnose wipers not working. Timer relay failed which caused the wiper to not stop and burned out the wiper motor. Replace both relay and wiper motor. Test ok. Put back online. |
| 1660945 | repair greaser | GOSMOND | 1/10/2024 | Internal | 18875.0 | \$0.00 | Grease All Points on Unit, Diagnose faulty greaser. Bleed system. Remove unit and check pumping motor. Ok. But still faulting. Check wiring ok. Manual grease unit. Order new grease pumping unit. Put back online waiting for parts. Labour |
| 1658086 | 18750hr II 250hr Service | GOSMOND | 1/10/2024 | Internal | 18743.0 | \$0.00 | Pickup parts. Fit new greaser pump. Bleed system and check. OK. Put back online. Steam clean equipment as necessary. 250hr Service Clean truck. Perform 18750hr pm service. Topup coolant. Put back online. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|--|------------|--------------------------------|----------|--------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1655139 | 18500hr II 500hr Service | BIG TRUCK SA | 12/09/2024 | Internal | 18530.0 | \$0.00 | Steam clean equipment as necessary. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. |
| 1643009 | 18250hr II 250hr Service | GOSMOND | 21/08/2024 | Internal | 18276.0 | \$0.00 | Clean truck. Perform 18500hr pm service. Tighten a/c belt. Put back online. Steam clean equipment as necessary. 250hr Service |
| 1649010 | operator has reported that the front wiper on forklift will not turn off | GOSMOND | 16/08/2024 | Internal | 18276.0 | \$0.00 | Clean truck. Perform 18250hr pm service. Put back online. Repair Windscreen Wiper as necessary, Timer replay shorted. Replaced with one stolen from 60 which is offline. Will have to replace wiper motor as well. Will finish job on Monday when 18250hr pm service will be due. |
| 1639048 | 18000hr II 3000hr Service | BIG TRUCK SA | 22/07/2024 | Internal | 18004.0 | \$0.00 | Wiper motor appears ok. Put back online. 2000hr Service Prep for service. Steam clean equipment as necessary. |
| 1637191 | Repair wipers | GOSMOND | 3/07/2024 | Internal | 17758.0 | \$0.00 | Steam clean truck. Perform 18000hr pm service. Change all filters and all oils. Put back online. Repair Windscreen Wiper as necessary, Diagnose wipers. Found wiper timer relay faulty. Replace with new one. Test ok. Put back online. |
| 1631542 | 17750hr II 250hr Service | BIG TRUCK SA | 2/07/2024 | Internal | 17757.0 | \$0.00 | Steam clean equipment as necessary. 250hr Service Clean truck. Perform 17750hr pm service. Put back online. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|--|------------|--------------------------------|----------|--------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1603197 | Replace transmission seal & tie rod ends | GOSMOND | 17/06/2024 | Internal | 17570.0 | \$0.00 | <p>Repair Transmission as necessary,</p> <p>Order parts</p> <p>Repair Hydraulic Tilt Cylinder as required,</p> <p>Order further parts</p> <p>Replace Tie Rod End/s,</p> <p>Clean and re-pack Steer Wheel Bearings,</p> <p>Get Trident to remove steer wheels. Replace both tie rod ends. Reuse pins as waiting for 4 months for new ones. Reassemble. Remove lhs steer hub. Clean and inspect bearings. ok. Repack and reassemble. Ready for Trident to refit wheels.</p> <p>Cleanup after job and track down missing parts.</p> <p>Top up Transmission Oil to correct level,,</p> <p>Pickup missing parts and sort out.</p> <p>Steam clean equipment as necessary.</p> <p>Clean truck. Remove driveshaft, trans output yoke and seal. Seal damaged fom installation. See image, spring out of groove. Make new seal installation tool. Fit new seal. Refit yoke and driveshaft. Fill with oil.</p> <p>Replace transmission rear output seal. Calibrate transmission. Had to update software on tablet. Still faulting. Found faulty new cable. Repaired cable, ok now. Test drive ok. Put back online.</p> <p>Steam clean equipment as necessary.</p> |
| 1625695 | 17500hr II 500hr Service | BIG TRUCK SA | 4/06/2024 | Internal | 17489.0 | \$0.00 | <p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p> <p>Manufacture Mud flaps,</p> <p>Clean truck. Carry out 17500hr pm service. Top up trans and coolant levels. Remove lhs rear mudflap. Make new one and fit to truck. Put back online.</p> |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|--|------------|--------------------------------|----------|--------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1627259 | Seat adjuster does not work | GOSMOND | 27/05/2024 | Internal | 17469.0 | \$0.00 | <p>Repair Seat as necessary, Repair and strengthen seal position lever. Seat rails worn and sticking. Order new seat rails. Lubricate worn ones. Test ok until new rails can be fitted. Put back online.</p> <p>Repair Steering as necessary,</p> <p>Remove old rails and fit new ones. Replace worn out steering wheel spinner. Put back online.</p> |
| 1619279 | 17250 II 250hr Service + Bolts Missing in Mast | GOSMOND | 14/05/2024 | Internal | 17300.0 | \$0.00 | <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>Broken bolt in light/hose bracket. Remove m12 bolts and replace with m14 bolts. Top up hydraulic oil. Put back online.</p> <p>Steam clean equipment as necessary.</p> <p>250hr Service</p> |
| 1613864 | 17000hr II 1000hr Service | GOSMOND | 22/04/2024 | Internal | 17025.0 | \$0.00 | <p>Clean truck. Perform 17250hr pm service. Top up coolant and trans oils. Put back online.</p> <p>Steam clean equipment as necessary.</p> <p>1000hr Service</p> |
| 1607642 | 16750hr II 250hr Service | GOSMOND | 5/04/2024 | Internal | 16780.0 | \$0.00 | <p>Clean truck. Perform 17000hr pm service. Adjust a/c belt. Calibrate transmission. Replace failed lhs lower mast light. Put back online.</p> <p>Steam clean equipment as necessary.</p> <p>250hr Service</p> <p>Clean truck. Perform 16750hr pm service. Put back online.</p> |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|----------------------------|--|------------|--------------------------------|----------|--------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1608588 | A/C - Not Blowing Cool Air | GOSMOND | 18/03/2024 | Internal | 16650.0 | \$0.00 | <p>Repair Air Conditioner as necessary,</p> <p>Diagnose no a/c. A/c system works ok. Condensor fans noisy and need replacing. Blower fan sticking and not spinning. Get it to spin but needs replacing as it is unreliable. Order parts</p> <p>Labour</p> <p>Pick up condensor fans. Kickstart blower fan again.</p> <p>Prep for job. Unable to get truck due to work demands.</p> <p>Replace blower fan. Replace condensor fans. Put back online.</p> |
| 1608294 | No Start - Crank | GOSMOND | 15/03/2024 | Internal | 16550.0 | \$0.00 | <p>Replace Battery,</p> <p>Labour</p> <p>Diagnose non crank. Batteries flat and boiled dry. Steal batteries from offline 20 tonner and fit to truck. Test charge rate ok. Wash all acid off truck. Put back online. order new batteries. Pick up new batteries.</p> <p>Refit Battery to unit, Refit ancillary items,</p> |
| 1605296 | 16500hr II 500hr Service | GOSMOND | 12/03/2024 | Internal | 16475.0 | \$0.00 | <p>Fit new batteries. Test ok. Put back online. Steam clean equipment as necessary.</p> <p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p> |
| 1601985 | 16250hr II 250hr Service | GOSMOND | 26/02/2024 | Internal | 16274.0 | \$0.00 | <p>Clean truck. Perform 16500hr pm service. Topup trans and hydraulic oils. Put back online. Steam clean equipment as necessary.</p> <p>250hr Service</p> <p>Clean truck. Perform 16250hr pm service. Top up transmission. Put back online.</p> |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|---|--|------------|--------------------------------|----------|--------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1596311 | Brake Issue | GOSMOND | 26/02/2024 | Internal | 16275.0 | \$0.00 | <p>Carry out Inspection and Diagnosis of Brake System</p> <p>carry out brake pressure test,found brake pump not stroking up,remove and check unloader valve,remove brake manifold clean,inspect reseal,refit,test,solenoid for resistance and voltage,could not detrmine fault.</p> <p>Check/Inspect/Diagnose Hydraulic Tilt Valve Section and test operation,</p> <p>Reseal Hydraulic Valve Section as necessary ,</p> <p>Continue with diagnosis. Eventually found blocked 'g' orifice in brake block. Cleanout and reassemble. Test ok. Put back online.</p> <p>Remove pirority valve and reseal. Test ok. Put back online</p> <p>Reseal Hydraulic Control Valve as necessary ,</p> |
| 1603234 | Complete mast swap | BIG TRUCK SA | 23/02/2024 | Internal | 15178.0 | \$0.00 | <p>Check/Inspect/Diagnose Cylinder</p> <p>Investigate oil sample result. Take new sample to rule out contamination. Lhs tilt cylinder dtarting to weep. Maybe the cause. Put back online.</p> |
| 1602513 | Inspect hydraulic system - abnormal reading | GOSMOND | 21/02/2024 | Internal | 16275.0 | \$0.00 | |
| 1594582 | 16000hr II 2000hr Service | GOSMOND | 8/02/2024 | Internal | 16019.0 | \$0.00 | <p>Steam clean equipment as necessary.</p> <p>2000hr Service</p> <p>Clean truck. Perform 16000hr pm service. Top up coolant.</p> <p>Calibrate trans. Adjust inching. Check wheel bearings. Put back online.</p> |
| 1596310 | Repair aircon | GOSMOND | 29/01/2024 | Internal | 15908.0 | \$0.00 | <p>Repair Air Conditioner as necessary ,</p> |
| 1588039 | 15750hr II 250hr Service | BIG TRUCK SA | 16/01/2024 | Internal | 15758.0 | \$0.00 | <p>Clean out all cores. Test ok. Put back online.</p> <p>Steam clean equipment as necessary.</p> <p>Clean truck. Shane did rest of service.</p> <p>250hr Service</p> <p>carry out 250hr service</p> |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|---|--|------------|--------------------------------|----------|--------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1584941 | 15500hr II 500hr Service | BIG TRUCK SA | 17/12/2023 | Internal | 15514.0 | \$0.00 | Steam clean equipment as necessary. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. |
| 1575606 | 15250 II 250hr Service | BIG TRUCK SA | 28/11/2023 | Internal | 15287.0 | \$0.00 | Clean truck. Perform 15500hr pm service. Top up hydraulic oil. Put back online. Steam clean equipment as necessary. 250hr Service |
| 1578960 | no brake pressure | SPitman | 13/11/2023 | Internal | 15154.0 | \$0.00 | carry out 250hr service,steer link/pins need replacing,steam clean. Travel to site, Carry out Inspection and Diagnosis of Brake System Check/Inspect/Diagnose Hydraulic Tilt Valve Section and test operation, Unit still has issue with brake pressure warning light and alarm going off,unable to test brake pressure due to not having any testing equipment,removed charging valve and cleaned,unit worked ok for a short time then fault returned,may have a faulty charging valve. could not fault,unable to check brake pressure no testing equipment Adjust Accumulator Pressure |
| 1578818 | H15947 - CALLOUT - BRAKE PRESSURE ALARM GOING OFF | 511 Planning A | 12/11/2023 | Internal | 15152.0 | \$0.00 | checked unloader valve orings,checked brake pressure and accumulator charge pressure,adjusted to spec,tested,could not fault. Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, After hours call out unit has brake pressure waring alarm on and wont go off.diagnose brake fault,checked wiring to pressure sensor,cleaned and reseated,tested could not fault. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|--|------------|--------------------------------|----------|--------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1577331 | diagnose fault codes E0197/E0235 | GOSMOND | 6/11/2023 | Internal | 15134.0 | \$0.00 | Top up cooling system, Diagnose fault codes. Low coolant level. Found leak at coolant tank. Order new tank. Truck is offline. Travel to site, Repair Radiator as required, Bleed cooling system and remove air locks Steam clean equipment as necessary. Flush and Replace Cooling System Coolant Drain,flush and refill cooling sytem. |
| 1575362 | replace wheel stud | WHILL | 26/10/2023 | Internal | 15001.0 | \$0.00 | Repair Hub/s as necessary, |
| 1571546 | 15000hr II 5000hr Service | GOSMOND | 26/10/2023 | Internal | 15000.0 | \$0.00 | Replace broken rhs drive wheel studs. Put back online. Steam clean equipment as necessary. 5000hr Service Clean truck. Perform 15000hr pm service. Replace fan and a/c belts. Calibrate transmission. Adjust valve clearances. Replace diff and final drive oil. Put back online |
| 1570777 | REPLACE LEAKING RADIATOR HOSES | GOSMOND | 23/10/2023 | Internal | 14821.0 | \$0.00 | Remove and Replace Coolant Hose/s Replace both heater hoses. Refill coolant. Bleed system and check for leaks. OK.Put back online. |
| 1572450 | unit not starting - parked at drymill infeed | GOSMOND | 16/10/2023 | Internal | 14888.0 | \$0.00 | Repair Fleet Management System as required, Diagnose no cab power. FM1 module failed. Replace with VAM unit and configure. Test ok. Put back online. |
| 1567728 | 14750hr II 250hr Service | GOSMOND | 9/10/2023 | Internal | 14821.0 | \$0.00 | Steam clean equipment as necessary. 250hr Service Replace Light/s Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, |
| 1566992 | throwing engine code | GOSMOND | 22/09/2023 | Internal | 14560.0 | \$0.00 | Clean truck. Perform 14750hr pm service. Replace 4 non-working worklights. Replace broken bolt and tighten other bolt on light bracket. Put back online. Fault code e2249 Rail pressure less than commanded. Filters changed the other day so ok. Check for restriction in lines. Fount bug in fitting to primary filter head. Cleaned and tested. OK. Put back online. |
| 1566326 | broken wheel nuts | GOSMOND | 20/09/2023 | Internal | 14536.0 | \$0.00 | Repair Fuel Line as necessary, Repair Hub/s as necessary, Replace broken wheel studs lhs drive. Put back online. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|--|------------|--------------------------------|----------|--------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1566080 | FORKTRACK FAULT | GOSMOND | 20/09/2023 | Internal | 14536.0 | \$0.00 | Repair Attachment as necessary, |
| 1554919 | FURTHER WORKS , REPLACE HOSES UNDER CAB INSPECT TRANS COOLER | GOSMOND | 20/09/2023 | Internal | 14536.0 | \$0.00 | Remove bypass and test. ok. Put back online. Replace Hydraulic Hose/s and ancillary items, Remove steer hoses and get new ones made. Replace 3 other under cab hoses. Order parts. Put back online awaiting further parts. Replace Steering Box, Replace leaking HMU. Test ok. Put back online. Replace Transmission Oil Cooler, Replace leaking trans cooler. Put back online. |
| 1561765 | 14500hr II 500hr Service | BIG TRUCK SA | 19/09/2023 | Internal | 14536.0 | \$0.00 | Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Steam clean equipment as necessary. Clean truck. Perform 14500hr pm service. Put back online. |
| 1563120 | BROKEN WHEELSTUDS | GOSMOND | 8/09/2023 | Internal | 14335.0 | \$0.00 | Repair Hub/s as necessary, |
| 1555977 | 14250hr II 250hr Service | GOSMOND | 4/09/2023 | Internal | 14262.0 | \$0.00 | Replace broken wheel stud lhs drive. Put back online. Steam clean equipment as necessary. 250hr Service Clean truck. Perform 14250hr pm service. Adjust a/c belt. Put back online. |
| 1556304 | hydraulic leak - same as last time | STRIGG | 15/08/2023 | Internal | 14106.0 | \$0.00 | Travel to site, Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, travel to tarpena , check hyd oil leak ,repair oil leak , clean down and check |
| 1551617 | 14000hr II 2000hr Service | GOSMOND | 8/08/2023 | Internal | 14023.0 | \$0.00 | Steam clean equipment as necessary. 2000hr Service Clean truck. Perform 14000hr pm service. Flush trans and fill with Dexron 3. Calibrate trans. Check wheel bearings. Put back online. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|---|--|------------|--------------------------------|----------|--------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1550205 | INVESTIGATE GREASE SYSTEM | GOSMOND | 18/07/2023 | Internal | 14941.0 | \$0.00 | Grease All Points on Unit, Diagnose error code E25 in greaser. Greaser motor failed. Order new unit. |
| 1544871 | 13750hr II 250hr Service | GOSMOND | 18/07/2023 | Internal | 13730.0 | \$0.00 | Fit new greaser unit and test. OK. Put back online. Steam clean equipment as necessary. 250hr Service Repair Hub/s as necessary, Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, Clean truck. Complete 13750hr pm service. Adjust a/c belt. Replace broken rhs drive wheel stud. Diagnose cameras not working. Found blown fuse. Replaced and tested. ok. Put back online. |
| 1548026 | ALLOCATE PARTS COST - TRANSMISSION FROM JOB 1543656 | 511 Planning C | 10/07/2023 | Internal | 13560.0 | \$0.00 | ALLOCATE PARTS COST – TRANSMISSION FROM JOB 1541614 |
| 1543799 | Fit stiffner plate and wheel stud breakage | GOSMOND | 22/06/2023 | Internal | 13471.0 | \$0.00 | Repair Hub/s as necessary, Replace broken wheel stud rhs drive and fit stiffner plate.Put back online. |
| 1538149 | 13500hr II 500hr Service | GOSMOND | 22/06/2023 | Internal | 13560.0 | \$0.00 | Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Perform 13500hr pm service. Change diff and final drive oil. Put back online. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|---------------------------|--|------------|--------------------------------|----------|--------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1541614 | Transmission failure | GOSMOND | 14/06/2023 | Internal | 13471.0 | \$0.00 | <p>Carry out Inspection and Diagnosis of Transmission</p> <p>Diagnose fault code. Transmission slipping. Clean and put in the shed ready for replacement.</p> <p>Remove ancillary items and Transmission, Strip, Inspect and report,</p> <p>Remove transmission.</p> <p>Remove transmission.</p> <p>Travel to site,</p> <p>Replace Transmission,</p> <p>Refit Transmission and ancillary items,</p> <p>Finish up job. Fill trans and hyd with oil. Bleed pumps and calibrate transmission.</p> <p>Steam clean equipment as necessary.</p> |
| 1537718 | Trans fault code showing | GOSMOND | 29/05/2023 | Internal | 13250.0 | \$0.00 | <p>Complete job and cleanup. Fit failed trans to pallet. Put back online.</p> <p>Carry out Inspection and Diagnosis of Transmission</p> <p>Fault code t1110 trans filter blocked. Remove filter and fit new one. Test ok. Put back online. Cut filter open and media is full of clutch material. Trans will fail soon.</p> |
| 1536834 | 13250hr II 250hr Service | GOSMOND | 29/05/2023 | Internal | 13250.0 | \$0.00 | <p>Steam clean equipment as necessary.</p> <p>250hr Service</p> <p>Clean truck. Perform 13250hr pm service. Put back online.</p> |
| 1530990 | 13000hr II 1000hr Service | BIG TRUCK SA | 11/05/2023 | Internal | 13001.0 | \$0.00 | <p>Steam clean equipment as necessary.</p> <p>1000hr Service</p> <p>Clean truck. Perform 13000hr pm service. Replace missing grase nipple in trans end spider assembly. Put back online.</p> |
| 1530963 | Stiffener plates | 511 Planning C | 28/04/2023 | Internal | 12738.0 | \$0.00 | |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|--|------------|--------------------------------|----------|--------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1529714 | 12250hr II 250hr Service | GOSMOND | 24/04/2023 | Internal | 12738.0 | \$0.00 | Steam clean equipment as necessary. 250hr Service Clean truck. Perform 12250hr pm service. Replace rear worklight. Repair grease line to chain sheeve. Put back online. |
| 1525511 | Lift chains | GOSMOND | 3/04/2023 | Internal | 13001.0 | \$0.00 | Adjust Lift Chain to correct specification, Checked chains on 12500hr pm service and need replacing. Order new lift chains. Replace Lift Chain, |
| 1525510 | Wheel studs | GOSMOND | 3/04/2023 | Internal | 12475.0 | \$0.00 | Cut new chains to length. Remove worn chains and fit new ones. Adjust chains and hoses. Put back online. Repair Hub/s as necessary, |
| 1524181 | 12500 II 500hr service Hyster Bladed Truck C236 - 500hr Service Kit. 0500 Hour Service | GOSMOND | 3/04/2023 | Internal | 12475.0 | \$0.00 | Found 4 broken wheel studs on pm service. Have to replace 8 as per Tharala instruction. Paint new studs red. Put back online. Steam clean equipment as necessary. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. |
| 1523611 | Will not start | GOSMOND | 27/03/2023 | Internal | 12402.0 | \$0.00 | Clean Truck. Perform 12500hr pm service. repair and bolt rhs drive mudflap back on. Put back online. Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, Replace Transmission Control Lever, Diagnose no crank. Blowing trans fuse. Check wiring unable to find reason for dead short. Put back online. Stopped again after 5 mins. Now won't go backwards. T0102 code. Replace trans shift lever and find wiring shorting out at lever. Repair wiring and reassemble truck. Put back online. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|--|------------|--------------------------------|----------|--------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1522215 | Low brake pressure | GOSMOND | 21/03/2023 | Internal | 12402.0 | \$0.00 | <p>Repair Hydraulic Hose/s as necessary,</p> <p>Low brake pressure waring light on. Test pressures ok. Replace sensor. Test ok. Ordered from pirtek accumulator hose as is weeping.</p> <p>Replace Hydraulic Hose/s and ancillary items,</p> <p>Replace accumulator charge hose. Top up hyd. oil. Test ok. Put back online.</p> <p>Steam clean equipment as necessary.</p> |
| 1519246 | 12250 II 250hr service 0250 Hour Service | GOSMOND | 21/03/2023 | Internal | 12328.0 | \$0.00 | <p>250hr Service</p> <p>Adjust and Retention Steer Wheel Bearings</p> <p>Clean truck. Perform 12250hr pm service. Adjust lhs steer wheel bearing. Replace worklight on mast. Put back online.</p> |
| 1521828 | Unit wont crank | GOSMOND | 20/03/2023 | Internal | 12310.0 | \$0.00 | <p>Repair Starter Circuit as required,</p> <p>Non crank. Checked starter motor OK. Bypass forktrack system OK. Check wiring OK. Transmission wont communicate with tablet. Found blown trans fuse. Check, now cranks and starts. Put back together and put back online.</p> |
| 1517688 | Broken wheel studs | GOSMOND | 1/03/2023 | Internal | 12055.0 | \$0.00 | <p>Repair Hub/s as necessary,</p> <p>Replace broken wheel studs. Replaced three lhs, seven rhs. All painted green. Put back online.</p> |
| 1513606 | 12000 II 3000hr service | GOSMOND | 23/02/2023 | Internal | 12055.0 | \$0.00 | <p>Steam clean equipment as necessary.</p> <p>2000hr Service</p> <p>Clean truck. Perform 12000hr pm service. Change diff and final drive oils. Adjust a/c belt. Replace failed rhs upper cab worklight.</p> |
| 1507418 | 11750 II 250hr service 0250 Hour Service | GOSMOND | 3/02/2023 | Internal | 11747.0 | \$0.00 | <p>Finish off service. Put back online.</p> <p>Steam clean equipment as necessary.</p> <p>250hr Service</p> <p>Clean truck. Perform 11750hr pm service. Put back online.</p> |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|---|--|------------|--------------------------------|----------|--------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1508369 | Replace worn seat base | GOSMOND | 19/01/2023 | Internal | 11605.0 | \$0.00 | Repair Seat as necessary, Remove worn out cushion. Change seat switch as wiring was different. Fit new seat cushion. Test ok. Put back online. |
| 1506472 | Faulty greasing system | GOSMOND | 10/01/2023 | Internal | 11540.0 | \$0.00 | Grease All Points on Unit, Greaser reporting e11 fault code. Fill up grease pot. Bleed lines. Run system and check for grease at all points. OK. Put back online. |
| 1500652 | 11500 II 500hr service | GOSMOND | 10/01/2023 | Internal | 11540.0 | \$0.00 | Steam clean equipment as necessary. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. |
| 1503863 | Front wiper will not turn off | GOSMOND | 23/12/2022 | Internal | 11888.0 | \$0.00 | Clean truck. Perform 11500hr pm service. Tighten leaking mast attachment return line. Top up transmission. Put back online. Repair Windscreen Wiper as necessary, Diagnose fault with front wiper. Motor and switch ok. Timer relay u/s. Replace and test ok. Put back online. |
| 1499587 | Replace alternator | GOSMOND | 7/12/2022 | Internal | 10821.0 | \$0.00 | |
| 1499161 | Broken wheel studs | GOSMOND | 5/12/2022 | Internal | 11258.0 | \$0.00 | Repair Hub/s as necessary, Replace 6 rhs drive wheel studs and 3 lhs drive wheel studs. |
| 1490654 | 11250 II 250hr service 0250 Hour Service | GOSMOND | 5/12/2022 | Internal | 11258.0 | \$0.00 | Steam clean equipment as necessary. 250hr Service Clean truck. Perform 10250hr pm service. Put back online. |
| 1498717 | Missed Invoice from job 1468515 | 511 Planning B | 2/12/2022 | Internal | 10765.0 | \$0.00 | |
| 1491866 | Replace leaking trans cooler | GOSMOND | 8/11/2022 | Internal | 11147.0 | \$0.00 | Notice leaking trans cooler on turbo job. Order parts Remove ancillary items and Transmission Oil Cooler, Inspect and report, Refit Transmission Oil Cooler and ancillary items, Replace leaking transmission cooler. Test run ok. Top up trans fluid and hyd oil. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|--|------------|--------------------------------|----------|----------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1491597 | Turbo blown | GOSMOND | 7/11/2022 | Internal | 11148.0 | \$0.00 | Replace Turbo, Diagnose low power. Unable to hear turbo. Remove air inlet hose. Turbo shaft bent no boost. Remove turbo and intercooler. Pack up intercooler to go to be cleaned. Fit new turbo. Still awaiting return of intercooler. Fit up new intercooler. Finish all lines and test. ok. Put back online. |
| 1490286 | Replacement hoses | 511 Planning C | 2/11/2022 | Internal | 10357.0 | \$0.00 | |
| 1489919 | Broken wheel studs | GOSMOND | 31/10/2022 | Internal | 11047.0 | \$0.00 | Repair Hub/s as necessary, Replace 2 x studs rhs drive. Had to use used studs as no new ones in stock. Put back online. Steam clean equipment as necessary. |
| 1483103 | 11000 II 1000hr service Hyster Bladed Truck C236 - 1000hr Service Kit. 1000 Hour Service | 511 Planning B | 31/10/2022 | Internal | 11047.0 | \$0.00 | 1000hr Service Clean truck. Perform 11000hr pm service. Put back online. |
| 1488823 | Front wiper insert | GOSMOND | 26/10/2022 | Internal | 1612.0 | \$0.00 | Replace Windscreen Wiper, Replace both wiper blades. Check for adjustment ok. Put back online. |
| 1482814 | Hydraulic oil leak | GOSMOND | 30/09/2022 | Internal | 10823.0 | \$0.00 | Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Diagnose oil leak. Blown oring on lhs lift cylinder fitting. Clean and dismantle. Replace oring from kit. Check oil level ok. Test ok. Put back online. |
| 1482673 | Continuation on from 1471057 Camera and reverse radar not working | GOSMOND | 30/09/2022 | Internal | 10821.0 | \$0.00 | Repair Attachment as necessary, Diagnose fault with radar system. Set can protocol to 6 and setup radar camera overlays to 12 and 3. Switched the keyboard buzzer on and volume to 100. Test ok. Put back online. |
| 1479928 | Customer Damage - Hydraulic suction hole | GOSMOND | 16/09/2022 | External | 10850.0 | \$842.96 | Oil leak from rear pump suction hose. Appears to have small puncture in the hose. Make a temp patch over the hose and order a replacement one. Inpect temp repair. Still working great. Will change suction hose at next hyd oil change. Put back online |
| 1479927 | Broken wheel studs | GOSMOND | 16/09/2022 | Internal | 10750.0 | \$0.00 | Repair Hub/s as necessary, Replace broken wheels studs. Put back online. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|---|--|------------|--------------------------------|----------|--------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1475609 | 10750 II 250hr service 0250 Hour Service | 511 Planning B | 16/09/2022 | Internal | 10750.0 | \$0.00 | Steam clean equipment as necessary. 250hr Service Clean truck. Perform 10750 hr pm service. Adjust a/c belt. Put back online. Repair Hub/s as necessary, |
| 1477099 | Broken wheel stud | GOSMOND | 5/09/2022 | Internal | 10682.0 | \$0.00 | Replace one broken wheel stud RHS drive. Put back online. Remove and Replace Coolant Hose/s |
| 1476974 | Leaking hydraulic fluid from font of machine | GOSMOND | 5/09/2022 | Internal | 10682.0 | \$0.00 | Steam clean equipment as necessary. Diagnose oil leak. Actually coolant leak. Shorten up heater hose and refit. Fill with coolant. Test no leaks. Top up hyd oil. Reroute undercab hoses. Clean up leaked coolant from trans.cab etc. Put back online. Repair Hub/s as necessary, |
| 1473300 | Broken wheel stud | GOSMOND | 19/08/2022 | Internal | 10518.0 | \$0.00 | Replace broken wheel stud RHS drive. Put back online. Steam clean equipment as necessary. |
| 1467004 | 10500 II 500hr service Hyster Bladed Truck C236 - 500hr Service Kit. 0500 Hour Service | 511 Planning A | 14/08/2022 | Internal | 10518.0 | \$0.00 | Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Clean truck. Perform 10500hr pm service. Put back online. |
| 1471057 | Camera and reverse radar not working | GOSMOND | 10/08/2022 | Internal | 10685.0 | \$0.00 | Repair Attachment as necessary, Order faulty camera moniter. Diagnose no radar system. Check power and wiring ok. Identify all components and trace out circuit. Suspect radar interface box faulty. Order new box. |
| 1468515 | Oil leak under the cab | GOSMOND | 1/08/2022 | Internal | 10750.0 | \$0.00 | Steam clean equipment as necessary. Repair Hydraulic Hose/s as necessary, Replace Hydraulic Hose/s and ancillary items, Diagnose oil leak. Suction hose leaking. Order new hose assy. Found hard and cracked steering hoses. Replaced them as well. Perform temp fix to get back online. Test ok. Clean truck and put back online. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|---|--|------------|--------------------------------|----------|--------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1468318 | Lights not working | GOSMOND | 29/07/2022 | Internal | 10281.0 | \$0.00 | Repair Light Circuit as required, Diagnose no mast lights. One light flashing dimly. Check for rubs and breaks in the loom. Found corrosion in plug. Replaced plug and tested ok. Put back online. |
| 1468167 | Fortrack fault | GOSMOND | 28/07/2022 | Internal | 10260.0 | \$0.00 | Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, Fault in forktrack. When timing out not triggering the idle timer thus truck never stops. Try another fm1 module, no change. Check all relays ok. Found fault in wiring configuration. Rectify and test. OK. Put back online. |
| 1468026 | Replace broken wheel stud | GOSMOND | 28/07/2022 | Internal | 10260.0 | \$0.00 | Repair Hub/s as necessary, Remove and replace 2 broken wheel studs rhs drive. Tension up and put back online. |
| 1464319 | 10250 II 250hr service 0250 Hour Service | 511 Planning A | 28/07/2022 | Internal | 10260.0 | \$0.00 | Steam clean equipment as necessary. 250hr Service |
| 1463291 | Additional Labour for 10,000hr Service | GOSMOND | 13/07/2022 | Internal | 10169.0 | \$0.00 | Clean truck. Perform 10250hr pm service. Top up hyd oil. Put back online. Steam clean equipment as necessary. Repair Seat as necessary, Repair Air Conditioner as necessary, Replace Light/s Clean and re-pack Steer Wheel Bearings, Clean truck. Replace missing/loose bolts in seat base. Order new seat belt. Replace a/c belt. Replace failed RHS guard worklight. Organise Trident to remove steer wheels. Start to remove steer hubs to check bearings. Remove both steer hubs and clean, inspect, repack bearings. Fit new seals and refit to truck. Clean up and pack up. Still waiting for replacement seat belt but put back online. Fit Seat Belt, Replace worn seat belt. Put back online. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|---|--|------------|--------------------------------|----------|--------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1463296 | Faulty Side Shift Valve Module | GOSMOND | 6/07/2022 | Internal | 10102.0 | \$0.00 | Repair Hydraulic Control Valve as necessary, Order parts. Replace Hydraulic Control Valve, Pickup new part. Remove failed valve and fit new one. Test ok. Put back online. Repair Hub/s as necessary, |
| 1462100 | Broken Wheel studs | GOSMOND | 30/06/2022 | Internal | 9982.0 | \$0.00 | Found 3 broken wheel studs on service. Replace 3 broken wheel studs RHS drive. Put back online. Steam clean equipment as necessary. |
| 1461013 | 10000 II 5000hr service. Hyster Bladed Truck C236 - 5000hr Service Kit. 5000 Hour Service | GOSMOND | 30/06/2022 | Internal | 9982.0 | \$0.00 | 5000hr Service Clean truck. Perform 10000hr pm service. Will open further work job next year. Put back online. Repair Hub/s as necessary, |
| 1460489 | Broken wheel studs | GOSMOND | 23/06/2022 | Internal | 9851.0 | \$0.00 | Replace 2 broken wheel studs RHS drive and 1 on LHS drive. Put back online. Steam clean equipment as necessary. |
| 1458572 | 9750 II 250hr service 0250 Hour Service | GOSMOND | 20/06/2022 | Internal | 9851.0 | \$0.00 | 250hr Service Clean truck. Perform 9750hr pm service. Put back online. Repair Hub/s as necessary, |
| 1456655 | Broken Wheel Studs | GOSMOND | 6/06/2022 | Internal | 9579.0 | \$0.00 | Replace 6! broken wheel studs. RHS drive. Put back online. Steam clean equipment as necessary. |
| 1454461 | 9500 II 500hr service. Hyster Bladed Truck C236 - 500hr Service Kit. 0500 Hour Service | GOSMOND | 6/06/2022 | Internal | 9579.0 | \$0.00 | Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. |
| 1451750 | Broken wheel studs | GOSMOND | 17/05/2022 | Internal | 9261.0 | \$0.00 | Clean truck. Perform 9500hr pm service. Put back online. Repair Hub/s as necessary, Replace 2 RHS drive wheel studs. Put back online. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|--|------------|--------------------------------|----------|--------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1447720 | 9250 II 250hr service. 0250 Hour Service | GOSMOND | 17/05/2022 | Internal | 9260.0 | \$0.00 | Steam clean equipment as necessary. 1000hr Service Clean truck. Start 9000hr pm service. Put back online. 250hr Service Clean truck. Perform 9250hr pm service and finish off 9000hr service from the other day. Put back online. |
| 1451188 | Side shift not working. Tagged Out. ETKT-132240 | GOSMOND | 16/05/2022 | Internal | 9410.0 | \$0.00 | |
| 1445697 | Broken Wheel Studs | GOSMOND | 19/04/2022 | Internal | 8822.0 | \$0.00 | Repair Hub/s as necessary, Replace two RHS drive and one LHS drive wheel studs. Put back online. |
| 1445481 | 9000 II 3000hr service Hyster Bladed Truck C236 - 3000hr Service Kit. 3000 Hour Service | GOSMOND | 19/04/2022 | Internal | 8822.0 | \$0.00 | Steam clean equipment as necessary. 250hr Service Clean truck. Perform 8750hr pm service. Put truck back online. |
| 1442310 | Forklift H15947 has a small oil leak on the side shift cylinder. Will show Greg. | GOSMOND | 1/04/2022 | Internal | 8664.0 | \$0.00 | Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Diagnose oil leak lhs tyne positioner cylinder. Tighten loose fitting and check others. Test ok. Clean down and put back online. |
| 1439402 | 8500hr service II 500hr type. Hyster Bladed Truck C236 - 500hr Service Kit. 0500 Hour Service | GOSMOND | 17/03/2022 | Internal | 8500.0 | \$0.00 | |
| 1436258 | H15947 - Can we pls have the A/C in forklift 15947 looked at as reported that it is blowing hot air. | GOSMOND | 17/03/2022 | Internal | 8466.0 | \$0.00 | Repair Air Conditioner as necessary, Checked a/c system. No gas in system. After discussion with Wayde it is an ongoing problem. He is ordering a new compressor to solve the leak. Regassed to get through the weekend. Put back online until new compressor can be fitted. Labour Travel to pickup compressor from Hynam.Return Remove failed compresor. Swap bracket over and fir new compressor. Vac down. Holding vac ok. Regas system and test ok. Put back online. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|--|------------|--------------------------------|----------|--------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1436504 | Broken wheel stud | GOSMOND | 4/03/2022 | Internal | 8326.0 | \$0.00 | Repair Hub/s as necessary, Replace 1 x Lhs drive wheel stud and nut. Put back online. Steam clean equipment as necessary. |
| 1432769 | Scheduled Service - 8250hr service. .0250 Hour Service | GOSMOND | 4/03/2022 | Internal | 8326.0 | \$0.00 | 250hr Service |
| 1432710 | H15947 is having issues blowing hot air again. Can this be looked at pls | WHILL | 18/02/2022 | Internal | 8050.0 | \$0.00 | Carry out 8250hr pm service. Repair Air Conditioner as necessary, Travel to site, Travelled to site and located unit. Confirmed fault and found compressor cycling excessively. Connected gauges and confirmed pressures ok. Dropped the heater box and replaced the faulty thermostat. Refitted all parts and rechecked operation. Vent temps now 6 degrees. Returned unit to service |
| 1430619 | Replace broken wheel stud on RHS drive wheel | WHILL | 9/02/2022 | Internal | 7998.0 | \$0.00 | Travel to site, Repair Wheel/s as necessary, Carry out Inspection and Diagnosis of Drive Axle Located unit. Replaced broken wheel stud and retensioned nuts |
| 1426731 | Scheduled Service - 8000hr service. .2000 Hour Service | WHILL | 9/02/2022 | Internal | 7998.0 | \$0.00 | 5000hr Service Travel to site, Steam clean equipment as necessary. 4000hr Service, Repair Air Conditioner as necessary, Travelled to site and located unit. Cleaned unit and carried out service as per schedule. Returned unit to service. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|--|------------|--------------------------------|----------|--------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1424369 | Air con not working & transmission service | WHILL | 31/01/2022 | Internal | 7925.0 | \$0.00 | <p>Repair Air Conditioner as necessary,</p> <p>Travel to site,</p> <p>Repair Transmission as necessary,</p> <p>Carried out transmission service and calibrated transmission. Confirmed a/c inop and compressor not cutting in. Connected gauges and found pressures low. Inspected with u/v torch and found no visible signs of leakage. Removed remaining gas out of system and charged with nitrogen. Using leak detector fluid checked for and leaks. Unable to find any. Removed nitrogen and evacuated system. Found syatem unable to hold a vacuum. Recharged system with reclaimed gas and checked with gas sniffer. Found possible suppected leak in the evaporator. Refitted all parts and ordered new parts.</p> <p>Re-gas Air Conditioner to correct specification,</p> <p>not holding vacuum. Suspected internal leakage in the condensor and evaporator. Sourced new parts. Decomissioned system and replaced the condensor. dropped the heater box and replaced the evaporator. Replaced the receiver dryer. Refitted all parts and recomissioned the system. Rechecked operation. Returned unit to service</p> |
| 1427483 | Switch issues | WHILL | 25/01/2022 | Internal | 7851.0 | \$0.00 | <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Repair Switch/es</p> <p>UNIT STOPPED IN THE MIDDLE OF THE YARD AND WONT RESTART. Located unit and confirmed fault. Found ignition comes on but no crank. Checked operation of the seat and buckle switches. Fitted known good forktrack module but still faulting. Connected tablet and checked all inputs. Found no signal coming from the parkbrake switch. Checked connections. Removed switch and cleaned up contacts. Rechecked and confirmed correct operation of the switch. Refitted all parts and rechecked operation. Unit now starting every time</p> |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|---|--|------------|--------------------------------|----------|--------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1426293 | The air conditioner on the H15947 is not working, can we please get this looked at. | WHILL | 19/01/2022 | Internal | 7925.0 | \$0.00 | <p>Repair Air Conditioner as necessary,</p> <p>Located unit and confirmed fault. Found blower fan not working. Checked fuses and operation of the fan speed switch. Tilted cab and dropped the heater box. Checked and found power to the blower fan. Sourced new parts and replaced blower motor. Refitted all parts. Rechecked operation and returned unit to service.</p> <p>Labour</p> <p>Unit returned with no a/c operation. Connected gauges and confirmed pressures correct but no cooling. Suspected partial blockage in the tx valve. Sourced parts and returned to site. Dropped heater box. Removed heater core to access. Decommissioned system. Replaced tx valve and receiver dryer. Reassembled and refitted all parts. Recommissioned system</p> |
| 1421702 | Scheduled Service - 7750hr service. .0250 Hour Service | WHILL | 10/01/2022 | Internal | 7791.0 | \$0.00 | <p>Travel to site,</p> <p>Steam clean equipment as necessary.</p> <p>250hr Service</p> |
| 1417206 | Scheduled Service - 7500hr service. .0500 Hour Service | WHILL | 13/12/2021 | Internal | 7554.0 | \$0.00 | <p>Travelled to site and located unit. Cleaned unit and carried out service as per schedule.</p> <p>Travel to site,</p> <p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p> <p>Steam clean equipment as necessary.</p> |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|--|------------|--------------------------------|----------|--------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1419026 | H15947 the A/C belts is squealing | WHILL | 6/12/2021 | Internal | 7624.0 | \$0.00 | <p>Replace Fan Belt,</p> <p>Diagnose noisy belts. Drive pulleys polished due to leaking trans cooler putting oil on them. The trans leak has been fixed by the belts are still slipping. Cleaup but no good. Order new parts to replace.</p> <p>Repair fan assembly as required.</p> <p>Removed fan and belts. Removed and replaced fan pulleys and belt tensioner. Fitted new belt and retensioned. Cleaned unit and returned to service.</p> <p>Steam clean equipment as necessary.</p> <p>Repair Air Conditioner as necessary,</p> <p>Sourced new parts. Replaced belt, pulley and tensioner. Confirmed air conditioning not working. Connected gauges. Found no gas in the system. Charged system with nitrogen. Retensioned all fitting and evacuated system. Regassed unit and added dye. System now working. Returned unit to service.</p> |
| 1418946 | Air con in forklift H15947 reported to be not working. | GOSMOND | 6/12/2021 | Internal | 7449.0 | \$0.00 | <p>Repair Air Conditioner as necessary,</p> <p>Clean truck. Diagnose A/C. Wash out condenser and evaporator. Attach gauges and suction low and high pressure low. Suspect low gas charge. No sign of leaks. Top up with gas which has dye in it to find leak . Put back online.</p> |
| 1417114 | Broken wheel studs | GOSMOND | 25/11/2021 | Internal | 7273.0 | \$0.00 | <p>Repair Hub/s as necessary,</p> <p>Replace one broken wheel stud RHS drive wheel. Put back online.</p> |
| 1415684 | Scheduled Service - 7250hr service. | GOSMOND | 25/11/2021 | Internal | 7273.0 | \$0.00 | <p>Steam clean equipment as necessary.</p> <p>250hr Service</p> <p>Clean truck. Perform 7250hr pm service. Adjust a/c belt. Put back online.</p> |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|---|--|------------|--------------------------------|----------|--------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1413889 | Parked forklift H15947 as it has a fluid leak under the cab somewhere | WHILL | 11/11/2021 | Internal | 7035.0 | \$0.00 | <p>Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,</p> <p>Remove and Replace Coolant Hose/s</p> <p>Top up cooling system,</p> <p>Steam clean equipment as necessary.</p> <p>Located unit and confirmed coolant leaking. Dropped heater box and opened up. Found failed hose spring clamp going to the heater core. Removed heater tap and thermostat. Replaced all spring clamps with worm drive clamps. Refitted all parts and refilled with coolant. Cleaned unit and rechecked operation. Returned unit to service.</p> |
| 1413750 | Replace broken wheel studs | WHILL | 10/11/2021 | Internal | 7031.0 | \$0.00 | <p>Carry out Inspection and Diagnosis of Drive Axle</p> <p>Confirmed 2 broken drive wheels studs. Removed and replaced broken studs and retensioned nuts.</p> |
| 1411439 | Scheduled Service - 7000hr service II 1000hr type. .1000 Hour Service | WHILL | 9/11/2021 | Internal | 7031.0 | \$0.00 | <p>Travel to site,</p> <p>Steam clean equipment as necessary.</p> <p>1000hr Service</p> <p>Travelled to site and located unit. Cleaned unit. Carried out service as per schedule. Returned unit to service</p> |
| 1413145 | H15947 the carriage accumulator does not seem to be working | WHILL | 8/11/2021 | Internal | 6995.0 | \$0.00 | <p>Repair Accumulator as necessary,</p> <p>Located unit and checked operation. Connected gauges and adjusted accumulator pressure to 500psi. Returned unit to service..</p> |
| 1411563 | The side shift and tyne positioner functions are not working | WHILL | 1/11/2021 | Internal | 6859.0 | \$0.00 | <p>Travel to site,</p> <p>Check/Inspect/Diagnose Cylinder</p> <p>Repair Attachment as necessary,</p> <p>Travelled to site and located unit. Confirmed no sidedhif ofr tine positioner. Plugged in tablet and checked inputs into the controller. Confirmed correct inputs. Lubricated up tine slides and pins and rechecked operation. Functions now working. Returned unit to service.</p> |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|--|------------|--------------------------------|----------|--------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1406620 | Scheduled Service - 6750hr service II 250hr type. .0250 Hour Service | GOSMOND | 26/10/2021 | Internal | 6820.0 | \$0.00 | 250hr Service Steam clean equipment as necessary. Clean truck. Perform 6750hr pm service. Cleanup after job. Put back online. Carry out Inspection and Diagnosis of Transmission |
| 1408550 | The forklift is in the old reman shed parked up because it would not go into gear . Also the driver has told me that when he puts the park brake on it makes a big clunking noises | WHILL | 18/10/2021 | Internal | 6795.0 | \$0.00 | Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, After lengthy diagnosis fault was found to be loose connection on back of hydraulic isolation switch. Suspect cause is all the extra wiring which has been jammed in the side console. Put back online. |
| 1407898 | Ignition switch faulty | GOSMOND | 13/10/2021 | Internal | 6820.0 | \$0.00 | Repair Switch/es Repair Starter Circuit as required, Repair Ignition Circuit as required, Diagnose non crank. Problem solved as part of solving problem with the no drive issue on job number 1408550. Put back online. |
| 1407895 | Repalce broken wheel studs x 3 | GOSMOND | 13/10/2021 | Internal | 6667.0 | \$0.00 | Repair Hub/s as necessary, Replace 1 RHS drive wheel stud. Replace 2 LHS drive wheel stud. Put back online. |
| 1407894 | Repair oil leak from transmission cooler | GOSMOND | 13/10/2021 | Internal | 6671.0 | \$0.00 | Labour Travel to site, Steam clean equipment as necessary. Replace Transmission Oil Cooler, Trans cooler booked out to previous job. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|--|------------|--------------------------------|----------|--------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1391862 | UNIT FAULTING LOW ENGINE OIL PRESSURE | GOSMOND | 11/10/2021 | Internal | 5568.0 | \$0.00 | Carry out Inspection and Diagnosis of Electrical System Diagnose report of low oil pressure. No codees in dash. Oil level ok. Get Cummins tech to see if any codes in the engine ecm. No codes. Verify that low oil pressure engine protection is on. Correct. Do cm as suspect dash display faulty. Repair Main Electrical Control Panel as necessary, Exhausted options with CM Incident: 210728-000860. Order new module. Repair Seat as necessary, |
| 1406718 | Seat base worn out | GOSMOND | 8/10/2021 | Internal | 6672.0 | \$0.00 | Order part Labour Travel to site, |
| 1405080 | Broken wheel stud LHS | GOSMOND | 30/09/2021 | Internal | 6521.0 | \$0.00 | Replace worn out seat base. Ok. Repair Hub/s as necessary, |
| 1405079 | Fork Track not communicating | GOSMOND | 30/09/2021 | Internal | 6345.0 | \$0.00 | Replace broken wheel stud LHS drive. Put back online. Carry out Inspection and Diagnosis of Telemetry System Test with new antenna, still no good. Order and fit new fm1 module. Test ok. Put back online. |
| 1402600 | Scheduled Service - 6500hr service II 500hr type. .0500 Hour Service | GOSMOND | 30/09/2021 | Internal | 6521.0 | \$0.00 | Steam clean equipment as necessary. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. |
| 1403630 | Hydraulic Oil Leak | GOSMOND | 22/09/2021 | Internal | 6440.0 | \$0.00 | Clean truck. Perform 6500hr pm service. Put back online. Remove ancillary items and Hydraulic Hose/s, inspect and report, Labour Refit Hydraulic Hose/s and ancillary items, Diagnose oil leak. Remove brake acc. charging hose. Travel to repairer and get new hose made. Return and refit to truck. Top up hyd. oil. Put back online. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|--|------------|--------------------------------|----------|--------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1402795 | Non start | GOSMOND | 17/09/2021 | Internal | 6380.0 | \$0.00 | Repair Starter Circuit as required, Diagnose non crank. Checked wiring to seat switch and ignition switch. Reseated relays. Test ok now. Will monitor to see if problem reappears. |
| 1402395 | The heater is not working | WHILL | 16/09/2021 | Internal | 7031.0 | \$0.00 | Repair Switch/es Remove ancillary items and Solenoid from unit. Repair Solenoid as necessary and refit to unit, Refit ancillary items, Diagnose poor heaters. Check wiring and lines. Suspect heater tap or activating motor failed. Order parts for repair. Put back online. Labour Repair Air Conditioner as necessary, Sourced parts. Tilted cab and opened heater box. Removed and replaced heater tap. Cleaned out evaporator and heater core. Refitted all parts. Rechecked operation and returned to service. |
| 1401365 | Replace worm out RHS mudflap | GOSMOND | 10/09/2021 | Internal | 6256.0 | \$0.00 | Carry out Repairs to Mud Flaps, Make new mudflap. Remove worn out one and fit new rhs drive. Customer supplied rubber for mudflap. Put back online. |
| 1401364 | 2 Broken RHS drive wheel studs | GOSMOND | 10/09/2021 | Internal | 6256.0 | \$0.00 | Repair Hub/s as necessary, Replace 2 broken drive wheel studs Rhs drive. Put back online. |
| 1398460 | Scheduled Service - 6250hr service II 250hr type. .0250 Hour Service | GOSMOND | 10/09/2021 | Internal | 6255.0 | \$0.00 | Steam clean equipment as necessary. 250hr Service Clean truck. Perform 6250hr pm service. Repair worn grease line to king pin spindle. Put back online. |
| 1397637 | Broken Wheel Studs | GOSMOND | 23/08/2021 | Internal | 5989.0 | \$0.00 | Repair Hub/s as necessary, Replace two broken wheel studs LHS drive. Put back online. |
| 1395676 | Parts On order as at 20.9.2021 Nacco O/S Scheduled Service - 6000hr service II 3000hr type. .3000 Hour Service Completed but waiting on parts as at 8.9.21 | GOSMOND | 23/08/2021 | Internal | 5998.0 | \$0.00 | Steam clean equipment as necessary. 2000hr Service Clean truck. Perform 6000hr pm service. Change diff and final drive oils. Replace trans oil and filter. Calibrate transmission. Put back online. Cleanup. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|---|--|------------|--------------------------------|----------|--------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1396506 | Replace Tyne Carrier Bushes | GOSMOND | 18/08/2021 | Internal | 5943.0 | \$0.00 | Steam clean equipment as necessary. Replace Sideshift Bushes/Bearings, Clean truck. Remove worn out tyne carrier bushes and fit new ones. Replace LHS mudflap. Tyne bushes booked out on previous job. Mudflap supplied by customer. Put back online. |
| 1389446 | Scheduled Service - 5750hr service II 250hr type. .0250 Hour Service | GOSMOND | 3/08/2021 | Internal | 5798.0 | \$0.00 | Clean truck. Perform 5750hr pm service. Put back online. |
| 1392082 | Wheel stud u/s | GOSMOND | 28/07/2021 | Internal | 5649.0 | \$0.00 | Repair Hub/s as necessary, Clean truck. Replace one broken wheel stud LHS drive. Put back online. |
| 1385082 | Scheduled Service - 5500hr service II 500hr type. Hyster Bladed Truck C236 - 500hr Service Kit. 0500 Hour Service | GOSMOND | 12/07/2021 | Internal | 5500.0 | \$0.00 | Steam clean equipment as necessary. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Adjust Lift Chain to correct specification, Clean Truck. Perform 5500hr pm service. Tighten rhs lift chain. Replace loose/worn bolts in over the reel hose bracket and adjust tension on wiring loom. Put back online. |
| 1386707 | OIL PRESSURE LIGHT ON | GOSMOND | 2/07/2021 | Internal | 5500.0 | \$0.00 | Carry out Inspection and Diagnosis of Electrical System Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, Diagnose low oil pressure alarm. All ok. Monitered the problem since last friday and no reported instances of it reoccurring. Put back online. |
| 1384924 | TYNE FP BUSHES U/S AND TRANS OIL COOLER LEAKING | GOSMOND | 24/06/2021 | Internal | 5075.0 | \$0.00 | Repair Transmission Oil Cooler as necessary , |
| 1384780 | BROKEN WHEEL STUDS | GOSMOND | 23/06/2021 | Internal | 5261.0 | \$0.00 | Order parts for repair. Repair Hub/s as necessary, |
| 1382347 | Scheduled Service - 5250hr service II 250hr type. .0250 Hour Service | GOSMOND | 22/06/2021 | Internal | 5261.0 | \$0.00 | Replace one broken wheel stud RHS drive and one LHS drive. Tension and put back online. Steam clean equipment as necessary. 250hr Service Clean truck. Perform 5250hr pm service. Put back online. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|--|------------|--------------------------------|----------|--------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1376563 | Scheduled Service - 5000hr service II 1000hr type. .1000 Hour Service | WHILL | 7/06/2021 | Internal | 5021.0 | \$0.00 | 5000hr Service Steam clean equipment as necessary. Replace Steer Wheel Studs and Nuts, Carred out 5000hr service as per schedule. Replaced both alt. and ac belts. Retensioned wheel nuts and found 3 broken studs. Replaced broken studs and nuts. Returned unit to service. Travel to site, Carried out 5000hr service as per schedule. Found multiple broken drive wheel stud. Replaced broken studs Steam clean equipment as necessary. |
| 1371920 | Scheduled Service - 4750hr service II 250hr type 0250 Hour Service | GOSMOND | 10/05/2021 | Internal | 4766.0 | \$0.00 | 250hr Service Clean truck. Perform 4750hr pm service. Put back online. Steam clean equipment as necessary. |
| 1366720 | Scheduled Service - 4500hr service II 500hr type. | GOSMOND | 16/04/2021 | Internal | 4493.0 | \$0.00 | Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Clean truck. Perform 4500hr pm service. Put back online. Steam clean equipment as necessary. |
| 1363730 | Scheduled Service - 4250hr service II 250hr type | GOSMOND | 25/03/2021 | Internal | 4263.0 | \$0.00 | 250hr Service Clean truck. Perform 4250hr pm service. Top up transmission. No leaks seen. Put back online. |
| 1365718 | REPLACE WHEEL STUDS | GOSMOND | 22/03/2021 | Internal | 4211.0 | \$0.00 | Replace Steer Wheel Studs and Nuts, Replace 4 broken lhs drive wheel studs. |
| 1365522 | LHS steer wheel bearing check/replacement | GOSMOND | 22/03/2021 | Internal | 4400.0 | \$0.00 | Replace Steer Wheel Bearings, Clean truck. Replace lhs steer wheel bearings. Cleanup and order parts. Repair Hub/s as necessary, |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|---|--|------------|--------------------------------|----------|--------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1361512 | RHS STEER WHEEL BEARING COLLAPSED | GOSMOND | 2/03/2021 | Internal | 4019.0 | \$0.00 | Travel to site, Remove ancillary items and Hub/s, Strip, Inspect and report, Travel to site. Diagnose noise in driveline. Found failed rhs steer wheel bearing. Remove wheel, locknuts and hub. Inner bearings failed. |
| 1361440 | PROACTIVE - REPLACE LHS STEER WHEEL BEARINGS | GOSMOND | 2/03/2021 | Internal | 3349.0 | \$0.00 | Replace Steer Wheel Bearings, Replace Steer Wheel Bearings, |
| 1360922 | TIGHTEN LOOSE LIFT CHAIN | GOSMOND | 26/02/2021 | Internal | 4013.0 | \$0.00 | Order parts Adjust Lift Chain to correct specification, |
| 1360828 | o/mast hose damage | GOSMOND | 26/02/2021 | Internal | 4015.0 | \$0.00 | Adjust and tighten RHS lift chain. Put back online Remove ancillary items and Hydraulic Hose/s, inspect and report, Labour Refit Hydraulic Hose/s and ancillary items, Steam clean equipment as necessary. |
| 1356070 | Scheduled Service - 4000hr service II 2000hr type | GOSMOND | 23/02/2021 | Internal | 4015.0 | \$0.00 | Diagnose hose damage. Remove all 3 hoses as have had crush damage. Travel to repairer for new hoses. Return to site and fit hoses. Clean oil off truck. Put back online Steam clean equipment as necessary. 4000hr Service, Clean truck. Perform 4000hr pm service. Clean truck. Perform 4000hr pm service. Adjust a/c belt. Test ok. Put back online. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|---|--|------------|--------------------------------|----------|--------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1353304 | Scheduled Service - 3750hr service II 250hr type. | WBRAZIL | 5/02/2021 | Internal | 3750.0 | \$0.00 | Labour Travel to site, Repair Light/s 250hr Service Repair Air Conditioner as necessary, Adjust fan belt as required Steam clean equipment as necessary. Grease unit, change engine oil and filter, sample oils for analysis. |
| 1352705 | Repair reverse alarm wiring | GOSMOND | 20/01/2021 | Internal | 3566.0 | \$0.00 | Adjust Reverse buzzer to correct specification, Repair Hydraulic Hose/s as necessary, Diagnose reverse buzzer. Working fine. Straighten the mast hoses which were twisted. Put back online. |
| 1351980 | 3 broken wheel studs | GOSMOND | 15/01/2021 | Internal | 3473.0 | \$0.00 | Repair Wheel/s as necessary, Replace 3 broken wheel studs. |
| 1350032 | Scheduled Service - 3500hr service II 500hr type .Level B Service | GOSMOND | 15/01/2021 | Internal | 3474.0 | \$0.00 | Steam clean equipment as necessary. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. |
| 1348666 | CW- Broken wheel stud on the drive wheel- tech to assess for customer damage. Tagged out. | STRIGG | 29/12/2020 | Internal | 3410.0 | \$0.00 | Clean truck. Preform 3500hr pm service. Replace Steer Wheel Studs and Nuts, Travel to site, |
| 1344701 | Scheduled Service - 3250hr service II 250hr type | GOSMOND | 14/12/2020 | Internal | 3232.0 | \$0.00 | travel to tarpeena and replace wheel studs and nuts Steam clean equipment as necessary. 250hr Service Replace Switch/es |
| 1343279 | CW - Loose mast chain - Tagged out | GOSMOND | 30/11/2020 | Internal | 3024.0 | \$0.00 | Clean truck. Perform 250hr pm service. Replace failed air filter restriction sensor. Put back online. Adjust Lift Chain to correct specification, Adjust and tighten rhs lift chain. Put back online |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|---|--|------------|--------------------------------|----------|---------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1338383 | Scheduled Service - 3000hr service II 3000hr type. | GOSMOND | 30/11/2020 | Internal | 3024.0 | \$0.00 | Labour Travel to site, Steam clean equipment as necessary. 3000hr Service Pick up filters. Travel to site. Clean truck. Perform 3000hr pm service. Put back online. |
| 1341730 | Air seat wont stay pumped up | GOSMOND | 23/11/2020 | Internal | 3102.0 | \$0.00 | Fill out sample bottles and cleanup after service. Repair Seat as necessary, Diagnose air seat leaking down. Found line to switch loose and leaking. Make temp fix with customer supplied parts. Order new air switch. |
| 1340922 | CW- Leaking mast hose. Parked up. | GOSMOND | 18/11/2020 | Internal | 2867.0 | \$0.00 | Replace Hydraulic Hose/s and ancillary items, Labour Diagnose oil leak on mast. Blown over the reel hose. Steal one from H15946. Fit to truck and clean up oil mess. Travel to repairer to get new hose made. |
| 1340374 | CW-Camera recorder time stamps are out. Not reading correct date/ time ect. | GOSMOND | 16/11/2020 | Internal | 2957.0 | \$0.00 | |
| 1340248 | Broken wheel stud | GOSMOND | 16/11/2020 | Internal | 2826.0 | \$0.00 | Repair Hub/s as necessary, Remove 1 broken wheel stud RHS drive and 1 broken wheel stud LHS. Fit new studs and tension. Refit indicators. Put back online |
| 1336919 | Scheduled Service - 2750hr service II 250hr type. | GOSMOND | 16/11/2020 | Internal | 2826.0 | \$0.00 | Steam clean equipment as necessary. 250hr Service |
| 1338627 | CW-Air seat keeps losing air. Parked up. | GOSMOND | 9/11/2020 | Internal | 2715.0 | \$0.00 | clean truck. Perform 2750hr pm service. Put back online Repair Seat as necessary, Diagnose air leak. Leaking at valve again. Trim hose and hold connector firmly with copper wire. Reassemble armrest and test. Ok Put back online. |
| 1338411 | Refer Job 1328015 | 511 Planning A | 6/11/2020 | External | 2957.0 | \$36.01 | |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|--|------------|--------------------------------|----------|----------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1335864 | Broken wheel stud | GOSMOND | 26/10/2020 | Internal | 2715.0 | \$0.00 | Repair Hub/s as necessary, Replace 3 broken wheel studs LHS drive wheel. The same 3 studs from j/n 1332061 from 6-10-20 again. Replace 2 broken wheel studs LHS drive wheel. One was replaced on j/n 1332061 6-10-2020. The other one was a original stud. Refit wheel nut indicators. Repair Attachment as necessary, Repair Seat as necessary, Replace missing grease fitting and replace hose. Parts from previous job. Find air leak in seat. At switch. Trim hose and reconnect to switch test ok. Put truck back online. Travel to site, Steam clean equipment as necessary. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. |
| 1335729 | CW-Grease line has come off the mast & air seat will not pump up. Parked up. | GOSMOND | 26/10/2020 | Internal | 2482.0 | \$0.00 | Travel to site. Clean truck. Perform 2500hr pm service. Repair Attachment as necessary, |
| 1332810 | Scheduled Service - 2500hr service II 500hr type. | GOSMOND | 26/10/2020 | Internal | 2485.0 | \$0.00 | Grease line to rhs mast tilt pin worn through on wheel rim. Remove failed hose and fit temporary joiner. Order parts. Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Diagnose oil leak. Stick has punched hole in 2nd hyd pump suction hose. Pump out hyd tank. Remove suction hose and shorten for temporary repair. Refit hose and fill with oil. Test ok. Put back online. Labour Find and order parts Repair Hub/s as necessary, |
| 1333322 | Repair grease line | 511 Planning A | 12/10/2020 | Internal | 2718.0 | \$0.00 | Replace 3 broken wheel studs on lhs drive. Retension lhs drive wheel studs and check rhs drive. Found 3 more broken studs. Replaced broken studs on rhs. Retension wheel studs on rhs. Refit indicators. |
| 1330337 | Repair damaged suction hose | GOSMOND | 9/10/2020 | External | 2119.0 | \$970.21 | |
| 1332061 | Replace wheel studs | GOSMOND | 6/10/2020 | Internal | 2363.0 | \$0.00 | |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|--|------------|--------------------------------|----------|------------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1327805 | Scheduled Service - 2750hr service II 250hr type. | GOSMOND | 6/10/2020 | Internal | 2264.0 | \$0.00 | Steam clean equipment as necessary. 250hr Service |
| 1331066 | CW- Front windscreen wipers not working. Still in use. | GOSMOND | 1/10/2020 | Internal | 2198.0 | \$0.00 | Clean truck. Perform 2250hr pm service. Repair Windscreen Wiper as necessary, Adjust Lift Chain to correct specification, Adjust Accumulator Pressure |
| 1326696 | High pitch noise from the motor | GOSMOND | 28/09/2020 | Internal | 2320.0 | \$0.00 | Diagnose no front wiper. Replaced blown fuse. Tightened wiper arm retaining nuts. Adjust and tighten lift chains. Check and adjust pressure in lift accumulator. Order parts for diagnostic connector. Repair fan assembly as required. Diagnose noise from engine at high idle. Fan hub bearing noisy. Standard warranty expired at 2000 hours |
| 1329869 | CW-Air leak in the seat. Still in use. | GOSMOND | 25/09/2020 | Internal | 2048.0 | \$0.00 | Replace fan hub bearing. Test ok. Put back online. Repair Seat as necessary, |
| 1328015 | CW-Unit wont engage gears. Tagged out. | GOSMOND | 21/09/2020 | External | 2198.0 | \$8,103.35 | Diagnose air leak. Found one at switch. repair coupler at switch. Test ok. Put back online. Carry out Inspection and Diagnosis of Transmission Replace Transmission Control Valve, Swap complete trans control valve from H15961 to H15947. Calibrate trans and test drive. Ok. Put back online. Labour Repair Transmission Control Valve as necessary, Order Parts Adjust Transmission Control Valve to correct specification , Repair trans valve as instructed from hyster. Found a piece of machining swarf inside valve. Cleaned out and reassembled. Refit to truck with old gaskets. Calibrate transmission ok. Mechanic GOSMOND replaced order number 200924-000391 with . |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|---|--|------------|--------------------------------|----------|--------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1327617 | Broken wheel studs | GOSMOND | 17/09/2020 | Internal | 2033.0 | \$0.00 | Repair Wheel/s as necessary, Repair Hub/s as necessary, Travel to site, Install Wheel Nut Indicators, |
| 1318980 | Scheduled Service - 2000hr service II 2000hr type | GOSMOND | 17/09/2020 | Internal | 2119.0 | \$0.00 | Retension wheel nuts and refit indicators. Steam clean equipment as necessary. 2000hr Service Clean truck. Perform 2000hr pm service. Travel to site, Repair Hub/s as necessary, |
| 1326511 | Broken Wheel Studs | GOSMOND | 11/09/2020 | Internal | 1968.0 | \$0.00 | Labour Repair Wheel/s as necessary, Found broken stud on ground in yard. Track down from which truck. Total of 4 broken studs. Remove and replace broken studs. Tighten all nuts to spec. Install Wheel Nut Indicators, |
| 1320433 | Scheduled Service - 1750hrs service II 250hr type. | GOSMOND | 31/08/2020 | Internal | 1787.0 | \$0.00 | Retension nuts and fit indicators 250hr Service Steam clean equipment as necessary. |
| 1322558 | CW - Carriage accumulator not working - Still in use | WHILL | 25/08/2020 | Internal | 1720.0 | \$0.00 | Steam clean truck. Carry out 1750hr pm service. Adjust Accumulator Pressure |
| 1320385 | Reverse buzzer is not working & idle shutt down timer is not shutting the machine down. Tagged out. | GOSMOND | 14/08/2020 | Internal | 1615.0 | \$0.00 | Repair Tyne Latch as necessary, Remove and Replace Reverse buzzer, Refit to unit, Remove tyne retaining pin. Drill out pin hole and refit with a larger bolt. Diagnose no reverse buzzer. Buzzer failed. Fit new buzzer and test. ok. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|---|--|------------|--------------------------------|----------|--------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1311590 | Scheduled Service - 1500hr service II 500hr type .Level B Service | GOSMOND | 3/08/2020 | Internal | 1460.0 | \$0.00 | Steam clean equipment as necessary. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Repair Attachment as necessary, Clean truck. Carry out 500hr pm service. Repair broken grease line to steer axle pivot. Travel to site, |
| 1317558 | Loose mast chain. Tagged out. | GOSMOND | 31/07/2020 | Internal | 1438.0 | \$0.00 | Adjust Lift Chain to correct specification, Travel to site. Rhs chain loose. Tighten upper chain anchors and adjust. |
| 1317181 | Reverse buzzer not working | GOSMOND | 29/07/2020 | Internal | 1439.0 | \$0.00 | Remove and Replace Reverse buzzer, Refit to unit, |
| 1310676 | Scheduled Service - 1250hr service II 250hr type. | GOSMOND | 14/07/2020 | Internal | 1238.0 | \$0.00 | Replace non working reverse buzzer. Test ok. Steam clean equipment as necessary. 250hr Service |
| 1310283 | Adjust steer wheel bearings | GOSMOND | 29/06/2020 | Internal | 975.0 | \$0.00 | Clean truck. Carry out 1250hr pm service. Adjust and Retention Steer Wheel Bearings |
| 1308241 | Scheduled Service - 1000hr service II 1000hr type. Level C Service. | GOSMOND | 29/06/2020 | Internal | 976.0 | \$0.00 | Check and adjust steer wheel bearings. Labour Travel to site, 1000hr Service Pickup trans filter. Travel to site. Steam clean truck. Perform 1000hr pm service. Fill out oil sample bottles. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|---|--|------------|--------------------------------|----------|------------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1309481 | CW-Broken wheel stud- LHS Tagged out. | GOSMOND | 25/06/2020 | External | 963.0 | \$1,667.87 | Remove ancillary items and Remove Drive Wheel from unit, Refit Drive Wheel, Refit ancillary items, Remove drive wheels both sides. Remove all wheel studs and flap disc all contact areas on hubs and wheels. Fit new wheelstuds. Refit wheels with new nuts and tension up. Labour Travel to site, Refit Wheel/s and ancillary items, Travel to pick up parts. travel to site. Retension drive wheel nuts. Adjust Lift Chain to correct specification, |
| 1309366 | Tighten up lift chains | GOSMOND | 24/06/2020 | Internal | 936.0 | \$0.00 | Tighten and adjust lift chains. Both sides, top and bottom loose. Refit Hydraulic Hose/s and ancillary items, |
| 1308821 | Over the reel hoses jumped off the roller | GOSMOND | 22/06/2020 | External | 920.0 | \$128.75 | Over the reel hoses run off reel. Hoses knocked off by running into shed. Refit hoses onto reel. Test adjustment ok. Put back to work. |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|--|------------|--------------------------------|----------|--------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1306626 | Issue with the bushes | GOSMOND | 15/06/2020 | Internal | 1238.0 | \$0.00 | <p>Steam clean equipment as necessary.</p> <p>250hr Service</p> <p>Carry out 750hr PM service.</p> <p>Labour</p> <p>Travel to site,</p> <p>Repair Carriage as necessary,</p> <p>Parts ferrying, various assistance, administrative tasks, parts ordering.</p> <p>Repair Tyne Latch as necessary,</p> <p>Clean truck. Weld nut on end of tyne carrier pin and remove. Find tooling does not fit properly. Return to mtg and machine tooling.</p> <p>Attempt to push bush back in. Tooling still not right. Travel to mtg and get tooling fixed. Return to site. Push bush back in and replace clip. Refit tyne carrier pin. Test ok. Put back to work.</p> |
| 1303426 | NEW SET OF TYNES | BIG TRUCK SA | 15/06/2020 | Internal | 758.0 | \$0.00 | |
| 1302900 | Scheduled Service - 750hr service II 250hr type | GOSMOND | 15/06/2020 | Internal | 1237.0 | \$0.00 | <p>Repair Sideshift as necessary,</p> <p>Diagnose clip out of groove rhs s/s bush retainer. Remove failed c clip and order new parts.</p> |
| 1302488 | CW-Broken wheel studs- tech to assess for customer damage. Tagged out | GOSMOND | 2/06/2020 | Internal | 679.0 | \$0.00 | <p>New tooling needs to be made</p> <p>Travel to site,</p> <p>Repair Wheel/s as necessary,</p> <p>Travel to site. Replace 4 broken wheel studs and nuts. Retension all nuts.</p> |
| 1301369 | Rework before unit can go in service - refer to Notes | 511 Planning D | 27/05/2020 | Internal | 657.0 | \$0.00 | |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--|--|------------|--------------------------------|----------|------------|--|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1299819 | CW - Oil leak on the mast - Parked up. | GOSMOND | 21/05/2020 | External | 542.0 | \$1,468.35 | <p>Travel to site,</p> <p>Steam clean equipment as necessary.</p> <p>Repair Hydraulic Hose/s as necessary,</p> <p>Top up Hydraulic Oil to correct level,</p> <p>Travel to site. Diagnose hydraulic oil leak. Loose t piece on lift cylinder line and o ring has blown out. Clean machine down. Remove hose and replace oring from my kit. Refit hose and top up hydraulic oil. Test ok.</p> <p>Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,</p> <p>Labour</p> <p>Repair Light/s</p> |
| 1297208 | Scheduled Service - 500hr service II 500hr type .Level B Service | GOSMOND | 21/05/2020 | Internal | 542.0 | \$0.00 | <p>Repair Revolving/Flashing/Strobe light as required, Steam clean equipment as necessary.</p> <p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p> <p>Carry out 500hr pm service. Tighten loose light bracket bolts.</p> |
| 1294502 | WTY - windscreen repair | GOSMOND | 30/04/2020 | External | 276.0 | \$96.50 | <p>Replace Windscreen,</p> <p>Assist Windscreen repairer.</p> |
| 1294501 | 250hr service Level B Service | GOSMOND | 30/04/2020 | Internal | 276.0 | \$0.00 | <p>250hr Service</p> <p>Carry out initial 250hr pm service. Change engine oil and filter. Change trans oil and filter. Change brake filter. Change diff and final drive oils.</p> |
| 1291089 | Scheduled Service - 1ST 100HR SERVICE | GOSMOND | 16/04/2020 | Internal | 115.0 | \$0.00 | <p>Labour</p> <p>100Hr Service</p> <p>Travel to parts. Carry out 100hr pm service. Tighten loose chain anchor nuts. Fit corrected spec plate.</p> |
| 1290067 | Fit Radio | 501WORKSHOP | 8/04/2020 | Internal | 16.0 | \$0.00 | |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|--------------------------------------|--|-----------|--------------------------------|----------|--------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1289861 | CW-Wont engage gear - top up hyd oil | GOSMOND | 8/04/2020 | Internal | 18.0 | \$0.00 | <p>Travel to site,</p> <p>Repair Transmission as necessary,</p> <p>Repair Wheel/s as necessary,</p> <p>Top up Hydraulic Oil to correct level,</p> <p>Travel to site. Diagnose no drive. Change direction in trans set too low. Calibrate trans and test ok. Setup speed limit to 13kmh. Retension wheel nuts. Top up hyd oil.</p> |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|----------------------------|---------------------------|--|-----------|--------------------------------|----------|--------|---|
| Owner: ADAP001 | | | | | | | |
| Equip. Code: H15947 | | Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above | | | | | |
| Make: HYSTER | | Model: H20XM-9 | | Serial No.: C236E03536T | | | |
| 1199998 | Prep for Rent; Timberlink | GOSMOND | 9/04/2019 | Cap Prep | 16.0 | \$0.00 | <p>Carry out equipment condition assessment</p> <p>Prepare For Sale - Workshop</p> <p>Refit Mast and ancillary items,</p> <p>Fit Fleet Management System as required,</p> <p>Install Radio,</p> <p>Install Light/s</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,</p> <p>Fit Speakers to Equipment,</p> <p>Remove ancillary items, prepare and Paint unit as required,</p> <p>Assist Efraim in painting and refit other attachment.</p> <p>Refit Hydraulic Hose/s and ancillary items,</p> <p>Remove ancillary items and Hydraulic Hose/s, inspect and report,</p> <p>Replace Hydraulic Hose/s and ancillary items,</p> <p>Repair Light/s</p> <p>Remove and Replace Reverse buzzer, Refit to unit,</p> <p>Refit Forks/Tynes and ancillary items,</p> <p>Repair Hydraulic Hose/s as necessary,</p> <p>Adjust Fleet Management System as required,</p> <p>Carry out New Equipment Predelivery to correct specification.</p> <p>Repair Light Circuit as required,</p> <p>Install Hi Vis Tape,</p> |

| Job No. | Description | Mechanic | Date | Job Type | Eng. Hrs | Retail | Notes |
|---------|-------------|----------|------|----------|----------|--------|-------|
|---------|-------------|----------|------|----------|----------|--------|-------|

Owner: ADAP001

Equip. Code: H15947

Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above

Make: HYSTER

Model: H20XM-9

Serial No.: C236E03536T

Install Hard Labels,
 Install Wheel Nut Indicators,
 Repair Light Bracket as required,
 Replace Engine Intake Ducting as required,
 Repair Engine Intake Ducting as required,
 Steam clean equipment as necessary.
 Prepare For Hire - Workshop
 Remove ancillary items and Forks/Tynes, Inspect and report,
 Remove ancillary items and Mast, Strip, Inspect and report,
 Travel to site,
 Repair Air Conditioner as necessary,
 Found dignostic plug inaccessible. Removed modules and relocated plug. Refitted all parts. Adjusted speeds and trans restrictions. Removed mast and cab pressurizer ready for transport. Travelled to site and refitted mast and replumbed up. Refitted and reconnected pressurizer.
 Refit Mast. Test Machine functions. Clean down.
 Adjust Accumulator Pressure

| | |
|-------------------------|--------------------|
| Equipment Total: | <u>\$20,815.34</u> |
| Customer Total: | <u>\$20,815.34</u> |