

ADAPT-A-LIFT GROUP PTY LTD

Service History Listing Active Units

Date: 19/06/2026

Time: 10:44:17AM

For Equipment Code From: H15961 To: H15961

For Customer Code From: All To: All

For Date Posted From: All To: All

For Branch Code From: All To: All

Don't Show Cost

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1827373	Oversee unit being removed from site	GOSMOND	20/05/2026	Internal	31750.0	\$0.00	Carry out equipment condition assessment
1807858	Dehire and Demobilisation	GOSMOND	15/04/2026	External	30746.0	\$1,142.40	Assistwith loading truck. Travel to site Cap off unit hydraulics and prep the day before demobilisation Travel to site Create an exclusion zone and isolate the machine Liaise with Franna to remove mast and carriage from unit Load unit for transport. Transport unit offsite. Timberlink to provide 25t Franna and Dogman. Timberlink to provide scissorlift for 2 days. Repair Seat Switch Wiring,
1789324	stuck in our yard and it wont start	GOSMOND	23/02/2026	Internal	30745.0	\$0.00	Diagnose non start. Found fault in seat belt wiring. Repaired wiring. Test ok. Put back online.
1784059	30750hr II 250hr Service	GOSMOND	23/02/2026	Internal	30745.0	\$0.00	Steam clean equipment as necessary. 250hr Service Clean truck. Perform 30750hr pm service. Tynes 47.1mm Chains 0.75%. NOTE rhs steer wheel bearings failing. Truck back online but only used as backup and will be dehiared on 27/2/2026.
1780124	30500hr II 500hr Service	GOSMOND	5/02/2026	Internal	30651.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Prep work for service tomorrow. Steam clean equipment as necessary. Clean truck. Perform 30500hr pm service. Tynes 47mm Chains 1.0%. Put back online. Replace fuel filters and air filter. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1783409	Investigate steer wheel bearing and repair failed ram support	GOSMOND	4/02/2026	Internal	30512.0	\$0.00	Adjust wheel bearings, Forktrack keypad mounting failed. Make and fit bracket to support keypad and display. RHS steer wheel excessive movement in wheel bearing. Readjust bearings. Test ok. Put back online.
1781760	Horn going off by itself	GOSMOND	29/01/2026	Internal	30746.0	\$0.00	Remove ancillary items and Horn from unit. Replace and refit Horn Button, Refit ancillary items, Replaced horn button and repaired wiring to it. Test ok. Seat leaking down again. Replace leaky valve with one from H15947. Test ok. Put back online
1780619	forklift wont start	GOSMOND	23/01/2026	Internal	30385.0	\$0.00	Check Horn ok. Finished Replace Switch/es Diagnose no crank. Ignition switch worn out. Replace with new switch. Test ok. Put back online. Repair Seat as necessary,
1778122	the seat is loosing air and going down	GOSMOND	15/01/2026	Internal	30266.0	\$0.00	Seat going flat in minutes. Diagnose air leak. Found leak at switch. Remove and trim hose to a new section. Refit and assemble. Test ok. Put back online.
1777068	error code coming up	GOSMOND	13/01/2026	Internal	30245.0	\$0.00	Remove and Replace Coolant Hose/s Top up cooling system, Truck shutting down with a low coolant alarm. Diagnose the headter tank has a crack. Remove tank and swap with one from H15947. Make a repair to the leaking tank. Refit to H15947. FFill and test ok. Put H15947 back awaiting pickup.
1770900	250hr Service	GOSMOND	26/12/2025	Internal	30302.0	\$0.00	Steam clean equipment as necessary. 250hr Service
1767588	250hr Service	GOSMOND	8/12/2025	Internal	300023.0	\$0.00	Clean truck. Perform 30250hr pm service. Chains 0.5%. Tynes 87.5mm. Put back online. Steam clean equipment as necessary. 250hr Service Clean truck. Perform 30000hr pm service. (Only did a 250hr pm as due to be dehiired soon.) Tynes 47.2mm Chains 0.5%. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1768555	been reported that there are 4 broken wheel studs on LHS steer tyre	GOSMOND	1/12/2025	Internal	29888.0	\$0.00	Repair Hub/s as necessary, Replace 5 broken steer wheel studs. NOTE studs from a previous job. Tension all other nuts. Put back online.
1766830	A/C is not working on forklift	GOSMOND	24/11/2025	Internal	29772.0	\$0.00	Repair Air Conditioner as necessary, No A/c. Diagnose issue. Found both condensor fans failed. Remove fans and fit new units. Test ok. Put back online.
1763398	29750hr II 250hr Service	GOSMOND	23/11/2025	Internal	29771.0	\$0.00	Steam clean equipment as necessary. 250hr Service
1762558	tynes are going up without operating the controls	GOSMOND	11/11/2025	Internal	29544.0	\$0.00	Clean truck. Perform 29750hr pm service. Tynes 82.1mm Chains 0.6%. Put back online. Check/Inspect/Diagnose Hydraulic Tilt Valve Section and test operation, Remove ancillary items and Hydraulic Valve Section , Strip, Inspect and report, Diagnose fault causing lift to go without being commanded. Fault code h1028 displayed. PVE Actuator in Error Mode. Work out which pve was faulting. Remove pve and check wiring, o rings etc. No fault found. Still brining on fault and red led on actuator. Order new part. Truck offline. Replace Hydraulic Valve Section,
1762001	29500hr II 500hr Service	BIG TRUCK SA	6/11/2025	Internal	29543.0	\$0.00	Pickup parts. Fit new module. Test ok. Clean up after job and put back online, Steam clean equipment as necessary. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1762075	job raised for PO to be raised as jn was posted 1761514	511 Planning C	5/11/2025	Internal	29523.0	\$0.00	wash down unit,carry out 500hr service,no fuel filters in stock had to get suitable replacements from cummins.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1761514	hydraulic leak on a fork positioning	SPitman	4/11/2025	Internal	29510.0	\$0.00	Check/Inspect/Diagnose Cylinder Steam clean equipment as necessary. Replace Hydraulic Hose/s and ancillary items, diagnose and repair hydraulic leak under mast.steam clean,remove blown hose and heat affected hose on rh tyne positioner,travel to get hoses made,refit,tested. Carry out equipment condition assessment
1759054	Dehire Inspections	GOSMOND	23/10/2025	Internal	30746.0	\$0.00	Steam clean equipment as necessary.
1756466	29250hr II 250hr Service	GOSMOND	22/10/2025	Internal	29271.0	\$0.00	Steam clean truck. Preform dehire inspection. Steam clean equipment as necessary. 250hr Service Clean truck. Perform 29250hr pm service. Top up coolant. Chains 0.3% Tynes 87.2mm. Put back online. Repair Air Conditioner as necessary,
1757148	AC not working well	GOSMOND	20/10/2025	Internal	29271.0	\$0.00	Washout blocked evatorator. Wash out condensor. All fans work. Tested ok. Put back online. Steam clean equipment as necessary.
1751403	29000hr II 1000hr Service (Engine Service Only, Offhiring Soon)	GOSMOND	7/10/2025	Internal	29029.0	\$0.00	1000hr Service Clean truck. Perform limited 1000hr pm service. Chains 0.5% Tynes 87.2mm. Put back online. Repair Inching Valve as necessary,
1751871	Inching pedal not functioning properly	GOSMOND	25/09/2025	Internal	28794.0	\$0.00	Truck presents with fault code t1506 Inching out of range. Adjust free play voltage with multimeter as Taskman software is out of date. Calibrate but faults again when brakes pushed. Order new sensor. Swap out one from H15960 to get them going. After trouble getting it to calibrate. Calibrated and tested. Put back online. Labour Replace Inching Valve, Pickup new part. Remove borrowed sensor from H15960 and fit and calibrate new sensor. Test ok. Put back online. Refit sensor back onto H15960 and calibrate. Test ok.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1749174	28750hr II 250hr Service	GOSMOND	22/09/2025	Internal	28736.0	\$0.00	Steam clean equipment as necessary. 250hr Service Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Clean truck. Perform 28750hr pm service. Chains 0.5% tynes 87.9mm. Adjust a/c belt. Top up coolant. Repairer broken air inlet pipe mount. Dismantle and lubricate brake/inching pedal assembly as pedal was stiff. Put back online. Replace Hydraulic Hose/s and ancillary items, Labour Replace leaking steer hoses under cab with change over ones. Replace fan and a/c belts. Clean up and take hoses to Kempes for replacement. Steam clean equipment as necessary.
1747863	H15961- replace undercab hoses	GOSMOND	10/09/2025	Internal	28504.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Clean truck. Perfrom 28500hr pm service. Chains 0.5% tynes 86.9mm. Drive belts and leaking hoses under cab. Repaired on separate job. Put back online. Steam clean equipment as necessary.
1745481	28500hr II 500hr Service	GOSMOND	10/09/2025	Internal	28504.0	\$0.00	Repair Tyne Latch as necessary , Clean truck. Remove lhs tyne and carrier from truck. Remove worn out bushes and fit new ones(left over from previous job). Reassemble and grease. Test ok. Put back online. Collect parts and travel to site Replace and reseal leaking transmission cooler Top up transmission oil. Steam clean equipment as necessary. Replace Transmission Oil Cooler, Clean truck. Remove leaking trans cooler anf fit new one. Test for leaks ok. Put back online.
1744917	FW - Replace L/H Tyne Bushes	BIG TRUCK SA	29/08/2025	Internal	28376.0	\$0.00	
1744913	FW - Oil leaking from transmission cooler core	BIG TRUCK SA	29/08/2025	External	28391.0	\$5,360.98	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1744672	H15961 - broken wiper arm	GOSMOND	29/08/2025	Internal	28391.0	\$0.00	Repair Windscreen Wiper as necessary, Wiper arm broken. Make temp repair and order new part. Pickup new wiper arm Replace Windscreen Wiper, Remove old arm. Swap over wiper blades, fit new arm assembly and time. Test ok. Put back online. Steam clean equipment as necessary.
1741988	28250hr II 250hr Service	BIG TRUCK SA	28/08/2025	Internal	28256.0	\$0.00	250hr Service Clean truck. Perform 28250hr pm service. Topped up Transmission. Tynes 88.9mm Chains 0.5%. NOTE two further work jobs for replace tyne slide bushes and transmission cooler leak. Put back online. Adjust Accumulator Pressure
1742814	H15961 - carriage accumulator is not working on forklift	GOSMOND	22/08/2025	Internal	28149.0	\$0.00	Check accumulator charge. At 500psi ok. Test drive, working correctly. Put back online. Replace Forks/Tynes,
1742081	H15961 has cracks in the tynes	GOSMOND	19/08/2025	Internal	28110.0	\$0.00	Fetch new tynes. Remove old tynes and fit new ones. Strp old tynes down and mark them. Put in storage. Put truck back online. Steam clean equipment as necessary.
1738465	28000hr II 3000hr Service	BIG TRUCK SA	15/08/2025	Internal	28016.0	\$0.00	2000hr Service Clean truck. Perform 28000hr pm service. Chains 0.3%. Tynes 82.1mm. Put back online. Steam clean equipment as necessary.
1740680	H15961 - has a broken tyne keeper plate, sleeve for tyne to slide on is broken	GOSMOND	13/08/2025	Internal	27980.0	\$0.00	Repair Tyne Latch as necessary , Clean truck.Remove tyne and carrier. Remove worn out bushes. Fit new spare bushes. Make new stop block. Refit tyne and carrier to truck and get TLA welder to weld block back on. Grease up and put back online. Steam clean equipment as necessary.
1734789	27750hr II 250hr Service	GOSMOND	1/08/2025	Internal	27749.0	\$0.00	250hr Service Clean truck. Perfrom 27750hr pm service. Adjust a/c belt. Chains 0.5% Tynes 78.8mm. Put back online. Cleanup w/shop.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1729808	27500hr II 500hr Service	GOSMOND	18/07/2025	Internal	27488.0	\$0.00	<p>Steam clean equipment as necessary.</p> <p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p> <p>Repair Windscreen Wiper as necessary,</p> <p>Clean truck. Perform 27500hr pm service. Front wiper not working on intermittent or during screen wash. Found issue was with wiper timer relay. Order new relay. Tynes 78.8mm Chains 0.1%. Put back online.</p>
1729390	A/C Not working	GOSMOND	1/07/2025	Internal	27321.0	\$0.00	<p>Repair Air Conditioner as necessary,</p> <p>A/c compressor pulley worn out. Remove old pulley and fit good second hand one. Adjust up and test with a new belt. OK. Put back to work.</p>
1728455	27250hr II 250hr Service	GOSMOND	27/06/2025	Internal	27298.0	\$0.00	<p>Steam clean equipment as necessary.</p> <p>250hr Service</p> <p>Repair Air Conditioner as necessary,</p> <p>Clean truck. Perform 27250hr pm service. Topped up transmission. Replaced a/c belt. Chains 0.1% tynes 79mm. Put back online.</p> <p>Clean truck. Perform 27250hr pm service. Topped up transmission. Replaced a/c belt. Chains 0.1% tynes 79mm. Put back online.</p>
1722501	27000hr II 1000hr Service	GOSMOND	15/06/2025	Internal	27001.0	\$0.00	<p>3000hr Service</p> <p>Steam clean equipment as necessary.</p> <p>Remove and Replace Coolant Hose/s</p> <p>Clean truck. Perform 27000hr pm service. Diagnose coolant leak. Replaced heater hose. Chains 0.2% Tynes 79mm. Put back online.</p>
1725382	Low coolant alarm - top radiator hose leaking	GOSMOND	13/06/2025	Internal	27078.0	\$0.00	<p>Remove and Replace Coolant Hose/s</p> <p>Diagnose coolant leak. Top up and pressure test system. ok. Put back online to monitor. Truck has done multiple shifts with no issues.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1723927	Lost R/H Tyne wear plate & rubbing on carriage	GOSMOND	10/06/2025	Internal	26970.0	\$0.00	Repair Tyne Latch as necessary, Trim wear block and refit to truck. Grind down all the gouges in the wear surface. Weld in shim to account for wear in the tyne carrier. Grease up and test ok. Put back online.
1717424	26750hr II 250hr Service	AFOX	25/05/2025	Internal	26790.0	\$0.00	Steam clean equipment as necessary. Clean truck. Clean truck. 250hr Service Carried out 250hr and pressure tested cooling system to find water leak due to low resevoir bottle. Tightened up clamp at rear of cylinder head, re pressure tested unit all tested ok.
1712005	26500hr II 500hr Service	GOSMOND	13/05/2025	Internal	26544.0	\$0.00	Steam clean equipment as necessary. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1709493	26250hr II 250hr Service	GOSMOND	17/04/2025	Internal	26264.0	\$0.00	Clean truck. Perform 26500hr pm service. Topped up coolant. Crack in top of muffler. Weeping hydraulic hoses under cab. A/C condensor fans noisy. Chains 0%. Tynes 79mm. Put back online. Steam clean equipment as necessary. 250hr Service Clean truck. Perform 26250hr pm service. Chains 0%. Tynes 78.7mm. Put back online.
1707085	Check accumulator not working properly & seat isnt holding air	SPitman	2/04/2025	Internal	26145.0	\$0.00	Adjust Accumulator Pressure Repair Seat as necessary, check soft ride accumulator pressure,oil present on gas side and only had 320psi,recharged to 500psi and ordered accumulator.check air seat going flat,found leaking push in fitting on switch,repaired,tested ok Replace Accumulator, Steam clean equipment as necessary. replace soft ride accumulator,reset charge pressure,test

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1706493	Hydraulic hose blown	DBARNARD	1/04/2025	Internal	26007.0	\$0.00	Remove ancillary items and Hydraulic Hose/s, inspect and report, Labour Replace Hydraulic Hose/s and ancillary items, located unit and investigate complaint found hose from high pressure filter to pump blown, removed and source repairer in mt gambier to make new hose return to site, fit new hose and test ok Travel to site, 2000hr Service travel to mt gambier.
1697856	26000hr II 2000hr Service	DBARNARD	31/03/2025	Internal	26006.0	\$0.00	travel to site, located unit and carry out pm service Adjust Accumulator Pressure Adjust pressure.
1697036	Check accumulator pressure	GOSMOND	19/03/2025	Internal	25828.0	\$0.00	Check back with operator. All good. Replace Steer Wheel Bearings, Found movement as part of pm service. Order parts. Truck is offline. Measure up worn area and send photos to Josh. Package up and ship to Dry Creek for repair.
1697115	Excessive movement in L/H steer wheel bearing	GOSMOND	18/03/2025	Internal	25827.0	\$0.00	fit steer bearings,hub,adjust preload get trudent to fit wheel,check wheel nut tension Replace Light/s
1696144	Inspect & replace blue reverse light	GOSMOND	6/03/2025	Internal	25821.0	\$0.00	R and I new blue light. Test ok. Steam clean equipment as necessary. 250hr Service
1690876	25750hr II 250hr Service	GOSMOND	24/02/2025	Internal	25821.0	\$0.00	Clean truck. Complete 250hr pm service as per service sheet. Chains at 1.75%, replacement job requested. Lhs steer wheel bearing movement. Job issued.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1693786	Chain inspection & sheeve roller assessment	GOSMOND	14/02/2025	Internal	25719.0	\$0.00	Carry out Inspection and Diagnosis of Mast/Carriage Perform sheave and chain inspection. No noticable movement in sheave. Chain is 90% worn. Will be replaced as part of the repair.
1693074	Broken chain	GOSMOND	10/02/2025	Internal	25821.0	\$0.00	Replace Lift Chain, Replace Chain Sheave, Pickup parts and find out where chains are. Assemble chain sheave and fit to truck. Remove lift chains from H15960 and fit to truck. Remove batteries from H15960 and fit to truck. Check operation and adjust over the reel wiring loom. Put back online. Cut new chain to length. Clean up anchors ready for chain fitment.
1691223	A/C Not working	GOSMOND	3/02/2025	Internal	25636.0	\$0.00	Fit new chains. Adjust hoses. Put back online. Repair Air Conditioner as necessary, A/c not working. Diagnose belt slipping. Tighten belt and test. OK. Put back online. Steam clean equipment as necessary.
1684446	25500hr II 500hr Service	GOSMOND	29/01/2025	Internal	25551.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Clean truck. Perfrom 25500hr pm service. Put back online. Steam clean equipment as necessary.
1681739	250hr service	GOSMOND	6/01/2025	Internal	25279.0	\$0.00	250hr Service Clean truck. Perfrom 25250hr pm service. Put back online.
1681143	Engine Oil Leak	GOSMOND	13/12/2024	Internal	25222.0	\$0.00	Remove ancillary items and repair Engine Oil Leaks as required, Refit ancillary items, Replace Temperature Sender, Remove brake pump and clean. Reseal pump and refit to truck. Test ok. Replace coolant level sensor as was getting false codes. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1678265	Replace side step mounts	GOSMOND	4/12/2024	Internal	25009.0	\$0.00	Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,
1675641	25000hr II 5000hr Service	GOSMOND	4/12/2024	Internal	25009.0	\$0.00	Replace broken lhs side step mounts. NOTE customer supplied mounts. Steam clean equipment as necessary. 5000hr Service
1667382	25750hr II 250hr Service	GOSMOND	21/11/2024	Internal	24786.0	\$0.00	Clean truck. Perform 25000hr pm service. Adjust valves. Put back online. Steam clean equipment as necessary. 250hr Service
1670991	Broken light bracket & no hydraulic power or steering	WHILL	7/11/2024	Internal	24786.0	\$0.00	Clean truck. Perform 24750hr pm service. Adjust a/c belt. Put back online. Check/Inspect/Diagnose Cylinder Remove ancillary items and Hydraulic Pump, inspect and report, Repair Hydraulic Pump as necessary, Replace Hydraulic Oil as Required Travel to site, Check/Inspect/Diagnose Hydraulic Pump and test operation, Diagnose front pump failure and order new pump. Replace Hydraulic Pump, Refit Hydraulic Pump and ancillary items, Remove acc. pump drive and retrieve broken shaft. Reassemble. Remove pumps and case drain hose assembly. Fit new hose assembly. Remove failed pump and fit new one to existing pump. Refit pumps to truck. Connect all lines. Fill tank with oil. Start and bleed system. Works ok. Test pressures and for leaks. OK. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1670214	as one of the mast light brackets has come loose and the light is hanging.	GOSMOND	4/11/2024	Internal	24785.0	\$0.00	Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Weld up broken bracket. Reassemble. Test ok. Put back online.
1663557	24500hr II 500hr Service	GOSMOND	25/10/2024	Internal	24524.0	\$0.00	Steam clean equipment as necessary. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1659879	24250hr II 250hr Service	GOSMOND	9/10/2024	Internal	24267.0	\$0.00	Clean truck. Perform 24500hr pm service. Reattach door latch cover. Put back online. Steam clean equipment as necessary. 250hr Service
1655401	24000hr II 2000hr Service	GOSMOND	25/09/2024	Internal	24013.0	\$0.00	Clean truck. Perform 24250hr pm service. Cleanup work area. Put back online. Steam clean equipment as necessary. 4000hr Service,
1659021	hydraulic oil leak	GOSMOND	24/09/2024	Internal	24155.0	\$0.00	Clean truck. Perform 24000hr pm service. Replace hydraulic oil and filter. Replace diff and final drive oils. Finish service and calibrate transmission. Adjust a/c belt. Put back online. Adjust and Retention Steer Wheel Bearings Replace Hydraulic Hose/s and ancillary items, Repair Air Conditioner as necessary , Fit spare pump main hose. Tighten weight gauge display. Replace wheel stud. Retension LHS steer wheel bearing. Repair Hub/s as necessary, Now I have spare wheel studs, checked other studs ok. Put back online. Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1656165	Warning lights and alarm going off	GOSMOND	13/09/2024	Internal	23810.0	\$0.00	Top up cooling system, Diagnose issue. Fault codes report low coolant level. Level seems ok but topped up a bit. Check and clean sensor plug and wiring. Test ok. Clear codes and put back online. Steam clean equipment as necessary.
1653177	23750hr II 250hr Service	BIG TRUCK SA	10/09/2024	Internal	23755.0	\$0.00	250hr Service Clean truck. Perform 23750hr pm service. Replace worn a/c belt. Put back online. Steam clean equipment as necessary.
1644835	23500hr II 500hr Service	GOSMOND	14/08/2024	Internal	23499.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Clean truck. Perform 23500hr pm service. Tighten loose drive wheel nuts. Lubricate still inch/brake linkage. Put back online.
1648245	repair greaser fault".	GOSMOND	13/08/2024	Internal	23510.0	\$0.00	Remove ancillary items and Hydraulic Hose/s, inspect and report, Labour Diagnose error 12. Found ruptured primary hose. Remove and take to repairer for replacement as none in the country. Grease All Points on Unit, Pickup repaired grease line. Fit to truck and test. ok. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1595956	leaking lift cylinder	GOSMOND	8/08/2024	Internal	23280.0	\$0.00	<p>Check/Inspect/Diagnose Cylinder</p> <p>Steam clean equipment as necessary.</p> <p>Remove ancillary items and Carriage, Strip, Inspect and report,</p> <p>Remove ancillary items and Mast, Strip, Inspect and report,</p> <p>Replace Right Lift Cylinder,</p> <p>Clean truck. Remove carriage. Remove mast. Swap out failed rhs lift cylinder for new one.</p> <p>Labour</p> <p>Replace Mast Wear Strips,</p> <p>Refit Mast and ancillary items,</p> <p>Refit mast and all associated hoses and lines.</p> <p>Refit Carriage and ancillary items,</p> <p>Refit carriage. Topup hydraulic oil. Clean down and put back online.</p>
1645116	Replace brake value and wiper blades	GOSMOND	1/08/2024	Internal	23279.0	\$0.00	<p>Carry out Inspection and Diagnosis of Brake System</p> <p>Replace Windscreen Wiper,</p> <p>Replace Brake master cylinder,</p> <p>Rplace worn front wiper blades. Replace leaking brake valve.</p>
1641122	23250hr II 250hr Service	BIG TRUCK SA	26/07/2024	Internal	23247.0	\$0.00	<p>250hr Service</p> <p>Steam clean equipment as necessary.</p> <p>Clean truck. Perform 23250hr pm service. Put back online.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1637037	23000hr II 1000hr Service	BIG TRUCK SA	10/07/2024	Internal	22999.0	\$0.00	Steam clean equipment as necessary. 3000hr Service Labour Clean truck. Perform 23000hr pm service. Adjust a/c belt. Fit worm clamps to weeping heater hoses. Put back online.
1635592	Repair park brake	GOSMOND	26/06/2024	Internal	22758.0	\$0.00	Replace brake shoe/s, Park brake pads worn out. Remove caliper and replace pad. Reassemble and adjust. Test ok. Put back online.
1631552	22750hr II 250hr Service	BIG TRUCK SA	26/06/2024	Internal	22758.0	\$0.00	Steam clean equipment as necessary. 250hr Service Clean truck. Perform 22750hr pm. Adjust a/c belt. Cleanup after job. Put back online.
1631344	Metal found in the RHS final drive when changing the oil	GOSMOND	14/06/2024	Internal	22521.0	\$0.00	Carry out Inspection and Diagnosis of Drive Axle Refit Drive Wheel Bearings, Refit ancillary items, Adjust Wheel Bearings to correct specification, Metal came out with oil on rhs final drive. No metal from diff or lhs fd drain. Trident removed wheels and dismantled rhs final drive. Bearings ok. Thrust washer tabs broken off and gone threw gears. Fitted spare thrust washer and reassemble. Fill with oil and get trident to refit wheels. Put back online. Clean up after job. Repair Hub/s as necessary, Packup and clean workshop. Labour Pickup parts.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1627677	22500hr II 500hr Service	BIG TRUCK SA	11/06/2024	Internal	22484.0	\$0.00	<p>Steam clean equipment as necessary.</p> <p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p> <p>Labour</p> <p>Clean truck. Perform 22500hr pm service. Had to go to Cummins to pickup an air cleaner as stock order still not here. Drain and refill diff and final drives. Found metal in rhs final drive again. Will investigate on another job. Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p>
1630769	Repair LHS sliding window	GOSMOND	7/06/2024	Internal	22417.0	\$0.00	<p>Lhs sliding window fell out. Track worn. Replace guides and have to screw them in due to wear. Order new guides. Test ok. Put back online.</p> <p>Remove ancillary items and Hydraulic Hose/s, inspect and report,</p>
1627479	Replace hydraulic hose	GOSMOND	28/05/2024	Internal	22224.0	\$0.00	<p>Find leaking hose on pm service. Remove hose and drop off at repairer.</p> <p>Refit Hydraulic Hose/s and ancillary items,</p>
1627264	2 X alarms coming up	GOSMOND	27/05/2024	Internal	22224.0	\$0.00	<p>Pickup hose. Fit to truck. Test ok. Put back online. Remove and Replace Coolant Hose/s</p> <p>Diagnose fault codes. Relate to low coolant level. Check level low. Pressure test system and find leak at radiator hose. Tighten clamp and fit secondary clamp. Leak fixed. Top up coolant and put back online.</p>
1625696	22250hr II 250hr Service	BIG TRUCK SA	27/05/2024	Internal	22224.0	\$0.00	<p>Steam clean equipment as necessary.</p> <p>250hr Service</p> <p>Clean truck. Perform 22250hr pm service. Make and fit rhs rear mudflap. Put back online</p>
1625838	Wipers stuck on	GOSMOND	21/05/2024	Internal	22124.0	\$0.00	<p>Repair Windscreen Wiper as necessary,</p> <p>Diagnose wipers stuck on. Traced fault to wiper relay. Replaced relay and test. OK. Put back online.</p>
1607577	3G Sunset Device Swap (FM1 to VAM)	GOSMOND	20/05/2024	Internal	22112.0	\$0.00	<p>Replace Fleet Management System as required,</p> <p>Carry out FM1 to VAM swap as part of 3G sunset. Had to get Mike to intervene as the truck would not wake up from seat switch. Put back online</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1621358	22000hr II 2000hr Service	GOSMOND	15/05/2024	Internal	22037.0	\$0.00	2000hr Service Start service whilst the operator is at lunch as H15960 is offline.
1615886	21750hr II 250hr Service	GOSMOND	1/05/2024	Internal	21765.0	\$0.00	Shane completed service. Steam clean equipment as necessary. 250hr Service Clean truck. Perform 21750hr pm service. Put back online.
1617731	Machine Wont Start - No Crank	GOSMOND	22/04/2024	Internal	21608.0	\$0.00	Replace alternator, Non crank. Jumpstart and check charge rate. Alternator not charging. Remove alt and fit new one. Check chage rate ok. Charge up batteries and put back online.
1613398	Repair Seat	GOSMOND	8/04/2024	Internal	21765.0	\$0.00	Repair Seat as necessary, Diagnose movement in seat. Seat suspension is worn out. Seat rails are worn out. Oorder parts and put back online.
1610098	21500hr II 500hr Service	GOSMOND	5/04/2024	Internal	21474.0	\$0.00	Replace worn out seat rails and suspension unit. Put back online. Steam clean equipment as necessary. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Clean truck. Perform 21500hr pm service. Top up trans and coolant. Put back online. Cleanup.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1610827	Steer Wheel Bearing Collapsed	GOSMOND	3/04/2024	Internal	21324.0	\$0.00	<p>Replace Steer Wheel Bearings,</p> <p>Noise in driveline. Found steer wheel bearings failing. Dismantle and order parts.</p> <p>Steam clean equipment as necessary.</p> <p>Carry out Inspection and Diagnosis of Steering System</p> <p>remove bearings from hubs,steam clean,inspect for damaged parts</p> <p>Labour</p> <p>Trvel to pickup parts and my engine crane . Return to site. Fit bearings to hubs. Reassemble rhs side and tension. Unable to finish lhs as waiting on outer bearing.</p> <p>Continue with lhs steer wheel. Awaiting outer bearing from supplier.</p> <p>Refit Wheel/s and ancillary items,</p> <p>Pickup parts. Reassemble lhs steer wheel. Wait for Trident to fit wheels. Test drive and put back online.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1608106	Oil coolers leak	GOSMOND	2/04/2024	Internal	21117.0	\$0.00	<p>Repair Transmission Oil Cooler as necessary, order parts</p> <p>Replace Transmission Oil Cooler, Replace leaking transmission oil cooler.</p> <p>Remove ancillary items and Hydraulic Hose/s, inspect and report, Remove hydraulic pump delivery hoses and drop off at repairer to be made up.</p> <p>Labour</p> <p>Replace Hydraulic Hose/s and ancillary items, Pickup new pump hoses. Fit to truck.</p> <p>Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Run truck and prime pumps. Reseal part of tilt lock valve. Steam clean equipment as necessary.</p>
1606871	21250hr II 250hr Service	GOSMOND	21/03/2024	Internal	21248.0	\$0.00	<p>250hr Service</p> <p>Clean truck. Perform 21250hr pm service. Top up transmission as cooler is leaking. Put back online.</p>
1608437	Mast Creeping Down	GOSMOND	15/03/2024	Internal	21136.0	\$0.00	
1603613	21000hr II 3000hr Service	GOSMOND	6/03/2024	Internal	20981.0	\$0.00	<p>Steam clean equipment as necessary.</p> <p>1000hr Service</p> <p>Clean truck. Perform 21000hr pm service. Put back online.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1605306	Aircon Fault	GOSMOND	4/03/2024	Internal	20980.0	\$0.00	<p>Steam clean equipment as necessary.</p> <p>Repair Air Conditioner as necessary,</p> <p>Diagnose a/c system. Blower fan not working. Tilt cab and check fan. Plug was corroded and loose. Repair plug and test ok. Wash out all coolers. Fill up graes pot as has faulted but suggest the is an air bubble in the pot. Put back online.</p> <p>Blower fan still wonky. Fitted new plugs to fan and test. Ok. Put back online.</p> <p>Blower fan stopped o/night again. Test wiring and power to fan. Hit fan with hammer and it starts spinning. Replace blower with new unit. Test ok. Reassemble and put back online.</p>
1603232	Change pins and bushed in mast	BIG TRUCK SA	23/02/2024	Internal	20800.0	\$0.00	
1601987	250hr service 0250 Hour Service	GOSMOND	23/02/2024	Internal	20800.0	\$0.00	<p>250hr Service</p> <p>Perform 20750hr pm service. Put back online.</p> <p>Steam clean equipment as necessary.</p>
1600191	Coolant leak	GOSMOND	13/02/2024	Internal	20617.0	\$0.00	<p>carry out 250hr service</p> <p>Remove and Replace Coolant Hose/s</p> <p>Low level coolant in tank. Found pinhole in heater hose. Shorten hose and top up level. Test ok. Put back online.</p>
1596718	20500hr II 500hr Service	GOSMOND	6/02/2024	Internal	20500.0	\$0.00	<p>Steam clean equipment as necessary.</p> <p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p>
1595020	20250hr II 250hr Service	GOSMOND	24/01/2024	Internal	20262.0	\$0.00	<p>Clean truck. Perform 20500hr pm service. Put back online</p> <p>Steam clean equipment as necessary.</p> <p>250hr Service</p> <p>Clean truck. Perform 20250hr pm service. Top up hydraulic tank. Put back online.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1592836	tilt issue	GOSMOND	15/01/2024	Internal	20117.0	\$0.00	<p>Check/Inspect/Diagnose Hydraulic Tilt Valve Section and test operation, Diagnose issue with tilt function. Operates slow or not at in forward tilt. ok in return direction. Check wiring., plug full of oil. Clean and seal with dilectric grease. Still faulty. Order new module. Fix oil leaks on valve.</p> <p>Repair Hydraulic Control Valve as necessary,</p> <p>Fit new module. Replace leaking front pump main hose. Test ok. Put back online. Repair Drive Wheel as required,</p>
1592779	Repair Drive Wheel	GOSMOND	14/01/2024	Internal	20116.0	\$0.00	<p>*CALLOUT* Travel to breakdown. Found loose wheel nuts LHS drive wheel. Tension all nuts to 500. Some 1/8 turn loose. Some 2 turns loose. Check all other wheel nuts, ok. Put back online. Steam clean equipment as necessary.</p>
1586734	20000hr II 5000hr Service	BIG TRUCK SA	27/12/2023	Internal	200010.0	\$0.00	<p>5000hr Service</p> <p>Replace Fan Belt,</p> <p>Carry our valve clearence adjustments</p> <p>carry out 20000hr service,steam clean unit,replaced fan and alternator belts,adjust valves. Replace Light/s</p>
1589014	REPLACE FRONT WORKLIGHT	511 Planning A	20/12/2023	Internal	19902.0	\$0.00	<p>replace front worklight,test.</p>
1589012	REPLACE LH REVERSE LIGHT	SPitman	20/12/2023	External	19901.0	\$0.00	
1587408	LEAK ON HEADER TANK	511 Planning A	14/12/2023	Internal	19811.0	\$0.00	<p>Flush and Replace Cooling System Coolant</p> <p>Repair Radiator as required,</p> <p>Top up cooling system,</p> <p>drain and flush coolant,replace leaking header tank,bleed cooling system,check for leaks.</p> <p>Replace header tank,</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1587174	oil leak on carriage	GOSMOND	13/12/2023	Internal	19811.0	\$0.00	Check/Inspect/Diagnose Hydraulic Oil Leak and test operation, Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Replace leaking Actuator on carriage valve.Fitted cab filter missed on last service. Top up hyd oil. Put back online. Steam clean equipment as necessary. 250hr Service
1584412	19750hr II 250hr Service	BIG TRUCK SA	10/12/2023	Internal	19725.0	\$0.00	Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Repair Light/s
1586037	REAR TAIL LIGHT DAMAGE	511 Planning C	8/12/2023	External	19902.0	\$498.74	order parts customer damage. Replace Light/s
1577852	19500hr II 500hr Service	BIG TRUCK SA	28/11/2023	Internal	19547.0	\$0.00	collect parts,seized/broken bolt in light facia panel,drill out and retap thread,replace damaged reverse light,test. Travel to site, Steam clean equipment as necessary. Replace Light/s Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. carry out 500hr service,steam clean,replace blown work lights.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1580237	mast hoes leak	SPitman	17/11/2023	Internal	19383.0	\$0.00	<p>Travel to site,</p> <p>Check/Inspect/Diagnose Cylinder</p> <p>Remove ancillary items and Hydraulic Hose/s, inspect and report,</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>Refit Hydraulic Hose/s and ancillary items,</p> <p>Top up Hydraulic Oil to correct level,</p> <p>dianose hydraulic leak,mast hose leaking and others cracked,removed and got pirtek to make 3x hose assys,found broken bolts in mast hose roller bracket,remove bracket assys,remove broken bolts,remove hoses and refit new hose assys and retension,top up hydraulic oil,test,wash down unit.</p>
1579170	low brake pressure reading alarm	SPitman	14/11/2023	Internal	19346.0	\$0.00	<p>unit has no service brake pressure,spongy pedal,brake pressure warning lights going off,can only assume brake pressure fault unable to test no testing equipment</p> <p>Travel to site,</p> <p>Adjust Accumulator Pressure</p> <p>Steam clean equipment as necessary.</p> <p>checked brake and accumulator pressures,found faulty charging valve,replaced,adjusted charing pressure,tested,ok.</p>
1578819	H15961 - CALLOUT - ENGINE STOP CODE - E0132	SPitman	12/11/2023	Internal	19323.0	\$0.00	<p>Remove ancillary items and Potentiometer, Replace Potentiometer and Refit to unit, Refit ancillary items,</p> <p>called to unit stop engine light cones on intermitently,code e0132,checked throttle wiring,replace throttle pot,tested.</p>
1578695	broken wheel stud	SPitman	10/11/2023	Internal	19332.0	\$0.00	<p>Travel to site,</p> <p>Carry out Inspection and Diagnosis of Wheel</p> <p>call up unit,check for missing,broken,loose wheel studs,none missing or broken,unable to fault.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1577834	Further Work - Replace Leaking Steering Cylinder	SPitman	8/11/2023	Internal	19322.0	\$0.00	Travel to site, Steam clean equipment as necessary. Overhaul Steering as required, Replace Tie Rod End/s, steam clean, replace steer cylinder and tie rods, take old cylinder to kempes to be overhauled for stock. Repair Hub/s as necessary,
1577328	replace wheel studs	GOSMOND	6/11/2023	Internal	19243.0	\$0.00	Replace 3 x broken Lhs drive wheel studs. Put back online. Repair Attachment as necessary,
1576929	CALIBRATE WEIGHT GAUGE	GOSMOND	6/11/2023	Internal	19243.0	\$0.00	Calibrate weight gauge. Test ok. Send back out for operators to test over the weekend.
1575365	19250hr II 250hr Service	BIG TRUCK SA	6/11/2023	Internal	19243.0	\$0.00	Recalibrate as not right. Test ok. Put back online. Steam clean equipment as necessary. 250hr Service Clean truck. Perform 19250hr pm service. Put back online.
1563286	19000hr II 1000hr Service	GOSMOND	24/10/2023	Internal	19001.0	\$0.00	Steam clean equipment as necessary. 1000hr Service Clean truck. Perform 1000hr pm service. Calibrate trans. Adjust a/c belt. Put back online.
1571853	INSPECT/REPLACE WORKLIGHTS	GOSMOND	12/10/2023	Internal	18792.0	\$0.00	Replace Light/s
1571852	hydraulic issue	GOSMOND	12/10/2023	Internal	18792.0	\$0.00	Replace 3 non-working work lights. Ok. Repair Steering Pump as necessary, Steering works if wheel turned slowly but locks up if you go too fast. Clean out brake charging valve. Check pressures. Check/Inspect/Diagnose Hydraulic Pump and test operation,
1543441	Weight guage not working	GOSMOND	5/10/2023	Internal	17810.0	\$0.00	Continue diagnosis. Eventually found issue with tech unable read own marks. Put back online. Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1559042	18750hr II 250hr Service	GOSMOND	6/09/2023	Internal	18768.0	\$0.00	Steam clean equipment as necessary. 250hr Service
1559979	POSSIBLE HYDRAULIC PUMP ISUE	GOSMOND	30/08/2023	Internal	18659.0	\$0.00	Clean truck. Perform 18750hr pm service. Top up hyd tank. Put back online. Replace Transmission Filter, Diagnose noise and fault lights on dash. Found trans filter bypass opening. Replace filter and cut open. Full of clutch pack material. Due to trans failing. Test drive, no more faults coming up. Put back online.
1555978	18500hr II 500hr Service	GOSMOND	23/08/2023	Internal	18555.0	\$0.00	Steam clean equipment as necessary. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1556676	removal of damaged pump 4700545 off job 1544618	511 Planning C	16/08/2023	Internal	18424.0	\$0.00	Clean truck. Perform 18500hr pm service. Top up hyd oil. Replace broken wheel stud rhs drive. Put back online.
1555288	hmu issues	GOSMOND	9/08/2023	Internal	18780.0	\$0.00	Repair Steering Box as necessary, Hmu leaking, Tyne bushes worn out. Order parts. Replace Steering Box, Replace leaking HMU unit. Test ok. Put back online. Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Reseal hyd. module. Test ok. Put back online. Steam clean equipment as necessary. Replace Tyne Latch, Clean truck. Remove tynes and carriers. Remove worn out bushes. Fit new bushes. Refit tyne carriers to carriage. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1546747	18250hr II 250hr Service	GOSMOND	9/08/2023	Internal	18297.0	\$0.00	Steam clean equipment as necessary. 250hr Service Clean truck. Perform 18250hr pm service. Repair oil leak at trans filter head. O rings have gone hard. Top up trans and hyd. Put back online. Replace two broken wheel studs rhs drive. Put back online.
1550207	WHEEL STUDS	GOSMOND	18/07/2023	Internal	18071.0	\$0.00	Replace two broken wheel studs rhs drive. Put back online.
1549854	REPLACE HOSE	GOSMOND	17/07/2023	Internal	18047.0	\$0.00	
1549611	LEAK UNDER CAB	GOSMOND	17/07/2023	Internal	18047.0	\$0.00	Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Diagnose oil leak. Blown out o ring from fitting. Replace o ring from kit and fill up hyd. tank. Test ok. Clean oil off truck and put back online.
1548809	REPLACE BRGS R/H/F WHEEL - UNIT MAKING METAL	GOSMOND	12/07/2023	Internal	18034.0	\$0.00	Steam clean equipment as necessary. Remove ancillary items and Hub/s, Strip, Inspect and report, Clean truck. Have rhs drive wheels removed by tyre fitters. Dismantle hub and found inner race of outer bearing conne has failed. Repair Hub/s as necessary, Refit Hub/s and ancillary items, Finish dismantling final drive. Outer bearing bore suspect. After crack testing Scott advised to reuse. Fit new bearings and seals. Reassemble hub and final drive. Fill final drive with oil. Test drive and check for leaks. OK. Put back online.
1547865	OIL LEAK UNDER CAB..	GOSMOND	10/07/2023	Internal	18001.0	\$0.00	Repair Hydraulic Hose/s as necessary, Steam clean equipment as necessary. Diagnose oil leak. Blown o ring on pump output hose fitting. Replace o ring and test ok. Top up oil in tank and clean oil off truck. Put back online.
1546850	No steering - poss hyd pump failed	GOSMOND	4/07/2023	Internal	17990.0	\$0.00	Check/Inspect/Diagnose Hydraulic Pump and test operation, Diagnose no steering and no brake pressure. Follow tests in book. Swap hoses around on pumps. Symptoms resolved. Rear pump has failed. Remove ancillary items and Hydraulic Pump, inspect and report, Refit Hydraulic Pump and ancillary items,

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1544004	18000hr II 2000hr Service	GOSMOND	4/07/2023	Internal	17985.0	\$0.00	Steam clean equipment as necessary. 2000hr Service Clean truck. Perform 18000hr pm service. Adjust a/c belt. Replace diff and gearbox oils. Put back online. Cleanup after job.
1546500	Coolant leak	GOSMOND	3/07/2023	Internal	17978.0	\$0.00	Remove and Replace Coolant Hose/s Diagnose coolant leak. Found top radiator hose has a pinhole and other hoses gone hard. Make temporary fix to get truck back online. Order replacement parts.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1543656	Replace Transmission	GOSMOND	22/06/2023	Internal	18792.0	\$0.00	<p>Carry out Inspection and Diagnosis of Transmission</p> <p>Fault code t1110. Blocked trans filter. Replaced filter and put truck back online. Cut filter open and find clutch friction material.</p> <p>Remove ancillary items and Transmission, Strip, Inspect and report,</p> <p>travel to yoihire. pull out trans. put it on the pallet. drop off to the workshop to be sent to site. returned trailer to pn kerry rd.</p> <p>Equipment Transport,</p> <p>Prepare For Sale - Workshop</p> <p>picked up trailer an pallet from kerry rd an drove to site helped pierrer loaded up gb onto pallet onto the trailer, dropped back to workshop for transport taken trailer back to kerry rd</p> <p>Steam clean equipment as necessary.</p> <p>Clean truck. Test drive and appears forward clutch has failed. Calibrate trans to see if we can get some more life from it. Calibration failed, forward clutch failed. Put over pit and drain oil.</p> <p>Remove transmission from truck. Get change over trans down from storage.</p> <p>Refit Transmission and ancillary items,</p> <p>Swapped over parts. Fit new transmission to truck. Continue cleaning and fitting parts.</p> <p>Finish installing tailshaft, pumps etc. Fill trans with dex3 and calibrate. Unable to calibrate. Forward direction clutch failed.</p> <p>Remove trans controller from H15946 and H15961. Fit 61 controller to 46 and calibrate. Refit to 61 and test. Very sluggish to drive in forward but no codes. Put back online. Refit controller to 46 and put back online.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001 Equip. Code: H15961 Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above Make: HYSTER Model: H20XM-9 Serial No.: C236E03539T							
							Repair Transmission as necessary, Strap first failed trans to pallet for transport Pickup parts from tnt. Finish putting trans onto pallets and move round to store for pickup. Tnt refused to take them unless they were containered. Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Replace Inching Valve, Reseal brake charging valve. Attempt to reseal lift module but I ordered the wrong kit. Ordered the correct kit. Diagnose fault 211. Inching pedal sensor fault. Replaced sensor and adjusted. Put truck back online. Clean truck. Start removing transmission. Steam clean truck. Remove transmission. Swap parts over and fit new transmission to truck. Fit tailshaft, pumps. Fill trans and bleed pumps. Calibrate trans ok. Finish up job. Clean truck and cleanup workshop. Put old trans on frame ready for transport. Put back online.
1533769	17250hr II 250hr Service	DBARNARD	21/06/2023	Internal	17258.0	\$0.00	250hr Service Travel to site, carry out 250hr service as per oem guidelines
1540034	17750hr II 250hr Service	BIG TRUCK SA	20/06/2023	Internal	17534.0	\$0.00	250hr Service
1536837	17500hr II 500hr Service	GOSMOND	5/06/2023	Internal	17520.0	\$0.00	Steam clean equipment as necessary. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Manufacture Mud flaps, Clean truck. Perform 17500hr pm service. Cut and fit new lhs rear mudflap. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1530991	17000hr II 2000hr Service	GOSMOND	10/05/2023	Internal	17034.0	\$0.00	Steam clean equipment as necessary. 1000hr Service Clean truck. Perform 17000hr pm service. Adjust a/c belt. Calibrate inching and trans. Top up hydraulic oil. Put back online.
1530965	Stiffener plates	511 Planning C	28/04/2023	Internal	16808.0	\$0.00	
1529715	16750hr II 250hr Service	GOSMOND	25/04/2023	Internal	16734.0	\$0.00	Steam clean equipment as necessary. 250hr Service Clean truck. Perform 16750hr pm service. Put back online.
1528589	Not starting and dropping gear regualry	GOSMOND	18/04/2023	Internal	16642.0	\$0.00	Repair Seat Switch Wiring, Diagnose trans dropping out and inconsistent cranking. Suspect seat belt switch. Order new seat belt. Put back online. No crank. Found cracked seat base causing seat switch issue. Pack with cardboard to get back online. Order new seat base. Repair Switch/es Problem getting worse. Replace seat belt. No better. Try to fix broken seat cushion but still no good. Found fault in forward reverse lever. Fit 2nd hand spare and put back online. Order new lever. Repair Seat as necessary, Replace worn out seat cushion with new one. Test ok. Put back online.
1528192	Leaking steer cylinder. Lift cylinder is leaking oil on window	GOSMOND	17/04/2023	Internal	16600.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1527286	Metal flakes found in diff - investigate RHS hub/ final drive.	GOSMOND	12/04/2023	Internal	16528.0	\$0.00	<p>Carry out Inspection and Diagnosis of Drive Axle</p> <p>Investigate metal flakes in rhs final drive oil. Tyre fitters removed wheels and I dismantled hub. No obvious source of the metal flakes but the remaining oil seemed to have brass in it. Wheel bearings rough and Scott wants them changed but none in the country. Suspect the metal has come from the diff.</p> <p>Refit Drive Axle Assembly, refit ancillary items,</p> <p>Clean parts and reassemble. Get tyre fitters to refit wheels and put back online.</p> <p>Steam clean equipment as necessary.</p> <p>Clean up floor after job.</p> <p>Adjust Wheel Bearings to correct specification,</p> <p>Order parts.</p> <p>Final drive has done 250hrs so I drained the oil and sampled it. Refilled with new oil. No evidence of metal in oil. Put back online.</p>
1527165	Replace broken wheel studs	GOSMOND	12/04/2023	Internal	16528.0	\$0.00	<p>Repair Hub/s as necessary,</p> <p>Found one broken stud lhs drive. Replaced 3 and painted green. Broken stud had orange flag on it.</p>
1525549	16500 II 500hr service Hyster Bladed Truck C236 - 500hr Service Kit. 0500 Hour Service	GOSMOND	12/04/2023	Internal	16528.0	\$0.00	<p>Steam clean equipment as necessary.</p> <p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p> <p>Clean truck. Perform 16500hr pm service. Replace diff and final drive oils. Found metal in rhs final drive. Will investigate.</p>
1521248	16250 II 250hr service 0250 Hour Service	GOSMOND	30/03/2023	Internal	16276.0	\$0.00	<p>Steam clean equipment as necessary.</p> <p>250hr Service</p> <p>Clean truck. Perform 16250hr pm service. Put back online.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1523610	3x broken wheel studs	GOSMOND	27/03/2023	Internal	16217.0	\$0.00	Repair Hub/s as necessary, Replace 6 broken wheel studs rhs drive. Painted red. Unable to verify when the broken studs were replaced last. Put back online. Steam clean equipment as necessary.
1519259	16000 II 2000hr service Hyster Bladed Truck C236 - 2000hr Service Kit. 2000 Hour Service	GOSMOND	17/03/2023	Internal	16010.0	\$0.00	2000hr Service Clean truck. Perform 16000hr pm service. Replace rhs mudguard worklight. Check steer wheel bearings ok. Calibrate transmission. Put back online. Repair Seat as necessary,
1520441	Seat in forklift is leaking air and keeps going down	GOSMOND	14/03/2023	Internal	15994.0	\$0.00	Seat leaking down quickly. Found split in air hose. Fixed with joiner. Test ok. Put back online. Repair Windscreen Wiper as necessary,
1518540	Wiper arms worn	GOSMOND	6/03/2023	Internal	16010.0	\$0.00	Wipers not working. Found loose nuts. Tighten but still slipping. Clean embedded metal from pivots and ream arms. Resemble and test ok. Will order new arms as are worn out and will slip again. Put back online. Replace Windscreen Wiper, Remove old arms and fit new ones. Test ok. Put back online. Steam clean equipment as necessary.
1515031	15500 II 500hr service Hyster Bladed Truck C236 - 500hr Service Kit. 0500 Hour Service	GOSMOND	1/03/2023	Internal	15746.0	\$0.00	250hr Service Clean truck. Perform 15750hrpm NOTE 15750hr pm Not 15500hr. Put back online. Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,
1514782	Replace transmission cooler and fix oil leaks	GOSMOND	17/02/2023	Internal	17023.0	\$0.00	Oil leak from transmission cooler. Replace leaking o ring on loadf sense line and plug. Order parts. Repair Mast as necessary, Diagnose oil leak from rhs lift cylinder. Check/Inspect/Diagnose Cylinder Truck presented with overheating trans. Trans cooler finally failed. R and I new trans cooler. Test ok. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1514781	Wheel studs	GOSMOND	17/02/2023	Internal	15510.0	\$0.00	Repair Hub/s as necessary, Replace 2 broken wheel studs RHS drive. Broken studs painted green replaced 20/12/2022 j/n 1502626. New studs painted yellow. Put back online.
1495550	AC repairs	GOSMOND	17/02/2023	Internal	15510.0	\$0.00	Repair Air Conditioner as necessary, Diagnose faulty a/c. Condensor fans u/s. Wiring burnt out at cab socket. Do temp fix and order parts. Pickup parts and fit new a/c belt to truck. Test ok. Put back online. Replace burnt plug/connector on back of cab. Reassemble and test ok. Still need new condensor fans. Put back online. Order new condensor fans. Remove old fans and fit new ones. Test ok. Put back online.
1511764	AC not working	GOSMOND	6/02/2023	Internal	15301.0	\$0.00	Repair Air Conditioner as necessary, Diagnose no a/c. Compressor pulley worn out and failed. Fabricate puller to remove pully from compressor. Remove ok pulley from leaky old compressor and fit to truck. Adjust clearances and test. Ok. Fit and tension new belt and put back online.
1510391	15250 II 250hr service 0250 Hour Service	GOSMOND	3/02/2023	Internal	15243.0	\$0.00	Steam clean equipment as necessary. 250hr Service Clean truck. Perform 15250hr pm service. Tighten loose and leaking hyd. hose to soft ride accumulator. Put back online.
1510141	Broken wheel studs	GOSMOND	30/01/2023	Internal	15170.0	\$0.00	Steam clean equipment as necessary. Repair Hub/s as necessary, Clean truck. Replace 5 wheels studs RHS drive. Replace 3 wheel studs LHS drive. All new studs have orange flags on them. Put back online.
1508365	oil leak around top of mast.	GOSMOND	19/01/2023	Internal	15006.0	\$0.00	Check/Inspect/Diagnose Hydraulic Oil Leak and test operation, Diagnose oil leak. Unable to see signs of oil leak. Test operate and mast hoses ok. Suspect oil from lubing chains caused the report of oil leak. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1507437	15000 II 5000hr service	GOSMOND	18/01/2023	Internal	14995.0	\$0.00	Steam clean equipment as necessary. 5000hr Service Clean truck. Perform 15000hr pm service. Replace fan and a/c belt. Adjust valve clearances. Calibrate transmission. Replace diff and final drive oils. NOTE: metal on rhs final drive drain plug. Replace 2 mast lights. Put back online. Steam clean equipment as necessary.
1502835	14750 II 250hr service 0250 Hour Service	511 Planning A	16/01/2023	Internal	14769.0	\$0.00	250hr Service Clean truck. Perform 14750hr pm service. Put back online.
1505609	Battery issues- unit will not start	GOSMOND	9/01/2023	Internal	14876.0	\$0.00	Replace Battery, Diagnose non start. Batteries boiled dry. Remove batteries and order new. Clean all the acid out from battery compartment. Pick up batteries from repco. Fit new batteries. Start nad test charge rate. 28.3 volts at the alternator. Test drive ok. Put back online.
1503269	RHS Wheel studs broken	GOSMOND	21/12/2022	Internal	14769.0	\$0.00	Repair Hub/s as necessary, Replace 3 broken wheels studs. Total of 7 changes as per Tharala direction. First broken stud replaced on j/n 1496263 14252hrs. Second stud replaced on j/n 1488012 13885hrs. Third studs unknown hours. All new studs painted green.Put back online.
1497677	14500 II 500hr service	GOSMOND	12/12/2022	Internal	14600.0	\$0.00	Steam clean equipment as necessary. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1497843	Wheel studs	GOSMOND	29/11/2022	Internal	14336.0	\$0.00	Clean truck. Perform 14500hr pm service. Put back online. Repair Hub/s as necessary, Clean truck. Replace 6 broken wheel studs RHS drive. Fitted caps to replaced studs. Put back online.
1496266	Replace worn lift chains	GOSMOND	23/11/2022	Internal	14249.0	\$0.00	Replace Lift Chain, Check lift chains. 100% worn. Order new chains.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1496263	Broken wheel studs	GOSMOND	23/11/2022	Internal	14252.0	\$0.00	Repair Hub/s as necessary, Replace 3 broken wheel studs RHS drive. Painted red. Put back online.
1493352	14250 II 250hr service 0250 Hour Service	GOSMOND	23/11/2022	Internal	14252.0	\$0.00	Steam clean equipment as necessary. 250hr Service Clean truck. Perform 14250hr pm service. Put back online.
1490304	Blown turbo	GOSMOND	2/11/2022	Internal	14042.0	\$0.00	Replace Turbo, Diagnose noise and smoke from engine. Turbo shaft broken. Remove turbo. Remove intercooler and box up to be shipped to Adelaide for cleaning. Fit new turbo. Fit new intercooler as old one is u/s. Test drive ok. Put back online.
1489414	14000 II 2000hr service Hyster Bladed Truck C236 - 2000hr Service Kit. 2000 Hour Service	511 Planning A	31/10/2022	Internal	14039.0	\$0.00	Steam clean equipment as necessary. 2000hr Service Clean truck. Perform 14000hr pm service. Put back online. Cleanup after service.
1483105	13750 II 250hr service 0250 Hour Service + repair steer axle	511 Planning B	31/10/2022	Internal	13764.0	\$0.00	250hr Service Steam clean equipment as necessary. Travelled to site and located unit. Cleaned unit and carried out 250hr service as per schedule. Manually greased the steer axle due to the faulty greaser(job ongoing)
1488822	RHS drive wheel, broken wheel studs	GOSMOND	26/10/2022	Internal	13923.0	\$0.00	Repair Hub/s as necessary, Replace 2 broken wheel studs. Put back online.
1488702	Faulty accumulator	GOSMOND	25/10/2022	Internal	13906.0	\$0.00	Repair Lift Chain Anchors as necessary, Diagnose noise and rough riding. Check accumulator pressure. 500psi ok. Found missing bolt in rhs lower chain anchor bracket. Replaced bolt and test drive. Ok. Put back online.
1488360	Replace failed work light	GOSMOND	24/10/2022	Internal	14042.0	\$0.00	Replace Light/s Replace failed rhs mudgaurd, rhs upper cab light and rhs rear light.
1488358	Diagnose fault 11 greaser	GOSMOND	24/10/2022	Internal	13885.0	\$0.00	Repair Attachment as necessary, Diagnose fault code 11. Check lines ok. Bleed system. Fill up canister. Test ok. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1488012	Broken wheel studs	511 Planning A	24/10/2022	Internal	13885.0	\$0.00	Steam clean equipment as necessary. Repair Hub/s as necessary, Chck all other studs. Found 1 more on rhs and 1 on the lhs. Replace 9 wheel studs, 6 one rhs and 3 on rhs. Tension and fit flags. Put back online.
1487625	Carriage accumulator not working	WHILL	21/10/2022	Internal	13810.0	\$0.00	Travel to site, Repair Accumulator as necessary, Travelled to site and located unit. Checeked and adjusted pressures to 500psi. Retested operation and returned to service
1483816	The front wiper is not working	GOSMOND	6/10/2022	Internal	13597.0	\$0.00	Replace Windscreen Wiper, Diagnose non working wiper. Found arm broken at wiper pivot. Remove old wiper assembly and fit new one with new blades. Adjust sweep and test. ok. Put back online
1481380	Broken wheel studs	GOSMOND	26/09/2022	Internal	13538.0	\$0.00	Repair Hub/s as necessary, Replace 4 broken RHS drive wheel studs. Trident removed wheels and I took Photos. Refit wheels. Put back online.
1480366	13500 II 500hr service Hyster Bladed Truck C236 - 500hr Service Kit. 0500 Hour Service	511 Planning A	26/09/2022	Internal	13464.0	\$0.00	Replace 2 studs either side of previously broken studs. Found another broken stud so had to replace stud next to it. Chck tension on all nuts to 500ftpd. put back online. Steam clean equipment as necessary. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1478834	3x right handside drive studs to be replaced	GOSMOND	13/09/2022	Internal	13253.0	\$0.00	Clean truck. Perform 13500hr pm service. Replace missing bolt in fuel tank bracket. Put back online. Repair Hub/s as necessary,
1475615	13250 II 250hr service 0250 Hour Service	511 Planning B	12/09/2022	Internal	13253.0	\$0.00	Replace 3 broken RHS drive wheel studs. Steam clean equipment as necessary. 250hr Service Clean truck. Perform 13250hr pm service. Repair broken hose clip under transmission. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1475691	Inching brake is not working correctly, very jerky when using	GOSMOND	30/08/2022	Internal	12985.0	\$0.00	Adjust Transmission Control Valve to correct specification , Diagnose inching fault. Reset inching setting in Testman. Test ok. Put back online.
1475392	Replace broken wheel studs	GOSMOND	29/08/2022	Internal	2978.0	\$0.00	Repair Hub/s as necessary, Replace 5 broken RHS drive wheels studs. Put back online
1473926	13000 II 1000hr service Hyster Bladed Truck C236 - 1000hr Service Kit. 1000 Hour Service	GOSMOND	29/08/2022	Internal	12978.0	\$0.00	Steam clean equipment as necessary. 1000hr Service
1472586	12750hr 250hr service 0250 Hour Service	GOSMOND	17/08/2022	Internal	12722.0	\$0.00	Clean truck. Perform 13000hr pm service. Adjust a/c belt which was loose. Top up hyd oil. Put back online.
1471935	Broken wheel stud on LHS drive wheels	GOSMOND	15/08/2022	Internal	12722.0	\$0.00	Clean truck. Perform 12750hr pm service. Put back online. Repair Hub/s as necessary,
1469362	Replace broken wheel stud	GOSMOND	3/08/2022	Internal	12506.0	\$0.00	Replace 3 broken wheel studs RHS drive. Put back online. Repair Hub/s as necessary,
1467014	12500 II 500hr service Hyster Bladed Truck C236 - 500hr Service Kit. 0500 Hour Service	511 Planning A	3/08/2022	Internal	2506.0	\$0.00	Replace broken RHS drive wheel stud. Put back online. Steam clean equipment as necessary. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1468169	Repair oil leak	GOSMOND	28/07/2022	Internal	12384.0	\$0.00	Clean truck. Perform 12500hr pm service. Put back online. Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,
1464339	12250 II 250hr service 0250 Hour Service	GOSMOND	19/07/2022	Internal	12240.0	\$0.00	Clean truck. Replace leaking parts. Parts order on previous j/n 1463297. Check for leaks.ok Top up hyd oil. Put back online. Steam clean equipment as necessary. 250hr Service
1465351	Front wiper not working	GOSMOND	14/07/2022	Internal	12183.0	\$0.00	Clean truck. Perform 12250hr pm service. Put back online. Cleanout pit and workshop. Replace Windscreen Wiper, Wiper motor failed. Replace motor and test ok. Motor booked out on previous jobs. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1463297	Oil Leak From Valve Body	GOSMOND	6/07/2022	Internal	12034.0	\$0.00	Reseal Hydraulic Control Valve as necessary ,
1461033	12000 II 3000hr service. Hyster Bladed Truck C236 - 3000hr Service Kit. 3000 Hour Service	511 Planning A	6/07/2022	Internal	12183.0	\$0.00	Order parts Steam clean equipment as necessary. 3000hr Service Clean truck. Perform main part of 12000hr pm service. Will finish off on wednesday. Clean truck. Change diff and final drive oils. Change cab filters. Put back online. Travel to site,
1447679	Further works - leaking steer cylinder	GOSMOND	5/07/2022	Internal	12004.0	\$0.00	Repair Steering as necessary, Clean truck. Remove steer cylinder. Reseal steer cylinder. Refit to truck. Connect all lines, pins etc. Test ok. Put back online. Overhaul Steer Axle as required,
1456498	11500 II 500hr service. Hyster Bladed Truck C236 - 500hr Service Kit. 0500 Hour Service	GOSMOND	21/06/2022	Internal	11737.0	\$0.00	Repair Steer Axle as necessary, Replace Switch/es Diagnose fuel gauge reading incorrect. Order new fuel sensor. Steam clean equipment as necessary. 250hr Service Clean truck. Perform 11750hr pm service. Put back online.NOTE pics emailed.
1459355	Has an oil leak behind RHS drive wheel	GOSMOND	20/06/2022	Internal	11890.0	\$0.00	Steam clean equipment as necessary. Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Clean truck. Diagnose oil leak. Found perished hoses going from valve bank to hmu and brake valve. Replaced all hoses. Top up with oil. Test ok. Cleanup after job. PICS emailed.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1453439	The wiper in forklift H15961 will not go. Can Greg check this today as we are forecasted rain tonight.	GOSMOND	17/06/2022	Internal	11235.0	\$0.00	Repair Windscreen Wiper as necessary, Diagnose front wiper not stopping. Found intermittant relay faulty. Stole one from H15946 as it is offline. Fitted and tested ok. Put back to work. Ordered new wiper motor as was weak and new relay.
1458877	The intermittent wipers on forklift H15961 do not work. The other wiper functions are ok.	GOSMOND	16/06/2022	Internal	11652.0	\$0.00	
1456091	H15961 - fuel gauge on forklift H15961 is not working	GOSMOND	3/06/2022	Internal	11619.0	\$0.00	Steam clean equipment as necessary. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Clean truck. Perform 11500hr pm service. Change trans oil to new type. Put back online.NOTE: pics on j/n 1456091
1454464	11250 II 250hr service. 0250 Hour Service	GOSMOND	30/05/2022	Internal	11342.0	\$0.00	Steam clean equipment as necessary. 250hr Service
1451382	11000 II 1000hr service. Hyster Bladed Truck C236 - 1000hr Service Kit. 1000 Hour Service	GOSMOND	23/05/2022	Internal	11086.0	\$0.00	Clean truck. Perform 11250hr pm service. Put back online. Steam clean equipment as necessary. 1000hr Service
1440981	Two Person Job - Further works - leaking steer cylinder	GOSMOND	29/04/2022	Internal	10271.0	\$0.00	Clean truck. Perform 11000hr pm service. Put back online. Carry out Inspection and Diagnosis of Steering System
1446883	Truck Down Alternator ordered 27.4.22 - Non start - parked in the mill	GOSMOND	28/04/2022	Internal	10758.0	\$0.00	Notice leaking steer cylinder on pm service. Order parts. Truck online. Repair Alternator as required, Labour
							Diagnose non start. Batteries flat. Jumpstarted and noted alternator not charging. Order new alt. Remove old one and drop off at repairer for quote to be repaired as a spare. Replace alternator,
							Pickup new alternator. Travel to site and fit to truck. Check charge rate ok. Diagnose cameras not working. Found blown fuse. Replace fuse and test ok. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1446846	10750 II 250hr service Hyster Bladed Truck C236 - 250hr Service Kit. 0250 Hour Service	GOSMOND	26/04/2022	Internal	10744.0	\$0.00	Steam clean equipment as necessary. 250hr Service Clean truck. Perform 10750hr pm service. Put back online.
1444089	10500 II 500hr service Hyster Bladed Truck C236 - 500hr Service Kit. 0500 Hour Service	GOSMOND	26/04/2022	Internal	10745.0	\$0.00	Steam clean equipment as necessary. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Clean truck. Perform engine service only. Will get truck back later to finish service. Clean truck. Finish off 10500hr pm from other day. Remove trans dipstick and fix oil leak at junction with trans. Put back online.
1440920	Further work job for replacing worn out fan pulley on H15961?	GOSMOND	26/04/2022	Internal	10745.0	\$0.00	Repair fan assembly as required. Carry our valve clearence adjustments Pick up parts. Remove old belts and tensioner, fan drive pulley. Replace parts with new parts. Perform valve lash adjustment. Put back online.
1445476	Air con issues - not working	GOSMOND	19/04/2022	Internal	10644.0	\$0.00	Repair Air Conditioner as necessary, Diagnose no a/c. Tighten loose a/c belt. Test performance of system. Working fine. Put back online.
1445467	Broken Wheel Studs	GOSMOND	19/04/2022	Internal	10644.0	\$0.00	Repair Hub/s as necessary, Replace one broken LHS drive wheel stud. Put back online.
1442306	Two way radio not working	GOSMOND	1/04/2022	Internal	10348.0	\$0.00	Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, Two way radio not working after I removed the trans controller the other day to fix H15960. Found wiring fault and rectified it. Put back online.
1440980	Repair accumulator	GOSMOND	28/03/2022	Internal	10271.0	\$0.00	Adjust Accumulator Pressure Investigate complaint of rough riding. Check sofride accumulator. Pressure down from 500psi setting.
1440979	Broken Wheel studs	GOSMOND	28/03/2022	Internal	10271.0	\$0.00	Repressurize to 500psi. Test ok. Put back online. Repair Hub/s as necessary, Replace broken rhs drive wheel stud. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1439424	10250hr II 250hr type service. 0250 Hour Service	GOSMOND	28/03/2022	Internal	10271.0	\$0.00	Steam clean equipment as necessary. 250hr Service Clean truck. Perform 10250hr pm service. Put back online.
1437216	Broken wheel studs	GOSMOND	8/03/2022	Internal	9897.0	\$0.00	Repair Hub/s as necessary, Replace 1 rhs drive and 1 lhs drive wheel studs. Put back online.
1435153	Scheduled Service - 10000hr service II 5000hr type .5000 Hour Service	LVENN	8/03/2022	Internal	9897.0	\$0.00	Steam clean equipment as necessary. 2000hr Service Clean truck. Perform 10000hr pm service.
1432793	Scheduled Service - 9750hr service .0250 Hour Service	511 Planning D	2/03/2022	Internal	9558.0	\$0.00	Travel to site,
1435515	H15961 - Have just had a hydraulic hose fail under the front 20T forklift H15961. Unit has been tagged out, can we get this looked at asap pls.	WBRAZIL	28/02/2022	Internal	9750.0	\$0.00	Travel to site, Replace Hydraulic Hose/s and ancillary items, Attend site, diasssemble hose looms to identify faulty hose, pirtek manufacture replacement hose, replace faulty hose amd resecure hose looms, refill hydraulic oil tank, clean and washdown machine.
1429613	Scheduled Service - 9500hr service. .0500 Hour Service	WHILL	25/02/2022	Internal	9546.0	\$0.00	Travel to site, Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Steam clean equipment as necessary.
1432425	Photo's of transmission data plate	WHILL	16/02/2022	Internal	9546.0	\$0.00	Travelled to site nd located unit. Caried out service as per schedule. Cleaned and returned to service Repair Transmission as necessary, Partially rmoved trans support bar while supporting trans and took photos of data plate. Refitted all parts. Emailed photos

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1432268	Repack wheel bearings	WHILL	16/02/2022	Internal	9546.0	\$0.00	Labour Travel to site, Repair Steer Axle as necessary, Repair Air Conditioner as necessary, Adjust fan belt as required Secondary tech labour, - travel, to sight for various job, restocking partss etc at timberlink, clean aair connvaporator and condenser, adjust aor con compressor belt. Travelled to site and located unit. Had contractor remove wheels as per procedures. Removed hubs and cleaned up bearings. Found the lh side had evidence of wear. Replaced bearings. Packed bearings and refitted. Replaced hub seals and refitted hubs. Retensioned hub and got the contractor to refit the wheels. Returned unit to service
1428141	Labour to Job #1426736 Scheduled Service - 9250hr service. .0250 Hour Service	WHILL	31/01/2022	Internal	9259.0	\$0.00	
1426736	Scheduled Service - 9250hr service. .0250 Hour Service	WHILL	27/01/2022	Internal	9149.0	\$0.00	Labour Travel to site, 250hr Service 3000hr Service
1421716	Scheduled Service - 9000hr service. .3000 Hour Service	WHILL	24/12/2021	Internal	8952.0	\$0.00	Carried out pm service as per schedule. Trans service not required as trans replaced 200 hours ago.
1422857	Parts to Service Scheduled Service - 9000hr service. .3000 Hour Service Job 1421716	511 Planning C	23/12/2021	Internal	8962.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1406720	Greg to install parts week of 15.11.21 - Worn out tyne bushes Replace missing grease nipples on driveshaft.	GOSMOND	17/11/2021	Internal	8748.0	\$0.00	Repair Tyne Latch as necessary, Order parts. Labour Repair Driveshaft Assembly Clean truck. Supplied grease nipples are incorrect. Modify to fit. Fit grease nipples and grease driveshaft. Remove Lhs tyne and carrier. Remove worn out bushes and fit new ones. Remove Rhs tyne and carrier. Remove worn out bushes Fit new bushes to tyne carrier. Refit tynes to truck and test ok.
1410607	Broken RHS wheel stud	GOSMOND	26/10/2021	Internal	8748.0	\$0.00	Repair Hub/s as necessary, Replace broken rhs drive wheel stud. 250hr Service
1406627	Scheduled Service - 8750hr service II 250hr type. .0250 Hour Service	GOSMOND	18/10/2021	Internal	8747.0	\$0.00	Perform 8750hr pm service.
1408334	Replace Transmission	511 Planning A	15/10/2021	Internal	8747.0	\$0.00	Carry out Inspection and Diagnosis of Transmission Heat up and pressure test trans. Report pressures to CM. Replace filter and cut open. Lot of debris in filter. Suggest trans has failed. Repair Transmission Control Valve as necessary, Repair Transmission as necessary, Steam clean equipment as necessary. Wash truck to prepare for trans removal. Travel to site, Remove ancillary items and Transmission, Strip, Inspect and report, Replace Transmission, Travelled to site and located unit. Cleaned unit and setup truck with the crane. Drained the hydraulic tank and removed the hydraulic pump. Removed tail shaft. Drained transmission and removed. Fitted transmission and refilled with oil. Refitted all other aprts and refilled hydraulic tank. Warmed up trans and carried out calibrations. Rechecked operation and returned unit to service.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1405096	Scheduled Service - 8500hr service II 500hr type. Hyster Bladed Truck C236 - 500hr Service Kit. 0500 Hour Service	GOSMOND	1/10/2021	Internal	8514.0	\$0.00	Labour Travel to site, Steam clean equipment as necessary. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1403732	Fault Code E2249 reappeared will need further work	GOSMOND	23/09/2021	Internal	8368.0	\$0.00	No parts at TNT due to strike. Get air filter from Cummins. Travel to site. Clean truck. Carry out 8500hr pm service. Put back online.
1402796	3 x broken wheel studs	GOSMOND	17/09/2021	Internal	8590.0	\$0.00	
1399836	Scheduled Service - 8250hr service II 250hr type. .0250 Hour Service	GOSMOND	14/09/2021	Internal	8261.0	\$0.00	Steam clean equipment as necessary. 250hr Service Clean truck. Perform 8250hr pm service. Reseal leaking hyd. fitting on tyne positioner ram RHS. Clean up after job. Put back online.
1401484	Gearbox dropping out of gear - fault on dash	AMOODY	13/09/2021	Internal	8185.0	\$0.00	
1401449	Fault code E2249 reappeared; will need further works	GOSMOND	13/09/2021	Internal	8184.0	\$0.00	Flush Fuel System and lines as required, Diagnose fault code. Cummins tech came out and checked out engine. Low fuel pressure found to be caused by a blockage in the primary filter head. Cleanout blockage and test ok. Put back online.
1401363	Fault code E2249	GOSMOND	10/09/2021	Internal	8176.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System Diagnose fault code E2249. Reported as low fuel rail pressure. Replace fuel filters and test. Ok. Put back online. Checked with operator at end of day and problem has not returned.
1399095	Broken wheel stud RHS	GOSMOND	31/08/2021	Internal	8002.0	\$0.00	Repair Hub/s as necessary, Replace 2 x RHS wheel studs. Put back online.
1397169	Scheduled Service - 8000hr service II 2000hr type. .2000 Hour Service	GOSMOND	31/08/2021	Internal	8002.0	\$0.00	Steam clean equipment as necessary. 2000hr Service Clean truck. Perform 8000hr pm service. Change hydraulic oil. Put back online. Clean up after job.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1396211	Has 2 broken wheel studs on the 2 drive wheels -This problem has been going on since the forklift arrived - Tech to assess	GOSMOND	17/08/2021	Internal	7728.0	\$0.00	
1395703	Scheduled Service - 7750hr service II 250hr type. .0250 Hour Service	511 Planning D	17/08/2021	Internal	7730.0	\$0.00	Steam clean equipment as necessary. 250hr Service Clean truck(very muddy). Perform 7750hr pm service. Put back online.
1392367	WHEEL STUDS U/S	GOSMOND	17/08/2021	Internal	7730.0	\$0.00	Steam clean equipment as necessary. Repair Hub/s as necessary, Check all wheel studs and find 1 more broken one. Clean truck. Replace 2 x LHS drive wheel studs. Tension nuts and fit flags. Put back online. 17-08-21 Clean wheels. Four broken wheel studs, two each side. Remove old studs and replace with new. Put back online.
1394802	oil leak on carriage	GOSMOND	9/08/2021	Internal	7580.0	\$0.00	Replace Hydraulic Hose/s and ancillary items, Labour Diagnose leaking hose. Crimp let go. Remove hose and fit new hose. Test ok. Put back online. Get repairer to make new hose.
1394126	Repair oil leak from transmission cooler	GOSMOND	5/08/2021	Internal	8002.0	\$0.00	Pickup new hose. Remove ancillary items and Transmission Oil Cooler, Inspect and report, Refit Transmission Oil Cooler and ancillary items, Remove cooler module from truck. Replace leaking trans cooler core with one stolen from job H15947. Reassemble truck and test run. No leaks found. Order replacement parts for H15947. Labour Replace Transmission Oil Cooler, Pickup coolant. Pressure test cooler core. Cracks vertically up tubes from weld to bottom tank. Unable to be repaired. Clean up after job.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1391012	Scheduled Service - 7500hr service II 500hr type. .0500 Hour Service	511 Planning D	4/08/2021	Internal	7512.0	\$0.00	Steam clean equipment as necessary. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Clean truck. Perform 7500hr pm service. Change trans oil and filter. Change final drives and diff oils. Put back online.
1392897	Failed blower fan.	GOSMOND	2/08/2021	Internal	7512.0	\$0.00	Repair Air Conditioner as necessary, Adjust Lift Chain to correct specification, Diagnose no blower fan. Check fuses, wiring and switches. Remove blowwer fan assy. and test on bench. Motor failed. Adjusted rhs lift chain as was loose. Labour Travel to site, Replace failed blower fan with new unit. Test ok. Put back online.
1389452	Scheduled Service - 7250hr service II 250hr type. .0250 Hour Service	GOSMOND	22/07/2021	Internal	7248.0	\$0.00	Steam clean equipment as necessary. 250hr Service Clean truck. Perform 7250hr pm service. Adjust a/c belt. Put back online.
1389771	Seat adjustment lever is not working properly - Tagged out	GOSMOND	19/07/2021	Internal	7233.0	\$0.00	Repair Seat as necessary,
1389603	FAULT CODES PRESENT	GOSMOND	16/07/2021	Internal	7237.0	\$0.00	Carry out Inspection and Diagnosis of Transmission Investigate truck fault coding and no drive overnight. Multiple fault codes relating to all six trans solenoids shorted to ground. Inspect wiring but no problems found. Will let run to see if codes reappear. Check for reapperance of codes but no new ones recorded. Put back online.
1388117	wheel studs u/s	GOSMOND	9/07/2021	Internal	7038.0	\$0.00	Repair Hub/s as necessary, Clean truck. Replace one broken RHS drive wheel stud. Tension nuts and refit flags. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1385096	Scheduled Service - 7000hr service II 1000hr type. .1000 Hour Service	GOSMOND	7/07/2021	Internal	7038.0	\$0.00	Steam clean equipment as necessary. 1000hr Service
1385226	C/O WHEEL STUDS	GOSMOND	25/06/2021	Internal	6772.0	\$0.00	Clean truck. Perform 7000hr pm service. Adjust seat rails. Repair Hub/s as necessary, Replace two broken wheel studs on RHS drive and one on LHS drive. Tension and put back online. 250hr Service
1383782	Scheduled Service - 6750hr service II 250hr type. .0250 Hour Service	GOSMOND	25/06/2021	Internal	6772.0	\$0.00	Steam clean equipment as necessary. Clean truck. Perform 6750hr pm service. Put back online. Pickup parts for service. Clean truck. Perform 6500hr pm service. Put back online.
1379388	Scheduled Service - 6250hr service II 250hr type. .0250 Hour Service	WHILL	3/06/2021	Internal	6301.0	\$0.00	Travel to site, 250hr Service
1380383	4 x rhf and 2 x lhf wheel studs u/s	WHILL	2/06/2021	Internal	6301.0	\$0.00	Steam clean equipment as necessary. Travel to site, Replace Steer Wheel Studs and Nuts, Confirmed 1 broken wheel stud and replaced. Retensioned up wheel nuts and found 4 more broken wheel studs. Replaced studs and 2 nuts. Retensioned all nuts and returned unit to service. Labour
1375033	Scheduled Service - 6000hr service II 3000hr type. .3000 Hour Service	GOSMOND	18/05/2021	Internal	5992.0	\$0.00	Travel to site, Steam clean equipment as necessary. 2000hr Service Pickup parts and travel to site. Clean truck. Perform 6000hr pm service. Change trans oil and filter. Calibrate trans. Change diff and final drive oils. Replace cab filters. Put back online.
1373433	Scheduled Service - 5750hr service II .0250 Hour Service	GOSMOND	6/05/2021	Internal	5775.0	\$0.00	Steam clean equipment as necessary. 250hr Service Clean truck. Perform 5750hr pm service. Adjust a/c belt. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1373760	BENT HOSE REEL BRACKET AND INSTALL RUBBER TO MUDGUARD	GOSMOND	3/05/2021	Internal	5713.0	\$0.00	Repair Mast as necessary, Fit Mud Flaps to Unit, Clean truck. Remove hose reel bracket and straighten. Refit bracket, install hoses and adjust. Remove worn out mudflaps and make new ones. Fit new mudflaps to truck. (Customer supplied material). Put back online. Labour
1370677	Scheduled Service - 5500hr service II 500hr type.	GOSMOND	23/04/2021	Internal	5536.0	\$0.00	Steam clean equipment as necessary. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Pickup parts for pm service. Clean Truck. Perform 500hr pm service. Put back online. Labour
1369598	WHEEL STUDS U/S	GOSMOND	12/04/2021	Internal	5297.0	\$0.00	Repair Hub/s as necessary,
1369107	Front wiper is not working	GOSMOND	9/04/2021	Internal	5238.0	\$0.00	Replace 3 x broken wheel studs RHS drive. Repair Windscreen Wiper as necessary,
1368018	Scheduled Service - 5250hr service II 250hr type.	GOSMOND	8/04/2021	Internal	5242.0	\$0.00	Diagnose no interminant wiper function. Timer relay no good. Order part. Steam clean equipment as necessary. 250hr Service Clean truck. Perform 5250hr pm service. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1365428	Further Works: Replace lift chains & seat rail.	GOSMOND	8/04/2021	Internal	6502.0	\$0.00	Labour Steam clean equipment as necessary. Replace Lift Chain, Replace seat rails. Test ok. Pickup lift chains. Cut to length and start to remove. Had to refit as spare truck developed a fault and they needed it back. Will finish job on Tuesday. Put back online. Adjust Lift Chain to correct specification, Remove old lift chain and fit new chain. Adjust chains to give correct clearance under tynes. Put back online. Clean up after job. Strap up old tynes. Put old chains in scrap.
1368191	2 broken wheel studs on the drive wheel. Tagged out. - tech to assess for customer damage.	GOSMOND	6/04/2021	Internal	5183.0	\$0.00	Steam clean equipment as necessary. Repair Hub/s as necessary, Clean truck. Replace 3 broken wheel studs RHS Drive. Check all others. Put back online.
1362272	Scheduled Service - 5000hr service II 1000hr type	GOSMOND	2/04/2021	Internal	5062.0	\$0.00	Steam clean equipment as necessary. 5000hr Service Clean truck. Perform 5000hr pm service. Blow out cab air precleaner. Replace a/c and fan belts. Replace engine prefilters. Put back to work.
1365982	BROKEN WHEEL STUDS	GOSMOND	23/03/2021	Internal	4953.0	\$0.00	Repair Hub/s as necessary, Clean truck. Replace 2 wheel studs lhs drive, 1 on rhs drive.
1365223	Front wiper is not working. Still in use.	GOSMOND	19/03/2021	Internal	3871.0	\$0.00	Repair Windscreen Wiper as necessary, Diagnose no front wiper. Found blown fuse. Replace fuse. Test ok. Put back online. Order parts for preemptive jobs.
1364554	THROTTLE POSITION SNSOR U/S	GOSMOND	16/03/2021	Internal	4953.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System Order part Replace Switch/es Fit and calibrate new throttle position sensor. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1364370	Broken wheel stud - Tech to assess for cust damage	GOSMOND	16/03/2021	Internal	3814.0	\$0.00	Repair Hub/s as necessary,
1363885	TRANS IN LIMP MODE	GOSMOND	12/03/2021	Internal	4747.0	\$0.00	Replace two broken wheel studs RHS drive. Carry out Inspection and Diagnosis of Transmission Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, Truck presents with t709 code and in limp mode. Code relates to open circuit k3 solenoid. Clean truck and remove solenoid covers from trans. All 6 solenoids ohmed out the same. Trace wiring inside trans to plug and check ok. Trace wiring from trans plug to back of cab. No continuity to solenoid 6. Check between trans plug and main loom ok. Wire broken between cab plug and trans interface plug. No signs of damage. Run new wire to bypass loom. Test ok. Put back online.
1362274	FURTHER WORKS - LIFT CHAIN REPLACEMENT	511 Planning D	5/03/2021	Internal	4667.0	\$0.00	
1361779	Unit will not go into gear.	GOSMOND	3/03/2021	Internal	4747.0	\$0.00	Carry out Inspection and Diagnosis of Transmission Replace Transmission Control Lever, Diagnose no drive. Transmission showing te nn (forced neutral on dash). Check wiring and function to seat and seat belt switch. OK. Found faulty trans shift lever. Cleaned up ols spare and fitted it. Will order new as gear selection not working correctly as is not the correct unit for the truck. Put back online. Pickup new part. Fit new lever to truck. Test ok. Put back online. Steam clean equipment as necessary.
1359298	Scheduled Service - 4500hr service II 500hr type .Level B Service	GOSMOND	1/03/2021	Internal	4660.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Adjust Transmission Control Valve to correct specification , Clean truck. Perform 4500hr pm service. Replace trans oil and filter. Calibrate trans. Replace diff and final drive oils. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1360559	Repair oil leak	WBRAZIL	25/02/2021	Internal	4340.0	\$0.00	<p>Travel to site,</p> <p>Steam clean equipment as necessary.</p> <p>Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,</p> <p>Labour</p> <p>Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,</p> <p>Travel to site, clean and diagnose leaking sideshift fittings, travel to tooling and consumables, replace fitting orings.</p>
1354533	Scheduled Service - 4250hr service II 250hr type.	GOSMOND	15/02/2021	Internal	4313.0	\$0.00	<p>250hr Service</p> <p>Steam clean equipment as necessary.</p> <p>Repair Air Conditioner as necessary,</p> <p>Repair Seat as necessary,</p> <p>Clean truck. Perform 4250hr pm service. Adjust a/c belt. Tighten loose seat mounting bolts. Put back online.</p>
1356642	LH TIE ROD C/O REQUIRED	GOSMOND	8/02/2021	Internal	5063.0	\$0.00	<p>Replace Tie Rod End/s,</p> <p>Order parts to replace worn lhs tie rod end.</p> <p>Replace LHS tie end and both pins. Manually grease and reconnect greaser lines. Test ok. Put back online.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1353311	Scheduled Service - 4000hr service II 2000hr type.	GOSMOND	2/02/2021	Internal	4048.0	\$0.00	Steam clean equipment as necessary. 4000hr Service, Clean truck. Perform 4000hr pm service. Tighten loose wear blocks mast lower. Travel to site, Carry our valve clearence adjustments Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Check/Inspect/Diagnose Hydraulic Pump and test operation, Adjust Inner Channel Mast Rollers to correct specification, Repair Hub/s as necessary,
1354791	RH DRIVE WHEEL STUDS U/S	GOSMOND	1/02/2021	Internal	4048.0	\$0.00	Replace 2 broken wheel studs RHS drive. 250hr Service
1350047	Scheduled Service - 3750hr service II 250hr type.	GOSMOND	18/01/2021	Internal	3470.0	\$0.00	Carry out 3750 hr pm service. Repair Hub/s as necessary,
1351978	Broken wheel stud	GOSMOND	15/01/2021	Internal	3470.0	\$0.00	Replace broken wheel stud RHS drive. Steam clean equipment as necessary.
1351858	Hydraulic oil leak / blown hose	GOSMOND	15/01/2021	Internal	4588.0	\$0.00	Replace Hydraulic Hose/s and ancillary items, Top up Hydraulic Oil to correct level, Labour Diagnose oil leak. Blown hose on carriage. Borrow hose from 46 and fit to truck. Test ok. Top up oil. Put back online. Refit Hydraulic Hose/s and ancillary items, Pick up new hose.Fit to truck.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1350164	Front facing camera issue	WBRAZIL	6/01/2021	Internal	3712.0	\$0.00	Repair Visual display unit as necessary, Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, Remove covers and ancillaries, remove and refit varying components of camera system from stricken unit (46) trial components on 61, test all wiring. head unit found to be faulty.
1350131	Repair camera	GOSMOND	6/01/2021	Internal	3671.0	\$0.00	Repair Visual display unit as necessary,
1348665	Broken wheel stud on the drive wheel.	STRIGG	29/12/2020	Internal	3667.0	\$0.00	Travel to site, Labour Replace Steer Wheel Studs and Nuts, travel to tarpeena and replace wheel studs and nuts Repair Mast as necessary, Both bolts holding bracket on broken. Remove bolts and inspect. Stress cracks caused the failure. Replace 1/2 inch bolts with m14 bolts. Reattach and tighten up. Put back online. Steam clean equipment as necessary.
1347450	Light bracket on the mast has come loose	GOSMOND	17/12/2020	Internal	3549.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1346428	Scheduled Service - 3500hr service II 500hr type.	GOSMOND	16/12/2020	Internal	3492.0	\$0.00	Clean Truck. Perform 3500hr pm service. Put back online Steam clean equipment as necessary.
1343113	Scheduled Service - 3250hr service II 250hr type	GOSMOND	11/12/2020	Internal	3385.0	\$0.00	250hr Service Clean truck. Perform 3250hr pm service. Tighten a/c belt. Put back online.
1340582	Drive wheel has broken wheel studs.	GOSMOND	17/11/2020	Internal	3013.0	\$0.00	Travel to site, Repair Hub/s as necessary, Travel to site. Replace 5 broken wheel studs RHS drive. Tension wheel nuts and refit indicators. Put back online. Steam clean equipment as necessary.
1338374	Scheduled Service - 3000hr service II 3000hr type.	GOSMOND	17/11/2020	Internal	3013.0	\$0.00	3000hr Service Clean truck. Perform 3000hr pm service. Put back online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1340377	CW-Camera recorder time stamps are out. Not reading correct date/ time ect.	GOSMOND	16/11/2020	Internal	4436.0	\$0.00	Adjust Attachment to correct specification, Diagnose incorrect timestamps on recordings. Found procedure to set time. Remove sd card and create date.txt. Fit back to truck and test. Ok. Put back online. Steam clean equipment as necessary.
1336910	Scheduled Service - 2750hr service II 250hr type	GOSMOND	9/11/2020	Internal	2852.0	\$0.00	250hr Service
1329916	Scheduled Service - 2500hr service II 500hr type	GOSMOND	26/10/2020	Internal	2595.0	\$0.00	Clean truck. Perform 2750hr pm service. Put back online. Steam clean equipment as necessary. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1334671	Transmission Cooler leaking Oil - Prts Wty	511 Planning A	19/10/2020	External	2444.0	\$5,222.49	Clean truck. Carry out 500hr pm service. Removed belley plate and top cover. Drained coolant. Disconnected trans cooler lines. Removed trans cooler assembly and fitted new one. Refitted all parts. Refilled cooling system. Checked trans fluid level. Bled cooling system. Checked operation and returned to service. Repair Hub/s as necessary,
1334652	CW - Wheel stud is broken on RHS drive wheel - Tagged out	GOSMOND	19/10/2020	Internal	2464.0	\$0.00	Broken wheel stud rhs drive. Checked all other and found 1 more on the rhs and another on the lhs drive. Replaced wheel studs and tensioned all nuts. Fill up greaser. Adjust loose a/c belt.
1334447	Indicator switch not working	GOSMOND	19/10/2020	Internal	2452.0	\$0.00	Retension wheel nuts and fit indicators. Replace Switch/es Labour
1326459	Scheduled Service - 2250hr service II 250hr type.	GOSMOND	24/09/2020	Internal	2262.0	\$0.00	Replace faulty indicator switch. Travel to site, Steam clean equipment as necessary. 250hr Service Carry out 250hr pm service.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1324884	Transmission Cooler leaking Oil	GOSMOND	4/09/2020	Internal	2262.0	\$0.00	<p>Travel to site,</p> <p>Repair Transmission Oil Cooler as necessary,</p> <p>Carry out Inspection and Diagnosis of Transmission</p> <p>Identify and order part.</p> <p>Steam clean equipment as necessary.</p> <p>Clean down. Order parts</p> <p>Remove ancillary items and Transmission Oil Cooler , Inspect and report,</p> <p>Remove intercooler to access trans cooler.</p> <p>Labour</p> <p>Replace Transmission Oil Cooler,</p> <p>Flush and Replace Cooling System Coolant</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>Removed belley plate and top cover. Drained coolant. Disconnected trans cooler lines. Removed trans cooler assembly and fitted new one. Refitted all parts. Refilled cooling system. Checked trans fluid level. Bled cooling system. Checked operation and returned to service.</p> <p>Repair Tyne Latch as necessary,</p> <p>Diagnose worn bushes. Order parts</p> <p>Pickup parts.</p> <p>Travel to site,</p> <p>Replace Sideshift Bushes/Bearings,</p> <p>Replace Forks/Tynes,</p> <p>Replace sideshift bushes. Refit tyne carriers to truck. Refit tynes to truck. Pack up and cleanup after job.</p>
1324883	Tyne positioner bushes worn	GOSMOND	4/09/2020	Internal	2262.0	\$0.00	<p>Diagnose worn bushes. Order parts</p> <p>Pickup parts.</p> <p>Travel to site,</p> <p>Replace Sideshift Bushes/Bearings,</p> <p>Replace Forks/Tynes,</p> <p>Replace sideshift bushes. Refit tyne carriers to truck. Refit tynes to truck. Pack up and cleanup after job.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1324684	CW-Grinding noise coming from the LHS drive wheel. Tagged out.	GOSMOND	4/09/2020	External	1972.0	\$2,965.89	Remove ancillary items and Hub/s, Strip, Inspect and report, Remove lhs steer wheel hub and bearings. Identify bearings and order from local supplier as hyster parts from o/s. Repair Hub/s as necessary, Refit Wheel/s and ancillary items, Pickup parts from TNT. Pickup parts from Bearing supplier. Clean up parts. Fit new bearings and reassemble as per service manual. Refit steer wheel and tension. Test drive ok. Put back online.
1320449	Scheduled Service - 2000hr service II 2000hr type .Level B Service	GOSMOND	3/09/2020	Internal	1972.0	\$0.00	Replace Steer Wheel Bearings, 2000hr Service
1324056	Light bracket on the mast is coming lose- Still in use.	GOSMOND	1/09/2020	Internal	1929.0	\$0.00	Clean machine. Carry out 2000hr pm service. Calibrate transmission. Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,
1320448	Scheduled Service - 1750hr service II 250hr type.	WHILL	27/08/2020	Internal	1558.0	\$0.00	Tighten loose mounting bolts reel bracket. Test ok. Put back online. 250hr Service
1322419	Wheel stud on the front LHS is broken.- Tagged out.	WHILL	25/08/2020	Internal	1784.0	\$0.00	Replace Steer Wheel Studs and Nuts,
1308316	Scheduled Service- 1500hr service II 500hr type. Level B Service.	GOSMOND	11/08/2020	Internal	1502.0	\$0.00	Sourced parts. Replaced broken wheel stud. Retensioned wheel nuts. Steam clean equipment as necessary. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Clean truck. Perform 1500hr pm service.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1312778	Replace RHS wheel studs	GOSMOND	9/07/2020	Internal	1287.0	\$0.00	Repair Hub/s as necessary, Remove rhs drive wheel studs. Repair Wheel/s as necessary, Flap disc all mateing surfaces. Warren fitted new wheel studs. Warren assisted refitting wheels and tension nuts to spec. Labour Travel to site, Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1308533	CW-Making a loud grinding noise. Tagged out.	GOSMOND	22/06/2020	External	1328.0	\$15,238.11	<p>Carry out Inspection and Diagnosis of Drive Axle</p> <p>Replace Steer Wheel Bearings,</p> <p>Diagnose noise from driveline. Check diff and final drives. OK. Found bearing failure rhs steer wheel. Remove wheel and remove hub. Order parts and email Scott to get him in the loop.</p> <p>Labour</p> <p>Repair Wheel/s as necessary,</p> <p>Replace Right King Pin,</p> <p>Remove wheel studs to reuse in new hub. Remove remains of inner bearing race. Found material transferred from bearing race to spindle. Unable to remove material as is too hard to file. Prepare parts list. Remove damaged spindle from axle. Stopped at last step until lifting equipment is used.</p> <p>Remove spindle and clean up for photos. Clean up hub for photos.</p> <p>Repair Steer Axle as necessary,</p> <p>Chase up where parts are. Remove and straighten spindle shims.</p> <p>Travel to site,</p> <p>Replace King Pin Bearings,</p> <p>Replace Load Wheel Bearings,</p> <p>Pick up parts. Order parts and continue with job.</p> <p>Pickup parts. Continue fitting parts to spindle ready to fit to truck.</p> <p>Repair King Pins,</p> <p>Pickup parts. Pack bearings and fit. Fit new spindle and adjust bearing preload. Fit new hub and set bearing preload. Fit steer wheel and tighten nuts.</p> <p>Retension wheel nuts and fit indicators.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1300158	Broken Wheel Studs	511 Planning D	22/06/2020	External	815.0	\$356.10	Repair Hub/s as necessary, Two broken drive wheel studs rhs. Remove broken stds and fit new ones. Tension wheel nuts to spec. Reset trans change of direction from 2mph to 1mph. Put back online.
1308242	Scheduled Service - 1250hr service-250hrtype. Level A Service.	GOSMOND	19/06/2020	Internal	1271.0	\$0.00	Found another broken stud on retension of wheel studs. Reused the nut. Replaced the stud. Steam clean equipment as necessary. 250hr Service Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Clean truck. Carry out 250hr pm service. Adjust door latch. Repair Windscreen Wiper as necessary,
1306411	CW-Auto greaser is leaking + Wiper issue	GOSMOND	15/06/2020	Internal	1205.0	\$0.00	Leak at outlet of auto greaser. Tighten hose fitting and test ok. Wiper blades falling apart. Reassemble and crimp end to hold together. Test ok.
1303430	NEW SET OF TYNES	BIG TRUCK SA	15/06/2020	Internal	1009.0	\$0.00	
1305025	CW-Rear lights are not working. Still in use	GOSMOND	10/06/2020	Internal	1012.0	\$0.00	Repair Light Circuit as required, Diagnose no rhs rear worklight. Found the infamous twist and tape. Repaired loom and test ok. Put back online. 1000hr Service Steam clean equipment as necessary.
1302902	Scheduled Service - 1000hr service II 1000hr type. Level C.	GOSMOND	4/06/2020	Internal	1012.0	\$0.00	Carry out 1000hr pm service. Repair Wheel/s as necessary, Clean truck. Replace broken wheel stud LHS drive. Mark new stud with red paint to see if the same one is failing. Tension all studs. Put back to work. 250hr Service
1302831	CW-Broken wheel stud for the drive wheel. Tagged out.	GOSMOND	3/06/2020	Internal	993.0	\$0.00	Carry out 750hr pm service. Travel to site, Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, replace mast light bracket bolts.
1297210	Scheduled Service - 750hr service II 250hr type.	GOSMOND	25/05/2020	Internal	813.0	\$0.00	
1298624	CW-Mast light bracket bolts have fallen off- Tagged out.	WBRAZIL	18/05/2020	Internal	680.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1298270	CW - Oil leak underneath cab, somewhere. Unknown source - Tagged out. URGENT.	GOSMOND	15/05/2020	Internal	669.0	\$0.00	Travel to site, Steam clean equipment as necessary. Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Top up Hydraulic Oil to correct level, Travel to site. Clean truck. Diagnose oil leak. Blown o ring on plug because was only finger tight. Replaced o ring and refitted plug. Topped up hyd oil. Test ok.
1298174	Repair auto greaser fault codes	GOSMOND	14/05/2020	Internal	669.0	\$0.00	Repair Attachment as necessary, Diagnose fault 12 with greaser. Continue with diagnosis. Follow troubleshootin in manual. No leaks visable. Refill resevoir with grease. Run test cycles, fault has now gone. Put back to work.
1296698	Air seat leaking	GOSMOND	8/05/2020	External	601.0	\$238.40	Unable to claim warranty for no fault found Repair Seat as necessary, Travel to site, Air seat deflating. Found leak at inflation switch. Repair seal into switch. Test ok. Put back to work.
1295733	Scheduled Service - 500hr service II 500hr type. Level B Service	GOSMOND	6/05/2020	Internal	523.0	\$0.00	Travel to site, Steam clean equipment as necessary. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Adjust Transmission Control Valve to correct specification , Carry out 500hr pm service. Calibrate transmission. Clean up after job.
1293894	Windscreen popping out	GOSMOND	28/04/2020	External	351.0	\$329.00	Replace Windscreen,
1293764	CW-Oil leak from the valve bank on the mast. Tagged out.	GOSMOND	28/04/2020	External	351.0	\$259.25	Proactively shim and silastic in windscreen Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Top up Hydraulic Oil to correct level, Diagnose oil leak. Blown o ring on danfoss valve. Clean and remove pipes etc. to get access. Replace o ring from one in my kit. Test ok. Top up hydraulic oil.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1292107	Scheduled Service - 250hr service II 250hr type	GOSMOND	24/04/2020	Internal	351.0	\$0.00	250hr Service Carry out 250hr initial service. Change engine oil and filter. Change trans oil and filter. Change diff and final drives oil. Replace brake oil filter. Carry out other checks and adjustments as per service schedule.
1291303	CW - Forward facing camera is not working - still in use.	GOSMOND	16/04/2020	Internal	669.0	\$0.00	Fit Full Camera Kit, Substitute with known good camera. No good. Bypass sections of loom still no camera working. Continue with diagnosis. Go into setup menu and reset camera. Camera now works.
1290810	Scheduled Service - 1ST 100HR SERVICE	GOSMOND	14/04/2020	Internal	120.0	\$0.00	100Hr Service Repair Wheel/s as necessary,
1290686	CW - Mast lights are not working	GOSMOND	14/04/2020	Internal	351.0	\$0.00	Carry out 100hr pm service. Retension wheel nuts. Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Replace Switch/es Repair Visual display unit as necessary, Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Diagnose and check wiring to mast lights. No power to wiring. Switch in dash missing. Fit bridge wire and order switch. Unable to jack up cab. Tilt cylinder had fallen off pivot point. Lift cab with crane and refit tilt cylinder. Front camera not working. Check wiring seems ok. Further investigation needed. Oil leak around hyd. oil filter cap. No o ring. Fit new o ring test ok. Adjust Lift Chain to correct specification, Adjust aiming of worklights. Adjust lift chains. Lock nuts loose. Labour Fit new switch and test ok.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1290083	Calibrate transmission + fit tynes	GOSMOND	8/04/2020	Internal	11.0	\$0.00	Repair Transmission as necessary, Remove ancillary items and Forks/Tynes, Inspect and report, Refit Forks/Tynes and ancillary items, Steam clean equipment as necessary.
1290073	Fit Radio	501WORKSHOP	8/04/2020	Internal	10.0	\$0.00	Calibrate speed limiter. Swap tynes from existing truck to this truck. Prep to put online.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15961		Description: Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above					
Make: HYSTER		Model: H20XM-9		Serial No.: C236E03539T			
1200016	Prep for Rent; Timberlink	GOSMOND	9/04/2019	Cap Prep	10.0	\$0.00	<p>Prepare For Sale - Workshop</p> <p>Refit Mast and ancillary items,</p> <p>Fit Fleet Management System as required,</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>Adjust Mast to correct specification,</p> <p>Refit Forks/Tynes and ancillary items,</p> <p>Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,</p> <p>Install Turbo Timer,</p> <p>Replace Switch/es</p> <p>Fit Full Camera Kit,</p> <p>Install Light/s</p> <p>Remove ancillary items, prepare and Paint unit as required,</p> <p>Refit Hydraulic Hose/s and ancillary items,</p> <p>Carry out New Equipment Predelivery to correct specification.</p> <p>Install Fire Extinguisher,</p> <p>Replace Mast Hanger Bushes,</p> <p>Carry out Inspection and Diagnosis of Telemetry System</p> <p>Install Radio,</p> <p>Install Wheel Nut Indicators,</p> <p>Prepare For Hire - Workshop</p> <p>Remove ancillary items and Hydraulic Hose/s, inspect and report,</p> <p>Remove ancillary items and Forks/Tynes, Inspect and</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
---------	-------------	----------	------	----------	----------	--------	-------

Owner: ADAP001
Equip. Code: H15961 **Description:** Hyster H20XM-9 - Timberlink to pay for repair costs \$5000 and above
Make: HYSTER **Model:** H20XM-9 **Serial No.:** C236E03539T

report,

 Remove ancillary items and Mast, Strip, Inspect and report,

 Install Stickers,

 Repair Engine Intake Ducting as required,

 Travel to site,

 Found dignostic plug inaccessible. Removed modules and relocated plug. Refitted all parts. Adjusted speeds and trans restrictions. Removed mast and cab pressurizer ready for transport. Travelled to site and refitted mast and replumbed up. Refitted and reconnected pressurizer.

 Steam clean equipment as necessary.

 Adjust Accumulator Pressure

Equipment Total:	<u>\$31,611.36</u>
Customer Total:	<u>\$31,611.36</u>