

ADAPT-A-LIFT GROUP PTY LTD

Service History Listing Active Units

Date: 19/06/2026

Time: 11:08:40AM

For Equipment Code From: H2772N To: H2772N

For Customer Code From: All To: All

For Date Posted From: All To: All

For Branch Code From: All To: All

Don't Show Cost

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H2772N		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R04240E			
1825223	Prep for Auction	NWILLIAMS	12/05/2026	Internal	11797.0	\$0.00	Carry out equipment condition assessment unit was preped for hire a month ago and is clean all functions are working fluid oil and water levels were checked no pressure wash required

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H2772N		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R04240E			
1805563	Minor repairs	RBLACKMORE	2/03/2026	Internal	11797.0	\$0.00	<p>Remove ancillary items and Remove Drive Wheel from unit, Remove ancillary items and Remove Drive Shaft Assembly from unit, Remove wheel/s, Remove Brake drum/s, Drain and refill differential oil, Remove ancillary items and Mirror and Replace, Refit Mirror and ancillary items, Repair Light Bracket as required, Replace Lift Chain, Remove Steering Arm Assembly, Replace Ignition Spark Plugs as required, Replace Light/s Replace Light Bracket as required,</p> <p>Replace Brake master cylinder,</p> <p>Replace Brake Wheel Cylinders,</p> <p>Replace brake shoe/s,</p> <p>Refit Brake drum/s and refit Wheel/s,</p> <p>Repair Brake pipe/s as required.</p> <p>Refit Drive Axle Assembly, refit ancillary items,</p> <p>Refit Wheel/s and ancillary items,</p> <p>Replace Tie Rod End/s,</p> <p>Servicd/cleaned starter motor and solenoid. Replaced link pins. extracted screws from right kingpin cover and re-gasket. Replaced freelif chains Right Working light and bracket. Brake lights Replaced brake drums Removed trunion assembly to access stuck bolts in King pin</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H2772N		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R04240E			
1805199	GREEN TAG	RBLACKMORE	27/02/2026	Internal	11795.0	\$0.00	<p>Steam clean equipment as necessary.</p> <p>Carry out equipment condition assessment</p> <p>-Clean Machine - Worst machine I have seen yet</p> <p>-Load Backrest Bent</p> <p>-Right Mirror 1pc - RP6123</p> <p>-Working Light 1pc RP6170</p> <p>-Brake Light 2pc - 4626002</p> <p>-Brake pull to right need check</p> <p>-Right Fork Tip damaged</p> <p>-FreeLift Chains need replacing more than 4% stretch</p> <p>-FL Hoses</p> <p>-Steering pin Link - 2021793</p> <p>-Steering Bushing Link - 2021794</p>
1805206	Scheduled Service Job. Hyster B466_0500Hr SvKit LPG_Maz_H2.0-3.5TX. 0500 Hour Service	RBLACKMORE	28/09/2025	Internal	11797.0	\$0.00	<p>Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.</p> <p>-Change Oil</p> <p>-Oil Filter</p> <p>-Clean Distributor Points</p> <p>-Grease Mast and Rollers</p> <p>-Lubricate chain</p> <p>-Grease Mastpoints.</p> <p>-New Air filter - Rhian had part</p> <p>Did not grease steering as pins will need to be changed</p>
1720403	FW from 1720107 - Fanbelt worn and Seat worn	DPhangnalay	27/05/2025	Internal	11355.0	\$0.00	<p>Prepare For Hire - Workshop</p> <p>Travel to site,</p> <p>Replace Fan Belt,</p> <p>Removed and replaced fan belt as required. Need to return to replace the seat.</p> <p>Repair Seat as necessary,</p> <p>Labour</p> <p>Seat cushion is to difficult to remove without braking parts. Ordered seat and returned the cushion.</p> <p>Replace Seat,</p> <p>Removed and replaced seat as required.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H2772N		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R04240E			
1720107	Unit has broken down and is making weird noises. Maybe a timing belt issue they are unsure though etkt #1116405	DMackay	26/05/2025	Internal	11346.0	\$0.00	Travel to site, Carry out equipment condition assessment Adjust fan belt as required Adjust Timing chain to correct specification , Adjust Carburettor to correct specification, Travel to site, locate onsite contact & assess machine - started perfectly fine buy engine noisy & dash vibrating badly. Traced engine noise to distributor so R&R top timing belt cover & inspect - tightened timing belt & fanbelt. Engine noise much improved so adjusted carburetter to smooth engine operation/quieten dash. Excess travel home REPAIRS REQUIRED: -Service due -Fanbelt worn -Seat worn CUSTOMER DAMAGE: -Right worklight -Right mirror missing -Right taillight lens broken
1805200	Scheduled Service Job. Hyster B466_0500Hr SvKit_LPG_Maz_H2.0-3.5TX. 0500 Hour Service		1/04/2025	Internal	11795.0	\$0.00	
1705463	Scheduled Service - BB IC 2000HR SM .2000 Hour Service	201WSHOP-ALLOCATOIN	1/04/2025	Internal	10962.0	\$0.00	
1663338	CANCELLED Replace Seat, Tynes 1070 & RH mirror.	901QUOTE SENT01	9/10/2024	Internal	10962.0	\$0.00	No approval provided to proceed with damaged repairs - quotes cancelled pending review at a later date or time of de-hire
1658918	Scheduled Service - DG IC 500HR SM .0500 Hour Service	DPhangnalay	3/10/2024	Internal	10962.0	\$0.00	Travel to site, Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Carried out 500hr service as required. Seat and tynes are worn out and need replacing. Tynes are 1070 unit is missing RH mirror.
1612030	CANCELED Replace Seat, RHS mirror& RHS headlamp	901QUOTE SENT01	2/04/2024	Internal	10729.0	\$0.00	No approval provided to proceed with damaged repairs - quotes cancelled pending review at a later date or time of de-hire.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H2772N		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R04240E			
1611087	FW 1589196- Visible oil leak suspected valve cover gasket. steer tyres need replacement (600x9)	SUBC-RNT20102	26/03/2024	Internal	10759.0	\$0.00	Travel to site, Remove ancillary items and repair Engine Oil Leaks as required, Refit ancillary items, Removed and replaced rocker cover gasket as required. Cleaned up the oil leak. return to service. Carry out Inspection and Diagnosis of Wheel all four wheels need to be replaced on unit. drive wheel (x2) 7.00 - 12. steer wheel (x2) 6.00 - 9. non-marking.
1589196	*UPGRADED Scheduled Service - GS IC 1000Hr SM - 13000Hrs Hyster B466_1000Hr SvKit_LPG_Maz_H2.0-3.5TX. 1000 Hour Service	MPERIA	26/03/2024	Internal	10729.0	\$0.00	Travel to site, 1000hr Service travel to site locate machine 1000hr service carry out preventive Maintenance Service and safety inspection in the line with agreed scope of works report on condition of Equipment and additional works requirement notes seat damaged (see photo) right hand side mirror missing (see photo) right hand headlamp damaged (see photo) visible oil leak suspected valve cover gasket (see photo) steer tyres need replacement (600x9) (see photo)
1454570	Scheduled Service - NKA- 4000hr IC SM - 9000hrs .4000 Hour Service	MPERIA	16/02/2023	Internal	10149.0	\$0.00	Travel to site, 4000hr Service, carry out preventive maintenance service and safety inspection in the line with agreed of scope of work. NOTE For replacement of gasket (leak) For replacement of headlight 1pc Missing side mirror 1pc
1427464	Unit needed to be jump started this morning.	AKALANJ	28/01/2022	Internal	9665.0	\$0.00	Travel to site, Carry out Inspection and Diagnosis of Electrical System Labour Replace Battery, Travel to site and sign in. Complete take 5 safety screen. Diagnose and load test battery and starting system. Test output of alternator. Leave site to obtain new battery. Return to site and fit battery. Retest out put of alternator. Test start engine a few times and return unit to operator .

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H2772N		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R04240E			
1361167	Bolt has snapped at the weld on the side backrest of the tynes causing the backrest to detach.-tech to assess for customer damage.	SPETERSON	1/03/2021	Internal	9316.0	\$0.00	Travel to site, Replace Load Guard, travelled to siteeeee, inspected unit, load guard broken, go to workshop and pick up new load guard. Returned to site and fitted new load guard
1345429	steers need replacing : 600x9 white non markers (from JN 1344841)	201SUBC	8/12/2020	Internal	9265.0	\$0.00	
1344841	MONDAY 7TH - Scheduled Service - 500 Hour Service .0500 Hour Service	SPETERSON	7/12/2020	Internal	9265.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. travelled to site, unit not available to 8:30, go to workshop , 500 hr scheduled maintenance, repair lights, steer tyres need replacing 600x9 white non marking
1299384	RATING PLATE ON OWEN DESK - Gather info for Load rating plate. Templete emailed to you.	ALI	20/05/2020	Internal	9124.0	\$0.00	Travel to site, Carry out equipment condition assessment travel to site. check unit. requests a new rating plate for using jib(work cover). east west engineering jib: fjs45,#111007. 95kg, 4500kg@670mm. hcg 735mm. all other details see photos. customer ask service date. Labour to base. rating plate not arrived yet. Repair Attachment as necessary, pick up in DP. to site. locate unit. fit a new rating plate. to base, drop off waste, stock van.
1276696	mast hydraulic hoses need repair, cust request tech to fix while on site for another task	MSHAHEEM	13/02/2020	Internal	9023.0	\$0.00	Remove ancillary items and Hydraulic Hose/s, inspect and report, Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Refit Hydraulic Hose/s and ancillary items, Mast roller mount loose. Removed mast hydraulic hoses, rollers, repaired mount and fit back. Test,ok.
1276601	Gather info for Load rating plate. Templete emailed to you.	MSHAHEEM	12/02/2020	Internal	9023.0	\$0.00	Carry out equipment condition assessment Gather information for load rating plate. Images attached for further clarification. Customer requires narrow tynes as well for extension slippers. Size 1070x40x100 class 2.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H2772N		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R04240E			
1243347	Hose at the front has come off the pully, tech to assess for damage - tagged out	DPhangnalay	25/09/2019	Internal	8857.0	\$0.00	Travel to site, Check/Inspect/Diagnose Cylinder Remove ancillary items and Hydraulic Hose/s, inspect and report, Carry out Inspection and Diagnosis of Attachment Labour Repair Sideshift Cylinder as necessary, Top up Engine Oil as required, Refit Hydraulic Hose/s and ancillary items, Top up cooling system, Travelled to site, contacted site manager, located unit, organised work area. Carried out diagnosis on oil leak. Oil leak is coming from the LH side shift over mast hose. Hose has frade and got caught on the hose capping causing it to pull and stretch off the pully. Its also damaged the hydraulic tube on the carriage. Removed hoses and organised bj hydraulics to come out. Reverse buzzer wasnt working. Removed covers and checked buzzer. Travelled to work shop to organised reverse buzzer and hydraulic tube. Return to site. Blew off unit and cleaned out radiator. Topped up coolant and engine oil. Fitted hydraulic tube and hoses. Horn is on order. will return to fit once i get the part. Return unit to customer Remove and Replace Reverse buzzer, Refit to unit, Travelled to parts, Travelled to site. Carried out replacing reverse buzzer. Test unit ok
1223454	Gather information for New Load plate	DPhangnalay	10/07/2019	Internal	8737.0	\$0.00	Travel to site, Carry out Inspection and Diagnosis of Attachment Travelled to workshop to print out forms. travelled to site. conacted site manager. was advised he wanted a load plate made up for the attachment jib. took photos of load plates.see photo. advised manager i would return tomorrow cause operator was busy on unit Carry out equipment condition assessment Customer wants load plate made up for unit to suit the jim attachment. see photos for refs. ive taken photos of all the load plates off the unit and jib attachment. ive taken more than one photos of some cause they were unclear. CUSTOMER HAS REQUESTED AN EMAIL CONFIRMATION FOR LOAD PLATE APPLICATION ASAP

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H2772N		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R04240E			
1222722	Unit switches off every 2-3 mintues	DPhangnalay	8/07/2019	Internal	8732.0	\$0.00	Carry out Inspection and Diagnosis of Electrical System Steam clean equipment as necessary. Adjust Carburettor to correct specification, Carried out diagnosis on rough idle. unit was very dirty and dusty. clean down unit. unit idling really rough, adjusted screw on gas regulator which stopped the rough idle. test unit. unit still stalling under load, adjusted idle screw on the carburetor. test functions ok. Oil is leaking from the rocker cover see photos. unit needs a service Scheduled Service - Site Contact: Darren 0410 734 288
1145277	4000hr IC Scheduled Service - Site Contact: Darren 0410 734 288	SKHAN	14/09/2018	Internal	8383.0	\$0.00	03/10 KM - req service kit be sent to SKHAN DP. Once parts arrive will contact customer to book in. PS requested NPARRA action 08/10 KM - followed up Parts as nothing booked to the job 16/10 KM - unable to make contact with customer to book in. Have asked CST to assist with scheduling in. 17/10 DS - Called the office of this business to see if they can get someone to call me in relation to this service. She will get Amar to call me back on my mobile as Darren is not able to answer his mobile in the warehouse. 4000hr Service, Complete 4000 hour service. To be continued tomorrow Travel to site, Came here this afternoon with the intention of completing the service, however the unit is in use. Will come past another time as this site is around the corner from the workshop. Head to workshop to pick up parts. Completed all outstanding components on job.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H2772N		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R04240E			
1042549	Leaking gas	GBANKS	28/08/2017	Internal	7946.0	\$0.00	<p>Repair LPG Convertor as necessary,</p> <p>Repair Light/s</p> <p>Adjust LPG Mixer to correct specification,</p> <p>CHECK UNIT WITH A GAS SMELL.FOUND SOLINOID LEAKING. REPLACE SOLINOID AND CHECK FOR LEAKS,REPAIR LIGHTS, ADJUST GAS MIXTURES & IDLE.GB28/8/17. Carry out equipment condition assessment</p>
1034056	PREP FOR GREEN TAG	CSHANNON	24/07/2017	Internal	7942.0	\$0.00	<p>Carry out Inspection and Diagnosis of Mast/Carriage</p> <p>Replace King Pin Bearings,</p> <p>Remove ancillary items and Carriage Rollers, Strip, Inspect and report,</p> <p>remove siezed pins and bushes refit new pins and bushes remove carraige and broken rollers</p> <p>Repair Carriage as necessary,</p> <p>Refit Carriage Rollers and ancillary items,</p> <p>Refit Carriage and ancillary items,</p> <p>Adjust Lift Chain to correct specification,</p> <p>Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,</p> <p>Remove ancillary items and Wheel/s, Inspect and report,</p> <p>Refit Wheel/s and ancillary items,</p> <p>Fit Attachment and ancillary items,</p>
1000394	De hire inspection	BGREEN	10/03/2017	Internal	7935.0	\$0.00	<p>tyre swap, find 1800 slippers and fit, order slipper pins De hire inspection</p> <p>Carry out equipment condition assessment</p> <p>Carried out dehire inspection.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H2772N		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R04240E			
998101	Prep for Rental - Nutrition Warehouse	GGILBERT	2/03/2017	Internal	4444.0	\$0.00	Prep Unit for Rental - 6/3/17 (Nutrition Warehouse). Must have full GAS Bottle & H11330 (Hyster ROO) with Unit. Travel to site, Prepare For Hire - Workshop travel to site carry out prehire on unit. check over grease lube mast and chains function test and clean. Prepare For Hire - Field Travelled to workshop and waited for tow truck to pick up unit.
971037	dehire inspection as required	BGREEN	14/11/2016	Internal	7932.0	\$0.00	Prepare For Hire - Workshop
969187	Prep for Rental	GGILBERT	8/11/2016	Internal	7832.0	\$0.00	Need a FULL GAS BOTTLE WITH THIS UNIT PLEASE Prepare For Hire - Workshop travel to get new battery return to aal wshop get unit running and assess unit for str. make list of repairs and order parts. Replace Seat, 250hr Service travel to site carry out repairs for str. fit seat pm service repair lights wash and paint unit take gas bottle to fill. function test unit all ok.
536489	DEHIRE	201WORKSHOP	8/02/2013	Internal	7926.0	\$0.00	travel to wshop wait for tpt to collect. DEHIRE
533257	steering knob	LALBARCHIN	29/01/2013	Internal	7926.0	\$0.00	steering knob Replace Steering Wheel,
527939	tail lights not working	LALBARCHIN	7/01/2013	Internal	7868.0	\$0.00	replaced steering knob tail lights not working Carry out Check Over of unit in line with the agreed scope of work. Report on condition of equipment and additional work requirements. site check ; repair tail lights not working, fit new globes

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H2772N		Description: HYSTER H2.5TX					
Make: HYSTER		Model: H2.5TX		Serial No.: B466R04240E			
522814	head light not working	LALBARCHIN	10/12/2012	Internal	7769.0	\$0.00	head light not working Repair Light Circuit as required, blown head light fuse , left hand side head light wiring fault ; repair wiring and replace globe Old Job Code: AAL-0000156449
353112	Cutting Out	LALBARCHIN	6/11/2012	Internal	7708.0	\$0.00	Old Job Code: QLD-0000155713
351970	Starting Fault	LALBARCHIN	30/10/2012	Internal	7626.0	\$0.00	Old Job Code: QLD-0000153855
349097	CARRIED OUT PM SERVICE	LALBARCHIN	8/10/2012	Internal	7576.0	\$0.00	Old Job Code: QLD-0000150438
342116	Leaking drive motor-Vic to quote on drive motor on new job	LALBARCHIN	16/08/2012	Internal	7380.0	\$0.00	Old Job Code: AAL-0000149761
340567	Axle damage, see job 149503 Quote TP	LALBARCHIN	6/08/2012	Internal	7383.0	\$0.00	Old Job Code: NSW-0000149135
339074	HYDRAULIC OIL LEAK	LALBARCHIN	30/07/2012	Internal	7307.0	\$0.00	Old Job Code: AAL-0000149134
339072	H3369V - hrs"1291 - PM Service (INT)	LALBARCHIN	30/07/2012	Internal	7307.0	\$0.00	Old Job Code: QLD-0000147727
335789	pm service not enough hours/drive slows	LALBARCHIN	4/07/2012	Internal	7216.0	\$0.00	Old Job Code: QLD-0000147211
334564	Inspect after impact damage	LALBARCHIN	25/06/2012	Internal	7186.0	\$0.00	Old Job Code: NSW-0000145989
331688	Perform C Service - FL 1134	LALBARCHIN	31/05/2012	Internal	7093.0	\$0.00	Old Job Code: QLD-0000144271
327647	replace x2 drive and x2 steer tyres	LALBARCHIN	27/04/2012	Internal	6944.0	\$0.00	Old Job Code: QLD-0000144270
327645	CODE 14 NO LIFT- PM DUE	LALBARCHIN	27/04/2012	Internal	6944.0	\$0.00	Old Job Code: AAL-0000144110
327275	Further perp for sale McCains	LALBARCHIN	24/04/2012	External	6932.0	\$647.25	Old Job Code: NSW-0000142789
324292	SIDE SHIFT REPAIR	LALBARCHIN	29/03/2012	Internal	6811.0	\$0.00	Old Job Code: AAL-0000141814
322096	water leak	LALBARCHIN	12/03/2012	Internal	6779.0	\$0.00	Old Job Code: QLD-0000141213
320687	BRAKE AND TAIL LIGHT BULBS BLOWN	LALBARCHIN	5/03/2012	Internal	6749.0	\$0.00	Old Job Code: NSW-0000141212
320684	PM SERVICE	LALBARCHIN	5/03/2012	Internal	6749.0	\$0.00	Old Job Code: QLD-0000140521
319109	ENGINE MANAGEMENT LIGHT ON AND ENGINE STOP LIGHT	LALBARCHIN	20/02/2012	Internal	6718.0	\$0.00	Old Job Code: NSW-0000139623
317037	PM SERVICE- BASEPLAN	LALBARCHIN	2/02/2012	Internal	7002.0	\$0.00	Old Job Code: QLD-0000138246
313925	Service Unit	LALBARCHIN	12/01/2012	Internal	6580.0	\$0.00	Old Job Code: NSW-0000136997
311160	SPEEESHIELD SOUNDER BUZZING	LALBARCHIN	19/12/2011	Internal	6524.0	\$0.00	Old Job Code: QLD-0000135383
307643	Noise in drive	LALBARCHIN	25/11/2011	Internal	6409.0	\$0.00	Old Job Code: NSW-0000134140
305174	PM SERVICE	LALBARCHIN	4/11/2011	External	6325.0	\$0.00	Old Job Code: NSW-0000133577
303909	REPLACE TYRES ALL ROUND-REFER TO 134647,134648 & 134649	LALBARCHIN	31/10/2011	Internal	6269.0	\$0.00	Old Job Code: NSW-0000132738
302168	SINGLE POINT FILL GUN	LALBARCHIN	17/10/2011	Internal	6195.0	\$0.00	Old Job Code: NSW-0000132737
302165	GENRAL REPAIRS	LALBARCHIN	17/10/2011	Internal	6195.0	\$0.00	Old Job Code: NSW-0000132554
301759	REPLACE JOYSTICK	LALBARCHIN	12/10/2011	Internal	6164.0	\$0.00	Old Job Code: AAL-0000132542
301729	leaking oil	20-T830	11/10/2011	Internal	0.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H2772N		Description: HYSTER H2.5TX					
Make: MITSUBISHI		Model: FG35AN		Serial No.: F13F50077			
301062	PM SERVICE AND NO BRAKE LIGHTS- ANDREW 0431289335	LALBARCHIN	6/10/2011	Internal	6409.0	\$0.00	Old Job Code: NSW-0000132243
299931	After Hours Call Out - No Start	LALBARCHIN	30/09/2011	Internal	6101.0	\$0.00	Old Job Code: AAL-0000131703
299928	paint unit	LALBARCHIN	30/09/2011	External	6101.0	\$0.00	Old Job Code: AAL-0000131700
297495	cutting out	20-T086	8/09/2011	External	5762.0	\$0.00	Old Job Code: AAL-0000130610
296154	pm service	20-T086	5/09/2011	External	6253.0	\$154.79	Old Job Code: AAL-0000129990
289876	PM SERVICE	RTOPIC	19/07/2011	Internal	5765.0	\$0.00	Old Job Code: AAL-0000127165
288540	DEHIRE CHECK PLEASE	SHOPWOOD	8/07/2011	Internal	5765.0	\$0.00	Old Job Code: QLD-0000126510
288301	Site checks - Monday 19/7/10	20-T086	7/07/2011	Internal	5776.0	\$0.00	Old Job Code: QLD-0000126397
281825	Replace accelerator pedal	RTOPIC	23/05/2011	Internal	5536.0	\$0.00	Old Job Code: QLD-0000123355
281208	scrubber tank	PHILDERBRA	17/05/2011	Internal	5503.0	\$0.00	Old Job Code: AAL-0000123061
278905	Pre hire check.	NCLARKE	2/05/2011	Internal	5377.0	\$0.00	Old Job Code: AAL-0000121965
277441	HYDRAULIC LEAK	20-T051	15/04/2011	Internal	5370.0	\$0.00	Old Job Code: NSW-0000121270
277282	steering problem	20-T086	14/04/2011	Internal	4990.0	\$0.00	Old Job Code: AAL-0000121193
268505	Gas converter repairs - dirty gas	LALBARCHIN	8/02/2011	Internal	4988.0	\$0.00	Old Job Code: QLD-0000116824
265248	REPLACE STEER TYRES	NCLARKE	17/01/2011	Internal	4600.0	\$0.00	Old Job Code: NSW-0000115155
255473	REPAIR BRAKES	20-T046	8/11/2010	Internal	4548.0	\$0.00	Old Job Code: NSW-0000110080
255400	REVERSE BEEPER N/W	20-T086	8/11/2010	Internal	5336.0	\$0.00	Old Job Code: QLD-0000110043
254150	leaking oil and burning smell	20-T046	3/11/2010	External	4529.0	\$0.00	Old Job Code: AAL-0000109412
253791	NO CHARGE LIGHTS	20-T046	2/11/2010	Internal	4529.0	\$0.00	Old Job Code: NSW-0000109237
238768	Hyd Pump Leaking	DSMITH	23/08/2010	Internal	4097.0	\$0.00	Old Job Code: QLD-0000103022
238749	NOT STARTING	DSMITH	23/08/2010	External	4097.0	\$105.18	Old Job Code: NSW-0000103013
235884	BROKEN GRAB HANDLE	20-T051	9/08/2010	Internal	4162.0	\$0.00	Old Job Code: NSW-0000101944
230205	TYRES REQUIRED ALL ROUND / RIMS ALSO REQUIRED	PHIRONS	9/07/2010	Internal	3843.0	\$0.00	Old Job Code: SA-0000099923
203337	REPLACE SEAT AND FAN BELT	LALBARCHIN	11/03/2010	Internal	3593.0	\$0.00	Old Job Code: SA-0000090278
197908	SERVICE	20-T830	11/02/2010	Internal	0.0	\$0.00	Old Job Code: NSW-0000088332
196588	DAMAGED HYD HOSE	TALLEN	4/02/2010	Internal	3073.0	\$0.00	Old Job Code: QLD-0000087846
195824	COLLECT METER READINGS AS REQUESTED	20-T017	1/02/2010	Internal	3061.0	\$0.00	Old Job Code: SA-0000087565
183395	STEER TYRES REQUIRED - CHARGEABLE	20-T826	4/01/2010	Internal	2832.0	\$0.00	Old Job Code: SA-0000082530
185985	WELD BROKEN UPRIGHT	RJAMES	27/11/2009	Internal	2378.0	\$0.00	Old Job Code: NSW-0000083538
181686	REPAIR FAULTY CABLE PLUG	20-T826	6/11/2009	External	2377.0	\$231.00	Old Job Code: SA-0000081890
Equipment Total:						\$1,138.22	
Customer Total:						\$1,138.22	