

ADAPT-A-LIFT GROUP PTY LTD

Service History Listing Active Units

Date: 19/06/2026

Time: 11:01:29AM

For Equipment Code From: H56048 To: H56048

For Customer Code From: All To: All

For Date Posted From: All To: All

For Branch Code From: All To: All

Don't Show Cost

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H56048		Description: MANITOU MLT-X 732					
Make: MANITOU		Model: MLT-X 732		Serial No.: MAN00000C01007103			
1823946	ORDERED - install customer damage parts - charged to customer already (1742630)	JPENA	7/05/2026	Internal	2278.0	\$0.00	Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Repair Customer Damage : removed broken roof back cover , straighened bracket and replaced new back cover ,replaced gas strut.
1823552	Carry Out Pre-Hire Inspection	JPENA	6/05/2026	Internal	22774.0	\$0.00	Prepare For Hire - Workshop Pre Hire : Checked over the machine, checked all fluids, topped up. gear oil in one planetary gear,greased all points, diagnosed not working headlight ,fixed/ repaired broken headlight wiring and tested,calibrate thestrain guage.cleaned the cab and inside glass window, tested wiper spray and wipers, tested all machine function, refitted panels. Prep for Hire : continued cleaning the glass window, removed broken rental stickers and decals, painted new rental equipment number , fit new decals, inflated the all tyres (35 psi) tested the machine.. Steam clean equipment as necessary. Carry out equipment condition assessment Customer Damage : washed the machine and checked customer damages. note: broken cab / roof cowl , rear light lens , dented panel.. Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Repair : Straightened dented surface
1823234	Rental Return - Customer Damage - Excessive Cleaning	JPENA	5/05/2026	Internal	22774.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H56048		Description: MANITOU MLT-X 732					
Make: MANITOU		Model: MLT-X 732		Serial No.: MAN00000C01007103			
1818961	Cardan Shaft Failure - Remove & Replace	JALDEMITA	17/04/2026	Internal	2270.0	\$0.00	Travel to site, Replace Drive Shaft Assembly, travel to site ,remove and replace cardan shaft ,replace bolt ,topup coolant ,topup transmission oil ,cheeck angle gear box oil ,check and testing the unit ,unit Ok need radiator cup
1816212	Starting Issue - Diagnose & Repair	JALDEMITA	8/04/2026	Internal	2262.0	\$0.00	Travel to site, Replace Switch/es Replace Battery, Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, travel to site ,remove and replace ignition switch assembly ,check baterry condition Baterry low ,remove and replace baterry,replace baterry terminal ,check charging system , check and repair e stop switch ,check and testing the unit (unit Ok)
1807718	READY - Faulty Starter Motor - Remove & Replace With New	JALDEMITA	10/03/2026	Internal	2253.0	\$0.00	Travel to site, Remove ancillary items and remove Radiator from unit, Inspect and report, Replace Starter Motor, Refit Radiator to unit, Refit ancillary items, Flush and Replace Cooling System Coolant Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Carry out equipment condition assessment travel to site ,remove remove hose and radiator assembly ,remove transmission hose and transmission cooler ,remove and replace starter motor ,refit transmission cooler and radiator ,refit radiator hose and transmission cooler hose ,topup coolant check and testing the unit ,need radiator cap

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H56048		Description: MANITOU MLT-X 732					
Make: MANITOU		Model: MLT-X 732		Serial No.: MAN00000C01007103			
1805213	Prep for hire - Fit ATT038 2m3 bucket	BBERNARDEZ	27/02/2026	Internal	2244.0	\$0.00	Prepare For Hire - Workshop prepared for hire replaced the thermostat control assembly(taken from old machine) cleaned the cabin and blowout the cabin filter,and air cleaner filter. grease all greasing point and fit the ATT 038 bucket attachment. Note: aircon not cooling.
1766786	replace broken a/c switch and a/c roof cover	221PLANNING	24/11/2025	External	2243.0	\$0.00	
49025	General service inspection	221WORKSHOP	17/11/2025	Inspection	2253.0	\$0.00	
1762579	STR DE-HIRE INSPECTION	JALDEMITA	7/11/2025	Internal	2169.0	\$0.00	Prepare For Hire - Workshop Steam clean equipment as necessary. Grease All Points on Unit, check the unit ,check costumer damage ,check oil level ,check planeratory oil ,clean the unit ,wash the unit ,need air con cover ,and air con switch Repair Air Conditioner as necessary , check blower fan chek filter was blocked tried system still slow remove step remove bottn plate on box checked volt going to fan notcied dropping to 9-10 vollts remove other fan from unit outside fit check volts going to 10.5v clean conectors found dirty earth clean and test got 11.6 had to glue in new riv nuts refit bonnet aadjusts bonnet Repair Light/s
1744665	Pre-hire Inspection & Repairs	MLALLY	20/10/2025	Internal	2169.0	\$0.00	Carry out Inspection and Diagnosis of Brake System Repair Handbrake Lever as required, Repair Windscreen Wiper as necessary, Repair Switch/es Remove and Replace Coolant Hose/s
1743367	Diagnose & Repair Coolant Leak Repair & Adjust Handbrake	JALDEMITA	25/08/2025	Internal	2167.0	\$0.00	check and repair elelrical system of head light ,(over head guard)repair beacon light ,repair wiper switch and wirring ,check and top up planeratory oil ,repair park brake caliper ,replace reverse alarm ,top up coolant ,replace upper radiator hose ,repair windscreen washer ,repair JSM

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H56048		Description: MANITOU MLT-X 732					
Make: MANITOU		Model: MLT-X 732		Serial No.: MAN00000C01007103			
1742630	CUSTOMER DAMAGE	JALDEMITA	21/08/2025	External	2167.0	\$747.00	Prepare For Hire - Workshop Steam clean equipment as necessary. Carry out Inspection and Diagnosis of Electrical System Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, check costumer damage, thoroughly clean and wash the unit replace damaged bonnet and strut, replace LH tail light, replace air conditioner roof cover Prepare For Hire - Field
1729829	PARTS ORDERED - Carry Out Pre Hire Inspection To Go With ATT038 & Hay Forks	MLALLY	2/07/2025	Internal	2003.0	\$0.00	Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, steam clean check over found e stop has been bypassed all lights good got bucket hay forks and normal forks ready for hire found wiper washer not working checked out wiper stalk on steering collom is not working Equipment Transport,
1728638	rear diff seal leak	BBERNARDEZ	27/06/2025	Internal	2002.0	\$0.00	Remove ancillary items and Remove Drive Axle Assembly from unit, Remove and Replace Drive Axle Seal/s Refit Drive Axle Assembly, refit ancillary items, Check Diff oil level, top up oil level as required, bring the unit inside workshop, take 5, remove propeller, replace differential oil seal rear side. refit propeller shaft & tighten. check differential oil level. oil in good level Replace Timing Cover Seal as required,
1724080	READY - VALVE COVER ASSY - DIRECTIONAL SWITCH (FOR SIGNAL LIGHT) - REAR DIFFERENTIAL INPUT SHAFT OIL SEAL	JALDEMITA	10/06/2025	Internal	2002.0	\$0.00	Replace Switch/es remove and replace rocker cover ,remove and replace light switch assembly
1722071	DEHIRE CHECK	PFLORA	2/06/2025	Internal	1999.0	\$0.00	Carry out equipment condition assessment carried out de-hire inspection of the machine. checked all over the machine.
1713885	bucket blade bolts - transmission oil leak	JALDEMITA	30/04/2025	Internal	1985.0	\$0.00	Repair Attachment as necessary, remove and replace broken blade bolt ,repair transmission leak

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H56048		Description: MANITOU MLT-X 732					
Make: MANITOU		Model: MLT-X 732		Serial No.: MAN00000C01007103			
1710414	NO BRAKES - NO HANDBRAKE	JALDEMITA	14/04/2025	Internal	1985.0	\$0.00	<p>Travel to site,</p> <p>Adjust Handbrake Cable to correct specifications,</p> <p>Labour</p> <p>Repair Brake master cylinder,</p> <p>Replace Brake master cylinder,</p> <p>master was leaking reeplace with old one</p> <p>Bleed Brake System</p> <p>Repair Handbrake Cable,</p> <p>replace master cylinder ,bleed brake system ,remove park brake caliper and repair ,repair transmission leak</p> <p>Prepare For Hire - Workshop</p>
1697826	replace fork lock pins, wiper blades, tow pins and lock, radio antenna, repair air con, replace front spotlight/globe, washer motor	JPENA	20/03/2025	Internal	1981.0	\$0.00	<p>widscreen wipers mudgard fork lock pins add H number toe pin</p> <p>Repair Forks/Tynes as necessary,</p> <p>Refit Forks/Tynes and ancillary items,</p> <p>Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,</p> <p>installed new fork lock , welded carriage lock for forks (temporary lock)</p> <p>Steam clean equipment as necessary.</p> <p>Replace Windscreen Wiper,</p> <p>Fit Attachment and ancillary items,</p> <p>washed and cleaned the machine surfaces, clean the cab and cleaned the glass window, greased all points, tested machine hydruatic functions, replaced wiper blades, prepared bucket put to the pallet, load the machine.</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H56048		Description: MANITOU MLT-X 732					
Make: MANITOU		Model: MLT-X 732		Serial No.: MAN00000C01007103			
1697773	customer damage - replace door glass, replace RH headlight, straighten RHF mud guard, straighten rear mirror bracket, clean cabin	MLALLY	20/03/2025	External	1980.0	\$1,548.53	Prepare For Hire - Workshop Remove ancillary items and Mirror and Replace, Refit Mirror and ancillary items, Carry out Repairs to Mud Flaps, customer damage - replace door glass, headlight, rear view mirror, antenna and precleaner. repair mudguard.
1697426	Scheduled Service - 2000 Hour Service	MLALLY	20/03/2025	Internal	1980.0	\$0.00	2000hr Service 2000hr service
1691632	DE HIRE INSPECTION	JPENA	10/02/2025	Internal	1980.0	\$0.00	2000 hr service Remove ancillary items and Attachment, Strip, Inspect and report, Carry out equipment condition assessment carried out machine inspection from hire,, removed the attachment and machine panels, prep the machinr for washing and cleaning Steam clean equipment as necessary. washed / cleaned outside surfaces of the machine Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, reviewed/re inspect the machine damages and tested all functions , refit panels that being removed before. inspection: Damaged Parts to be Replaced: side door glass window,wipers,fork locks,bonnet cowl, roof plastic panels, bucket cuttin edge, bucket cutting edges bolts and screws,alternator belt, right head light assy.Tow pins and lock (missing) Front right mud guard,radio antenna,) boom prof (not comptible) boom prof pins and lock(missing), boom Prof plastic handle knob,(missing) cab aircon filter, Parts to be repair / fix: rear mirror Bracket (bent),aircon blower not very strong, wiper bottle reservior (no power supply) head spot light (not working),for checking all fluids,for cleaaning of cab and glass window,hyd tank surfaces (bent)

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H56048		Description: MANITOU MLT-X 732					
Make: MANITOU		Model: MLT-X 732		Serial No.: MAN00000C01007103			
1723551	Scheduled Service - Inspection 12 Months	BBERNARDEZ	6/09/2024	Internal	2002.0	\$0.00	Carry out Inspection and Diagnosis of Brake System Repair Handbrake Lever as required, Adjust Handbrake/Park Brake Remove and Replace Reverse buzzer, Refit to unit, Carry out equipment condition assessment taake 5, Inspection 12 Months, check overall unit, repair park brake due to stock up and adjust, check back up alarm not working. replace reverse alarm testing of unit. unit okay.
1722691	Scheduled Service - Inspection 12 Months	PFLORA	12/09/2023	Internal	1985.0	\$0.00	Carry out equipment condition assessment Carry out Inspection and Diagnosis of Electrical System Repair Cylinder head as required Steam clean equipment as necessary. Grease All Points on Unit, carried out 12 months inspection. checked all over the unit troubleshooting for electrical wiring problem for signal lights. removed and checked the valve cover because of oil leak. checked the oil leak from rear differential input shaft. washed and cleaned the machine. cleaned the windscreen and inside of cabin. grease all greasing point. put lubricant at the boom. Note: need to change the valve cover assembly,directional switch(fir signal lights)and oil seal for rear differential input shaft.
					Equipment Total:		\$2,295.53
					Customer Total:		\$2,295.53