

Sales Invoice

Number: 24909
Reference: Unit 82
Issued: 09/18/2025
Due: 10/18/2025

Deliver To
Box 23089
Grande Prairie AB T8V 6X2

Dynamud Logistics Services Inc.
Box 23089
Grande Prairie AB T8V 6X2

MVR Mechanical Ltd.
RR#1 Site 4, Box 25
Sexsmith AB T0H3C0
Canada
7805186291
mike@mvrmechanical.com
GST/HST 851918615 RT 0001

Item	Qty/Hrs	Price/Rate	Sales Tax	Net
SHOP TIME - September 18, 2025	14.00	140.00	GST 5.00%	1,960.00
75w90 Trans. oil- per liter	16.00	16.55	GST 5.00%	264.80
RTL018918B-PCAN TRANSMISSION	1.00	5,399.99	GST 5.00%	5,399.99
108925-25AM - Clutch - 15.5" 2050 TQ 7 SP	1.00	1,392.38	GST 5.00%	1,392.38
MAFB201 - CLUTCH BRAKE 2" HINGED	1.00	45.24	GST 5.00%	45.24
FLYWHEEL MACHINED	1.00	231.00	GST 5.00%	231.00
4965569 - ISX Rear Crank Seal	1.00	213.97	GST 5.00%	213.97
2507018X - SPL 250 STRAP KITS	2.00	29.64	GST 5.00%	59.28
63062RSJ - Ball Bearings/Clutch Release/Etc	1.00	39.36	GST 5.00%	39.36
3688113 - Gear Cover, Plug	1.00	26.64	GST 5.00%	26.64
TGGSKA1 - Seal Kit	1.00	303.78	GST 5.00%	303.78
19T34462 - Capscrew, PTO Flange	2.00	4.49	GST 5.00%	8.98
35P152 - PTO-Gasket (8 Bolt .020)	2.00	2.64	GST 5.00%	5.28
Brass	1.00	4.22	GST 5.00%	4.22
0551771 - LED, Low Beam, 4X6 8800-12/24V, Chrome/Heated	1.00	372.48	GST 5.00%	372.48

Comments

September 18-19, 2025

Mileage: 436667

Hours: 9728

S/N: 1XKZD40X1PJ999320

License: A32981

Year: 2022

Unit: 82

Make: Kenworth

Model: T880

Pick up unit from Dynamud. Notice noise in transmission low range and low split. Trouble shoot. Find large tooth broken off counter shaft in Aux section. Drain transmission and remove PTO. Find hydraulic pump mount flange on PTO needs repair. Remove transmission and fly wheel - inspect rear seal. Replace rear seal. Swap parts from old transmission to new (sensors, bell housing etc)

Installed exchange flywheel, and new pilot bearing. Installed transmission.

Extract broken bolts from PTO pump flange. Clean. Re-seal PTO.

Reseal PTO air shifter (oil in air line)

Install and shim PTO. Install clutch actuator.

Fill transmission, install drive line and mount hydraulic pump. Install new front gear cover plug as old one was leaking engine oil.

Build mud flap bracket to protect air dryer. Paint and install.

Tie up hydraulic lines.

Trouble shoot LH low beam. Find blown fuse-replace. Find faulty heat sync/transformer for LED bulb. Replace LH low beam and reassemble.

Test drive - find air line rubber through on zip tie. Repair.

Total Net	10,327.40
-----------	-----------

GST 5.00%	516.36
-----------	--------

Invoice Total	10,843.76
----------------------	------------------

Total to Pay	\$10,843.76
---------------------	--------------------

Terms and Conditions

Payment due upon pickup.