

TRIM(WOHH.WOWH_MODEL)	WOWH_DESC	WOWH_ORDER_N	WOWH_INVOICE_DATE	WOWH_METER	Comments	Full Rep Code
P19-W-021	ISUZU FRR600 LONG EWP	235653	11/09/2024 0:00	376259	PREP FOR AUCTION, Completed by: wilson.wang@porterplant.com.au on: Sep 11, 2024	GR - GENERAL REPAIRS
P19-W-021	ISUZU FRR600 LONG EWP	216456	21/04/2023 0:00	376259	DAMAGE ON FRONT BUMPER AND 1ST+2ND LOCKERS, REPLACE FRONT BUMPER, REPLACE 1ST AND 2ND LOCKER CABINETS, AS PER REPAIRER QUOTE# 30821	CD - CUSTOMER DAMAGE
P19-W-021	ISUZU FRR600 LONG EWP	215356	22/03/2023 0:00	376259	CARRIED OUT RETURN FROM HIRE INSPECTION, PO 182472 - EPV	PI - PLANT INSPECTION
P19-W-021	ISUZU FRR600 LONG EWP	208934	14/10/2022 0:00	376251	CARRIED OUT MINOR TRUCK SERVICE & REPAIRS, 28/9/22 - REPLACED ENGINE OIL & OIL FILTER, REPLACED FUEL FILTERS, REPLACED WIPER BLADES, GREASED,, FOUND THE FILTER SEDIMENTER HOUSING CRACKED, REMOVED & REPLACED SEDIMENTER ASSY., PO 175879 - EMA	PS - PLANNED SERVICE
P19-W-021	ISUZU FRR600 LONG EWP	208702	30/09/2022 0:00	373779	REPAIRED AIRLINE TO PTO, 31/8/22 - CALL OUT - PTO NOT ENGAGING, CARRY OUT INSPECTION, BUILD UP AIR PRESSURE,, CARRY OUT CHECKS, FIND BROKEN AIR LINE, DROP, AIR PRESSURE, REPAIR AIR LINE, BUILD AIR, PRESSURE, RETEST, OK., PO 175636 - EMA	BM - BREAKDOWN - MECHANICAL
P19-W-021	ISUZU FRR600 LONG EWP	207244	21/09/2022 0:00	367812	REPAIRED FUSES & WIRING FOR STARTING, 11/4/22 - CALL OUT AFTER HOURS TO CRANBOURNE, VEHICLE WILL NOT START, NO CRANK., CHECK SCAN TOOL, NO CODES. DISCONNECT BATTERY, CARRIED OUT LOAD TEST, BOTH, BATTERIES GOOD VOLTAGE. CHECK E-STOPS, NIL DEFECTS. INSPECT FUSES IN CABIN, OK., INSPECT ENGINE BAY FUSES BOX, BLOW SLOW BLOW 60A FUSE, REMOVE & REPLACE., TURN KEY TO ATTEMPT START, FUSE BLOWN. CARRY OUT DIAGNOSTICS, REVIEW VEHICLE, START SCHEMATIC, CHASE DOWN STARTER LOOM & INSPECT, FIND START SOLENOID WIRE, RUBBED & SHORTED OUT ON P-CLAMP NEAR STARTER, GAIN ACCESS & REPAIR LOOM,, RELOCATE LOOM TO AVOID RUBBING, REPLACE 60A FUSE, START VEHICLE OK., PO 174154 - EMA	BE - BREAKDOWN - ELECTRICAL
P19-W-021	ISUZU FRR600 LONG EWP	207875	21/09/2022 0:00	372308	CARRIED OUT ELECTRICAL TEST, HV DRY TEST, HV WET TESTS, PO 174779 - SETCO	ET - ELECTRICAL TEST
P19-W-021	ISUZU FRR600 LONG EWP	207251	31/08/2022 0:00	369893	REPLACED BATTERIES, 2/8/22 - CALL OUT TO SITE AFTER HOURS, VEHICLE WON'T START,, REMOVE & REPLACE BATTERIES, TEST CHARGE RATE - 27.4V, OK., PO 174154 - EMA	BE - BREAKDOWN - ELECTRICAL
P19-W-021	ISUZU FRR600 LONG EWP	207565	31/08/2022 0:00	372308	S & F CRANE REMOTE CONTROL BATTERIES, 22/8/22 - INSPECT TOWER REMOTE, INSPECT BATTERIES, FOUND CONTACT, POINTS UNSERVICEABLE, REMOVE & REPLACE BATTERIES WITH NEW., PO 174496 - EMA	ER - ELECTRICAL REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	207499	31/08/2022 0:00	370243	CARRIED OUT 12MTH TOWER SERVICE INCL A/I & W/TEST, REPLACED HYDRAULIC OIL & FILTERS. PTO HOUR METER NOT WORKING,, TRUCK WAS NEEDED SO REPAIRS TO BE DONE AT LATER DATE., PO 174440 - EPV	AS - ATTACHMENT SERVICES
P19-W-021	ISUZU FRR600 LONG EWP	205617	09/08/2022 0:00	367812	REPLACED REAR SPRINGS, 4/7/22 - REAR SPRINGS UNROADWORTHY, RH SPRING PACK FOUND COMPRESSED/INVERTED, 60MM LEAN TO RHS,, REMOVE DRIVE WHEELS, REMOVE 2 X SPRING PACKS, FIT NEW SPRING PACKS AS PER MAINTENANCE MANUAL,, RH SPRING PACK BEEFED UP TO COMPENSATE FUTURE SAG, S & F NEW U BOLTS, ALL HARDWARE TORQUED TO, SPEC, WHEELS FITTED, ROAD TESTED, U BOLT TORQUE CARRIED OUT., PO 172646 - EMA	MR - MECHANICAL REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	205616	09/08/2022 0:00	367812	CARRIED OUT TRUCK SERVICE, 4/7/22 - REPLACED ENGINE OIL & OIL FILTER, REPLACED FUEL FILTERS, TOPPED UP, COOLANT, REPLACED WIPER BLADES, BRAKE THICKNESS CHECKED:, RHF 6MM, LHF 7MM, RHR 8MM, LHR 8MM. REPLACED BLOWN GLOBE IN FOG LAMP., PO 172646 - EMA	PS - PLANNED SERVICE
P19-W-021	ISUZU FRR600 LONG EWP	206355	09/08/2022 0:00	367812	REPLACED 4 TYRES & CRACKED RIM, 4/7/22 - 4 X TYRES UNROADWORTHY, RHR INNER RIM CRACKED., WHEEL REMOVED & RIM ORDERED, STRIP & FIT CARRIED OUT., REPLACED 4 TYRES, WHEEL NUTS TORQUED & WNI FITTED., PO 172646 - EMA	TC - TYRE CHANGE/REPLACEMENT
P19-W-021	ISUZU FRR600 LONG EWP	205676	22/07/2022 0:00	366337	REPLACED E-STOP BUTTON ON REMOTE, E-TO BUTTON ON REMOTE CONTROL BROKEN, REPLACED E-STOP BUTTON & TESTED, OK., PO 172694 - EPV	ER - ELECTRICAL REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	205611	22/07/2022 0:00	365903	CHECKED OPERATION OF LOWER BOOM, LOWER BOOM WON'T RAISE OFF REST., TESTED, FOUND BOOM OPERATED OK, ADDED 180KG LOAD, HAD TROUBLE LIFTING., ADJUSTED PRESSURE RELIEF VALVE AND WORKED OK. OPERATOR TO MONITOR., PO 172640 - EPV	MR - MECHANICAL REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	204644	18/07/2022 0:00	364512	REPAIRED PUNCTURE TO LHR OUTER TYRE, 6/6/22 - CALL OUT, LHR OUTER TYRE DAMAGED, REMOVE TYRE & REPLACE WITH SPARE, REPAIR PUNCTURE., PO 171846 - EMA	TP - PUNCTURE REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	204634	29/06/2022 0:00	363158	REPLACED DAMAGED REVERSE CAMERA, 21/6/22 - REVERSE CAMERA NOT WORKING, INSPECT REV CAMERA SYSTEM, REVERSE CAMERA & LOOM BOTH UNSERVICEABLE., REMOVED DAMAGED CAMERA ASSY & DAMAGED LOOM, S & F NEW CAMERA ASSY, CONNECTED & RE-ROUTED LOOM TO SUITABLE, SAFER LOCATION ON VEHICLE BODY, CARRY OUT ADJUSTMENT & PROGRAMMING, CARRY OUT OPERATIONAL CHECK, ALL OK., PO 171815 - EMA	BE - BREAKDOWN - ELECTRICAL

P19-W-021	ISUZU FRR600 LONG EWP	204212	17/06/2022 0:00	363158	REPAIRED LHR PUNCTURE, TRAVEL TO SITE, REMOVE DAMAGED TYRE & REPLACE WITH SPARE,, CARRY OUT TYRE CHANGE, TORQUE WHEEL TO SPEC., PO 171390 - EMA	TP - PUNCTURE REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	203637	31/05/2022 0:00	360595	CARRIED OUT 9MTH TOWER SERVICE, LHR STABILISER FOOTPLATE RETAINING PLATE BENT & BOLTS BROKEN,, REMOVED PLATE, DRILLED OUT BOLT, STRAIGHTENED PLATE & REFITTED,, REPLACED BOLT., PO 170818 - EPV	AS - ATTACHMENT SERVICES
P19-W-021	ISUZU FRR600 LONG EWP	203041	30/05/2022 0:00	358936	REPLACED DAMAGED TYRE - SIDEWALL DAMAGE, RH INNER TYRE UNROADWORTHY, REMOVE BOTH RH WHEELS, STRIP UNSERVICEABLE TYRE FROM INNER RIM,, NO DAMAGE NOTED ON RIM, REMOVED TYRE, FOUND SIDEWALL TORN & DAMAGED, FITTED 2ND HAND TYRE., DURING REMOVAL FOUND 1 WHEEL STUD & NUT UNSERVICEABLE, GRIND OFF NUT & STUD FROM OUTER RIM,, S & F NEW NUT & STUD, REFIT WHEELS TO VEHICLE, TORQUE WHEEL NUTS, ROAD TEST., PO 170136 - EMA	TD - REPLACEMENT OF DAMAGED TYRE
P19-W-021	ISUZU FRR600 LONG EWP	203040	30/05/2022 0:00	358936	CARRIED OUT MINOR TRUCK SERVICE & REPAIRS, 125/5/22 - REPLACED ENGINE OIL & OIL FILTER, REPLACED FUEL FILTER & PCV FILTER, REPLACED WIPER BLADES, TOPPED UP COOLANT, GREASED., FLOOR MATS IN CABIN UNSAFE & UNROADWORTHY, REMOVED, VACUUMED & CLEANED CABIN FLOOR, FITTED NEW MATS & SECURED IN POSITION., BRAKE THICKNESS CHECK - RHF 5MM & LHF 5MM, RHR 8MM & LHR 8MM., PO 170136 - EMA	PS - PLANNED SERVICE
P19-W-021	ISUZU FRR600 LONG EWP	202738	24/05/2022 0:00	356480	REPLACED MISSING FIRE EXT, 23/4/22 - CHECK VEHICLE FOR CORRECT FIRE EXT ON BOARD,, REPLACE MISSING FIRE EXT, VEHICLE NOW COMPLIES WITH SPECS., PO 169785 - EMA	GR - GENERAL REPAIRS
P19-W-021	ISUZU FRR600 LONG EWP	200581	23/03/2022 0:00	346665	CARRIED OUT ELECTRICAL TEST, HV DRY TEST, HV WET TESTS, PO 167499 - SETCO	ET - ELECTRICAL TEST
P19-W-021	ISUZU FRR600 LONG EWP	200580	23/03/2022 0:00	346665	REPLACED REMOTE E-STOP, REPAIR RADIO REMOTE, PO 167495 - SHERRIN RENTALS	ER - ELECTRICAL REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	200218	25/02/2022 0:00	346665	CARRIED OUT 6MTH TOWER SERVICE INCL WEIGHT TEST, REPLACED HYDRAULIC FILTER, PO 167112 - EPV	AS - ATTACHMENT SERVICES
P19-W-021	ISUZU FRR600 LONG EWP	199720	18/02/2022 0:00	346637	GENERAL REPAIRS TO ITEMS FOUND DURING SERVICE, 02/02/22 - CENTRE CONSOLE LATCH UNSERVICEABLE, REPLACED LATCH WITH NEW, ALL OK. NUMBER PLATE LIGHTS UNSERVICEABLE, REPLACED WITH NEW,, LH CLEARANCE LIGHT UNSERVICEABLE, REPLACED WITH NEW, TESTED LIGHTS, ALL OK. LH WHEEL STUDS FOUND UNSERVICEABLE & WNI'S FOUND MISALIGNED,, REMOVED WHEEL NUTS, STUD BROKEN, REMOVE & INSPECT RIM, FOUND DAMAGED & CRACKED, (REPAIRED AS PER INV 9813), 6 X WHEEL STUDS & NUTS, REPLACED DUE TO DAMAGE, REPLACED ALL STUDS & NUTS, REPLACED HUB & AXLE SEALS, ALL OK., I-ARS SEAT SENSOR FAILED, REMOVED SEAT BASE, REMOVED SEAT SENSOR, FIT & REPLACED, FIT SEAT BASE, TEST, ALL OK., PO 166043 - EMA	ER - ELECTRICAL REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	199234	18/02/2022 0:00	346637	REPLACED 3 TYRES & LH OUTER RIM, RHF TYRE BALD & RH INNER TYRE INNER EDGE HAS WIRE EXPOSED, WILL BOTH REQUIRE REPLACEMENT & TYRE ROTATION, 02/02/22 - CARRIED OUT TYRE INSPECTION, FRONT TYRES UNSERVICEABLE, WNI'S MISALIGNED ON LHR, REMOVE WHEELS, (RE INV 9814 FOR STUD REPLACEMENTS), RH INNER TYRE UNSERVICEABLE, LH OUTER SIDE WALL DAMAGED, LH OUTER RIM REPLACED DUE TO CRACKED RIM, REPLACED ALL REQUIRED TYRES, CARRIED, OUT ROTATION, TORQUED TO SPEC., PO 166043 - EMA	TC - TYRE CHANGE/REPLACEMENT
P19-W-021	ISUZU FRR600 LONG EWP	199233	18/02/2022 0:00	346637	CARRIED OUT MINOR TRUCK SERVICE, 02/02/22 - REPLACED ENGINE OIL & OIL FILTER, REPLACED FUEL FILTERS, REPLACED PCV KIT, GREASED, TOPPED UP COOLANT, REPLACED WIPER BLADES,, CARRIED OUT DIAGNOSTIC SCAN, BRAKE & CLUTCH ADJUSTMENT. POST SERVICE/BRAKE ADJUSTMENTS, VEHICLE TAKEN TO ROLLING BRAKE CHECK -, REPORTED GOOD, NIL DEFECTS., PO 166043 - EMA	PS - PLANNED SERVICE
P19-W-021	ISUZU FRR600 LONG EWP	197436	21/01/2022 0:00	334965	CARRIED OUT FRONT END ALIGNMENT, STEER TYRES FOUND TO BE SCRUBBING, ALIGNMENT CHECKS CARRIED OUT,, TOE-IN ADJUSTED AS REQD., PO 164172 - EMA	WA - AXLE CORRECTION/ALIGNMENT
P19-W-021	ISUZU FRR600 LONG EWP	197435	21/01/2022 0:00	334965	CARRIED OUT MINOR TRUCK SERVICE, 29/11/21 - REPLACED ENGINE OIL & OIL FILTER, REPLACED AIR FILTER & FUEL FILTERS, REPLACED WIPER BLADES,, BRAKE & CLUTCH ADJUSTMENT, FLUIDS TOPPED UP, GREASED, BRAKE FLUID & COOLANT., PO 164172 - EMA	PS - PLANNED SERVICE
P19-W-021	ISUZU FRR600 LONG EWP	196278	03/12/2021 0:00	329763	REPAIRED AIRCON, 28/10/21 - A/C GAS LOW, HAVE SYSTEM RECHARGED, TEST SYSTEM, NOW SATISFACTORY, AIRCON RELAY, UNSATISFACTORY, REPLACED RELAY WITH NEW, WORKING OK., PO 162911 - EMA	AC - AIR-CONDITION REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	196277	03/12/2021 0:00	329763	REPAIRED PTO WIRING, 28/10/21 - PTO NOT WORKING, INSPECT SYSTEM, INSPECT RELAY, FOUND BROKEN WIRE, CARRY OUT REPAIRS, CHECK, OK., PO 162911 - EMA	ER - ELECTRICAL REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	196279	03/12/2021 0:00	329763	INSPECTED AND ADJUSTED BRAKES AS REQUIRED, PO 162911 - EMA	MR - MECHANICAL REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	194920	01/12/2021 0:00	325548	SUPPLY & FIT 4 X STABILISERS JACK PADS, PO 161406 - EMA	GR - GENERAL REPAIRS
P19-W-021	ISUZU FRR600 LONG EWP	195948	01/12/2021 0:00	329221	CHECK AIRCON & REPLACE REMOTE BATTERY, 25/10/21 - TOWER REMOTE INTERMITTENT, BATTERY CONTACT POINTS UNSERVICEABLE, REPLACED 2 BATTERIES., A/C CUTTING IN & OUT, RUN & INSPECT A/C, SITE GLASS AIR-RATED NOT ENOUGH GAS IN SYSTEM, BELT TENSION, GOOD, REGAS AIRCON NEXT AVAIL RDO., PO 162452 - EMA	BE - BREAKDOWN - ELECTRICAL

P19-W-021	ISUZU FRR600 LONG EWP	196909	29/11/2021 0:00	333680	CARRIED OUT 3MTH TOWER SERVICE, START BUTTON ON REMOTE BROKEN, REPLACED BUTTON., PO 163580 - EPV	AS - ATTACHMENT SERVICES
P19-W-021	ISUZU FRR600 LONG EWP	192546	01/11/2021 0:00	307084	***CANCELLED - TO BE BILLED VIA EMA WHO COMPLETED WORK***, FAULTY STARTER RELAYS, PO 158588 - PATTERSON CHENEY	MR - MECHANICAL REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	195378	19/10/2021 0:00	325625	SUPPLY SOFT BASKET COVER, TRAVEL TO BEACONSFIELD, FITTED COVER TO BASKET & FOUND THE NYLON BARS THAT CREATE THE LIFT SO WATER DOESN'T POOL ARE, MISSING, ORDERED NEW BARS., PO 161965 - EPV	GR - GENERAL REPAIRS
P19-W-021	ISUZU FRR600 LONG EWP	194368	06/10/2021 0:00	323445	REPLACED IGNITION SWITCH & ALTERNATOR, 14/9/21 - REPORTS OF ELECTRICAL ISSUES, DASH LIGHTS LOST & IGNITION FAULTING, ALTERNATOR INSPECTION CARRIED OUT, VOLTAGE, SUPPLY AT MAX LOAD AT 23.5V, INSPECTION OF LOOM & EARTH CONNECTIONS, ALL FOUND TIGHT & NIL CORROSION, OK, ORDER PARTS., 15/9/21 - CALL OUT TO SITE AT BFD YARD, VEHICLE WON'T START, ISOLATED VEHICLE, REMOVED & REPLACED IGNITION SWITCH, VEHICLE, STARTS, CARRIED OUT ODB-2 SCANNING, NIL CODES, NOW OK., 20/9/21 - ISOLATED VEHICLE, REMOVED & REPLACED ALTERNATOR WITH NEW, REMOVED & REPLACED BOTH BELTS - A/C & COOLING., SET TO REQD TENSION, CARRIED OUT ALTERNATOR CHARGE RATES, NOW AT 28.8V, ALL OK., PO 160756 - EMA	ER - ELECTRICAL REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	194916	05/10/2021 0:00	320837	CARRIED OUT 12MTH TOWER SERVICE INCL A/I & W/TEST, REPLACED HYDRAULIC FILTERS & OIL. INCL WAITING TIME FOR TRUCK TO BE RETURNED TO SITE., PO 161402 - EPV	AS - ATTACHMENT SERVICES
P19-W-021	ISUZU FRR600 LONG EWP	192345	05/10/2021 0:00	307084	***"CANCELLED - NO INVOICE RECEIVED"***, AFTER HOURS CALL OUT - TRANSMISSION FAULT, DRIVER LEANT ON GEAR SELECTOR WHILE DRIVING, PO 158111 - EMA	BM - BREAKDOWN - MECHANICAL
P19-W-021	ISUZU FRR600 LONG EWP	194275	30/09/2021 0:00	320472	CARRIED OUT ELECTRICAL TEST, HV DRY TEST, HV WET TESTS, PO 160655 - SETCO	ET - ELECTRICAL TEST
P19-W-021	ISUZU FRR600 LONG EWP	193601	30/09/2021 0:00	320837	CARRIED OUT 320KM TRUCK SERVICE & REPAIRS, REPLACED ENGINE OIL & OIL FILTER, REPLACED FUEL FILTERS, AIR FILTER BLOWN OUT, REPLACED WIPER BLADES, BRAKE & CLUTCH, ADJUSTMENT, TOP UP FLUIDS WHERE REQD, REMOVE MAF SENSOR, CLEAN & INSPECT, GREASED, TEST PARK BRAKE., CLEAN CABIN FLOOR & REPLACE FLOOR MATS WITH NEW. BATTERY BOX LID UNSATISFACTORY, INSTALLED NEW. REPLACED REAR, DIFF OIL., PO 159824 - EMA	PS - PLANNED SERVICE
P19-W-021	ISUZU FRR600 LONG EWP	193669	31/08/2021 0:00	320472	REPLACED 4 TYRES & ROTATED, 4 X 235/75R17.5 HIFLY 143/141 HH309 - POS 3/4/5/6, PO 159917	TC - TYRE CHANGE/REPLACMENT
P19-W-021	ISUZU FRR600 LONG EWP	192150	12/08/2021 0:00	314335	CLEARED FAULT CODES FOR TRANSMISSION, 15/7/21 - VEHICLE NOT STARTING & GEAR SELECTION FLASHING ON THE DASH, CALL OUT TO SITE, CARRIED OUT DIAGNOSTIC, SCAN & DOWNLOAD, ECM & TCM LOST COMMUNICATION, INSPECTED WIRING SYSTEM FOR ABNORMAL FINDINGS, INSPECTED, ECM & TCM FOR BROKEN WIRES OR DAMAGE, CLEAN & RECONNECT ALL ELECTRICAL TERMINALS & CONNECTORS, CARRIED OUT, TRANSMISSION RE-LEARN, REPROGRAMMED & FAULT CODES CLEARED, TEST DRIVE & RESCAN, ALL OK., 17/7/21 - CALL OUT TO SITE, VEHICLE WILL NOT START, ATTEMPT TO START VEHICLE, STARTED FIRST TIME, CONNECT SCAN TOOL., CARRY OUT DOWNLOADS, CODE 0-700 CLEARED, RECHECKED STARTING PROCEDURE NUMEROUS TIMES, NIL DEFECTS, EVIDENT., PO 158111 - EMA	ER - ELECTRICAL REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	190435	04/06/2021 0:00	307084	CARRIED OUT 9MTH TOWER SERVICE, PO 156355 - EPV	AS - ATTACHMENT SERVICES
P19-W-021	ISUZU FRR600 LONG EWP	187655	12/04/2021 0:00	293312	CARRIED OUT ELECTRICAL TEST, HV DRY TEST, HV WET TESTS, PO 153297 - SETCO	ET - ELECTRICAL TEST
P19-W-021	ISUZU FRR600 LONG EWP	186906	09/03/2021 0:00	293312	CARRIED OUT 6MTH TOWER SERVICE & REPAIRS, TANK MOUNT BOLT BROKEN, REPLACED BOLT. BOOM REST MOUNT LOOSE, TIGHTENED BOLTS., PO 152511 - EPV	AS - ATTACHMENT SERVICES
P19-W-021	ISUZU FRR600 LONG EWP	185769	04/02/2021 0:00	286458	REPLACED BROKEN L/R FOOTPLATE RETAINING BOLTS, PO 151298 - EPV	GR - GENERAL REPAIRS
P19-W-021	ISUZU FRR600 LONG EWP	183718	08/12/2020 0:00	277279	CARRIED OUT 3MTH TOWER SERVICE & REPAIRS, COVER MISSING FROM TOP BOOM AT ELBOW, REMOVED BROKEN COVER & MADE UP NEW COVER FROM A PIECE OF COVER, REPLACED BOLTS, & FITTED COVER. TETHER ON CDD ROPE CLIP, FITTED NEW TETHER., PO 149184 - EPV	AS - ATTACHMENT SERVICES
P19-W-021	ISUZU FRR600 LONG EWP	181818	24/11/2020 0:00	268912	S & F I-ARS - ANTI ROLL AWAY SYSTEM, HAVE VASS CERTIFICATION CARRIED OUT, DECOMMISSION PARK SAFE SYSTEM., PO 147178 - EMA	AR - ADDITIONAL WORK
P19-W-021	ISUZU FRR600 LONG EWP	182497	02/11/2020 0:00	263339	REPLACED BROKEN BOLTS IN FOOT PLATE, LHF STABILISER FOOT PLATE RETAINING BOLTS BROKEN & PLATES BENT, HAD A LOT OF TROUBLE REMOVING FOOTPLATE AS COULDN'T UNDO, BOLTS, EVENTUALLY GOT IT OFF THEN HAD MORE TROUBLE REMOVING BROKEN BOLTS, CLEANED THREADED HOLES, STRAIGHTENED PLATES, & REFIT FOOT WITH NEW BOLTS, USED 6 X 8MM X 30MM COUNTER SUNK CAP SCREWS., PO 147871 - EPV	MR - MECHANICAL REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	181079	08/10/2020 0:00	259564	CARRIED OUT ELECTRICAL TEST, HV DRY TEST, HV WET TESTS, PO 146479 - SETCO	ET - ELECTRICAL TEST
P19-W-021	ISUZU FRR600 LONG EWP	179865	02/09/2020 0:00	259564	FITTED NEW TIMER RELAY, TOWER STOPPED WORKING, OVERRIDE WAS USED TO PACK UNIT, UP, CHECKED UNIT & AFTER SOME TIME FOUND TIMER RELAY, UNSERVICEABLE, SOURCED NEW RELAY, FITTED & TESTED, ALL OK., PO 145285 - EPV	ER - ELECTRICAL REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	179712	31/08/2020 0:00	257761	REPAIRED REMOTE FOR TOWER, TRANSMITTER WON'T SYNC WITH RECEIVER, RED LIGHT FLASHES, ON START-UP THEN GOES OUT, GREEN LIGHT ALSO GOES OUT., PO 145123 - EPV	ER - ELECTRICAL REPAIR

P19-W-021	ISUZU FRR600 LONG EWP	179182	20/08/2020 0:00	257761	CARRIED OUT 12MTH TOWER SERVICE INCL A/I & W/TEST, REPLACED HYDRAULIC FILTERS., LHR FOOTPLATE RETAINING PLATES HAVE 3 BROKEN BOLTS & 3, BENT ONES, REMOVED FOOTPLATE, REMOVED BENT & BROKEN, BOLTS, TOOK A WHILE TO REMOVE BROKEN BOLTS, REPLACED ALL, BOLTS, REFITTED FOOTPLATE, STRAIGHTENED RETAINING PLATES., PO 144602 - EPV	AS - ATTACHMENT SERVICES
P19-W-021	ISUZU FRR600 LONG EWP	177096	13/07/2020 0:00	251136	REMOTE NOT WORKING - FITTED SPARE TRANSMITTER, TOWER NOT WORKING FROM REMOT CONTROL, CHECKED ON SITE,, NOT ABLE TO MAKE IT WORK. BACK AT DEPOT FITTED SPARE, TRANSMITTER & GOT UNIT WORKING. TRANSMITTER SENT FOR REPAIRS, & WILL SWAP THEM BACK WHEN DONE., PO 142744 - EPV	ER - ELECTRICAL REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	176406	24/06/2020 0:00	249022	INVESTIGATE ISSUE OF TOP BOOM NOT WORKING, DRIVER REPORTED THAT TOP BOOM WOULD NOT OPERATE, CHECKED, OPERATION WITH DRIVER & ALL WORKED, OPERATED FOR A WHILE, WITH DRIVER, NOT ABLE TO FAULT, ADVISED DRIVER TO MONITOR &, ADVISE IF FAULT OCCURS AGAIN., PO 142295 - EPV	MR - MECHANICAL REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	174878	05/06/2020 0:00	248214	REPAIRED SPHERICAL BEARINGS & LUFF CYLINDER ON BOOM, NOISE IN LOWER BOOM, INSPECT EXCESSIVE NOISE FROM LOWER LUFF, CYLINDER (ROD END), FOUND SPHERICAL BEARING EXCESSIVELY, CORRODED & CREAKING ON PIN. LUBED BEARING & TESTED, FOUND NO, CHANGE TO NOISE. ATTEMPT TO REMOVE PINS, PINS SEIZED, HAD TO, WELD ON HYDRAULIC PULLER & PRESS OUT PINS, PRESSED OUT, SPHERICAL BEARINGS & PRESSED ON NEW ONES, CLEANED UP & REFIT, PINS ONTO LUFF CYLINDER & RECONNECT ALL HOSES, CARRIED OUT, DYNAMIC WEIGHT TEST & FLY & OPERATE TOWER. FOUND NO NOISE &, LEAKS ALL OK. WASH TOWER & REFIT COVERS, CHECKED HYD OIL, OK, PO 141041 - EPV	MR - MECHANICAL REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	174877	05/06/2020 0:00	248214	CARRIED OUT 9MTH TOWER SERVICE & REPAIRS, REPLACED VARIOUS DAMAGED/MISSING LABELS, REPLACED MISSING, DUST CAPS ON BASKET TOOLS, REPAIRED DAMAGED GELCOAT ON, BASKET, CUT & POLISH LOWER INSERT (FADED), REPLACED BROKEN, "R" CLIP ON CDD BOX LANYARD, WELD BROKEN ENGINE TAIL PIPE, BRACKET, REPLACED BROKEN NYLON BOLTS UPPER BOOM END COVER,, REPAIRED GELCOAT WORN THROUGH ON UPPER BOOM AT BOOM REST, AREA., PO 141041 - EPV	AS - ATTACHMENT SERVICES
P19-W-021	ISUZU FRR600 LONG EWP	171974	09/04/2020 0:00	232015	CARRIED OUT ELECTRICAL TEST, HV DRY TEST, HV WET TESTS, PO 138453 - SETCO	ET - ELECTRICAL TEST
P19-W-021	ISUZU FRR600 LONG EWP	172249	01/04/2020 0:00	235666	AFTER HOURS CALL OUT TO JUMP START FLAT BATTERY, TRAVELLED TO AND FROM MONBULK SITE TO JUMP START UNIT &, CHECK CHARGE RATE, OK. RECOMMEND NEW BATTERIES ASAP., PO 138721 - EPV	BE - BREAKDOWN - ELECTRICAL
P19-W-021	ISUZU FRR600 LONG EWP	171428	13/03/2020 0:00	232015	REPAIRED WIRE IN REMOTE, LH DEADMAN ON REMOTE CONTROL TRANSMITTER NOT WORKING,, SPLIT REMOTE TRANSMITTER & FOUND WIRE BROKEN ON LH DEAD MAN, TOGGLE SWITCH, SOLDERED WIRE BACK ON REASSEMBLED TRANSMITTER, CHECKED ALL FUNCTIONS, ALL OK., PO 137939 - EPV	ER - ELECTRICAL REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	170253	24/02/2020 0:00	232015	CARRIED OUT 6MTH TOWER SERVICE INCL WEIGHT TEST, CHANGED HYDRAULIC FILTER, PO 136872 - EPV	AS - ATTACHMENT SERVICES
P19-W-021	ISUZU FRR600 LONG EWP	166684	02/12/2019 0:00	208691	CARRIED OUT 3MTH TOWER SERVICE, PO 133365 - EPV	AS - ATTACHMENT SERVICES
P19-W-021	ISUZU FRR600 LONG EWP	166561	02/12/2019 0:00	208691	REPAIRED THROTTLE MODULE AND REMOTE CONTROL, SLOW TO POWER UP, PTO TAKES 10 MINS TO START, REMOTE DROPS, OUT, FOUND THROTTLE MODULE FAULTY, DEADMAN & REMOTE KEY, HOUSING BOTH INTERMITTENTLY FAILING, REPLACED REMOTE, BATTERY, HOUSING KEY, DEADMAN SWITCH, THROTTLE MODULE., PO 133225 - SHERRIN RENTALS	MR - MECHANICAL REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	165473	01/11/2019 0:00	208691	REFITTED LOWER LEVEL CYLINDER COVER, LOWER LEVEL CYLINDER COVER BROKEN OFF, DRILLED OUT BROKEN, BOLTS, RETAPPED HOLES, REPLACED BOLTS & REFITTED COVER., PO 132079	GR - GENERAL REPAIRS
P19-W-021	ISUZU FRR600 LONG EWP	163298	01/10/2019 0:00	202669	CARRIED OUT 6MTHLY ELECTRICAL TEST, HV DRY TEST, HV WET TESTS, PO 130039 - SETCO	ET - ELECTRICAL TEST
P19-W-021	ISUZU FRR600 LONG EWP	163511	25/09/2019 0:00	206863	ASSISTED WITH MANUAL STOW OF LEGS, 2 x CALL OUTS FOR SAME PROBLEM - 9/9/19 AND 10/9/19, 9/9/19 - AFTER HOURS CALL OUT, LEGS WON'T STOW/NOT WORKING, & NO HOME LIGHT. CHECK ALL FUSES IN DASH & IN BOX ON SIDE, OF TURRET, ALL OK, CHECK PROXY'S ON BOOM REST & THEY HAVE NO, POWER, CHECK ALL RELAYS ARE NOT LOOSE, ALL OK, FOUND THAT, TIMER RELAY NOT WORKING & COULDN'T REPLACE AS DID NOT HAVE, ONE, PACK LEG UP WITH MANUAL OVERRIDE SO TRUCK COULD GO BACK, TO YARD., 10/9/19 AFTER HOURS CALL OUT, LEGS WON'T STOW, WENT TO TRUCK, ON-SITE & GOT TRUCK PACKED UP. CHECKED TRUCK AT LILYDALE, DEPOT, NO POWER TO BOOM STOWED PROXY'S, TRACED WIRING &, FOUND FAULTY TIMER RELAY, TOOK RELAY FROM ANOTHER TRUCK THAT, WAS OUT OF SERVICE (1FS5MU) & GOT THIS ONE GOING, WILL, ARRANGE FOR A NEW RELAY TO GO INTO OTHER TRUCK AT EPV W'SHOP, PO 130234	BM - BREAKDOWN - MECHANICAL
P19-W-021	ISUZU FRR600 LONG EWP	162304	30/08/2019 0:00	202669	CARRIED OUT 12MTH TOWER SERVICE INCL A/I & W/TEST, COVER MISSING FROM LH BASKET PIN, REPLACED COVER. COVER, MISSING FROM ELBOW PIN, MADE UP NEW COVER & FITTED., PO 129026	AS - ATTACHMENT SERVICES

P19-W-021	ISUZU FRR600 LONG EWP	161937	16/08/2019 0:00	185017	R#BUS011645980,	RE - REGISTRATION
P19-W-021	ISUZU FRR600 LONG EWP	157291	23/05/2019 0:00	185017	CARRIED OUT 9MTH TOWER SERVICE, REPLACED BROKEN BOLTS IN LOWER LEVEL CYLINDER COVER., PO 124752	AS - ATTACHMENT SERVICES
P19-W-021	ISUZU FRR600 LONG EWP	157141	23/05/2019 0:00	183856	REPAIRED THE RADIO REMOTE, RADIO REMOTE NOT WORKING, CHECKED OPERATION OF THE REMOTE,, REMOVED THE COVER, CHECKED FOR MOISTURE, LOOSE WIRING,, SWITCHES, ETC, CHECKED & PUSHED HOME MULTI PIN PLUGS, PACKED, UP & RESET THE LEGS, UNIT, ETC, RESET & TESTED THE LEGS,, ETC, RADIO REMOTE WORKED, CHECKED ALL FUNCTIONS, OK., PO 124610 - EPV	ER - ELECTRICAL REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	154928	11/04/2019 0:00	174415	6MTH TOWER SERVICE AND WEIGHT TEST, PO 122796, CARRIED OUT 6MTH TOWER SERVICE INCL WEIGHT TEST, PO 122796	AS - ATTACHMENT SERVICES
P19-W-021	ISUZU FRR600 LONG EWP	153972	28/03/2019 0:00	149964	ELECTRICAL TEST, PO 121921, CARRIED OUT ELECTRICAL TEST, HV DRY TEST, HV WET TESTS, PO 121921	ET - ELECTRICAL TEST
P19-W-021	ISUZU FRR600 LONG EWP	147872	12/12/2018 0:00	149964	3 MONTH TOWER SERVICE COMPLETED., COMPLETE 3m TOWER SERVICE, P/O 116513	AS - ATTACHMENT SERVICES
P19-W-021	ISUZU FRR600 LONG EWP	147579	01/11/2018 0:00	149964	REPLACED E-STOP BUTTON SWITCH AND SWITCH BASE., P/O 116242	ER - ELECTRICAL REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	145867	03/10/2018 0:00	149964	REPLACED BROKEN BOLTS TO TELE BOOM COVER., LEVEL BUBBLE NOT READABLE - REMOVED & CLEANED., TELE BOOM COVER BROKEN OFF - REMOVED BROKEN BOLTS & REFITTED, COVER., REMOTE WON'T START UP, INTERMITTENT - CHECKED OPERATION, NUMEROUS TIMES NOT ABLE TO FAULT. CHECKED INTERNALS OF, REMOTE TO BE SURE, OK., SPEED ON TELE BOOM SLOW - OPERATED UNIT AND FOUND IT TO BE, SLOW FROM REMOTE CONTROL ONLY. ADJUSTED SPEED, NOW OK., PO#114584	GR - GENERAL REPAIRS
P19-W-021	ISUZU FRR600 LONG EWP	144827	11/09/2018 0:00	145738	STRAIGHTENED FOOT PLATE KEEPERS & REFITTED., REPLACED BROKEN BOLTS, FOOT PLATE HAD BEEN BROKEN OFF., P/O 113526	CD - CUSTOMER DAMAGE
P19-W-021	ISUZU FRR600 LONG EWP	144287	03/09/2018 0:00	121394	COMPLETED 12m TOWER SERVICE, WEIGHT TEST & ANNUAL INSPECTION, 2x BOLTS BROKEN IN TELE BOOM COVER - REPLACED BOLTS., R/F WORK LIGHT NOT WORKING - REPAIRED WIRING AT PLUG ON, LIGHT., PO#113097	AS - ATTACHMENT SERVICES
P19-W-021	ISUZU FRR600 LONG EWP	144727	03/09/2018 0:00	139305	COMPLETED 6m WET & DRY ELECTRICAL TESTS, P/O 113458	ET - ELECTRICAL TEST
P19-W-021	ISUZU FRR600 LONG EWP	141378	03/09/2018 0:00	132172	REPLACED FAULTY SAFETY RELAY, DUE TO LEG NOT ENGAGING., INSPECTED AND TRACED FAULT WITH LEG NOT ENGAGING FOUND, SAFETY RELAY TO BE FAULTY. ORDERED PART IN, REPLACED & TEST, ALL OK., P/O 110571	ER - ELECTRICAL REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	143616	16/08/2018 0:00	139305	R# WEB006880690, POST: CLAIR@ DOWNER PO BOX 4993 MELBOURNE 3001	RE - REGISTRATION
P19-W-021	ISUZU FRR600 LONG EWP	142102	01/08/2018 0:00	139305	CHECKED TOWER NOT ACTIVATING, CHECKED ALL SWITCHES & WIRING., STABILISERS ENGAGING BUT TOWER WOULD NOT WORK. CHECKED ALL, PROXY SWITCHES & WIRING FROM STABILISER ENGAGED ALL APPEAR, OK. FOUND SAFETY RELAY IN TURRET CONTROL BOX ACTIVATED., CHECKED ALL WIRING COULDN'T FOLLOW CIRCUIT. RECEIVED A, DIAGRAM FROM MANUFACTURER AS PER SERIAL NO. TRACED THIS, WIRING THROUGH, BUT DIAGRAM NOT THE WAY IT WAS ACTUALLY, WIRED. AFTER SEVERAL HOURS OF TRYING, ADVISED PP, NOT ABLE TO FIX., P/O 111110	ER - ELECTRICAL REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	139117	01/06/2018 0:00	132172	COMPLETED 9m TOWER SERVICE, P/O 108879	AS - ATTACHMENT SERVICES
P19-W-021	ISUZU FRR600 LONG EWP	137312	23/04/2018 0:00	129264	REPLACED WORN STEER TYRES & COMPLETED ALIGNMENT, P/O 107378	TC - TYRE CHANGE/REPLACMENT
P19-W-021	ISUZU FRR600 LONG EWP	135635	10/04/2018 0:00	120721	REFITTED PLUG THAT HAD COME OUT OF BOARD. TESTED ALL OK, CHECKED REMOTE CONTROL NOT WORKING, WAS NOT TURNING ON., REMOVED BACK & ON INSPECTION FOUND A PLUG THAT HAD COME, OUT OF BOARD, REFITTED, CHECKED ALL FUNCTIONS. OK, P/O 106069	ER - ELECTRICAL REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	134619	01/03/2018 0:00	100437	COMPLETED 6m TOWER SERVICE, CHECKED REPORT OF PTO NOT ENGAGING, OPERATED AND COULD NOT, FIND FAULT., DISASSEMBLED REMOTE & FOUND BAD CONNECTION ON ONE JOYSTICK., REPAIRED CONNECTION & CHECKED OPERATION. ALL OK, REMOVED FOOT PLATE, REMOVED BROKEN BOLT & REFITTED FOOT, PLATE., PO#105195	AS - ATTACHMENT SERVICES
P19-W-021	ISUZU FRR600 LONG EWP	134565	01/03/2018 0:00	100437	COMPLETED ELECTRICAL DRY & WET TEST. GEL COAT CARRIED OUT, BOOM WASHED AND POLISHED TELE AND BOTTOM BOOM, PO#105152	ET - ELECTRICAL TEST
P19-W-021	ISUZU FRR600 LONG EWP	134219	09/02/2018 0:00	100437	COMPLETED 6 MONTH ELECTRICAL TEST, P/O 104871	ET - ELECTRICAL TEST
P19-W-021	ISUZU FRR600 LONG EWP	130193	06/12/2017 0:00	100437	COMPLETED 3m TOWER SERVICE, PO#101710	AS - ATTACHMENT SERVICES
P19-W-021	ISUZU FRR600 LONG EWP	128169	23/10/2017 0:00	100437	CHECKED REMOTE, UNABLE TO FAULT., OPERATOR REPORTED REMOTE NOT TURNING ON., CHECKED OPERATION NOT ABLE TO FAULT. OPENED REMOTE CONTROL, AND INSPECTED ALL CONNECTIONS & JOYSTICKS. SETUP & OPERATED, FROM SCRATCH. 3 TIMES ALL OK. OPERATOR TO NOTIFY IF HAPPENS, AGAIN., PO#99922	ER - ELECTRICAL REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	125747	05/09/2017 0:00	94479	COMPLETE 12m TOWER SERVICE, EIGHT TEST & ANNUAL INSPECTION, REPLACED BLOWN STABILISER LED LIGHT, PO 97784	AS - ATTACHMENT SERVICES
P19-W-021	ISUZU FRR600 LONG EWP	125667	04/09/2017 0:00	83463	COMPLETED 6m ELECTRICAL TESTS, P/O 97731	AS - ATTACHMENT SERVICES
P19-W-021	ISUZU FRR600 LONG EWP	123125	27/06/2017 0:00	79752	CHANGED SETTINGS ON REVERSE CAMERA AS IMAGE WAS REVERSED., TESTED OPERATION, CHECKED WITH DRIVERS, ALL OK., P/O 95469	ER - ELECTRICAL REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	123174	27/06/2017 0:00	83463	RECTIFIED COMPLAINT THAT BASKET CONTROLS ARE SLOW, CHECKED ALL WIRING. ALL OK & TESTED. GOOD., P/O 95517	ER - ELECTRICAL REPAIR

P19-W-021	ISUZU FRR600 LONG EWP	123234	01/06/2017 0:00	81485	INVESTIGATED CAUSE OF TRUCK TURNING OFF WHEN SYSTEM POWER UP, TRACED WIRING TO ALL ESTOPS. COULD NOT FIND CAUSE. REFERRED, BACK TO DEALER., P/O 95552	ER - ELECTRICAL REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	122056	01/06/2017 0:00	81374	COMPLETED 9m TOWER SERVICE. REPLACED BROKEN BOLTS, FROM TELE BOOM COVER., P/O 94502, COMPLETED ON SITE AT LILYDALE.	AS - ATTACHMENT SERVICES
P19-W-021	ISUZU FRR600 LONG EWP	122914	01/06/2017 0:00	81374	ATTENDED AFTERHOURS CALL OUT AT MENZIES CREEK TO PACK UP, UNIT. ATTEMPTED TO FIND CAUSE. CLEANED OUT BOX BEHIND LEG, CONROLS AS IT WAS FULL OF MUD. CLEANED ALL MUD FROM RELAYS,, FUSES / LINKS., P/O 95285	ER - ELECTRICAL REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	122236	31/05/2017 0:00	73840	REPAIRED WIRING TO REVERSE CAMERA. TESTED, ALL OK.	ER - ELECTRICAL REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	120304	12/04/2017 0:00	70196	REPLACED FAILED BOOM STRAP PROXY SWITCH., TESTED OPERATION, ALL OK., P/O 93076	ER - ELECTRICAL REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	119542	07/04/2017 0:00	70188	COMPLETED 70,000km SERVICE. REPLACED OIL & FUEL FILTER., REPLACED WIPERS. CHECKED OVER. LUBES & INSPECTED CUPBOARD, LATCHES & STRUTS. LUBED DOOR HINGES. CHECKED BRAKES & CLUTCH	PS - PLANNED SERVICE
P19-W-021	ISUZU FRR600 LONG EWP	119261	20/03/2017 0:00	63568	CALLED OUT TO INSPECT TOP BOOK NOT WORKING, CHECKED WIRING, AND REMOTE, CLEANED MOISTURE OUT AND TESTED ALL OK, IF FAULTS AGAIN MAY REQUIRE NEW REMOTE, P/O 92322	ER - ELECTRICAL REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	118546	28/02/2017 0:00	58388	INSPECTED CRACKS IN BOOM AND REPORTED BACK TO ADAM MILLS, , P/O 118546	GR - GENERAL REPAIRS
P19-W-021	ISUZU FRR600 LONG EWP	118375	24/02/2017 0:00	50979	COMPLETED 6 MONTH ELECTRICAL TEST - ALL OK	ET - ELECTRICAL TEST
P19-W-021	ISUZU FRR600 LONG EWP	117810	07/02/2017 0:00	50979	REPLACED DAMAGED BUCKET COVER, , P/O 91130	CD - CUSTOMER DAMAGE
P19-W-021	ISUZU FRR600 LONG EWP	117160	31/01/2017 0:00	50979	COMPLETED 50,000km SERVICE. REPLACED OIL, FUEL & PCV FILTERS, CHECKED & TOPPED UP ALL FLUIDS. REPLACED WIPER INSERTS., CHECKED OVER. GREASED. COMPLETED PARK BRAKE TEST ADR35.5.	PS - PLANNED SERVICE
P19-W-021	ISUZU FRR600 LONG EWP	115534	01/12/2016 0:00	50978	COMPLETED 3m TOWER SERVICE. MADE & FITTED NEW COVER, TO REPLACED MISSING LOWER END OF BOOM COVER. CHECKED OVER., GREASED. ALL OK., P/O 89344	AS - ATTACHMENT SERVICES
P19-W-021	ISUZU FRR600 LONG EWP	114255	04/11/2016 0:00	43831	TRAVELLED TO SITE A COCKATOO TO PACK UP STABILISER LEGS., INSPECT FOR LEGS WILL NOT OPERATE TO PACK UP THE UNIT., LOCATED & USED MANUAL OVER RIDE TO CONTROL LEGS. PACKED UP, VEHICLE FOR TRAVEL BACK TO DEPOT., P/O 88305	BE - BREAKDOWN - ELECTRICAL
P19-W-021	ISUZU FRR600 LONG EWP	114179	31/10/2016 0:00	46602	REPLACED 4x WORN DRIVE TYRES (POS 3-6), P/O 88273	TC - TYRE CHANGE/REPLACEMENT
P19-W-021	ISUZU FRR600 LONG EWP	113017	17/10/2016 0:00	42377	USED MANUAL OVERRIDES TO STOW UNIT & GET BACK TO DEPOT., AFTER HOURS ON SUNDAY AT YARRA GLEN., P/O 87426	BE - BREAKDOWN - ELECTRICAL
P19-W-021	ISUZU FRR600 LONG EWP	114088	14/10/2016 0:00	43601	INSPECTED FOR REPORTED FAULT OF STABILISERS NOT ENGAGING., CHECKED TO SEE IF LEGS WORKED - THEY DO. TRIED TO OPERATE, BOOMS WHILE LEGS WERE STOWED, COULD NOT - THIS IS CORRECT, OPERATION. CHECKED IF LEGS COULD BE STOWED WHILE BOOM WAS, OFF OF REST; WAS NOT ABLE TO. DID THIS THREE TIMES AND ALL, OPERATED AS IT SHOULD., P/O 88227	BH - BREAKDOWN - HYDRAULIC
P19-W-021	ISUZU FRR600 LONG EWP	112263	12/09/2016 0:00	37449	0	RE - REGISTRATION
P19-W-021	ISUZU FRR600 LONG EWP	111216	30/08/2016 0:00	33745	COMPLETED ELECTRICAL TEST, COMPLETED HV DRY TEST, P/O 85926	ET - ELECTRICAL TEST
P19-W-021	ISUZU FRR600 LONG EWP	111276	23/08/2016 0:00	37449	COMPLETED 12m TOWER SERVICE, WEIGHT TEST & ANNUAL INSPECTION, BOLTS BROKEN IN MASTER LEVEL CYLINDER COVER. REPLACED BOLTS., BOLTS BROKEN IN TELE BOOM COVER. REPLACED BOLTS., HYD OIL LEAK FROM R/R STABILISER. INSPECTED & FOUND OIL, LEAK COMING FROM TOP MOUNTING PIN., PO#85978	AS - ATTACHMENT SERVICES
P19-W-021	ISUZU FRR600 LONG EWP	111034	15/08/2016 0:00	36565	REPAIRED REMOTE., SET UP THE LEGS. TESTED THE FUNCTIONS AT THE BASE. OK., SET UP THE RADIO REMOTE. TESTED ALL FUNCTIONS - TELE IN/OUTS, NOT WORKING. CHECKED THE WIRING TO THE BASE FUNCTION. OK., OPENED UP THE RADIO REMOTE, CHECKED ALL WIRING PLUGS., CONNECTIONS ETC. LOCATED A CIRCUIT BOARD OUT OF POSITION, REFITTED & TESTED. OK. UNIT WILL OPERATE ON LEGS AND BOOM, COMPARED WITH ANOTHER TRUCK, SAME., PO#85768	UR - UNPLANNED REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	109950	29/07/2016 0:00	33745	COMPLETED 30,000km SERVICE. REPLACED OIL, PCV & FUEL FILTERS, X2. REPLACED WIPER INSERTS. REPLACED BLOWN FUSE FOR SAFE T, PARK SYSTEM - TESTED ALL OK. CHECKED OVER., P/O 84964	PS - PLANNED SERVICE
P19-W-021	ISUZU FRR600 LONG EWP	108422	09/06/2016 0:00	26872	REPAIRED WATER DAMAGED REMOTE., ATTENDED AND CHECKED FOR REMOTE NOT WORKING. CHECKED, TRANSMITTER, FOUND TO BE WATER DAMAGED. CLEANED OUT ALL, MOISTURE AND DRIED REMOTE. TESTED ALL REMOTE FUNCTIONS, OK., P/O 83895, NOTE: THE DRIVER IS NOT REMOVING THE REMOTE DURING TRANSIT, ALLOWING RAIN/MOISTURE TO ENTER THE REMOTE. SUGGEST DRYING, REMOTE AND PLACING IN CAB DURING TRAVEL TO PREVENT THE ISSUE, REOCCURRING.	UR - UNPLANNED REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	107713	30/05/2016 0:00	21221	COMPLETED 9m TOWER SERVICE. CHECKED OVER., TIGHTENED LEFT TOP LEG PIN AND CHECKED ALL OTHERS., P/O 83281	AS - ATTACHMENT SERVICES
P19-W-021	ISUZU FRR600 LONG EWP	105743	05/04/2016 0:00	21221	REPLACED BROKEN START BUTTON ON RADIO REMOTE., CHECKED ALL FUNCTIONS, OK., P/O 81742	Other

P19-W-021	ISUZU FRR600 LONG EWP	104007	29/02/2016 0:00	18161	COMPLETED 6m TOWER SERVICE & WEIGHT TEST., REPLACED HYD FILTER.TIGHTENED ALL FRONT & INTERMEDIATE BODY, PARTS. FITTED BEWARE POWER LINES, 66/33/LV RATING &, DRY ONLY LABELS. SUPPLIED LOG BOOK. BASKET REINFORCING ON, DRIVERS SIDE COMING UNDONE- ADVISE TO ARRANGE UNDER WARRANTY, COMPLETED AT 166 PTO HOURS., P/O 80510	AS - ATTACHMENT SERVICES
P19-W-021	ISUZU FRR600 LONG EWP	103603	12/02/2016 0:00	18161	COMPLETED 6m ELECTRICAL TESTS, P/O 80208	AS - ATTACHMENT SERVICES
P19-W-021	ISUZU FRR600 LONG EWP	103188	05/02/2016 0:00	18161	COMPLETED 15,000km SERVICE., REPLACED FUEL, PCV & OIL FILTERS. GREASED. CLEANED WATER, TRAP. ADJUSTED BRAKES, HAND & FOOT. ADJUSTED CLUTCH., DRAINED AIR TANKS. TIGHTENED MANIFOLDS & EXHAUST SYSTEM., SERVICED AIR CLEANER., P/O 79880	PS - PLANNED SERVICE
P19-W-021	ISUZU FRR600 LONG EWP	103177	05/02/2016 0:00	17665	REPLACED 1x DAMAGED TYRE (POS 6), P/O 79876, TYRE HAD SIDE WALL DAMAGE AND WAS NOT REPAIRABLE	TC - TYRE CHANGE/REPLACEMENT
P19-W-021	ISUZU FRR600 LONG EWP	101066	01/12/2015 0:00	8925	COMPLETED MODIFICATIONS AS REQUESTED., REMOVED CABINETS AS REQUESTED. MODIFIED CABLE REEL., MODIFIED HAND RAIL & ADDITIONAL KICK BOARDS., P/O 76008	AR - ADDITIONAL WORK
P19-W-021	ISUZU FRR600 LONG EWP	98433	09/10/2015 0:00	2921	REPAIR HYDRAULIC OIL LEAKS, NUMEROUS LOOSE FITTINGS., TEST. APPEARS OK.	UR - UNPLANNED REPAIR
P19-W-021	ISUZU FRR600 LONG EWP	97885	22/09/2015 0:00	0	REMOVED CABINETS AS REQUESTED. MODIFIED CABLE REEL., MOFIDIED HAND RAIL & ADDITIONAL KICK BOARDS., PAINTED MODIFICATIONS., P/O 76008	AR - ADDITIONAL WORK