

Service Job	Invoice No	Date	Customer Id	Customer Name	Cost Cent	Prob	Type of Call	Equip ID	Hrs	Kms	Job Description	Work Done	Labor Cost	Material Cost	Subcontra ctor Cost	Other Cost	Total Cost
85114	102600	02/10/2026	1HM335HBG	ID - REABURN QUARRY PRODUCTION	184G	R	Sundries	1ME739	19214.00 00	0	INSPECTION	INSPECTED UNIT PMI	100	20	0	20	120
10549	11676	02/17/2022	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Electrical	1ME739	17067.00 00	0	ATTEND TO PARK BRAKE ISSUES	INSPECT REPORTED NO PARBRAKE INSPECT ELECTIRCS AND TOGGLE SWITCH TEST OPERATION ALL OK	170.84	65.11	0	7	242.95
97530	116886	09/10/2026	1HM335HBG	ID - REABURN QUARRY PRODUCTION	184G	S	Service Earthmovi ngA	1ME739	19229.00 00	0	PMI SERVICE	TRAVELLED TO HBMI CARRIED OUT PREDISPOSAL & INSPECTION AS REQUIRED - HYDRAULIC TOPPED UP AS REQUIRED. - VEHICLE WOULD NOT START AT TIME OF INSPECTION JUMP STARTED & CHECKED CHARGE RATE - ALL OK - CHECKED BATTERY HEALTH - FOUND TO BE U/S RETURNED TO WORKSHOP TO SOURCE REPLACEMENTS TRAVELLED BACK TO HBMI THE NEXT DAY & REPLACED BATTERIES.	630	861.5	0	390	1851.5
958	1314	06/22/2021	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Service Earthmovi ngA	1ME739	16635.00 00	0	S1 AUTO GREASER AND DRIVELINE		111.56	0	0	5.58	126.98
11758	13216	03/16/2022	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Service Earthmovi ngA	1ME739	16977.00 00	0	WEEKLY GREASE	HRS: 17075 WEEKLY GREASE WEEKLEY GREASE GREASED MACHINE CHECKED ALL FLUID LEVELS GENERAL CHECK OVER	434.94	31.15	0	125.7	591.79
11279	13328	03/03/2022	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Brake	1ME739	16977.00 00	0	PARK BRAKE FAULT- DIAGNOSE & REPLACE VALVE - KOMATSU FIELD REPAIR	Subcontractor- TRAVEL TO RAEBURN QUARRY, DIAGNOSE AND REPAIR PARK BRAKE, FREE UP STUCK SPOOL IN PARK BRAKE VALVE, IDENTIFIED BOOSTER OIL LEAK AND OTHER OIL LEAKS ON MACHINE.	0	0	761.44	0	761.44
1347	1425	06/30/2021	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Bodywork	1ME739	16635.00 00	0	INSPECT DRIVERS SEAT OPERATION		250.74	4.92	0	12.54	268.2
1648	1461	07/07/2021	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Service Earthmovi ngA	1ME739	16635.00 00	0	WEEKLY DRIVELINE GREASE		128.13	0	0	6.41	144.38
13057	15048	04/14/2022	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Sundries	1ME739	16977.00 00	0	HYDRAULIC LEAK	HRS: 13057 HYD LEAK	814.21	0	0	104.5	918.71

13353	15436	04/26/2022	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Service Earthmovi ngA	1ME739	0.0000	17104	WEEKLY GREASE	HRS: 17,104	46.63	0	0	68.8	115.43
												WEEKLEY GREASE GREASED MACHINE CHECKED ALL FLUID LEVELS GENERAL CHECK OVER					
2054	1554	07/16/2021	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Service Earthmovi ngA	1ME739	16635.00	000	WEEKLY GREASE		85.42	37.52	0	4.28	127.22
13459	15590	04/28/2022	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Hydraulic	1ME739	16977.00	000	ATTEND TO OIL LEAK FROM PUMP FLANGE PIPE	HRS: 17,107	703.59	6.32	0	98.95	808.86
												REPAIR OIL LEAK FROM PUMP FLANGE PIPE					
13464	15896	04/28/2022	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Service Earthmovi ngA	1ME739	16977.00	000	WEEKLY GREASE	WEEKLEY GREASE GREASED MACHINE CHECKED ALL FLUID LEVELS GENERAL CHECK OVER	58.5	0	0	68.8	127.3
16150	19766	06/28/2022	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Service Earthmovi ngA	1ME739	17245.00	000	250 HR SERVICE	S1 SERVICE COMPLETE SERVICE AND SAFETY CHECKS AS PER REQUIRED SCHEDULE. GREASE ALL LUBRICATION POINTS. CHANGE ENGINE OIL AND FILTER. CHANGE AIR FILTER. CHANGE FUEL FILTER. CHECK ALL OTHER FLUID LEVELS.	170.84	456.45	0	8.55	635.84
												NO H/COPY					
15834	22848	06/21/2022	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Brake	1ME739	17245.00	000	DIAGNOSE PARK BRAKE FAULT	HRS: 22180	944.01	5038.96	0	0	5982.97
												CHECK PARK BRAKE NOT WORKING CHECK SWITCH WIRING FUSES ETC CHECK POWER SULLP TO VALVE BANK LIFT CAB INSPECTED CHECKED SWITCHES & WIRING					
												22/06 ASSIST KOMATSU WITH PARKBRAKE ISSUES REMOVE VALVE BANK DISMANTLE & INSPECT DRAIN OIL FROM ACCUMLATOR & REGAS APPEARS TO BE WIRING ISSUES					
20289	23003	09/26/2022	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Chassis	1ME739	17245.00	000	GREASE AND CHECK OVER	CHECKED ENGINE OIL CHECKED COOLANT CHECKED FOR LEAKS GREASED ALL GREASE POINTS	85.63	0	0	5	90.63

22461	27471	11/14/2022	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	INT-R	Brake	1ME739	17245.00	0	00	PARKBRAKE ISSUE	HRS: 17520	171.26	0	0	8.6	179.86
													11/11 CHECK NO PARKBRAKE REMOVE SIDE COVER INSPECT SENSOR & WIRING RAISE CAB INSPECT SENSORS WIRING CONNECTIONS ETC ADVISED QUARRY MANAGER AUTO ELECTRIOCIAN WILL BE REQUIRED FOR FURTHER ESTING & DIAGNOSIS					
													07/12 KOMASTSU INSPECTED & REPAIRED FAULT					
2248	2762	07/21/2021	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Service Earthmovi ngA	1ME739	16635.00	0	00	21-07 WEEKLY GREASE AND REPAIR		128.13	9.84	0	70.21	208.18
2633	2875	07/30/2021	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Service Earthmovi ngA	1ME739	16635.00	0	00	WEEKLY GREASE		85.42	19.68	0	63.8	168.9
25269	29301	01/25/2023	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	INT-R	Brake	1ME739	17245.00	0	00	Park Brake Issue	HRS: 17588	85.63	0	0	68.8	154.43
													CHECK PARKBRAKE NOT RELEASING CHECK FAULT CODES CARRY OUT RESET PROCEDURE PARKBRAKE NOW ALL OK					
28283	33273	03/09/2023	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Brake	1ME739	17247.00	0	00	BRAKE FAULT, REPLACE ACCUMULATORS (SUBLET KOMATSU)		0	6840.13	0	0	6840.13
27860	33884	03/01/2023	1HM335HBG	ID - REABURN QUARRY PRODUCTION	121G	R	Sundries	1ME739	17245.00	0	00	Lever		0	1128.54	0	0	1128.54
28595	33973	03/17/2023	1HM335HBG	ID - REABURN QUARRY PRODUCTION	184G	R	Electrical	1ME739	17597.00	0	00	Tracker repairs	DIAGNOSED TRACKER FAUL, FOUND POOR RECEPTION DUE TO MOUNTING LOCATION. RELOCATED TO BELOW STEP INSIDE WHEEL WELL	428.15	0	0	291	719.15
21019	34032	10/11/2022	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	INT-S	Service Earthmovi ngB	1ME739	17245.00	0	00	500 HR SERVICE		220.9	456.67	0	15	692.57
30839	35199	04/13/2023	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Engine	1ME739	0.0000	0		INSPECT OIL LEAK	HRS: 17611	367.34	0	0	48	415.34
													CHECK OIL LEAK UNDERNEAITH MACHINE RAISE & SECURE CAB REMOVE AFFECTED HOSE O-RING REFIT HOSE, LOWER CAB RUN MACHINE CHECK FOR LEAK ALL OK					
3315	3542	08/17/2021	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Service Earthmovi ngA	1ME739	16635.00	0	00	S1A SERVICE	1ME739 HRS: 16710 S1A Service Carried out service & Check over	170.84	9.38	0	63.8	244.02

3324	3545	08/17/2021	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Electrical	1ME739	16635.00	0	00	SECURE BATTERY	11ME739 HRS: 16710 Secure Battery	169.38	80.71	0	63.8	313.89
30712	35775	04/11/2023	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Brake	1ME739	0.0000	0		Park Brake Issue (Komatsu)	ARRANGE SUBLET - PARK BRAKE	0	5106.16	0	5	5111.16
24903	36113	01/18/2023	1HM335HBG	ID - REABURN QUARRY PRODUCTION	352G	R	Sundries	1ME739	17245.00	0	00	REPAIR TYRE		0	962.5	0	0	962.5
3645	3628	08/25/2021	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Brake	1ME739	16635.00	0	00	PARK BRAKE INOP	1ME739 HRS: 16737 Park Brake INOP	380.06	0	0	63.8	443.86
31827	36610	05/05/2023	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Service Earthmovi ngA	1ME739	0.0000	0		Top Up Trans Oil & Grease Driveline	HRS: 17625 TOPPED UP TRANSMISSION TOOK ABOUT 20 LT GRASED LINES USED RBQ OIL STOCK	149.86	6.28	0	5	161.14
3075	3798	08/11/2021	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Service Earthmovi ngA	1ME739	16635.00	0	00	WEEKLY GREASE	1ME739 Hrs: 16766 WEEKLEY GREASE CARRIED OUT WEEKLEY GREASE & CHECK OVER	128.13	0	0	73.64	201.77
34265	38370	06/01/2023	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Electrical	1ME739	0.0000	0		Warning Light On	HRS: 17626 CHECKED WARNING LIGHT ON DASH DIAGNOSEDTRANSMISSION SENSOR FAULT - PRESSURE CHECK & ADJ OIL LEVEL RESET FAULT CODE ROAD TEST - NO LIGHT ON OPERATOR TO DRIVE MACHINE UNDER LOAD CONSDITIONS NO WARNING LIGHT	128.45	0	0	71	199.45
3743	3844	08/27/2021	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Service Earthmovi ngA	1ME739	16635.00	0	00	WEEKLY GREASE	1ME739 OD:16720 WEEKLEY GREASE GREASED MACHINE CHECKED ALL FLUID LEVELS GENERAL CHECK OVER CHECKED EMERGENCY STEERING PUMP ON & NO PARKBRAKE	76.01	0	0	73.68	149.69
4175	3856	09/07/2021	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Service Earthmovi ngA	1ME739	16635.00	0	00	WEEKLY GREASE	1ME739 HRS: 16768 CARRIED OUT WEEKLY GREASE SERVICE	161.43	0	0	68.1	229.53
3926	3869	08/31/2021	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Service Earthmovi ngA	1ME739	16635.00	0	00	WEEKLY GREASE	1ME739 OD:16,760 WEEKLY GREASE & INSPECTION	161.43	0	0	83.56	244.99

34879	39510	06/15/2023	1HM775HBG	ID - BEAUTY POINT SAND QUARRY	192G	R	Electrical	1ME739	17630.00	0	00	E03 Fault Code	TRAVEL TO BPS, FOUND FAULT CODE ON DASH FOR LOW BRAKE PRESSURE OIL FOR REAR BRAKE SYSTEM, TESTED TRUCK, FOUND FAULT CODE WOULD COME ON & GO OVER CERTAIN AMOUNT OF TIME, CHECKED WIRING TO SENSORS & CHECKED SENSORS - ALL OK, LIFTED CAB & CHECKED MORE WIRING - OK, ORGANISE KOMATSU TO INSPECT & TEST ACCUMULATOR, TRAVEL TO WORKSHOP. MADE CONTACT WITH KOMATSU, WHO ADVISED TO TEST, TRAVEL TO BPS, GOT FAULT CODE TO START COMING ON DASH, BLOCKED OFF PILOT LINE GOING FROM REAR ACCUMULATOR TO PARK BRAKE VALVE, JUMPED IN CAB TO SEE IF FAULT CODE WOULD COME BACK - DID NOT COME BACK ON, REFITTED PILOT LINE & TESTED, GOT FAULT TO COME BACK, ISOLATED ISSUE TO PARK BRAKE VALVE BYPASSING, ORDER NEW PARK BRAKE VALVE, FOUND DOOR LOCK NOT TURNING, INSPECTED & FOUND SIEZED, ORDER NEW DOOR LOCK BARREL, PACK UP TOOLS & TRAVEL TO WORKSHOP. COLLECT NEW PARTS, TRAVEL TO BPS, REMOVED OLD PARK BRAKE VALVE FROM LINE CHANGES OVER FITTINGS FROM OLD TRAVEL TO BPS	1082.8	1894.89	0	356.7	3334.39
36099	41892	07/06/2023	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Electrical	1ME739	0.0000	0	0	Inspect Fault Code	OPERATIED COMPLAINED OF FAULT CODE COMING UP ON DASH FOR FUEL SYSTEM OPERATED MACHINE FOUND FAULT CODE COME UP FOR TEMP SENSOR FOR REAR BRAKES INSPECTED TEMP SENSOR FOUND BROKEN WIRES JOINED WIRES TESTED OK COULD NOT GET FUEL FAULT TO APPREA TRUCK PLAYED UP THE NEXT DAY WITH FUEL ISSUE INSPECTED PRE FITTED SCREEN FOUND BLOCKED WITH RUST DIRECT FROM TANK CLEANED TESTED OK	388.25	5	0	94.5	487.75
37508	43611	08/01/2023	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Sundries	1ME739	17718.00	0	00	Dipstick Missing	PARTS ONLY	0	62.19	0	0	62.19
2803	4438	08/04/2021	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Service Earthmovi ngA	1ME739	16635.00	0	00	WEEKLY GREASE	1ME739 DO: 16692 Grease machine & check over	85.42	0	0	80.02	165.44

4600	4591	09/17/2021	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Service Earthmovi ngA	1ME739	16635.00	0	00	WEEKLY GREASE	1ME739 HRS:16798 WEEKLEY GREASE GREASED MACHINE CHECKED ALL FLUID LEVELS GENERAL CHECK OVER	85.42	0	0	73.64	159.06
40234	48449	09/26/2023	1HM775HBG	ID - BEAUTY POINT SAND QUARRY	192G	S	Service Earthmovi ngC	1ME739	0.0000	0	00	1000HR SERVICE	DR ASSIST DN WITH SERVICE DN CARRIED OUT 1000HR SERVICE AS PER SERVICE SHEET FOLLOW UP RH SIDE CAB INDICATOR NEEDS NEW GLOBES MIDDLE LH WHEEL MISSING BOLT	995.25	2865.5	0	159.5	4020.25
40546	48651	10/02/2023	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Sundries	1ME739	0.0000	0	00	Fit Missing LH Rim Mounting Bolt	ARRANGE SUPPLY OF PARTS FIT & TIGHTEN LH RIM MOUNTING BOLT	0	2.92	0	5	7.92
40603	48891	10/02/2023	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Electrical	1ME739	0.0000	0	00	FIT REVERSE BEEPER	INSPECTED REVERSE BEEPER FOUND IT TO BE WORKING REMOVED & CLEANED DEBRIS FROM INIT RE INSTALLED - ALL OK	134.38	0	0	5	139.38
28218	48996	03/08/2023	1HM335HBG	ID - REABURN QUARRY PRODUCTION	352G	R	Sundries	1ME739	17245.00	0	00	Lever		0	0.1	0	0	0.1
41299	49126	10/17/2023	1HM775HBG	ID - BEAUTY POINT SAND QUARRY	192G	R	Bodywork	1ME739	0.0000	0	00	Breakdown - Tray Wont Work	HRS: 17822 BRAKEDOWN - TRAN WONT MOVE LOCKED IN FIRST GEAR CHECKED TRAN POSITION, POTENTIOMETER CLEAN ALL OK FAULT WENT AWAY WHILE DIAGNOSING DRIVE UNIT - FAULT RETURNED - PARK BRAKE FAULT CHECKED OILS ETC - FAULT CLEARED UNIT WORKED ALL DAY NO ISSUES	288.38	0	0	15	303.38
42785	50785	11/16/2023	1HM775HBG	ID - BEAUTY POINT SAND QUARRY	192G	R	Hydraulic	1ME739	17969.00	0	00	oil leak, poss accumulator issue	HRS: 17969 OD: 115234 BRAKEDOWN - OIL LEAK TRAVEL TO SITE LOCATE LEAK - ACCUMULATOR DISCHARGE, REMOVE FITTINGS REPPLACE O'RINGS ASSEMBLE TEST - OK	220	0	0	121	341
43354	51870	11/27/2023	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Service Earthmovi ngB	1ME739	18045.00	0	00	250HR SERVICE	HRS: 18045 SERVICE CARRIED OUT AS PER SERVICE SHEET	154	191.21	0	44	389.21

4914	5202	09/23/2021	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Service EarthmovingA	1ME739	16635.00	000	WEEKLY GREASE	1ME739 16803 WEEKLEY GREASE GREASED MACHINE CHECKED ALL FLUID LEVELS GENERAL CHECK OVER	85.42	0	0	68.72	154.14
5141	5226	09/29/2021	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Service EarthmovingA	1ME739	16635.00	000	WEEKLY GREASE	1ME739 hRS: 16808 WEEKLEY GREASE GREASED MACHINE CHECKED ALL FLUID LEVELS GENERAL CHECK OVER	85.42	0	0	73.64	159.06
5124	5243	09/29/2021	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Bodywork	1ME739	16635.00	000	SEAT INOP AND CLEAN CABIN	1ME739 SEAT INOP & CLEAN CABIN CLEANED CABIN TO BE ABLE TO PROCED WORK ORDER	641.02	0	0	141.64	782.66
44321	52947	12/14/2023	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Air Con	1ME739	0.0000	0	Inspect Air Con	HRS: 18128 INSPECT AC SYSTEM FOUND GAS LOW IN SYSTEM PULLED REMAINING GAS OUT OF SYSTEM VACCED SYSTEM DOWN CHECKED FOR LEAKS GASSED SYSTEM UP ALL OK FOLLOW UP FIT NEW TEMP SENSOE ERCEIVER DRIVE	154	28	0	7.75	189.75
44332	52958	12/15/2023	1HM775HBG	ID - BEAUTY POINT SAND QUARRY	192G	R	Electrical	1ME739	0.0000	0	Inspect Beacon Light	INSTALL NEW GLOBE IN BEACON LIGHT TESTED -ALL OK	22	5.35	0	5	32.35
3878	5325	08/31/2021	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Engine	1ME739	16635.00	000	ENGINE LOW POWER AND MISSING	1ME739 ENGINE LOW POWER & MISSING SUBCONTRACT REPAIR TO KOMATSU FOUND BROKEN WIRES IN ENGINE	1260.26	1072.15	2063.38	63.8	4459.59
5400	5412	10/07/2021	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Service EarthmovingA	1ME739	16635.00	000	WEEKLY GREASE	1ME739 HRS:16837 WEEKLEY GREASE GREASED MACHINE CHECKED ALL FLUID LEVELS GENERAL CHECK OVER	170.84	0	0	74.68	245.52
45754	55672	01/29/2024	1HM775HBG	ID - BEAUTY POINT SAND QUARRY	192G	R	Bodywork	1ME739	0.0000	0	New Door Handle	REMOVE AND REPLACE DOOR HANDLE	102.5	114.36	0	0	216.86
45241	55747	01/16/2024	1HM775HBG	ID - BEAUTY POINT SAND QUARRY	192G	S	Service EarthmovingB	1ME739	18219.00	000	500HR SERVICE	CARRY OUT SERVICE AND VEHICLE INSPECTION. CHECK ALL LIGHTS, CHECK FLUID LEVELS. CHECK SUSPENSION, BRAKES AND TYRES	418	1342.58	0	120	1880.58

5694	5901	10/14/2021	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Sundries	1ME739	0.0000	0	CARRY OUT WEEKLY GREASE INSPECTION	1ME739 WEEKLEY GREASE GREASED MACHINE CHECKED ALL FLUID LEVELS GENERAL CHECK OVER	42.71	0	0	57.54	100.25
51241	61824	04/30/2024	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Sundries	1ME739	18219.0000	0	Supply Fuel Filters		45.05	53.55	0	0	98.6
52898	63437	06/03/2024	1HM335HBG	ID - REABURN QUARRY PRODUCTION	187G	R	Sundries	1ME739	18219.0000	0	genral repairs	INSPECT BONNET	383.19	0	0	0	383.19
52783	63591	05/30/2024	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Electrical	1ME739	18219.0000	0	supply flashing light		186.56	254	0	0	440.56
51243	63731	04/30/2024	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Service EarthmovingB	1ME739	0.0000	0	500HR SERVICE	WORK CARRIED OUT BY RBQ MECHANIC	39.22	0	0	0	39.22
6156	6395	10/27/2021	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Service EarthmovingA	1ME739	16635.0000	0	WEEKLY GREASE	1ME739 WEEKLEY GREASE GREASED MACHINE CHECKED ALL FLUID LEVELS GENERAL CHECK OVER	128.13	0	0	81.04	209.17
53279	64041	06/11/2024	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Sundries	1ME739	0.0000	18683	machine inspection and report on faults	TRAVEL TO RAEBURN QUARRY. INSPECTED & REPORTED ON MACHINE.	303.16	0	0	50	353.16
52981	64058	06/03/2024	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Electrical	1ME739	18219.0000	0	replace cab lights (sublet nbc)		45.05	68	0	0	113.05
55315	66631	07/19/2024	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Service EarthmovingA	1ME739	18903.0000	0	250 HR SERVICE	CARRIED OUT SERVICE & VEHICLE INSPECTION. CHECKED ALL LIGHTS, CHECKED FLUID LEVELS. CHECKED SUSPENSION, BELTS, BRAKES & TYRES. LUBRICATED ALL GREASE POINTS. ROAD TESTED - ALL OK AT TIME OF TESTING NOTES: ALL FAULTS LISTED PREVIOUSLY.	209.88	225.12	0	52	487
54770	66712	07/09/2024	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Engine	1ME739	18219.0000	0	supply oil filters LF9018		45.05	241.98	0	0	287.03
6534	6694	11/05/2021	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Service EarthmovingA	1ME739	16635.0000	0	WEEEEKLY GREASE	1ME739 WEEKLEY GREASE GREASED MACHINE CHECKED ALL FLUID LEVELS GENERAL CHECK OVER	139.89	9.84	0	7	156.73
6508	6697	11/05/2021	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Engine	1ME739	16635.0000	0	FUEL LEAK AT PRESS SENSOR	1ME739 FUEL LEAK AT PRESS SENSOR FUEL LEAK IDENTIFIED AND PARTS REPLACED	130.46	0	0	64.45	194.91

56018	67441	07/31/2024	1HM335HBG	ID - REABURN QUARRY PRODUCTION	184G	R	Electrical	1ME739	18951.00	000	3G/4G TRACKER REPLACEMENT	CARRY OUT 3G TO 4G TRACKER UPGRADE. ACTIVATE NEW TRACKER AND TEST OPERATION ALL OK	233.2	0	0	170	403.2
59023	71326	09/30/2024	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Hydraulic	1ME739	18951.00	000	Blown hydraulic hose	TRAVEL TO SITE REMOVE BLOWN HOSE FROM MACHINE. SUBLET TO MAKE UP NEW HOSE. FIT NEW HOSE TO MACHINE AND FILL WITH HYDRAULIC OIL. ZIP TIE WIRING LUME AND REFIT HOSE CONDUIT. NOTES: QUARRY SUPPLIED OIL.	281.7	383.27	0	200	864.97
6799	7249	11/14/2021	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Service EarthmovingA	1ME739	16635.00	000	WEEKLY GREASE	1ME379 OD: 16978 WEEKLEY GREASE GREASED MACHINE CHECKED ALL FLUID LEVELS GENERAL CHECK OVER	186.52	9.84	0	73.1	269.46
61016	73039	11/08/2024	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Service EarthmovingB	1ME739	18951.00	000	parts missed off 51243 service job	PARTS PICKED UP & DELIVERED 01/05/10/24 MISSED OFF SERVICE JOB 51243	45.05	1034.51	0	0	1079.56
56702	73740	08/13/2024	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Service EarthmovingB	1ME739	18951.00	000	CARRY OUT 1000HR SERVICE	CARRIED OUT 1000 HR SERVICE & INSPECTION. - CHECKED ALL LIGHTS & REFLECTORS. - INSPECTED, GREASED & ADJUSTED WHEEL BEARINGS. - CHECKED & LUBRICATED SUSPENSION POINTS & HITCH. - INSPECTED CHASSIS FOR CRACKS, RUST & DAMAGE. - CHECKED TYRE CONDITION & PRESSURES. - CHECKED HITCH FOR PLAY & ADJUSTED. - OIL SAMPLES TAKEN. - CHANGED OIL.	731.93	1726.83	0	442.64	2901.4
61311	73747	11/14/2024	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Service EarthmovingA	1ME739	19159.00	000	250 HR SERVICE	TRAVEL TO SITE.CARRIED OUT 250 HR SERVICE & CHECKS AS REQUIRED - ALL OK. OIL SAMPLE TAKEN. CHECKED ALL FLUIDS. NOTES: ORBITAL STEERING VALVE LEAK. DIFF BUSHES (SIDE TO SIDE) OIL LEAK FROM HYDRAULIC TANK WHEEL ENDS LEAKING LH STEER CYLINDER LEAKING NEED TO CHECK TYRE PRESSURES.	138.33	0	0	92	230.33

62115	74365	11/28/2024	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Air Con	1ME739	19212.00	0	00	Inspect A/C System	INSPECT A/C SYSTEM. FOUND LOW GAS, RE-GASSED SYSTEM UP TO SPEC. CHECKED OPERATION - ALL OK. CLEANED CABIN FILTERS	138.33	0	0	140	278.33
62198	76586	11/29/2024	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Sundries	1ME739	19214.00	0	00	TRAVEL & INSPECT NOISE COMING FROM RUCK	TEST DRIVE TRUCK. DIAGNOE NOISE COMING FROM FRONT DIFF AS DIFF LOCK IS ENGAGED. TOOK OIL SAMPLES FROM FRONT DIFF AND FINAL DRIVES. CONTAMINATION FOUND IN OIL SAMPLES. FURTHER WORK REQUIRED.	233.2	0	0	78	311.2
65584	85643	01/29/2025	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Drive Line	1ME739	19214.00	0	00	Carry out inspection / contamination in diff oils / front diff binding	CARRIED OUT VISUAL CHECK AND REPORTED TO SUPERVISOR. CLEAN UNDER CARRIAGE, FRONT & ENGINE BOX. REPAIR DAMAGED WIRE ON 1ST DRIVE AXLE, REPLACE DAMAGED WIRE & SOCKET. REMOVE LH DRIVE FRONT AXLE AND INSPECT BEARING FOR DAMAGE. CLEAN UP OIL SPILL FROM UNDER TRUCK. INSPECT HUB CONDITION ON FRONT RH DRIVE WHERE LEAK FOUND. RE-INSTALL HUB LOCK PLATE AND ACCESSORIES. REMOVE TAIL SHAFT ON RH DRIVE FRONT HUB AND CHECK BUSHING CONDITION. CHECK & RUN ENGINE- NO LEAK FOUND. FILL UP TRANSMISSION OIL. DRAIN FRONT DIFF OIL AND CHECK FOR DEBRIS. ATTEMPTED TO MOVE TRUCK - E03 COMES OUT OF GEAR AND WON'T GO IN. CHECK & CLEAN PARTS. REFIT DRIVE SHAFT. REFIT PLANETARY HUB GEAR COVER. NOTES:	2839.25	117.04	0	122	3078.29
280	864	06/04/2021	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Service Earthmovi ngA	1ME739	16603.00	0	00	auto greaser and grease unit		83.58	104.73	0	63.8	252.11
72153	86863	06/02/2025	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Sundries	1ME739	19214.00	0	00	Assist with loading onto float	START TRUCK & CHECK BATTERY VOLTAGE. MOVE TRUCK TO FLOAT AND ASSIST TO LOAD ONTO FLOAT.	50	0	0	0	50
080414- 0048	90	05/12/2008	1H0103	ID - EXCAVATING	122_INT	R	Sundries	1ME739				TYRE REPAIR @ DEE LAGOON		0	-404.36	0	0	-404.36

8116	9005	12/14/2021	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Bodywork	1ME739	17000.00	0	00	WASH TRUCK/ INSPECT OIL LEAK	1ME739 HRS:17000	85.42	0	0	63	148.42
													CARRIED OUT INSPECTIONFOR MAJOR OIL LEAK TOP OFF DIFF WASHED TRUCK					
110207- 0024	9471	02/18/2011	1H0103	ID - EARTHMOVING	187_INT	R	Engine	1ME739	7827			OPENED IN ERROR		0	0	0	0	0
8105	9475	12/14/2021	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	S	Engine	1ME739	17000.00	17030	00	WEEKLY GREASE/INSPECTION	1ME739 HRS; 27030	85.42	4.92	0	8.84	99.18
													WEEKLEY GREASE GREASED MACHINE CHECKED ALL FLUID LEVELS GENERAL CHECK OVER					
7764	9507	12/07/2021	1HM335HBG	ID - REABURN QUARRY PRODUCTION	186G	S	Service Earthmovi ngC	1ME739	17000.00	0	00	SERVICE C - 1000 HR	1ME739 HRS: 17030	256.26	1101.88	0	269	1627.14
													SERVICE C - 1000HR AS PER SERVICE SHEET					
7888	9508	12/09/2021	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Hydraulic	1ME739	0.0000	0		DIAGNOSE/REPAIR HYDRAULIC OIL LEAK	1ME739 HRS: 17028	768.78	0	0	49.92	818.7
													DIAGNOSE / REPAIR HYDRAULIC OIL LEAK					
8865	9993	01/11/2022	1HM335HBG	ID - REABURN QUARRY PRODUCTION	192G	R	Sundries	1ME739	17000.10	0	00	WEEKLY GREASE	1ME739 HRS: 17047	132.52	9.8	0	74.1	216.42
													WEEKLEY GREASE GREASED MACHINE CHECKED ALL FLUID LEVELS GENERAL CHECK OVER					
071129- 0070	SVC00002 809	11/29/2007	1H0103	ID - EXCAVATING	184_INT	R	Brake	1ME739	2999	HRS		Inspect park brake fault	TRAVELLED TO MCROBBIES TIP. INSPECT PARK BRAKE FAULT,ADJUST PARK BRAKE AND TEST	45	0	0	5.25	50.25
080111- 0075	SVC00003 588	01/31/2008	1H0103	ID - EXCAVATING	184_INT	S	Service	1ME739	3186			S1 C - 1000 HR SERVICE.	TRAVELLED TO HMBI. CARRIED OUT SERVICE AS PER SERVICE SCHEDUEL	586.25	1247.23	0	117.2	1950.68
080114- 0057	SVC00004 033	02/07/2008	1H0103	ID - EXCAVATING	184_INT	R	Hydraulic	1ME739	3175			REPLACE STEERING CYL FITTING.	ODOMETER: 3175	250	635.15	0	83.2	968.35
													TRAVELLED TO HBMI X 2. REMOVE BROKEN FITTING FROM STEERING RAM AND STEER HOSE. TAKE FITTING FROM M740 AND REFIT TO M739, FILL WITH OIL AND TEST OK					
071017- 0025	SVC00004 44	01/18/2008	1H0103	ID - EXCAVATING	184_INT	S	Service	1ME739	2842			S1 A - SERVICE.	TRAVEL TO CAMBRIDGE. SERVICE UNIT AS REQUESTED	128.75	211.17	0	30.8	370.72
080228- 0038	SVC00006 035	03/07/2008	1H0103	ID - EXCAVATING	122_INT	R	Sundries	1ME739				PARTS REQUISITION 16629		0	59	0	0	59
080304- 0019	SVC00006 243	03/07/2008	1H0103	ID - EXCAVATING	122_INT	R	Sundries	1ME739				PARTS REQUISITION 17159		0	70.42	0	0	70.42
080307- 0043	SVC00006 417	03/07/2008	1H0103	ID - EXCAVATING	184_INT	R	Electrical	1ME739	3325			CHECK FOR OVERHEATING FAULT	CHECK UNIT FOR OVERHEATING FAULT AND TEST ON ROAD	52.5	0	0	0	52.5

080325-0079	SVC00007 317	04/07/2008	1H0103	ID - EXCAVATING	184_INT	R	Brake	1ME739		CHEAK FAULT LIGHT ON BRAKES	TRAVELLED TO DEE LAGOON TO INVESTIGATE STEERING AND BRAKE FAULT. CHECKED FAULT CODES, NO ELECTRICAL FAULTS RECORDED, CHECKED MECHANICAL CODES AND FOUND BRAKE OVER HEATS, RAN MACHINE WITH DRIVER, COULD NOT FAULT MACHINE AS ALL TEMPS WERE NORMAL	0	0	946.73	0	946.73
080319-0010	SVC00007 986	04/03/2008	1H0103	ID - EXCAVATING	122_INT	R	Sundries	1ME739		TYRE REPLACEMENT @ DEE LAGOON	1ME739 ODO - 3444 HRS DUGGAN AND PARKER TYRE SERVICE CALLOUT TO DEE LAGOON REPLACE DAMAGE TYRE	0	233.28	0	0	233.28
071029-0017	SVC00009 35	10/29/2007	1H0103	ID - EXCAVATING	122_INT	R	Tyres	1ME739		CALL OUT CHECK & ADJUST TYRE		0	54.56	0	0	54.56
080326-0077	SVC00009 365	07/29/2008	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739	3325	S1 A - 250 HR SERVICE.	TRAVELLED TO DEE LAGOON TO CARRY OUT 250HR SERVICE	0	138.59	1392.86	0	1531.45
080414-0048	SVC00009 378	05/12/2008	1H0103	ID - EXCAVATING	122_INT	R	Sundries	1ME739		TYRE REPAIR @ DEE LAGOON	1ME739 GOODYEAR TYRES ROAD SIDE SERVICE AFTER HOURS SATURDAY MORNING TO DEE LAGOON & REPAIR TYRE	0	404.38	0	0	404.38
080428-0022	SVC00009 890	05/30/2008	1H0103	ID - EXCAVATING	184_INT	R	Hydraulic	1ME739	3707	REPAIR HOIST CONTROL FAULT.	TRAVELLED TO DEE LAGOON. CHECK HYDRAULIC SYSTEM, CHECK HYDRAULIC CONTROL, REMOVE AND REPAIR,REMOVE CONTROL FROM M740 AND TEST OPERATION OF M739 AND REFIT TO M740, REMOVE AND REPLACE SOLINOID ON VALVE BANK, LOWER AND SECURE CAB AND TEST RUN	1278.75	2357.25	1721.97	822.8	6180.77
080520-0057	SVC00010 790	05/20/2008	1H0103	ID - EXCAVATING	184_INT	R	Hydraulic	1ME739	3741	LOCATE OIL LEAK	LOCATE OIL LEAK UNDER CAB, LIFT CAB AND ASCERTAIN NO FRESH LEAKS ANYWHERE BUT IS LEAKING AIRCON WATER OUT OF VENT PIPES, TAKE PHOTOS TO REPORT BACK TO P STELFOX AND SHOW DRIVER AND M HAZELL NO NEW LEAKS FOUND.	203.75	0	0	41.6	245.35
080519-0060	SVC00011 096	05/26/2008	1H0103	ID - EXCAVATING	184_INT	R	Electrical	1ME739	3168.	REPLACE REVOLVING LIGHT.	CHANGE FLASHING LIGHT ***NO PARTS ISSUED - ORDERED ON SEPARATE SERVICE CALL***	103.75	0	0	0	103.75
080528-0008	SVC00011 489	05/29/2008	1H0103	ID - EXCAVATING	122_INT	F	Tyres	1ME739		FIT CUSTOMER RUNOUT	1ME739 ODO - 3705 HRS DUGGAN AND PARKER TYRE SERVICE TRAVEL TO DEE LAGOON FIT CUSTOMER OWN PRODUCT ARRANGED BY DARREN McCONNON	0	402.36	0	0	402.36

080528-0006	SVC00011 05/29/2008 491	1H0103	ID - EXCAVATING	122_INT	R	Tyres	1ME739		REPAIR TYRE	1ME739	0	324	0	0	324
										DUGGAN AND PARKER TYRE SERVICE REPAIR TYRE - TO BE HELD FOR SPARE					
080612-0098	SVC00012 07/05/2008 041	1H0103	ID - EXCAVATING	122_INT	R	Sundries	1ME739		REFER REQ.13310	REFER TO REQ 13310	0	77.06	0	0	77.06
080522-0073	SVC00012 06/17/2008 268	1H0103	ID - EXCAVATING	184_INT	S	Service	1ME739	3896	SI B - 500 HR SERVICE.	TRAVELLED TO SISTERS HILLS TO CARRY OUT SERVICE AS PER SCHEDULE	242.5	684.77	0	44.8	972.07
080711-0010	SVC00013 07/15/2008 624	1H0103	ID - EXCAVATING	184_INT	R	Electrical	1ME739	3921 HRS	REPLACE BROKEN GLOBES	TRAVELLED TO SISTERS HILLS. REPAIR AND REFIT REAR LIGHT ASSEMBLY AND REPLACE BROKEN GLOBES	165	40.59	0	22.5	228.09
080804-0059	SVC00014 11/25/2008 846	1H0103	ID - EARTHMOVING	184_INT		Service	1ME739	4151.	S1 A SERVICE	TRAVELLED TO SISTERS HILLS AND CARRIED OUT SERVICE AS PER SCHEDULE ON UNIT	195	203.07	0	50.4	448.47
080826-0038	SVC00015 11/06/2008 752	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739	4151.	S1 D - 2000 HR SERVICE	CARRY OUT 250HR SERVICE	290	189.37	0	56.7	536.07
										HOURS MISSED OFF SERVICE CALL 080804-0059 SVC00014846					
080926-0014	SVC00017 09/30/2008 859	1H0103	ID - EARTHMOVING	184_INT	R	Service	1ME739	4371	CLEAN AROUND STEER CYLINDERS	CLEAN AROUND STEERING CYLINDERS	100	0	0	0	100
081008-0035	SVC00018 10/22/2008 113	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739	4493hrs	S1 B - 500 HR SERVICE.	TRAVELLED TO BELL BAY TO CARRY OUT S1-B 500HR SERVICE AS PER SCHEDULE	530	771.13	0	202.5	1503.63
081016-0067	SVC00018 11/05/2008 709	1H0103	ID - EARTHMOVING	184_INT	R	Trimming	1ME739	4502	REPLACE SEAT SHOCK ABSORBERS	TRAVELLED TO BELL BAY TO PICK UP PARTS. REMOVE SEAT AND DISMANTLE, FIT NEW SHOCK ABSORBERS AND REFIT SEAT	453.5	192	0	169.2	814.7
081106-0071	SVC00019 11/28/2008 626	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739		SUNDRY SUPPLEMENTARY SERVICE.	Service unit as required Replace windscreen Replace tail shaft grease nipples, replace park brake circlip in slack adjuster, replace mirror, repair tilt cab and reseal 2 hydraulic cylinders, remove door and straighten window channels, straighten front mudgaurd. Fit remote diff breathers and front axle breathers, replace axle seal on front left hand side.	641.5	2168.56	187.27	5.4	3002.73
081125-0036	SVC00020 11/28/2008 557	1H0103	ID - EARTHMOVING	186_INT	R	Differentia l-FD	1ME739		REPAIR LEAKING FRONT AXLE SEAL	Removed and replaced front left hand side axle seal and ran two hub breather lines	400	203.14	0	0	603.14
081111-0024	SVC00020 11/27/2008 717	1H0103	ID - EARTHMOVING	184_INT	R	Bodywork	1ME739	4552	REPLACE L/H CAB DOOR WINDOW.	TRAVELLED TO SOUTH HBART. CLEAN UP MACHINE AFTER BEING VANDALISED, REMOVE DOOR WITH GOOD WINDOW AND PUT ON 1ME645 AND PUT DAMAGED DOOR FROM 1ME645 ONTO 1ME739	245	216.33	0	9	470.33
081208-0011	SVC00021 03/20/2009 577	1H0103	ID - EARTHMOVING	186_INT	R	Sundries	1ME739		SET MACHINE UP FOR TYRES.	Repair oil leaks and set the machine up for new tyres, Jack up the machine and place on stands. Lower the machine back onto the ground and clean.	1055	377.23	0	0	1432.23
081228-0006	SVC00022 12/29/2008 012	1H0103	ID - EARTHMOVING	184_INT	R	Tyres	1ME739	4552.	ASSIST FITTING OF L/H TYRE SET	ASSIST WITH THE CHANGING OUT OF TYRES IN WORKSHOP	125	0	0	0	125

081230-0021	SVC00022 12/30/2008 053	1H0103	ID - EARTHMOVING	184_INT	R	Engine	1ME739	4600	CLEAN OUT RADIATOR	TRAVELLED TO ROCKMOUNT RD. CLEAN OUT RADIATOR, COOLER AND CONDENSOR AND CHECK COOLANT LEVELS	130	0	0	40.5	170.5
090123-0010	SVC00023 01/27/2009 193	1H0103	ID - EARTHMOVING	184_INT	R	Bodywork	1ME739	4675	CLEAN WINDOW CHANNEL	CLEAN WINDOW CHANNEL travel to deloraine to clean window channel	200	0	0	112.5	312.5
090130-0101	SVC00023 05/14/2009 519	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739		S1 A - 250 HR SERVICE	CARRIED OUT 250HR SERVICE AS PER SCHEDULE	230.5	138.65	0	0	369.15
090207-0005	SVC00023 03/26/2009 844	1H0103	ID - EARTHMOVING	122_INT	R	Sundries	1ME739		REFER REQ.26783 FEB PG	REFER REQ.26783 FEB PG	0	427.92	0	0	427.92
090216-0010	SVC00024 02/17/2009 166	1H0103	ID - EARTHMOVING	184_INT	R	Bodywork	1ME739	4823	DIS MANTLE WINDOW CHANNEL	DISMANTLE WINDOW CHANNEL window channel full of crud and motor full of glass cleaned out as much as we could may need new motor travel to deloraine	254.5	0	0	90	344.5
090210-0029	SVC00024 02/26/2009 876	1H0103	ID - EARTHMOVING	184_INT	R	Electrical	1ME739	4675 HRS	REPAIR UHF LEAD	REPAIR UHF LEAD : PLEASE REFER TO JOB NUMBER 0901123 - 0010 THIS WAS RAISED FOR PURCHASE ORDER NUMBER.	0	24.3	0	0	24.3
090306-0075	SVC00025 04/07/2009 252	1H0103	ID - EARTHMOVING	122_INT	R	Sundries	1ME739		REFER MARCH REQ.PG 26794	REFER MARCH REQ.PG 26794	0	17.06	0	0	17.06
090115-0057	SVC00025 03/19/2009 896	1H0103	ID - EARTHMOVING	122_INT	R	Sundries	1ME739		REFER REQ.26776 JAN PG	REFER REQ.24765 JAN PG	0.05	18	0	0	18.05
090401-0061	SVC00026 04/09/2009 824	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739	5,037 HRS	S1 C - 1000 HR SERVICE	S1 C - 1000 HR SERVICE : TRAVELLED TO DELORAINE. CARRY OUT 1000 HR SERVICE AND CHECKS.	450.5	1496.51	0	200.7	2147.71
090406-0031	SVC00026 04/07/2009 886	1H0103	ID - EARTHMOVING	122_INT	R	Sundries	1ME739		PARTS REQ APRIL 25155	PARTS REQ APRIL 25155	0	17.12	0	0	17.12
090401-0061	SVC00027 04/09/2009 230	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739	5,037 HRS	S1 C - 1000 HR SERVICE	TRAVELLED TO DELORAINE. CARRIED OUT 1000HR SERVICE AND FITTED NEW NUMBER PLATES TO UNIT	799	0	0	452.7	1251.7
090417-0030	SVC00027 05/12/2009 533	1H0103	ID - EARTHMOVING	122_INT	R	Sundries	1ME739		REFER APRIL REQ.PG 25160	REFER APRIL REQ.PG 25160	0	31.06	0	0	31.06
090521-0050	SVC00029 06/26/2009 546	1H0103	ID - EARTHMOVING	122_INT	R	Sundries	1ME739		REFER MAY REQ.PG 25178	REFER MAY REQ.PG 25178,	0	169.64	0	0	169.64
090601-0006	SVC00030 06/24/2009 282	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739	5258	S1 A - 250 HR SERVICE	SHARED TRAVEL TO MUSSELROE BAY AND CARRIED OUT 250HR SERVICE AS PER SCHEUDLE	254.5	296.94	0	243	794.44
090611-0035	SVC00030 06/11/2009 717	1H0103	ID - EARTHMOVING	122_INT	R	Tyres	1ME739	NA	PUNCTURE REPAIR CALL OUT	PUNCTURE REPAIR CALL OUT	0	489.09	0	0	489.09
090811-0058	SVC00033 09/17/2009 951	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739	5557	S1 B - 500 HR SERVICE	S1 B - 500 HR SERVICE : AT M.R.B CARRY OUT SERVICE AND CHECKS ON UNIT. * ALL FILTERS SUPPLIED THROUGH KOMATSU LAUNCESTON - ORDERED P/ STELFOX ONSITE AT MUSSLEROE BAY. LOAD UP SERVICE KIT	311	714.98	0	29.7	1055.68
090814-0081	SVC00034 08/18/2009 217	1H0103	ID - EARTHMOVING	184_INT	R	Bodywork	1ME739	5480	REMOVE WINDOW WINDER	TRAVELLED TO MUSSLEROE BAY. CARRY OUT WINDOW WINDER MOTOR AND TOP UP COOLANT AND CHECK FOR LEAKS	268	0	0	99	367

090807-0029	SVC00034 08/19/2009 406	1H0103	ID - EARTHMOVING	186_INT	R	Electrical	1ME739		REPAIRS TO POWER WINDOW	Locate and repair fault in power windows as required	110	231.82	0	0	341.82
090821-0062	SVC00036 09/28/2009 095	1H0103	ID - EARTHMOVING	184_INT	R	Hydraulic	1ME739	5583	REPLACE HYD TANK BREATHER ASS	replace hydraulic tank breather assembly	55	271.13	0	0	326.13
090831-0035	SVC00036 09/18/2009 300	1H0103	ID - EARTHMOVING	184_INT	R	Ancillary Equip	1ME739	5,583 HRS	FIT UP WINDOW REGULATOR	FIT UP WINDOW REGULATOR : TRAVEL TO M.R.B REFIT UP REPAIRED WINDOW REGULATOR AND TEST. * ALL REPAIRS DONE THROUGH HOBART W/SHOP ! TRAVEL DISTANCE 100 KMS CLOSE JOB !	137.5	0	0	90	227.5
090918-0030	SVC00036 10/06/2009 440	1H0103	ID - EARTHMOVING	184_INT	R	Engine	1ME739	5686	REPAIR OVERHEATING FAULT	TRAVELLED TO MUSSELROE BAY. INSPECT OVERHEATING, CHECK COOLANT AND FAN BELT. RADIATOR FOUND TO BE PARTLY BLOCKED. UNABLE TO BLOW OUT RADIATOR AS HAD TO 4WD 20 MIN OUT TO DUMP TRUCK. UNABLE TO GET SERVICE TRUCK OUT THERE	997	70.8	0	585	1652.8
091008-0020	SVC00037 10/23/2009 350	1H0103	ID - EARTHMOVING	122_INT	R	Sundries	1ME739		STORE ISSUE OCT.PG REQ.898	STORE ISSUE OCT.PG REQ.898	0	232.32	0	0	232.32
091012-0037	SVC00037 10/26/2009 514	1H0103	ID - EARTHMOVING	184_INT	R	Electrical	1ME739	5795	REPLACE R/H REARINDICATOR LENS	ALREADY ON SITE AT MACHINE. CHECK AND REPAIR FRONT PARK LIGHT, ADD RADIATOR STOP LEAK AND TOP UP RADIATOR. REPLACE TAIL LIGHT LENS	127	308.98	0	0	435.98
091019-0020	SVC00037 10/29/2009 843	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739	5859	S1 A - 250 HR SERVICE	SHARED TRIP TO MUSSELROE BAY TO CARRY OUT 250HR SERVICE AS PER SCHEDULE	380	448.48	0	119.7	948.18
091012-0058	SVC00038 10/27/2009 390	1H0103	ID - EARTHMOVING	184_INT	R	Transmissi on	1ME739	5762 HRS	DIAGNOSE TRANSMISSION ALARM FA	DIAGNOSE TRANSMISSION ALARM FAULT. Travel to musselroe bay . Rerairs completed travel 50kms	475	0	0	45	520
091028-0054	SVC00038 11/05/2009 489	1H0103	ID - EARTHMOVING	184_INT	R	Transmissi on	1ME739	5762	REPAIR GEAR SELECTION FAULT	DIAGNOSED FAULT WITH DUMP TRUCK FAULT CODE : E03 DDT JKA REPAIRED GEAR SELECTION FAULT	13.75	0	399.28	0	413.03
091106-0027	SVC00039 01/08/2010 022	1H0103	ID - EARTHMOVING	122_INT	R	Sundries	1ME739		STORE ISSUE NOV.PG REQ.1136,	STORE ISSUE NOV.PG REQ.1136,	0	21	0	0	21
091116-0083	SVC00039 12/31/2009 499	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739	6153 hr	S1 D - 2000 HR SERVICE	Service unit as required for "D" type service. And repairs as per the fault sheet.	1149.5	4855.08	0	2.7	6007.28
091108-0010	SVC00039 12/10/2009 507	1H0103	ID - EARTHMOVING	184_INT	R	Electrical	1ME739	5935	REPLACE R/H WINDOW WINDER ASSY	TRAVELLED TO MUSSELROE BAY. ATTEMPT TO FIT WINDOW WINDER ASSEMBLY. WORKED OUT THAT NEW DRIVE MOTOR FITTED WAS LARGER THEN ORIGINAL AND WOULD NOT ROTATE ENOUGH TO ALIGN BOLT HOLES. MOTOR WAS LEFT HAND DOOR AND IS LARGER THEN MOTOR REQUIRED FOR RIGHT HAND	550	1655.7	0	76.5	2282.2
091119-0069	SVC00039 11/25/2009 809	1H0103	ID - EARTHMOVING	184_INT	R	Engine	1ME739		CLEAN AIR FILTERS	CLEAN AIR FILTERS OFF BOTH 1ME739 AND 1ME740	55	0	0	0	55
091119-0084	SVC00041 12/18/2009 354	1H0103	ID - EARTHMOVING	184_INT	R	Ancillary Equip	1ME739	4988	REPAIR AIR COND SYSTEM	SUPPLY AND FIT AIR CON RECIEVER DRYER AND OTHER FAULTS WHICH ARE FOUND	573	349.42	0	0	922.42

100127-0052	SVC00043 01/27/2010 330	1H0103	ID - EARTHMOVING	184_INT	R	Sundries	1ME739	6200	REPLACE DAMAGE GREASE NIPPLES	TRAVELLED TO BRIGHTON AND REPLACE DAMAGED GREASE NIPPLES	66	0	0	9	75
100202-0082	SVC00043 02/04/2010 782	1H0103	ID - EARTHMOVING	184_INT	R	Engine	1ME739	6217	CHECK OVERHEATING FAULT	TRAVELLED TO BRIGHTON AND BLOW OUT RADIATOR, OIL COOLER AIR CON AND AIR CLEANER	96.5	0	0	13.5	110
100115-0005	SVC00043 02/09/2010 978	1H0103	ID - EARTHMOVING	186_INT	R	Electrical	1ME739	51,155 km 6,203 hrs	Check air con	Repair the a/c system.	231	0	0	0	231
100215-0064	SVC00044 03/26/2010 413	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739	6438	S1 A - 250 HR SERVICE	TRAVELLED TO BRIGHTON AND CARRIED OUT 250HR SERVICE AS PER SCHEDULE. CHANGED ENGINE OIL AND FILTERS. TENSIONED FAN BELT AND AIR CON BELT. TOPPED UP WWITH COOLANT AND CHANGED AIR FILTER	55	289.27	380.66	0	724.93
100203-0056	SVC00046 03/29/2010 068	1H0103	ID - EARTHMOVING	184_INT	R	Ancillary Equip	1ME739	6333	REPAIR AIR COND SYSTEM	TRAVELLED TO BRIGHTON. CHECK OVER AIR CON AND FOUND LOW PERFORMANCE. REPLACE AIR CON AFTER REPAIRS FROM TEMP SOLUTIONS	373	787.03	160	40.5	1360.53
100311-0050	SVC00046 03/15/2010 116	1H0103	ID - EARTHMOVING	184_INT	R	Ancillary Equip	1ME739	6423	REPLACE AIR COND CONDENSER	19/02 - CHECKED AIR COND SYSTEM AND FOUND RECENTLY FITTED CONDENSER HAD FAILED. ORDERED REPLACEMENT SUPPLIED BY KOMATSU UNDER PARTS WARRANTY. 22/02 - TEMPERATURE SOLUTIONS REPLACED CONDENSER AND REGASSED SYSTEM ANSD TESTED OPERATION OK.	198.5	0	195	67.5	461
100316-0018	SVC00046 03/16/2010 387	1H0103	ID - EARTHMOVING	184_INT	R	Engine	1ME739	6454	CHECK OVERHEATING FAULT	TRAVELLED TO BRIGHTON AND BLOW OUT RADIATOR, AIR CON OIL COOLER AND CHANGE BRAKE LIGHTS	135.5	0	0	13.5	149
100325-0031	SVC00047 03/26/2010 075	1H0103	ID - EARTHMOVING	122_INT	R	Sundries	1ME739		STORE ISSUE MARCH PG.103-1971,	STORE ISSUE MARCH PG.103-1971,	0	152.64	0	0	152.64
100415-0049	SVC00048 05/21/2010 108	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739	6757 hrs	S1 B - 500 HR SERVICE	TRAVELLED TO BRIGHTON AND CARRIED OUT 500 HR SERVICE AS PER SCHEDULE.	27.5	876.66	633.84	0	1538
100430-0022	SVC00049 05/13/2010 024	1H0103	ID - EARTHMOVING	184_INT	S	Transmissi on	1ME739	6792	Replace transmission oil	TRAVELLED TO DOVER. DRAIN AND TAKE TRANSMISSION OIL SAMPLES	295	294.5	0	72	661.5
100504-0096	SVC00049 05/19/2010 244	1H0103	ID - EARTHMOVING	184_INT	R	Engine	1ME739	6802 hrs	REPLACE HEATER TAPS	ONSITE AT STRINGERS CREEK. CARRIED OUT REPAIRS FOR THE REPLACEMENT OF SEIZED AND BROKEN HEATER TAPS	171.5	62.58	0	0	234.08
100504-0098	SVC00050 05/20/2010 430	1H0103	ID - EARTHMOVING	182_INT	R	Lathe	1ME739		MACHINE 4 DOOR STRIKER BUSHES	MACHINE 4 DOOR STRIKER BUSHES	126.5	171.16	0	0	297.66
100618-0018	SVC00052 06/29/2010 998	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739	7024	S1 C - 1000 HR SERVICE	TRAVELLED TO STRINGERS CREEK. CARRIED OUT 1000HR SERVICE AS PER SCHEDULE	629	1714.21	0	45	2388.21
100811-0038	SVC00055 08/12/2010 734	1H0103	ID - EARTHMOVING	184_INT	R	Electrical	1ME739	7287	Repair Revolving light	TRAVELLED TO BRIGHTON. REPLACE GLOBE IN REVOLVING LIGHT	64	0	0	9	73
100730-0048	SVC00055 08/18/2010 957	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739	7329	S1 A - 250 HR SERVICE	ONSITE AT UNIT. CARRIED OUT 250HR SERVICE AS PER SCHEDULE	266	219.47	0	2.7	488.17
101111-0040	SVC00060 11/17/2010 560	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739	7604	S1 B - 500 HR SERVICE	CARRIED OUT 500HR SERVICE AS PER SCHEDULE	345	683.42	0	2.7	1031.12
101215-0009	SVC00062 12/16/2010 216	1H0103	ID - EARTHMOVING	184_INT	R	Electrical	1ME739	7629	REPAIR AIR CONDITION OPERATION	TRAVELLED TO HBMI. REPAIRED A/C, CLEANED OUT FILTERS AND TIGHTENED COMP BELT. REPLACED BLOWN WORK LIGHT GLOBES	172.5	0	0	0	172.5

110125-0047	SVC00064 01/31/2011 355	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739	7847	S1 A - 250 HR SERVICE	TRAVELLED TO HOBART. CARRIED OUT 250HR SERVICE AS PER SCHEDULE. REPLACE WIPER RUBBERS AND UNBLOCKED AND ADJUSTED WASHER NOZZLES. CHECK NO BRAKE LIGHTS AND FOUND TO BE A WIRING FAULT	442	264.35	0	171	877.35
110201-0045	SVC00064 02/18/2011 758	1H0103	ID - EARTHMOVING	187_INT	R	Engine	1ME739	7827	REPLACE U/S FAN BELTS ETC	REPLACED FAN BELTS.	248.5	83.46	0	0	331.96
110325-0034	SVC00067 04/06/2011 440	1H0103	ID - EARTHMOVING	122_INT	R	Sundries	1ME739		STORE ISSUE MARCH PG 103-4158	STORE ISSUE MARCH PG 103-4158	0	19.9	0	0	19.9
110831-0017	SVC00076 09/22/2011 251	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739	8235	S1 D - 2000 HR SERVICE	TRAVEL TO BURNIE. CARRIED OUT 2000 HR SERVICE AS PER SCHEDULE. REPAIR INDICATOR WIRING ON TAIL LIGHTS.	1180.5	1926.65	1393.95	350	4851.1
110907-0042	SVC00076 09/28/2011 423	1H0103	ID - EARTHMOVING	184_INT	R	Electrical	1ME739	8236	FIT TRAVEL ALARM FOR PULP MILL	TRAVEL TO PULPMILL. FIT AND WIRE UP NEW REVERSE ALARM AND CHECK ELECTRICAL SYSTEM.	172.5	356	0	38	566.5
110922-0060	SVC00077 09/28/2011 392	1H0103	ID - EARTHMOVING	184_INT	R	Differentia l-FD	1ME739	8238	REPLACE FRONT DIFF AXLE SEAL	SUBLET KOMATSU TO REPLACE FRONT DIFF AXLE SEAL AND REAR PIPE	14.75	0	2042.12	0	2056.87
111026-0079	SVC00079 11/29/2011 442	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739	8500	S1 A - 250 HR SERVICE	SERVICE UNIT AS REQUIRED FOR 250 HOUR	280.75	225.95	0	2.7	509.4
111125-0039	SVC00080 12/08/2011 960	1H0103	ID - EARTHMOVING	184_INT	R	Trimming	1ME739	8475	CHECK AND REPAIR SEAT	TRAVEL TO SITE A BELL BAY. REPAIR SEAT. REPAIR BRACKET HOLDING ARTICULATION HOSES. RETURN TO W/SHOP AND ORDER PARTS. PARTS WERE SENT TO HOBART AS THE TRUCK LEFT AREA. CLEAN UP WORK AREA AND RETURN TRAVEL. WORK CARRIED OUT BY KOMATSU	44.25	0	657.45	0	701.7
111209-0068	SVC00081 01/30/2012 684	1H0103	ID - EARTHMOVING	187_INT	R	Engine	1ME739	8595 HRS	LOW POWER AND SMOKE	CHECK UNIT FOR LOW POWER AND SMOKE TRAVELLED TO LONG HILL AND CHECK ENGINE FAULT, LOCATED BLOCKED FUEL FILTERS, TRAVELLED TO LAUNCESTON AND PICKED UP FILTERS, RETURN TO LONGHILL AND REPLACE FILTERS, DRAINED DEBRIS FROM TANK AND CLEN SCREENS.	352	273.62	0	126	751.62
120113-0064	SVC00082 02/29/2012 629	1H0103	ID - EARTHMOVING	187_INT	R	Starter Motor	1ME739	8751 HRS	Starter motor	DIAGNOSED FAULTY STARTER MOTOR, REMOVED AND REPLACED WITH NEW STARTER MOTOR;TEST AND CHECK STARTER MOTOR FAULT ,REMOVE REPLACE S/MOTOR,FIT UP AND TEST AT LONG HILL QUARRY.	450.5	20	1241.25	252	1963.75
120119-0017	SVC00082 03/23/2012 727	1H0103	ID - EARTHMOVING	186_INT	R	Starter Motor	1ME739		O/HAUL STARTER MOTOR	OVERHAUL STARTER MOTOR AS REQUIRED	236	848.64	0	0	1084.64

120210-0034	SVC00083 968	04/11/2012	1H0103	ID - EARTHMOVING	187_INT	R	Drive Line	1ME739	8,870 hrs	REPAIR SLIPJOINT REAR	REPAIR SLIP JOINT REAR TRAVELLED TO LONG HILL AND CHECK SLIP JOINT FOR REAR JACK SHAFT, REMOVE AND TAKE TO JAYBEN FOR REPAIRS, RETURN TO UNIT AND REINSTALL REPAIRED SHAFT, TEST OPERATION OK.	276	0	1264.52	282	1822.52
											travel to longhill and check slip joint for rear jackshaft. remove and take to Jayben for repairs.. return ,refit and test. travel 280 kms 1 sundaries \$20.00					
120206-0106	SVC00083 969	06/05/2012	1H0103	ID - EARTHMOVING	187_INT	S	Service	1ME739	8770 hrs	S1 B SERVICE 500 HR	TRAVEL TO LONGHILL . CARRIED OUT 500 HR SERVICE AS PER SCHEDULE. CHANGED ENGINE OIL AND FILTER, FUEL FILTERS, SAMPLE PLANETARIES,DIFFS,ENG ,HYD, TRANS. GREASE AND LIGHTS.	295.5	836.86	0	66.5	1198.86
120127-0049	SVC00085 126	02/29/2012	1H0103	ID - EARTHMOVING	187_INT	R	Tyres	1ME739	N/A	TYRE REPAIRS	TYRE REPAIRS AS REQUIRED	34.5	162.78	0	0	197.28
120307-0043	SVC00085 742	05/29/2012	1H0103	ID - EARTHMOVING	186_INT	R	Differentia l-FD	1ME739		CHANGE FRONT DIFF OIL	ASSESS DIFF FAULT DRAIN FRONT DIFF OIL AND FLUSH, REFILL ADDING CAT AXLE ADDITIVE, REMOVE LEAKING LEFT FRONT BRAKE COOLER HOSE AND FIT NEW ONE. REMOVE AND REPLACE FAULTY REVOLVING LIGHT REMOVE AND REPLACE REAR TAIL LIGHT WITH LED LIGHTS REMOVE OPERATORS SEAT AND STRIP UPHOLSTRY, REPLACE MAIN SEAT FRAME, REFIT SEAT AND CLEAN FABRIC. TEST OPERATION OF UNIT OK.	1365.5	441.28	0	0	1806.78
120309-0029	SVC00089 796	05/24/2012	1H0103	ID - EARTHMOVING	187_INT	R	Drive Line	1ME739	8999 HRS	CHECK NOISE IN FRONT DIFF AREA	TRAVEL TO LONGHILL AND CHECK NOISE IN FRONT DIFF. BINDING, KNOCKING NOISE COMING FROM DRIVE TRAIN. INSPECT AND REMOVE FRONT DRIVELINES AND INSPECT UNI'S(NEED REPLACING), REMOVE AND INSPECT ARTIC DRIVELINE,WORN SPLINES, CALL AND DISCUSS PROBLEM WITH KOMATSU, REASSEMBLE AND TEST INDIVIDUALLY. JACK UP FRONT WHEELS AND CHECK FOR CORRECT OPERATION OF DIFF. REASSEMBLE AND SEND TO HBT	517.5	55	0	126	698.5
120530-0083	SVC00090 984	06/12/2012	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739	9151	S1 A - 250 HR SERVICE	TRAVEL TO SITE AT REMOUNT RD AND CARRY OUT 250 HR SERVICE AND INSPECTION. CLEAN UP WORK AREA AND RETURN TRAVEL. WORK CARRIED OUT BY KOMATSU	59	0	538.98	0	597.98

120709-0082	SVC00094 08/03/2012 063	1H0103	ID - EARTHMOVING	187_INT	S	Service	1ME739	9350 hrs	S1 C SERVICE 1000 HR	S1 C SERVICE 1000 HR	570	1795.91	0	111.5	2477.41
120926-0051	SVC00097 09/28/2012 400	1H0103	ID - EARTHMOVING	184_INT	R	Trays/Buckets	1ME739	9315	REPLACE TRAY WEAR STRIP	TRAVELLED TO LONGHILL. REPAIR REAR OF TRAY AND WELD ON HARDOX WEAR STRIP.	375	77.25	0	96	548.25
120924-0023	SVC00097 10/08/2012 791	1H0103	ID - EARTHMOVING	187_INT	S	Service	1ME739	9650 hrs	S1 A SERVICE 250 HRS	S1 A SERVICE 250 HRS TRAVEL TO LONGHILL AND SERVICE AS PER SHEET. ENG OIL AND FILTER, SAMPLE, CLEAN OUTER AIR FILTER, CHECK ALL FLUID LEVELS. GREASE DRIVELINE CHECK VALVES, LIGHTS AND CLEAN FUEL SCREEN. TEST. FAULTS AS PER PHOTOS AND E-MAIL SENT TO HBT	402.5	225.75	0	61.1	689.35
121011-0073	SVC00098 11/28/2012 252	1H0103	ID - EARTHMOVING	182_INT	R	Milling	1ME739		MANUF BACK TORSION BAR AS REQUESTED	MANUFACTURE BACK TORSION BAR AS REQUESTED BY PAUL KELLEHER	1962.5	435.1	165	0	2562.6
121010-0004	SVC00098 10/16/2012 474	1H0103	ID - EARTHMOVING	186_INT	R	Sundries	1ME739		OCTOBER CONSUMABLES	OCTOBER CONSUMABLES REQ # 103-6801 PAUL KELLEHER	0	10.6	0	0	10.6
121217-0008	SVC00102 12/19/2012 270	1H0103	ID - EARTHMOVING	184_INT	R	Hydraulic	1ME739	9766	REPLACE BLOWN PILOT HOSE	TRAVEL TO TUNBRIDGE. REPLACE BLOWN PILOT LINE. INSPECT FOR OIL LEAK UNDER CAB. REMOVE HOSE TO BE REPLACED AND REFITTED.	488.5	29.59	0	120	638.09
121213-0021	SVC00102 12/21/2012 428	1H0103	ID - EARTHMOVING	186_INT	R	Electrical	1ME739	68,375 km 9,774 hrs	REPAIRS TO TRAY POSITION WIRING	TEST WIRING BETWEEN TRAY POSITION SENSOR AND CAB. NO FAULTS WERE FOUND.	205	10	0	0	215
121220-0001	SVC00102 01/15/2013 466	1H0103	ID - EARTHMOVING	184_INT	R	Engine	1ME739	9795 HRS	REPAIR FUEL FAULT	TRAVELLED TO TUNBRIDGE. CHECKED ENGINE MISS FAULT. GOT FAULT CODE AND CHECKED WIRING ATC. PULLED PARTS FROM 1ME645 AS SPARES. CHECKED RESISTANCE OF SENSOR ETC ALL SEEMS OK. FOUND LOOSE PLUG ON FUEL PUMP AND REPAIRED PIN WORKING OK. CHECKED FUEL FAULT.	1833.5	196.54	0	144	2174.04
121221-0049	SVC00102 01/30/2013 856	1H0103	ID - EARTHMOVING	184_INT	R	Electrical	1ME739	9805 HRS	INSPECT EO3 FAULT CODE	TRAVEL TO TUNBRIDGE. INSPECTED FAULT CODE. CHECKED WIRING ON TRAY POSITION SENSOR COULD NOT FAULT AT TIME OF INSPECTION. TRAVEL BACK TO SITE. SWAP OVER SOLENOID ON FUEL PUMP, CHECK ALL PLUGS ON HARNESS, CLEAN OUT FUEL FILTER, DRIVE MACHINE UNTIL IT PLAYS UP, FIND FAULT IN WIRING HARNESS, REMOVE HARNESS, TRAVEL TO IMPACT, REMOVE WIRING HARNESS OF 1ME645, TRAVEL BACK TO SITE, REFIT HARNESS, TEST MACHINE OK.	1453.5	1330	0	144	2927.5
130121-0071	SVC00103 02/05/2013 692	1H0103	ID - EARTHMOVING	184_INT	R	Hydraulic	1ME739	9853	REPLACE 2 HYD HOSE UNDER CAB	TRAVEL TO TUNBRIDGE. MAKE 2 NEW HOSES AS PER SAMPLE. TRAVEL BACK TO SITE. PREPARE CAB. JACK UP CAB AND INSTALL SAFETY PROP. REMOVE LEAKING HOSES. GREASE JACK SHAFT. REFIT HOSES. TOP UP HYD OIL.	719.5	144.46	0	139.2	1003.16
130129-0010	SVC00104 01/30/2013 066	1H0103	ID - EARTHMOVING	184_INT	R	Drive Line	1ME739	9980	replace grease nipples	TRAVEL TO PIPELINE. REMOVE BROKEN GREASE NIPPLE AND FIT NEW ONE.	153.5	7	0	96	256.5

130207-0069	SVC00105 02/28/2013 845	1H0103	ID - EARTHMOVING	186_INT	R	Electrical	1ME739		REPAIR ENGINE HARNESS	STRIP HARNESS OF INSULATION. TEST WIRING. COULDNT FIND FAULT. TEST ALL WIRING. AFTER DISCUSSION, DECIDE TO NOT FIX.	260	5	0	0	265
130129-0091	SVC00106 03/06/2013 238	1H0103	ID - EARTHMOVING	184_INT	R	Service	1ME739	9916	S1 D - 2000 HR SERVICE	TRAVEL TO TUNBRIDGE TIERS ROAD. ASSISTED IN SERVICE AS PER SCHEDULE. TRAVELLED TO TUNBRIDGE, PICKED UP OILS AND PARTS REQUIRED. RETURNED TO OATLANDS FOR INDUCTIONS, RETURNED TO SITE AND COMMENCE 2000 HR SERVICE AS HAZELLS CHECK SHEET REQUIRED. WORK COMPLETED BY KOMATSU.	648.5	2608.06	1781.44	76.8	5114.8
130314-0012	SVC00107 03/20/2013 011	1H0103	ID - EARTHMOVING	184_INT	R	Engine	1ME739	10011	CLEAN AIR CLEANERS	TRAVEL TO SORELL SPRINGS, CLEAN AIR FILTERS	78.5	0	0	48	126.5
130402-0036	SVC00108 04/11/2013 192	1H0103	ID - EARTHMOVING	184_INT	R	Electrical	1ME739	10070	REPLACE U/S TRAY ANGLE SENSOR	TRAVEL TO OATLANDS, REPLACE U/S TRAY ANGLE SENSOR	232	825.52	0	24	1081.52
130424-0001	SVC00108 04/30/2013 903	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739	10189	S1 A - 250 HR SERVICE	TRAVEL TO PIPELINE, CARRIED OUT S1 A - 250 HR SERVICE AS PER SCHEDULE.	269	337.67	0	96	702.67
130422-0005	SVC00109 04/30/2013 010	1H0103	ID - EARTHMOVING	184_INT	R	Electrical	1ME739	10139	REPAIR UHF & REVOLVING LIGHT	TRAVEL TO SORELL SPRINGS RD, REPAIR UHF & REVOLVING LIGHT FAULTS	235.5	6	0	28.8	270.3
130429-0001	SVC00109 05/08/2013 321	1H0103	ID - EARTHMOVING	184_INT	R	Electrical	1ME739	10165	JUMP START AND CHECK CHARGE	TRAVEL TO PIPELINE, JUMP START AND CHECK CHARGE RATE ALL OK	107.5	5	0	24	136.5
130422-0049	SVC00109 05/31/2013 515	1H0103	ID - EARTHMOVING	184_INT	R	Electrical	1ME739	10150	INSPECT TRAY SENSOR FAULT	TRAVEL TO PIPELINE SITE, INSPECT TRAY SENSOR FAULTCHECK WIRING AND CONNECTIONS, REPAIR WIRING FOR TAIL LIGHTS, REPAIR REVERSE ALARM, REPAIR UHF WIRING.	825	0	0	106	931
130503-0001	SVC00109 05/13/2013 772	1H0103	ID - EARTHMOVING	184_INT	R	Electrical	1ME739	10189	JUMP START	TRAVEL TO OLD TIER RD, JUMP START AS REQUIRED.	75	0	0	48	123
130507-0014	SVC00109 05/15/2013 878	1H0103	ID - EARTHMOVING	184_INT	R	Electrical	1ME739	10237	REPLACE U/S BATTERIES	TRAVEL TO OLD TIERS ROAD, REPLACE U/S BATTERIES, CLEAN OUT BATTERY BOX, CHECK CHARGE RATE	215	442.14	0	48	705.14
130520-0015	SVC00110 05/21/2013 158	1H0103	ID - EARTHMOVING	184_INT	R	Electrical	1ME739	10269 HR	RESET SERVICE CODES	TRAVEL TO SORELL SPRINGS, RESET SERVICE CODES	107.5	0	0	48	155.5
130525-0005	SVC00110 05/29/2013 564	1H0103	ID - EARTHMOVING	184_INT	R	Trays/Buckets	1ME739	10313 HR	WELD CRACKS AT TRAY PIVOT	TRAVEL TO PIPELINE, WELD CRACKS AT TRAY PIVOT	428.5	31.87	0	106	566.37
130522-0039	SVC00110 05/30/2013 580	1H0103	ID - EARTHMOVING	184_INT	R	Engine	1ME739		REPLACE RADIATOR CAP	REPLACE RADIATOR CAP	32.5	34.01	0	0	66.51
130510-0070	SVC00110 05/28/2013 615	1H0103	ID - EARTHMOVING	184_INT	R	Hydraulic	1ME739	10249	REPLACE LEAKING SIGHT GLASS	TRAVEL TO PIPELINE, REPLACE LEAKING HYDRAULIC SIGHT GLASS	112.5	107.76	0	34.8	255.06
130522-0038	SVC00110 06/18/2013 652	1H0103	ID - EARTHMOVING	184_INT	R	Electrical	1ME739	10311 HR	repair tail lights	TRAVEL TO OLD TIER ROAD, REPAIR TAIL LIGHTS AS REQUIRED	215	18	0	76.8	309.8
130524-0057	SVC00111 06/12/2013 298	1H0103	ID - EARTHMOVING	184_INT	R	Differentia I-FD	1ME739	10302	CHECK FRONT DIFF OIL LEAK	TRAVEL TO PIPELINE, CHECK FRONT DIFF OIL LEAK, CHECKED OIL LEVEL, CLEANED OUT BLOCKED BREATHER	114.5	83	0	24	221.5
130528-0062	SVC00111 06/20/2013 817	1H0103	ID - EARTHMOVING	184_INT	R	Engine	1ME739	10382	REPLACE EXHAUST BRAKE CABLE	REQ# 103-7495 TODD MURRAY 20LTRS ENG OIL TRAVEL TO PIPELINE, REPLACE EXHAUST BRAKE CABLE REPLACE AM FM RADIO AERIAL	177.5	458.21	0	53	688.71
130614-0042	SVC00112 06/26/2013 208	1H0103	ID - EARTHMOVING	184_INT	R	Electrical	1ME739	10419	REPAIR TAIL LIGHT MOUNT	TRAVEL TO PIPELINE, REPAIR TAIL LIGHT MOUNT, REPLACE BROKEN RUBBER MOUNTS	75	93.26	0	24.2	192.46

130612-0006	SVC00112 06/25/2013 211	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739	10417 HR	S1 B - 500 HR SERVICE	TRAVELLED TO UNIT AND CARRIED OUT SERVICE AS REQUIRED	514.25	683.98	0	121	1319.23
130627-0003	SVC00112 06/28/2013 536	1H0103	ID - EARTHMOVING	184_INT	R	Sundries	1ME739	10445	Inspect Fault Code	TRAVEL TO PIPELINE, INSPECT FAULT CODE E03, COULD NOT FAULT AT TIME OF INSPECTION AND NO ACTIVE CODES, LAST CODE RECORDED WAS 2G42Z (ACCUMULATOR PRESSURE)	145	0	0	53	198
130711-0072	SVC00113 08/15/2013 211	1H0103	ID - EARTHMOVING	184_INT	R	Engine	1ME739	10566	repair hydraulic oil leaks	TRAVEL TO OATLANDS, REPAIR HYDRAULIC OIL LEAKS, RAISE CAB, REMOVE LEAKING PIPE, WELD UP CRACKED PIPE, REFIT PIPE WITH NEW O RINGS, REPLACE LEAKING HOSES AND O RINGS, TOP UP HYDRAULIC OIL, TEST FOR LEAKS, LOWER CAB.	1013	320.06	0	96	1429.06
130717-0048	SVC00113 07/31/2013 431	1H0103	ID - EARTHMOVING	184_INT	R	Engine	1ME739	10517	REPLACE LEAKING ENG SUMP PLUG	REPLACE LEAKING ENG SUMP DUST PLUG, TOP UP HYDRAULIC OIL, REPLACE BROKEN GREASE NIPPLES,	187.5	84.55	0	48	320.05
130816-0004	SVC00115 08/20/2013 475	1H0103	ID - EARTHMOVING	184_INT	R	Hydraulic	1ME739	10577 HR	Inspect Oil Leaks	TRAVELLED TO LOWER MARSHES, REMOVED INNER WHEEL PADS AND INSPECT OIL LEAK UNDER CAB, LEAKING VALVE BODY	123	0	0	48	171
130827-0054	SVC00116 09/26/2013 652	1H0103	ID - EARTHMOVING	186_INT	R	Hydraulic	1ME739	10578 HR	REPAIR OIL LEAKS	REPAIR OIL LEAKS OVE RESEAL AND REFIT BOTH STEERING CYLINDERS REMOVE RESEAL AND REFIT RH LIFT CYL CYLINDER CHECK DIFF BREATHERS AND RESEAL FINAL DRIVE COVERS ON FRONT AND CENTRE AXLES AS NEEDED FRONT WHEELS REMOVED TO ALLOW STEERING CYLINDERS TO BE ACCESSED FOR REPAIRS LIFT CAB AND REPAIR OIL LEAKS AT AMPLIFIER VALVE AND HYDRAULIC PIPES CHECK FOR LEAKS AND LOWERCAB PUT BACK TO WORKR CAB	7074	3981.35	0	50	11105.35
130902-0001	SVC00116 09/10/2013 667	1H0103	ID - EARTHMOVING	182_INT	R	Lathe	1ME739		MACHINE CYLINDER GLAND BUSHES	MACHINE CYLINDER GLAND BUSHES	32.5	0	0	0	32.5
130910-0088	SVC00117 09/20/2013 054	1H0103	ID - EARTHMOVING	182_INT	R	Hydraulic	1ME739	10587 HRS	REPAIRS TO HOIST CYLINDER R/H	REPAIRS TO HOIST CYLINDER R/H	422.5	0	0	30	452.5
130918-0071	SVC00117 09/23/2013 557	1H0103	ID - EARTHMOVING	186_INT	R	Electrical	1ME739	73,763 km 10,578 hrs	REPAIR SEAT WIRING	REPAIR WIRING TO NEW SWITCH FOR SEAT OPRATION, TEST OK.	130	0	0	6.5	136.5

131010-0014	SVC00119 448	10/28/2013	1H0103	ID - EARTHMOVING	184_INT	R	Engine	1ME739	10588	CHECK OIL LEAK NEAR ENGINE	INSPECT FOR OIL LEAK AROUND ENGINE, TIGHTEN LOOSE PIPE CLAMPS ON OIL COOLER, TEST OK. TOP UP HYDRAULIC OIL LOCATE, REMOVE AND REPLACE 2 LEAKING HOSES FROM ENGINE BAY TO UNDER CAB. INSPECT FOR OIL LEAK AT TOP OF FUEL TANK, REMOVED BELLY6 PLATE AND TEST DRIVE, HAVE OPERATOR OPERATE TRAY WHILST I INSPECTED, FOUND PIN HOLE IN HOSE, REFIT BELLY PLATE.	1132	98.5	0	136.4	1366.9
131014-0020	SVC00119 544	10/22/2013	1H0103	ID - EARTHMOVING	186_INT	R	Electrical	1ME739	10,588 Hrs	REPLACE BROKEN TAIL LIGHT	ORDERED REPLACEMENT LED REAR LIGHTS, 65 REPLACED WITH VEHICLE WAS ON FLOAT	65	72.55	0	0	137.55
131021-0091	SVC00119 594	10/29/2013	1H0103	ID - EARTHMOVING	184_INT	R	Sundries	1ME739	10600	REPLACE SEAT AIR BAG	TRAVEL TO HBMI, CHECK FOR SEAT FAULT. LOCATE SPLIT AIR BAG AND LOCATE 2ND SEAT. REDRILL MOUNTS AND FIT SPARE SEAT. ORDER NEW PARTS AS REQUIRED. TRAVEL BACK TO SITE. FIT NEW AIR BAG TO SEAT ASSY AS REQUIRED. TRAVEL BACK TO SITE. REMOVE SEAT AGAIN FROM MACHINE. FIT AND WIRE UP ORIGINAL SEAT AND REPAIR WIRING IN ARTIC HARNESS AS REQUIRED.	862.5	213.82	0	96.4	1172.72
131101-0018	SVC00120 292	11/05/2013	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739	10676	S1 A - 250 HR SERVICE	TRAVELLED TO HBMI, CARRIED OUT S1 A - 250 HR SERVICE AS PER SCHEDULE. TOPPED UP OILS ON FRONT DIFF AND CENTRE DIFF. REMOVED LHF WHEEL BOLT TO MATCH UP FOR REPAIRS.	327.5	230.54	0	81.1	639.14
131111-0122	SVC00120 692	11/26/2013	1H0103	ID - EARTHMOVING	184_INT	R	Electrical	1ME739	10701	REPAIR HORN,LIGHTS,TRAY SENSOR	TRAVEL T HBMI, CHECK FOR TRAY POSITION FAULT. REPAIR WIRING TO SENSOR AND CALIBRATE AND TEST OK. TRAVEL BACK TO SITE. REPAIR HORN AND LIGHT WIRING IN ARTIC HARNESS AND TEST. CHECK FOR GEARSHIFT FAULT. CHECK WIRING IN HARNESS AND LOCATE BROKEN BOLT IN SENSOR AND REPAIR WIRING TO MULTIPIN CONNECTOR.	712.5	0	0	106	818.5
131127-0113	SVC00121 924	12/20/2013	1H0103	ID - EARTHMOVING	184_INT	R	Sundries	1ME739	10752	REPAIR LIGHT BRACKET	REPAIR BENT LIGHT BRACKET, REPAIR FAULTS IN CHASSIS WIRING.	262.5	82.24	0	0	344.74
140106-0004	SVC00123 595	01/21/2014	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739	10924	S1 C - 1000 HR SERVICE	TRAVEL TO LESLIEVALE, CARRIED OUT 1000 HR SERVICE AS PER SCHEDULE.	600	1728.74	0	91.1	2419.84
140115-0012	SVC00124 019	02/28/2014	1H0103	ID - EARTHMOVING	184_INT	R	Electrical	1ME739	10938	REPLACE WORK LIGHT	TRAVEL TO SITE, REPLACE WORK LIGHT AS REQUIRED.	75	94.95	0	14.4	184.35
140317-0048	SVC00127 434	03/19/2014	1H0103	ID - EARTHMOVING	184_INT	R	Electrical	1ME739	11014	REPAIR WORK LIGHT WIRING	TRAVEL TO HBMI, REPAIR WORK LIGHT WIRING AND REPLACE GLOBE AS REQUIRED.	112.5	0	0	25.2	137.7
140502-0029	SVC00130 307	05/14/2014	1H0103	ID - EARTHMOVING	186_INT	S	Service	1ME739	11200	S1 A SERVICE	COMPLETED SERVICE AS PER SERVICE SHEET	409.5	229.38	0	23.5	662.38

140502-0030	SVC00130 05/20/2014 331	1H0103	ID - EARTHMOVING	186_INT	R	Sundries	1ME739	11200 HR	REPAIR OIL LEAK RHF WHEEL HUB	REPAIR OIL LEAKS RHF WHEEL HUB. REPLACE MISSING WHEEL BOLT, REPAIR OIL LEAK EXHAUST BRAKE CYLINDER. REMOVE AND REPLACE U/S WORK LIGHT ON REAR OF CAB REMOVE FRONT WHEELS STRIP OUT RH FRONT FINAL DRIVE AND REPLACE SEALS. REPLACE UNI JOINT ON DRIVE SHAFT. REMOVE AND RESEAL LH STEERING CYLINDER REFIT WHEELS AND BLEED BRAKES REMOVE EXHAUST BRAKE CYLINDER RESEAL AND REFIT	4541.79	4915.35	195	50	9702.14
140508-0005	SVC00130 05/26/2014 496	1H0103	ID - EARTHMOVING	182_INT	R	Lathe	1ME739		MACHINE NEW TRAY SAFETY PINS	MACHINE NEW TRAY SAFETY PINS	273.01	52.97	0	14	339.98
140526-0018	SVC00131 05/26/2014 324	1H0103	ID - EARTHMOVING	184_INT	R	Tyres	1ME739	11204	STRIP AND FIT LOADER TYRE	TRAVELLED TO THE PIPELINE JOB, REMOVED TYRE AND TOOK BACK TO RUBANDS TO FIT TO RIM WITH SPARE TYRE LOCATED IN THE BARN, RETURNED TO SITE AND FITTED TYRE AS REQUIRED	967.06	95	0	153.6	1215.66
140529-0007	SVC00131 06/20/2014 643	1H0103	ID - EARTHMOVING	184_INT	R	Exhaust	1ME739	11228	REPAIR EXHAUST BRAKE CYL LEAK	TRAVEL TO TEA TREE, CHECKED OIL LEAK AND OIL LEVEL, FOUND AT EXHAUST BRAKE CYLINDER, REMOVE RAM AND DISASSEMBLED, SOURCED PARTS FOR CYLINDER, RESEALED AND REFITTED, REPLACED WIPER BLADES.	585.39	87.49	0	106.8	779.68
140606-0022	SVC00132 06/30/2014 087	1H0103	ID - EARTHMOVING	184_INT	R	Tyres	1ME739	11253	CHANGE DAMAGED LHF TYRE	TRAVEL TO SITE, REMOVE DAMAGED LHF TYRE, TAKE TO RUBANDS FOR REPAIR, TRAVEL BACK TO SITE AND FIT.	236.25	0	215	96	547.25
140626-0032	SVC00133 06/30/2014 146	1H0103	ID - EARTHMOVING	184_INT	R	Hydraulic	1ME739	11352	INSPECT TRAY HOLD FAULT	TRAVEL TO PIPELINE, CHECKED FOR TRAY FAULT, SWAPPED OVER CONTROLLER AND CHECK - TILL NOT WORKING. TRAVEL BACK TO SITE, CHECKED OIL LEAK ON DUMPER AND CLEANED BREATHERS.	294.01	0	0	43.8	337.81
140701-0014	SVC00133 07/10/2014 600	1H0103	ID - EARTHMOVING	184_INT	R	Differentia l-FD	1ME739	11368	INSPECT LEAKING LHF F/DRIVE	TRAVEL TO DAM SITE, INSPECT OIL LEAK ON F/DIRVE AND CHECK OIL LEVEL.	78.75	0	0	33	111.75
140702-0016	SVC00133 07/15/2014 752	1H0103	ID - EARTHMOVING	186_INT	R	Differentia l-FD	1ME739	11368 hr	RESEAL LH FRONT HUB	RESEAL LH FRONT HUB REMOVE L/HAND FRONT WHEEL AND STRIP OUT HUB HAVE DRIVE AXLE AND DIFF FLANGE SEAL SURFACES REPAIRED, REASSEMBLE WITH NEW SEALS AND O RINGS, RECONNECT BRAKE LINES AND BLEED BRAKES, REFIT WHEEL AND FILL FRONT DIFF AND HUB WITH OIL, CHECK ALL LIGHTS, REPLACE WIPER BLADE, REMOVE GLOVE BOX REPAIR LATCH AND REFIT, CHECK OPERATION OF HOIST REMOVE COVER AND CLEAN ELECTRICAL CONNECTIONS TESTED OK.	2261.71	4052.27	350	50	6729.98

140808-0059	SVC00135 769	08/12/2014	1H0103	ID - EARTHMOVING	184_INT	R	Differentia I-FD	1ME739	11423	INSPECT REPORTED DIFF NOISE	TRAVEL TO PIPELINE, INSPECT UNIT FOR DIFF NOISE, CHECK OIL ETC AND MAGNETIC PLUG ALL OK, SOUNDS LIKE SUSPENSION IS CREEKING ON STOP ON HARD LOCK, ALL OK	196.88	0	0	65	261.88
140808-0077	SVC00135 801	08/20/2014	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739	11432	S1 B SERVICE	TRAVEL TO PIPELINE, CARRIED OUT S1 B SERVICE AS PER SCHEDULE	393.75	694	0	105.5	1193.25
140901-0024	SVC00137 127	09/04/2014	1H0103	ID - EARTHMOVING	184_INT	R	Differentia I-FD	1ME739	11505	INSPECT RHF FINAL DRIVE LEAK	TRAVEL TO PIPELINE, CHECK FINAL DRIVE LEAK AT RHF, CHECKED OIL AND CLEANED OUT BREATHER. ***UNIT TO BE MONITORED	39.38	0	0	11	50.38
140901-0002	SVC00137 237	09/10/2014	1H0103	ID - EARTHMOVING	184_INT	R	Drive Line	1ME739	11491 HR	CHECK NOISE IN DRIVELINE	TRAVEL TO DAMSITE, CHECK NOISE IN DRIVELINE, DIG OUT DIRT PACKED AROUND HANDBRAKE ROTOR AND TAILSHAFT, WATCH MACHINE OPERATE TO SEE WHERE NOISE IS COMING FROM, NO FURTHER NOISE FOUND, SUSPECT A ROCK PACKED IN DIRT SCRAPING ON DRIVELINE	236.25	0	0	45	281.25
140904-0032	SVC00137 273	09/10/2014	1H0103	ID - EARTHMOVING	184_INT	R	Hydraulic	1ME739	11539	REPLACE LEAKING LIFT CYL HOSE	TRAVEL TO PIPELINE, REPLACED RHS BRAKE HOSE IN ARTIC, HARDY SPICER TO FABRICATE NEW HOSE, FIT TO UNIT	354.38	0	275.84	51	681.22
140911-0017	SVC00137 684	11/19/2014	1H0103	ID - EARTHMOVING	184_INT	R	Hydraulic	1ME739	11571	REMOVE RESEAL AND REFIT RH LIF	REMOVE CYLINDER AND STRIP FOUND CYLINDER DAMAGED AND PARTS NOT AVAILABLE, TRAVEL TO PIPELINE AND REMOVE CYLINDER FROM 1ME737, TRAVEL BACK TO W/SHOP AND FIT TO 1ME739 TO ALLOW MACHINE TO RETURN TO WORK, PURCHASE NEW CYLINDER AND FIT TO 1ME737	1981.89	13383.3	0	94	15459.19
140915-0039	SVC00137 890	09/17/2014	1H0103	ID - EARTHMOVING	184_INT	R	Hydraulic	1ME739	11580	INSPECT DRIVE & HYD OIL LEAKS	TRAVEL TO PIPELINE, CHECKED UNIT FOR OIL LEAKS, FOUND LHS FRONT FINAL DRIVE LEAKING, OIL LEVEL OK, FOUND LEAKING HYDRAULIC HOSE UNDER CAB - WILL NEED REPLACING	118.13	0	0	39	157.13
140925-0067	SVC00138 522	10/17/2014	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739	11723	S1 A SERVICE	TRAVELLED TO PIPELINE, CARRIED OUT S1 A SERVICE AS PER SCHEDULE REQ # 103-8562 1 DRUM COOLANT - DANNI BONNEY / RICKY MARRIOTT	272.49	360.16	0	83	715.65
141013-0011	SVC00139 322	10/24/2014	1H0103	ID - EARTHMOVING	184_INT	R	Tyres	1ME739	11730	REMOVE & REPAIR LHSM TYRE	TRAVELLED TO THE PIPELINE X 2 REMOVED FLAT TYRE AND TAKE TO RUBAND FOR REPAIRS, TRAVELLED BACK TO SITE AND REFIT TYRE, REMOVED TYRE AGAIN AND RETURN TO LA, LARGE CRACK IN SIDE WALL, REMOVED WHEEL FROM TRUCK IN WORKSHOP AND FIT TO 1ME739	741.84	75	0	189	1005.84
141013-0024	SVC00139 330	10/13/2014	1H0103	ID - EARTHMOVING	121ADMIN	R	Engine	1ME739		supply coolant	SUPPLY COOLANT AS PER DANNI BONNEY'S REQUEST	0	0	0	0	0
141030-0022	SVC00140 240	11/28/2014	1H0103	ID - EARTHMOVING	184_INT	R	Hydraulic	1ME739	11920	REPLACE LEAKING HYDRAULIC HOSE	TRAVEL TO DAM SITE, REMOVE AND REPLACE LEAKING LIFT HOSE AT REAR IF CAB, UNBOLT AND LIFT CAB, REMOVE AND REPLACE LEAKING HOSES, TOPPED UP HYD OIL AND TEST OPERATION	637.35	618.78	0	65	1321.13

141110-0047	SVC00140 774	11/12/2014	1H0103	ID - EARTHMOVING	184_INT	R	Drive Line	1ME739	11849	CHECK & GREASE DRIVE LINE	TRAVEL TO PIPELINE, INSPECTED DRIVE LINE AND GREASED AS REQUIRED, TEST ALL OK	43.05	0	0	22	65.05
141124-0007	SVC00141 463	12/03/2014	1H0103	ID - EARTHMOVING	184_INT	R	Electrical	1ME739	11812	REPAIR TRANS FILL SWITCH FAULT	TRAVEL TO PIPELINE DAM SITE, INSPECT ELECTRICAL FAULT CASING NO DRIVE, CHECKED WIRING ETC, COULD NOT FAULT WIRING, UNPLUGGED LEVEL SENSOR, CHECKED WIRING IN ARTIC ALL OK, FAULT STILL OCCURRING, LIFTED CAB, CHECKED WIRING, SWAPPED COMPUTERS, AFTER SOME TESTS FOUND FAULTY LC FILL SWITCH, WAIT FOR PARTS TO ARRIVE AND TRAVEL BACK TO SITE, LIFT CAB, FIT NEW PARTS AND REPAIR WIRING, TOPPED UP TRANS OIL AND TEST ALL OK	2821.37	135.17	0	237	3193.54
141124-0012	SVC00141 626	11/26/2014	1H0103	ID - EARTHMOVING	184_INT	R	Sundries	1ME739	11812	REFUEL AT SEIS PIPELINE	TRAVEL TO SEIS PIPELINE DAM SITE, REFUEL MACHINE AS PER KIM WOOLLEY	78.76	0	0	400.5	479.26
141217-0028	SVC00143 124	12/18/2014	1H0103	ID - EARTHMOVING	121ADMIN	R	Sundries	1ME739		SUPPLY CTN MOLLY GREASE	SUPPLY CTN MOLLY GREASE	0	38.2	0	0	38.2
150106-0014	SVC00143 709	01/12/2015	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739	12027	S1 D SERVICE	COOLECT PARTS AND TRAVEL TO BELL BAY, CARRIED OUT S1 D SERVICE AS PER SCHEDULE, RETURN TO WORKSHOP, DISPOSE OF OIL AND FILTERS	1065.76	2012.06	0	273.5	3351.32
150121-0015	SVC00144 304	01/30/2015	1H0103	ID - EARTHMOVING	184_INT	R	Drive Line	1ME739		RESEAL RHF FINAL DRIVE SHAFT	WASH AROUND WHEEL AND JACK UP FRONT OF MACHINE, REMOVE RHF WHEEL, DISMANTLE RHF WHEEL END & REPLACE 2 X DUO CONE SEALS, REASSEMBLE & FIT WHEEL END & WHEEL, TEST OPERATION - ALL OK. WORK CARRIED OUT BY KOMATSU	0	0	6148.85	0	6148.85
150121-0017	SVC00144 305	01/27/2015	1H0103	ID - EARTHMOVING	187_INT	R	Drive Line	1ME739	12055	INSPECT RHF DRIVE SHAFT UNI	INSPECT RHF DRIVE SHAFT UNI FOUND BOLTS FOR MOUNTING END CAPS TO YOKE AT WHEEL END WERE LOOSE, AND OTHER TWO BOLTS WERE SHEARED OFF	172.2	0	0	85.6	257.8
150223-0024	SVC00145 984	02/25/2015	1H0103	ID - EARTHMOVING	184_INT	R	Engine	1ME739	12138	CLEAN OUT RADIATOR & COOLER	TRAVELLED TO HBMI, INSPECTED FOR OVERHEATING FAULT, BLOW OUT RADIATOR, REMOVED FRONT GRILL AND REFIT	118.13	0	0	39	157.13
150313-0073	SVC00147 012	03/17/2015	1H0103	ID - EARTHMOVING	184_INT	R	Drive Line	1ME739	12243	REPLACE U/S JACK SHAFT UNI	TRAVEL TO KEMPTON, REPLACED REAR JACK SHAFT UNIT JOINT AND GREASED	243.6	91.23	0	67	401.83
150401-0002	SVC00148 219	04/08/2015	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739	12328	S1 A SERVICE	TRAVELLED TO MIDLANDS HWY SITE, CARRIED OUT S1 A SERVICE AS PER SCHEDULE, TOPPED UP ENGINE OIL	236.25	178.48	0	70.5	485.23
150409-0082	SVC00148 358	04/14/2015	1H0103	ID - EARTHMOVING	121_INT	R	Tyres	1ME739	12352	Puncture repair	PUNCTURE REPAIR CARRIED OUT BY RUBAND 114649 + ROAD SIDE ASSISTANCE	0	205.91	0	0	205.91
150421-0041	SVC00149 025	04/22/2015	1H0103	ID - EARTHMOVING	121_INT	R	Tyres	1ME739	12405	REMOVE RODS FROM POS 2	REMOVE RODS FROM POS 2	0	0	270	0	270
150522-0011	SVC00150 764	05/27/2015	1H0103	ID - EARTHMOVING	184_INT	R	Brake	1ME739	12488	CHECK & ADJUST PARK BRAKE	TRAVELLED TO BELLERIVE, CHECKED RETARDER FAULT, WORKING FINE, ADJUSTED PARK BRAKE	118.13	0	0	39	157.13

150630-0012	SVC00152 07/30/2015 945	1H0103	ID - EARTHMOVING	186_INT	R	Differentia I-FD	1ME739	12513	REPAIR OIL LEAK FRONT DIFF R/	REPAIR OIL LEAK FRONT DIFF R/HAND SIDE & REPAIR OIL LEAKS UNDER CAB LIFT CAB AND CHECK OIL LEAKS FOUND LEAKING HOSES AT STEERING ACTUATOR REMOVE AND REPLACE LEAKING HOSES ALSO FOUND CRACK IN OIL MANIFOLD WHICH WAS REMOVED AND REPAIRED STRIP OUT FINAL DRIVE AND CHECK FOR LEAK FOUND RETAINER AND SPACER WORN ALLOWING MOVEMENT IN SEAL CAUSING LEAK REPLACE WORN PARTS AND REASSEMBLE WITH NEW SEAL REMOVE LEAKING SEAL FROM DIFF HOUSING AND REPLACE SUSPECT SEAL MAY HAVE BEEN DAMAGED WHEN UNI JOINT COLLAPSED ON DRIVE SHAFT PREVIOUSLY REFIT WHEEL AND TENSION BOLTS TOP UP ALL OILS	2866.53	1773.5	0	50	4690.03
150727-0051	SVC00154 07/31/2015 116	1H0103	ID - EARTHMOVING	184_INT	R	Electrical	1ME739	12519	REPAIR INDICATOR & WORK LIGHT	TRAVELLED TO BESSER BRICK AND CHECK FOR LIGHTING FAULT, CHECK WIRING IN REAR CAB JUNCTION, REFIT PLUG TO CORRECT POSITION AND TEST OPERATION ALL GOOD.	118.13	0	0	6	124.13
150723-0035	SVC00154 07/30/2015 264	1H0103	ID - EARTHMOVING	186_INT	S	Service	1ME739	12513 HR	S1 B SERVICE	S1 B SERVICE CARRY OUT SERVICE AND SAFETY CHECKS AS PER SERVICE SCHEDULE, TAKE ALL SAMPLES. REMOVE STEERING WHEEL AND REPAIR HORN CONTACTS, REMOVE CAB FLOOR MAT AND CHIP DIRT FROM UNDER BRAKE PEDAL, REPLACE FIRE EXTINGUISHER REPAIR WINDSCREEN WASHERS, REPLACE LEAKING TOP RADIATOR HOSE REPLACE MISSING BOLTS R/HAND CENTRE AXLE. RODNEY ADVISED NOT TO BOTHER SEPARATING REPAIRS FROM SERVICE.	648.38	745.47	0	37	1430.85
150812-0026	SVC00154 08/21/2015 893	1H0103	ID - EARTHMOVING	184_INT	R	Electrical	1ME739	12568	CHECK REPORTED ALARM FAULT	TRAVELLED TO K&D BRICK, REPAIRED E03 FAULT CODE AND FOUND CHAFFED WIRING IN LOOM ON ARTIC, REPAIRED AND TESTED ALL GOOD.	315	0	0	26	341
150825-0049	SVC00155 08/31/2015 732	1H0103	ID - EARTHMOVING	184_INT	R	Brake	1ME739	12621 HR	REPAIR BRAKE LINE ON CENTRE AX	TRAVELED TO K&D BRICKS AND GIBLIN STREET TO REPLACE LEAKING BRAKE PIPE WITH FLEXIABLE LINE AND TEST, OK	196.88	0	114.99	37.5	349.37
150909-0018	SVC00156 09/14/2015 305	1H0103	ID - EARTHMOVING	184_INT	R	Electrical	1ME739	12642	REPAIR BRAKE TEMP SENSOR WIRIN	TRAVELLED TO K&D BRICK AND CHECK FOR FAULT CODES, LOCATE A BROKEN WIRE IN CHASSIS HARNESS FOR BRAKE TEMPRETURE SENSOR WIRING, REPAIR WIRING AND TEST ALL GOOD.	236.25	0	0	23	259.25
151030-0044	SVC00158 11/23/2015 902	1H0103	ID - EARTHMOVING	184_INT	R	Hydraulic	1ME739	12805	REPAIR HYDRAULIC OIL LEAK	TRAVEL TO HUONVILLE REMOVE AND REPLACED LEAKING O-RING AND TOP UP HYD OIL	315	353.7	0	158	826.7

151029-0029	SVC00159 010	11/12/2015	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739	12805	S1 A SERVICE	TRAVEL TO CLARKS SAND AND CARRIED OUT THE REQUIRED SERVICE AND SAFETY CHECKS AS PER SERVICE SCHEDULE	243.6	266.16	0	92	601.76
151214-0020	SVC00160 832	01/29/2016	1H0103	ID - EARTHMOVING	182_INT	R	Trays/Buckets	1ME739		REPAIR CRACKS IN TRAY BEFORE P	REPAIR CRACKS IN TRAY BEFORE PAINTING, SUPPLY NEW TRAY PIVOT SAFETY PINS	868.88	115.83	0	0	984.71
151124-0050	SVC00161 765	01/07/2016	1H0103	ID - EARTHMOVING	181_INT	R	Bodywork	1ME739	87,923 KM 12,880 HRS	CARRY OUT REPAIRS AND PAINTWOR		7725.43	1600.16	2839.02	455	12619.61
151221-0119	SVC00161 766	01/19/2016	1H0103	ID - EARTHMOVING	186_INT	R	Electrical	1ME739	87,923 Klms 12,880 Hrs	CHECK LIGHTS ,REPAIR AS NECESS	INSPECT LIGHTS, LH INDICATOR AT FRONT COMING ON AS PARK LIGHTS, NO HEADLIGHTS, CHECKED FOR EARTH AT LIGHTS ALL OK, CHECKED DIP SWITCH ALL OK, CHECKED FOR POWER AT LIGHTS OK, REPAIRED WIRING BETWEEN LIGHTS AND ENGINE BAY, LH FRONT PARK LIGHTS/INDICATOR, RUSTED OUT, ORDER NEW LIGHT, FIT NEW LIGHT, CHECK HORNS U/S, ORDER AFTERMARKET HORNS AND FIT IN PLACE	887.26	125.27	0	44.5	1057.03
160303-0080	SVC00164 597	03/29/2016	1H0103	ID - EARTHMOVING	184_INT	R	Bodywork	1ME739	12918	REPLACE MISSING RHS STEP	INSPECT FOR BONNET LOCK FAULT, RETURN TO WSHOP AND REMOVED LATCH FROM M648. RETURN TO SITE AT ELWICK AND FIT LATCH AND ADJUST. TEST OK. REPLACED MISSING STEP AND MAKE UP BRACKET TO SUIT.	239.93	744.52	0	12	996.45
160315-0001	SVC00164 975	03/16/2016	1H0103	ID - EARTHMOVING	184_INT	R	Air Con	1ME739	12920	SERVICE & REPAIR AIR CON SYSTE	CHECKED FOR LEAKS ON MACHINE AND FOUND LEAKING CONDENSOR, REMOVED AND REPAIRED AS REQUIRED, REFITTED AND REGASSED MACHINE	447.83	0	0	99	546.83
160310-0015	SVC00164 990	03/16/2016	1H0103	ID - EARTHMOVING	184_INT	R	Drive Line	1ME739	12920	REPLACE U/S REAR JACK SHAFT	REMOVED BROKEN TAIL SHAFT, REPAIRED AND REFITTED.	354.38	0	1503.05	18	1875.43
160621-0016	SVC00169 853	06/27/2016	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739	13104 HR	S1 C SERVICE	TRAVELLED TO K&D BRICK, CARRIED OUT S1 C SERVICE AS PER SERVICE SHEET, TAKE SAMPLES AS PER SHEET	483.53	1523.13	0	45.5	2052.16
160620-0055	SVC00170 150	06/27/2016	1H0103	ID - EARTHMOVING	184_INT	R	Brake	1ME739	13100 HRS	CHECK PARK BRAKE FAULT	TRAVELLED TO K&D BRICK, CHECKED AND ADJUSTED PARK BRAKE AS REQUIRED. ROAD TEST ON BANK AFTER REPAIRS TO BE SURE BRAKE HOLDING	78.75	0	0	16.5	95.25
160816-0069	SVC00172 902	08/18/2016	1H0103	ID - EARTHMOVING	186_INT	R	Sundries	1ME739		REPLACE REAR BREATHER	SUPPLY BREATHER	0	3.86	0	0	3.86
161219-0078	SVC00179 353	12/21/2016	1H0103	ID - EARTHMOVING	184_INT	R	Brake	1ME739	13313	REPAIR BRAKE LINE OIL LEAK	TRAVELLED TO TRANMERE, REMOVE AND REPLACE BLOWN O RING ON BRAKE LINE TO R/HAND FRONT AXLE, TEST OPERATION	100.44	0	0	0	100.44
170123-0013	SVC00180 922	01/30/2017	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739	13331 HRS	S1 A SERVICE	TRAVELLED TO TRANMERE, CARRIED OUT S1 A SERVICE AS PER SERVICE SHEET	320.01	271.72	0	58.5	650.23

170127-0005	SVC00181 155	02/22/2017	1H0103	ID - EARTHMOVING	184_INT	R	Electrical	1ME739	13338 HRS	REPAIR ALL LIGHTS	TRAVELLED TO TRANMERE, REPAIR ALL LIGHTS, REPAIR WIRING TO REAR WORK LIGHT, CHECK AND REPAIR WIRING TO L/HAND TAIL LIGHT ASSEMBLY	163.58	0	0	20.5	184.08
170227-0026	SVC00182 273	02/27/2017	1H0103	ID - EARTHMOVING	184_INT	R	Differentia l-FD	1ME739	13343 HRS	CHECK OIL LEAK LEFT REAR AXLE	CHECK OIL LEAK LEFT REAR AXLE FOUND LEAKING HUB SEAL . CHECKED AND CLEANED BREATHER. CHECKED OIL LEVEL	120.53	0	0	55	175.53
170504-0066	SVC00185 691	05/09/2017	1H0103	ID - EARTHMOVING	184_INT	R	Brake	1ME739		REPLACE LEAKING BRAKE COOLING	REPLACE LEAKING BRAKE COOLING HOSE RHF AXLE COMPLETED BY ENZED	0	0	522.03	0	522.03
170515-0080	SVC00186 170	05/15/2017	1H0103	ID - EARTHMOVING	184_INT	R	Engine	1ME739	13452 HRS	CHECK OVERHEATING FAULT	TRAVELLED TO HBMI, CHECK OVERHEATING FAULT, WASH OUT RADIATOR TO REMOVE RUBBISH FROM FINS	80.35	0	0	37.5	117.85
170522-0010	SVC00186 627	05/23/2017	1H0103	ID - EARTHMOVING	184_INT	R	Tyres	1ME739	13482 HRS	PUMP UP L/HAND FRONT TYRE	TRAVELLED TO HBMI, PUMP UP L/HAND FRONT TYRE AND CHECK FOR AIR LEAK	120.53	0	0	37.5	158.03
170606-0025	SVC00187 983	06/20/2017	1H0103	ID - EARTHMOVING	184_INT	S	Service	1ME739	13565 HRS	S1 B SERVICE	TRAVELLED TO HBMI, CARRIED OUT S1 B SERVICE AS PER SERVICE SHEET, PLEASE NOTE UNIT HAS HOLES IN TRAY AND CHROME LIFTING OFF REAR STRUT ROD	327.15	751.54	0	58.5	1137.19
170703-0099	SVC00188 642	07/05/2017	1H0103	ID - EARTHMOVING	184_INT	R	Brake	1ME739	13601 HRS	ADJUST PARK BRAKE	TRAVELLED TO HBMI, ADJUST PARK BRAKE AND TEST OPERATION ALL OK.	80.35	0	0	37.5	117.85
170717-0003	SVC00189 308	07/20/2017	1H0103	ID - EARTHMOVING	187_INT	R	Transmissi on	1ME739	13,627HR	TRANSMISSION FAULT	TRANSMISSION FAULT.	241.05	65.34	0	87.05	393.44
											TRANSMISSION WILL NOT ENGAGE DRIVE. FOUND SELECTOR LEAVER FAULTY. REMOVED AND REPAIRED THEN REINSTALLED AND ADJUSTED. TOPPED UP TRANSMISSION OIL. TESTED UNIT. ALL OK.					
170724-0021	SVC00189 669	07/27/2017	1H0103	ID - EARTHMOVING	187_INT	R	Bodywork	1ME739	13,642hr	BONNET LATCH REPAIR	BONNET LATCH REPAIR	120.53	0	0	43.53	164.06
											TRAVEL TO FLOWERDALE AND INSPECT BONNET CATCH WHICH IS STIFF AND TIGHT. FREE UP AND LUBE LATCH AND UNIT LINK. TEST OK.					
170725-0033	SVC00189 772	07/26/2017	1H0103	ID - EARTHMOVING	184_INT	R	Tyres	1ME739	13644	CHANGE DAMAGED TYRE AT FLOWERD	BRIDGESTONE EARTHMOVER CHANGED OUT DAMAGED TYRE AT FLOWERDALE, COSTS CHARGED TO FLOWERDALE AS REQUESTED BY EARTHMOVING AS UNIT IS ON DRY HIRE	0	0	455	0	455
170807-0055	SVC00190 514	08/09/2017	1H0103	ID - EARTHMOVING	180_INT	H	Cut Plate Sale	1ME739		SUPPLY HARDOX 12MM PER LIST	SUPPLY HARDOX 12MM PER LIST HARDOX450 - 1 @ 2000mm x 800mm x 12mm	142.7	296.26	0	0	438.96
170817-0011	SVC00191 127	08/25/2017	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Trays/Buckets	1ME739	13,671 HRS	WELD IN PLATE	WELD IN PLATE.	602.63	80.8	0	105.13	788.56
											CLEAN OUT REAR OF TRAY. INSTALL PLATE IN POSITION AND WELD IN PLACE TO TRAY LINER.					

170828-0089	SVC00191 08/30/2017 590	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Service	1ME739	N/A	SUPPLY BOX GREASE	SUPPLY BOX GREASE.	0	69.6	0	0	69.6
170830-0073	SVC00191 09/07/2017 824	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Brake	1ME739	13,682 HRS	BRAKE COOLER PIPE LEAK	SUPPLY ONLY. BRAKE COOLER PIPE. TEST AND CHECK FOR OIL LEAKS. REMOVE BODY PLATES AND CLEAN SUROUNDS. TENSION LOOSE CLAMPS. TEST UNIT AND TOP UP TRAN OIL LEVEL AND BRAKE RESERVOIR.	164.46	133.58	0	83.23	381.27
170906-0001	SVC00192 10/26/2017 141	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Hydraulic	1ME739	13,711 HRS	RESEAL LHS HOIST CYLINDER	SUPPLIED SPARE OIL 20LT- 134398 RESEAL LHS HOIST CYLINDER. REMOVE LHS LIFT CYLINDER FROM UNIT. LOAD ON UTE DELIVER TO DEVONPORT FOR REPAIR. PICK UP FROM DEVONPORT AND RETURN TO FLOWERDALE AND INSTALL. TEST OK.	736.34	586.3	595	378.68	2296.32
171026-0004	SVC00194 10/31/2017 729	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Electrical	1ME739	13,723 HRS	STARTING FAULT	STARTING FAULT. TEST START FAULT. TEST BATTERIES. TEST STARTER MOTOR. FOUND THAT STARTER MOTOR IS FAULTY. REMOVED AND REPLACED. TESTED ALL OK.	537.29	658.11	0	176.86	1372.26
171103-0083	SVC00195 11/28/2017 289	1H0774	FLOWERDALE SAND QUARRY	187_INT	S	Service	1ME739	13,745 HRS	S1A SERVICE	S1A SERVICE COMPLETE SERVICE AND SAFETY CHECKS AS PER REQUIRED SCHEDULE. REPLACED ENGINE OIL/FILTER. CARRIED OUT OILS SAMPLING. GREASED ALL LUBRICAION POINTS. CHECKED ALL OTHER FLUID LEVELS. REPLACED WIPER BLADE. STRAIGHTEN BENT L/H RAIL. GOOD VISUAL CHECK OVER UNIT.	284.99	363.41	0	89.25	737.65
190729-0013	SVC00197 10/28/2019 413	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Brake	1ME739	15205HR	BRAKE OIL FAULT	1ME739 CALLED TO FLOWERDALE TO INVESTIGATE OIL LEAK FROM THE FRONT DRIVE AXLE. FOUND THE MIDDLE DUO TO BE LEAKING. REMOVED THE HUB GROUP AND REBUILT AS NEEDED.	2547.7	454.9	0	0	3002.6
180223-0034	SVC00200 03/15/2018 650	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Engine	1ME739	13,834 HRS	TENSION BELTS	TENSION BELTS. TRAVEL TO FLOWERDALE. TENSION A/C BELTS. TENSION ALT/FAN BELTS. TEST ALL GOOD.	80.35	0	0	41.52	121.87

180320-0051	SVC00201 04/06/2018 900	1H0774	FLOWERDALE SAND QUARRY	187_INT	S	Service	1ME739	13,988HR	S1D SERVICE 2000HR	S1 D SERVICE 2000HRS	1469.73	2410.7	0	125	4005.43
										TRAVEL TO FLOWERDALE. COMPLETE SERVICE AND SAFETY CHECKS AS PER REQUIRED SCHEDULE. CHANGE ENGINE OIL AND FILTERS. CHANGE TRANS OIL AND FILTERS. CHANGE FUEL FILTER. CHANGE DIFF OILS. CHANGE HYD FILTER, AIR FILTER AND CAB AIR FILTER. CHANGE WATER FILTER AND BRAKE FILTER. SAMPLE ALL 12 COMPONENTS. REPAIR BRACKET IN ARTICULATION. REPAIR MIDDLE DIFF BREATHER. GOOD VISUAL CHECK OVER UNIT.					
180406-0055	SVC00202 05/17/2018 813	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Brake	1ME739	14,112 HRS	REPLACE P/BRAKE PADS + BELTS	REPLACE P/BRAKE PADS + BELTS	280.49	1085.24	0	89.03	1454.76
										REMOVE PARK BRAKE ASSEMBLY AND REPLACE PADS. ADJUST TO SUIT. REMOVE ALT AND A/C V-BELTS. FIT NEW BELTS AND ADJUST TO TENSION. TEST ALL OK.					
180423-0096	SVC00203 04/24/2018 723	1H0774	FLOWERDALE SAND QUARRY	121_INT	R	Tyres	1ME739		CALLOUT TO INFLATE TYRES	CALLOUT TO INFLATE TYRES ON MACHINE AT FLOWEDALE	0	0	160	0	160
180510-0066	SVC00204 05/28/2018 604	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Service	1ME739	14,112 HRS	REPLACE LHS WINDOW REGULATOR	REPLACE LHS WINDOW REGULATOR.	405.51	897.85	0	57.77	1361.13
										TRAVEL TO FLOWERDALE. REMOVE OLD WORN OUT LEFT WINDOW REGULATOR. FIT NEW REGULATOR, WIRING, DOOR SKIN AND BRACKETS. TEST. ALL OK.					
180521-0109	SVC00205 05/31/2018 151	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Hydraulic	1ME739	14,133 HRS	REPLACE STEERING HOSES	REPLACE STEERING HOSES.	281.23	3.72	449.75	32.81	767.51
										TRAVEL TO FLOWERDALE SITE. TILT CAB, REPLACE BLOWN STEERING HOSES. TEST UNIT. CHECK HYD LEVEL. ALL OK. RE-POSITION CAB.					
180621-0012	SVC00206 09/28/2018 971	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Sundries	1ME739	14,357 HRS	LHS WINDOW WINDER	LHS WINDOW WINDER.	371.4	1832.06	0	56.07	2259.53
										TRAVEL TO FLOWERDALE SITE. REMOVE & REPLACE WINDOW SEALS & BRACE. REPLACE RH SIDE WINDOW REGULATOR. RECTIFY POWER FAULT. TEST ALL OK.					

180711-0041	SVC00208 151	07/11/2018	1H0774	FLOWERDALE SAND QUARRY	184_INT	R	Tyres	1ME739	14240	REPLACE DAMAGED TYRE WITH SPAR	REPLACE DAMAGED TYRE WITH SPARE RUNOUT, DAMAGED TYRE HAD A SIDEWALL BUBBLE. REMOVED TYRE SERIAL NO: S4JLS0284 FITTED TYRE SERIAL NO: YPV0525E1A CARRIED OUT BY BRIDGESTONE E/MOVER	0	0	305	0	305
180718-0024	SVC00208 540	08/17/2018	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Suspension/UC	1ME739	14,251 HRS	REAR SUSPENSION REPAIRS	REAR SUSPENSION REPAIRS. TRAVEL TO FLOWERDALE QUARRY. REMOVE REEAR DRIVE A-FRAME. DE-GAS STRUTS. REMOVE LH REAR TYRE. REPLACE BUSH IN A-FRAME. CLEAN SURROUNDING AREA. RE-TAP THREADS. RE-FIT A-FRAME. TORQUE BOLTS. FIT TYRE. TORQUE WHEEL BOLTS. RE-GAS REAR STRUTS. GREASE LUBE POINTS. TEST UNIT.	1857	795.33	0	125	2777.33
180723-0032	SVC00208 731	07/31/2018	1H0774	FLOWERDALE SAND QUARRY	187_INT	S	Service	1ME739	14,251 HRS	S1 A SERVICE	S1 A SERVICE. TRAVEL TO FLOWERDALE QUARRY. COMPLETE SERVICE AND SAFETY CHECKS AS PER REQUIRED SCHEDULE. GREASE ALL LUBRICATION POINTS. CHANGE ENGINE OIL AND FILTER. CARRY OUT OIL SAMPLING(ENGINE) INSPECT DIFF OIL AND FILTERS. INSPECT HYD OIL. CHECK ALL OTHER FLUID LEVELS.	245.1	365.25	0	49.75	660.1
180718-0024	SVC00209 822	08/17/2018	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Suspension/UC	1ME739	14,251 HRS	REAR SUSPENSION REPAIRS	REAR SUSPENSION REPAIRS. TRAVEL TO FLOWERDALE QUARRY. REMOVE REEAR DRIVE A-FRAME. DE-GAS STRUTS. REMOVE LH REAR TYRE. REPLACE BUSH IN A-FRAME. CLEAN SURROUNDING AREA. RE-TAP THREADS. RE-FIT A-FRAME. TORQUE BOLTS. FIT TYRE. TORQUE WHEEL BOLTS. RE-GAS REAR STRUTS. GREASE LUBE POINTS. TEST UNIT.	0	0	336.97	0	336.97
180820-0060	SVC00210 370	08/29/2018	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Sundries	1ME739	14,296 HRS	REPAIR SEAT BELT /TRANS LEVEL	REPAIR SEAT/TOP UP TRANS LEVEL. TRAVEL TO FLOWERDALE SITE. RECTIFY SEAT BELT FAULT. TOP UP TRANS OIL LEVEL. CHECK TYRE PRESSURES.	163.4	21.59	0	45.67	230.66

180917-0097	SVC00211 09/28/2018 945	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Sundries	1ME739	14,357 HRS	REPLACE FUEL CAP	REPLACE FUEL CAP.	81.7	289.41	0	41.59	412.7
180924-0085	SVC00212 09/28/2018 361	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Sundries	1ME739	14375 HRS	SEAT REPAIR	TRAVEL TO FLOWERDALE SITE. FIT NEW FUEL CAP & SCREEN. ADJUST PARK BRAKE. RE-SEAL ROOF. SEAT REPAIR.	422.35	493.25	0	96.11	1011.71
181108-0006	SVC00215 11/29/2018 202	1H0774	FLOWERDALE SAND QUARRY	187_INT	S	Service	1ME739	14513 HRS	S1 B SERVICE 500 HRS	RE-FIT SEAT TO UNIT AND TEST. ALL OK. S1B SERVICE 500HR	650.6	807.5	0	32.53	1490.63
181205-0048	SVC00216 12/17/2018 823	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Starter Motor	1ME739	14,566HR	Replace starter motor	COMPLETE SERVICE AND SAFETY CHECKS AS PER REQUIRED SCHEDULE. GREASE ALL LUBRICATION POINTS. CHANGE ENGINE OIL AND FILTER. FILL AUTO GREASER. CARRY OUT OIL SAMPLING(5). SAMPLE ENG, HYD, TRANS & DIFFS. CHANGE AIR FILTER. CHANGE FUEL FILTER AND CHECK SYSTEM FOR LEAKS. INSPECT DIFF OIL AND FILTERS. INSPECT HYD OIL. CHECK ALL OTHER FLUID LEVELS. TIGHTEN LOOSE A/C & ALTERNATOR BELTS. CHECK EXHAUST LEAKS AT TURBO & DUMP PIPE AREA. REPLACE STARTER MOTOR.	750.3	655	0	112.52	1517.82
181203-0064	SVC00216 12/14/2018 996	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Sundries	1ME739	14,570HR	SUPPLY GREASE GUN	TRAVEL TO FLOWERDALE. TEST START FAULT. FOUND STARTER MOTOR FAULTY. REMOVE WIRING & MOUNT BOLTS. CLEANED AREA. FITTED NEW STARTER MOTOR. TEST UNIT ALL OK SUPPLY GREASE GUN. PARTS ONLY.	0	128	0	0	128

181221-0008	SVC00217 01/10/2019 709	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Engine	1ME739	14654HR/95608KM	OVER HEATING FAULT	OVER HEATING FAULT. TRAVEL TO FLOWERDALE TO ATTEND CALL OUT (IN HOURS). OVER HEATING FAULT. CHECK COOLANT HOSES, ALL PIPES, INTERCOOLER AND RADIATOR FOR BLOCKAGE. ALL OK. ASKED DRIVER TO PUT A LOAD IN THE TRUCK AND GET MACHINE HOT. DROVE AROUND FOR 1/2 AN HOUR BUT ONLY SHOWED WORKING NORMAL OPERATING TEMPS. WILL MONITOR ONGOING.	163.4	0	0	83.17	246.57
190123-0071	SVC00219 01/27/2019 241	1H0774	FLOWERDALE SAND QUARRY	184_INT	R	Tyres	1ME739	NOT SUPPLIED	REMOVE FLAT TYRE, FIT RUNOUT	REMOVE FLAT TYRE FROM POS 4 AND FIT RUNOUT TYRE	0	0	332.5	0	332.5
190124-0030	SVC00219 01/31/2019 287	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Electrical	1ME739	14726 HRS	REPAIR ROTATING LIGHT	REPAIR ROTATING LIGHT.	81.7	0	0	4.09	85.79
190130-0048	SVC00219 02/06/2019 607	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Electrical	1ME739	14726 HRS	Repair starting fault	REPLACE ROTATING LIGHT GLOBE. REPAIR STARTING FAULT.	163.4	0	200	45.67	409.07
190207-0068	SVC00220 02/21/2019 108	1H0774	FLOWERDALE SAND QUARRY	184_INT	S	Service	1ME739	14,782hr	S1 A SERVICE & EXHAUST REPAIR	TRAVEL TO FLOWERDALE SITE. DIAGNOSE STARTING FAULT. GMC ELECTRICAL TO REPAIR. TRACED FAULT TO SHORT CIRCUIT IN STARTER. CARRIED OUT TEMPORARY REPAIR TO STARTER TO KEEP IT GOING UNTIL IT CAN BE REPLACED. S1 A SERVICE TRAVEL TO FLOWERDALE SITE. COMPLETE SERVICE AND SAFETY CHECKS AS PER REQUIRED SCHEDULE. GREASE ALL LUBRICATION POINTS. CHANGE ENGINE OIL AND FILTERS. CARRY OUT OIL SAMPLING(1) CHANGE AIR FILTERS. CHANGE FUEL FILTERS. CHECK ALL OTHER FLUID LEVELS. CHECKED EXHAUST LEAK & ARRANGED FOR ENZED TO CARRY OUT REPAIRS. ENZED ATTENED SITE AND REPLACED LEAKING DIESEL RETURN HOSE & SWIVEL.	586.9	254.3	218.23	104.34	1163.77

190219-0009	SVC00220 02/22/2019 678	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Tyres	1ME739	14799HR	TYRE REPAIR	TYRE REPAIR	0	0	720	0	720
										SUBLET ONLY TO BRIDGESTONE. TRAVELLED TO FLOWERDALE QUARRY. REMOVED POS 5 TYRE DUE TO SIDEWALL CUT. FIT & SUPPLY SECONDHAND TYRE (F6K482654 RTD 21/22) TO GET MACHINE GOING.					
190404-0034	SVC00223 04/12/2019 792	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Brake	1ME739	14,924HR	PARK BRAKE REPAIR	PARK BRAKE REPAIR.	122.55	0	0	43.63	166.18
										TRAVEL TO FLOWERDALE SITE. TEST & CHECK PARK BRAKE ASSEMBLY. ADJUST PARK BRAKE TRAVEL ON SHAFT PIVOT.					
190430-0068	SVC00225 05/14/2019 135	1H0774	FLOWERDALE SAND QUARRY	187_INT	S	Service	1ME739	5,010hr	1000HR SERVICE	S1 C SERVICE 1000 HOUR SERVICE	1019.75	2293.08	0	125	3437.83
										COMPLETE SERVICE AND SAFETY CHECKS AS PER REQUIRED SCHEDULE. GREASE ALL LUBRICATION POINTS. CHANGE ENGINE OIL AND FILTER. CARRY OUT OIL SAMPLING(ALL 12 COMPONENETS). CHANGE HYD FILTER. CHANGE AIR FILTER. CHANGE CAB FILTER. CHANGE FUEL FILTERS.. CHECK DIFF OIL. CHANGE TRANS. OIL & FILTER. INSPECTED BRAKES & SUSPENSION. CHECK ALL OTHER FLUID LEVELS. CHANGE COOLANT.					
190507-0059	SVC00225 05/23/2019 291	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Differentia l-FD	1ME739	15,048HR	WHEEL SEAL LEAK		892.9	1298.16	0	119.64	2310.7
190509-0070	SVC00225 05/21/2019 429	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Hydraulic	1ME739	15020hr	BLOWN BRAKE COOLER PIPE	BLOWN BRAKE COOLER PIPE.	373.65	568.62	1077.68	93.68	2113.63
										TRAVEL TO FLOWERDALE SITE TO TOP UP TRANSMISSION OIL LEVEL AFTER ENZED CARRIED OUR SUBLET REPAIRS TO REPLACE BLOWN HOSES. REF ENZED INV NB87563.					
190510-0031	SVC00225 05/30/2019 462	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Electrical	1ME739	15,048HR	REPLACE AM/FM RADIO & W MODUEL	REPLACE AM/FM RADIO & WINDOW MODULE	163.4	130	598.8	83.17	975.37
										TRAVEL TO FLOWERDALE SITE. FIT UP REAPIRED WINDOW ELEC MODULE. WIRE IN PLUMBING & TEST. ALL OK. RADIO INSTALLED BY AE: TRACED FAULT TO RELAY BLOCK IN FUSE PANEL. ALL INPUTS OK. FAULTY RELAYS INSIDE MODULE. REMOVED, RE-ASSEMBLE AND RETURN TO WSHOP. BUILD REPLACEMENT MODULE DEVICE CONSISTING OF REPLACEMENT RELAY AND BASES. WIRE UP AND SUPPLY TO SEAN FOR FITTMENT.					

190522-0065	SVC00226 05/30/2019 404	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Hydraulic	1ME739	N/A	SUPPLY PARTS FOR HOSING	PARTS ONLY. SUPPLY PARTS FOR HOSING. SUPPLIED BY PIRTEK LAUNCESTON.	0	499	0	0	499
190603-0037	SVC00227 06/27/2019 318	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Sundries	1ME739	15,071hr	WINDOW REG FAULT	WINDOW REG FAULT. TRAVEL TO FLOWERDALE SITE (X2). FIT UP MODULE. MODULE FAILED CAUSING CIRCUIT TO BLOW FUSE. CONTACT AUTO ELECTRICIAN TO RECTIFY FAULT. TEMPORY CLOSE WINDOW. RETURN TO WORKSHOP. TRAVEL BACK TO FLOWERDALE FIT UP GENUINE MODULE. FIT COVERS AND TEST. ALL OK.	486.85	483.16	0	173.25	1143.26
190606-0013	SVC00227 06/27/2019 463	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Hydraulic	1ME739	15,109HR	HYDRAULIC OIL LEAK	HYDRAULIC OIL LEAK. TRAVEL TO FLOWERDALE SITE. RECTIFY HYD LEAK IN TILT CAB. REMOVE HYD STEEL PILE FROM FLOW AMP VALVE AND HOSE FROM HYD/PUMP, CLAMPS ETC. RETURN TO WORKSHOP TO ORGANISE REPAIRS REPLACEMENT HOSES AND REPAIRS. HAVE PIPE REPAIRED BY DEVONPORT HYDRAULICS. PIRTEK TO REPLACE 2 X HOSES. RETURN TO FLOWERDALE SITE. RE-FIT PIPE AND HOSES TO UNIT. TEST ALL OK. BOLT CAB DOWN. CHECK HYD LEVEL.	1084.6	3.11	371.37	200	1659.08
190620-0007	SVC00228 09/30/2019 041	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Sundries	1ME739	15196hr	WHEEL SEAL	WHEEL SEAL - LEAKING WHEEL HUBS SET UP UNIT ON WASH BAY. WASH AROUND UNDER CAB AND AROUND WHEEL END AND CLEAN UP. SET UP ON SAFETY STANDS IN WORKSHOP. REMOVE WHEELS ON RIGHT HAND SIDE 3RD AND 2ND AXLES. DRAIN OILS. DISASSEMBLE HUBS, INSPECTED AND CLEANED. REASSEMBLED. FILL WITH OIL AND REINSTALL WHEELS. TORQUED TO TENSION. TURNED UNIT AROUND AND SET UP ON STAND. LEFT HAND 1ST AXLE, 2ND & 3RD AXLES REMOVED WHEEL COVER AND DRAINED OILS. DISASSEMBLED HUBS AND CLEANED TO INSPECT PARTS. REASSEMBLED WITH NEW SEALS ETC FILLED WITH OIL. REINSTALLED WHEELS AND TORQUED TO TENSION. CLEANED DOWN UNIT. TEST DROVE AROUND EAST MILL SITE FOR 1/2 AN HOUR. CHECKED WHEEL NUT TENSION AND OIL LEVELS ALL OK. RAN FOR A FURTHER 1 HOUR. CHECKED OVER FOR LEAKS ALL OK.	10539.35	11410.02	0	50	21999.37

190708-0032	SVC00229 105	07/19/2019	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Exhaust	1ME739	15,196hr	Exhaust repair	EXHAUST REPAIR. REMOVE EXHAUST AND REPLACE FLEX & WELD INTO PLACE. REPLACE FLANGE, GASKETS. BOLT INTO PLACE. FIT CLAMPS AND CLAMP INTO PLACE. REPLACE EXHAUST RINGS IN END OF TURBO. FIT EXHAUST ELBOWS AND REINSTALL ALL EXHAUST COVERS. TEST. ALL OK.	2133.45	310.96	0	50	2494.41
190710-0069	SVC00229 285	07/26/2019	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Hydraulic	1ME739	15196 HRS	REPAIR HOSES	REPAIR HOSES. REMOVE BLOWN HITCH HOSE AND BRAKE HOSES. PIRTEK CALLED IN TO MAKE REPLACEMENTS. FIT HOSES AND TEST. ALL OK.	381.8	371.56	568.1	19.09	1340.55
190718-0043	SVC00229 681	07/19/2019	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Tyres	1ME739	15196hr	TYRE CHANGE OUT	TYRE CHANGE OUT. SUBLET ONLY TO BRIDGESTONE. BRIDGESTONE TRAVELLED TO HB BURNIE WSHOP. UNBOLT & FIT TYRE TO POS.1. TYRE OFF ECJ031655A RTD.2/3 TYRE ON: F7B381937 RTF 29/30. UNBOLT AND FIT CUSTOMER RUNOUT TYRE TO POS.2 TYRE OFF 7/8 TYRE. TYRE ON: F7B381938 RTD: 27/27	0	0	520	0	520
190723-0020	SVC00229 912	07/30/2019	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Transmissi on	1ME739	15205HR	TRANSMISSION FAULT	TRANSMISSION FAULT. TRAVELLED TO FLOWERDALE SITE. INSPECTED OIL LEVEL ON TRANSMISSION. FOUND TO BE A BIT LOW. INSPECTED WHEEL ENDS AND WET BRAKES. NO LEAKS FOUND. CHECKED BRAKE PRESSURE ALL OK. TOPPED UP TRANSMISSION OIL. TESTED ALL OK.	285.95	112.25	0	87.98	486.18
190723-0021	SVC00229 914	07/26/2019	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Tyres	1ME739	15205HR	Retension wheels	RETENSION WHEELS. TRAVEL TO FLOWERDALE SITE. RETORQUE ALL WHEELS. RETURN TO WORKSHOP.	163.4	0	0	83.17	246.57

190731-0057	SVC00230 440	08/23/2019	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Drive Line	1ME739	15,206hr	REPAIR DRIVE FAULT	REPAIR DRIVE FAULT. TRAVEL TO FLOWERALE. RECTIFY NOISE IN DRIVE. TEST AND CHECKED DRIVE COMPONENTETS. FOUND UNIVERSAL FAULTY. REMOVED DRIVELINE. REPLACED UNIVERSALS. REFIT DRIVELINE & TEST. GREASE ALL LUBE POINTS. CALE: TRAVELLED TO FLOWERDALE TO INSTALL HITCH DRIVE SHAFT. STILL MAKING NOISE. NARROW ISSUE DOWN TO FRONT DRIVE COMPONENTS.	1310.55	2013.44	1712.29	150	5186.28
190805-0098	SVC00230 727	08/23/2019	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Trimming	1ME739		SUPPLY SEAT COVER	SUPPLY SEAT COVER. SUPPLY ONLY	0	231.18	0	0	231.18
190808-0013	SVC00230 893	09/20/2019	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Differentia I-FD	1ME739	15,209hr	INSPECT FRONT DIFF NOISE	INSPECT FRONT DIFF NOISE. TRAVEL TO FLOWERDALE SITE(X2). INSPECT & CHECK FOR FRONT DIFF CHATTER & KNOCK. CHECK AND INSPECT DRIVE LINE. REPLACED CENTRE ARTICULATION DRIVE LINE AND UNI'S. REPLACHED RH FRONT DRIVE UNI.'S. REMOVED LH FRONT DRIVE WHEEL ASSEMBLY, DISASSEMBLED , CHECKED AND INSPECTED. ALL OK. REASSEMBLED, CHANGE FRONT DIFF OIL AND PUT CAT ADDITIVE. TEST UNIT. RETORQUE WHEEL NUTS. (CAT ADDITIVE CHARGED ON JOB 190731-0057)	1474.35	106	0	200	1780.35
190809-0033	SVC00230 963	08/30/2019	1H0774	FLOWERDALE SAND QUARRY	187_INT	S	Service	1ME739	15246hr	250HR SERVICE	S1 A SERVICE TRAVEL TO FLOWERDALE SITE. COMPLETE SERVICE AND SAFETY CHECKS AS PER REQUIRED SCHEDULE. GREASE ALL LUBRICATION POINTS. CHANGE ENGINE OIL AND FILTER. CARRY OUT OIL SAMPLING (1) CHECK ALL OTHER FLUID LEVELS. GREASE DRIVELINE.	300.95	255.39	0	90.04	646.38
190904-0071	SVC00232 429	09/20/2019	1H0774	FLOWERDALE SAND QUARRY	187_INT	R	Sundries	1ME739	15,284HR	REPAIR LUBE POINT	REPAIR LUBE POINT. TRAVEL TO FLOWERDALE AND REPLACE BLOCKED GREASE NIPPLES.	122.55	0	0	43.63	166.18

191023-0053	SVC00235 000	12/10/2019	1H0774	FLOWERDALE SAND QUARRY	192_INT	R	Engine	1ME739	15401	FUEL SUPPLY PUMP	FUEL SUPPLY PUMP TRVEL TO SITE AND CARRY OUT TROUBLE SHOOTING FOR FAULT CODES, FAULT RELATED TO LOW FUEL PRESSURE SUPPLY, CHECKED LINES AND IN LINE STRAINERS, TESTED SUPPLY PUMP PRESSURE AND FOUND TO NOT BE BUILDING UP PRESSURE, REQUIRES NEW FUEL SUPPLY PUMP, CLEAN UP WORK AREA. RETURNED TO SITE AND DISCONNECT AND REMOVED FUEL PUMP, INSTALLED NEW FUEL PUMP AND RECONNECTED. RETURNED TO SITE FOR TROUBLESHOOTING FOR NO FUEL PRESSURE, REMOVED FRONT ENGINE COVER AND FOUND FUEL PUMP DRIVE GEAR TIMING MARKS NOT ALIGNING CORRECTLY, PULLED GEAT FROM FUEL PUMP AND FOUN WOODRUFF KEY BROKEN, TRAVELLED TO STORE AND PICKED UP NEW KEY, RETURNED TO SITE AND SET GEAR TIMING TO CORRECT POSITION, INSTALLED NEW KEY, FITTED FRONT COVER AND BLED UP FUEL SYSTEM, JUMP STARTED MACHINE AS IT PRESSURIED, ALL AT SPEC CARRIED OUT BY KOMATSU LAUNCESTONEXTRACT	233.6	6634.93	0	0	6868.53
191204-0060	SVC00237 361	01/07/2020	1H0774	FLOWERDALE SAND QUARRY	192_INT	R	Engine	1ME739	15490	BREAKDOWN AT RAEBURN FUEL	FUEL SUPPLY PUMP TRAVEL TO RAEBURN, INSPECT TRUCK BREAK DOWN, CHECK FUEL FILTERS BOTH DRY AND WITH CONTAMINATION, REMOVED AND REPLACED FUEL FILTERS, INSPECT TANK AND FOUND FULL OF ALGIE, DRAIN AND REFILL FUEL TANK, FOUND STRAINER FILTER BLOCKED, REMOVE AND CLEAN AND REFIT, BLEED AND TEST RUN.	979.61	195.82	0	95	1270.43
191211-0001	SVC00237 670	12/20/2019	1H0774	FLOWERDALE SAND QUARRY	192_INT	R	Service	1ME739	15514	S1 500HR SERVICE	TRAVELLED TO RAEBURN, CARRIED OUT 500 HR SERVICE, GET OIL SAMPLE.	218.1	582.86	0	65	865.96
191215-0010	SVC00237 861	02/26/2020	1H0774	FLOWERDALE SAND QUARRY	192_INT	R	Hydraulic	1ME739		BLOWN HYD LINE UNDER CAB X 3	REMOVE AND REPLACE RETURN HOSE AND SECOND HOSE ON DUMP TRUCK, TOP UP HYD OIL	1020.15	76.1	1187	0	2283.25
200115-0036	SVC00239 110	01/21/2020	1H0774	FLOWERDALE SAND QUARRY	192_INT	R	Tyres	1ME739	15588 HR	INSPECT TYRES	LIASE WITH OPERATOR AND INSPECT DAMAGE TO RIGHT REAR TYRE AS REQUIRED	36.35	0	0	0	36.35
200117-0066	SVC00239 376	01/28/2020	1H0774	FLOWERDALE SAND QUARRY	192_INT	R	Bodywork	1ME739	15613 HRS	Body repairs	CHECK TIPPING BODY, MEASURE UP AREA TO BE MODIFIED TO PREVENT MATERIAL BUILD UP, CHECK DAMAGE TO REAR TYRE.	72.7	0	0	0	72.7
200129-0094	SVC00239 985	02/04/2020	1H0774	FLOWERDALE SAND QUARRY	192_INT	R	Tyres	1ME739		TYRE REPAIRS	TRAVEL TO SITE TO INSPECT TYRE, CALL IN TYRE RIGHT TO FIT 2 SECOND HAND TYRES AS REQUIRED	75.8	18.18	240.9	0	334.88

200219-0014	SVC00241 127	02/25/2020	1H0774	FLOWERDALE SAND QUARRY	192_INT	R	Trays/Buckets	1ME739	15795 HRS	REPAIR REAR TRAY FLOOR	TRAVELLED TO RAEBURN, CLEANED FLOOR UP, PLACE PLATE IN POSITION, TACK OUT PREHEAT, FULLY WELD INTO POSITION, CLEANED UP AFTER JOB, TEST ALL OK.	835.05	0	0	167	1002.05
200220-0014	SVC00241 235	04/30/2020	1H0774	FLOWERDALE SAND QUARRY	180_INT	H	Cut Plate Sale	1ME739		HARDOX PLATE FOR TRAY FLOOR		218.1	393.6	0	60.5	672.2
200310-0058	SVC00242 324	03/17/2020	1H0774	FLOWERDALE SAND QUARRY	192_INT	S	Service	1ME739	103,175	S1A SERVICE	CARRIED OUT S1 A SERVICE AS PER SCHEDULE	176.23	290.12	0	8	474.35
200318-0026	SVC00242 783	04/15/2020	1H0774	FLOWERDALE SAND QUARRY	192_INT	R	Bodywork	1ME739		SEAT REPAIRS	TRAVELLED TO QUARRY TO DIAGNOSE ISSUE, REMOVED SUSPECTED COMPONENT AND ORDER NEW, TRAVEL BACK TO SITE AND FIT NEW VALVE KIT.	379.65	173.4	0	50	603.05
200416-0010	SVC00243 193	04/22/2020	1H0774	FLOWERDALE SAND QUARRY	192_INT	R	Electrical	1ME739	15939 HR	STARTER FAULT	TRAVEL TO AND FROM TUNBRIDGE, CHECK MACHINE NOT STARTING, CHECK BATTERIES AND LEADS, CHECK STARTER MOTOR NOT ENGAGING, NEEDS REPLACING, PICK UP NEW PARTS AND TRAVEL BACK TO SITE, REMOVE STARTER MOTOR AND MODIFY WIRING TO SUIT, FIT NEW STARTER AND TEST OPERATION ALL OK.	594	1055	0	355	2004
200428-0025	SVC00244 755	05/14/2020	1H0774	FLOWERDALE SAND QUARRY	184_INT	S	Service	1ME739	15991 HRS	S1 D SERVICE	S1 D SERVICE AS PER SERVICE SHEET	1021.25	2224.81	0	125	3371.06
200511-0022	SVC00245 500	05/13/2020	1H0774	FLOWERDALE SAND QUARRY	184_INT	R	Hydraulic	1ME739	16002 HRS	REPAIR OIL LEAK UNDER CAB	REPAIR OIL LEAK UNDER CAB LIFT CAB AND INSPECT OIL LEAK, REMOVE AND REPLACE O RINGS ON TWO HYDRAULIC FITTINGS RUN UNIT AND CHECK FOR FURTHER LEAKS, TESTED OK LOWER CAB AND SECURE IN PLACE TRAVEL TUNBRIDGE QUARRY	371.4	0	0	147.25	518.65
200515-0045	SVC00245 936	06/17/2020	1H0774	FLOWERDALE SAND QUARRY	184_INT	R	Hydraulic	1ME739	16062 HRS	REPLACE COLLAPSED LIFT CYLINDE	REPLACE COLLAPSED BEARINGS IN LIFT CYLINDERS REMOVE BOTH LIFT CYLINDERS AND RETURN TO WORKSHOP FOR REPAIRS CLEAN UP CYLINDERS AND REPLACE MOUNTING BEARINGS IN ONE CYLINDER HAVE EYE REPAIRED IN OTHER CYLINDER AND FIT NEW BEARINGS REFIT CYLINDERS TO MACHINE AND LUBRICATE ALL JOINTS TOP UP HYDRAULIC OIL AND TEST OPERATION TRAVEL TUNBRIDGE QUARRY AND RETURN	1415.33	587.24	0	325	2327.57
200518-0093	SVC00246 034	05/28/2020	1H0774	FLOWERDALE SAND QUARRY	192_INT	R	Electrical	1ME739		Inspect Flashing Light	CHECK REVOLVING LIGHT NOT WORKING, CHECK WIRING, CONNECTIONS ETC, REMOVE BULB AND FIT NEW, TEST OK.	39.45	0	0	5	44.45

200513-0019	SVC00246 690	05/28/2020	1H0774	FLOWERDALE SAND QUARRY	192_INT	R	Transmission	1ME739	16037	REVERSE GEAR ISSUE	TRAVEL TO TUNBRIDGE, CHECK WARNING LIGHT ON DASH, WHEN REVERSE SELECTED, OPERATE MACHINE AND CHECK FOR FAULTS, DIFFICULT TO ENGAGE REVERSE GEAR, RESET FAULT CODE AND OPERATE MACHINE, CHECK WIRING AND CONNECTIONS AT TUB PIVOT AND ARTICULATION POINT, REMOVE CONSOLE AND CHECK GEAR SELECTOR MECHANISM, WILL NEED FURTHER INVESTIGATING.	224.3	0	0	131.25	355.55
200609-0053	SVC00247 237	06/16/2020	1H0774	FLOWERDALE SAND QUARRY	192_INT	R	Electrical	1ME739	16145 HRS	Replace batteries	TRAVEL TO TUNBRIDGE, REMOVED AND REPLACED BATTERIES IN DUMP TRUCK.	223.8	502.58	0	125	851.38
200610-0024	SVC00247 334	06/18/2020	1H0774	FLOWERDALE SAND QUARRY	184_INT	S	Service	1ME739	16154 HRS	S1 A SERVICE	S1 A SERVICE AS PER SERVICE SHEET TRAVEL TUNBRIDGE TO LA	386.4	280.56	0	131.25	798.21
200610-0072	SVC00247 372	06/24/2020	1H0774	FLOWERDALE SAND QUARRY	182_INT	R	Milling	1ME739		REPAIR LIFT CYLINDER TUBE &	REPAIRED LIFT CYLINDER TUBE BEARING BORE & NEW PIN	727	35.98	0	30	792.98
200611-0064	SVC00247 434	06/16/2020	1H0774	FLOWERDALE SAND QUARRY	192_INT	R	Brake	1ME739		ADJUST PARK BRAKE	TRAVEL TO TUNBRIDGE, CHECK PARK BRAKE NOT HOLDING, REMOVE CENTRE CONSOLE, INSPECT PARK BRAKE SWITCH, WIRING, CONNECTIONS ETC, REFIT CONSOLE, HELP REMOVE BOTH LIFT CYLINDERS AND LOAD ONTO FIELD SERVICE TRUCK, UNABLE TO CONTINUE WITH PARK BRAKE INSPECTION	218.1	0	0	125	343.1
200624-0039	SVC00248 093	07/08/2020	1H0774	FLOWERDALE SAND QUARRY	192_INT	R	Brake	1ME739	16185	ADJUST PARK BRAKE	TRAVEL TO TUNBRIDGE, CHECK CONDITION OF PARK BRAKE PADS, ADJUST PARK BRAKE, LOOSEN HOSE AND CHECK OIL SUPPLY, REMOVE DASH FASCIA PANEL, REMOVE COVER AND CHECK CONDITION OF PARK BRAKE BULB, BROKEN OFF, UNABLE TO REPLACE BULB AS PART OF CIRCUIT BOARD, CHECK TOGGLE SWITCH, SWAP OVER RELAYS AND TEST ALL OK.	412.25	0	0	125	537.25

200626-0059	SVC00248 07/27/2020 657	1H0774	FLOWERDALE SAND QUARRY	186_INT	R	Sundries	1ME739	16212 HRS	Repairs as per list	1ME739 Park brake issue	6252.2	2852.42	90	50	9244.62
										Set the machine up and raised the cab, noting excessive oil leaks and a couple of hoses that were worn Found the front brake Accumulator to be low in pressure, This was reset The park brake still wouldn't release. Trouble shooted the system and eventually found a bad earth on the pb relay to be loose. This was repaired, the solenoid for the park brake was also u/s. Rechecked the accumulator this had dropped considerably in pressure, the unit was removed and disassembled new seals were installed. the oil leaks around the steering manifold were addressed, the leaks around the hydraulic manifold were also repaired. Transmission hose from the filter housing to the transmission was removed and a new hose fabricated. Removed the covers from the exhaust pipe, removed the exhaust section and repaired. Fabricated a new exhaust flange, repaired the broken heat covers from the exhaust manifold then reinstalled. Removed the hoist control valve,					
200828-0029	SVC00251 08/31/2020 525	1H0335	REABURN QUARRY PRODUCTION	184_INT	R	Air Con	1ME739	16,270 HRS	CHECK A/C SYSTEM	TRAVEL TO HBMI, CHECK A/C SYSTEM AND CLEANED CAB FILTERS, CHECK GAS PRESSURES AND TESTED OPERATION. FOUND RUNNING AT 2 DEG C AT VENTS.	81.7	0	0	37.5	119.2
200813-0082	SVC00251 08/31/2020 681	1H0335	REABURN QUARRY PRODUCTION	121_INT	R	Tyres	1ME739		SUPPLY AND FIT TYRES	SUPPLY AND FIT TYRES NICOLE ELLIOTT REQUESTED 13/08/2020 1ME739 tyres are fitted. RUBAND have agreed to bill 2 tyres this month and 2 x tyres next month. Could you arrange a purchase order for them so they can complete their paper work RUBAND TYRES 4 x TYRES purchased. COST per tyre \$2310.00 - tyre \$80 fitment \$15 per o ring	0	0	4790	0	4790
200902-0020	SVC00252 09/23/2020 799	1H0335	REABURN QUARRY PRODUCTION	121_INT	F	Tyres	1ME739		SUPPLY AND FIT 2 TYRES	SUPPLY AND FIT 2 TYRES REQUESTED BY NICOLE ELLLIOTT 31/08/20220 TWO TYRES WERE ALSO FITTED ON PREVIOUS SERVICE CALL 200813-0082	0	0	4790	0	4790

200923-0061	SVC00252 975	09/29/2020	1H0335	REABURN QUARRY PRODUCTION	192_INT	R	Brake	1ME739	16317	INSPECT AND ADJ. PARK BRAKE	TRAVEL TO TUNBRIDGE, CHECK PARKBRAKE NOT WORKING, REMOVE CONSOLE AND CHECK SWITCH WIRING CONNECTIONS AND HARNESS, REFIT CONSOLE, CHECK FUSES AND RELAYS. RELEASE PRESSURE TO MODULATOR VALVE, PARK BRAKE NOW WORKING	85.45	0	0	62.5	147.95
200924-0039	SVC00253 020	10/27/2020	1H0335	REABURN QUARRY PRODUCTION	184_INT	R	Brake	1ME739	16,317 HRS	REPAIR PARK BRAKE FAULT	INSPECT UNIT AND CHECK PRESSURES AT PARK BRAKE RELEASE VALVE. FOUND VALVE TO BE HOLDING PRESSURE WHEN PARK BRAKE RELEASED, CARRY OUT TEMPORARY REPAIRS UNTIL NEW VALVE AVAILABLE TRAVEL TO TUNBRIDGE QUARRY FIT NEW PARK BRAKE RELEASE VALVE AND CHECK OPERATION, TESTED OK TRAVEL TO TUNBRIDGE QUARRY	698.2	1322.81	0	309.5	2330.51
201011-0027	SVC00253 814	10/26/2020	1H0335	REABURN QUARRY PRODUCTION	192_INT	R	Bodywork	1ME739	16363	REPAIR WIPER ARM	TRAVEL TO TUNBRIDGE, REPLACED DAMAGED WIPER ARM ASSY, TEST ALL OK.	40.85	0	0	125	165.85
201001-0060	SVC00253 886	10/13/2020	1H0335	REABURN QUARRY PRODUCTION	192_INT	R	Engine	1ME739	16354	COOLANT LEAK	TRAVEL TO TUNBRIDGE, CHECK MACHINE COOLANT LEVEL LOW, TOP UP COOLANT AS REQUIRED, CHECK AROUND ENGINE, HEATER CORE, RADIATOR, HOSES ETC, NO LEAK EVIDENT.	40.85	0	0	133	173.85
201016-0030	SVC00254 075	10/21/2020	1H0335	REABURN QUARRY PRODUCTION	184_INT	R	Tyres	1ME739		TYRE REPAIR, FIT SECOND HAND	TYRE REPAIR, ASSIST WITH FITMENT OF SECOND HAND TYRE, SUBLET FOR DOWLING McCARTHY. CHECK WITH DALLAS BEFORE CLOSING. TYRES AT TUNBRIDGE. TRAVEL TO TUNBRIDGE AND FIT SUPPLIED TYRE	276.95	0	640	0	916.95
201217-0020	SVC00257 374	12/23/2020	1H0335	REABURN QUARRY PRODUCTION	187_INT	R	Brake	1ME739	16,402hr	PARK BRAKE FAULT	PARK BRAKE FAULT RECTIFY PARK BRAKE FAULT. FOUND RELAY INTERMITTER FAULT. SWAPPED OVER RELAY FROM ANOTHER CITCUIT. RE-TEST. WILL MONITOR UNIT. TEST SWITCH FOUND TO BE WORKING OK	174.65	0	0	8.74	183.39
210216-0011	SVC00259 454	02/26/2021	1H0335	REABURN QUARRY PRODUCTION	192_INT	R	Engine	1ME739		Fuel supply issue	TRAVEL TO AND FROM SITE, CHECK FOR POWER LOSS AND NO START, CHECK FUEL SYSTEM, CLEAN OUT SYSTEM AND REFILL WITH DIESEL AND ADD CLEANING ADDITIVE, CHECK INLINE GAUSE FILTERS, REMOVE AND CLEAN, CLEAN OUT AIR FILTERS, START AND RUN MACHINE, ALL OK.	404	45	0	122.5	571.5

210212-0066	SVC00259 02/24/2021 808	1H0335	REABURN QUARRY PRODUCTION	192_INT	R	Hydraulic	1ME739	HYDRAULIC LEAK LHF WHEEL AREA	CHECK OIL LEAK FROM LEFT FRONT WHEEL. REMOVE INNER GUARD AND COVERS. CLEAN AREA AND RUN MACHINE. OIL LEAKING FROM ARTICULATION CYLINDER. RAISE CAB AND REMOVE HOSE. FIT NEW HOSE FABRICATED BY PIRTEK. TOP UP HYDRAULIC OIL. LOWER CAB AND RUN MACHINE. CHECK FOR LEAKS ALL OK, REFIT COVERS AND GUARDS.	452.35	38.1	290.85	20	801.3
210212-0067	SVC00259 02/25/2021 809	1H0335	REABURN QUARRY PRODUCTION	192_INT	S	Service	1ME739	S1A SERVICE	TRAVEL TO RAEBURN. CARRIED OUT S1A SERVICE AS PER SCHEDULE.	81.7	47.72	0	50	179.42
210505-0075	SVC00263 05/24/2021 869	1H0335	REABURN QUARRY PRODUCTION	192_INT	R	Electrical	1ME739	CHECK FAULT CODE ON DASH	CHECK FAULT CODE ON DASH CHECK WARNING LIGHT & ALARM COMING ON INTERMITTENTLY. CHECK ACTIVE FAULT CODES - NONE PRESENT CHECK OIL & WATER. REMOVE AND CLEAN AIR FILTER. REMOVE FUEL FILTER & INSPECT. RECOMMEND REPLACING BOTH FILTERS. RUN MACHINE UNDER LOAD CONDITIONS. ALL OK AT THIS TIME.	289.7	0	0	69.49	359.19

Applied filters:
Posted_Date is on or after 01/01/1900
Equipment_ID is 1ME739