

Service Job	Invoice No	Date	Customer Id	Customer Name	Cost Cent	Prob	Type of Call	Equip ID	Hrs	Kms	Job Description	Work Done	Labor Cost	Material Cost	Subcontra ctor Cost	Other Cost	Total Cost
97580	117204	09/11/2026	1HM368HBG	ID - TRUCK FLEET	186G	R	Sundries	1VT1086	52181.0000	0	Pre Disposal	CARRIED OUT PRE DISPOSAL CHECK -VACUUMED THE CAB -CLEANED FLOOR, DASH AND DOOR WITH SPRAY AND WIPE -HOOKED COMPRESSOR UP TO AIR TANK, CHARGED FULL OF AIR	275	59.83	0	10	334.83
62413	76085	12/03/2024	1HM368HBG	ID - TRUCK FLEET	186G	R	Tyres	1VT1086	0.0000	0	W/POWER WDC53 DRIVE TYRE X1 + DIS X1		22.53	475	0	0	497.53
62352	84703	12/03/2024	1HM368HBG	ID - TRUCK FLEET	186G	R	Engine	1VT1086	4819.0000	0	using coolant	FOUND PUSHING COOLANT OUT OF RAD FOUND NO.4 CYLINDER PUSHING AIR INTO COOLING SYSTEM . DRAIN COOLANT, REMOVE ALL REQUIRED COMPONENTS FOUND BLOWN HEAD GASKET AND LOOSE CYLINDER LINERS IN ENGINE BLOCK WILL NEED FULL ENGINE REBUILD OR REPLACEMENT	5496.1	374.39	0	200	6070.49
62243	76051	12/02/2024	1HM368HBG	ID - TRUCK FLEET	184G	R	Tyres	1VT1086	4819.0000	0	CHANGE FLAT TYRE		139.92	0	0	0	139.92
61888	73788	11/25/2024	1HM368HBG	ID - TRUCK FLEET	184G	R	Sundries	1VT1086	4819.0000	0	Inspect cvoolant entry into engine oil	INSPECT FOR COOLANT ENTRY INTO ENGINE OIL CARRY OUT TESTS AND FOUND NOTHING AT THE TIME WILL NEED TO BE BOUGHT BACK TO WORKSHOP FOR FURTHER INSPECTIONS	279.84	0	0	20	299.84
60742	73892	11/04/2024	1HM368HBG	ID - TRUCK FLEET	184G	R	Sundries	1VT1086	4819.0000	0	fit supplied wiper blades + pmi	INSPECT COOLANT LIGHT, TOPPED UP COOLNT FIT WIPERS	238.24	0	0	0	238.24
60092	72361	10/21/2024	1HM368HBG	ID - TRUCK FLEET	184G	R	Sundries	1VT1086	4819.0000	0	Chute jack repairs	REMOVE LOCKING SCREW AND FREE UP THREAD, REFIT AND FILL WITH OIL	139.92	0	0	135	274.92
60129	72380	10/21/2024	1HM368HBG	ID - TRUCK FLEET	184G	S	Service Transport B	1VT1086	4819.0000	0	Carry Out B Service @ LKW	CARRY OUT SERVICE AND VEHICLE INSPECTION. CHECK ALL LIGHTS, CHECK FLUID LEVELS. CHECK SUSPENSION, BRAKES AND TYRES - TORQUE ROD BUSHES WORN - DRAG LINK NEEDS TO BE REPLACED	748.36	270.91	0	55	1074.27
59487	73828	10/08/2024	1HM368HBG	ID - TRUCK FLEET	184G	R	Electrical	1VT1086	4819.0000	0	REPLACE HEADLIGHTS		0	1305.04	0	0	1305.04
59007	71010	09/30/2024	1HM368HBG	ID - TRUCK FLEET	184G	R	Chassis	1VT1086	4819.0000	0	MODIFY DOOR STOPPER	REMOVE DOOR STOPPER CUT SHORTER AND REFRILL HOLE FOR PIN REFIT	186.56	0	0	0	186.56
58660	70482	09/23/2024	1HM368HBG	ID - TRUCK FLEET	184G	R	Chassis	1VT1086	4819.0000	0	JACK HANDLE REPAIR	JACK THAT MOVES CHUTE UP AND DOWN ON BACK OF TRUCK HAS WORN BOLTS/HOLES DRILL NEW HOLES TO OVERSIZE AND RUN NEW BOLTS TIGHTEN ALL POINTS UP TO LIMIT AMOUNT OF MOVEMENT AND TAKE SLACK OUT OF JOINTS	93.28	0	0	0	93.28
58328	71026	09/16/2024	1HM368HBG	ID - TRUCK FLEET	184G	R	Sundries	1VT1086	0.0000	0	PUMP UP TYRES AND FIX GEAR BOOT	PUMP UP ALL DRIVE TYRES, STICK DOWN GEARSTICK BOOT TO STOP FUMES IN CAB	336.55	0	0	60	396.55
57879	70216	09/04/2024	1HM368HBG	ID - TRUCK FLEET	184G	R	Electrical	1VT1086	4819.0000	0	L.E.D HEADLIGHT UPGRADE		536.36	80.47	0	20	636.83

54458	72438	07/03/2024	1HM368HBG	ID - TRUCK FLEET	186G	R	Clutch	1VT1086	4819.000 0	0	Replace clutch	ATTEND TO VEHIUCLE WITH CLUTCH ENGAGEMENT ISSUES FLUSH CLUTCH SYSTEM AND BLED - NO CHANGE . FOUND CLUTCH ADJUSTING ROD TO BE BENT, REPLACED AND READJUSTED CLUTCH - NO CHANGE PULLED BOX AND FOUND CLUTCH PLATE RUSTED TO PRESSURE PLATE CUASING ISSUE, FOUND ENGINE MOUNTS LOOSE AND BROKEN WHEN BOX REMOVED EXTRACT BROKEN BOLTS, RETHREAD/SIZE ALL ENGINE MOUNT BOLT HOLES. REPAIRED THREADS ON ENGINE MOUNTS REMOVE FLYWHEEL FOR MACHING, FIT MACHINED FLYWHEEL AND CLUTCH ASSEMBLY. REPAIRED GREASE LINE FOR THROW OUT. REINSTALLED BOX AND CARRY OUT FUNCTION TEST OF CLUTCH ALL OK FABRICATE COVER PLATE FOR CLUTCH HOUSING TO STOP WATER INGRESS TO CLUTCH HOUSING.	2361.42	973.26	0	100	3434.68
53415	69681	06/13/2024	1HM368HBG	ID - TRUCK FLEET	186G	R	Suspensio n/UC	1VT1086	4819.000 0	0	Suspension / Engine	REMOVE LEFT REAR SPRING PACK. FOUND SPRING HAS SIEZED ONTO MOUNTS REMOVED WITH HEAT AND PORTER POWER SUBLET REPAIRS TO MOONAH SPRINGWOKRS REFIT SPRING PACK AND FIT NEW U BOLTS AND TENSION TO SPEC REFIT WHEEL AND GUARDS FOUND CLTUCH OPERAITON U/S REPAIRED CLUTCH PPIN AND CONNECTOR, BLEED SYSTEM TO REMOVE AIR FOUND CLUTCH SEIZED TO FLYWHEEL AND BELL HOUSING FULL OF WATER	3863.17	1479.41	1231.82	120	6694.4
52550	62513	05/27/2024	1HM368HBG	ID - TRUCK FLEET	184G	R	Electrical	1VT1086	4580.100 0	0	Fit up rear light and front light bar - replace mud guard and poles	Lights supplied on seperate job FITTED NEW MUD GAURD AND POLES MOUNTED WORK LIGHTS AND LIGHT BAR WIRED IN AS REQUIRED. TESTED OK	1042.64	0	0	0	1042.64
52410	64258	05/23/2024	1HM368HBG	ID - TRUCK FLEET	184G	S	Service Transport B	1VT1086	0.0000	0	B Service @ LKW	CARRY OUT SERVICE AND VEHICLE INSPECTION. CHECK ALL LIGHTS, CHECK FLUID LEVELS. CHECK SUSPENSION, BRAKES AND TYRES - FOUND BROKEN SPRING ON LH REAR OIL VALVE FROM ROCKER COVER POWER STEERING LEAKING VEHICLE TAGGED OUT DUE TO SUSPENSION FAILURE, VEHICLE TO RETURN TO WORKSHOP FOR REPAIRS	513.04	220.41	0	40	773.45
52177	62803	05/17/2024	1HM368HBG	ID - TRUCK FLEET	186G	R	Sundries	1VT1086	4580.100 0	0	Suply mud gard pole		326.48	190.22	0	0	516.7
50783	61811	04/19/2024	1HM368HBG	ID - TRUCK FLEET	186G	R	Hydraulic	1VT1086	4580.100 0	0	Supply Slump Gauge.		125.08	139.27	0	0	264.35
50373	59753	04/11/2024	1HM368HBG	ID - TRUCK FLEET	186G	R	Tyres	1VT1086	0.0000	0	SUPPLY & FIT TYRE (1) - RUBAND		0	460	35	0	495

50132	59562	04/08/2024	1HM368HBG	ID - TRUCK FLEET	184G	R	Tyres	1VT1086	4580.100	0	0	LHR Flat tyre, Fit spare	INSPECTED L/H/R OUTER TYRE FLAT. MOVED TRUCK TO WORKSHOP, JACKED UP AND REMOVED WHEEL. FITTED SPARE TYRE AND TENTIONED.	93.28	0	0	5	98.28
45737	55420	01/29/2024	1HM368HBG	ID - TRUCK FLEET	184G	R	Sundries	1VT1086	4580.100	0	0	Pendant repairs @ LKW	FOLLOW UP NOTES: - REQUIRES RETENSIONS INSPECTED REAR PENDANT INOPERATIONAL: - REPLACED FAULTY SWITCH - TESTED, ALL OK	361.5	0	0	20	381.5
45744	55422	01/29/2024	1HM368HBG	ID - TRUCK FLEET	184G	R	Sundries	1VT1086	4580.100	0	0	Repair Drivers door / exhaust brake	WELDED UP BROKEN DOOR FRAME TO FIX CLOSING ISSUE. REPLACED FITTING IN EXHAUST BRAKE AND CUT BACK HOSE.	308	0	0	320	628
45342	62025	01/18/2024	1HM368HBG	ID - TRUCK FLEET	184G	R	Clutch	1VT1086	4580.100	0	0	Replace Clutch Slave Cylinder		572	279.96	0	35	886.96
44934	55344	01/09/2024	1HM368HBG	ID - TRUCK FLEET	184G	R	Sundries	1VT1086	4580.100	0	0	A/C Repairs, Supply and fit new belts - LKW	SOURCED AND FITTED NEW BELTS. CARRIED OUT A/C REPAIRS.	2439	769.91	0	90	3298.91
43881	52458	12/07/2023	1HM368HBG	ID - TRUCK FLEET	186G	R	Tyres	1VT1086	0.0000	61980	0	FIT R/OUT TYRE AND DISPOSAL X1		0	65	0	0	65
42451	52500	11/09/2023	1HM368HBG	ID - TRUCK FLEET	186G	S	Chassis	1VT1086	4580.100	61976	0	INSPECTION	CARRIED OUT INSPECTION AND SERVICE ON VEHICLE AS REQUIRED. REPAIRED ALL FAULTS IN THE LIST. FIXEDFLH WINDSHIELD. FIXED WIPER & WASHER MOTOR.	1614	3066.37	0	87	4767.37
36297	42160	07/10/2023	1HM368HBG	ID - TRUCK FLEET	184G	R	Sundries	1VT1086	4574.000	0	0	BRAKEDOWN	ATTENDED BREAKDOWN ON ROAD INTO COMPOUND FOUND VEHICLE OUT OF FUEL. BLED SYSTEM & RAN TRUCK - ALL OK PACKED UP & RETURNED TO SERVICE	88	0	0	40	128
35061	39878	06/19/2023	1HM368HBG	ID - TRUCK FLEET	184G	R	Tyres	1VT1086	4460.000	0	0	REPLACE LH INNER TYRE		128.45	0	0	30	158.45
31215	37675	04/20/2023	1HM368HBG	ID - TRUCK FLEET	184G	S	Service Transport B	1VT1086	4356.000	0	0	CARRY OUT B SERVICE AT LKW	TRAVEL TO LAKE KING WILLIAM - 60KM CARRIED OUT B-TYPE SERVICE TRUCK NEEDS: NEW EXHAUST PIPING NEW TORQUE ROD BUSHES	342.52	189.96	0	110	642.48
28336	34132	03/10/2023	1HM368HBG	ID - TRUCK FLEET	184G	R	Bodywork	1VT1086	4233.000	0	0	Replace Drivers Side Door Handle		214.08	202.26	0	85	501.34
23265	27356	11/30/2022	1HM368HBG	ID - TRUCK FLEET	186G	R	Tyres	1VT1086	0.0000	0	0	PUNCTURE REPAIRS X1		0	65	0	0	65
20933	26919	10/10/2022	1HM368HBG	ID - TRUCK FLEET	182G	INT-R	Lathe	1VT1086	0.0000	0	0	MACHINE NYLON SPACERS FOR SLACK ADJUSTERS	MACHINE NYLON SPACERS FOR SLACK ADJUSTERS	169.74	20	0	20	209.74
20554	23861	09/30/2022	1HM368HBG	ID - TRUCK FLEET	186G	R	Tyres	1VT1086	0.0000	59071	0	MICH XZY-3 STEER TYRES X2 + BAL X2 + DIS X2		41.39	1410	0	0	1451.39
20429	23417	09/28/2022	1HM368HBG	ID - TRUCK FLEET	186G	INT-S	Service Transport B	1VT1086	4022.000	59077	0	S1 B SERVICE	CARRY OUT B SERVICE NOTES: LOWER ROCKER COVER LEAK FROM REAR OF ENGINE X3 TORQUE RODS NEED REPLACING EXHAUST RUSTED AFTER MUFLER REAR SLACK ADJUSTERS SEIZED FRONT LOWER SHOCK BUSHES SPLIT A/C BELT MISSING FRONT TYRES LOW	177.3	163.02	0	15	355.32

20442	25044	09/28/2022	1HM368HBG	ID - TRUCK FLEET	186G	INT-R	Brake	1VT1086	15600.00 00	338000	REPLACE REAR SLACK ADJUSTERS AND BRAKE BOOSTERS	ATTENDED TO SEIZED SLACK ADJUSTERS CUT THE SLACK ADJUSTERS OFF THE BOOSTERS AND THE S CANS NEW SPACERS MADE REMOVED AND REPLACED BOOSTERS HAD NEW BRAKE HOSES MADE	1324.33	1945.65	48	60	3377.98
17992	21258	08/08/2022	1HM368HBG	ID - TRUCK FLEET	186G	INT-R	Electrical	1VT1086	3947.000 0	57967	REPAIR INDICATORS	INSPECT INOP L&RH DOOR INDICATORS INOP FOUND GLOBE TO BE BLOWN ON LH DOOR - REPLACED REMOVE DOOR CARD AND INSPECT WIRING HARNESS AND REMOVE FOUND BROKEN WIRES - REPAIRED AS REQUIRED AND REFIT TEST OPERATION ALL OK	372.47	91.87	0	20	484.34
16335	19868	07/01/2022	1HM368HBG	ID - TRUCK FLEET	186G	INT-R	Electrical	1VT1086	8500.000 0	404000	Repair indicator fault	REPLACE INDICATOR SWITCH TEST ALL OK	106.38	236.28	0	0	342.66
14478	17304	05/20/2022	1HM368HBG	ID - TRUCK FLEET	186G	S	Service Transport A	1VT1086	3753.000 0	55561	S1 A SERVICE	COMPLETED SERVICE AS PER SERVICE SHEET. REMOVED FRONT SHOCK ABSORBER SLEEVES AND SHORTENED ON LATHE TO TIGHTEN LOOSE RUBBERS. REMOVED LIVE DRIVE COVER HELD ON WITH WIRE TIES AND FABRICATED BOLT ON SETUP. MADE UP BRACKETS TO SUPPORT DAMAGED TO SUPPORT LHS STEER AXLE REAR GUARD. SWAPPED LOWER CAB ACCESS STEPS FROM LHS TO RHS TO STOP DRIVER SLIPPING ON WORN TREAD PLATE. ROTATED BOWL WITH WATER TO FLUSH OUT SUGAR USED TO STOP CONCRETE GOING OFF. RAISED TYRE PRESSURES TO CORRECT SPECS. REPLACED GEAR SHIFT BOOT. BUSHED WORN LINKS IN THE CHUTE JACK AND REPLACED OIL. NOTE. FOLLOW UP IS REQUIRED ON THE COOLING SYSTEM AT THE RADIATOR CAP HAS BEEN BYPASSED.	211.95	300.47	0	15	527.42
14371	17306	05/18/2022	1HM368HBG	ID - TRUCK FLEET	186G	R	Clutch	1VT1086	3752.000 0	55565	CLUTCH REPAIRS	REPLACE MISSING CLUTCH THROW OUT RETAINING CLIPS TRAVELED TO ROKEBY AND INSPECTED CLUTCH ISSSUE. FOUND THE THROW OUT BEARING RETAINING CLIPS HAD DISLODGED AND ALLOWED THE THROW OUT BEARING TO ROTATE. UNABLE TO STOP THE ENGINE AS THERE WAS STILL CONCRETE IN THE BOWL. PURCHASED SUGAR TO MIX WITH CONCRETE TO SLOW SETTING. VEHICLE WAS TOWED TO HAZELLBROS LA. ORDERED AND FITTED NEW CLIPS, ADJUSTED THE CLUTCH AND REFITTED THE DRIVE SHAFT. TEST DROVE .	358.98	83.37	625	15	1082.35
4511	5160	09/15/2021	1HM368HBG	ID - TRUCK FLEET	183G	S	Service Transport A	1VT1086	3643.000 0	0	SERVICE ON FLIDERS ISLAND	1VT1086 ISUZU TRUCK/ AGITATOR SERVICE AND SAFETY CHECK. REPLACE 2 X FUEL FILTERS AND BLEED. SERVICE AGITATOR.	0	906.5	0	0	906.5

210126-0003	SVC00252 677	02/09/2021	1H0368	IC-TRUCK FLEET	187_INT	R	Clutch	1VT1086	3469hr	Replace clutch	REPLACE CLUTCH	1695.46	2432.45	92	50	4269.91
											NEW BALL JOINTS ON TOP OF GEARBOX. REMOVED ALL PLUGS AND AIR LINES OFF GEARBOX AND MARKED THEM. UNBOLTED TAILSHAFT, REMOVED GEAR BOX. REMOVED CLUTCH OFF FLYWHEEL. CLEANED/WASHED FLYWHEEL. HAD FLYWHEEL MACHINED, INSTALLED NEW SPIGET BEARING. TORQUED FLYWHEEL ON, INSTALLED NEW CLUTCH FORK AND THROW OUT BEARING ON GEARBOX. BOLTED NEW CLUTCH BACK ON. REFIT GEARBOX, TIGHTENED ALL BOLTS. REFIT ALL PLUGS AND AIR LINES, BOLTED TAIL SHAFT BACK ON. TEST DRIVE - ADJUSTED CLUTCH. INSTALLED NEW SPRING ON CLUTCH SLAVE CYLINDER.					
200917-0060	SVC00252 624	09/30/2020	1H0368	IC-TRUCK FLEET	187_INT	S	Service	1VT1086	3332hr	S1C SERVICE	S1 C SERVICE - COACH AND TRUCK	333.7	1045.95	0	16.69	1396.34
											COMPLETE SERVICE AND SAFETY CHECKS AS PER REQUIRED SCHEDULE. GREASE ALL LUBRICATION POINTS. CHANGE ENGINE OIL AND FILTERS. CARRY OUT OIL SAMPLING(1) CHANGE AIR FILTERS. CHANGE FUEL FILTERS. CHECK ALL OTHER FLUID LEVELS.					
200703-0038	SVC00248 686	08/07/2020	1H0368	IC-TRUCK FLEET	187_INT	R	Electrical	1VT1086	3147HR	Fit isolator	FIT ISOLATOR	157.68	160	0	7.89	325.57
											FITTED ISOLATOR, MADE A PLATE AND NEW CABLES & NEW TERMINALS. FITTED TO ISOLATOR.					
200402-0001	SVC00244 884	05/15/2020	1H0368	IC-TRUCK FLEET	186_INT	R	Engine	1VT1086		AGITATOR ENGINE REVS FAULT	CHECKED FOR ENGINE NOT REVING UP FROM THE REAR. TRACED WIRING TO THE HINO SIDE. FOLLOW UP REQUIRED.	218.1	0	0	10.5	228.6
200429-0073	SVC00244 885	05/08/2020	1H0368	IC-TRUCK FLEET	187_INT	S	Service	1VT1086	3018HR	S1A SERVICE	S1 A SERVICE - COACH AND TRUCK	303.09	228.82	0	15.16	547.07
											COMPLETE SERVICE AND SAFETY CHECKS AS PER REQUIRED SCHEDULE. GREASE ALL LUBRICATION POINTS. CHANGE ENGINE OIL AND FILTER. CHECK ALL OTHER FLUID LEVELS. REPAIR/REPLACE U/S NUMBERPLATE LIGHT AND FUSES.					
200310-0029	SVC00242 302	03/19/2020	1H0368	IC-TRUCK FLEET	187_INT	R	Engine	1VT1086	2791hr	replace leaking radiator	REPLACE LEAKING RADIATOR	519.93	1028.02	0	26	1573.95
											COOLANT LEAK, TOP TANK LEAKING COOLANT. CRACKEC ALONG CRIMP					
											CALE 10/3/20 - RE-FIT REMOVED RADIATOR, FILL WITH COOLANT AND TEST DRIVE. CHECK FOR LEAKS - ALL OK					
200205-0024	SVC00240 400	02/28/2020	1H0368	IC-TRUCK FLEET	187_INT	R	Electrical	1VT1086	2655hr	Repair UHF fault	REPAIR UHF FAULT	327.15	119.38	248.5	16.36	711.39
											INSPECT UHF FAULT. FOUND COAX CABLE INTO ANTENNA U/S CORD HEAD OUT FAULT. REPLACE UNIT. SEND OLD UNIT FOR REPAIR, BLANKED OFF OLD UHF ANTENNAS.					

200206-0019	SVC00240-461	02/20/2020	1H0368	IC-TRUCK FLEET	187_INT	R	Air Con	1VT1086	2655hr	A/C REPAIR	A/C REPAIR	363.5	50	0	18.18	431.68
											CARRY OUT A/C TESTS, TIGHTEN BELTS, CHECK FOR POWER AT A/C COMPRESSOR, NO POWER FOUND. WHEN GIVEN POWER, COMPRESSOR WOULD NOT ENGAGE PROPERLY AND PRESSURES IN SYSTEM ROSE INDICATING BLOCKAGE. PARTS WILL BE ORDERED AND REPAIRS WILL BE DONE THEN. FOLLOWED UP - FOUND HIGH HEAT PRESSURE VAC SYSTEM RECOVER GAS, GASED UP UNTIL TEMP @ 11 DEGREES ON A 23 DEGREE DAY.					
200206-0020	SVC00240-462	02/20/2020	1H0368	IC-TRUCK FLEET	187_INT	S	Service	1VT1086	2655hr	S1B SERVICE	S1B SERVICE	145.4	186.86	0	7.27	339.53
											COMPLETE SERVICE AND SAFETY CHECKS AS PER REQUIRED SCHEDULE. GREASE ALL LUBRICATION POINTS. CHANGE ENGINE OIL AND FILTERS. CHANGE AIR FILTERS. CHANGE FUEL FILTERS. CHECK ALL OTHER FLUID LEVELS.					
190704-0028	SVC00228-975	02/07/2020	1H0368	IC-TRUCK FLEET	187_INT	R	Engine	1VT1086	24679km/1961hr	ECM Fault	ECM FAULT CHECKED INTERMITANT FAULT WITH ENGINE LOSING POWER WHEN AGI BOWL BEING USED CHECKED AND CLEANED EARTH POINTS ON VEHICLE FOR VEHICLE CONTROLS, CHECKED BATTERIE 1 X BATTERY POOR, CONNECTED HINO DIAGNOSTIC AND CHECK FAULT CODES FOUND FAULT CODE RELATING TO LOW POWER TO ELECTRONIC GOVENER ON FUEL PUMP CHECKED POWER SUPPLY, RELAYS. PLUGS AND WIRING, FOUND ROTATING BEACON & AFTERMARKET LOW OIL PRESSURE BUZZER WIRED INTO POWER SUPPLY FROM ENGINE ECU TO DIAGNOSTICE PLUG REMOVED BEACON AND BUZZER FROM DIAGNOSTIC CIRCUIT RAN NEW FUSE POWER TO ROTATING BEACON AND OIL BUZZER, REPAIRED WIRING TO DIAGNOSTIC PLUG CHECK POWER RELAYS AND FOUND EXCESSIVE VOLTAGE DROP OVER RELAYS, REPLACED RELAYS AND TEST OPERATION, CARRIED OUT BY FRM	1611.8	0	1725.84	50	3387.64
191105-0063	SVC00235-691	12/13/2019	1H0368	IC-TRUCK FLEET	187_INT	R	Suspension/UC	1VT1086	2304hr/29879km	REPLACE BROKEN SPRING RHSR	REPLACE BROKEN SPRING RHSR. RHS SPRING PACK BROKEN BOTTOM LEAF. REMOVE ALL ACCESSORIES AND SPRING. SEND FOR REPAIR. REINSTALL SPRING PACK, NEW U BOLT, GUARDS AND TYRES. TENSION WHEEL NUTS. ALL OK.	696.85	1150.6	0	34.85	1882.3
191105-0063	SVC00237-845	12/13/2019	1H0368	IC-TRUCK FLEET	187_INT	R	Suspension/UC	1VT1086	2304hr/29879km	REPLACE BROKEN SPRING RHSR	RE-OPENED TO ADD FREIGHT TO JOB	0	29.14	0	0	29.14
191105-0046	SVC00235-680	11/25/2019	1H0368	IC-TRUCK FLEET	187_INT	S	Service	1VT1086	2304hr/29879km	S1 A SERVICE	S1 A SERVICE	109.05	155.03	0	5.46	269.54
											COMPLETE SERVICE AND SAFETY CHECKS AS PER REQUIRED SCHEDULE. GREASE ALL LUBRICATION POINTS. CHANGE ENGINE OIL AND FILTER. CHANGE AIR FILTER. REPLACED AIR CLEANER. CHECK ALL OTHER FLUID LEVELS.					

191029-0051	SVC00235253	11/15/2019	1H0368	IC-TRUCK FLEET	187_INT	R	Engine	1VT1086	2284HR	FUEL LEAK INJECTOR LINES	REPAIR FUEL LEAKS ON INJECTOR LINES. FUEL LEAKING FROM TOP OF HEAD AROUND INJECTOR LINES. STEAM CLEAN ENGINE BAY & NO.4 INJECTECTOR LINE IS WHERE THE LEAK IS. REMOVE #4 INJECTOR LINE AND FIND CORRODED AND PITTED MARKS ON SEALING FLANGE. CLEAN ENDS UP AND REINSTALL. TEST DRIVE AND STILL FOUND TO BE LEAKING. REMOVE INJECTOR LINE AGAIN AND REPLACE WITH INJECTOR LINE FROM ANOTHER TRUCK. TEST DRIVE AND STILL LEAKING. REMOVE INJECTOR LINE, ROCKER COIVER AND #4 INJECTOR. REPLACE INJECTOR WITH ONE FROM ANOTHER TRUCK. REINSTALL ALL COMPONENTS & TEST DRIVE. ALL OK. REPLACE INJECTOR LINE AND INJECTOR FROM SPARE TRUCK WITH NEW COMPONENTS ONCE ARRIVED. TEST ALL OK.	1281.55	1168.83	0	50	2500.38
190913-0015	SVC00232866	10/21/2019	1H0368	IC-TRUCK FLEET	187_INT	R	Engine	1VT1086	3121hr	FUEL PUMP REPAIR	FUEL PUMP REPAIR. SWAP OUT FUEL PUMP TO DIAGNOSE FUEL FAULT. REMOVE INTAKE HOSES/PIPING, FUEL LINES TO PUMP. REMOVE ROCKER COVER AND ALIGN TIMING MARKS. REMOVE INJECTOR PUMP AND FIT REPLACEMENT. FINISH OFF INSTALL OF FUEL PUMP. TEST FUEL PUMP OFF 1VT876 WHICH IS ON 1VT1086 AND VICE VERSA.	1938.95	0	0	50	1988.95
190904-0015	SVC00232385	09/10/2019	1H0368	IC-TRUCK FLEET	187_INT	R	Tyres	1VT1086	04/09/19	11R22.5 TYRES	NEW TYRES SUPPLIED BY RUBAND.	0	1566	0	0	1566
190730-0015	SVC00230262	07/31/2019	1H0368	IC-TRUCK FLEET	187_INT	R	Electrical	1VT1086	1995HR	STARTING FAULT	STARTING FAULT. ATTEND BREAK DOWN AT BURNIE BATCH PLANT. JUMP START TRUCK. CHECK VOLTAGE. ALL OK. LOAD TEST BATTERIES. ONE BATTERY U/S. SOURCE BATTERY AND FIT NEW BATTERIES BACK AT WORK SHOP.	154.4	490.91	0	7.72	653.03
190701-0061	SVC00228736	07/19/2019	1H0368	IC-TRUCK FLEET	187_INT	R	Engine	1VT1086	1950hr	REPAIR ENGINE OIL LEAK	REPAIR ENGINE OIL LEAK DRAIN COOLANT FROM TRUCK. REMOVE COOLANT AND AIRLINES FROM COMPRESSOR. REMOVE HEAD OF COMPRESSOR AND REMOVE BLOCK. CLEAN ALL SURFACES. REPLACE GASKETS. RE-INSTALL ALL COMPONENTS. TEST ALL OK.	872.4	1132.23	0	43.62	2048.25
190710-0002	SVC00222890	07/19/2019	1H0368	IC-TRUCK FLEET	187_INT	R	Drive Line	1VT1086	24679km/1961hr	REPAIR TAIL SHART SLIPJOINT	REPAIR TAILSHAFT SLIPJOINT. MOVEMENT IN TAILSHAFT VIBRATION. CHECKED DRIVELINE AND FOUND FAULTY SLIP JOINT AND LOOSE YOKE NUT ON DIFF. REMOVE SHAFT. SUBLET REPAIR TO JAYBEN (INSTALLED NEW SLIP ASSY 1 UNI KIT AND BALANCE). TIGHTENED UP YOKE NUT AND REINSTALLED DRIVESHAFT WHEN RETURNED FROM REPAIR. GREASED.	260.65	16.77	2443.56	13.03	2734.01
190701-0101	SVC00222757	07/12/2019	1H0368	IC-TRUCK FLEET	187_INT	R	Suspension/UC	1VT1086	1961HR/24679KM	Suspension repair	SUSPENSION REPAIR. REMOVE REAR SUSPENSION TRAILING ARMS X4. REPLACE WORN BUSHES ON EACH END. REFIT RODS TO TRUCK. REPAIRD DAMAGED THREAD ON ONE BOLT. TENSION ALL BOLTS.	1074.15	540	0	50	1664.15

190626-0075	SVC00228 423	07/10/2019	1H0368	IC-TRUCK FLEET	187_INT	S	Service	1VT1086	1950hr	S1B SERVICE	S1 B SERVICE - COACH AND TRUCK	221.2	480.58	0	11	712.78
											COMPLETE SERVICE AND SAFETY CHECKS AS PER REQUIRED SCHEDULE. GREASE ALL LUBRICATION POINTS. CHANGE ENGINE OIL AND FILTERS.CHANGE AIR FILTERS. CHANGE FUEL FILTERS. CHECK ALL OTHER FLUID LEVELS. SUMPLUG THREAD PULLED FROM PLUG. REPLACED SUMP PLUG. REPLACE SPLIT ENGINE BREATHER WITH NEW HOSE. FOUND ALL TRACK ARM BUSHES U/S. TAIL SHAFT SLIP JOINT HAS MOVEMENT CAUSING A VIBRATION AT 60KM AND ABOVE. PARTS ORDERED AND NEW JOB OPENED.					
190529-0060	SVC00226 909	06/14/2019	1H0368	IC-TRUCK FLEET	187_INT	R	Electrical	1VT1086	1851hr	ACC THROTTLE FAULT	ACC THROTTLE FAULT	145.4	459.2	0	7.27	611.87
											DIAGNOSE FAULT WITH IDLE UP CONTROL. REMOVED AND REPLACED POTENTIOMETER AND SET MAX REVS AT 2000 ROM. TEST ALL OK.					
190521-0065	SVC00226 336	05/29/2019	1H0368	IC-TRUCK FLEET	187_INT	R	Sundries	1VT1086	1826 HRS/2280 7 KMS	REPAIRS	REPAIRS AS PER FAULT REPORT 50181 DATED 20.5.19	184.85	133	0	9.24	327.09
											REPLACED MISSING BOLTS FROM GUARD. INSTALL NEW CLIPS ON INDICATORS. REPAIR REAR TAIL LIGHTS AND CLIP INTO PLACE. REMOVE WATER TAP. ORDER NEW ONE AND INSTALL. (PARTS CHARGED ON 190515-0057)					
190325-0110	SVC00222 920	04/17/2019	1H0368	IC-TRUCK FLEET	187_INT	R	Sundries	1VT1086		RADIO ANTENNA	RADIO ANTENNA.	0	46.31	0	0	46.31
											SUPPLY PARTS ONLY.					
190314-0036	SVC00222 312	03/22/2019	1H0368	IC-TRUCK FLEET	187_INT	R	Engine	1VT1086	1648hr	ENGINE FAULT	ENGINE FAULT.	1368.8	428.91	0	50	1847.71
											REPAIR FUEL FAULT. DETERMINED FUEL SYSTEM WAS SUCKING AIR. DAMIAN REPLACED ALL FUEL LINES FROM TANK TO PUMP AND RETURN. REPLACED FUEL/WATER SEPERATOR FILTER AND BOWL. BLEED AIR OUT OF SYSTEM BY PRESSURISING SYSTEM. TAKE TRUCK FOR TEST DRIVE. ALL OK.					
190301-0025	SVC00221 702	03/12/2019	1H0368	IC-TRUCK FLEET	187_INT	R	Sundries	1VT1086	19533km/1632hr	fuel sender fault	FUEL SENDER FAULT.	72.7	224	0	3.64	300.34
											REMOVE FAULTY FUEL SENDER AND REPLACE WITH NEW ONE.					
190207-0051	SVC00220 089	02/21/2019	1H0368	IC-TRUCK FLEET	187_INT	S	Service	1VT1086	1544hr/18 354km	S1 A SERVICE	S1 A SERVICE	184.85	144.67	0	9.24	338.76
											COMPLETE SERVICE AND SAFETY CHECKS AS PER REQUIRED SCHEDULE. GREASE ALL LUBRICATION POINTS. CHANGE ENGINE OIL AND FILTER. CHANGE AIR FILTER. CHECK ALL OTHER FLUID LEVELS.					

190131-0076	SVC00219731	02/20/2019	1H0368	IC-TRUCK FLEET	187_INT	R	Electrical	1VT1086	1544hr/18354km	REPAIR REAR INDICATORS	REPAIR REAR INDICATORS. REAR INDICATORS NOT WORKING. REFER FAULT REPORT 50176. REMOVED OLD TAIL LIGHT ASSEMBLIES. DRILLED NEW HOLES IN BRACKETS FOR NEW TAIL LIGHT ASSEMBLIES. MOUNTED NEW LIGHTS. WIRED IN NEW TAIL LIGHTS. TESTED ALL OK.	357.85	252	0	17.89	627.74
190109-0087	SVC00218441	01/18/2019	1H0368	IC-TRUCK FLEET	187_INT	R	Clutch	1VT1086	17071km/1453hr	Clutch repair	CLUTCH REPAIR. CHECKED OVER SYSTEM & ADJUSTED FREE TRAVEL AND BLEED CLUTCH. REQUESTED DRIVER TO MONITOR AND ADVISE IF ANY FURTHER PROBLEMS. DRIVER RETURNED NEXT DAY AND REPORTED CLUTCH HAD LOST PEDAL AGAIN. PARTS ORDERED. REMOVED CLUTCH MASTER & SLAVE CYLINDERS. INSTALLED NEW ONES. FLUSHED OLD FLUID OUT OF SYSTEM. BLEED CLUTCH CIRCUIT AND TESTED OK.	545.25	530	0	27.26	1102.51
181123-0027	SVC00216027	11/29/2018	1H0368	IC-TRUCK FLEET	187_INT	R	Sundries	1VT1086	13275 HRS/15624 KMS	SEAT REPAIR & GUARD	SEAT REPAIR & GUARD. REMOVE DAMAGED BOLT. FIT PLATE WASHER INSIDE OF RAIL. FIT WASHER TO OUTSIDE POST & FIT NEW BOLT. REMOVED SEAT & CHECKED AIR BAG IN SEAT FOR LEAKS. ALL GOOD. FOUND TIGHT SWITCHED JAMMED WITH DIRT. CLEANED AND LUBED. RE-INSTALLED. TESTED OK. TO BE MONITORED.	330.25	83.11	0	16.51	429.87
181107-0076	SVC00215196	11/15/2018	1H0368	IC-TRUCK FLEET	187_INT	S	Service	1VT1086	1264HR	S1B SERVICE	CARRIED OUT THE REQUIRED SERVICE AND SAFETY INSPECTIONS AS PER SERVICE SHEET REPAIRED AN AIR LEAK AT THE BRAKE BOOSTER , LEFT HAND FRONT PARK LIGHT	260.65	182.14	0	20	462.79
181016-0065	SVC00213747	10/19/2018	1H0368	IC-TRUCK FLEET	187_INT	R	Tyres	1VT1086	11856 HRS 13109 KMS	Puncture repair	PUNCTURE REPAIR. SUBLET ONLY.	0	135	0	0	135
180723-0029	SVC00208729	07/31/2018	1H0368	IC-TRUCK FLEET	187_INT	R	Electrical	1VT1086	10120 hrs	REPAIR INDICATORS	REPAIR INDICATORS. DIAGNOSE FAULTY INDICATOR ASSEMBLY. SOURCE NEW ASSEMBLY LOCALLY AND INSTALL. TEST ALL GOOD.	218.1	129.14	0	10.91	358.15
180620-0046	SVC00206954	06/28/2018	1H0368	IC-TRUCK FLEET	187_INT	R	Electrical	1VT1086	95706 HRS	BOWL REV FAULT	BOWL REV FAULT. COMPLETE TESTS AGAIN ON HAND THROTTLE FAULT. SEEMS TO BE WIRING ISSUE WHERE WIRING ENTERS CABIN. RE-WIRE FROM FRONT OF CAB INTO ECM. TEST ALL OK.	290.8	0	0	14.54	305.34

180605-0026	SVC00206121	06/21/2018	1H0368	IC-TRUCK FLEET	187_INT	S	Service	1VT1086	10472 KMS/946 HRS	S1 B SERVICE	S1 B SERVICE COMPLETE SERVICE AND SAFETY CHECKS AS PER REQUIRED SCHEDULE. GREASE ALL LUBRICATION POINTS. CHANGE ENGINE OIL AND FILTERS. CARRY OUT OIL SAMPLING(1) CHANGE AIR FILTER. CHANGE FUEL FILTERS. CHECK ALL OTHER FLUID LEVELS.	392.43	217.34	0	19.62	629.39
180510-0068	SVC00204605	05/28/2018	1H0368	IC-TRUCK FLEET	187_INT	R	Electrical	1VT1086	920.9	THROTTLE FAULT	THROTTLE FAULT. COMPLETE TESTS ON HAND THROTTLE FAULT. INTERMITTENTLY WORKING. LOCATED LOOSE PLUG CONNECTION. REMOVE CLUTCH SLAVE AND FIT NEW REPLACEMENT. ADJUST AND TEST. ALL GOOD.	520.4	277.68	0	26.02	824.1
180507-0020	SVC00204337	05/18/2018	1H0368	IC-TRUCK FLEET	187_INT	R	Engine	1VT1086	9675 KMS/892 HRS	DIESEL LEAK	DIESEL LEAK INSPECTED FOR DIESEL LEAK. FOUND NO.6 INJECTOR LINE CRACKED. ORDERED NEW PART. INSTALLED CLEANED AND TESTED ALL OK.	142.7	345.4	0	7.14	495.24
180430-0132	SVC00204072	05/04/2018	1H0368	IC-TRUCK FLEET	187_INT	R	Sundries	1VT1086	884 HRS	REPLACE WIPER BLADES	REPLACE WIPER BLADES.	35.68	56	0	1.78	93.46
180320-0032	SVC00201878	03/23/2018	1H0368	IC-TRUCK FLEET	187_INT	R	Electrical	1VT1086	718 HRS/8401 KMS	STARTING FAULT	REMOVE AND REPLACE WIPER BLADES. STARTING FAULT. TRUCK WON'T START. TESTED BATTERY. NO VOLTS IN ONE, LOW VOLTS IN THE OTHER. JUMP START TRUCK. CHECKED CHARGE. ALL OK. REPLACED FAULTY BATTERIES. REPLACED BATTERY LINE CABLE.	160.7	414.96	0	8.04	583.7
180222-0084	SVC00200577	02/28/2018	1H0368	IC-TRUCK FLEET	187_INT	S	Service	1VT1086	627 HRS	S1 A SERVICE	S1 A SERVICE COMPLETE SERVICE AND SAFETY CHECKS AS PER REQUIRED SCHEDULE. CHANGE ENGINE OIL & FILTER. CARRY OUT OIL SAMPLING (1). CHANGED AIR FILTERS. TIGHTENED BELTS. GREASE ALL LUBRICATION POINTS. CHECK ALL OTHER FLUID LEVELS. GOOD VISUAL CHECK OVER UNIT.	142.7	196.73	0	7.14	346.57
180221-0049	SVC00200460	02/26/2018	1H0368	IC-TRUCK FLEET	187_INT	R	Brake	1VT1086	627 HRS	brake repair	BRAKE REPAIR. INVESTIGATE BRAKE LOW AIR FAULT. FOUND FAULTY PRESSURE SWITCH ON FRONT BRAKE AIR TANK. ORDERED NEW PART AND INSTALLED.	184.59	95.77	0	9.23	289.59
171211-0066	SVC00197199	12/15/2017	1H0368	IC-TRUCK FLEET	187_INT	R	Sundries	1VT1086	435 HRS/4913 KMS	REPAIR WIND DEFLECTOR	REPAIR WIND DEFLECTOR REMOVE TAPE FROM OLD WIND DEFLECTOR, GET NEW TAPE AND RE-INSTALL DEFLECTOR TO DOOR.	71.35	13.96	0	3.57	88.88
171113-0090	SVC00195716	11/17/2017	1H0368	IC-TRUCK FLEET	121_INT	R	Tyres	1VT1086		11R22.5 HN353 X 4 + ROTATE X 2	11R22.5 HN353 X 4 + ROTATE X 2 + DISPOSAL X 4 RUBAND 45713	0	1528	0	0	1528

171108-0029	SVC00195501	11/13/2017	1H0368	IC-TRUCK FLEET	184_INT	R	Electrical	1VT1086	3165	Repair starting fault	REPAIR STARTING FAULT, LOCATE FAULTY START ISOLATING SWITCH AND AND TRACK WIRING, RECONNECT ORIGNIAL START WIRING, INSULATE AND SECURE WIRING AND CHECK OPERATION. COMPLETED BY ST LEONARDS AUTO ELEC	0	0	106	0	106
171018-0040	SVC00194276	10/26/2017	1H0368	IC-TRUCK FLEET	187_INT	R	Suspension/UC	1VT1086	296 HRS	REPLACE FRONT SHOCK ABSORBERS	REPLACE FRONT SHOCK ABSORBERS. REMOVE BROKEN SHOCKIES. FIT UP NEW SHOCKIES FOR FRONT AXLE. REMOVE FAN HUB ASSEMBLY. REPLACE A/C V-BELT. FIT NEW BELT, ADJUST AND FIT FAN & HUB.	361.58	374.35	0	268.08	1004.01
171009-0100	SVC00193912	10/19/2017	1H0368	IC-TRUCK FLEET	187_INT	S	Service	1VT1086	16,296 HRS/3165 KMS	service s1b	SERVICE S1B COMPLETE SERVICE AND SAFETY CHECKS AS PER REQUIRED SCHEDULE. GREASE ALL LUBRICATION POINTS. CHANGE ENGINE OIL/FILTERS. CARRY OUT OIL SAMPLING. CHECK ALL OTHER FLUID LEVELS. GOOD VISUAL CHECK OVER UNIT.	361.58	156.46	0	143.08	661.12
170510-0062	SVC00186004	05/24/2017	1H0368	IC-TRUCK FLEET	181_INT	R	Bodywork	1VT1086	305,762 KM	PREP AND PAINT NEW REAR STEP S	PREP AND PAINT NEW REAR STEP SAFETY YELLOW	69.95	26.17	0	0	96.12
170513-0001	SVC00186216	05/16/2017	1H0368	IC-TRUCK FLEET	186_INT	S	Service	1VT1086	92 hrs	S1 PRE MAINTANCE INSPECTION	S1 PRE MAINTANCE INSPECTION. COMPLETED INSPECTION.	69.95	0	0	0	69.95
170327-0011	SVC00184042	05/09/2017	1H0368	IC-TRUCK FLEET	186_INT	R	Engine	1VT1086	305762 KMS	ENGINE OIL LEAK	ENGINE OIL LEAK. REMOVED ROCKER COVER AND INJECTOR PLATE. REPARED DAMAGED SECTION AT THE REAR OF THE INJECTOR PLATE. HAD TO FABRICATE PLATE TO HOLD GASKET IN PLACE. REASSEMBLED AND CHECKED FOR LEAKS.	664.05	375.43	0	33	1072.48
170330-0067	SVC00184184	05/09/2017	1H0368	IC-TRUCK FLEET	186_INT	R	Bodywork	1VT1086	305762 KMS	FIT UP NEW GAURDS	FIT UP NEW GAURDS. FITTED UP NEW GAURDS,POLES,BRACKETS,MUD FLAPS AND CLEARANCE SIGNS. GAURDS AND POLES ON PAINTING SERVICE CALL.	615.83	126.58	0	30	772.41
170404-0009	SVC00184665	04/28/2017	1H0368	IC-TRUCK FLEET	186_INT	R	Electrical	1VT1086	0	FIT UP REAR LIGHTS	Supply new rear lights on Hino. fit to truck & wire in. Fit new reverse buzzer & wire in. wire in number plate light. Fit deutsch plug. Check rad fan wiring and operation. not working. check fan - OK Quick connect plugs full of dirt and corrosion. Cut out and fit 2 pin deutsch plugs. Re-connect battery supply to fan relay, re-connect ignition supply. fit new test fan button. Check operation - OK Seal up box and put together.	769.45	381	0	35	1185.45
170306-0076	SVC00182987	04/26/2017	1H0368	IC-TRUCK FLEET	186_INT	R	Bodywork	1VT1086		REPLACE FUEL TANK	REPLACE FUEL TANK. DRAINED AND REMOVED RUSTED FUEL TANK. DRILLED NEW J BRACKETS TO SUIT HOLES IN THE CHASSIS. HAD TO DRILL EXTRA HOLES TO TO SUIT NEW J BRACKETS. FITTED TANK AND MIDIFIED FUEL GAUGE TO SUIT. CONNECTED SUPPLY AND RETURN FUEL HOSES AND BREATHER.TENSIONED STRAPS AND CLEANED OFF TANK. REFILLED WITH DIESEL.	573.34	3.37	0	1420.7	1997.41

170306-0076	SVC00185 204	04/26/2017	1H0368	IC-TRUCK FLEET	186_INT	R	Bodywork	1VT1086		REPLACE FUEL TANK	FREIGHT CHARGE FROM TAS FREIGHT SERVICES FOR FUEL TANK ON INVOICE SVC00182987	0	0	0	147.52	147.52
170406-0013	SVC00184 487	04/19/2017	1H0368	IC-TRUCK FLEET	182_INT	R	Lathe	1VT1086		MACHINE SHIMS & SPACERS	MACHINE SHIMS & SPACERS FOR LIVE DRIVE	139.9	0	0	7	146.9
170214-0057	SVC00182 811	03/31/2017	1H0368	IC-TRUCK FLEET	181_INT	R	Bodywork	1VT1086	305,762 KM 85HRS	PRESSURE WASH TRUCK CHASSIS TO	PRESSURE WASH TRUCK CHASSIS TO REMOVE GREASE AND DIRT ETC BEFORE BLASTING REMOVE EXCESS CONCRETE FROM CHASSIS BEFORE BLASTING SANDBLAST CHASSIS AND WHEELS REPAIR RUST IN REAR OF CAB REPAIR FRONT BUMPER AND APRON REPAIR REMAINDER OF CAB PREPARE AND RESPRAY EXTERIOR OF CAB HINO WHITE MARK OUT AND PAINT RED STRIPE ONTO CAB FIT CAB BACK UP ONCE PAINTED FIT NEW LHS WINDOW MOTOR PAINT CHASSIS BLACK REMOVE WHEELS AND PAINT SILVER FIT HAZELL DECALS AND UNIT NUMBERS	7674.34	1547.94	1030	210	10462.28
170320-0065	SVC00183 484	03/28/2017	1H0368	IC-TRUCK FLEET	186_INT	R	Electrical	1VT1086	305762km 85hrs	CHECK DASH CLUSTER	REPLACED FAULTY DASH CLUSTER.TACHO AND LOW AIR WARNING NOT WORKING ON ORIGINAL DASH.	139.9	1640	0	0	1779.9
170221-0036	SVC00182 988	03/22/2017	1H0368	IC-TRUCK FLEET	186_INT	R	Electrical	1VT1086	305762km 85hrs	Replace batteries	TRAVEL TO UNIT AT BRIDGEWATER, REPLACED 2 BATTERIES AND CLEANED BATTERY TERMINALS, TEST ALL OK.	174.88	0	0	0	174.88
170316-0038	SVC00183 378	03/22/2017	1H0368	IC-TRUCK FLEET	186_INT	R	Electrical	1VT1086	305762km 85hrs	Repair elec window	INSPECT PASSENGER ELECTRIC WINDOW PROBLEM, REMOVED DOOR TO ACCESS CAB WIRING, ALL OK, CHECKED DRIVERS SIDE WIRING AND FOUND 3 BROKEN WIRES, REMOVED DOOR TRIM AND UNPLUG HARNESS AND REMOVE, REPAIRED AND REFIT, REFIT DOOR TRIM, CHECKED ELEC WINDOW SWITCHES, PASSENGER SIDE OK BUT DRIVERS SIDE FAULTY, REMOVED AND REPLACED AS REQUIRED, TEST OPERATION OF BOTH WINDOWS ALL OK.	279.81	263.66	0	14	557.47
160826-0080	SVC00173 413	10/19/2016	1H0368	IC-TRUCK FLEET	186_INT	R	Electrical	1VT1086	305,711Kl ms 73 Hrs	CHECK FOR LOW AIR BUZZER NOT C	CHECK BUZZER O9PERATION, CEHCK PRESSURE SWITCHES AND WIRING TO DASH, REMOVED DASH CLUSTER AND LOCATED FAULT, FIT AFTERMARKET WARNING BUZZER AND TEST OPERATION ALL GOOD, REPLACED FAULTY REVERSE LIGHT GLOBE	1399.15	332.8	0	50	1781.95
160825-0025	SVC00173 333	08/29/2016	1H0368	IC-TRUCK FLEET	186_INT	S	Service	1VT1086	305711 kms 73 hrs	S1 A SERVICE		147	148.58	0	12	307.58
160729-0039	SVC00171 936	08/02/2016	1H0368	IC-TRUCK FLEET	121_INT	R	Tyres	1VT1086	305227	11R22.5 D928 X 1 + DISPOSAL	11R22.5 D928 X 1 + DISPOSAL	0	312	0	0	312
160602-0042	SVC00169 160	07/21/2016	1H0368	IC-TRUCK FLEET	186_INT	R	Sundries	1VT1086		RE TRIM SEAT-- PAUL BAKER	The seat was repaired by Paul Baker. The trade off was a vehicle service as he could repair the seat over night, re trim was not avaiable.	102.38	96.92	0	0	199.3
160427-0067	SVC00167 447	05/26/2016	1H0368	IC-TRUCK FLEET	186_INT	R		1VT1086	300758 KMS 9816 HRS	Brake light repairs	BRAKE LIGHT REPAIRS. MODIFIED THE GAURD OVER THE LIVE DRIVE SHAFT TO STOP THE REAR CABLES CATCHING. TRACED BRAKE LIGHT FAULT TO SWITCH.REMOVED BRAKE LIGHT SWITCH AND DISASSEMBLED.CLEANED,RETENSIONED CONTACTS, REASSEMBLED AND ADJUSTED.	102.38	0	0	5	107.38
160407-0045	SVC00167 116	05/04/2016	1H0368	IC-TRUCK FLEET	186_INT	R	Bodywork	1VT1086	299676km	REPLACE DOOR HINGE	REPLACE DOOR HINGE. REPLACED WORN RHS TO DOOR HINGE.	136.51	219.65	0	6.5	362.66

160404-0074	SVC00167115	05/03/2016	1H0368	IC-TRUCK FLEET	186_INT	R	Transmission	1VT1086	299676 KMS	Gear shift repairs	FIELD SERVICE ATTENDED GEAR SHIFT FAULT AT NEW NORFOLK, CARRY OUT TEMP REPAIR TO GET BACK TO WORKSHOP. DISASSEMBLED THE GEAR SHIFT, REPLACED WORN CENTRE BUSH AND MISSING SIDE BUSH. REMOVED CONSOLE AND FOUND MISSING PIN FROM CABLE BALL LOCK. REASSEMBLED AND TESTED.	480.38	66.7	0	24	571.08
160419-0027	SVC00167117	04/29/2016	1H0368	IC-TRUCK FLEET	186_INT	R	Clutch	1VT1086	9788 HRS	CHECK CLUTCH OPERATION	CHECK CLUTCH OPERATION. TRACED FAULT TO BROKEN CLUTCH THROW OUT BEARING RETAINING CLIPS. MANAGED TO BE ABLE TO FIT NEW CLIPS THROUGH THE CLUTCH ADJUSTING OPENING. CHECKED OPERATION AND ROAD TESTED.	273	42.28	0	0	315.28
160404-0091	SVC00165928	04/13/2016	1H0368	IC-TRUCK FLEET	186_INT	S	Service	1VT1086	2736H 299676KM	S1 B SERVICE	COMPLETED THE REQUIRED SERVICE AND SAFETY INSPECTIONS AS PER SERVICE SCHEDULE	220.5	212.64	0	15	448.14
160405-0024	SVC00166310	04/13/2016	1H0368	IC-TRUCK FLEET	186_INT	R	Bodywork	1VT1086		REPLACE DAMAGED GAURD	REMOVE AND REPLACED THE DAMAGED GUARD AS REQUIRED	178.5	54.83	0	8.5	241.83
160405-0025	SVC00166309	04/13/2016	1H0368	IC-TRUCK FLEET	186_INT	R	Electrical	1VT1086		Reverse light repairs	REPLACED THE REVERSE BUZZER AND WORK LIGHT AS REQUIRED	102.38	70.75	0	0	173.13
160406-0058	SVC00166315	04/13/2016	1H0368	IC-TRUCK FLEET	186_INT	R	Clutch	1VT1086	299683KM 9739H	REPLACE CLUTCH MASTER CYLINDER	REMOVE AND REPLACED FAILED CLUTCH MASTER CYLINDER AS REQUIRED	204.76	168.33	0	10	383.09
160309-0006	SVC00164807	03/09/2016	1H0368	IC-TRUCK FLEET	121_INT	R	Tyres	1VT1086	297885	CALLOUT FIT COP + DISPOSAL	CALLOUT FIT COP + DISPOSAL CARRIED OUT BY RUBAND	0	122	0	0	122
160120-0004	SVC00162920	02/04/2016	1H0368	IC-TRUCK FLEET	186_INT	R	Sundries	1VT1086		REPAIR AS PER FAULT LIST	INSPECT CLUTCH AND ADJUST FREE TRAVEL, CHECK PARK BRAKE NOT COMING ON, CHECK RELAY VALVE AND CONTROL VALVE, CLEANED AND TEST, ORDER AND FIT NEW PARK BRAKE VALVE AS REQUIRED	238.88	963.92	0	12	1214.8
160121-0008	SVC00162929	02/04/2016	1H0368	IC-TRUCK FLEET	186_INT	R	Engine	1VT1086		change coolant	REMOVED AND REPLACED COOLANT AS REQUIRED	68.25	156.2	0	0	224.45
151014-0070	SVC00158396	12/21/2015	1H0368	IC-TRUCK FLEET	186_INT	R	Engine	1VT1086	9353 hrs 291810 kms	CHECK FOR DIESEL IN OIL	Checked for fuel in engine oil. Removed rocker covers and inspected. Checked the injector bleed off pipe. Resealed and reassembled all ok.	614.26	115.81	50	30	810.07
150817-0004	SVC00155982	10/15/2015	1H0368	IC-TRUCK FLEET	186_INT	R	Engine	1VT1086	9249 HRS 290485 KMS	CRACKED BLOCK REPAIRS	CRACKED BLOCK REPAIRS. SOURCED SECOND HAND BLOCK, THE ONLY ONE AVAILABLE OR THAT COULD BE FOUND WAS IN QUEENSLAND THIS WAS PRESSURE TESTED AND CRACK TESTED PRIOR TO PURCHASE. SWAPPED OVER ENGINE INTERNALS FROM CRACKED BLOCK. COMPLETED REASSEMBLY AND FITTED ENGINE TO VEHICLE. TEST DROVE. OK. NOTE. ENGINE ONLY HAD WATER IN IT AND THE VEHICLE NEEDS A COMPLETE ROAD WORTHINESS INSPECTION BECAUSE OF A NEW ENGINE NUMBER.	2968.9	1033.92	0	3225	7227.82

150619-0012	SVC00152162	10/14/2015	1H0368	IC-TRUCK FLEET	186_INT	R	Engine	1VT1086	290416 KMS 9245 HRS	ENGINE REPAIRS/REBUILD	ENGINE REPAIRS/REBUILD, DUE TO ENGIONE OVER HEAT. CHECKED ENGINE NOT STARTING. REPLACED DAMAGED TURBO. STARTED ENGINE FOUND RUNNING ROUGH AND BLOWING SMOKE.REMOVED HEAD AND FOUND PISTONS HAD PICKED UP ON THE BORE.REMOVED THE ENGINE AND DISASSEMBLED.REPLACE HEAD AS TO WAS BENT .014".ORDERED NEW HEAD AND ASSEMBLED.REBUILT NEGINE AND REFITTED TO THE VEHICLE.TEST DROVE,FOUND COOLANT LEAKING INTO THE SUMP.PRESSURE TESTED AND FOUND COOLANT LEAKING BEHINE THE LINER,REMOVED AND DISASSEMBLED. FOUND CRACKS ON FOUR BORES WHEN LINERS WERE REMOVED.	4874.66	13892.05	2461.89	0	21228.6
150622-0007	SVC00154504	08/21/2015	1H0368	IC-TRUCK FLEET	186_INT	R	Electrical	1VT1086	290416 KMS	REPLACE DAMAGED REVOLVING LIGH	REPLACE DAMAGED REVOLVING LIGH. REPLACED DAMAGED REVOLVING LIGHT AND REPAIRED FAULT WITH BRAKE LIGHTS.	204.75	105	0	0	309.75
150619-0025	SVC00154503	08/17/2015	1H0368	IC-TRUCK FLEET	186_INT	S	Service	1VT1086	290416 KMS 9246 HRS	S1 A SERVICE	COMPLETED THE REQUIRED SERVICE AND SAFETY CHECKS AS PER SERVICE SCHEDULE	102.38	116.89	0	10	229.27
150807-0043	SVC00155079	08/17/2015	1H0368	IC-TRUCK FLEET	186_INT	R	Clutch	1VT1086		Replace clutch	REPLACE CLUTCH. REPLACED CLUTCH PLATE ONLY. CENTRE ON THE ORIGINAL ONE WAS VEY WORN.	102.38	379.08	0	5	486.46
150723-0037	SVC00153928	07/30/2015	1H0368	IC-TRUCK FLEET	182_INT	R	Milling	1VT1086		DRILL & TAP & HELICOIL BELL HS	DRILL & TAP & HELICOIL BELL HSG	136.5	0	0	0	136.5
150619-0001	SVC00152109	06/24/2015	1H0368	IC-TRUCK FLEET	184_INT	R	Engine	1VT1086	290416 KLMS 9245 HRS	INSPECT ENGINE / TURBO FAULT	TRAVELED TO LAWITTA TO HOOK UP AND TOW BACK TO LAMPTON AVE	680.41	18.15	0	144	842.56
150525-0087	SVC00151158	05/28/2015	1H0368	IC-TRUCK FLEET	186_INT	R	Electrical	1VT1086	288,272 Klms 9,139 Hrs	CHECK ENGINE WONT REV AT TIMES	CHECK ENGINE REVS ON CONTROL CABLE, LUBRICATED ALL MOVING PARTS, DISCONNECT NETURAL SWITCH, BY PASS AND CHECK REVE SEVERAL TIMES ALL GOOD, ORDER A REPLACEMENT SWITCH TO BE FITTED AT A LATTER DATE	102.38	247.54	0	5	354.92
150320-0039	SVC00147797	03/27/2015	1H0368	IC-TRUCK FLEET	186_INT	R	Transmissi on	1VT1086	8873 HRS 283715 KMS	ENGINE SPEED SENSOR	REPLACED FAULTY SPEED SENSOR ON THE GEARBOX AND TEST DROVE.	102.38	190.96	0	5	298.34
150217-0073	SVC00146170	03/17/2015	1H0368	IC-TRUCK FLEET	186_INT	R	Transmissi on	1VT1086	282098 KMS 8803 HRS	GEARBOX REPAIRS	Failed transmission. Removed the gear box from the truck. Disassembled and repaired transmission. Cleaned all parts and inspected, ordered the required parts and reassembled the transmission. Fitted all parts and the new bearing kit, installed the new drive gear. Installed the rebuilt transmission into the truck.	3460.82	4658.92	0	0	8119.74
150312-0005	SVC00147042	03/16/2015	1H0368	IC-TRUCK FLEET	186_INT	R	Engine	1VT1086		BLEED UP FUEL SYSTEM	BLEED UP FUEL SYSTEM. CHECK NOT STARTING ISSUE.FOUND THE VEHICLE HAD RAN OUT OF FUEL. FILLED 20 LITRE DRUMS WITH FUEL AND DECANTED INTO THE FUEL TANK. PRIMED THE SYSTEM, BLED THE SYSTEM AND CHECKED FOR LEAKS.	68.25	0	0	25	93.25
150217-0045	SVC00146172	03/03/2015	1H0368	IC-TRUCK FLEET	186_INT	R	Engine	1VT1086	8803 HRS	Radiator repairs	RADIATOR REPAIRS. REMOVED RADIATOR FOR REPAIRS,DELIVERED TO NEW NORFOLK FOR REPAIRS, RETURNED AND REFITTED.TOPPED UP THE COOLANT.	307.14	32.21	140	15	494.35
150225-0011	SVC00146471	03/03/2015	1H0368	IC-TRUCK FLEET	186_INT	R	Engine	1VT1086	8803H	FABRICATE AND FIT EXH CLAMP	FABRICATE AND FIT EXH CLAMP. CUT STAINLESS PLATE AND SHAPED TO SUIT MISSING EXHAUST BRACKET.FITTED AND TIGHTENED BOLTS.	102.38	0	0	5	107.38

150216-0020	SVC00145 905	02/24/2015	1H0368	IC-TRUCK FLEET	186_INT	S	Service	1VT1086	8802H 282098KM	S1 C SERVICE	COMPLETED SERVICE AND SAFETY CHECKS AS PER SERVICE SCHEDULE	273	325.63	0	17.5	616.13
150217-0068	SVC00145 908	02/20/2015	1H0368	IC-TRUCK FLEET	186_INT	R	Electrical	1VT1086	8802 HRS 282098	REPAIR REVERSE LIGHTS	REPAIR REVERSE LIGHTS. REPAIRED BROKEN WIRE AT THE GEARBOX AND THE REVERSE BUZZER.	68.25	0	0	0	68.25
150212-0086	SVC00145 675	02/18/2015	1H0368	IC-TRUCK FLEET	186_INT	R	Engine	1VT1086	281975 kms	OIL LEAK	OIL LEAK. CLEANED OIL FROM VEHICLE AND CHECKED FOR OIL LEAKS.TOPPED UP COOLANT AS THE LOW LEVEL LIGHT WAS ON. VEHICLE HAD NO SPEEDO, TRACED FAULT TO DRIVE PIN INSIDE SPEEDO HEAD HAD VIBRATED LOOSE. CHECKED LEAK AND FOUND GEARBOX OUT PUT FLANGE LOOSE. REMOVED THE DRIVE SHAFT AND TIGHTENED THE NUT. CHECKED OIL LEVEL. OIL WAS BLACK SO DRAINED OIL AND REFILLED. NOTE THE WAS AN HIGH METAL BUILD UP ON THE DIFF LEVEL AND DRAIN PLUG. GEAR BOX WILL NEED REBUILDING.	341.25	76.29	0	17	434.54
141211-0021	SVC00143 429	02/16/2015	1H0368	IC-TRUCK FLEET	186_INT	R	Sundries	1VT1086		REBUILD LIVE DRIVE TOR BE FITT	REBUILD LIVE DRIVE . REMOVED THE LIVE DRIVE AND REPLACED BEARINGS AND SEAL. MACHINED NEW SPACER TO SET UP BEARINGS AND ZERO END FLOAT. REFITTED THE LIVE DRIVE AND RECONNECTED THE DRIVE SHAFT.	307.13	0	0	15	322.13
150105-0086	SVC00143 637	01/07/2015	1H0368	IC-TRUCK FLEET	121ADMIN	R	Tyres	1VT1086	279148	MICHELIN XYZ-3 11R22.5 X 2 + B	MICHELIN XYZ-3 11R22.5 X 2 + BALANCE POWDER X 2 + DISPOSAL X 2 RUBAND 11297	0	1274	0	0	1274
141202-0039	SVC00142 235	12/04/2014	1H0368	IC-TRUCK FLEET	186_INT	S	Service	1VT1086	8562 hrs 277375 kms	S1 B SERVICE	S1 B SERVICE. COMPLETED SERVICE AS PER SERRVICE SHEET .REPLACED BLOWN LIGH GLOBE. NOTE. LIVE DRIVE NEEDS BEARINGS REPLACED AND THE REAR TORQUE ROD BUSHES NEED REPLACING.	204.75	222.01	0	13.5	440.26
141202-0062	SVC00142 209	12/04/2014	1H0368	IC-TRUCK FLEET	186_INT	R	Clutch	1VT1086	8562 hrs 277375 kms	CLUTCH REPAIRS	CLUTCH REPAIRS. FREED UP CLUTCH ADJUSTMENT ROD AND ADJUSTED THE CLUTCH FREE TRAVEL.	68.25	0	0	0	68.25
141202-0063	SVC00142 255	12/04/2014	1H0368	IC-TRUCK FLEET	186_INT	R	Bodywork	1VT1086	8562 hrs 277375 kms	TIGHTEN LOOSE GAURD POLES	TIGHTEN LOOSE GAURD POLES. REPLACED ONE GAURD WITH GOOD SECOND HAND GAURD FORM THE BARN.STRAIGHTENED AND TIGHTENED LOOSE GAURD POLES.	233.63	0	0	11	244.63
140624-0043	SVC00132 990	07/07/2014	1H0368	IC-TRUCK FLEET	186_INT	R	Engine	1VT1086		SUPPLY LOCKABLE FUEL CAP	SUPPLY LOCABLE FUEL CAP AS REQUIRED	0	148.72	0	0	148.72
140617-0040	SVC00133 046	06/25/2014	1H0368	IC-TRUCK FLEET	186_INT	R	Electrical	1VT1086	264490KM 7848HOURS	Heater repairs	HEATER REPAIRS. CHECKED SWITCHES AND FAN OPERATION .FOUND POWER TO FAN BUT FAN NOT OPERATING. ORDERED NEW FAN, DISMANTLED THE DASH AND REPLACED THE FAN ASSEMBLY. REASSEMBLED UNIT AND TEST OPERATION ALL GOOD	249.38	509.79	0	9.5	768.67
140528-0010	SVC00131 568	05/28/2014	1H0368	IC-TRUCK FLEET	181_INT	R	Bodywork	1VT1086		SUPPLY SILVER PAINT FOR DRIVER	SUPPLY SILVER PAINT FOR DRIVER SO AS HE CAN PAINT WHEELS	0	14.84	0	4.5	19.34
140515-0060	SVC00130 889	05/22/2014	1H0368	IC-TRUCK FLEET	121ADMIN	R	Tyres	1VT1086	261,428	W/POWER HN357 11R X4 + DISPOSAL	W/POWER HN357 11R X4 + DISPOSALS RUBAND DD 07733	0	1384	0	0	1384
140318-0018	SVC00127 810	03/24/2014	1H0368	IC-TRUCK FLEET	186_INT	A	Electrical	1VT1086	257379 kms 7454 hrs	REPAIR DAMAGED NUMBER PLATE LI	REPAIR DAMAGED NUMBER PLATE LIGHT. REPLACED NUMBER PLATE LIGHT,REVERSE BUZZER AND LIGHT AND WORN CLEARANCE SIGNS.	147.5	123.67	0	7	278.17

140318-0019	SVC00127 838	03/24/2014	1H0368	IC-TRUCK FLEET	186_INT	R	Clutch	1VT1086	257379 kms 7454 hrs	CHECK CLUTCH OPERATION	CHECK CLUTCH OPERATION. CHECKED CLUTCH OPERATION AND COULD NOT EXTERNAILLY FAULT THE OPERATION.. REMOVED THE GEARBOX AND CLUTCH ASSEMBLY AND FITTED UP AN ORGANIC TYPE CLUTCH WHICH WILL GIVE A SOFTER OPERATION. REFITTED THE GEARBOX AND TEST DRIVE.	910	937.14	0	45	1892.14
140318-0024	SVC00127 837	03/24/2014	1H0368	IC-TRUCK FLEET	186_INT	S	Service	1VT1086	7454 hrs 257379 kms	S1 B SERVICE	S1 B SERVICE. COMPLETED SERVICE AS PER SERVICE SHEET. TOPPED UP COOLANT AND REPAIRED AIR LEAK.	245	176.44	0	13	434.44
140211-0105	SVC00125 781	02/18/2014	1H0368	IC-TRUCK FLEET	186_INT	R	Engine	1VT1086	7362 HRS 255730 KMS	top up coolant	TOP UP COOLANT. CHECKED BUZZER AND FOUND LOW COOLANT.TOPPED UP COOLANT AND CHECKED FOR LEAKS.	48.75	32.15	0	0	80.9
140117-0015	SVC00124 257	02/14/2014	1H0368	IC-TRUCK FLEET	186_INT	R	Engine	1VT1086	7284 HRS	CHECK OUT COOLANT LEAK	CHECK OUT COOLANT LEAK. TOPPED UP THE COOLANT AND CHECKED FOR COOLANT LEAKS.	65	0	0	3	68
140117-0011	SVC00124 236	01/20/2014	1H0368	IC-TRUCK FLEET	186_INT	R	Clutch	1VT1086	7284HRS	ADJUST CLUTCH	ADJUST CLUTCH FREE TRAVEL AND TEST DRIVE	65	8.82	0	0	73.82
140117-0026	SVC00124 235	01/20/2014	1H0368	IC-TRUCK FLEET	186_INT	R	Engine	1VT1086	7284HRS	REPAIR OIL LEAK AT TURBO	LOCATE OIL LEAK ON RIGHT HAND SIDE OF ENGINE ,FITTED NEW ORING TO TURBO OIL FEED LINE AND WASH OFF ENGINE RUN AND TEST FOR LEAKS ALL GOOD	65	12	0	3	80
131203-0024	SVC00123 509	12/31/2013	1H0368	IC-TRUCK FLEET	186_INT	R	Sundries	1VT1086	7127HRS 251647KM S	TEMP REPAIR LEAKING FUEL TANK	Drain fuel tank and removed fuel tank from truck, Flush out tank with steam cleaner .Had tank repaired by welders .	260	13.24	0	13	286.24
131205-0013	SVC00122 375	12/12/2013	1H0368	IC-TRUCK FLEET	182_INT	R	Sundries	1VT1086		CLEAN OUT FUEL TANK & WELD UP	CLEAN OUT FUEL TANK & WELD UP AS REQUIRED.	130	0	0	6.5	136.5
131031-0080	SVC00120 391	11/13/2013	1H0368	IC-TRUCK FLEET	186_INT	R	Engine	1VT1086	7084 HRS 251043 KMS	REMOVE HEAD AND REPAIR	REMOVE HEAD AND REPAIR. REMOVED THE ROCKER COVER AND PRESSURE TESTED THE CYLINDERS.FOUND 4,5 AND 6 LEAKING GAS INTO THE COOLING SYSTEM. REMOVED THE HEAD AND HAD CRACK TESTED,INJECTOR SLEEVES REPLACED AND SURFACED. REASSEMBLED THE ENGINE,HELLI COILED ROCKER COVER THREADS AND FILLED ENGINE WITH WATER. REPLACED THE ENGINE OIL AND TEST DROVE TO CHECK OPERATION. NOTE,ENGINE WILL NEED WATER DRAINING AND REPLACED WITH COOLAND SOON.	1267.5	2044.72	430	50	3792.22
131029-0005	SVC00120 171	10/31/2013	1H0368	IC-TRUCK FLEET	186_INT	R	Brake	1VT1086	250812 KMS 7076 HRS	check park brake operation	CHECK PARK BRAKE OPERATION. CHECKED EXHAUST ON THE PARK BRAKE LEVER AND RELAY VALVE.CLEANED OUT EXHAUST ON THE RELAY VALVE AND RECHECKED.	65	0	0	0	65
131029-0006	SVC00120 172	10/31/2013	1H0368	IC-TRUCK FLEET	186_INT	R	Engine	1VT1086	250812 KMS 7076 HRS	CHECK INJECTOR SLEEVES	CHECK INJECTOR SLEEVES. REMOVED ALL INJECTORS AND RESEATED THE INJECTOR SLEEVES USING CORRECT TOOL. REFITTED THE INJECTORS,CLEANED THE HEADER TANK AND CHECKED FOR AIR IN THE SYSTEM.	195	3.59	0	9.5	208.09
131011-0028	SVC00119 289	10/15/2013	1H0368	IC-TRUCK FLEET	186_INT	R	Engine	1VT1086	7046 hrs 250165 kms	REPLACE THERMOSTAT	Test drove and checked temperatures.Removed the thermostat and checked in boiling water. was only opening fractionally. Ordered new thermostat and fitted.	227.5	122.72	0	11	361.22
130925-0020	SVC00118 116	10/03/2013	1H0368	IC-TRUCK FLEET	121ADMIN	R	Tyres	1VT1086	249,342	RUBAND W/POWER 11R22.5 HN357 X	RUBAND W/POWER 11R22.5 HN357 X 4 + DISPOSAL X 3 DD 04117	0	1316	0	0	1316
130916-0121	SVC00117 980	09/24/2013	1H0368	IC-TRUCK FLEET	186_INT	R	Bodywork	1VT1086		SEAT REPAIRS	SEAT REPAIRS. Unlocked the seat and checked operation. Removed the seat and fitted new shock absorber. Checked operation.	162.5	264	0	8	434.5

130916-0127	SVC00117 367	09/17/2013	1H0368	IC-TRUCK FLEET	186_INT	R	Electrical	1VT1086	249175 kms 6990 hrs	REPAIR REVERSE LIGHT,BUZZER	REPAIR REVERSE LIGHT,BUZZER. Replaced missing light globe in reverse light,cleaned up eaths and replaced faulty reverse alarm.	65	50.81	0	0	115.81
130916-0135	SVC00117 369	09/17/2013	1H0368	IC-TRUCK FLEET	186_INT	R	Electrical	1VT1086	249175 kms 6990 hrs	FUEL GAUGE REAPIRS	FUEL GAUGE REAPIRS. Removed damaged weather pack plug and hard wired fuel gauge.	32.5	0	0	0	32.5
130904-0037	SVC00117 026	09/11/2013	1H0368	IC-TRUCK FLEET	186_INT	R	Engine	1VT1086	6940 HRS 248403 KMS	CHECK FOR LOW COOLANT FAULT	CHECK FOR LOW COOLANT FAULT. CHECKED LEVEL IN HEADER TANK AND RADIATOR. REPLACED CLAMP ON HEADER TANK . INSPECTED HOSE FROM THE HEADER TANK TO THE RADIATOR NECK,CHECKED THE CAP AND PRESSURE TESTED THE SYSETM.NO LEAKS FOUND. TOPPED UP THE COOLANT.	100	14.78	0	0	114.78
130805-0041	SVC00114 724	08/15/2013	1H0368	IC-TRUCK FLEET	182_INT	F	Sundries	1VT1086		FIT UP TOW LUG AS REQUIRED	FIT UP TOW LUG AS REQUIRED	72.5	0	0	0	72.5
130802-0013	SVC00114 679	08/05/2013	1H0368	IC-TRUCK FLEET	186_INT	R	Drive Line	1VT1086	6864 hrs 246546 kms	CHECK DRIVE LINE NOISE	CHECK DRIVE LINE NOISE. Checked both drive shafts and slip joints.Checked cab mounts and engine mounts.Adjusted the clutch and returned to the yard.	32.5	0	0	0	32.5
130722-0042	SVC00113 895	07/29/2013	1H0368	IC-TRUCK FLEET	186_INT	S	Service	1VT1086	6837 hrs 246135 kms	S1 B SERVICE	S1 B SERVICE. Completed service as per service sheet. Refittted gear box boot.	520	146.47	0	28.5	694.97
130722-0056	SVC00113 898	07/29/2013	1H0368	IC-TRUCK FLEET	186_INT	R	Electrical	1VT1086	6837 hrs 246135 kms	REPAIR BATTERY LEAD	REPAIRED BATTERY LEAD, REPLACED TERMINAL AND CLEANED UP BATTERY AS REQUIRED	65	0	0	3	68
130412-0046	SVC00108 590	04/19/2013	1H0368	IC-TRUCK FLEET	186_INT	R	Bodywork	1VT1086	6424 hrs 239024 kms	Repairs as per defect list	REPAIRS AS PER DEFECT LIST. Replaced drivers side seat belt. Replaced deliniated and clearance signs.Replaced numberplates and number plate light.	267.5	569.3	0	0	836.8
130402-0049	SVC00108 285	04/17/2013	1H0368	IC-TRUCK FLEET	186_INT	R	Bodywork	1VT1086	6424 hrs	SEAT REPAIRS	SEAT REPAIRS. Disassembled seat, found base U/S.found second hand base and fitted new rollers (ex stock).Machined new bushes and reassembled.Checked operation OK.	422.5	21	0	0	443.5
130328-0085	SVC00107 944	04/12/2013	1H0368	IC-TRUCK FLEET	186_INT	S	Service	1VT1086	6364 hrs 237792 kms	S1 B SERVICE	S1 B SERVICE. Completed service as per service sheet. Note,torque bushes worn, and drag link needs replacing.	230	172.85	0	3.5	406.35
130124-0063	SVC00104 546	02/28/2013	1H0368	IC-TRUCK FLEET	184_INT	S	Service	1VT1086	6085 HRS 232054 KLMS	S1 B SERVICE	CARRYOUT B SERVICE. CHANGE ENGINE OIL, GREASE, FILTERS, CHECK FLUIDS, LIGHTS, BELTS, BATTERY ITEMS, STRAIGHTEN AND RETENSION REAR LH GUARD FIXTURES.	65	0	544.35	0	609.35
130124-0064	SVC00105 543	02/28/2013	1H0368	IC-TRUCK FLEET	184_INT	R	Electrical	1VT1086	6085 HRS 232054 KLMS	REPAIR AIR CON & LIGHTS	REPAIR AIRCON AND NUMBER PLATE LIGHT. WORK COMPLETED BY CJD EQUIPMENT	32.5	0	158.13	0	190.63
130123-0009	SVC00103 925	02/05/2013	1H0368	IC-TRUCK FLEET	186_INT	R	Tyres	1VT1086		PUNCTURE REPAIR X2 RUBAND D/D	PUNCTURE REPAIR X2 RUBAND D/D 73083	0	80	0	0	80
121213-0014	SVC00102 454	12/20/2012	1H0368	IC-TRUCK FLEET	184_INT	R	Sundries	1VT1086	229440 KLMS 5944 HRS	CHECK SEAT SUSPENSION FAULT	CHECK SEAT SHOCKER OPERATION. REMOVE SEAT BASE AND CHECK SEAT SHOCKER AND SCISSOR ACTION. FOUND SHOCKY OK, SCISSOR WORN SLIGHTLY. WORK CARRIED OUT BY CJD EQUIPMENT.	32.5	0	102	0	134.5
121112-0052	SVC00100 642	11/26/2012	1H0368	IC-TRUCK FLEET	184_INT	R	Brake	1VT1086	228796	ADJUST UP BRAKES	TRAVELLED TO MUSSELROE. ADJUSTED BRAKES AND GREASE UNIT.	175	10	0	24	209
121112-0040	SVC00100 320	11/19/2012	1H0368	IC-TRUCK FLEET	184_INT	R	Tyres	1VT1086	NOT SUPPLIED	CHANGE OUT FLAT TYRE	TRAVELLED TO MUSSELROE. CHANGE FLAT TYRE AS REQUESTED.	116	10	0	28.8	154.8
121101-0053	SVC00099 806	11/14/2012	1H0368	IC-TRUCK FLEET	184_INT	R	Sundries	1VT1086	5861 HRS	REPLACE LOST FUEL CAP	PICK UP NEW FUEL CAP AND TRAVELLED TO MUSSELROE BAY AND FIT TO UNIT AS REQUIRED.	75	106.52	0	24	205.52

120913-0071	SVC00096 951	10/02/2012	1H0368	IC-TRUCK FLEET	186_INT	R	Sundries	1VT1086		Repairs as per list	REPAIRS AS PER LIST. Replaced number plate light and deliniated line at the rear of the vehicle. Replaced missing bolts on the rear gaurds. Tightened loose radiator hose clamps after pressure testing. Cleaned viscous hub reaction spring. Topped up engine oil. Had windscreen replaced.Repaired horn.	472.5	74.55	472.73	0	1019.78
120920-0033	SVC00097 461	09/27/2012	1H0368	IC-TRUCK FLEET	186_INT	S	Service	1VT1086	5742 hrs 225392 kms	S1 B SERVICE	S1 B SERVICE. Completed service as per service sheet.	450	212.5	0	3.5	666
120914-0001	SVC00096 806	09/18/2012	1H0368	IC-TRUCK FLEET	184_INT	R	Electrical	1VT1086	NOT SUPPLIED	repair reverse light	CHECK REVERSE LAMP, REPAIR WIRING AND CONNECTIONS, FIT NEW GLOBE AND TEST. WORK CARRIED OUT BY ST LEONARDS ELECTRICAL.	32.5	75.53	67	0	175.03
120905-0008	SVC00096 510	09/11/2012	1H0368	IC-TRUCK FLEET	184_INT	R	Engine	1VT1086	224145 KLMS 5693 HRS	REPAIR COOLANT LEAK	RECTIFY COOLANT LEAK. PRESSURE TEST COOLING SYSTEM, LOCATE LEAKING HOSE FROM JOINER RADIATOR TO HEADER TANK, REMOVE OLD HOSE AND FIT NEW HOSE WITHOUT JOINER, CHECK OK. WORK CARRIED OUT BY CJD EQUIPMENT.	65	0	265.8	0	330.8
120827-0086	SVC00095 720	08/31/2012	1H0368	IC-TRUCK FLEET	184_INT	R	Hydraulic	1VT1086	223392 KLMS 5666 HRS	REPAIR HYDRAULIC OIL LEAK	WARNING BUZZER ISSUE - CHECK WARNING SYSTEM FOR LOW COOLANT BUZZER COMING ON - FAIRLY CERTAIN IT WAS DUE TO COOLANT LEVEL BEING LOW, TOPPED UP RADIATOR WITH 2 LITRES OF COOLANT. REMEDY HYDRAULIC TANK LEAK. FOUND SIGHT GLASS LEAKING - REMOVE AND RE-SEAL, REFIT AND CHECK OK. WORK CARRIED OUT BY CJD EQUIPMENT.	29.5	0	114	0	143.5
120803-0039	SVC00094 523	08/10/2012	1H0368	IC-TRUCK FLEET	184_INT	S	Service	1VT1086	220664 KLMS 5533 HRS	S1 B SERVICE	CARRY OUT BASIC SERVICE AT 5533HRS / 220664 KLMS. CHANGE ENGINE OIL, GREASE, FILTERS - INCL AIR FILTER , CHECK FLUIDS, LIGHTS, BELTS, BATTERY CONNECTIONS, WHEELS, SUSPENSION, DRIVELINE & OPERATING SYSTEMS, ROAD TEST. WORK CARRIED OUT BY CJD EQUIPMENT.	59	0	564.05	0	623.05
120619-0005	SVC00091 477	06/20/2012	1H0368	IC-TRUCK FLEET	184_INT	R	Electrical	1VT1086	NOT SUPPLIED	REPLACE TAIL LIGHTS & REPAIRS	CHECK FAULT IN HYDRAULIC COOLING FAN, LOCATE AND REPAIR FAULTY WIRING, SECURE AND TEST. SUPPLY AND FIT NEW LED TAIL LAMPS TO VEHICLE, REPLACE REAR WIRING, FIT LOAD RESISTORS IN CIRCUIT, CONNECT AND SECURE WIRING AND TEST. WORK CARRIED OUT BY ST LEONARDS AUTO ELECTRICAL	59	0	581.14	0	640.14
120508-0058	SVC00089 114	05/15/2012	1H0368	IC-TRUCK FLEET	184_INT	R	Engine	1VT1086	214188 KMS 5210 HRS	REPAIR LEAKING INJECTOR PIPE	REPAIR LEAKING INJECTOR PIPE, TIGHTEN LOOSE HEATER CONTROLS, REPAIR LEAKING VALVES ON RH AND LH AIR TANKS	59	0	101.4	0	160.4
120508-0059	SVC00089 113	05/15/2012	1H0368	IC-TRUCK FLEET	184_INT	S	Service	1VT1086	214188 KMS 5210 HRS	S1 B SERVICE	SERVICE UNIT AS REQUIRED CARRIED OUT BY CJD EQUIPMENT CHANGE ENGINE OIL, FILTERS, GREASE AND INSPECT ALL FLUIDS, LIGHTS BELTS, BATTERY CONNECTIONS OPERATIONG G SYSTEMS, WHEEL SSUSPENSION, DRIVELINE AND OTHER ITEMS	59	0	539.35	0	598.35
120411-0019	SVC00088 191	04/27/2012	1H0368	IC-TRUCK FLEET	184_INT	R	Sundries	1VT1086	NOT SUPPLIED	REPLACE U/C SEAT SHOCKIE	SUPPLY SEAT SHOCKIE TO DRIVER AS REQUESTED	29.5	264	0	0	293.5
120222-0033	SVC00088 120	04/26/2012	1H0368	IC-TRUCK FLEET	187_INT	R	Electrical	1VT1086	N/A	repair tail lights	REPAIR TAIL LIGHTS SUBLETS - ST LEONARDS AUTO ELECTRICAL 3606541	0	0	79.5	0	79.5
120201-0031	SVC00084 073	03/28/2012	1H0368	IC-TRUCK FLEET	186_INT	S	Service	1VT1086	4909 hrs 209527 kms	S1 B SERVICE	S1 B SERVICE. Completed service as per service sheet. Replaced torque rod bushes.	289.5	184.69	0	3.5	477.69

120206-0094	SVC00083 995	03/08/2012	1H0368	IC-TRUCK FLEET	181_INT	R	Bodywork	1VT1086		SUPPLY NEW CLIPS FOR LHF CORNE	SUPPLY NEW CLIPS FOR LHF CORNER PANELS ON CONCRETE TRUCK HINOS	0	62.25	0	0	62.25
120206-0020	SVC00084 848	02/27/2012	1H0368	IC-TRUCK FLEET	186_INT	R	Radio	1VT1086	209,527 Kms 4,191 Hrs	REPLACE UHF RADIO.	REMOVE AND REPLACE UHF RADIO AND AERIAL AS REQUIRED	118	359	0	0	477
120103-0061	SVC00083 143	02/22/2012	1H0368	IC-TRUCK FLEET	187_INT	R	Tyres	1VT1086	N/A	Puncture repair	REPAIR PUNCTURE AS REQUIRED	0	45	0	0	45
120201-0029	SVC00083 481	02/18/2012	1H0368	IC-TRUCK FLEET	186_INT	R	Clutch	1VT1086	4,910H 209,527K M	replace failed clutch	REPLACE FAILED CLUTCH Checked operation oc clutch.Removed the gearbox and clutch,checked the clutch and found the drive centre had broken away inside the clutch. Removed the flywheel and had ,achined.Fitted up new clutch assembly and refitted the geat box. Adjusted the clutch and test drove.	1405	977.78	181.82	0	2564.6
120206-0010	SVC00083 973	02/14/2012	1H0368	IC-TRUCK FLEET	184_INT	R	Transmissi on	1VT1086	209528	Inspect drive fault	INSPECT DRIVE FAULT - CARRIED OUT BY CJD LAUNCESTON INSPECT GEAR SELECTION FAULT, SELECTORS AND RANGE CHANGE VERY RATTY INSIDE OF GEAR BOX, TRUCK TO GO BACK TO HAZELL BROS L/A FOR REPAIR	59	0	110	0	169
111221-0003	SVC00081 907	12/29/2011	1H0368	IC-TRUCK FLEET	184_INT	R	Engine	1VT1086	206615 KMS 4744 HRS	REPAIR FUEL LEAK	RECTIFY LEAK ON #1 INJECTOR. LOCATE LEAK AT NO. 1 INJECTOR LINE, REMOVE LINE AND FIT PLASTIC COVER PIPE, RE-FIT AND CHECK OK, ORDER NEW INJECTOR LINE PIPE, FITTED ON 7/12. WORK CARRIED OUT BY CJD EQUIPMENT	59	8.54	439.6	0	507.14
111216-0046	SVC00081 871	12/28/2011	1H0368	IC-TRUCK FLEET	187_INT	A	Bodywork	1VT1086	207555 kms	REPAIRS TO STEP	REPAIRS TO STEP. Remove and repair step	59	20	0	0	79
110923-0055	SVC00077 594	09/30/2011	1H0368	IC-TRUCK FLEET	186_INT	S	Service	1VT1086	4590 hrs 204403 kms	S1 C SERVICE	S1 C SERVICE. Completed service as per service sheet. Tightened loose rear guards.	413.75	817.39	0	2.7	1233.84
110713-0048	SVC00073 497	07/22/2011	1H0188	CONCRETE TRUCK FLEET	122_INT	R	Tyres	1VT1086	201793	TYRE REPAIRS RUBAND 59852	REPLACE 2 TYRES AS REQUIRED	0	1230	0	0	1230
110705-0001	SVC00073 343	07/19/2011	1H0188	CONCRETE TRUCK FLEET	186_INT	R	Engine	1VT1086	4366 hrs 201388 km	TROUBLESHOOT F / PUMP TIMING	TROUBLESHOOT F / PUMP TIMING Checked induction system and turbo.Checked injectors and injector lines. Checked and adjusted fuel pump timing.	560.5	0	0	0	560.5
110518-0046	SVC00071 291	06/16/2011	1H0188	CONCRETE TRUCK FLEET	186_INT	R	Engine	1VT1086		FUEL LEAK	fuel leak . removed and resealed fitting in lift pump.	33	0	0	0	33
110526-0045	SVC00070 795	06/07/2011	1H0188	CONCRETE TRUCK FLEET	186_INT	R	Drive Line	1VT1086	199020 kms 4213 hrs	REPLACE DRIVE SHAFT SLIP JOINT	REPLACE DRIVE SHAFT SLIP JOINT. Remove first drive shaft and had worn out slip joint replaced.Refitted the driven shaft and greased.	187.5	0	918.85	0	1106.35
110523-0089	SVC00070 477	05/31/2011	1H0188	CONCRETE TRUCK FLEET	186_INT	S	Service	1VT1086	4191H 198645KM	S1 B SERVICE	performed b service as per service sheet. repair lights	236	204.22	0	2.7	442.92
110317-0064	SVC00066 867	03/28/2011	1H0188	CONCRETE TRUCK FLEET	186_INT	R	Engine	1VT1086	3,938HOURS	Check for Overheating	CLEANED BI METAL STRIP ON VISCOUS HUB, CHECKED THERMOSTAT AND CLEANED RADIATOR ROAD TEST TO COLLINSVALE	88.5	-26.33	0	0	62.17
110222-0081	SVC00065 163	03/10/2011	1H0188	CONCRETE TRUCK FLEET	186_INT	S	Service	1VT1086	3856 hrs	S1 B SERVICE	Carry out the required sevrice and required repairs.	275	179.05	0	2.7	456.75
110131-0085	SVC00064 664	02/23/2011	1H0188	CONCRETE TRUCK FLEET	186_INT	R	Electrical	1VT1086	192,788 Klms 3,784Hrs	CHECK BATTERIES REPLACE IF NES	Trouble shoot the system. Found the batteries to be u/s removed and installed new batteries tested the charge rates etc.	236	329.76	0	0	565.76

101216-0059	SVC00064 836	02/10/2011	1H0188	CONCRETE TRUCK FLEET	186_INT	B	Engine	1VT1086	3780 hr 192784km	ENGINE REPAIRS	The engine had failed. The unit was trouble shooted to find the fuel pump had failed. (Drive by wire puel pump). The pump was sent away for repair. The problem with the pump was terminal 18k for a new pump 10k to repair the unit we have. The pump failed due to containated fuel. The repaired pump was returned and fitted. tested all ok.	1755	289.24	10200	0	12244.24
110106-0069	SVC00063 150	01/12/2011	1H0188	CONCRETE TRUCK FLEET	184_INT	R	Engine	1VT1086	3780 HRS	CHECK CUTTING OUT FAULT	TRAVELLED TO UNIT AT MORENINGTON. INSPECT FOR ENGINE RUNNING POORLY. CARRIED OUT INSPECTION AND FOUND UNIT HAD FUEL PUMP FAULT. RETURNED TO UNIT AND OBTAIN AND REMOVE FAULT CODES FROM UNIT. ON REOCCURING CODE RETURN TO THE WORKSHOP AND PRINT OUT CLIENT DIAGNOSTICS INFO	0	0	303.6	0	303.6
101222-0044	SVC00063 293	01/10/2011	1H0188	CONCRETE TRUCK FLEET	184_INT	R	Engine	1VT1086	190729 KMS 3657 HRS	Repair compressor oil leak	8/11/2010 REPAIR COMPRESSOR OIL LEAK - STEAM CLEANED AND FOUND COMPRESSOR LEAKING BADLY, REMOVE COMPRESSOR, CLEAN AND RE-SEAL TOP SECTION, RE-FIT, IDENTIFY FURTHER PROBLEM WITH CRACKED HOUSING, TRUCK HAD TO GO BACK TO WORK.	29.5	0	855.97	0	885.47
101222-0056	SVC00063 292	01/10/2011	1H0188	CONCRETE TRUCK FLEET	184_INT	R	Engine	1VT1086	191024 KMS	REPAIR COOLANT LEAK	15/11/2010 REPAIR COOLANT LEAK - REMOVE RADIATOR HOSES, HEATER HOSES, FUEL PIPE BRACKETS, REMOVE LEAKING COMPRESSOR COOLANT PIPE AND SOLDER UP AS TEMP REPAIR, RE-FIT AND TEST, ORDER NEW PIPE 18/11/2010 PIPE BROKE AGAIN AT ST MARYS, REMOVE ASSOCIATED PARTS TO REMOVE BROKEN PIPE, FIT NEW PIPE AND RE-ASSEMBLE OTHER PARTS, TOP UP COOLANT, TEST FOR LEAKS.	29.5	0	1467.65	0	1497.15
101222-0060	SVC00063 289	01/10/2011	1H0188	CONCRETE TRUCK FLEET	184_INT	R	Engine	1VT1086	191532 KMS	REPLACE COMPRESOR COOLANT PIPE	23/11/2010 REPLACE COMPRESSOR COOLANT PIPE - COOLANT PIPE BROKE DUE TO COMPRESSOR MOVEMENT, SLEEVE PIPE AND SILVER SOLDER AS TEMP REPAIR UNTIL NEW COMPRESSOR IS FITTED, TOP UP COOLANT AND TEST FOR LEAKS.	29.5	0	528	0	557.5
101222-0067	SVC00063 291	01/10/2011	1H0188	CONCRETE TRUCK FLEET	184_INT	R	Engine	1VT1086	191852 KMS	REPLACE U/S COMPRESSOR	25/11/2010 REPLACE U/S COMPRESSOR - BOLTS BROKEN IN FRONT MOUNT AND CRACKED HOUSING, REMOVE ASSOCIATED PIPES AND FUEL PUMP WIRING, TIME ENGINE, REMOVE FUEL PUMP AND OIL LINES, REMOVE OLD AND FIT NEW COMPRESSOR, RE-ASSEMBLED REMOVED PARTS, FIT NEW COMPRESSOR COOLANT PIPE, TEST FOR LEAKS AND OPERATION.	29.5	0	6112.2	0	6141.7
101216-0060	SVC00062 313	12/22/2010	1H0188	CONCRETE TRUCK FLEET	184_INT	R	Engine	1VT1086		CHECK ENGINE FAULT	TRAVELLED TO MORNINGTON. CHECKED ENGINE FAULT. CHECKED FILTERS AND ELECTRICAL PLUGS. ASSISTED FRM IN THE DIAGNOSTICS AND REMOVED TAIL SHAFT	207	0	0	22.5	229.5
101119-0065	SVC00062 267	12/20/2010	1H0188	CONCRETE TRUCK FLEET	181_INT	F	Bodywork	1VT1086	192390KM 3758HRS	SUPPLY NEW HB DECALS FOR DOORS	SUPPLY NEW HB DECALS FOR DOORS ON TRUCK TO BE FITTED BY RODNEY ONIONS	0	0	60	0	60

101216-0007	SVC00062247	12/20/2010	1H0188	CONCRETE TRUCK FLEET	184_INT	R	Engine	1VT1086	192390 KMS 3758 HRS	REPAIR FUEL LEAK	REPAIR FUEL LEAK - 7.12.2010 CHECK DIESEL LEAK AND FOUND NO.1 INJECTOR PIPE LEAKING, REMOVE PIPE AND INSPECT, FOUND END BADLY SCORED, CLEAN AND RE-FIT, ORDER NEW PIPE. 8.12.2010 FIT NEW PIPE.	14.75	0	444.8	0	459.55
101201-0046	SVC00061853	12/10/2010	1H0188	CONCRETE TRUCK FLEET	184_INT	R	Bodywork	1VT1086	190227 KMS	REPLACE RHS DRIVE GUARD	REPLACE RHS DRIVE GUARD - REMOVE OLD AND FIT NEW GUARD AND FIT MUDFLAP	14.75	0	359.85	0	374.6
101028-0028	SVC00059859	11/03/2010	1H0188	CONCRETE TRUCK FLEET	184_INT	R	Engine	1VT1086	188703	CHECK AND REPAIR FUEL FAULT	ADJ EQUIP ATTENDED FUEL PROBLEM AT MIDLANDS HWY. TRAVELLED TO CLEVELAND AND CHECKED FUEL PROBLEM. FUEL TO LOW, BLED FUEL SYSTEM SEVERSAL TIMES TI GET RUNNING OK	14.75	0	205	0	219.75