

Service Job	Invoice No	Date	Customer Id	Customer Name	Cost Cent	Prob	Type of Call	Equip ID	Hrs	Kms	Job Description	Work Done	Labor Cost	Material Cost	Subcontractor Cost	Other Cost	Total Cost
94228	114560	07/15/2026	1HM105HB	ID - NYRST#	105G	R	Bodywork	1VT1293	11722.000	0	REMOVE TRAY AND BREATHE SAFE	H30 - 1VT1293	0	140	781.56	0	921.56
90675	113177	05/18/2026	1HM105HB	ID - NYRST#	105G	R	Transmissio	1VT1293	11722.000	0	DIANOSE TRAY NOT LIFTING FAULTS - PTO NOT ENGAGING	JOB CARRIED OUT - REMOVE TRAY AND BREATH SAFE. H30 - 1VT1293	707.13	0	315	0	1022.13
												ODOMETER - 11727 HOURS					
												JOB CARRIED OUT - DIAGNOSE TRAY NOT LIFTING FAULTS - PTO. TESTED ELECTRICAL SIDE IN CAB AND ON PUMP, FOUND OK. CHECKED AIR HOSES ON VALVES GOING TO PUMP, FOUND OK. CHECK OIL FLOWON PTO/PICK UP SIDE, FOUND NOT OK. REMOVED PTO TO INSPECT, DISASSEMBLE AND FOUND SEVERLEY CHEWED OUT INSIDE.					
89126	107147	04/23/2026	1HM105HB	ID - NYRST#	105G	R	Electrical	1VT1293	11722.000	0	REPLACED FAILED BATTERIES		240	280.02	0	0	520.02
78419	94800	09/23/2025	1HM105HB	ID - NYRST#	105G	R	Sundries	1VT1293	11722.000	0	OPERATIONAL INSPECTION READY FOR OFFSITE WASHING	H30 - 1VT1293	0	0	55	0	55
												ODOMETER - 11722 HOURS					
												JOB CARRIED OUT - OPERATIONAL INSPECTION READY FOR OFFSITE WASHING.					
72733	92911	06/13/2025	1HM105HB	ID - NYRST#	105G	R	Brake	1VT1293	11722.000	0	Overhaul Rear Brakes	H30 - 1VT1293	9048	2576.03	0	0	11624.03
												ODOMETER - 11722 HOURS					
												JOB CARRIED OUT - OVERHAUL REAR BRAKES.					
65924	79578	02/03/2025	1HM105HB	ID - NYRST#	105G	R	Air Con	1VT1293	11722.000	0	REPAIR A/C AS WAS NOT COOLING CABIN EFFECTIVELY	H30 - 1VT1293	0	0	120	0	120
												ODOMETER - 11722 HOURS					
												JOB CARRIED OUT - TEST A/C, FOUND IT OVER CHARGING. RECOVER EXCESS GAS. CONDENSOR IS BLOCKED AND NEEDS CLEANING. CONDENSOR FAN NEEDS REPLACING.					

65898	81031	02/03/2025	1HM105HB ID - NYRST# 105G	R	Brake	1VT1293	11722.000	INSPECT FOR BRAKES NOT WORKING	H30 - 1VT1293	90.1	0	0	30	120.1
									ODOMETER - 11722 HOURS					
									JOB CARRIED OUT - INSPECT FOR BRAKES NOT WORKING. RECOMMEND ALL REAR BRAKES ON BOTH SIDES BE REPLACED.					
63931	77306	01/14/2025	1HM105HB ID - NYRST# 184G	R	Air Con	1VT1293	11750.000	A/C repairs	ATTEND TO REPORTED NO A/C - FOUND NO GAS IN SYSTEM - LOCATED LEAKING PRESSURE SWITCH - FIT NEW RECIEVER DRIER AND PRESSURE SWITCH - PRESSURE TEST AND REGAS SYSTEM TESTED OPERATION ALL OK	1181.11	199.41	0	65	1445.52
									STOP ENGINE LIGHT ON - FOUND NO COOLANT IN HEADER TANK - REFILLED COOLANT					
63861	80742	01/13/2025	1HM105HB ID - NYRST# 105G	R	Air Con	1VT1293	11664.000	REPAIR A/C	H30 - 1VT1293	664.09	46.3	0	0	710.39
									JOB CARRIED OUT - CARRY OUT REPAIRS TO A/C.					
63803	77248	01/13/2025	1HM105HB ID - NYRST# 105G	R	Electrical	1VT1293	11664.000	REPAIR TAILGATE AND LEFT HAND TAIL LIGHT WIRING	H30 - 1VT1293	360.4	0	0	100	460.4
									JOB CARRIED OUT - REPAIR TAILGATE AND LH TAIL LIGHT WIRING.					
63682	79584	01/09/2025	1HM105HB ID - NYRST# 105G	R	Hydraulic	1VT1293	11660.000	Power Steer Hose Rubbed Through	H30 - 1VT1293	360.4	0	0	30	390.4
									JOB CARRIED OUT - POWER STEER HOSE RUBBED THROUGH. CLEAN TO GET TO PIPE, REMOVE AND REPLACE STEER HOSE.					
63321	81079	12/20/2024	1HM105HB ID - NYRST# 105G	R	Electrical	1VT1293	11660.000	Repair Inoperative Lights	H30 - 1VT1293	135.15	729.02	0	0	864.17
									JOB CARRIED OUT - CARRY OUT REPAIRS FOR INOPERATIVE LIGHTS.					
63252	77274	12/19/2024	1HM105HB ID - NYRST# 105G	S	Service Ear	1VT1293	11660.000	DECEMBER PMI	H30 - 1VT1293	180.2	0	0	0	180.2
									JOB CARRIED OUT - CARRY OUT PMI.					
63251	77009	12/19/2024	1HM105HB ID - NYRST# 105G	R	Electrical	1VT1293	11660.000	REVERSE ALARM AND HEADLIGHT GLOBE REPLACEMENT	H30 - 1VT1293	135.15	92	0	60	287.15
									JOB CARRIED OUT - REPLACE REVERSE ALARM AND HEAD LIGHT GLOBE.					

62715	76216	12/10/2024	1HM105HB ID - NYRST# 105G	INT-R	Electrical	1VT1293	11642.000	0	Repair Tail light wiring	H30 - 1VT1293	180.2	0	0	200	380.2
										ODOMETER - 11642 HOURS					
										JOB CARRIED OUT - INSPECT FOR PARK LIGHT IN TAIL LIGHTS NOT WORKING. FOUND WIRING BROKEN. REPAIRED WIRING AND TESTED OPERATION.					
60975	73333	11/07/2024	1HM105HB ID - NYRST# 105G	R	Bodywork	1VT1293	11395.000	0	Carry Out Temporary Tray Repairs	H30 - 1VT1293	180.2	0	0	0	180.2
										ODOMETER - 11395 HOURS					
										JOB CARRIED OUT - TRAY REPAIRS. CLEAN AREA TO BE WELDED. BASH FAILED PIECE OF TRAY BACK IN AND WELD.					
59514	71757	10/08/2024	1HM105HB ID - NYRST# 105G	R	Brake	1VT1293	11395.000	0	REPLACE SLACK ADJUSTER AND DRAIN COCKS	H30 - 1VT1293	495.55	142.9	760	0	1398.45
										ODOMETER - 11395 HOURS					
										JOB CARRIED OUT - CUT OFF SIEZED SLACK ADJUSTER. SOURCE AND FIT NEW ONE, ADJUST BRAKES. SOURCE AND FIT NEW DRAIN COCKS.					
59454	71760	10/08/2024	1HM105HB ID - NYRST# 105G	A	Brake	1VT1293	11395.000	0	REPLACED FAILED R/H REAR BRAKE BOOSTER DUE TO PRODUCT	H30 - 1VT1293	315.35	0	160	0	475.35
										ODOMETER - 11395 HOURS					
										JOB CARRIED OUT - REPLACE FAILED RH REAR BRAKE BOOSTER.					
59342	71843	10/04/2024	1HM105HB ID - NYRST# 105G	S	Service Ear	1VT1293	11395.000	0	S1B SERVICE	H30 - 1VT1293	225.25	261.53	0	0	486.78
										ODOMETER - 11395 HOURS					
										JOB CARRIED OUT - S1B SERVICE.					
57656	69406	09/02/2024	1HBGNYR# ID-NYRST# 105G	R	Sundries	1VT1293	11395.000	0	REPLACE BROKEN AIR LINES (LOAD DUMPED ON CYLINDER) REFER TO TOM.S	H30 - 1VT1293	0	0	232.85	0	232.85
										ODOMETER - 11395 HOURS					
										JOB CARRIED OUT - CALL OUT - BROKEN AIR LINES AT LEFT HAND TAIL GATE LOCK. REPLACE BROKEN FITTINGS. LOAD DUMPED ON CYLINDER.					

57433	70424	08/27/2024	1HM105HB ID - NYRST# 105G	S	Service Ear	1VT1293	11395.000	0	SEPTEMBER PMI	H30 - 1VT1293	270.3	0	120	0	390.3
										ODOMETER - 11395 HOURS					
										JOB CARRIED OUT - CARRY OUT PMI'S DURING SEPTEMBER.					
56543	68354	08/12/2024	1HM105HB ID - NYRST# 105G	R	Sundries	1VT1293	11350.000	0	AUGUST PMI	H30 - 1VT1293	360.4	0	160	100	620.4
										ODOMETER - 11350 HOURS					
										JOB CARRIED OUT - CARRY OUT PMI'S DURING AUGUST.					
56155	67482	08/02/2024	1HM105HB ID - NYRST# 105G	R	Sundries	1VT1293	11229.000	0	DIAGNOSE + REPAIR STEERING COLUMN FAILURE	H30 - 1VT1293	180.2	0	0	0	180.2
										ODOMETER - 11229 HOURS					
										JOB CARRIED OUT - DIAGNOSE AND REPAIR STEERING COLUMN FAILURE. LOOSE LOCK NUT ON STEER COLUMN. TIGHTENED SO STEERING COLUMN LOCKS IN PLACE. CARRIED OUT PMI.					
56153	67504	08/02/2024	1HBGNYR# ID-NYRST# 105G	R	Sundries	1VT1293	11229.000	0	REPAIR BREATHE SAFE FAULT	H30 - 1VT1293	180.2	442.63	0	0	622.83
										ODOMETER - 11229 HOURS					
										JOB CARRIED OUT - REPAIR BREATHE SAFE FAULT. RE-SEALED SYSTEM, REPLACED FILTER.					
55548	66582	07/23/2024	1HM105HB ID - NYRST# 105G	R	Electrical	1VT1293	11229.000	0	FITUP 4G GPS TRACKER	H30 - 1VT1293	0	0	160	0	160
										ODOMETER - 11229 HOURS					
										JOB CARRIED OUT - FITUP NEW 4G GPS TRACKER.					
54911	65805	07/11/2024	1HM105HB ID - NYRST# 105G	R	Engine	1VT1293	11229.000	0	DIAGNOSE LOW COOLANT	H30 - 1VT1293	0	55.8	80	0	135.8
										JOB CARRIED OUT - TEST STOP ENGINE LIGHT FAULT. FOUND LOW COOLANT, TOP UP AND TEST OPERATION.					
54756	65865	07/09/2024	1HM105HB ID - NYRST# 105G	R	Electrical	1VT1293	11229.000	0	DIAGNOSE REVERSE ALARM FAULT	H30 - 1VT1293	0	0	160	0	160
										JOB CARRIED OUT - DIAGNOSE REVERSE ALARM FAULT. REPAIR WIRING AND FIT NEW REVERSE ALARM.					

54038	65029	06/25/2024	1HM105HB ID - NYRST# 105G	R	Sundries	1VT1293	11229.000	0	JUNE MONTHLY PMI INSPECTION	H30 - 1VT1293	0	0	80	0	80
										JOB CARRIED OUT - CARRY OUT PMI'S DURING JUNE.					
53615	64350	06/17/2024	1HM105HB ID - NYRST# 105G	S	Service Ear	1VT1293	11229.000	0	CARRY OUT S1A SERVICE	H30 - 1VT1293	270.3	123.28	0	0	393.58
										JOB CARRIED OUT - S1A SERVICE.					
52887	63467	06/03/2024	1HM105HB ID - NYRST# 105G	R	Electrical	1VT1293	10396.000	0	Replace batteries	H30 - 1VT1293	382.93	261.99	0	0	644.92
										JOB CARRIED OUT - REPLACE BATTERIES.					
52883	63465	06/03/2024	1HM105HB ID - NYRST# 105G	R	Brake	1VT1293	10396.000	0	PARK BRAKE ADJUSTMENT	H30 - 1VT1293	270.3	0	0	0	270.3
										JOB CARRIED OUT - ADJUST PARK BRAKES AND TEST OPERATION.					
52565	62128	05/27/2024	1HM105HB ID - NYRST# 105G	R	Sundries	1VT1293	10396.000	0	MAY MONTHLY PMI INSPECTION	H30 - 1VT1293	135.15	0	0	0	135.15
										JOB CARRIED OUT - CARRY OUT PMI.					
52230	61777	05/20/2024	1HM105HB ID - NYRST# 105G	R	Sundries	1VT1293	10396.000	0	TEMP REPAIR TO TAIL GATE WELD UP CRACKS AND PLATE	H30 - 1VT1293	450.5	0	0	0	450.5
										JOB CARRIED OUT - TEMP REPAIR TO TAIL GATE, WELD UP CRACKS AND PLATE.					
51587	61188	05/06/2024	1HM105HB ID - NYRST# 105G	R	Sundries	1VT1293	10396.000	0	TAILGATE NOT LATCHING.	H30 - 1VT1293	0	0	80	0	80
										JOB CARRIED OUT - TAIL GATE NOT LATCHING. REPAIR AIR LEAK TO TAIL GATE LOCK.					
50496	59919	04/15/2024	1HM105HB ID - NYRST# 105G	S	Service Ear	1VT1293	10396.000	0	PMI APRIL	H30- 1VT1293	135.15	0	0	0	135.15
										JOB CARRIED OUT - CARRY OUT PMI.					
47535	57586	03/04/2024	1HM105HB ID - NYRST# 105G	R	Service Ear	1VT1293	10396.000	0	MARCH PMI	H30 - 1VT1293	340	0	0	0	340
										JOB CARRIED OUT - CARRY OUT PMI'S DURING MARCH.					
47534	56381	03/04/2024	1HM105HB ID - NYRST# 105G	S	Sundries	1VT1293	10396.000	0	ATTEND TO AIR LEAKS	H30 - 1VT1293	127.5	0	0	0	127.5
										JOB CARRIED OUT - REPAIRED AIR LEAK UNDER CHASSIS RAILS, REPLACED LINK.					
47492	56400	03/04/2024	1HM105HB ID - NYRST# 105G	R	Brake	1VT1293	10396.000	0	ADJUSTED HANDBRAKE AS REQUIED	H30 - 1VT1293	106.25	0	0	0	106.25
										JOB CARRIED OUT - ADJUST HAND BRAKE.					
46747	55616	02/19/2024	1HM105HB ID - NYRST# 105G	R	Service Ear	1VT1293	10396.000	0	S1B SERVICE	H30 - 1VT1293	340	0	0	0	340
										JOB CARRIED OUT - S1B SERVICE.					

46472	55771	02/13/2024	1HM105HB ID - NYRST# 105G	S	Service Ear	1VT1293	10396.000	0	PMI FEBUARY	H30 - 1VT1293	297.5	0	0	0	297.5
										JOB CARRIED OUT - CARRY OUT PMI'S DURING FEBRUARY.					
46381	54945	02/09/2024	1HM105HB ID - NYRST# 105G	R	Sundries	1VT1293	10396.000	0	SERVICE AND DOOR HANDLE REPAIR AS REQUIRED	H30 - 1VT1293	255	0	0	0	255
										JOB CARRIED OUT - SERVICED AND REPAIRED DOOR HANDLE AS REQUIRED.					
46239	55551	02/07/2024	1HM105HB ID - NYRST# 182G	R	Trays/Buck	1VT1293	10396.000	0	REPAIR TRAY	REPAIR TRAY - NEEDLE GUN AROUND CRACKS, CUT 3mm MILD STEEL PLATE TO RESKIN TRAY AREAS, WELD PLATE INTO TRAY	1027.5	72	0	100	1199.5
46057	54921	02/05/2024	1HM105HB ID - NYRST# 105G	R	Bodywork	1VT1293	10396.000	0	TRAY CLEAN FOR INSPECTION	H30 - 1VT1293	127.5	0	0	0	127.5
										JOB CARRIED OUT - CLEANED TRAY FOR INSPECTION.					
46061	54925	02/05/2024	1HM105HB ID - NYRST# 105G	R	Hydraulic	1VT1293	10396.000	0	INSPECT FOR air LEAK	H30 - 1VT1293	212.5	0	0	0	212.5
										JOB CARRIED OUT - INSPECT FOR AIR LEAK, FOUND AIR LINE WORN THROUGH, REMOVED AND REPLACED AIR LINE.					
45786	54989	01/29/2024	1HM105HB ID - NYRST# 105G	R	Sundries	1VT1293	10396.000	0	ATTEND to door handle fault	H30 - 1VT1293	170	297.09	0	0	467.09
										JOB CARRIED OUT - ATTEND TO DOOR HANDLE FAULT, SOURCE PARTS AND FIT.					
45207	54311	01/15/2024	1HM105HB ID - NYRST# 105G	R	Electrical	1VT1293	10396.000	0	ATTEND TO INDICATOR INOP AND HEADLIGHTS NOT WORKING	H30 - 1VT1293	0	0	160	0	160
										JOB CARRIED OUT - REPAIR BAD CONNECTION TO RH FRONT INDICATOR. TEST PARK LIGHT FAULT, WORKING OK FROM HEADLIGHT SWITCH BUT DO NOT COME ON WITH DAYTIME RUNNING LIGHTS.					
45129		01/15/2024	1HM105HB ID - NYRST# 105G	R	Sundries	1VT1293	10396.000	0	TAILGATE LOCKS	H30 - 1VT1293	0	0	0	0	0
										JOB CARRIED OUT - INSPECTED FOR TAIL GATES INOP. FOUND SWITCH WAS LABELLED INCORRECTLY, OPERATOR WAS UNLOCKING INSTED OF LOCKING. LABELLED SWITCH CORRECTLY.					
44793	54252	01/05/2024	1HM105HB ID - NYRST# 105G	R	Hydraulic	1VT1293	10396.000	0	ATTEND TO LEAKING PTO	H30 - 1VT1293	722.5	1135.05	0	0	1857.55
										JOB CARRIED OUT - SOURCE AND FIT PTO PARTS.					

44761	54250	01/02/2024	1HM105HB ID - NYRST# 105G	R	Service Ear	1VT1293	10396.000	0	CARRY OUT PMI'S JANUARY	H30 - 1VT1293	340	0	0	0	340
										JOB CARRIED OUT - CARRY OUT PMI'S DURING JANUARY.					
44442	52749	12/18/2023	1HM105HB ID - NYRST# 105G	R	Electrical	1VT1293	10396.000	0	DIAGNOSE HEATER FAN FAULT	H30 - 1VT1293	297.5	0	0	0	297.5
										JOB CARRIED OUT - DIAGNOSE HEATER FAN FAULT. REMOVED BLOWER FAN, FOUND LOOSE TERMINAL. TIGHTENED AND TESTED OPERATION.					
44062	52277	12/11/2023	1HM105HB ID - NYRST# 105G	R	Sundries	1VT1293	10396.000	0	COMPLETE MINOR REPAIRS	H30 - 1VT1293	297.5	0	0	0	297.5
										JOB CARRIED OUT - REPAIRED X2 AIR LEAKS BY CUTTING AIR LINE AND FITTING JOINERS. REWIRED IN REVERSE LINE. PRESSURE WASHED AROUND TRANSMISSION. FOUND HYD PUMP OFF PTO LEAKING OUT INSPECTION HOLE. OVERFILLED HYD OIL.					
43351	52322	11/27/2023	1HM105HB ID - NYRST# 105G	R	Sundries	1VT1293	10396.000	0	Repair air leaks	H30 - 1VT1293	0	326.85	200	0	526.85
										JOB CARRIED OUT - REPLACE LEAKING TAIL GATE CYLINDER AND LEAKING FITTINGS.					
43023	51466	11/20/2023	1HM105HB ID - NYRST# 105G	R	Engine	1VT1293	10396.000	0	ATTEND TO TAILGATE REPAIR.	H30 - 1VT1293	0	0	160	30	190
										JOB CARRIED OUT - FIND AND REPAIR BROKEN LINKAGE IN TAIL GATE LATCH.					
42877	51560	11/17/2023	1HM105HB ID - NYRST# 105G	S	Sundries	1VT1293	10396.000	0	CARRY OUT NOVEMBER PMI	H30 - 1VT1293	467.5	111.2	0	0	578.7
										JOB CARRIED OUT - NOVEMBER PMI'S, REMOVED COOLANT TANK. SOURCED NEW SIGHT GLASS. RE-FIT COOLANT TANK & FILLER WITH COOLANT.					
42646	51178	11/13/2023	1HM105HB ID - NYRST# 105G	R	Sundries	1VT1293	10396.000	0	complete monior repairs	H30 - 1VT1293	0	0	280	0	280
										JOB CARRIED OUT - REPLACE BLOWN RH HEAD LIGHT. DIAGNOSE FAILED A/C FAN MOTOR. FIT NEW SIGHT GLASS IN HEADER TANK. TEST PARK BRAKE FAULT, NEED TO FIND LOCATION OF SECOND PRESSURE SWITCH.					

42396	50389	11/08/2023	1HM105HB ID - NYRST/ 105G	R	Engine	1VT1293	10396.000	0	ATTEND TO TAILGATE CONCERNS	H30 - 1VT1293	595	653.7	0	0	1248.7
										JOB CARRIED OUT - TAIL GATE NOT LATCHING. PRESSURE WASHED, REMOVED AIR LINES OFF AIR ACTUATORS. PINS SIEZED, USED GRINDER TO REMOVE. REMOVED AND REPLACED AIR ACTUATOR AND TEST OPERATION.					
41598	49924	10/23/2023	1HM105HB ID - NYRST/ 105G	R	Electrical	1VT1293	10396.000	0	DIAGNOSE PARK LIGHT FAULT	H30 - 1VT1293	0	152	520	0	672
										JOB CARRIED OUT - DIAGNOSE HOT SHORT IN PARK LIGHT CIRCUIT. FINAD AND REPAIR BROKEN POWER SUPPLY TO LEFT AND RIGHT TAIL LIGHTS.					
41155	49024	10/13/2023	1HM105HB ID - NYRST/ 105G	R	Brake	1VT1293	10396.000	0	ATTEND TO FAILED SLACK ADJUSTER	H30 - 1VT1293	1338.75	0	0	0	1338.75
										JOB CARRIED OUT - REPLACE FAILED BRAKE BOOSTER. REMOVE AND REPLACE SLACK ADJUSTER. ADJUSTED BRAKES AND REPAIRED AIR LINES.					
41116	49034	10/12/2023	1HM105HB ID - NYRST/ 105G	S	Service Trai	1VT1293	10396.000	0	S1B - 500HR SERVICE	H30 - 1VT1293	297.5	192.83	0	0	490.33
										JOB CARRIED OUT - S1B SERVICE.					
40174	48691	09/25/2023	1HM105HB ID - NYRST/ 105G	R	Brake	1VT1293	10396.000	0	REPAIR BRAKE OPERATION	H30 - 1VT1293	637.5	254.56	280	0	1172.06
										JOB CARRIED OUT - REMOVE AND REPLACE BOTH REAR BRAKE BOOSTERS. ADJUSTED ALL BRAKES.					
40038	46427	09/22/2023	1HM105HB ID - NYRST/ 105G	R	Electrical	1VT1293	10396.000	0	ATTEND TO FLAT BATTERIES.	H30 - 1VT1293	765	0	0	0	765
										JOB CARRIED OUT - INSPECTED VEHICLE FOR NO START. FOUND BATTERIES FLAT, ATTEMPTED JUMP START HOWEVER BATTERY TOO FLAT. REMOVED AND REPLACED BATTERIES. DROVE TRUCK TO WORKSHOP. LIFTED CAB AND FOUND DRIVE BELTS SHREDDED. REMOVED AND REPLACED BELTS. TEST OPERATION/CHARGE RATE, FOUND ALTERNATOR HAD FAILED. REMOVED AND REPLACED ALTERNATOR, TEST OPERATION.					
39884	49242	09/19/2023	1HM105HB ID - NYRST/ 105G	R	Electrical	1VT1293	10396.000	0	DIAGNOSE START FAULT	H30 - 1VT1293	340	1008.85	0	0	1348.85
										JOB CARRIED OUT - DIAGNOSE AND REPAIR START FAULT.					

39837	46065	09/18/2023	1HM105HB ID - NYRST# 105G	R	Electrical	1VT1293	10396.000	0	replace tail lights parts only	H30 - 1VT1293	0	244	0	0	244
39511	46500	09/12/2023	1HM105HB ID - NYRST# 105G	R	Sundries	1VT1293	10396.000	0	SEPTEMBER MONTHLY PMIS	JOB CARRIED OUT - PARTS ONLY - REPLACE TAIL LIGHT. H30 - 1VT1293	127.5	0	0	0	127.5
38858	45972	08/29/2023	1HM105HB ID - NYRST# 105G	R	Sundries	1VT1293	10396.000	0	REPLACE WINDOW ASSEMBLIES	JOB CARRIED OUT - CARRY OUT PMI'S DURING SEPTEMBER H30 - 1VT1293	977.5	1716.75	0	0	2694.25
38780	44965	08/28/2023	1HM105HB ID - NYRST# 105G	R	Brake	1VT1293	10396.000	0	ATTEND TO BRAKE CONCERN	JOB CARRIED OUT - REPLACE WINDOW ASSEMBLIES. H30 - 1VT1293	255	0	0	0	255
37976	46937	08/10/2023	1HM105HB ID - NYRST# 182G	R	Trays/Buck	1VT1293	10396.000	0	REPAIR TRAY	JOB CARRIED OUT - ATTEND TO BRAKE CONCERN. CLEANED OFF PRODUCT. JACKED UP, ADJUSTED AND TESTED. REPAIR TRAY - CUT OUT 3MM PATE TO PATCH FLOOR SIDES & DOOR, WELD I PATCHES, WELD UP CRACKS IN DOOR	2570	416	0	100	3086
37739	43792	08/07/2023	1HM105HB ID - NYRST# 105G	R	Electrical	1VT1293	10396.000	0	DIAGNOSE ELEC FAULT PARK LIGHT CIRCUIT	H30 - 1VT1293	340	0	0	0	340
37711	43777	08/04/2023	1HM105HB ID - NYRST# 105G	R	Brake	1VT1293	10396.000	0	BRAKE ADJUSTMENT AND PTO CONCERN	JOB CARRIED OUT - DIAGNOSE ELEC FAULT. FUSE BLOWING WHEN LIGHTS TURNED ON. FR PARK LIGHT CIRCUIT AT FAULT. REQUIRED SIGNIFICANT PANEL REMOVAL TO CHASE WIRING AND FIND FAULT. H30 - 1VT1293	425	0	0	0	425
37309	44384	07/28/2023	1HM105HB ID - NYRST# 105G	R	Electrical	1VT1293	10396.000	0	ATTEND TO LIST OF CONCERNS	JOB CARRIED OUT - INSPECT FOR INOP PTO. FOUND PLUG UNDONE FROM REAR OF PTO SWITCH. CONNECTED PLUG AND TESTED OPERATION. INSPECT FOR INOP BRAKES. ADJUSTED ALL SLACK ADJUSTERS AND TEST OPERATION. H30 - 1VT1293	1147.5	0	700	0	1847.5
										JOB CARRIED OUT - RECOVERED FROM CONS SHED AND INSPECTED FOR TRANS FAULT. TEST TRANS HARNESS. FOUND SEVERAL BREAKS IN HARNESS. REMOVE HARNESS, STRIP AND REPAIR ALL BREAKS. INSPECTED TRAY FOR DAMAGE.					

36991	42763	07/24/2023	1HBGNYRFD ID-NYRSTAI 105G	A	Brake	1VT1293	10396.0000	ATTEND TO CENTRE BOOSTER FAILURE	H30 - 1VT1293 JOB CARRIED OUT - REMOVED AND REPLACED LH CENTRE BRAKE BOOSTER, DUE TO BROKEN SPRING.	382.5	62.73	0	0	445.23
36323	42764	07/10/2023	1HBGNYRFD ID-NYRSTAI 105G	A	Brake	1VT1293	10070.0000	REPLACE FAILED BRAKE BOOSTERS DUE TO PRODUCT BUILD UP	H30 - 1VT1293 JOB CARRIED OUT - REPLACE FAILED BRAKE BOOSTERS, DUE TO PRODUCT BUILD UP.	425	125.46	0	0	550.46
36076	42157	07/06/2023	1HM105HBD ID - NYRSTAI 105G	S	Service Ear	1VT1293	10070.0000	SERVICE AS REQUIRED	H30 - 1VT1293 JOB CARRIED OUT - CARRY OUT SERVICE.	170	105.6	0	0	275.6
34495	38979	06/05/2023	1HM105HBD ID - NYRSTAI 105G	R	Electrical	1VT1293	10070.0000	ATTEND TO START CONCERN	H30 - 1VT1293 JOB CARRIED OUT - ATTEND TO START CONCERN. FOUND BATTERIES BULGING AND LOW VOLTS. REPLACED BATTERIES AND CHECK CHARGE RATE.	124.16	316.24	0	0	440.4
33937	40383	05/26/2023	1HBGNYRFD ID-NYRSTAI 105G	R	Brake	1VT1293	10070.0000	ATTEND TO BRAKE FAILURE DUE TO PRODUCT BUILDUP	H30 - 1VT1293 JOB CARRIED OUT - ATTEND TO BRAKE FAILURE DUE TO PRODUCT BUILD UP.	1117.4	0	0	0	1117.4
30721	35005	04/11/2023	1HM105HBD ID - NYRSTAI 105G	R	Sundries	1VT1293	10070.0000	REPAIR TAILGATE CYLINDER	H30 - 1VT1293 JOB CARRIED OUT - TAIL GATE INOP. FOUND AIR LINE FITTING BROKEN. SWAPPED FITTINGS AS REQUIRED AND TESTED OPERATION.	331.08	0	0	0	331.08
30645	35038	04/06/2023	1HM105HBD ID - NYRSTAI 105G	R	Electrical	1VT1293	10070.0000	ATTEND TO AIR LEAKS AROUND TAILGATE	H30 - 1VT1293 JOB CARRIED OUT - INSPECT FOR AIR LEAK ON TAIL GATE LOCKS/RAMS. FALOUND AIR LINE DISCONNECTED AT RAM. REFITTED AIR LINE AND TESTED.	165.54	0	0	0	165.54
28375	33302	03/14/2023	1HM105HBD ID - NYRSTAI 105G	R	Brake	1VT1293	10070.0000	DIAGNOSE BRAKE FAULT	H30 - 1VT1293 JOB CARRIED OUT - INSPECTED FOR BRAKES LOOSING AIR. FOUND BRAKE BOOSTER FAILURE CAUSING AIR LEAK.	289.7	0	0	50	339.7

28378	32814	03/14/2023	1HM105HB ID - NYRST/ 105G	R	Electrical	1VT1293	10070.0000	REPAIR HEAD LIGHT ELEC FAULT	H30 - 1VT1293	165.54	0	0	40	205.54	
									JOB CARRIED OUT - REPAIR HEAD LIGHT ELECTRICAL FAULT.						
27996	35062	03/03/2023	1HM105HB ID - NYRST/ 105G	R	Brake	1VT1293	10070.0000	ATTEND TO AIR LEAK	H30 - 1VT1293	1034.64	59.19	105	50	1248.83	
									JOB CARRIED OUT - INSPECT AIR LEAK IN BRAKE SYSTEM. REMOVE AND REPLACE LH REAR BOOSTER ASSEMBLY. ADJUSTED ALL BRAKES AND TEST OPERATION.						
27414	31908	02/20/2023	1HM105HB ID - NYRST/ 105G	S	Service Ear	1VT1293	10070.0000	S1B - 500HR SERVICE	H30 - 1VT1293	248.31	240.31	105	0	593.62	
									JOB CARRIED OUT - S1B SERVICE.						
24766	30049	01/16/2023	1HM105HB ID - NYRST/ 105G	R	Sundries	1VT1293	9844.0000	REPLACE REAR SPRINGS	H30 - 1VT1293	4510.98	3145.45	70	0	7726.43	
									JOB CARRIED OUT - REPLACE BROKEN REAR LEAF SPRINGS.						
									H30 - 1VT1293						
									JOB CARRIED OUT - REPLACE BROKEN REAR LEAF SPRINGS.						
24481	31379	01/09/2023	1HM105HB ID - NYRST/ 105G	R	Sundries	1VT1293	9844.0000	PMI inspection	H30 - 1VT1293	538.01	0	0	0	538.01	
									JOB CARRIED OUT - CARRY OUT PMI'S JANUARY.						
24383	28886	01/03/2023	1HM105HB ID - NYRST/ 105G	R	Electrical	1VT1293	9844.0000	JUMPSTART FLAT BATTERY	H30 - 1VT1293	372.47	0	0	0	372.47	
									JOB CARRIED OUT - JUMP STARTED VEHICLE.						
22884	28212	11/22/2022	1HM105HB ID - NYRST/ 105G	R	Sundries	1VT1293	9844.0000	replace failed door latch assembly	H30 - 1VT1293	1365.71	1160.51	0	0	2526.22	
									JOB CARRIED OUT - REPLACE FAILED DOOR LATCH ASSEMBLY.						
22847	26836	11/21/2022	1HM105HB ID - NYRST/ 105G	R	Sundries	1VT1293	9844.0000	REPAIR TAILGATE CYLINDERS	H30 - 1VT1293	538.01	586.3	0	0	1124.31	
									JOB CARRIED OUT - REPAIR TAIL GATE CYLINDERS.						
22242	28305	11/08/2022	1HM591HB CAPEX	105G	R	Sundries	1VT1293	9844.0000	fir up hepa filtratioon system	1VT1293 - CAPEX	2152.02	514.57	2135	150	4951.59
									JOB CARRIED OUT - FIT UP HEPA FILTRATION SYSTEM.						

22139	26761	11/07/2022	1HM105HB ID - NYRST# 105G	R	Hydraulic	1VT1293	9844.0000 0	DIAGNOSE LIFT CYLINDER H30 - 1VT1293 FAULT	703.55	225	0	150	1078.55
								JOB CARRIED OUT - TRUCK TIPPER NOT GOING UP, PTO SOLENOID. WASH TRANS TO ACCESS SOLENOID. REMOVE AND SOURCE NEW ONE, WIRE IN NEW SOLENOID AND TEST OPERATION.					
21987	25554	11/03/2022	1HM105HB ID - NYRST# 105G	S	Service Ear	1VT1293	9844.0000 0	S1A 250HR SERVICE	372.47	176.49	0	70	618.96
								JOB CARRIED OUT - S1A SERVICE. CLEAN PRODUCT OFF STEER AXLE TO ACCESS KING PINS. COULD NOT ADJUST BRAKES DUE TO EXCESSIVE PRODUCT AND ADJUSTERS NEED UNSIEZING.					
21814	25644	10/31/2022	1HM105HB ID - NYRST# 105G	R	Sundries	1VT1293	9640.0000 0	REPLACE FAILED BOOSTER WELD CRACK IN TRAY	662.16	0	0	0	662.16
								JOB CARRIED OUT - REMOVE AND REPLACE BOOSTER, LH CENTRE. WELD CRACKS IN TRAY.					
21225	24872	10/17/2022	1HM105HB ID - NYRST# 105G	R	Sundries	1VT1293	9640.0000 0	CALL -OUT DIAGNOSE NO AIR	2110.65	492.03	70	120	2792.68
								JOB CARRIED OUT - CALL OUT - TRUCK NOT BUILDING UP AIR. DIAGNOSE 1ST DRIVE AXLE RHS BOOSTER FAILED, AND TREADLE VALVE FAILED, TAG OUT. UNSIEZE BOOSTER AND TREADLE VALVE AND REMOVE. SOURCE NEW PARTS AND INSTALL. MAKE NEW AIR LINES AND SOURCE NEW AIR FITTINGS FOR BOOSTER. TEST OPERATION.					
20816	24903	10/06/2022	1HM105HB ID - NYRST# 105G	R	Sundries	1VT1293	9640.0000 0	OCTOBER MONTHLY PMI'S	165.54	0	0	0	165.54
								JOB CARRIED OUT - CARRY OUT PMI'S DURING OCTOBER.					
19130	23011	08/31/2022	1HM105HB ID - NYRST# 105G	R	Sundries	1VT1293	9640.0000 0	SEPTEMBER MONTHLY PMI	289.7	0	0	0	289.7
								JOB CARRIED OUT - CARRY OUT PMI'S DURING SEPTEMBER.					
18108	21147	08/09/2022	1HM105HB ID - NYRST# 105G	R	Sundries	1VT1293	9640.0000 0	REPAIR TAILGATE	165.54	0	0	0	165.54
								JOB CARRIED OUT - REALIGNED TAIL GATE LATCHES AND TEST OPERATION.					
18107	21845	08/09/2022	1HM105HB ID - NYRST# 105G	S	Service Ear	1VT1293	9640.0000 0	PMI'S AUGUST	331.08	0	0	0	331.08
								JOB CARRIED OUT - CARRY OUT PMI'S DURING AUGUST.					

17770	20701	08/03/2022	1HM105HB ID - NYRST# 105G	R	Sundries	1VT1293	9603.0000 0	REPAIR AIR LEAK AT TAILGATE	H30 - 1VT1293	165.54	0	0	60	225.54
									JOB CARRIED OUT - FOUND MULTIPLE AIR LEAKS AT TAILGATE AREA UNDER TRAY. REMOVED PRODUCT BUILDUP OFF COMPONENTS. REPLACED AIR FITTING ON LH SIDE UNDER TRAY. SHORTENED AIR LINE UNDER TRAY AND REFIT ON RH SIDE UNDER TRAY. TEST OPERATION.					
17464	20041	07/27/2022	1HM105HB ID - NYRST# 105G	S	Service Trai	1VT1293	9603.0000 0	S1A - 250 HR SERVICE	H30 - 1VT1293	124.16	101.86	0	0	226.02
16886	21240	07/14/2022	1HBGNYR# ID-NYRST# 105G	A	Suspensior	1VT1293	9501.0000 0	REPAIR BROKEN FRONT SPRINGS	H30 - 1VT1293	3476.37	2683.64	0	0	6160.01
									JOB CARRIED OUT - BOTH FRONT SPRINGS BROKEN. NEEDLE GUN AND WIRE WHEEL ALL PRODUCT OFF FRONT AXLE AND SPRINGS. U-BOLTS SIEZED, CUT OFF. DELIVER SPRINGS TO MOONAH SPRING WORKS. COLLECT NEW SPRINGS, INSTALL AND TENSION U-BOLTS. TEST OPERATION.					
16418	19429	07/04/2022	1HM105HB ID - NYRST# 105G	R	Brake	1VT1293	9501.0000 0	replace failed booster	H30 - 1VT1293	662.17	100.93	0	0	763.1
									JOB CARRIED OUT - LH REAR BOOSTER FAILED, ROD PIN SIEZED IN SLACK ADJUSTER. UNSIEZE AND CUT BOOSTER OUT, SET NEW BOOSTER LENGTH. INSTALL AND ADJUST BRAKES. COULD NOT ADJUST OTHERS DUE TO PRODUCT. CLEAN OFF PRODUCT FROM BRAKES TO ACCESS.					
15857	18415	06/22/2022	1HBGNYR# ID-NYRST# 105G	A	Brake	1VT1293	9501.0000 0	REPLACE BRAKE BOOSTER DUE TO PRODUCT BUILD UP	H30 - 1VT1293	228.03	0	0	0	228.03
									JOB CARRIED OUT - REMOVE AND REPLACE DAMAGED RH REAR BRAKE BOOSTER.					
15858	18417	06/22/2022	1HM105HB ID - NYRST# 105G	R	Electrical	1VT1293	9501.0000 0	REPAIR HEADLAMP	H30 - 1VT1293	76.01	0	0	20	96.01
									JOB CARRIED OUT - REPAIRED HEAD LAMP AND REPLACED GLOBE.					
15484	17927	06/10/2022	1HM105HB ID - NYRST# 105G	R	Engine	1VT1293	9489.0000 0	MIRROR + REVERSE LIGHT ISSUE	H30 - 1VT1293	152.02	0	0	0	152.02
									JOB CARRIED OUT - REPAIR AND RE-WIRE REVERSE LIGHT. RE-SECURE MIRROR.					

15452	19403	06/10/2022	1HM105HB ID - NYRST# 105G	R	Sundries	1VT1293	9486.0000 0	COMPLETE MONTHLY JUNE PMI	H30 - 1VT1293	228.03	0	0	0	228.03
									JOB CARRIED OUT - CARRY OUT PMI'S DURING JUNE.					
15003	17381	06/01/2022	1HM105HB ID - NYRST# 105G	R	Sundries	1VT1293	9486.0000 0	REPAIR TAILGATE LOCK OPERATION	H30 - 1VT1293	228.03	0	0	50	278.03
									JOB CARRIED OUT - TAIL GATE LOCKS GETTING STUCK ON. UNSIEZE ALL PINS AND ROD. LENGTHEN ROAD AND TEST OPERATION.					
14811	17396	05/27/2022	1HM105HB ID - NYRST# 105G	R	Sundries	1VT1293	9390.0000 0	REPAIR AIR LEAK	H30 - 1VT1293	190.03	112.44	0	30	332.47
									JOB CARRIED OUT - DIAGNOSE AND REPAIR AIR LEAK. UNSTICK REAR LATCHES.					
14043	16846	05/12/2022	1HM105HB ID - NYRST# 105G	R	Sundries	1VT1293	9390.0000 0	complete may monthly pmis	H30 - 1VT1293	38.01	0	0	0	38.01
									JOB CARRIED OUT - CARRIED OUT PMI'S DURING MAY.					
13794	17400	05/06/2022	1HM105HB ID - NYRST# 105G	R	Sundries	1VT1293	9390.0000 0	REPLACE FAILED HEATER TAP	H30 - 1VT1293	570.08	93.83	0	50	713.91
									JOB CARRIED OUT - REPLACE FAILED HEATER TAP.					
13500	15673	04/28/2022	1HM105HB ID - NYRST# 105G	R	Sundries	1VT1293	9390.0000 0	DIAGNOSE AIR LEAK	H30 - 1VT1293	114.02	0	0	60	174.02
									JOB CARRIED OUT - TRUCK NOT BUILDING AIR. FOUND AIR LINE RUBBED THROUGH. SOURCE JOINER AND REPAIR.					
12581	15159	04/04/2022	1HM105HB ID - NYRST# 105G	INT-R	Sundries	1VT1293	9282.0000 0	COMPLETE PMI'S APRIL	H30 - 1VT1293	152.02	0	0	0	152.02
									JOB CARRIED OUT - CARRY OUT PMI'S DURING APRIL.					
12563	14730	04/04/2022	1HM105HB ID - NYRST# 105G	S	Service Trai	1VT1293	9282.0000 0	S1B - 500HR SERVICE	H30 - 1VT1293	418.06	221.93	0	40	679.99
									JOB CARRIED OUT - CARRY OUT S1B SERVICE.					
12082	14557	03/23/2022	1HM105HB ID - NYRST# 105G	R	Sundries	1VT1293	9282.0000 0	COMPLETED WEEKLY PMI INSPECTION	H30 - 1VT1293	76.01	0	0	30	106.01
									JOB CARRIED OUT - CARRY OUT PMI'S DURING MARCH.					
11807	13872	03/16/2022	1HM105HB ID - NYRST# 105G	R	Electrical	1VT1293	9282.0000 0	REPAIR TAIL LIGHT OPERATION	H30 - 1VT1293	0	0	140	0	140
									JOB CARRIED OUT - FIND AND REPAIR BREAK IN TAIL LIGHT CIRCUIT.					

11806	13877	03/16/2022	1HM105HB ID - NYRST# 105G	R	Air Con	1VT1293	9282.0000 0	ASSES A/C OPERATION	H30 - 1VT1293	0	0	210	0	210
									JOB CARRIED OUT - TEST A/C. FOUND THE HEATER TAP STUCK PARTLY OPEN.					
11447	12883	03/08/2022	1HM105HB ID - NYRST# 105G	R	Electrical	1VT1293	9185.0000 0	REPAIR GAUGE FLICKERING TIDY UP TAIL LIGHT WIRING	H30 - 1VT1293	0	0	455	40	495
									JOB CARRIED OUT - REMOVE INSTRUMENT CLUSTER AND DISMANTLE. FOUND SEVERAL DRY SOLDER JOINTS ON THE CIRCUIT BOARD. REPAIR AND TEST GAUGES WORKING OK. TIDY UP TAIL LIGHT WIRING.					
11377	12887	03/07/2022	1HM105HB ID - NYRST# 105G	R	Sundries	1VT1293	9185.0000 0	REPLACE FAILED HUB SEAL	H30 - 1VT1293	1178.16	197.75	175	80	1630.91
									JOB CARRIED OUT - LH REAR HUB SEAL LEAK, REMOVE HUB, FOUND INNER WHEEL BEARING FAILED. REPLACE OIL SOAKED BRAKES, REPLACE BEARINGS AND SEALS. CLEAN UP BURRS ON AXLE TUBE, CUT OFF FAILED BEARING. REINSTALL COMPONENTS, ADJUST ALL BRAKES AND TEST.					
10518	13606	02/17/2022	1HM105HB ID - NYRST# 182G	R	Trays/Buck	1VT1293	9185.0000 0	REPAIR CRACKS IN TRAY	REPAIR CRACKS IN TRAY	1953.1	0	0	75	2028.1
9316		01/20/2022	1HM105HB ID - NYRST# 105G	R	Sundries	1VT1293	9185.0000 0	COMPLETE JANUARY 22 MONTHLY PMI'S	H30 - 1VT1293	0	0	0	0	0
									JOB CARRIED OUT - CARRY OUT PMI'S DURING JANUARY.					
9317		01/20/2022	1HM105HB ID - NYRST# 105G	A	Brake	1VT1293	9185.0000 0	PRODUCT BUILD CREATING BRAKE FAULTS	H30 - 1VT1293	0	0	0	0	0
									JOB CARRIED OUT - AS PER EMAIL CONVERSATIONS WITH NATHAN CLARK - PRODUCT NOT BEING WASHED OFF BRAKES, CAUSING BRAKE FAILURE.					
8278	10236	12/16/2021	1HM105HB ID - NYRST# 105G	R	Brake	1VT1293	9185.0000 0	INSPECT AND ADJUST PARK BRAKE OPERATION	H30 - 1VT1293	190.03	0	0	20	210.03
									JOB CARRIED OUT - INSPECT AND ADJUST PARK BRAKE, TEST OPERATION.					
7951	10249	12/10/2021	1HM105HB ID - NYRST# 105G	R	Sundries	1VT1293	9184.0000 0	WEEKLY PMI / REPAIRS	H30 - 1VT1293	304.04	0	0	0	304.04
									JOB CARRIED OUT - CARRY OUT WEEKLY PMI'S.					

7967	10254	12/10/2021	1HM105HB ID - NYRST# 105G	S	Service Trai	1VT1293	9184.0000 0	S1A 250HR SERVICE	H30 - 1VT1293	570.08	2327.58	0	0	2897.66
									JOB CARRIED OUT - CARRY OUT SERVICE AND CHECKOVER. LH REAR REVERSE LIGHT NOT WORKING. FOUND AND REPAIRED DAMAGED WIRING. TRAY UP SWITCHNOT HOLDING IN HOLD POSITION, SWITCH FAILED. SOURCE NEW SWITCH AND INSTALL.					
7392	8351	11/29/2021	1HM105HB ID - NYRST# 105G	INT-R	Electrical	1VT1293	9184.0000 0	COMPLETE GENERAL REPAIRS TO LIGHTS AND WIRING FAULTS	H30 - 1VT1293	266.04	0	0	0	266.04
									JOB CARRIED OUT - COMPLETE GENERAL REPAIRS TO LIGHTS AND WIRING FAULTS.					
7315	10225	11/25/2021	1HM105HB ID - NYRST# 105G	INT-R	Air Con	1VT1293	9147.0000 0	REPLACE A/C BELT AND DRIVE BELT	H30 - 1VT1293	228.03	297.38	280	0	805.41
									JOB CARRIED OUT - A/C ISSUES, FOUND BELT TENSION POOR, BELT STRETCHED. MOUNTS BROKEN, MODIFIED MOUNTS. DEGAS A/C SYSTEM. REPLACE BROKEN COMPRESSOR. VACUUM SYSTEM. LEAK TEST AND REGAS.					
6782	7918	11/12/2021	1HM105HB ID - NYRST# 105G	INT-R	Brake	1VT1293	9147.0000 0	Replace left rear brake booster	H30 - 1VT1293	570.08	38.91	0	0	608.99
									JOB CARRIED OUT - LH REAR SECOND DRIVE BOOSTER LEAKING AIR, CHISEL PRODUCT OFF. REMOVE SEIZED IN SLACK ADJUSTER. REPLACE LH REAR BRAKE BOOSTER. BOTH AIR LINES U/S. SOURCE NEW LINES AND FITTINGS, CUT LINES AND FIT.					
6355	8343	11/02/2021	1HM105HB ID - NYRST# 105G	INT-R	Sundries	1VT1293	9147.0000 0	COMPLETE NOVEMBER MONTHLY PMI'S	JOB CARRIED OUT - CARRY OUT PMI'S DURING NOVEMBER.	418.06	0	0	25	443.06
5561	6024	10/11/2021	1HM105HB ID - NYRST# 105G	INT-R	Air Con	1VT1293	8932.0000 0	REPAIR A/C SYSTEM	H30 - 1VT1293	0	57	385	75	517
									JOB CARRIED OUT - SOURCE FITTINGS. MAKE UP NEW HIGH PRESSURE HOSE. FIT NEW REVEIVER DRIER AND HOSE VACUUM SYSTEM AND REGAS.					

5006	4681	09/27/2021	1HM105HB ID - NYRST# 105G	INT-R	Sundries	1VT1293	8932.0000 0	REPAIR TAILGATE FAULT	H30 - 1VT1293	532.07	0	0	60	592.07
									JOB CARRIED OUT - TAIL GATE LOCKS NOT WORKING CORRECTLY, FOUND EXCESS PLAY IN PINS. REMOVE SEIZED PINS AND REPLACE. LUBE UP SYSTEM. FOUND TO BE OVER CAMMING, EWELDED PIECES OF 5MM PLATE TO TAIL GATE LOCKS TO SPACE OUT. TEST OPERATION, ALL OK.					
3340	3246	08/17/2021	1HM105HB ID - NYRST# 105G	INT-R	Hydraulic	1VT1293	8932.0000 0	FIT UP HYDRAULIC DCV TIPPER VALVE & PMI	H30 - 1VT1293	266.04	0	0	100	366.04
									JOB CARRIED OUT - HYD OIL LEAK REPORTED. FOUND FROM GAUGE AT FILTER HOUSING. REMOVE GAUGE, RE-TAP THREAD IN FITTING. SCREW IN BLANKING BOLT AND CHECK FOR LEAKS. CARRIED OUT PMI. REPLACED DCV VALVE. DRAINED HYD TANK DUE TO POOR OIL CONDITION. REPLACED HYD OIL. CARRIED OUT REPAIRS ON TILT CONTROLS.					
3048	3975	08/10/2021	1HM105HB ID - NYRST# 105G	INT-R	Air Con	1VT1293	8932.0000 0	INSPECT / REPAIR A/C SYSTEM	H30 - 1VT1293	0	0	140	0	140
									JOB CARRIED OUT - INSPECT/REPAIR A/C SYSTEM.					
2973	2549	08/09/2021	1HM105HB ID - NYRST# 105G	INT-R	Brake	1VT1293	8932.0000 0	INSPECT PARK BRAKE OPERATION	H30 - 1VT1293	114.02	0	0	0	114.02
									JOB CARRIED OUT - INSPECT PARK BRAKE OPERATION. ADJUSTED INTERMEDIATE AXLE, SLACK ADJUSTERS. TESTED OPERATION.					
2759	3286	08/03/2021	1HM105HB ID - NYRST# 105G	INT-S	Service Trai	1VT1293	8932.0000 0	S1A - 250HR SERVICE	H30 - 1VT1293	532.08	146.42	0	0	678.5
									JOB CARRIED OUT - CARRY OUT S1A SERVICE.					
2585	2489	07/29/2021	1HM105HB ID - NYRST# 105G	INT-R	Sundries	1VT1293	8932.0000 0	replace x2 tailgate cylinders	H30 - 1VT1293	418.06	539.8	0	30	987.86
									JOB CARRIED OUT - ATTENDED TO MULTIPLE AIR LEAKS, NOT ALLOWING REAR TAIL GATE LATCHES. DIAGNOSED TANK DRAIN NOT SEALING, ALSO AIR CYLINDERS LEAKING DUE TO PRODUCT COMPROMISING THE SEAL. REPLACED CYLINDERS AND CLEANED PRODUCT.					

210517-00 SVC0026507/22/2021 1HBGNYR ID-NYRSTA105_HBGN R Engine 1VT1293 Replace Coolant Hose H30 - 1VT1293 0 67.75 0 50 117.75																
JOB CARRIED OUT - REPLACE COOLANT HOSE AND FILL WITH COOLANT.																
1273 1000 06/29/2021 1HM105HB ID - NYRSTA105G INT-R Electrical 1VT1293 8932.0000 0 REPAIR L/H SIDE HEAD LIGHT & PMI H30 - 1VT1293 0 0 105 0 105																
JOB CARRIED OUT - REMOVED SEIZED BOLTS HOLDING HEAD LIGHT IN POSITION. REPLACE BLOWN GLOBE.																
210107-00 SVC0025906/23/2021 1HBGNYR ID-NYRSTA105_HBGN A Sundries 1VT1293 8725 REPAIR ENVIRO DAMAGE AIR LINES H30 - 1VT1293 72.7 81 0 40 193.7																
ODOMETER - 8725 HOURS																
JOB CARRIED OUT - AIR LINES TO TAIL GATE LOCK CYLINDERS DAMAGED DUE TO CATCHING ON PRODUCT. SOURCE NEW FITTINGS AND REPLACE. CABLE TIE LINES NEATLY.																
210416-00 SVC0026406/23/2021 1HBGNYR ID-NYRSTA105_HBGN R Sundries 1VT1293 8855 HRS REPLACE R/H SIDE DOOR LATCH H30 - 1VT1293 327.15 259.59 0 80 666.74																
ODOMETER - 8855 HOURS																
JOB CARRIED OUT - ASSESS DOOR LATCH OPERATION. TEMP REPAIR UTIL NEW ONE ARRIVES. INSTALLED NEW DOOR LATCH AND TESTED OPERATION.																
210517-01 SVC0026506/23/2021 1HBGNYR ID-NYRSTA105_HBGN R Hydraulic 1VT1293 REPLACE HYD 3 STAGE RAM H30 - 1VT1293 436.2 2255 0 0 2691.2																
JOB CARRIED OUT - WASHED OIL OFF RAM ASSY. DROVE TRUCK TO LA FOR REPAIRS. ASSISTED WITH DCV VALVE REMOVAL AND REPAIRS. REASSEMBLED VALVE AND TESTED OPERATION.																
999 1020 06/23/2021 1HM105HB ID - NYRSTA105G INT-R Sundries 1VT1293 8926.0000 0 COMPLETE WEEKLY PMI INSPECTION H30 - 1VT1293 111.56 0 0 50 161.56																
JOB CARRIED OUT - CARRY OUT WEEKLY PMI.																
210527-00 SVC0026506/18/2021 1HBGNYR ID-NYRSTA182_INT R Lathe 1VT1293 REPAIRS TO TRAY PIVOT SHAFT REPAIRS TO TRAY PIVOT SHAFT 1VT1293 1989.48 192.58 0 0 2182.06																
GOUGE OUT SEIZED PIN, MEASURE & RESIZE BORE, MACHINE PIN, BUSHES & COLLARS, FIT PIVOT ASSEMBLY, WELD ON COLLARS & GREASE																

647	3247	06/15/2021	1HM105HB ID - NYRST# 105G	INT-R	Hydraulic	1VT1293	2.0000	0	REPLACE DCV HYDRAULIC TIPPER VALVE	H30 - 1VT1293	0	812	0	0	812
										JOB CARRIED OUT - REPALCE DCV HYDRAULIC TIPPER VALVE.					
210525-00	SVC002649	06/03/2021	1HBGNYS ID-NYRSTA186_INT	R	Hydraulic	1VT1293	310783 KM		FIT UP CYLINDER	UNIT: 1VT1293 ODOMETER: 310,783 KMS 8900 HRS	1352.1	452.7	0	50	1854.8
										REMOVED THE LHS LADDER OF THE TRAY TO ALLOW REMOVAL OF THE HYDRAULIC TANK WHILE MACHINE SHOP WAS REPAIRING THE PIVOTS. REMOVED THE HYDRAULIC TANK AND CLEANED. REFITTED THE TANK AND WELDED LADDER BACK IN POSITION. REMOVED FILTER HOUSING FROM SECOND HAND AGITATOR TANK AND FITTED UP TO THE VEHICLE. PLUMBED IN WITH NEW HOSE ,AND FITTINGS. FILLED HYDRAULIC TANK AND FITTED NEW FILTER. REMOVED OLD CYLINDER AND MODIFIED MOUNTS ON THE FEET OF THE NEW CYLINDER TO PICK UP MOUNTING HOLES. FITTED NEW CYLINDER AND CHECKED OPERATION. NOTE. VEHICLE RETURNED TO NYSTAR TO HAVE PRODUCT REMOVED FROM THE TRAY TO ALLOW SAFE REMOVAL OF THE HYDRAULIC CYLINDER.					
28	1447	05/31/2021	1HM105HB ID - NYRST# 105G	INT-R	Trays/Buck	1VT1293	0.0000	0	1VT1293 - TRAY UP FAULT	H30 - 1VT1293	1152.74	76.2	264.24	0	1493.18
										JOB CARRIED OUT - REPORTED TRAY RAISING IN HOLD AND TRAY UP POSITION. REMOVED CONTROL VALVE AND CLEANED, STILL FAULTING. PISTON SEAT FOUND NOT SEATING. REMOVED AND LA MACHINED. REFITTED AND TESTED, NO FAULT FOUND.					

210225-00	SVC002651	05/29/2021	1	HBGNYR	ID-NYRSTA1	105_HBGN	R	Steering	1VT1293									REPLACE POWERSTEERING HOSE	H30 - 1VT1293	218.1	440.24	0	60	718.34
																			ODOMETER - 8794 HOURS					
																			JOB CARRIED OUT - ASSESSED POWER STEERING LEAK. CALLED PIRTEK TO MAKE X2 STEER HOSES. REMOVED DAMAGED HOSES AND FITTED NEW ONES.					
210323-00	SVC002651	05/29/2021	1	HBGNYR	ID-NYRSTA1	105_HBGN	R	Air Con	1VT1293									REPLACE A/C AVAPERATOR/DRYER	H30 - 1VT1293	254.45	212.42	1085	0	1551.87
																			ODOMETER - 8830 HOURS					
																			JOB CARRIED OUT - A/C REPORTED NOT WORKING. CHECK ALL ELECTRICAL, ALL OK. CONNECT GAUGES, NO GAS IN SYSTEM. FILL WITH NITROGEN AND LOCATE LEAK FORM EVAPORATOR. SOURCE NEW EVAPORATOR AND RECEIVER DRIER.					
210401-00	SVC002651	05/29/2021	1	HBGNYR	ID-NYRSTA1	105_HBGN	S	Service	1VT1293	310356	KL							S1A 250 HR SERVICE	H30 - 1VT1293	109.05	119.47	0	30	258.52
																			ODOMETER - 8839 HOURS					
																			JOB CARRIED OUT - CARRY OUT SERVICE.					
210416-00	SVC002651	05/29/2021	1	HBGNYR	ID-NYRSTA1	105_HBGN	R	Engine	1VT1293	8855	HRS							DIAGNOSE ENGINE SHUT OFF LIGHT	H30 - 1VT1293	181.75	0	0	40	221.75
																			ODOMETER - 8855 HOURS					
																			JOB CARRIED OUT - DIAGNOSE ENGINE SHUT OFF LIGHT. FOUND COOLANT TO BE LOW. TOPPED UP AND CHECKED FOR LEAKS.					
210217-00	SVC002641	05/22/2021	1	HBGNYR	ID-NYRSTA1	105_HBGN	R	Air Con	1VT1293									Repair A/C fault	H30 - 1VT1293	72.7	4.56	0	0	77.26
																			ODOMETER - 8784 HOURS					
																			JOB CARRIED OUT - DIAGNOSE A/C BLOWER FAN FAULT. BAD CONTACT IN ELECTRICAL PLUG. REMOVE DASH AND FIND FAULT.					
210517-00	SVC002641	05/20/2021	1	HBGNYR	ID-NYRSTA1	184_INT	R	Sundries	1VT1293	310,771	KM							CALL OUT INSPECT COOLANT AND H	CALL OUT INSPECT COOLANT AND HYDRAULIC LEAKS FORWARD PHOTOS TO ANDREW DALCO TRAVEL NYRSTAR AND RETURN	377	0	0	87.5	464.5

201218-00	SVC00257	01/13/2021	1HBGN YR	ID-NYRSTA	105_HBGN R	Brake	1VT1293	8686	Inspect/adjust brakes	H30 - 1VT1293	109.05	0	0	10	119.05
ODOMETER - 8686 HOURS															
JOB CARRIED OUT - HANDBRAKE NOT HOLDING WHEN LOADING, ADJUSTED ALL BRAKES AND GREASED.															
201201-00	SVC00257	12/16/2020	1HBGN YR	ID-NYRSTA	105_HBGN S	Service	1VT1293	8675	S1A - 250 HR SERVICE	H30 - 1VT1293	218.1	203.18	0	40	461.28
ODOMETER - 8675 HOURS															
JOB CARRIED OUT - CARRY OUT S1A SERVICE.															
201209-00	SVC00257	12/16/2020	1HBGN YR	ID-NYRSTA	105_HBGN R	Sundries	1VT1293	8680	Repair air leaks	H30 - 1VT1293	218.1	55	0	0	273.1
ODOMETER - 8680 HOURS															
JOB CARRIED OUT - REPAIR AIR LEAKS. REPLACE MIDDLE AXLE RH BRAKE BOOSTER. REPAIR SMALL AIR LEAKS AT TANK.															
201105-00	SVC00255	11/16/2020	1HBGN YR	ID-NYRSTA	105_HBGN R	Electrical	1VT1293	8640	REPLACED FAILED REVERSE ALARM	H30 - 1VT1293	109.05	56.5	0	10	175.55
ODOMETER - 8640 HOURS															
JOB CARRIED OUT - REPLACE FAILED REVERSE ALARM.															
201111-00	SVC00255	11/16/2020	1HBGN YR	ID-NYRSTA	105_HBGN R	Electrical	1VT1293		FIT UP NEW CHARGE RELAY	H30 - 1VT1293	0	184.35	0	0	184.35
JOB CARRIED OUT - SUPPLY CHARGE RELAY.															
200922-00	SVC00253	09/29/2020	1HBGN YR	ID-NYRSTA	105_HBGN A	Engine	1VT1293	8575	REPLACE LOST COOLENT RES CAP	H30 - 1VT1293	36.35	10.22	0	0	46.57
ODOMETER - 8575 HOURS															
JOB CARRIED OUT - COOLANT OVERFLOW CAP MISSING. FIT NEW COOLANT CAP.															

200827-00	SVC00251	09/11/2020	1HBGNYR	ID-NYRSTA	105_HBGN R	Electrical	1VT1293	8521	REPAIR CAB ALARM & RADIO	H30 - 1VT1293	363.5	0	0	20	383.5
										ODOMETER - 8521 HOURS					
										JOB CARRIED OUT - DIAGNOSE FAULT WITH STEREO. REPAIR ALARM BUZZER, RANDOMLY SETTING OFF. DISASSEMBLED DASH, CLEANED ALL PLUGS AND TESTED OPERATION. PULLED DASH APART, FOUND ARIEL WIRE PLUG NOT WIRED CORRECTLY. REMOVED AND REFITTED CORRECTLY AND TESTED.					
200727-00	SVC00250	08/12/2020	1HBGNYR	ID-NYRSTA	105_HBGN R	Sundries	1VT1293	8459	REPAIR TAILGATE LOCKS	H30 - 1VT1293	254.45	130.62	0	30	415.07
										ODOMETER - 8459 HOURS					
										JOB CARRIED OUT - ASSESS AND REPAIR TAIL GATE LOCKS.					
200721-00	SVC00249	07/24/2020	1HBGNYR	ID-NYRSTA	105_HBGN R	Bodywork	1VT1293	8453	REPAIR TAIL GATE CRACKS	H30 - 1VT1293	254.45	0	0	80	334.45
										ODOMETER - 8453 HOURS					
										JOB CARRIED OUT - CLEANED CRACKS IN TAIL GATE AND WELDED. PAINTED BARE METAL. CLEANED HYDRAULIC COOLER.					
200617-00	SVC00248	07/22/2020	1HBGNYR	ID-NYRSTA	105_HBGN S	Service	1VT1293	8448	S1A - 250 HRS SERVICE	H30 - 1VT1293	218.1	239.81	0	0	457.91
										ODOMETER - 8448 HOURS					
										JOB CARRIED OUT - CARRY OUT SERVICE AND CHECKOVER.					
200624-00	SVC00248	06/26/2020	1HBGNYR	ID-NYRSTA	105_HBGN R	Sundries	1VT1293	8411	COMPLETED PMI INSPECTION	H30 - 1VT1293	109.05	0	0	40	149.05
										ODOMETER - 8411 HOURS					
										JOB CARRIED OUT - CARRIED OUT PMI.					

200611-00	SVC002477	06/18/2020	1HBGNYR	ID-NYRSTA105_HBGN A	Brake	1VT1293	8396	Repair Rear Brakes	H30 - 1VT1293	1563.05	254.54	0	80	1897.59
									ODOMETER - 8396 HOURS					
									JOB CARRIED OUT - CLEAN REAR AXLE TO ACCESS BOOSTERS AND BRAKE BACKING PLATES. NEEDLE GUN QUICK RELEASE VALVES AND CHASSIS BULK HEADS. REMOVE WHEELS AND HUBS TO INSPECT BRAKE LININGS. REMOVE BACKING PLATES TO ALLOW ACCESS WHEN WASHING. REPLACE RH SIDE SLACK ADJUSTER. OXY CUT BOOSTER MOUNT BOLTS. REPLACE BOTH REAR AXLE BRAKE BOOSTERS. ADJUST BRAKES AND TEST OPERATION.					
200616-00	SVC002477	06/18/2020	1HBGNYR	ID-NYRSTA105_HBGN R	Sundries	1VT1293	8402HRS	REPAIR CAB LIFT JACK	H30 - 1VT1293	72.7	0	0	20	92.7
									ODOMETER - 8402 HOURS					
									JOB CARRIED OUT - REMOVE FAILED FITTING AND REPAIRED. REFITTED INTO CAB LIFT JACK. TOPPED UP OIL AND TESTED OPERATION.					
200616-00	SVC002477	06/18/2020	1HBGNYR	ID-NYRSTA105_HBGN R	Tyres	1VT1293	8402 HRS	Re-tension wheel nuts	H30 - 1VT1293	109.05	0	0	0	109.05
									ODOMETER - 8402 HOURS					
									JOB CARRIED OUT - RETENSION ALL WHEEL NUTS.					
200528-00	SVC002449	06/05/2020	1HBGNYR	ID-NYRSTA105_HBGN R	Electrical	1VT1293	8374	replace failed battery	H30 - 1VT1293	254.45	319.11	0	30	603.56
									ODOMETER - 8374 HOURS					
									JOB CARRIED OUT - REPLACED FAILED BATTERY.					

200601-00	SVC00247	06/05/2020	1HBGNYR	ID-NYRSTA	105_HBGN R	Brake	1VT1293	8385	DIAGNOSE BRAKE ISSUE	H30 - 1VT1293	690.65	179.68	0	50	920.33
										ODOMETER - 8385 HOURS					
										JOB CARRIED OUT - DIAGNOSE BRAKE ISSUE. BRAKES LOCKING ON CAUSING FLAT SPOTS ON THE TYRES. FOUND SLACK ADJUSTERS SEIZED DUE TO EXCESSIVE PRODUCT AND INCORRECT WASHING. REMOVED, REPLACED AND ADJUSTED BRAKES. FOUND EXCESSIVE PRODUCT AROUND QUICK RELEASE VALVES CAUSING BRAKES TO SLOW RELEASE. REMOVED AND CLEARED ALL PRODUCT.					
200501-00	SVC00246	05/22/2020	1HBGNYR	ID-NYRSTA	105_HBGN R	Sundries	1VT1293		MAY - MONTHLY PMI'S	H30 - 1VT1293	181.75	0	0	0	181.75
										JOB CARRIED OUT - CARRY OUT PMI'S DURING MAY.					
200408-00	SVC00245	05/07/2020	1HBGNYR	ID-NYRSTA	105_HBGN R	Sundries	1VT1293		APRIL - MONTHLY PMI'S	H30 - 1VT1293	327.15	0	0	0	327.15
										JOB CARRIED OUT - CARRY OUT PMI'S DURING APRIL.					
200414-00	SVC00244	04/28/2020	1HBGNYR	ID-NYRSTA	105_HBGN R	Steering	1VT1293	8324	CALL-OUT LEAKING STEERING BOX	H30 - 1VT1293	1403.83	2974.08	0	50	4427.91
										ODOMETER - 8324 HOURS					
										JOB CARRIED OUT - CALL OUT TO WHARF. ASSESS OIL LEAK. FOUND STEERING BOX TO BE LEAKING FROM SHAFT SEALS. DRAIN FLUID, REMOVE DRAG LINK AND PRESSURE LINES. REMOVE STEERING BOX AND SOURCE NEW ONE. FIT UP NEW BOX, RECONNECT ALL COMPONENTS. SWAP PITMAN ARM OVER. FOLLOW BLEED UP PROCEDURE AND TEST. DROPPED OLD STEERING BOX AT LA, PACKED FOR PICK UP.					

200211-00	SVC00240	04/23/2020	1HBGN YR	ID-NYRSTA	186_INT	A	Bodywork	1VT1293	8225	REPAIR DAMAGE	UNIT: 1VT1293 HRS	ODOMETER: 8225	912.19	741.77	0	45.5	1699.46
											JK1 - TEMP REPAIRS TO FUEL TANK AND AIR TANKS FOR REMOVAL OFF SITE						
											BC5 - ASSISTED WITH REPAIRS AND DELIVERY TO LAMPTON AVENUE.						
											REMOVED AIR RECIEVERS AND STRAIGHTENED DAMAGED AIR RECIEVER MOUNTING BRACKETS. REPLACED RETAINING STRAPS. PAINTED STRAIGHTENED BRACKETS AND REFITTED THE AIR RECIEVERS. TENSIONED RETAINING STRAPS. ORDER FUEL TANK AND STRAIGHTEN J BRACKETS.						
200306-00	SVC00243	04/16/2020	1HBGN YR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293		March PMI's	H30 - 1VT1293		399.85	0	0	30	429.85
											JOB CARRIED OUT - CARRY OUT WEEKLY PMI DURING MARCH.						
200331-00	SVC00244	04/16/2020	1HBGN YR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293	8300	REPAIR L/H&RH WINDOW'S	H30 - 1VT1293		109.05	0	0	0	109.05
											ODOMETER - 8300 HOURS						
											JOB CARRIED OUT - REMOVED DOOR TRIMS TO DIAGNOSE WINDOWS NOT WORKING. TRACED TO DRY CHANNELS, LUBRICATED. CLEANED WINDOW SWITCH CONTACTS.						
200324-00	SVC00243	03/29/2020	1HBGN YR	ID-NYRSTA	105_HBGN	R	Brake	1VT1293	8298HRS	REPAIR SEIZED BRAKE PEDAL	H30 - 1VT1293		181.75	0	0	10	191.75
											ODOMETER - 8298 HOURS						
											JOB CARRIED OUT - ASSESS BRAKES LOCKING ON. REMOVED SEIZED BRAKE PEDAL. REMOVE SEIZED PIN FROM PEDAL, CLEANED UP AND RE-FITTED. FITTED PEDAL BACK IN TRUCK AND TEST OPERATION.						
200129-00	SVC00240	03/18/2020	1HBGN YR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293	8258	FREBRUARY - PMI'S	H30 - 1VT1293		399.85	0	70	100	569.85
											ODOMETER - 8258 HOURS						
											JOB CARRIED OUT - CARRY OUT PMI. ASSESS CONDITION. GREASE UNIT AND CHECK FOR DAMAGES.						

200224-00	SVC00241	03/18/2020	1	HBGNYR	ID-NYRSTA	105_HBGN	A	Electrical	1VT1293		IGNITION LEFT ON	H30 - 1VT1293	290.8	0	0	0	290.8
												ODOMETER - 8256 HOURS					
												JOB CARRIED OUT - CALL OUT TO FLAT BATTERY. CALLED OUT SECOND TIME TO FLAT BATTERY. TESTED CHARGE RATE, LIGHTS HAD BEEN LEFT ON.					
200224-00	SVC00240	03/18/2020	1	HBGNYR	ID-NYRSTA	105_HBGN	R	Electrical	1VT1293	8258	DIAGNOSE BATTERY DRAIN ISSUE	H30 - 1VT1293	0	0	140	0	140
												ODOMETER - 8258 HOURS					
												JOB CARRIED OUT - TEST FOR CURRENT DRAW WHEN ALL IS TURNED OFF. 0.02 AMPS. TEST WITH ACCESSORIES LEFT ON, IT HAS ENOUGH CURRENT TO DRAW TO FLATTEN THE BATTERIES IN A SHORT PERIOD OF TIME. LABLE IGNITION TO LET OPERATOR KNOW TO TURN THE KEY STRAIGHT UP AND DOWN FOR OFF.					
200306-00	SVC00242	03/18/2020	1	HBGNYR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293	8262	REPAIR RH DOOR JAMMING	H30 - 1VT1293	145.4	0	0	30	175.4
												ODOMETER - 8262 HOURS					
												JOB CARRIED OUT - DISASSEMBLED DRIVERS SIDE DOOR. REMOVED DOOR LATCH, CLEANED AND LUBED LATCH. REINSTALLED DOOR LATCH AND TESTED OPERATION. REASSEMBLED DOOR.					
200106-00	SVC00238	02/26/2020	1	HBGNYR	ID-NYRSTA	182_INT	A	Sundries	1VT1293		REPAIR DAMAGED HEADBOARD	Unit 1VT1293	1392.7	253.4	0	150	1796.1
												Cut and remove damaged headboard section from tray.					
												Straighten up bent front top section of tray.					
												Grind and prep straightened section for fabrication.					
												Cut, press and process new top section of headboard.					
												Weld new top section to tray frame.					
												Prep and paint repair.					
												Inspect structure of frame post repairs.					

200129-00	SVC00240	02/25/2020	1HBGNYR	ID-NYRSTA	105_HBGN S	Service	1VT1293	8243	S1B - 500HR SERVICE	H30 - 1VT1293	254.45	55.76	0	100	410.21
										ODOMETER - 8243 HOURS					
										JOB CARRIED OUT - CARRY OUT SERVICE.					
200218-00	SVC00241	02/25/2020	1HBGNYR	ID-NYRSTA	105_HBGN R	Sundries	1VT1293	8243	REPAIR WINDOW RUNNERS	H30 - 1VT1293	145.4	0	0	40	185.4
										ODOMETER - 8243 HOURS					
										JOB CARRIED OUT - REMOVED RH DOOR SKIN TO ACCESS WINDOW RAILS. CLEAN GUIDES, REATTACH RUNNER TO DOOR. LUBE WINDOW RUBBERS WITH GRAPHITE POWDER. TEST OPERATION AND REASSEMBLED DOOR. REPEATED PROCESS ON LH SIDE DOOR.					
200214-00	SVC00241	02/19/2020	1HBGNYR	ID-NYRSTA	105_HBGN R	Sundries	1VT1293	8240	RELOCATE PTO SWITCH	H30 - 1VT1293	36.35	0	70	20	126.35
										ODOMETER - 8240 HOURS					
										JOB CARRIED OUT - FABRICATE ADAPTOR TO REFIT PTO SWITCH.					
200130-00	SVC00240	02/18/2020	1HBGNYR	ID-NYRSTA	105_HBGN R	Brake	1VT1293	8217	DIAGNOSE LONG BRAKE PEDAL	H30 - 1VT1293	254.45	0	0	30	284.45
										ODOMETER - 8217 HOURS					
										JOB CARRIED OUT - DIAGNOSE LONG BRAKE PEDAL. OPERATOR REPORTED BRAKES WEAK AND PEDAL GOING A LONG WAY. TEST RUN AND FOUND OUT OF ADJUSTMENT, 8MM WEAR LEFT. ADJUST ALL BRAKES AND TEST RUN.					
200206-00	SVC00241	02/18/2020	1HBGNYR	ID-NYRSTA	105_HBGN R	Electrical	1VT1293	8229	REPAIR REVERSE LIGHTS @ BEEPER	H30 - 1VT1293	36.35	58.9	0	10	105.25
										ODOMETER - 8229 HOURS					
										JOB CARRIED OUT - REPLACE FAULTY REVERSE BEEPER.					

191220-00	SVC002385	02/13/2020	1HBGN YR	ID-NYRSTA186_INT	R	Sundries	1VT1293	8172	REPAIRS AS PER LOG BOOK	UNIT 1VT1293 ODOMETER 8172 HOURS	1817.5	377.65	0	0	2195.15
									REPAIRS AS PER LOG BOOK. DISASSEMBLE DASH AND FITTED UP NEW HAZARD LIGHT SWITCH AND MODIFY SWITCH WIRING. MOUNTED TRAY UP LIGHT CLOSER TO THE DRIVER. CHECKED FAULT WITH HEATER NOT WORKING. REMOVED THE HEATER AND CLEANED. REFITTED AND CHECKED STILL RUNNING COLD. REMOVED THE THERMOSTAT AND CHECKED, STUCK OPEN. FITTED NEW THERMOSTAT AND TESTED. STILL RUNNING COLD. REMOVED ALL HOSES AND CHECKED FOR BLOCKAGES. OK. REMOVED THE WATER PUMP AND CHECKED CONDITION OK. REMOVED TRANS COOLER AND CHEKCED FOR BLOCKAGES OK. CHECKED PLUMBING AND FOUND PLUMBED INCORRECTLY FROM FACTORY. PLUMBED UP CORRECTLY AND						
200103-00	SVC002395	01/30/2020	1HBGN YR	ID-NYRSTA105_HBGN R		Sundries	1VT1293		JANUARY - PMI'S	H30 - 1VT1293	145.4	0	0	0	145.4
										JOB CARRIED OUT - CARRY OUT PMI'S DURING JANUARY.					
200124-00	SVC002395	01/30/2020	1HBGN YR	ID-NYRSTA105_HBGN A		Sundries	1VT1293		ASSES & INSPECT TIPPER BODY	H30 - 1VT1293	145.4	0	0	0	145.4
										JOB CARRIED OUT - ASSESS AND INSPECT TIPPER BODY. COMPLETE FULL INSPECTION ON TIPPER BODY AND MOUNTING POINTS. CHECKED ALL LIFTING HOIST MOUNTING POINTS FOR CRACKS AND DAMAGE, OK. CHECKED IMPACT POINTS ON BODY, SCUFFING OF PAINT BUT OK. OVERALL ASSESSMENT IS OK.					
200108-00	SVC002387	01/24/2020	1HBGN YR	ID-NYRSTA181_INT	R	Bodywork	1VT1293		PAINT REPAIRED HEAD BOARD	UNIT 1VT1293	363.5	114.3	0	25	502.8
										PAINT HEAD BOARD AS REQUIRED					

200113-01	SVC002396	01/24/2020	1HBGNYR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293		LUBE TAIL GATE LOCKS	H30 - 1VT1293	109.05	0	0	0	109.05
											JOB CARRIED OUT - CLEANED UP TAIL GATE LOCK AND MECHANISM. LUBED UP LINKAGES AND TEST OPERATION.					
191127-00	SVC002369	01/20/2020	1HBGNYR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293	8180	DECEMBER - PMI'S	H30 - 1VT1293	327.15	0	0	100	427.15
											ODOMETER - 8180 HOURS					
											JOB CARRIED OUT - CARRY OUT PMI'S DURING DECEMBER. DASH DROPPING OUT, REMOVE WIRING AND INSPECT CLUSTER, COULD NOT FAULT.					
200110-00	SVC002396	01/20/2020	1HBGNYR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293	8186	HOIST WILL NOT LIFT	H30 - 1VT1293	254.45	0	0	0	254.45
											ODOMETER - 8186 HOURS					
											JOB CARRIED OUT - PTO NOT ENGAGING. PLUGGED WIRES BACK INTO BACK OF SWITCH. REMOVED DASH PANELS TO REPAIR WINDOW SWITCH AND STEREO POWER FAULTS. REASSEMBLE DASH. TEST OPERATION OF ALL REPAIRS.					
191203-00	SVC002376	12/04/2019	1HBGNYR	ID-NYRSTA	105_HBGN	A	Electrical	1VT1293	8159	LIGHTS LEFT ON - JUMP START	H30 - 1VT1293	72.7	0	0	0	72.7
											ODOMETER - 8159 HOURS					
											JOB CARRIED OUT - JUMP START VEHICLE - LIGHTS WERE LEFT ON. JUMP START VEHICLE AT WHARF. HAD TO CONNECT JUMP PACK AND UTE TO VEHICLE, AS EXCESSIVLY FLAT. CHECKED CHARGE RATE, ALL OK.					
191031-00	SVC002354	11/27/2019	1HBGNYR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293	8121	NOVEMBER - PMI'S	H30 - 1VT1293	399.85	131.22	0	0	531.07
											ODOMETER - 8121 HOURS					
											JOB CARRIED OUT - CARRY OUT PMI'S DURING NOVEMBER.					

190703-00	SVC002304	11/08/2019	1HBGNYR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293		PROTECT WHEEL ARCHES	H30 - 1VT1293	508.9	230.97	0	50	789.87
											JOB CARRIED OUT - COLLECT ITEMS. PRESSURE WASH OFF PRODUCT FROM UNDER TRAY. NEEDLE GUN OFF HARD PRODUCT. WASH AND DRY OFF SURFACE AND PREPARE FOR SPRAYING OF TAR SEALER. COMPLETE SPRAYING AND CLEAN UP EQUIPMENT.					
190816-00	SVC002316	11/08/2019	1HBGNYR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293		ASSESS HEATER OPERATION	H30 - 1VT1293	72.7	0	0	0	72.7
											JOB CARRIED OUT - ASSESS HEATER OPERATION.					
190930-00	SVC002337	10/30/2019	1HBGNYR	ID-NYRSTA	105_HBGN	S	Service	1VT1293	8085	S1A - 250HR SERVICE	H30 - 1VT1293	218.1	273.38	0	40	531.48
											ODOMETER - 8085 HOURS					
											JOB CARRIED OUT - CARRY OUT SERVICE AND CHECKOVER. WASH CORES AND ENGINE BAY.					
190930-00	SVC002337	10/30/2019	1HBGNYR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293		OCTOBER - PMI'S	H30 - 1VT1293	799.7	0	140	0	939.7
											JOB CARRIED OUT - CARRY OUT PMI'S DURING OCTOBER.					
190827-00	SVC002327	09/30/2019	1HBGNYR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293		SEPTEMBER - MONTHLY PMI	H30 - 1VT1293	908.75	0	0	130	1038.75
											JOB CARRIED OUT - CARY OUT PMI'S DURING SEPTEMBER.					
190906-00	SVC002333	09/18/2019	1HBGNYR	ID-NYRSTA	105_HBGN	R	Electrical	1VT1293	7994	FAULTY BRAKE LIGHT SWITCH	H30 - 1VT1293	72.7	119.8	210	20	422.5
											ODOMETER - 7994 HOURS					
											JOB CARRIED OUT - TEST BRAKE LIGHTS. FIND AND REPAIR BREAK IN BRAKE AND TAIL LIGHT HARNESS. REMOVED AND REPLACED BRAKE SWITCH AND TEST OK.					
190809-00	SVC002327	09/13/2019	1HBGNYR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293		AUGUST - PMI INSPECTIONS	H30 - 1VT1293	545.25	177.18	0	0	722.43
											JOB CARRIED OUT - CARRY OUT PMI'S DURING AUGUST.					

190821-00	SVC00232	09/13/2019	1HBGNYR	ID-NYRSTAI105_HBGN R	Electrical	1VT1293	7977	REPLACE REAR TAIL LIGHTS	H30 - 1VT1293	109.05	188	140	80	517.05
									ODOMETER - 7977 HOURS					
									JOB CARRIED OUT - ASSESS REAR TAIL LIGHT OPERATION, FOUND TO BE FAULTY LIGHTS. SOURCED WATER PROOF LENSES, FIT NEW LED TAIL LIGHTS.					
190809-00	SVC00231	08/20/2019	1HBGNYR	ID-NYRSTAI105_HBGN R	Brake	1VT1293	7944	REPLACDE BRAKE SLACK ADJUSTERS	H30 - 1VT1293	472.55	162.08	0	40	674.63
									ODOMETER - 7944 HOURS					
									JOB CARRIED OUT - DISCUSSED CONCERNS AROUND PRODUCT DAMAGE WITH LUCAS. CLEAN BRAKE AREA AND REMOVE X4 BRAKE SLACK ADJUSTERS. SAMPLE AFTERMARKET ADJUSTERS TO MINIMISE COST. REFIT NEW ADJUSTERS, ADJUST BRAKES AND TEST.					
190806-00	SVC00231	08/15/2019	1HBGNYR	ID-NYRSTAI105_HBGN R	Sundries	1VT1293		BRAKE BOOSTERS PARTS ONLY	H30 - 1VT1293	0	100	0	0	100
									JOB CARRIED OUT - PARTS ONLY - BRAKE BOOSTER.					
190506-00	SVC00227	08/07/2019	1HBGNYR	ID-NYRSTAI105_HBGN R	Sundries	1VT1293		COMPLETE PMI 6/5/19	H30 - 1VT1293	72.7	0	0	0	72.7
									JOB CARRIED OUT - CARRY OUT PMI.					
190506-00	SVC00227	08/07/2019	1HBGNYR	ID-NYRSTAI105_HBGN R	Sundries	1VT1293		REPLACE TAIL GATE STOP	H30 - 1VT1293	218.1	0	0	0	218.1
									JOB CARRIED OUT - MODIFY TAIL GATE STOP TO SUIT OPERATION.					
190506-00	SVC00227	08/07/2019	1HBGNYR	ID-NYRSTAI105_HBGN R	Engine	1VT1293		FAILED COMPRESSOR LINE	H30 - 1VT1293	290.8	185.31	0	0	476.11
									REPLACE FATIGUED SUPPLY HOSE TO COMPRESSOR.					
190701-00	SVC00201	07/29/2019	1HBGNYR	ID-NYRSTAI105_HBGN R	Sundries	1VT1293	7858	JULY - COMPLETE PMI'S	H30 - 1VT1293	945.1	24	0	40	1009.1
									ODOMETER - 7858 HOURS					
									JOB CARRIED OUT - CARRY OUT PMI DURING JULY. REPLACE BLOWN RH INDICATOR GLOBE. WASHED ROOF OF CAB WITH ACID WASH. REPAIRED TAIL GATE LOCKS. TIGHTENED LOOSE MIRRORS. ADJUSTED BRAKES.					

190625-00	SVC00228	07/19/2019	1HBGNYR	ID-NYRSTA	105_HBGN	R	Bodywork	1VT1293	7843	FIT UP REAR MUD FLAP	H30 - 1VT1293	254.45	0	0	130	384.45
											ODOMETER - 7843 HOURS					
											JOB CARRIED OUT - MEASURED AND MADE UP A MUDFLAP HOLDER. CUT A MUDFLAP TO SIZE AND INSTALLED. CUT AND INSTALLED CHAIN.					
190606-00	SVC00228	06/28/2019	1HBGNYR	ID-NYRSTA	105_HBGN	S	Service	1VT1293	7838	S1C - 1000HR SERVICE	H30 - 1VT1293	472.55	277.14	0	50	799.69
											ODOMETER - 7838 HOURS					
											JOB CARRIED OUT - CARRY OUT SERVICE AND CHECKOVER. CARRIED OUT AT LA WORKSHOP.					
190625-00	SVC00228	06/28/2019	1HBGNYR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293	7843	COMPLETE PMI 25/6/19	H30 - 1VT1293	145.4	0	0	0	145.4
											ODOMETER - 7843 HOURS					
											JOB CARRIED OUT - CARRY OUT PMI.					
190613-00	SVC00228	06/20/2019	1HBGNYR	ID-NYRSTA	105_HBGN	R	Electrical	1VT1293	7831	REPAIR REVOLVING LIGHT/PMI	H30 - 1VT1293	181.75	105.83	0	0	287.58
											ODOMETER - 7831 HOURS					
											JOB CARRIED OUT - CARRIED OUT PMI. REMOVED AND REPLACED REVOLVING LIGHT.					
180917-01	10011	06/17/2019	1HBGNYR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293		ASSES TAILGATE OPERATION		363.5	0	0	0	363.5
181119-01	10026	06/17/2019	1HBGNYR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293	7438	REPAIR DRVERSIDE WINDOW RUNNER		72.7	0	0	0	72.7
181119-01	SVC00215	06/17/2019	1HBGNYR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293	7438	REPAIR DRVERSIDE WINDOW RUNNER	H30 - 1VT1293	72.7	0	0	20	92.7
											ODOMETER - 7438 HOURS					
											JOB CARRIED OUT - WINDOW STICKING, NOT GOING UP. REMOVE DOOR LINING, LUBRICATE WIRE FEED AND TEST OPERATION.					
181121-00	10031	06/17/2019	1HBGNYR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293	7440	COMPLETED PMI INSPECTION 21/11		109.05	0	0	0	109.05
181121-00	SVC00215	06/17/2019	1HBGNYR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293	7440	COMPLETED PMI INSPECTION 21/11	H30 - 1VT1293	109.05	0	0	20	129.05
											ODOMETER - 7440 HOURS					
											JOB CARRIED OUT - CARRY OUT PMI, CHECK REAR BRAKE ADJUSTMENT.					

190409-00	SVC00225	06/12/2019	1HBGNYR	ID-NYRSTA	105_HBGN R	Engine	1VT1293	7681HRS	DIAGNOSE HEATER FAULTS	1VT1293	181.75	461.9	190.89	0	834.54
										ODOMETER - 7681 HOURS					
										JOB CARRIED OUT - REMOVED HEATER HOSES AND CHECKED FOR FLOW, TESTED OK. REMOVED HEATER COVERS AND CHECKED HEATER TAP OPERATION. FIT UP ELECTRIC HEATER TO CAB ON IGNITION SUPPLY.					
190514-00	SVC00227	06/12/2019	1HBGNYR	ID-NYRSTA	105_HBGN R	Sundries	1VT1293	7763	RHS WINDOW FAULTS	H30 - 1VT1293	436.2	1281.66	0	20	1737.86
										ODOMETER - 7763 HOURS					
										JOB CARRIED OUT - RH SIDE WINDOW FAULTS. LUBED UP WINDOW TRACKS, NO CHANGE. REMVOED DOOR CORD AND LUBED CABLE, NO CHANGE. CHECKED POWER, FOUND MOTOR GETTING HOT. PULLED APART SWITCH AND FOUND CONTACTS BURNT OUT. ORDERED NEW PARTS. REPLACED BOTH SWITCHES.					
190523-00	SVC00227	06/12/2019	1HBGNYR	ID-NYRSTA	105_HBGN R	Sundries	1VT1293		ISRI SEAT ADJUST SWITCH FAILED	H30 - 1VT1293	72.7	116.92	0	0	189.62
										JOB CARRIED OUT - CHECK AND ASSESS SEAT SWITCH, TESTING OK. INCORRECT OPERATION OF SEAT ONLY.					
190604-00	SVC00227	06/12/2019	1HBGNYR	ID-NYRSTA	105_HBGN R	Sundries	1VT1293	7817	COMPLETE PMI 4/6/19	H30 - 1VT1293	145.4	0	0	25	170.4
										ODOMETER - 7817 HOURS					
										JOB CARRIED OUT - CARRY OUT PMI. CHECKED NOISE FROM BRAKES WHEN APPLIED IN REVERSE. ADJUSTED BRAKES, FOUND DRIVELINE AND BRAKES FULL OF MUD.					
190522-00	SVC00226	05/30/2019	1HBGNYR	ID-NYRSTA	105_HBGN R	Sundries	1VT1293	7778	COMPLETE PMI 21/5/19	H30 - 1VT1293	72.7	0	0	0	72.7
										ODOMETER - 7778 HOURS					
										JOB CARRIED OUT - CARRY OUT WEEKLY PMI.					

190514-00	SVC00226	05/19/2019	1HBGNYR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293	7763	COMPLETE PMI 14/5/19	H30 - 1VT1293	181.75	53.69	0	0	235.44
											ODOMETER - 7763 HOURS					
											JOB CARRIED OUT - CARRY OUT PMI.					
190426-00	SVC00225	05/08/2019	1HBGNYR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293	7714	REPAIR AIR LEAK	1VT1293	72.7	80.56	0	25	178.26
											ODOMETER - 7714 HOURS					
											JOB CARRIED OUT - REMOVE LEAKING AIR TANK COCKS. SOURCED NEW VALVES. FITTED NEW DRAIN VALVES AND TESTED OPERATTION.					
190430-00	SVC00225	05/08/2019	1HBGNYR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293	7725	COMPLETE PMI 30/4/19	1VT1293	109.05	0	0	20	129.05
											ODOMETER - 7725 HOURS					
											JOB CARRIED OUT - CARRY OUT PMI. REPORTED FAULT WITH BRAKES. ADJUSTED TO SPEC. FOUND LH REAR ADJUSTER TO BE BACKED OFF HARD DUE TO LOCKING COLLAR NOT COMING HARD OUT. FREED UP COLLAR, WORKING CORRECTLY.					
190221-00	SVC00220	04/30/2019	1HBGNYR	ID-NYRSTA	182_INT	R	Sundries	1VT1293		TAILGATE LOCKS AND HINGE MODS	Unit 1VT1293	2724	80.79	0	100	2904.79
											Clean and prep tray for repairs. Cut and remove old tray pivots. Remove and straighten bent tailgate. Repair cracks in tailgate. Fabricate new longer fixed tailgate hinges. Fit and weld new hinges to tail gate and tray. Straighten up and repair tailgate locks and doublers to suit repaired tailgate. Test working of new hinges and locks.					
190314-00	SVC00222	04/30/2019	1HBGNYR	ID-NYRSTA	182_INT	R	Sundries	1VT1293		BUILD UP LINKAGES	Unit 1VT1293	223.8	0	0	15	238.8
											Weld and build up worn linkages. Adjust linkages accordingly.					

190423-01	SVC00216	04/29/2019	1HBGN YR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293	7708	COMPLETE PMI 23/4/19	H30 - 1VT1293	36.35	0	0	30	66.35
											ODOMETER - 7708 HOURS					
											JOB CARRIED OUT - CARRIED OUT PMI. REPLACE FAILED RH REAR INDICATOR GLOBE. REPLACED FAILED LH BRAKE LIGHT GLOBE. HAZARD LIGHT SWITCH FAULTY, TEMPORARILY REPAIRED STOP LIGHTS COMING ON.					
190321-00	SVC00222	04/18/2019	1HBGN YR	ID-NYRSTA	182_INT	R	Sundries	1VT1293		FIT UP SECOND TAILGATE CYL	Unit 1VT1293	604.7	9.93	0	75	689.63
											Fabricate new under tray brackets and mounts to suit supplied air cylinder. Fit up air cylinder and fabricate air lines to suit. Load up tail gate and test locking system. Paint new brackets.					
190312-01	SVC00222	04/11/2019	1HBGN YR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293	7606	TAILGATE - WORN LINKAGES	H30 - 1VT1293	290.8	114.07	190.89	25	620.76
											ODOMETER - 7606 HOURS					
											JOB CARRIED OUT - TEST OPERATION OF TAIL GATE LATCH, FOUND WORN LINKAGES, ADJUSTED STOPPER ON LATCH, SWAP AIR LINES ON RAM.					
190325-00	SVC00223	04/11/2019	1HBGN YR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293		REPAIR TAILGATE CYLINDER	H30 - 1VT1293	654.3	81.25	0	0	735.55
											JOB CARRIED OUT - LH AIR RAM TAILGATE LOCK CONTROL LEAKING, REMOVE CYLINDER. ON TESTING, FOUND CYLINDER BYPASSING OVER PISTON SEAL. REPLACED PISTON SEAL. LINKAGES BINDING UP, REMOVED LINKAGES, FREED UP AND TESTED OPERATION.					
190328-00	SVC00223	04/11/2019	1HBGN YR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293		COMPLETE PMI INSPECTION	H30 - 1VT1293	72.7	53.69	0	0	126.39
											JOB CARRIED OUT - CARRY OUT PMI.					

190329-00	SVC00223	04/11/2019	1HBGNYR	ID-NYRSTA	105_HBGN	R	Brake	1VT1293	7648	REPLACE X2 BRAKE BOOSTERS	H30 - 1VT1293	1054.15	501.34	95.46	45	1695.95
											ODOMETER - 7648 HOURS					
											JOB CARRIED OUT - REAR BRAKES LOCKING ON. REMOVED DRUMS, LININGS WORN OUT. BOOSTERS FULL OF PRODUCT AND RODS LOOK BENT. REMOVED AND REPLACED X2 BOOSTERS. REMOVED AND REPLACED LEAKING CONTROL VALVE.					
190408-01	SVC00224	04/11/2019	1HBGNYR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293	7681	replace wiper arms	H30 - 1VT1293	72.7	62	0	25	159.7
											ODOMETER - 7681 HOURS					
											JOB CARRIED OUT - REMOVED WORN OUT WIPER BLADE ASSEMBLY. FITTED UP NEW WIPER BLADE ASSEMBLY. CLEANED OUT BLOCKED WIPER WASHER JETS.					
190409-00	SVC00224	04/11/2019	1HBGNYR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293	7681HRS	COMPLETE PMI INSPECTION 9/4	H30 - 1VT1293	254.45	25.2	0	0	279.65
											ODOMETER - 7681 HOURS					
											JOB CARRIED OUT - CARRY OUT PMI. ADJUSTED BRAKES AND LUBRICATED. REPAIRED BLOCKED GREASE NIPPLES.					
190409-00	SVC00224	04/11/2019	1HBGNYR	ID-NYRSTA	105_HBGN	R	Electrical	1VT1293	7681HRS	REPAIR DASH LIGHTS	H30 - 1VT1293	72.7	0	0	0	72.7
											ODOMETER - 7681 HOURS					
											JOB CARRIED OUT - REMOVE DASH ASSEMBLY, CHECKED WIRING AND POWER SUPPLY TO LIGHTS, OK. FOUND WIRING PLUG NOT CONNECTING TO SWITCH PROPERLY. REPAIRED AND TESTED OK.					
190220-00	SVC00220	03/20/2019	1HBGNYR	ID-NYRSTA	182_INT	B	Sundries	1VT1293		REPAIR HEADBOARD	Fabricate new top headboard section of tray due to abuse on site.	1427.95	43.14	0	100	1571.09
190301-00	SVC00222	03/08/2019	1HBGNYR	ID-NYRSTA	105_HBGN	S	Service	1VT1293	7000	COMPLETE S1A SERVICE	H30 - 1VT1293	327.15	62.12	0	0	389.27
											ODOMETER - 7000 HOURS					
											JOB CARRIED OUT - CARRY OUT SERVICE AND CHECKOVER.					

190307-00	SVC00222	03/08/2019	1HBGNYR	ID-NYRSTA	105_HBGN	R	Electrical	1VT1293		REPAIR HORN FAULT	H30 - 1VT1293	145.4	14.93	0	0	160.33
											JOB CARRIED OUT - DIAGNOSE FAULT WITH HORN. REPLACED FAULTY HORN.					
190307-00	SVC00222	03/08/2019	1HBGNYR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293		COMPLETE PMI INSPECTION	H30 - 1VT1293	109.05	0	0	0	109.05
											JOB CARRIED OUT - CARRIED OUT PMI.					
190212-00	SVC00220	02/27/2019	1HBGNYR	ID-NYRSTA	182_INT	A	Sundries	1VT1293		REPAIR DAMAGED TAILGATE	Unit 1VT1293	668.56	0	0	115	783.56
											Clean and prep tray for repairs. Manipulate and straighten bent and damaged tailgate. Cut and realign bent hinge. Straighten up and repair damaged dog locks. Touch up and paint all repairs.					
190212-01	SVC00221	02/27/2019	1HBGNYR	ID-NYRSTA	105_HBGN	R	Bodywork	1VT1293	7562	X2 REPAIR TAIL GATE	H30 - 1VT1293	109.05	0	127.26	0	236.31
											JOB CARRIED OUT - DAMAGE TO TAIL GATE LOCKS. 1ST REPAIR: TAILGATE REPAIRED AT LAMPTON AVENUE WORKSHOP. 2ND REPAIR: REPAIR BENT TAIL GATE LOCKS. 3RD REPAIR: REPAIR/MANUFACTURE NEW LOCKS. COMBINED ALL COSTS.					
190131-00	SVC00219	02/08/2019	1HBGNYR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293		TAIL GATE LOCK REPAIRS	H30 - 1VT1293	145.4	0	0	0	145.4
											JOB CARRIED OUT - BUILT UP TAILGATE LOCK LATCHES WITH MIG WELDER, ADJUSTED AND TESTED.					
190131-00	SVC00219	02/08/2019	1HBGNYR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293		COMPLETE PMI 30/1/19	H30 - 1VT1293	145.4	0	0	0	145.4
											JOB CARRIED OUT - CARRY OUT PMI.					
190206-00	SVC00220	02/08/2019	1HBGNYR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293	7547	COMPLETE PMI	H30 - 1VT1293	109.05	0	0	10	119.05
											ODOMETER - 7547 HOURS					
											JOB CARRIED OUT - CARRY OUT PMI.					
190117-00	SVC00219	01/31/2019	1HBGNYR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293		Replace tail gate cylinder	1VT1293	72.7	539.9	0	0	612.6
											JOB CARRIED OUT - REPLACE FAILED TAIL GATE CYLINDER.					

190123-00	SVC00219	01/24/2019	1HBGNYR	ID-NYRSTA	105_HBGN R	Sundries	1VT1293	7527	COMPLETE PMI	H30 - 1VT1293	109.05	0	0	0	109.05
										ODOMETER - 7527 HOURS					
										JOB CARRIED OUT - CARRY OUT PMI.					
190116-00	SVC00219	01/22/2019	1HBGNYR	ID-NYRSTA	105_HBGN R	Sundries	1VT1293	7517	COMPLETE PMI 16/1/19	H30 - 1VT1293	109.05	0	0	20	129.05
										ODOMETER - 7517 HOURS					
										JOB CARRIED OUT - CARRY OUT PMI.					
181218-00	SVC00217	12/20/2018	1HBGNYR	ID-NYRSTA	105_HBGN R	Sundries	1VT1293	7482	COMPLETE PMI 18/12/18	H30 - 1VT1293	36.35	0	0	0	36.35
										ODOMETER - 7482 HOURS					
										JOB CARRIED OUT - CARRY OUT PMI.					
181206-00	SVC00217	12/18/2018	1HBGNYR	ID-NYRSTA	105_HBGN R	Sundries	1VT1293		COMPLETE PMI 6/12/18	H30 - 1VT1293	327.15	0	0	40	367.15
										JOB CARRIED OUT - CARRY OUT PMI.					
181127-00	SVC00216	11/28/2018	1HBGNYR	ID-NYRSTA	105_HBGN R	Sundries	1VT1293	7446	COMPLETE PMI INSPECTION	H30 - 1VT1293	109.05	0	0	0	109.05
										ODOMETER - 7446 HOURS					
										JOB CARRIED OUT - CARRIED OUT PMI. COULD NOT ADJUST BRAKES, AS TOO MUCH PRODUCT BUILD UP.					
181106-00	SVC00216	11/27/2018	1HBGNYR	ID-NYRSTA	105_HBGN R	Sundries	1VT1293		COMPLETE PMI 6/11	H30 - 1VT1293	72.7	0	0	0	72.7
										JOB CARRIED OUT - CARRY OUT PMI. ADJUST LH MIRRORS AND MOVE SMALL MIRROR.					
181115-00	SVC00216	11/27/2018	1HBGNYR	ID-NYRSTA	105_HBGN R	Sundries	1VT1293	7428	COMPLETE PMI INSPECTION	H30 - 1VT1293	72.7	0	0	0	72.7
										ODOMETER - 7428 HOURS					
										JOB CARRIED OUT - CARRY OUT PMI. ADJUSTED MIRROR ON LH SIDE AS ASKED BY OPERATOR. ADJUSTED REAR BRAKES.					
181122-00	SVC00216	11/27/2018	1HBGNYR	ID-NYRSTA	105_HBGN R	Sundries	1VT1293	7450	REMOVE TRAY BRUSHES	H30 - 1VT1293	72.7	0	63.64	0	136.34
										ODOMETER - 7450 HOURS					
										JOB CARRIED OUT - REMOVE SPRAY SUPRESSION BRUSHES, AS REQUESTED BY NYRSTAR.					

181123-00	SVC002162	11/27/2018	1HBGNYR	ID-NYRSTA	105_HBGN R	Sundries	1VT1293	7450HRS	INSPECT TAILGATE OPERATION	H30 - 1VT1293	145.4	0	0	0	145.4
										ODOMETER - 7450 HOURS					
										JOB CARRIED OUT - INSPECT TAIL GATE OPERATION. HOT WASH TAIL GATE SEALING EDGES. HOT WASH ALL TAIL GATE LOCKING COMPONENTS. TEST OPERATION, TAIL GATE OPERATED AT TIME OF TESTING.					
181003-00	SVC002142	11/09/2018	1HBGNYR	ID-NYRSTA	105_HBGN R	Engine	1VT1293	7373	BLOCKED HEATER CORE	H30 - 1VT1293	836.05	10.08	127.28	0	973.41
										ODOMETER - 7373 HOURS					
										JOB CARRIED OUT - VEHICLE HEATERS NOT WORKING. FOUND TO BE BLOCKED HEATER TAP AND CORE. APPEARS COOLANT PIPE NOT CONNECTED CORRECTLY. FLUSH HEATER CORE.					
181017-01	SVC002142	11/09/2018	1HBGNYR	ID-NYRSTA	105_HBGN S	Service	1VT1293	7640	S1B - 500HR SERVICE	H30 - 1VT12393	581.6	363.22	0	0	944.82
										ODOMETER - 7640 HOURS					
										JOB CARRIED OUT - CARRY OUT SERVICE AND CHECKOVER.					
181017-00	SVC002142	10/30/2018	1HBGNYR	ID-NYRSTA	105_HBGN R	Sundries	1VT1293	7392	COMPLETE PMI 17/10	H30 - 1VT1293	109.05	0	0	0	109.05
										ODOMETER - 7392 HOURS					
										JOB CARRIED OUT - CARRY OUT PMI.					
181011-00	SVC002132	10/17/2018	1HBGNYR	ID-NYRSTA	105_HBGN R	Sundries	1VT1293	7378	COMPLETE PMI INSPECTION	H30 - 1VT12393	109.05	0	0	0	109.05
										ODOMETER - 7378 HOURS					
										JOB CARRIED OUT - CARRY OUT PMI.					
180925-00	SVC002122	10/11/2018	1HBGNYR	ID-NYRSTA	105_HBGN R	Sundries	1VT1293	7361	COMPLETE PMI AND LIST	1VT1293	145.4	53.69	0	0	199.09
										ODOMETER - 7361 HOURS					
										JOB CARRIED OUT - CARRY OUT PMI AND LIGHT REPAIR. HEATER TAP OPERATING CORRECTLY, RECOMMEND VEHICLE BE WARMED UP ASND HEATER HOSES CHECKED.					

181005-00	SVC002134	10/11/2018	1HBGNYR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293	7375	TEST AND ADJUST BRAKES	1VT1293	109.05	0	0	0	109.05
											ODOMETER - 7375 HOURS					
											JOB CARRIED OUT - INSPECTED AND ADJUST ALL BRAKES.					
181003-00	SVC002121	10/09/2018	1HBGNYR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293	7373	COMPLETE PMI 2/10/18	1VT1293	109.05	30.24	0	0	139.29
											ODOMETER - 7373 HOURS					
											JOB CARRIED OUT - CARRIED OUT PMI.					
180914-01	SVC002121	09/27/2018	1HBGNYR	ID-NYRSTA	105_HBGN	R	Sundries	1VT1293		COMPLETE PMI 18/9/18	1VT1293	72.7	23.36	0	0	96.06
											JOB CARRIED OUT - CARRIED OUT PMI, TOPPED UP FLUIDS.					
180820-00	SVC002111	09/06/2018	1H0105	ID - NYRSTA	105_HBGN	R	Transmissi	1VT1293		LOW TRANS OIL	1VT1293	72.7	382.49	0	0	455.19
											JOB CARRIED OUT - TOP UP LOW TRANS OIL.					
180716-00	SVC002081	08/30/2018	1H0105	ID - NYRSTA	105_HBGN	R	Sundries	1VT1293	298,853 KL	NEW TRUCK FITUP AT NYRSTAR	1VT1293	2580.85	605.41	668.15	150	4004.41
											ODOMETER - 298,853 KLMS					
											JOB CARRIED OUT - NEW TRUCK FITUP FOR NYRSTAR.					
180829-00	SVC002111	08/30/2018	1H0105	ID - NYRSTA	105_HBGN	R	Sundries	1VT1293	299,329 KL	COMPLETE PMI INSPECTION	1VT1293	145.4	4.23	0	0	149.63
											ODOMETER - 299,329 KLMS					
											JOB CARRIED OUT - CARRY OUT PMI.					
180806-00	SVC002091	08/27/2018	1H0105	ID - NYRSTA	182_INT	R	Trays/Buck	1VT1293		REPAIR CRACKS IN TAILGATE	Grind out and reweld split and cracked skin on tailgate.	330.25	0	0	16.5	346.75
											Straighten bent tailgate frame.					
180801-00	SVC002091	08/10/2018	1H0105	ID - NYRSTA	181_INT	R	Sundries	1VT1293		PAINT TAILGATE AFTER WELDING R	UNIT 1VT1293	109.05	0	0	20	129.05
											PAINT TAILGATE AFTER WELDING REPAIRS					
180802-00	SVC002091	08/08/2018	1H0105	ID - NYRSTA	105_HBGN	R	Sundries	1VT1293	7280	COMPLETE PMI 2/8/18	1VT1293	109.05	0	0	0	109.05
											ODOMETER - 7280 HOURS					
											JOB CARRIED OUT - CARRY OUT PMI.					

180709-00	SVC002079	07/27/2018	1H0105	ID - NYRST/ 181_INT	F	Sundries	1VT1293	298,831 KM	FIT HAZELL DECALS AND UNIT NUM	UNIT 1VT1293 ODOMETER 298831KM	508.9	28.5	270	0	807.4
										FIT HAZELL DECALS AND UNIT NUMBERS TO CAB FIT REFLECTIVE TAPE TO TRAY REPAIRED LOOSE EXTERIOR DOOR HANDLE ON RHS DOOR PAINT REVOLVING LIGHT ROOF BRACKET					
180725-00	SVC002090	07/27/2018	1H0105	ID - NYRST/ 105_HBGN R		Sundries	1VT1293	7272	COMPLETE PMI 25/7/18	1VT1293	145.4	0	0	0	145.4
										ODOMETER - 7272 HOURS					
										JOB CARRIED OUT - CARRIED OUT PMI.					
180710-00	SVC002080	07/20/2018	1H0105	ID - NYRST/ 186_INT	R	Sundries	1VT1293		WORK AS PER LIST	Unit 1VT1293	942.48	335.2	0	0	1277.68
										Fitted second hand UHF, working OK. Fitted reverse alarm, lights and HB mudflaps Fitted fire extinguisher, reverse LED lights Fitted wheel nut indicators. Fitted canvas seat covers and floor mats Supplied parts for fit up to be completed at Nyrstar workshop					

Applied filters:Posted_Date is on or after 01/01/1900Equipment_ID is 1VT1293