

Service Job	Invoice No	Date	Customer Id	Customer Name	Cost Cent	Prob	Type of Call	Equip ID	Hrs	Kms	Job Description	Work Done	Labor Cost	Material Cost	Subcontra ctor Cost	Other Cost	Total Cost
97389	117184	09/09/2026	1HM368HBG	ID - TRUCK FLI 186G		R	Sundries	1VT951	0.0000	5175984	Pre Disposal	CARRIED OUT PRE DISPOSAL WIPED AND CLEANED ALL CAB	385	35	120	35	540
97319		09/08/2026	1HM368HBG	ID - TRUCK FLI 181G		R	Bodywork	1VT951	0.0000	0	REMOVE HAZELL SIGNAGE FROM TRUCK.SWAP MUDFLAPS AROUND , PREP FOR SALE		495	0	0	0	495
84469	101179	01/28/2026	1HM368HBG	ID - TRUCK FLI 186G		R	Electrical	1VT951	32358.0000	0	JUMP START, REMOVE BATTERIES AND CHARGE.	ATTEMPTED TO CARRY OUT JUMP START ON TRUCK. - NO START REMOVED BATTERIES & BROUGHT TO WORKSHOP TO CHARGE FULLY. REFIT BATTERIES, CHECKED CHARGE RATE & STARTING - ALL OK AT TIME OF TESTING	310	20	0	20	330
81343	99077	11/21/2025	1HM368HBG	ID - TRUCK FLI 186G		R	Suspensior	1VT951	32358.0000	0	REPLACE SHOCK BSUHES X4		240	337.96	0	30	577.96
81344	100334	11/21/2025	1HM368HBG	ID - TRUCK FLI 186G		R	Engine	1VT951	0.0000	0	ENGINE REPAIRS	FOUDN EXHAUST FLANGE OT BE RUSTED OUT REMOVE AFFECTED SECTION AND REPLACE FLANGE REPLACED CLAMPS AND REFIT DEGREASED UNDER ENGINE AND AROUND WHOLE BELL HOUSING AND THOROUGHLY WASHED UNDERSIDE OF VEHICLE SO AS TO MAKE TRACING ENGINE OIL LEAKS POSSIBLE	1155	119.55	0	60	1274.55
81349	100323	11/21/2025	1HM368HBG	ID - TRUCK FLI 186G		R	Radiator	1VT951	32358.0000	0	REPAIR OVERHEATING FAULT		0	315.72	0	0	315.72
81384	100229	11/21/2025	1HM368HBG	ID - TRUCK FLI 186G		R	Chassis	1VT951	32358.0000	0	REPAIR DEFECTS AS PER OPERATOR FAULT SHEET	clutch needs adjusting horn not working eng oil leak window wipers not working properly drivers door hits mirror - has dropped and rubber falling off needs chute brake pads air leak from behind cab unit runs at 100 degrees most days even with engine fan on manual ENGINE OIL FILLER CAP BROKEN	624	516.35	0	30	1140.35

81188	98804	11/19/2025	1HM368HBG	ID - TRUCK FLI 186G	S	Service Trai	1VT951	32358.000	0	B SERVICE & DETAILED VEHICLE INSPECTION	OIL FILTER LF9039 FUEL FILTER FF5488 FUEL FILETR PRIMARY FS1003. AIR FILTER AF4878 CARRY OUT SERVICE AND VEHICLE INSPECTION. CHECK ALL LIGHTS, CHECK FLUID LEVELS. CHECK SUSPENSION, BRAKES AND TYRES - CARRY OUT DETAILS VEHICLE INSPECT AND REPORT LIST OF FAULTS NOTES: - LH MIRROR - LH PARK - A/C BELT - OIL LEAK FROM TIMING COVER - COOLANT LEAK FROM COMPRESSOR HEAD GASKET - RADIATOR CAP - LIVE DRIVE COVER IS LEAKING - CRACKS IN BOWL FRAME - LHR BRAKE BOOSTERS X2 - REAR AIR BAGS HAVING MINOR FRAYING - HYDRAULIC PUMP LEAKING - BOWL SPEED - SUMP IS LEAKING - TAILSHAFT SLIP JOINT HAS MOVEMENT - SPRING PINS, BUSHES AND ROCKER BOXES - LHR DRIVE BRAKE BACKING PLATE IS MISSING AND THERE IS CONCRETE OVER BRAKE SHOES AND INSIDE BRAKE	1238	508.76	0	130	1796.76
75597	90999	08/04/2025	1HM368HBG	ID - TRUCK FLI 186G	R	Chassis	1VT951	31952.000	0	Missed parts		0	60.52	0	0	60.52
74231	90071	07/09/2025	1HM368HBG	ID - TRUCK FLI 186G	R	Exhaust	1VT951	31952.000	0	PARTS MISSED OF PREVIOUS SERVIC EJOB	Missing parts	0	451.94	0	0	451.94
73762	89433	07/02/2025	1HM368HBG	ID - TRUCK FLI 186G	R	Transmissio	1VT951	31952.000	0	Tighten gearstick knob		48	0	0	0	48
73227	88411	06/23/2025	1HM368HBG	ID - TRUCK FLI 186G	R	Drive Line	1VT951	0.0000	0	Hub leak	ATTEND TO HUB LEAK FOUND DRAIN ON HUB CAP LOOSE TIGHTEN AND ADJUST OIL LEVEL REPLACE TRANS OIL AS REQUIRED DUE TO BAD SAMPLE	200	94.35	0	54	348.35
72735	89665	06/13/2025	1HM368HBG	ID - TRUCK FLI 186G	R	Sundries	1VT951	31557.000	0	Missed Parts off Job # 68437		0	430.95	0	0	430.95
72773	87961	06/13/2025	1HM186HBG	ID - WORKSHC 186G	PW	Chassis	1VT951	31557.000	0	OIL LEAK	DIAGNOSE OIL LEAK CUASED BY ENGINE OIL OVERFILLED EXTRACTED APPROX 15 LITRES TO SET OIL AT CORRECT LEVEL TRUCK SERVICE LESS THAN 1 WEEK PRIOR	336	0	0	0	336
72525	87352	06/10/2025	1HM368HBG	ID - TRUCK FLI 186G	R	Chassis	1VT951	31557.000	0	Equipment Fault Report	Viabrates at 60 km Grates into gear Replace damaged gaurd REMOVE OLD DAMAGED MUD GUARD HAD TO REMOVE BATTERIES AS FRONT GUARD BOLTS COULD ONLY BE ACCESSED VIA BAT BOX FIT NEW GUARD WITH NEW HARDWARE CARRY OUT ADJUSTMENT OF CLUTCH REPLACE TAIL SHAFT CENTRE BEARING	963	405.52	0	50	1418.52

72441	87157	06/06/2025	1HM368HBG	ID - TRUCK FLI 186G	S	Chassis	1VT951	0.0000	0	C' SERVICE	OIL FILTER LF9039	1594	562.9	0	162	2318.9
											FUEL FILTER FF5488					
											FUEL FILETR PRIMARY FS1003.					
											CARRY OUT SERVICE AND VEHICLE INSPECTION. CHECK ALL LIGHTS, CHECK FLUID LEVELS. CHECK SUSPENSION, BRAKES AND TYRES					
71641	86411	05/23/2025	1HM368HBG	ID - TRUCK FLI 182G	R	Sundries	1VT951	31557.000	0	REPAIR BENT REAR STEP		300	0	0	100	400
70916	87356	05/09/2025	1HM368HBG	ID - TRUCK FLI 186G	R	Exhaust	1VT951	0.0000	0	Exhaust repair	replace leaking exhaust vband clamp	240	378.48	0	0	618.48
											found exhaust still leaking					
											order new section to be replaced at a later date					
69849	84331	04/15/2025	1HM368HBG	ID - TRUCK FLI 182G	R	Sundries	1VT951	31557.000	0	REPAIR REAR STEP		1407	0	0	90	1497
69019	84158	03/31/2025	1HM368HBG	ID - TRUCK FLI 186G	R	Brake	1VT951	31557.000	508996	Replace RH Rear Brake Camber.		304.15	50.3	0	20	374.45
68629	86704	03/24/2025	1HM368HBG	ID - TRUCK FLI 186G	S	Service Trai	1VT951	31535.000	508901	B SERVICE	CARRY OUT SERVICE AND VEHICLE INSPECTION. CHECK ALL LIGHTS, CHECK FLUID LEVELS. CHECK SUSPENSION, BRAKES AND TYRES	2884.26	4549.67	0	176	7609.93
											- REPLACED RH HEADLIGHT					
											- CHIP EXCESS CONCRETE OFF REAR OF BOWL FRAME TO ACCESS BOWL ROLLERS					
											- REPLACE LH BOWL ROLLER					
											- RHF DRIVE WHEELS HAD COME LOOSE AND DAMAGED BOTH WHEELS, STUDS, HUB					
											- REMOVE DAMAGED PARTS AND REPLACED					
											- DURING SERVICE LARGE QUANTITY OF WATER WAS DRAINED FROM BOTH AIR TANKS, ALSO LARGE AMOUNTS OF CONCRETE HAD TO BE REMOVED FROM BRAKES AND OTHER COMPONENTS TO SERVICE					
											- CLEAN CONCRETE FROM AROUND REAR SLACK ADJUSTERS TO FIND GREASE NIPPLES AND ADJUST BRAKES					
											- REPLACED BOTTOM RADIATOR HOSE AND CHANGED COOLANT					
											- INSPECT FAULT WITH HEATER NOT WORKING. SUSPECT WIRING ISSUE FURTHER DIAGNOSTICS NEEDED					
											- CLEAN BATTERY TERMINALS AND REPLACED DAMAGED ONES					
											- ADJUST CLUTCH FREE TRAVEL					
											- REMOVE RHS FRONT DRIVE AXLE HUB AND REPLACED DAMAGED HUB AND BRAKE DRUM					
67495	80946	03/03/2025	1HM368HBG	ID - TRUCK FLI 186G	R	Drive Line	1VT951	31413.200	508111.5	Vibration in Drive Line	INSPECT DRIVE LINE	975.07	1110.9	0	50	2135.97
											FOUND REAR DRIVE SHAFT SLIP SPLINES HAS EXCESSIVE WEAR					
											REMOVE SHAFT AND SEND FOR REPAIRS					
											REFIT REPAIRED SHAFT					
											FIT NEW UNI JOINTS TO NEW SHAFT					
											FIT SHAFT GREASE AND TEST DRIVE					

63957	77525	01/15/2025	1HM368HBG	ID - TRUCK FLI 186G	S	Service Trai	1VT951	31157.200	506251.5	B SERVICE	CARRY OUT SERVICE AND VEHICLE INSPECTION. CHECK ALL LIGHTS, CHECK FLUID LEVELS. CHECK SUSPENSION, BRAKES AND TYRES - REPLACED FAN BELT - ADJUST BRAKES - REPAIRED AIR LINE FOR BREAK CIRCUIT - REPAIRED WEEPING RADIATOR HOSE NOTES: - FRONT BRAKES LOW - 1ST STEET TIE RODS HAVE MOVEMEMNT - DRAG LINK HAS MOVEMENT - REAR SPRING BUSHES - MONITOR - EXHASUT LEAK ON BACK OF TURBO - COOLANT LEAK - BUMPER CRACKERS NEAR NUMBER PLATE	1161.76	775.82	0	85	2022.58
62582	76376	12/06/2024	1HM368HBG	ID - TRUCK FLI 186G	R	Electrical	1VT951	30937.800	0	Engine Cutting Out	CHECK FOR ENGINE CUTTING OUT WHILST ON CRUISE CONTROL CONNECT LAPTOP AND FOUND COOLING SYSTEM FAULT SWAP COOLANT SENSOR FROM ANOTHER VEHICEL AND FIT PROBLEM STILL PRESENT. NEW SENSOR ORDERED REMOVED DAAMGED WIRING TO ECU AND REASSEMBLE HAVE VEHICLE ROAD TEST FOR COMPLETED REPAIRS REPLACED COOLANT LEVEL SENSOR WITH NEW AND TEST ALL OK FOUND ECM READING ROAD SPEED OF 10-15MPH WHEN STATIONARY, REMOVE OEM ECM HARNESS FOUND AND REPAIR DAMAGE AND REFIT FIT NEW COOLANT SENSOR AND ROAD TEST TAKE VEHCIEL TO BATCH PLANT TO BE LOADED BUT ENGINE WOULD NOT REV UP AT ALL	3517.61	102.77	0	150	3770.38
61872	73952	11/25/2024	1HM368HBG	ID - TRUCK FLI 184G	R	Electrical	1VT951	30905.000	0	Repair tracker not working	INSPECT FOR REPORTED TRACKER FAULT FOUND TRACKER TO BE UNPLUGGED RECONNECTED AND TEST ALL OK	46.64	0	0	0	46.64
61930	74071	11/25/2024	1HM368HBG	ID - TRUCK FLI 186G	S	Service Trai	1VT951	30937.800	504051.8	B SERVICE	CARRY OUT SERVICE AND VEHICLE INSPECTION. CHECK ALL LIGHTS, CHECK FLUID LEVELS. CHECK SUSPENSION, BRAKES AND TYRES - FOUND AIR LEAK ON PARK BRAKE HOSE IN CHASSIS FROM VALVE TO BOOSTERS - FOUND LINE CONNECTOR NOT CORRECTLY CONNECTED - REMOVE HOSE AND FIT & SECURE LINE CONNECTOR - FOUND POWERSTEERING ALL LOW, TOPPED UP OIL	342.38	368.39	0	51	761.77
61762	74238	11/21/2024	1HM368HBG	ID - TRUCK FLI 186G	R	Engine	1VT951	30905.000	503801	COOLANT LEAK	PRESSURE TEST COOLING SYSTEM TO FIND COOLANT LEAK FOUND RADIATOR RUBBER JOINER LEAKING DRAIN COOLANT AND REMOVED TOP PIPE REPLACE HOSE ON BOTH ENDS AND REASSEMBLE REFILL WITH COOLANT TEST AND INSPECT FOR LEAKS ALL OK AT TIME	270.3	225.84	0	10	506.14

61010	73628	11/08/2024	1HM368HBG	ID - TRUCK FLI 186G	PW	Sundries	1VT951	30783.700	0	Repair Melted Air Hose.		225.25	2.44	0	0	227.69
60437	73386	10/29/2024	1HM368HBG	ID - TRUCK FLI 186G	R	Clutch	1VT951	30783.700	502336.3	Replace clutch	CARRY OUT REPLACEMENT OF CLUTCH ADDITIONAL TIME TAKEN DUE TO REPAIRING DAMAGE THREADS AND EXHASUT RESEAL RANGE/DEEP REDUCTION VALVE ADDITIONAL TIME TAKEN TO GET RANGE WORKING CORRECTLY, HOSES NOT MOUNTED AND REFITTED INCORRECT ADJUST CLUTCH AND CARRY OUT ROAD TEST ALL OK	3024.45	2024.03	0	80	5128.48
58555	70856	09/19/2024	1HM368HBG	ID - TRUCK FLI 186G	R	Sundries	1VT951	30300.000	0	Repairs from fault book.	CHECK AND REPORT ON FAULTS IN REPORT BOOK - DRIVER DOOR STOP BROKEN REPAIRED & SECURED AS REQUIRED - HORN INOPERATIVE INSPECTED & FOUND HORN UNPLUGGED - REFIT & TESTED - ENGINE IDLING TOO HIGH CHECKED CRUISE CONTROL FUNCTIONS IN RELATION TO IDLING FOUND WITH CRUISE CONTROL OFF, IDLING LOWERS BUT STILL TOO HIGH CONNECTED CUMMINS COMPUTER & ADJUSTED IDLING TO SPEC. - STEERING WHEEL DAMAGED FOUND RUBBERISING HAD COME LOOSE, STEERING WHEEL U/S REMOVED STEERING WHEEL & FIT WHEEL FROM 1VT1001 - REAR WORKLIGHT INOPERATIVE CHECKED DEUTSCH PLUG CONNECTIONS, ALL OK TRACED WIRING FROM WORKLIGHT TO DASH FOR CONTINUITY & POWER FOUND SOME BREAKS & SHORTS IN WIRING - REPAIRED & RETESTED FOUND WORKLIGHT STILL INOPERATIVE - REMOVED & REPLACED - CLUTCH OUT OF ADJUSTMENT ADJUSTED CLUTCH & CLUTCH BRAKE AS REQUIRED - WIPER BLADES WORN & WASHER JETS MISSING REMOVED & REPLACED FULL WIPER JETS AS REQUIRED	1684.88	483.2	0	90	2258.08
57631	69720	08/30/2024	1HM368HBG	ID - TRUCK FLI 186G	S	Transmissio	1VT951	30300.000	0	CLUTCH ADJUSTMENT		90.1	0	0	0	90.1
57093	70133	08/21/2024	1HM368HBG	ID - TRUCK FLI 186G	R	Steering	1VT951	0.0000	30300	P/STEERING LEAK - BREAKDOWN	CALL OUT TO POWER STEERING LEAKING PULL OUT POWER STEERING LINE, RETURN TO WORKSHOP AND COLLECT NEW LINE, RETURN TO TRUCK AND FT NEW LINE, CABLE TIE AND FILL WITH OIL ALL OK TOP UP OIL AND TIGHTEN LINES FOLLOWING DAY	434.6	81.4	0	65	581
55071	66199	07/16/2024	1HM368HBG	ID - TRUCK FLI 184G	R	Electrical	1VT951	30300.000	498000	3G/4G TRACKER REPLACEMENT	CARRY OUT 3G TO 4G TRACKER UPGRADE. ACTIVATE NEW TRACKER AND TEST OPERATION ALL OK	233.2	0	0	40	273.2
54754	65659	07/09/2024	1HM368HBG	ID - TRUCK FLI 186G	S	Service Trai	1VT951	30502.200	497186	B SERVICE	CARRY OUT SERVICE AND VEHICLE INSPECTION. CHECK ALL LIGHTS, CHECK FLUID LEVELS. CHECK SUSPENSION, BRAKES AND TYRES NOTES: SUMP GASKET/REAR MAIN SEAL LEAKING LHF SHOCK LEAKING FAN BELTS U/S DRIVER COMPLAINING OF POOR PERFORMANCE	603.41	499.07	0	55	1157.48

54427	65987	07/03/2024	1HM368HBG	ID - TRUCK FLI 186G	R	Chassis	1VT951	30467.000	496959	Fault list as required	Hour meter not displaying numbers	1054.44	0	0	50	1104.44
											L H light assembly unservicable					
											Coolant leak on engine					
											Air dumping randomly					
											Heater not working HOUR METER INTERMITTENTLY DROPPING OU AND LOOSING THE DISPLAY - COULD NOT FAULT HOSE METER AT TIME OF REPAIR, REMOVED CLUTSTER AND CHECKED PLUGS					
											INSPECT LEFT HAND light assembly, found loose plug in rear - CLEANED OUT AND RETENSIONS PINS					
											COOLANT LEAK AT ENGINE NEAR THERMOSTAT HOUSING - PRESSURE TEST AND FOUND LEAK AT TOP RADIATOR HOSE, REMOVE AND REPAIR. RETEST ALL OK					
											INSPECT FOR REPORTED AIR DUMPING - COULD NOT FAULT AT TIME OF TESTING - CHECKED AND TIGHTEN FITTINGS AT TANK					
											INSPECT HEATER NOT WORKING CORRECTLY WHEN OPERATING TEST ALL FUNCTIONS, FOUND LOOSE PLUG TERMINAL AT					
51979	62829	05/14/2024	1HM368HBG	ID - TRUCK FLI 186G	S	Service Trar	1VT951	30194.000	0	C Service,Check Indecators,leaking water from A/C on cab floor.	CARRY OUT SERVICE AND VEHICLE INSPECTION. CHECK ALL LIGHTS, CHECK FLUID LEVELS. CHECK SUSPENSION, BRAKES AND TYRES	540.6	345.5	0	57	943.1
50935	60142	04/22/2024	1HM368HBG	ID - TRUCK FLI 186G	R	Engine	1VT951	29918.000	0	Check and top up engine oil.	CHECKED ENGINE OIL AND TOPPED UP.	38.69	42.88	0	0	81.57
49816	59381	03/28/2024	1HM368HBG	ID - TRUCK FLI 186G	R	Sundries	1VT951	29918.000	491420	Replace front hub level plug.	FITTED NEW PLUG TO HUB AND TOPPED UP WITH GEAR BOX OIL.	42.5	71.32	0	5	118.82
48563	61518	03/23/2024	1HM368HBG	ID - TRUCK FLI 186G	R	Electrical	1VT951	29794.000	0	Starting fault.	CALL OUT TO GLENORCHY TO ASSESS NON START FAULT FOUND BATTERIES FLAT AND NOT CHARGING FIT NEW BATTERIES TO GET BACK TO ARD REPLACED ALTERNATOR WITH KNOWN GOOD AND WORKING TEST ALL OK	654.5	520.73	0	30	1205.23
47287	56816	02/28/2024	1HM368HBG	ID - TRUCK FLI 186G	S	Service Trar	1VT951	29794.000	489897	B Service Brakes	CARRIED OUT SERVICE & VEHICLE INSPECTION. CHECKED ALL LIGHTS, CHECKED FLUID LEVELS. CHECKED SUSPENSION, BELTS, BRAKES & TYRES. REPLACED REAR BRAKES AS REQUIRED. ROAD TESTED - ALL OK AT TIME OF TESTING	2181.5	1763.81	0	97	4042.31
46915	56819	02/21/2024	1HM368HBG	ID - TRUCK FLI 186G	R	Electrical	1VT951	29737.000	489136	Repair temp gauge fluctuation.	REPLACED WATER TEMP SENDER, REPAIRED TEMP GAUGE FLUCTUATION. ROAD TESTED, ALL OK.	255	23.29	0	15	293.29
46025	55176	02/02/2024	1HM368HBG	ID - TRUCK FLI 186G	R	Drive Line	1VT951	29606.500	487814.1	Replace broken bolts on first drive tortion bar.	REPLACED BROKEN BOLTS ON FIRST DRIVE TORTION BAR.	547.5	0	0	25	572.5
44962	54566	01/10/2024	1HM368HBG	ID - TRUCK FLI 186G	S	Chassis	1VT951	29461.000	485899	B' SERVICE	CARRIED OUT SERVICE & VEHICLE INSPECTION. CHECKED ALL LIGHTS, CHECKED FLUID LEVELS. CHECKED SUSPENSION, BELTS, BRAKES & TYRES. ROAD TESTED - ALL OK AT TIME OF TESTING	340.5	306.83	0	27	674.33
44766	54559	01/02/2024	1HM368HBG	ID - TRUCK FLI 186G	INT-R	Brake	1VT951	29461.000	485899	REPLACE PARK BRAKE PRESSURE SWITCH	REPLACED PARK BRAKE PRESSURE SWITCH TESTED, ALL OK.	194.5	104.25	0	10	308.75

42542	50666	11/10/2023	1HM368HBG	ID - TRUCK FLI 186G	R	Brake	1VT951	29111.000	0	481500	Replace left rear brake booster	TRAVEL TO AUSTINS FERRY	332.25	63.64	0	55	450.89
42301	53271	11/07/2023	1HM368HBG	ID - TRUCK FLI 186G	S	Service Trar	1VT951	0.0000	0		B service,Park Brake Alarm,Door Wont Lock,Accelerator Pedal Roller	REMOVED AND REPLACED ULS BRAKE BOOSTER CARRY OUT SERVICE AND VEHICLE INSPECTION. CHECK ALL LIGHTS, CHECK FLUID LEVELS. CHECK SUSPENSION, BRAKES AND TYRES - REPLACED 4 TORQUE ROD BUSHES REPLACED RH VDOOR LOCK REPAIRED LH DOOR LOCK REPLACED THROTTLE PEDAL ROLLER, REPAIRED DOOR ALARM, REPLACED HEATER TAP AND REPLACED WATER HOSE AND GUN ON AGI	2299.75	3361.3	0	100	5761.05
41117	48850	10/12/2023	1HM368HBG	ID - TRUCK FLI 186G	R	Bodywork	1VT951	28936.800	0	479292	Body repairs	REPLACED MUD FLAP	201.5	23.2	0	0	224.7
40552	48550	10/02/2023	1HM368HBG	ID - TRUCK FLI 186G	R	Electrical	1VT951	28873.000	0	478589	Stating issue	REATTACHED RH FRONT BUMPER CORNER TESTED BATTERY VOLTAGE - ALL OK CHECKED WIRING ON / TO STARTER - ALL OK PULLED IGNITION OUT & TESTED - ALL OK ATTACHED JUMP PACK - WOULD NOT START INSPECTED FURTHER & FOUND CUT-OUT SWITCH ON ROOF TO BE OFF, SO REMOVED SWITCH & JOINED WIRES. RETESTED - ALL OK AT TIME OF TESTING	162	0	0	10	172
39771	46407	09/18/2023	1HM368HBG	ID - TRUCK FLI 186G	R	Tyres	1VT951	0.0000	477152		S/TRAK SP917 X8 DRIVE TYRES + DIS X6		42.5	3090	0	0	3132.5
39555	45844	09/12/2023	1HM368HBG	ID - TRUCK FLI 186G	S	Engine	1VT951	28755.000	0	477543	B' SERVICE	OIL FILTER LF9039 FUEL FILTER FF5488 FUEL FILETR PRIMARY FS1003. AIR FILTER AF4878 CARRIED OUT SERVICE & VEHICLE INSPECTION. CHECKED ALL LIGHTS, CHECKED FLUID LEVELS. CHECKED SUSPENSION, BELTS, BRAKES & TYRES. ROAD TESTED - ALL OK AT TIME OF TESTING	375.75	311.85	0	27	714.6
39245	45852	09/06/2023	1HM368HBG	ID - TRUCK FLI 186G	R	Engine	1VT951	0.0000	477215		replace u/s fan belt tentioner and belt	NOTED FOR FOLLOW UP: * RECOMMEND REPLACING 2ND STEER TIE ROD BUSHES AT/BY NEXT SVC * RECOMMEND REPLACING 2ND STEER BRAKES AT/BY NEXT SVC * RECOMMEND REPLACING FRONT SHOCKIES AT/BY NEXT SVC * MONITOR WEAR IN SPRING BUSHES * MONITOR SUMP LEAK * MONITOR GEARBOX LEAK	297.5	1091.41	0	15	1403.91
												ATTEND TO NOISE UNDER BONNETT. FOUND FAN BELT TENSIONER HAD FAILED AND BELT DAMAGED. REMOVED PARTS, TRAVELLED TO DENNY'S TO PICK UP NEW BELT AND TENSIONER. FIT NEW PARTS, ALL OKAY					

37161	42935	07/26/2023	1HM368HBG	ID - TRUCK FLI 186G	INT-S	Service Trai	1VT951	28497.000	0	475147	S1 B SERVICE	CARRIED OUT SERVICE & VEHICLE INSPECTION. CHECKED ALL LIGHTS, CHECKED FLUID LEVELS. CHECKED SUSPENSION, BELTS, BRAKES & TYRES. ROAD TESTED - ALL OK AT TIME OF TESTING	336	288.08	0	20	644.08
												NOTED FOR FOLLOW UP: * SUMP LEAK * CENTRE BEARING WORN * LH FRONT SHOCKIE NEEDS REPLACING * VERTICAL MOVEMENT DEVELOPING IN KING PINS * MOVEMENT DEVELOPING IN SPRING BUSHES * MONITOR WEAR ON FRONT STEER TIE-ROD ENDS * FIRST DRIVE AXLE DRIVER'S SIDE BOOSTER LEAKING					
37189	44198	07/26/2023	1HM368HBG	ID - TRUCK FLI 186G	INT-R	Drive Line	1VT951	28497.000	0	475147	REPLACE CENTRE BEARING/BRAKE BOOSTER	BRAKE BOOSTER: REMOVED PIN FROM SLACK ADJUSTER, UNIDID ALL RETAINING BOLTS REMOVED AIR LINES & REMOVED BRAKE BOOSTER CUT DOWN ROD ON NEW BOOSTER TO CORRECT LENGTH FIT AIR LINES & FIT NEW BOOSTER AS REQUIRED BUILT UP AIR & ADJUSTED BRAKES AS REQUIRED - ALL OK CENTRE BEARING: REMOVED REAR SECTION OF TAILSHAFT, YOKE NUT & WASHER REMOVED CENTRE BEARING BOLTS & ATTEMPTED TO REMOVE BEARING. WOULD NOT COME OFF EVEN WITH PORTAPOWVER. REMOVED WHOLE FRONT TAILSAHFT & TOOK TO HARDY SPICER CLEANED ALL SURFACES WHILE WAITING FOR SHAFT LINED UP UNIS ON YOKES & INSTALLED NEW SADDLES BOLTED UP CENTRE BEARING & TENSIONED TAILSHAFT BOLTS TO SPEC ROAD TESTED & RETENSIONED SADDLE BOLTS AS REQUIRED - ALL OK RETURNED VEHICLE TO BATCH PLANT	1122	422.31	0	0	1544.31
36219	45070	07/07/2023	1HM368HBG	ID - TRUCK FLI 186G	R	Sundries	1VT951	0.0000	0		CHECK AIR VALVE FAULT	CHECK AIR VALVE FAULT TIGHTENED LOOSE FITTING	36.5	0	0	0	36.5
34766	39068	06/13/2023	1HM368HBG	ID - TRUCK FLI 186G	INT-R	Electrical	1VT951	28310.000	0	472667	Replace batteries	TESTED BATTERIES FOUND AT 12v BUT INSUFFICIENT CURRENT TO START TRUCK TRIED TO BOOST WITH JUMP PACK, BUT NO IMPROVEMENT REPLACED BATTERIES AS REQUIRED & TESTED - VOLTAGE NOW 12.56, TRUCK STARTED IMMEDIATELY CHECKED CHARGE RATE WHILE TRUCK WAS RUNNING READING AT 13.26v, CHARGING FROM ALTERNATOR ALL OK SPRAYED TERMINALS WITH TERMINAL PROTECTOR & REPLACED COVER	149.44	340.6	0	0	490.04

34111	39155	05/30/2023	1HM368HBG	ID - TRUCK FLI 182G	R	Exhaust	1VT951	28309.000	0	REPAIR EXHAUST	REMOVE DAMAGED EXHAUST SECTION. CUT AND FABRICATE NEW SECTION INTO OLD EXHAUST. WELD OUT ALL FABRICATED COMPONENTS. REFIT EXHAUST.	376.67	97.15	0	75	548.82
34180	39098	05/30/2023	1HM368HBG	ID - TRUCK FLI 186G	INT-R	Suspension	1VT951	28309.000	472666	Suspension repairs	CARRIED OUT REIARS AS PER LIST: - REPLACED DRIVER'S SIDE REAR STEER AXLE SPRING - REPLACED DRIVER'S SIDE PIVOT SPRING PIN & BUSH - REPLACED FRONT DRIVE AXLE TORQUE ROD ASS'Y - REPLACED EXHAUST ELBOW & FLEX - REPLACED REAR DRIVE AXLE SHOCK ABSORBERS WASHED & ROAD TESTED - ALL OK AT TIME OF TESTING	2848.84	6987.1	0	75	9910.94
34053	39095	05/29/2023	1HM368HBG	ID - TRUCK FLI 186G	INT-R	Engine	1VT951	28309.000	28309	REPAIR EXHAUST	FIT NEW ELBOW UNDER MUFFLER, & REPLACED ELBOW FROM MUFFLER TO FIRST JOIN. REPLACED EXHAUST FLEX TO ENGINE PIPE. CHECKED FOR FURTHER EXHAUST LEAKS - NONE FOUND, ALL OK	1974.63	498.78	0	75	2548.41
32800	38936	05/24/2023	1HM368HBG	ID - TRUCK FLI 186G	R	Tyres	1VT951	0.0000	472101	MICHELIN XZY3 X2 + BAL X2 + DIS X2		0	1410	0	0	1410
31151	35705	04/19/2023	1HM368HBG	ID - TRUCK FLI 186G	INT-S	Service Trailer	1VT951	28115.000	469941	S1 C SERVICE	CARRY OUT SERVICE AND VEHICLE INSPECTION. CHECK ALL LIGHTS, CHECK FLUID LEVELS. CHECK SUSPENSION, BRAKES AND TYRES ROAD TESTED - ALL OK AT TIME OF TESTING	789.28	532.26	0	40	1361.54
30604	35104	04/06/2023	1HM368HBG	ID - TRUCK FLI 186G	R	Chassis	1VT951	28033.000	469116	Fault / List	NOTED FOR FOLLOW UP: * MONITOR WEAR IN SPRING PIN BUSHES * SUMP LEAKING * SUMP PLUG LOOSE * COOLANT LEAK Barrel Frame bolts U/S RHS steer tyre Pendant Faulty ATTENDED TO FAULTS AS LISTED: - REPLACED 2x BROKEN AGI BOLTS - REPLACED AGI PENDANT	103.46	0	0	5	108.46
27704	32612	02/27/2023	1HM368HBG	ID - TRUCK FLI 186G	S	Chassis	1VT951	27800.000	465617	B' Service/ Fault List	NOTE: NEW FRONT STEER TYRES NEEDED ASAP (RUBAND TOO BUSY TO REPLACE AT TIME OF REPAIRS) CARRY OUT SERVICE AND VEHILCE INSPECTION. CHECK ALL LIGHTS, CHECK FLUID LEVELS. CHECK SUSPENSION, BRAKES AND TYRES - INSPECT REPORTED A/C LEAK ON PASSENGER FLOOR, UNABLE TO FAULT AT TIME. - ADDRESS REPORTED FAULT WITH ACCELERATOR PEDAL ROLLER STICKING, SAND ACCELERATOR PLATE AND TEST ALL OK NOTES: TRUCK TO RETURN FOR PENDANTS AND HOUR METER	619.11	251.58	0	30	900.69

27334	32306	02/20/2023	1HM368HBG	ID - TRUCK FLI 186G	R	Tyres	1VT951	0.0000	0	C/OUT - FIT RUN OUT TYRE + DISPOSAL + SERVICE CALL X2 HOURS	C/OUT - FIT RUN OUT TYRE + DISPOSAL + SERVICE CALL X2 HOURS	0	265	0	0	265
26131	32056	02/15/2023	1HM368HBG	ID - TRUCK FLI 186G	INT-R	Brake	1VT951	27740.0000	464733	Replace leaking brake booster	REPLACE RHR BRAKE BOOSTER AND ADJUST BRAKES	256.89	63.64	0	105	425.53
23830	29260	12/13/2022	1HM368HBG	ID - TRUCK FLI 186G	INT-S	Service Trar	1VT951	27488.0000	460974	S1 BSERVICE	SERVICE AS PER SHEET	413.85	266.27	0	25	705.12
											ADJUST CLUTCH CLEAN CONCRETE OFF BRAKE ADJUSTERS WASH OFF ENGINE					
											NOTES : OIL LEAK AROUND OIL COOLER					
22243	26327	11/08/2022	1HM368HBG	ID - TRUCK FLI 186G	R	Tyres	1VT951	26981.0000	457617	PUNCTURE REPAIR X1		0	65	0	0	65
21652	25307	10/26/2022	1HM368HBG	ID - TRUCK FLI 186G	R	WHEEL_ALI	1VT951	26981.0000	456266	WHEEL ALIGNMENT AND STEER TYRE ROTATION	COMPLETE WHEEL ALIGNMENT ROTATE STEER TYRES ASSESS VIBRATIONS AND ROAD TEST	538.01	70	0	0	608.01
21571	25041	10/24/2022	1HM368HBG	ID - TRUCK FLI 186G	INT-S	Engine	1VT951	0.0000		S1 B SERVICE	1VT951 27168HRS 456251KMS	587.49	357.35	0	20	964.84
											COMPLETED SERVICE AS REQUIRED OIL FILTER LF9039 FUEL FILTER FF5488 FUEL FILETR PRIMARY FS1003. AIR FILTER AF4878					
19728	23884	09/12/2022	1HM368HBG	ID - TRUCK FLI 184G	INT-R	Brake	1VT951	26981.0000	0	REPLACE BLOCK AIR VALVE	REPLACE WATER TANK AIR CONTROL VALVE	85.63	51.32	0	0	136.95
19151	22661	08/31/2022	1HM368HBG	ID - TRUCK FLI 186G	INT-S	Service Trar	1VT951	25870.0000	452077	S1 B SERVICE	OIL FILTER LF9039 FUEL FILTER FF5488 FUEL FILETR PRIMARY FS1003. AIR FILTER AF4878 COMPLETE B SERVICE REPLACE A/C BELT REPAIR DAMAGED LIGHTS REPLACE E-STOP REPLACE LOOSE PENDANT WIRING	792.15	358.87	0	50	1201.02
											NOTES: INSEPCTED TYRES, RECOMMEND WHEEL ALIGNMENT AND TYRE ROTATION AT NEXT SERVICE					
18009	21931	08/08/2022	1HM368HBG	ID - TRUCK FLI 186G	INT-R	Brake	1VT951	26561.0000	447672	REPLACE LEAKING RELAY VALVE	CHECKED FOR AIR LEAK. FOUND AIR LEAK AT RELAY VALVE. SUPPLIED AND FITTED NEW UNIT TESTED OK	455.24	117.97	0	20	593.21
16809	19836	07/12/2022	1HM368HBG	ID - TRUCK FLI 186G	INT-R	Exhaust	1VT951	26561.0000	447672	EXHAUST REPAIRS	ATTEND TO EXHAUST FALLEN OUT OF MUFFLER FOUND BOTH ENDS OF PIPE STRAIGHTEN PIPE AS BEST AS POSSIBLE TO RESEAT INTO MUFFLER MAKE NEW CLAMP TO HOLD TOGETHER AS EXISTING CLAMP NOT SUITABLE	248.31	0	0	10	258.31
16633	19331	07/08/2022	1HM368HBG	ID - TRUCK FLI 186G	INT-S	Service Trar	1VT951	26545.0000	447445	S1 B SERVICE	COMPLETE B SERVICE	620.7	259.46	0	30	910.16
15696	18175	06/17/2022	1HM368HBG	ID - TRUCK FLI 186G	INT-R	Sundries	1VT951	26424.0000	445846	Replace air valve	REPLACED 3 WAY BALL VALVE TESTED - OK	190.03	151.24	0	10	351.27
15655	18515	06/16/2022	1HM368HBG	ID - TRUCK FLI 181G	R	Bodywork	1VT951	0.0000	0	REPLACE BROKEN BONNET HINGE	REPLACE BROKEN BONNET HINGE CUT BROKEN HINGE FROM BONNET AND GLUE IN NEW HINGE STRIP DRIVERS DOOR AND WELD UP SO AS TO STRENGTHEN	1591.15	529.12	0	20	2140.27

15337	18130	06/07/2022	1HM368HBG	ID - TRUCK FLI 186G	INT-R	Engine	1VT951	0.0000	445338	REPAIR ENGINE OIL LEAK	INSPECT FOR ENGINE OIL LEAK FOUND ROLL PRESSURE SENSOR LEAKING - TIGHTEN AND TST ALL OK FOUND SUMP AND LIVE DRIVE O-RING LEAKING REMOVE AND REPLACE SUMP GASKET REMOVE AND REPLACE LIVE DRIVE O-RING REFILL OIL AND TEST ALL OK	811.43	253.64	0	50	1115.07
13423	15927	04/27/2022	1HM368HBG	ID - TRUCK FLI 186G	S	Service Trar	1VT951	26165.0000	442798	S1 B SERVICE	LF9039 FS1003 FF5488 SOS002 COMPLETE B SERVICE REPLACED BLOWN MIRROR LIGHT REPLACED E-STOP ON BOWL AND REPAIRED TAMPERED WIRING MAKING E-STOP INOP. NOTES: SPRING PINS AND BUSHES WORN SUMP GASKET LEAKING CLAMP ON DUMP PIPE LOOSE AIR LEAK IN HOSE TO FAN HUB - REPLACED COOLANT LEAK - NEW HOSE CLAMP AUXILIARY FRONT HOUSING O-RING LEAKING REAR BRAKES GETTING LOW FAULT DOCKET 61072 NOTES: COOLANT LEAK ON HEATER SYSTEM - ON ORDER EXHAUST CLAMP ON TURBO LOOSE - TIGHTENED	549.37	539.99	0	25	1114.36
11283	12635	03/03/2022	1HM368HBG	ID - TRUCK FLI 186G	INT-R	Bodywork	1VT951	0.0000	0	REPLACE WINDSCREEN	FIT NEW NUT SETS IN ROOF	219.31	0	509.09	10	738.4
11166	12772	03/02/2022	1HM368HBG	ID - TRUCK FLI 186G	S	Service Trar	1VT951	25819.0000	437551	S1 B SERVICE	PREPARE TRUCK TO HAVE WINDSCREEN REPLACED CARRIED B TYPE SERVICE AS PER SERVICE SHEET FRONT & REAR SPRING BUSHES WORN OIL LEAK FROM ENGINE STEAM CLEAN AND MONITOR REPLACED BLOCKED AIR FILTER REPLACED LEAKING BALL VALVE ON AIR TANK REPLACED WORN FAN BELT REPLACED WINDSCREEN REPLACED CLUTCH PEDAL RUBBER TIGHTER LOOSE GRILL BOLTS TESTED - OK	896.05	621.69	0	45	1562.74
9048	10334	01/14/2022	1HM368HBG	ID - TRUCK FLI 186G	R	Tyres	1VT951	0.0000	433256	MICH XZY3 X2 STEER + BAL X2 + DIS X2 + ROT X1	MICH XZY3 X2 STEER + BAL X2 + DIS X2 + ROT X1	0	1402	0	0	1402
8945	10181	01/13/2022	1HM368HBG	ID - TRUCK FLI 186G	INT-R	Sundries	1VT951	25528.0000	433710	Repairs as per list	REPLACE SHTE BRAKES ON BOWL INSPECT WINDOW LEAK, TEST IN WASHBAY FOR PERIOD OF TIME. NO LEAK OCCURED	266.04	0	0	15	281.04
8667	10109	01/05/2022	1HM368HBG	ID - TRUCK FLI 186G	INT-S	Service Trar	1VT951	25510.0000	433255	S1 C SERVICE	COMPLETE C-TYPE SERVICE	798.12	429.62	0	40	1267.74
8678	10110	01/05/2022	1HM368HBG	ID - TRUCK FLI 186G	INT-R	Electrical	1VT951	25510.0000	433255	ELECTRICAL REPAIRS	REPLACE AND RELOCATE REVERSE BUZZER REPLACED FLASHING LIGHT	228.03	0	0	15	243.03
8212	11384	12/16/2021	1HM368HBG	ID - TRUCK FLI 186G	INT-R	Service Trar	1VT951	0.0000	0	S1 A SERVICE	COMPLETE A SERVICE	228.03	172.71	0	0	400.74
7810	9089	12/08/2021	1HM368HBG	ID - TRUCK FLI 186G	R	Tyres	1VT951	0.0000	437188	Puncture repair	PUNCTURE REPAIR	0	60	0	0	60
7499	8432	11/30/2021	1HM368HBG	ID - TRUCK FLI 186G	R	Sundries	1VT951	25324.0000	430410	List of repairs	REPLACED BROKEN BODY MOUNT BOLT ON LH/F REPAIR LOOSE GEAR STICK	76.01	0	0	4	80.01

6690	7740	11/10/2021	1HM368HBG	ID - TRUCK FLI 186G	INT-R	Air Con	1VT951	25074.000	415606	REPAIR A/C	Checked no A/C on Kenworth. No gas in system, pressurised system, located leaking hose at condensor. Removed hose, made up new hose as required. Replaced reciever drier and o-rings. vacuumed system down, pressure checked OK. Added dye to system. Gassed with 1000gm or R134a. Leak checked ok.	190.03	213.55	0	10	413.58
6580	8287	11/08/2021	1HM368HBG	ID - TRUCK FLI 186G	S	Service Trai	1VT951	0.0000	427930	S1 B SERVICE	B SERVICE AS PER SERVICE SHEET REPLACE REAR REVERSE ALARM REPLACE INDICATOR PLUG	706.78	341.73	0	35	1083.51
6088	7775	10/26/2021	1HM368HBG	ID - TRUCK FLI 184G	R	Engine	1VT951	25074.000	426280	REPLACE BLOWN COOLANT HOSE	REMOVE AND REPLACE BLOWN COOLANT HOSE, TOP UP COOLANT AND TEST FOR LEAKS TRAVEL BRIGHTON AND RETURN	128.13	30.15	0	73.5	231.78
5759	6968	10/15/2021	1HM368HBG	ID - TRUCK FLI 186G	INT-R	Bodywork	1VT951	24958.000	0	Replace door locks	Supplied and fitted new door locks. Collected from CJD. Removed door trims and fitted locks. Tested ok.	266.04	117.94	0	13	396.98
5721	7767	10/14/2021	1HM368HBG	ID - TRUCK FLI 186G	INT-R	Transmissio	1VT951	0.0000	425725	REPAIR LEAKING GEAR KNOB	REPAIR AIR LEAK ON GEAR KNOB LOCTITE SCREWS IN GEAR KNOB	76.01	0	0	0	76.01
5229	5681	10/01/2021	1HM368HBG	ID - TRUCK FLI 184G	R	Brake	1VT951	24958.000	0	REPLACE BLOWN BRAKE BOOSTER	INSPECT AIR LEAK ,REMOVE AND REPLACE BLOWN BOOSTER ON RIGHT FRONT DRIVE AXLE, ADJUST AND TEST BRAKES TRAVEL BOYER AND RETURN	213.55	64.8	0	97	375.35
210427-00	SVC00263	09/29/2021	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	416466 KM		S1 A SERVICE	COMPLETED SERVICE AS PER SERVICE SHEET.	72.7	75.59	0	0	148.29
4756	5264	09/21/2021	1HM368HBG	ID - TRUCK FLI 184G	R	Brake	1VT951	24624.000	0	REPAIR AIR LEAK	TRAVEL TO BRYN ESTYN CAGE OFF LEFT FRONT DRIVE AXLE BOOSTER AND BLOCK OFF AIR LINE. FOLLOW UNIT BACK TO LA FOR BOOSTER REPLACEMENT	213.55	0	0	72.5	286.05
4765	6282	09/21/2021	1HM368HBG	ID - TRUCK FLI 186G	R	Brake	1VT951	24898.000	423477	Replace leaking brake booster	CLEAN OFF CONCRETE, REMOVE BRAKE CHAMBER AND CUT ROD TO LENGTH. FIT NEW BRACK CHAMBER AND CHECK FOR LEAKS ADJUST BRAKES	266.04	198.52	0	0	464.56
4517	4505	09/15/2021	1HM368HBG	ID - TRUCK FLI 186G	INT-S	Service Trai	1VT951	24874.000	423034	S1 B SERVICE	COMPLETE S1 B SERVICE AS PER SERVICE SHEET	380.05	240.78	0	0	620.83
4243	7282	09/08/2021	1HM368HBG	ID - TRUCK FLI 186G	R	Trimming	1VT951	0.0000	422534	Replace drivers seat	REPLACE DRIVERS SEAT	58.5	3018.83	0	5	3082.33
4184	6110	09/07/2021	1HM368HBG	ID - TRUCK FLI 186G	R	Engine	1VT951	0.0000	422325	INSPECT TACO FAULT	INSPECT TACHO FOR FAULT. FOUND CAPACITOR AT ALTERNATOR TO BE DAMAGED REPLACED WITH NEW AND TEST	76.01	70.01	0	5	151.02
3750	5340	08/27/2021	1HM368HBG	ID - TRUCK FLI 186G	R	Engine	1VT951	0.0000	421530	ENGINE OIL LEAKS, CLUTCH, WINDSCREEN LEAKS	INSPECT AND GREASE ALL CLUTCH PIVOT AND LINKAGE POINTS. ALL OK INSPECT FOR OIL LEAKS, FOUND OIL PRESSURE SWITCH TO BE LEAKING FROM THREAD. TIGHTENED UP AND STEAM CLEAN - MONITOR OIL ALSO LEAKING FROM FLYWHEEL HOUSING - MONITOR	342.05	0	0	0	342.05
3609	4022	08/24/2021	1HM368HBG	ID - TRUCK FLI 186G	R	Tyres	1VT951	0.0000	421038	XCEED XL759 11R22.5 X8 DRIVE TYRES + DISPOSAL X5		0	2530	0	0	2530

3188	3322	08/13/2021	1HM368HBG	ID - TRUCK FLI 186G	R	Clutch	1VT951	24424.000	420318	CLUTCH REPAIRS	REMOVED FAILED CLUTCH PLATE ASSEMBLY. BROKE THE RETAINING STRAPS OFF THE INTERMEDIATE PLATE. FOUND CRACK EN THE ENGINE SIDE BELLHOUSING. ADVISED TO DRILL HOLE AT THE ROOT OF THE CRACK AND MONITOR. MACHINED THE FLYWHEEL AND FITTED UP NEW CLUTCH PLATE KIT. REPLACED WORN THROW OUT SHAFTS, BUSHES ,YOKE AND LEVERS. COMPLETED ASSEMBLY AND ADJUSTED THE CLUTCH BRAKE AND CLUTCH.	1493.94	2311.8	0	0	3805.74
3064	3238	08/11/2021	1HM368HBG	ID - TRUCK FLI 186G	R	Bodywork	1VT951	24424.000	420018	SIEZED BONNET REPAIRS	REMOVED BUMPER AND REMOVED SIEZED BONNET PIVOT PIN. PRESSED APART THE PIN ASSEMBLY AND CLEANED UP THE SHAFT. REASSEMBLED AND GREASED THE SHAFT. REFITTED THE PIVOT ASSEMBLY TO THE VEHICLE AND MOUNTED THE BONNET. REFITTED THE BUMPER.	614.05	0	0	0	614.05
2498	2286	07/28/2021	1HM368HBG	ID - TRUCK FLI 186G	R	Drive Line	1VT951	24424.000	419173	REPLACE FAILED CENTRE BEARING	INSPECTED DRIVE SHAFT. FOUND FAILED CENTRE BEARING. REMOVED DRIVE SHAFT AND FITTED NEW CENTRE BEARING AND STRAPS. REFITTED SHAFT AND TEST DROVE ,OK. ADJUSTED THE CLUTCH.	427.47	252.37	0	0	679.84
1806	2210	07/12/2021	1HM368HBG	ID - TRUCK FLI 186G	S	Service Trar	1VT951	0.0000	0	S1 A SERVICE	COMPLETED SERVICE AS PER SERVICE SHEET. NOTE SLIGHT MOVEMENT IN CENTRE BEARING AND LEAK AT THE SUMP.	260.3	180.84	0	0	441.14
1847	2064	07/12/2021	1HM368HBG	ID - TRUCK FLI 186G	R	Bodywork	1VT951	0.0000	417776	DOOR HANDLE REPAIRS	SWAPPED OUT RHS INTERIOR DOOR HANDLE FROM 1VT864 IN THE PAINT SHOP AND FITTED TO 1VT951. WHEN NEW DOOR AHNDLE ASSEMBLY ARRIVED IT WAS FITTED BACK ON THE DOOR OF 1VT864 IN THE PAINT SHOP.	74.37	163.12	0	0	237.49
201216-00	SVC00256	06/23/2021	1H0368	IC-TRUCK FLE 105_HBGN	R	Engine	1VT951			CALL-OUT FAILED RADIATOR HOSE	1VT951	0	928.05	0	0	928.05
											JOB CARRIED OUT - CALL OUT - FAILED RADIATOR HOSE.					
477	2250	06/09/2021	1HM368HBG	ID - TRUCK FLI 186G	R	Suspensior	1VT951	24424.000	416466	REPLACE AIR BAG 1VT951 CUTOVER	REPLACED REAR SUSPENSION AIR BAG	190.03	201.73	0	0	391.76
33	2153	05/31/2021	1HM368HBG	ID - TRUCK FLI 186G	R	Electrical	1VT951	24245.000	414200	1VT951 - REPLACE TAIL LIGHT	Replaced smashed tail light on agitator. Removed old, supplied and fitted new. Wired in, tested ok.	111.56	145.45	0	0	257.01
210503-00	SVC00263	05/27/2021	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	411914 KM		S1 A SERVICE		532.26	194.03	0	26.5	752.79
210414-00	SVC00263	04/29/2021	1H0368	IC-TRUCK FLE 186_INT	R	Suspensior	1VT951	410336 km		Suspension repairs	REMOVED REAR TRAILING ARM ASSEMBLY BECAUSTE THE DRIVE SHAFT HAD WORN INTO THE 57MM SHAFT. FRITTED NEW TRAILING ARM ASSEMBLY. REPAIR DRIVE LINE COMPLETED BY HARDY SPICER. REPLACED FAULTY LEVELING VALVE THAT WAS GOING INTO HIGH RISE AFTER LOAD WAS DISCHARGED.	1090.5	1847.67	1061.13	50	4049.3
210420-00	SVC00263	04/26/2021	1H0368	IC-TRUCK FLE 186_INT	A	Bodywork	1VT951	410652 km		GUARD DAMAGE	REPLACED RHS REAR STEER AXLE GUARD. USED SECOND HAND GUARD FROM 1VT981. ATT BUZZ.	109.05	0	0	5.5	114.55
210316-00	SVC00261	04/13/2021	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	407765 km		S1 B SERVICE		521.38	251.31	0	26	798.69

210303-00	SVC00260	03/03/2021	1H0368	IC-TRUCK FLE 183_INT	R	Tyres	1VT951	405,991 KM	PUNTURE REPAIR	1VT951 KENWORTH 405,991 KM	0	0	54.55	0	54.55
										REPAIR PUNTURED TYRE.					
210212-00	SVC00260	02/23/2021	1H0368	IC-TRUCK FLE 186_INT	R	Differential	1VT951	405194 KM	REPLACE DIFF / AXLE	(RUBAND TYRES) REMOVED REAR DIFF AND BROKEN AXLE FROM THE AXLE LOCK SIDE. DISASSEMBLED DIFF AND FOUND DAMAGE TO HEMOISPHERE SPLINES FOR AXLE LOCK. TRAVELED TO CJD AND PICKED UP NEW DIFF. SWAPPED OVER PARTS AND CLEANED OUT THE DIFF HOUSING. FITTED THE DIFF AND NEW AXLE (AXLE EX STOCK FROM CATTLE HILL) REFITTED THE JACK SHAFT AND TOPPED UP THE DIFF OIL	1798.56	4032.54	0	50	5881.1
201105-00	SVC00255	02/22/2021	1H0368	IC-TRUCK FLE 186_INT	R	Brake	1VT951	398266 km	Brake repairs	REPLACED SLACK ADJUSTER LHS FOURTH AXLE. ADJUSTED ALL BRAKES. ADJUSTED THE CLUTCH. SUPPLIED NEW WHEEL NUT, AXLE AND HUB COVERS FOR THE DRIVER TO FIT.. ORDERED NEW REAR AXLE BACKING PLATES AND GRILL BOLTS TO BE FITTED.	145.4	668.69	0	7	821.09
201105-00	SVC00257	02/22/2021	1H0368	IC-TRUCK FLE 186_INT	R	Brake	1VT951	398266 km	Brake repairs	JOB RE-OPENED FOR CREDIT FOR PARTS ONLY	0	-164.94	0	0	-164.94
210215-01	SVC00259	02/17/2021	1H0368	IC-TRUCK FLE 183_INT	R	Tyres	1VT951	405,194 KM	FIT CUSTOMERS PRODUCT	1VT951 KENWORTH 405,194 KM	0	0	88	0	88
										FIT CUSTOMERS PRODUCT TYRE DISPOSAL CHARGE.					
210212-00	SVC00259	02/16/2021	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	405194 KM	S1 A SERVICE	(RUBAND TYRES) COMPLETED SERVICE AS PER SERVICE SHEET. ADJUSTED THE CLUTCH, FREED UP SLACK ADJUSTERS. REPLACED GREASE NIPPLE ON THE BONNET PIVOT.	358.38	91.83	0	0	450.21
210212-00	SVC00259	02/16/2021	1H0368	IC-TRUCK FLE 186_INT	R	Suspensior	1VT951	405194 KM	Replace air bag	TRAVELED TO CJD AND PICKED UP AIR BAG. REMOVED WHEELS AND GAURD TO ACCESS BLOWN AIR BAG. REPLACED AIR BAG AND COMPLETED REASSEMBLY. TENSIONED WHEEL NUTS.	235.5	334.55	0	0	570.05
210215-00	SVC00259	02/16/2021	1H0368	IC-TRUCK FLE 184_INT	R	Differential	1VT951	405,194KM	BREAK DOWN BROKEN AXLE	INSPECT FAULT WITH AIR BAG AND AXLE,REMOVE BOTH REAR AXLES AND REMOVE BROKEN PIECES. REFIT LEFT HAND AXLE AND FLANGE SECTION OF BROKEN AXLE TO STOP OIL LEAKING. ATTEMPT TO REPLACE AIR BAG BUT FOUND FITTINGS RUSTED , SEALED OF AIR LINE TO ALLOW TRUCK TO BUILD UP AIR AND BE DRIVEN BACK TO WORKSHOP TRAVEL RISDON VALE AND RETURN	327.15	0	0	62.5	389.65
201204-00	SVC00256	12/09/2020	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	400868 km	S1 B SERVICE	COMPLETED 1 B SERVICE AS PER SERVICE SHEET. REPLACED REAR BRAKE BACKING PLATED ORDERED PREVIOUS SERVICE CALL. NOTE SOME BRAKES WILL REQUIRE REPLACEMENT NEXT SERVICE.	403.43	335.83	0	20	759.26
201204-00	SVC00256	12/07/2020	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	400847 km	COOLANT LEAK	SHORTENED LEAKING COOLANT HOSE TO THE HEADER TANK AND RECLAMPED. TAPED EXPOSED WIRING AT THE BONNET PIVOT POINT. TOPPED UP THE COOLANT AND CHECKED FOR LEAKS.	72.7	0	0	0	72.7

201104-00	SVC00255	11/06/2020	1H0368	IC-TRUCK FLE 181_INT	R	Sundries	1VT951		SUPPLY MATERIALS FOR REFURB		0	1303.38	0	370	1673.38
200817-00	SVC00253	10/30/2020	1H0368	IC-TRUCK FLE 181_INT	R	Bodywork	1VT951	396151km:	REFURBISH UNIT	REMOVE BOWL AND CRADLE FROM TRUCK. STRIP DOWN CRADLE AND FITTINGS FROM TRUCK NEEDLE GUN TO REMOVE CONCRETE FROM CRADLE AND CHASSIS PRIOR TO SANDBLASTING (3 DAYS) CARRY OUT WELDING REPAIRS TO CRADLE FROM ACCIDENT DAMAGE AND GENERAL WEAR AND TEAR WHERE REQUIRED REPLACE RUSTED RHS SECTIONS CARRY OUT MAJOR REPAIRS TO CAB FIBREGLOSS WHERE REQUIRED AND REPLACE BROKEN RIVETS IN CAB PANELS. REPLACE DRIVERS DOOR ON CAB WITH ONE FROM BODYWORKS STOCK RESPRAY CAB AND BONNET WHITE AND RED RESPRAY BOWL CRADLE AND CHUTES SANDBLAST AND PAINT CHASSIS FIT NEW PARTS TO TRUCK AS REQUIRED FIT FOUR NEW OUTER RIMS TO REAR AXLES FIT HAZELL DECALS UNIT NUMBERS SCROLLS AND PINLINES TO TRUCK FIT TRUCK BACK UP ONCE PAINTED CHECK BOWL SPEED AND OPERATION FOLD UP NEW LIGHT BAR FOR REAR OF TRUCK AND FIT NEW TAILLAMPS POLISH UP EXHAUST SHROUD,MIRRORS,GRILLE AND OTHER PIECES AS WELL AS POSSIBLE FIT NEW MUFFLER AND STACK	32581.72	6940.05	2620	590	42731.77
201020-00	SVC00254	10/28/2020	1H0368	IC-TRUCK FLE 186_INT	R	Bodywork	1VT951		REPLACE WINDOW REGULATOR	DISMANTLE AND FIT NEW WINDOW REGULATOR	218.1	280.64	0	10.5	509.24
201012-00	SVC00253	10/27/2020	1H0368	IC-TRUCK FLE 184_INT	R	Engine	1VT951	396,245KM	INSPECT FOR ENG. OIL LEAK.	INSPECT FOR ENGINE OIL LEAK. FOUND REAR MAIN SEAL LEAKING TRAVEL TO MARY'S HOPE ROAD AND RETURN REMOVED DRIVE SHAFT AND GEARBOX. REMOVED CLUTCH ASSEMBLY AND FLYWHEEL. REMOVED LEAKING REAR MAIN SEAL AND WEAR SLEEVE. MACHINE INSTALATION TOOL FOR NEW SEAL AND SLEEVE. COMPLETED REASSEMBLY AND ADJUSTED THE CLUTCH. WASHED OFF OIL FROM AROUND THE GEARBOX AREA AND RETURNED VEHICLE TO THE YARD.	89.2	10.91	0	12.5	112.61
201008-00	SVC00254	10/20/2020	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	396249 km	REPLACE REAR MAIN SEAL	REMOVED DRIVE SHAFT AND GEARBOX. REMOVED CLUTCH ASSEMBLY AND FLYWHEEL. REMOVED LEAKING REAR MAIN SEAL AND WEAR SLEEVE. MACHINE INSTALATION TOOL FOR NEW SEAL AND SLEEVE. COMPLETED REASSEMBLY AND ADJUSTED THE CLUTCH. WASHED OFF OIL FROM AROUND THE GEARBOX AREA AND RETURNED VEHICLE TO THE YARD.	1928.11	760.8	0	50	2738.91
201009-00	SVC00254	10/20/2020	1H0368	IC-TRUCK FLE 186_INT	R	Steering	1VT951	396249 km	WHEEL ALIGNMENT	INSPECTED TOE IN ON BOTH AXLES. ADJUSTED THE PHASING BETWEEN THE FIRST AND SECOND AXLE. TOE IN FIRST AXLE IS 3/4 MM AND SECOND AXLE 1 1/2 MM	290.8	0	0	0	290.8
200603-00	SVC00248	10/07/2020	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	396150 km	CHECK ENGINE FAN WIRING	CHECKED ENGINE FAN NOT WORKING ON AUTO. SUSPECTED FAULTY FAN SOLENOID. NO NEW ONES IN STOCK OR AVAILABLE THAT DAY. FITTED SPARE SECOND HAND UNIT. FAN NOT WORKING STILL. SUPPLIED AND FITTED NEW FAN SOLENOID. TESTED OK.	701.38	382.93	0	35	1119.31
200821-00	SVC00251	08/26/2020	1H0368	IC-TRUCK FLE 186_INT	R	Suspensior	1VT951	BATTERIES	REPLACE LHS RIDE HEIGHT VALVE	REPLACED VALVE WITH SPARE UNIT. WILL NEED ADJUSTING WITH WEIGHT ON THE VEHICLE.	109.05	0	0	5.5	114.55

200529-00	SVC00244	07/22/2020	1H0368	IC-TRUCK FLE 182_INT	R	Lathe	1VT951	22638 hrs	RECONDITION BONNET HINGE ASSY	RECONDITION BONNET HINGE ASSY	421.13	0	0	21	442.13
200708-00	SVC00249	07/22/2020	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951		FILTER HOUSING OIL LEAK	REMOVED OIL FILTER AND OIL FILTER HOUSING ADAPTOR. CLEANED OFF GASKET SURFACES AND FITTED NEW GASKET. REASSEMBLED AND REFITTED FILTER.	218.1	50.6	0	11.5	280.2
200715-00	SVC00249	07/22/2020	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	394162 KM	S1 C SERVICE	CARRIED OUT THE REQUIRED SERVICE AND SAFETY INSPECTIONS AS PER SERVICE SHEET.	330.73	536.17	0	16.5	883.4
200715-00	SVC00249	07/22/2020	1H0368	IC-TRUCK FLE 186_INT	R	Brake	1VT951		Brake repairs	REPLACED BRAKE BOOSTER 2ND AXLE LHS.	103.93	55	0	5	163.93
200701-00	SVC00248	07/07/2020	1H0368	IC-TRUCK FLE 186_INT	R	Tyres	1VT951	392899	MICH 11R22.5XZY3 X2 2ND ST X2	MICH 11R22.5XZY3 X2 2ND ST X2 + BALANCE X2 + DISPOSAL x2	0	1246.36	0	0	1246.36
200626-00	SVC00248	06/30/2020	1H0368	IC-TRUCK FLE 186_INT	R	Brake	1VT951	392423 KM	Brake booster repairs	REPLACED BOTH LEAKING FOURTH AXLE BRAKE BOOSTERS. STRAIGHTENED BENT RIDE HEIGHT BRACKET.	320.48	110	0	0	430.48
200522-00	10118	06/29/2020	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	389741 KM	REPLACE THERMOSTAT		0	0	0	0	0
200523-00	SVC00246	06/17/2020	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	389741 KM	FAN HUB REPLACEMENT	INSPECTED FAN HUB OPERATION. FOUND WORN OUT IN THE CLUTCH AND EXCESSIVE BEARING WEAR. REMOVED FAN AND FAN HUB ASSEMBLY. PICKED UP PARTS AND ASSEMBLED. FITTED NEW FAN HUB AND CLUTCH KIT. FITTED THE FAN AND CHECKED OPERATION. FOUND FAULT IN FAN CONTROL. REMOVED AIR SUPPLY TO ALLOW VEHICLE TO RETURN TO WORK. SEAN TO FOILLOW UP ON FAN CONTROL FAULT.	704.16	2269.4	0	35	3008.56
200525-00	SVC00246	06/16/2020	1H0368	IC-TRUCK FLE 186_INT	R	Suspensior	1VT951	389741 KM	REPLACE V BAR BUSHES	REMOVED BUILT UP CONCRETE AROUND SUSPENSION. REMOVED NUTS AND FOUND THROUGH BOLTS SIEZED. HEADS OF BOLTS WOULD NOT ROTATE. HAD TO CUT OFF HEADS AND DRILL OUT EITHER END OF THE BOLT TO LOOSEN IN THE HOUSING. USED PUNCH TO FINALLY REMOVE THE SIEZED BOLTS. REMOVED SUSPENSION TRAILING ARMS AND REPLACED BUSHES. REASSMEBLED AND TENSIONED THE NEW BOLTS. CHECKED TENSION WHEN VEHICLE RETURNED SEVERAL DAYS LATER.	1335.31	677.15	0	50	2062.46
200605-00	SVC00247	06/16/2020	1H0368	IC-TRUCK FLE 186_INT	R	Suspensior	1VT951	390947 KM	Replace air bag	REMOVED AIR BAG LHS 3RD AXLE. TRAVELED TO CJD AND PICKED UP NEW PART. RETURNED AND FITTED.	218.1	372.05	0	10.5	600.65
200602-00	SVC00247	06/10/2020	1H0368	IC-TRUCK FLE 186_INT	R	Suspensior	1VT951	389741 KM	RIDE HEIGHT AJUSTMENT	ADJUSTED RIDE HEIGHT WITH THE AGITATOR LOADED.	83.93	0	0	0	83.93
200518-00	SVC00246	06/03/2020	1H0368	IC-TRUCK FLE 186_INT	R	Suspensior	1VT951	389741 KM	Replace air bag	REPLACED FAILED REAR SUSPENSION AIR BAG.	223.8	415.69	0	11	650.49
200518-00	SVC00246	06/03/2020	1H0368	IC-TRUCK FLE 186_INT	R	Bodywork	1VT951	389741 KM	SEAT REPAIRS	REMOVED FAILED SEAT AND DISASSEMBLED. FOUND BASE NEEDED REPLACING. DISASSEMBLED SECOND HAND SEAT AND SWAPPED OVER PARTS. REASSEMBLED SEAT WITH NEW SEAT BELT. REFITTED SEAT TO VEHICLE.	595.84	340.91	0	29.5	966.25

200519-00	SVC00246	06/03/2020	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	389741 KM	Radiator repairs	DRAINED COOLANT AND REMOVED THE RADIATOR AND DELIVERED TO NEW NORRFOLK RADIATORS FOR REPAIRS. DISMANTLE, CLEAN, FLUSH AND REPAIR TEST AND PAINT RADIATOR REFITTED RADIATOR WITH NEW MOUNTING RUBBERS FOR RADIATOR AND INTERCOOLER. FILLED WITH COOLANT AND REPLACED BUMPER ,BONNET AND RADIATOR STAYS. REPLACED ELAKING COOLANT SENSOR. CHECKED FOR LEAKS AND STEAM CLENAED.	1343.1	532.44	650	50	2575.54
200520-00	SVC00246	06/03/2020	1H0368	IC-TRUCK FLE 186_INT	R	Clutch	1VT951	389741 KM	REPLACE CLUTCH PIVOT BEARINGS	REPLACED WORN CLUTCH PIVOT BEARINGS.	55.95	153	0	0	208.95
200520-00	SVC00246	06/03/2020	1H0368	IC-TRUCK FLE 186_INT	R	Bodywork	1VT951	389741	BONNET REPAIRS	WHILE RADAITOR WAS REMOVED AND ACCESS TO THE BONNET PIVOTS WAS EASIER THE BONNET PINS AND PIVOTS WERE REPLACED. PARTS WERE EX STOCK. REPLACED THE BONNET PIVOT MOUNTING RUBBERS AND REASSEMBLED. ADJUSTED THE BONNET.	380.76	154.46	0	19	554.22
200520-00	SVC00246	06/03/2020	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	389741 KM	TURBO OIL LEAKS	REPLACED LEAKING TURBO DRAIN HOSE AND SUPPLY O RING. PARTS EX STOCK.	139.88	0	0	7	146.88
200518-00	SVC00246	06/02/2020	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	389741 KM	S1 A SERVICE	CARRIED OUT THE REQUIRED SERVICE AND SAFETY INSPECTIONS AS PER SERVICE SHEET. REMOVED STEERING SHAFT AND REPLACED ALL UNIVERSAL JOINTS. REPLACED DAMAGED NUMBER PLATE LIGHT. REPLACED DAMAGED SIDE BONNET INDICATOR LIGHT. SUPPLIED NEW FIRST AID KIT.	634.07	348.41	0	31.5	1013.98
200520-00	SVC00246	06/02/2020	1H0368	IC-TRUCK FLE 186_INT	R	Steering	1VT951	389741 KM	Steering repairs	REPLACED WORN DRAG LING BETWEEN FIRST AND SECOND AXLE.	126.45	1402.36	0	6	1534.81
200522-00	SVC00246	05/29/2020	1H0368	IC-TRUCK FLE 184_INT	R	Engine	1VT951	22638 hrs	INSPECT COOLANT LEAK.	INSPECT COOLANT LEAK. CHECK REPORTED OVERHEATING FAULT. TOPPED UP COOLANT AND ESCOURTED TO DUMP LOAD. UNIT RUNNING AT 90DEG C AND FAN NOT CUTTING IN.(FAN TO BE REPLACED IN WORKSHOP)	178.4	0	0	31.25	209.65
200508-00	SVC00245	05/15/2020	1H0368	IC-TRUCK FLE 186_INT	R	Suspensior	1VT951	388797 KM	Replace air bag	TRAVEL CLEARY'S GATES AND RETURN TRAVELED TO CJD AND PICKED UP REAR SUSPENSION AIR BAG. FITTED TO RHS THIRD AXLE.	280.55	372.05	0	14	666.6
200417-00	SVC00244	04/30/2020	1H0368	IC-TRUCK FLE 186_INT	R	Suspensior	1VT951	368381 KM	AIR BAG REPAIRS	AIR BAG REPAIRS. REPLACED FAILED AIR BAG 3RD AXLE RHS.	503.38	252.66	0	25	781.04
200211-00	SVC00241	04/29/2020	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	382873 KM	REPLACE INJECTORS AND PUMP	REPLACE INJECTORS AND PUMP. DISASSEMBLED ENGINE AND REPLACED INJECTORS.HPL AND FUEL PUMP. REPLACED CHAFFED SUPPLY LINED. REASSEMBLED AND BLED FUEL SYSTEM. REN ENGINE AND CHECKED IDLE AND POWER. ALL GOOD. ADJUSTED THE BRAKES AND RETURNED TO CONCRETE.	2094.48	10377.43	0	50	12521.91

200221-00	SVC00241	04/29/2020	1H0368	IC-TRUCK FLE 186_INT	PW	Engine	1VT951		POLICY FUEL PUMP	POLICY FUEL PUMP. DAMAGED HIGH PRESSURE LINE WHEN ASSEMBLING ENGINE AND BROKE OFF INJECTOR ALIGNING PIN. DISASSEMBLED AND REPLACED DAMAGED HPL AND REPLACED BROKEN PIN.	836.05	352.7	0	0	1188.75
200407-00	SVC00243	04/14/2020	1H0368	IC-TRUCK FLE 186_INT	R	Suspension	1VT951	3855807 KI	Suspension repairs	REMOVED WHEELS TO ACCESS FAILED AIR BAG. HEATED UP SIEZED FITTINGS TO ALLOW RMOVAL OF AIR HOSE. REPLACED DMAGED NYLON HOSES AND FITTINGS. FITTED NEW AIR BAG AND REFITTED THE WHEELS. REPLACED BOLT MISSING ON REAR STEP.	422.38	161.34	0	21	604.72
200317-00	SVC00243	03/27/2020	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	384459 km	S1 B SERVICE	CARRIED OUT THE REQUIRED SERVICE AND SAFETY INSPECTIONS AS PER SERVICE SHEET. FITTED NEW WIPER BLADES. FREED UP SIEZED SLACK ADJUSTERS.	327.15	558.69	0	16	901.84
200319-00	SVC00243	03/27/2020	1H0368	IC-TRUCK FLE 186_INT	R	Suspension	1VT951	384675 km	REPLACE REAR SHOCK ABSORBERS	REMOVED BUILT UP CONCRETE AND CUT OFF BROKEN SHOCK ABSORBERS. CLEANED MOUNTS AND FITTED NEW SHOCK ABSORBERS.	363.5	263.54	0	18	645.04
200207-00	SVC00241	02/21/2020	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	22158hrs 3	CHECK FUEL PRESSURE FAULT	Collected truck, Reported down on power, excessive smoke etc. Fitted diagnostic equipment, fault code 449. Fault code indicates excessive fuel pressure is read by the actuator. Checked wiring and electrical connections at fuel pump - all OK. Cleared fault codes.	181.75	0	0	9	190.75
200212-00	SVC00241	02/19/2020	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	22158hrs 3	REPAIR COOLANT LEAK	Checked puddle of coolant under truck. Located leak out of low coolant level sensor. Drained coolant out of top tank, removed sensor. Cleaned out thread, re-sealed sensor and re-fitted. Filled coolant, cleaned coolant stains off radiator. Leak repaired.	218.1	0	0	10	228.1
200121-00	SVC00239	01/29/2020	1H0368	IC-TRUCK FLE 186_INT	R	Suspension	1VT951	381756 KM	Replace air bags	REPLACE AIR BAGS. REMOVED GUARD AND WHEELS FROM THE RHS ,FOURTH AXLE. REMOVED BUILT UP CONCRETE AND UNSIEZED HOSE. REMOVED AIR BAG AND PICKED UP NEW AIRBAG FROM CJD. FITTED AIR BAG ADJUSTED RIDE HEIGHT AND REFITTED WHEELS AND GUARDS.	339.43	353	0	16	708.43
191210-00	SVC00238	01/10/2020	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	399669 KM	S1 A SERVICE	CARRIED OUT THE REQUIRED SERVICE AND SAFETY INSPECTIONS AS PER SERVICE SHEET	263.15	266.8	0	15	544.95
191211-00	SVC00238	12/19/2019	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	379669km	REPLACE REVERSE ALARM	Checked no reverse alarm on kenworth. Tested fuses, OK. Tested wiring to alarm, wiring OK, fault in alarm. Removed faulty alarm, removed concrete off rear to mount new alarm. Mounted and fitted deutsch connector. Tested OK.	109.05	60.88	0	0	169.93
191212-00	SVC00238	12/19/2019	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	379669km	CHECK COOLANT TEMP ALARM/LIGHT	Checked coolant temp alarm stuck on. Removed coolant temp switch wire, alarm still going off. Traced wiring back under truck, found wiring chaffed causing alarm to stay on. Stripped harness back, repaired damage and re-taped. Re-fitted wiring. Tested All good	290.8	101.5	0	15	407.3

191210-00	SVC00237	12/13/2019	1H0368	IC-TRUCK FLE 186_INT	R	Starter Mot 1VT951	379669km	Replace starter motor	Checked Kenworth wont turn over at batch plant. Tested battery voltage, OK. Disturbed starter motor casing, truck turns over indicating worn brushes in starter motor. Cleaned heavily soiled starter and connections before removal. Disconnected batteries, removed starter wiring and bolts. Travelled to Ashdown, matched up starter motor. Returned, fitted new, cleaned up battery leads, re-connected batteries. Test started OK.	448.48	422.89	0	0	871.37
191126-00	SVC00236	11/29/2019	1H0368	IC-TRUCK FLE 186_INT	R	Tyres 1VT951	378804	MICH XZY3 11R22.5 X1+BAL+DISP	MICH XZY3 11R22.5 X1+BAL+DISP	0	622.5	0	0	622.5
191107-00	SVC00236	11/27/2019	1H0368	IC-TRUCK FLE 186_INT	R	Electrical 1VT951	21775hrs	Replace heater fan	Checked heater fan only working on some speeds and noisy. Tested switch and relays, all OK. Problem in fan. Supplied new parts Fitted A/C gauges, removed existing gas. Disconnected A/C hoses from TX valve, TX valve bolts seized to firewall bracket. Filled out hot works permit, cut bolt heads off. Disconnected heater core hoses. Attempted to remove evaporator and heater core, cores seized in heaterbox. Soaked cores in Penetrene to loosen, cores eventually free'd up and came out. Removed thermostat, heater fan wiring and unbolted U/S fan. Heater box filled with dirt/mud beacuse of drain holes blocked. Cleaned heaterbox out, blew drain holes out to clear dirt out so heater box works properly. Fitted old fan bracket to new on bench, adjusted wiring to suit kenworth on fan. Mounted new into heaterbox. Evaporator and heater cores blocked up, sprayed in foam away soloution to healp clear out blockages, hosed off with water. Re-fitted to heater box, fitted thermostat to evap. Re-fitted covers, sealed up with silicon and rivets. Fitted new TX valve and reciever drier, changed o-rings on both sides of TX.	617.95	359.53	0	0	977.48
191114-00	SVC00236	11/27/2019	1H0368	IC-TRUCK FLE 186_INT	R	Electrical 1VT951	21810hrs	REPLACE LHS TAIL LIGHT	Checked no LHS indicator or tail light. Tested power supplies, fault in light. Removed faulty light, supplied and fitted new light. Soldered and heat shrinkd harness. Tested OK. Fitted new flasher unit to suit LED indicators.	254.45	168.77	0	12	435.22
191115-00	SVC00236	11/27/2019	1H0368	IC-TRUCK FLE 186_INT	R	Engine 1VT951	21810hrs	CHECK TEMP GAUGE	Checked truck reportedly running hot under load. Fitted diagnostic equipment, no fault codes. Test ran truck, could not get truck to fault or get hot. Engine fan cutting in correctly. Temp gauge reading accurately.	181.75	0	0	0	181.75
191014-00	SVC00234	10/23/2019	1H0368	IC-TRUCK FLE 186_INT	S	Service 1VT951	375337KM	S1 B SERVICE	S1 B SERVICE CARRIED OUT THE REQUIRED SERVICE AND SAFETY INSPECTIONS AS PER SERVICE SHEET. FREE UP REAR SLACK ADJUSTER	290.8	228.81	0	14.5	534.11

191014-01	SVC00234	10/23/2019	1H0368	IC-TRUCK FLE 186_INT	R		Starter Mot	1VT951	375337KM	CHECK OUT STARTING FAULT	INVESTIGATE STARTING FAULT. JUMP START TRUCK AND CHECK CHARGING RATE.	72.7	0	0	0	72.7
190808-00	SVC00231	09/30/2019	1H0368	IC-TRUCK FLE 186_INT	R		Engine	1VT951	370798 KM	COOLANT LIGHT/OIL LEAKS	COOLANT LIGHT/OIL LEAKS. DEGREASED ENGINE AND GEARBOX TO CHECK FOR OIL LEAK. REPAIRED OIL LEAK AT THE FILTER HEAD. REPAIRED TERMINALS FOR COOLANT TEMP LIGHT.	181.75	0	0	9	190.75
190902-00	SVC00232	09/17/2019	1H0368	IC-TRUCK FLE 186_INT	R		Electrical	1VT951	21402hrs	UHF Repairs	Checked UHF not transmitting, Tested antenna and coax, tested OK. Fitted spare UHF, works OK. Took original radio to Pitts for repair. Collected repaired radio.	218.1	72	35	10	335.1
190903-00	SVC00232	09/04/2019	1H0368	IC-TRUCK FLE 183_INT	R		Tyres	1VT951	372,298 KM	REPAIR PUNTURED TYRE	1VT951 KENWORTH 372,298 KM	0	0	75	0	75
190808-00	SVC00231	08/27/2019	1H0368	IC-TRUCK FLE 186_INT	S		Service	1VT951	370778 KM	S1 B SERVICE	(RUBAND TYRES) S1 SERVICE. COMPLETED SERVICE AS PER SERVICE SHEET. REMOVED DAMAGED LIGHT ASSEMBLY. STRAIGHTENED LIGHT BAR. REPLACED LIGHT ASSEMBLY LHS REAR AND REPAIRED WIRING.	507.35	317.41	0	25	849.76
190808-00	SVC00231	08/14/2019	1H0368	IC-TRUCK FLE 186_INT	R		Clutch	1VT951	370798 KM	CLUTCH INSPECTION	INSPECTED CLUTCH LINKAGES AND ROSE JOINTS. SLIGHT WEAR IN BELL CRANK.	36.35	0	0	0	36.35
190809-00	SVC00231	08/14/2019	1H0368	IC-TRUCK FLE 186_INT	R		Sundries	1VT951	370798 KM	REPLACE DELINIATED LINE SIGNS	REPLACE DELINIATED LINE SIGNS	22.53	37.27	0	0	59.8
190620-00	SVC00228	07/26/2019	1H0368	IC-TRUCK FLE 186_INT	R		Electrical	1VT951	21050hrs	CHECK TRUCK CUTTING OUT	Checked truck de-rating/cutting out and losing ingition to cab. Fitted diagnostic equipment, fault codes relating to fuel pump over pressure. Followed trouble shooting steps, fault indicating to be an intermittent electrical connection. Disturbed wiring harness and fault went away. Test ran truck loaded and unloaded and would not fault. De-greased and cleaned engine bay area where needed to locate harness parts. Removed engine/gearbox/ecm/cab harness - Removed side covers, engine air intake, various hoses/clamps and interior. Priced up new harness @\$5500+ gst, harness unavailable currently. Stripped harness down, found faulty wires and previous repairs requiring attention. Cut-out damaged sections, soldered and dual wall heat shrinkd connections. Crimped new ends on harness where needed. Set-up harness in bench, cloth taped entire harness x2 times. Continuity tested harness on bench, tested OK. Re-fitted to truck, secured harness to truck as required. Re-connected gearbox harness, various switches and	2044.63	41.62	0	50	2136.25

190710-00	SVC00227	07/22/2019	1H0368	IC-TRUCK FLE 184_INT	R	Engine	1VT951	367817 KM	CHECK REPORTED OIL LEAK	CHECK REPORTED OIL LEAK , FOUND DIPSTICK TUBE PULLED OUT OF ENGINE. REFITTED TUBE INTO ENGINE AND SECURED IN PLACE WITH CABLE TIES UNTIL NEW PART AVAILABLE TRAVEL KINGSTON AND RETURN NEW DIPSTICK TUBE FITTED IN WORKSHOP .	453.23	228.37	0	57.5	739.1
190702-00	SVC00229	07/12/2019	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	367353 km	ENGINE OIL LEAK	ENGINE OIL LEAK. DISASSEMBED ENGINE BREATHER SYSTEM BACK TO THE BLOCK DRAIN PLATE. REPLACED CHAFFED PIPE AND PLATE O RING. CHECKED PLATE FOR FLATNESS AND FOUND TO BE BENT.NIL STOCK OF THE PLATE AUSTRALIA. REFITTED THE PLATE WITH SEALANT ON THE O RING. STEAM CLEANED AND TOPPED UP ENGINE OIL.	494.13	191.13	0	25	710.26
190704-00	SVC00228	07/11/2019	1H0368	IC-TRUCK FLE 181_INT	R	Bodywork	1VT951		PULL DOOR APART AND GLUE FRAME	PULL DOOR APART AND GLUE FRAME BACK TOGETHER ON RH DOOR HAVE WELDING SHOP WELD UP ALUMINIUM DOOR FRAME TO STRENGTHEN DOOR	290.8	108.8	0	15	414.6
190628-00	SVC00228	07/03/2019	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	366100km	REPLACE HEADLIGHT	checked headlights very poor. RHS light mounts broken, light U/S. Supplied and fitted new light. Aligned right and left hand lights. Parts ex stock	109.05	5.23	0	0	114.28
190606-00	SVC00227	06/26/2019	1H0368	IC-TRUCK FLE 182_INT	R	Trays/Buck	1VT951		REPAIR TARP MOTOR MOUNT	Remove damaged motor mount. Fabricate new mount. Paint and refit mount to motor.	223.8	0	0	25	248.8
190603-00	SVC00227	06/15/2019	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	365649 KM	S1 A SERVICE	CARRIED OUT THE REQUIRED SERVICE AND SAFETY INSPECTIONS AS PER SERVICE SHEET	139.88	177.53	0	15	332.41
190410-00	SVC00224	06/14/2019	1H0368	IC-TRUCK FLE 184_INT	R	Differential	1VT951	361300km	REPLACE BROKEN AXLE RIGHT FRON	REPLACE BROKEN AXLE RIGHT FRONT DRIVE REMOVE BROKEN AXLE FROM FRONT DIFFERENTIAL, FLUSH OUT HOUSING AND REMOVE BROKEN PIECES. FIT NEW AXLE AND FILL DIFF WITH OIL. TEST RUN UNIT , TESTED OK	627.75	1066.77	0	30	1724.52
190603-00	SVC00227	06/14/2019	1H0368	IC-TRUCK FLE 186_INT	R	Brake	1VT951		REPLACE LEAKING BRAKE HOSE	1VT951 air leak. Repaired the air leak and changed a slack adjusted	83.93	44.92	0	0	128.85
190531-00	SVC00227	06/06/2019	1H0368	IC-TRUCK FLE 181_INT	R	Bodywork	1VT951		REPLACE RHF BUMPER CORNER WITH	Adjusted the brakes . REPLACE RHF BUMPER CORNER WITH BETTER ONE FROM BODYWORKS STOCK.	72.7	0	0	0	72.7
190521-00	SVC00227	06/04/2019	1H0368	IC-TRUCK FLE 186_INT	R	Tyres	1VT951	364334 KM	11R22.5 MICH XZY3 X 2 + BALANC	11R22.5 MICH XZY3 X 2 + BALANCE POWDER X 2 + DISPOSAL X 1+ ROTATE X1 CARRIED OUT BY RUBAND DD 56949	0	1238.5	0	0	1238.5
190201-00	SVC00221	05/29/2019	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	356667km	FAULT CODE	Checked truck wont run cruise control and de-rated. plugged in diagnostic equipment, Fault code 242. Have been having issues with this fault on this truck, Conacted Denny mechanical and organised for them to adjust ecm so this fault no longer comes up	109.05	0	0	0	109.05

190507-00	SVC00225	05/29/2019	1H0368	IC-TRUCK FLE 186_INT	R	Sundries	1VT951	346320KM:	repairs as per fault sheet	REPAIRS AS PER FAULT SHEET REPLACED ONE SHOCK ABSORBER ON LHS REAR STEER AXEL AND TWO ON FRONT DRIVE AXEL. REMOVED DRIVE SHAFT FROM REAR TRANSMISSION AND TIGHTEN OUTPUT NUT AND REFITTED DRIVE SHAFT, CHECKED TRUCK DRIVE LINE AND ROAD TEST TO FIND VIBRATION, CHECKED FRONT STEER WHEELS, LHS FRONT OUT OF ROUND. REPLACED TYRES ON FRONT STEER.	470.93	424.11	0	23	918.04
190506-00	SVC00225	05/09/2019	1H0368	IC-TRUCK FLE 186_INT	R	Tyres	1VT951	362938	SPORTRAK 11R22.5 SP917 X + D	SPORTRAK 11R22.5 SP917 X + DISPOSAL X 1 + PUNCTURE REPAIR RUBAND DD56780	0	386.5	0	0	386.5
190403-00	SVC00223	04/06/2019	1H0368	IC-TRUCK FLE 186_INT	R	Drive Line	1VT951	360784 KM	Drive line vibration	DRIVE LINE VIBRATION. TEST DROVE TO CHECK VIBRATION.PLACED VEHICLE ON HOIST AND CHECKED THE DRIE LINE. FOUND MISSING BALANCE WEIGHTS ON SECOND DRIVE SHAFT. TIGHTENED LOOSE EXHAUST SHROUD MOUNTING BOLTS. FITTED BOLTS TO THE LHS SIDE OF THE CAB WHERE THE BODY RIVITS HAD FALLEN OUT.	109.05	0	0	0	109.05
190327-00	SVC00223	04/04/2019	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	359987 KM	S1 B SERVICE	S1 B SERVICE. COMPLETED SERVICE AS PER SERVICE SHEET. REPAIRED DAMAGED GEAR BOX LEVEL PLUG. REPAIRED LADDER BRACKETS.	469.88	295.84	0	23	788.72
190328-00	SVC00223	04/04/2019	1H0368	IC-TRUCK FLE 186_INT	R	Sundries	1VT951	359987 KM	FUEL GUAGE REPAIRS	FUEL GUAGE REPAIRS. REPAIRED DAMAGED FUEL SENDER WIRING	72.7	0	0	0	72.7
190329-00	SVC00223	03/29/2019	1H0368	IC-TRUCK FLE 186_INT	R	Tyres	1VT951	359987	SPORTRAK 11R22.5 WDR26 X 4 +	SPORTRAK 11R22.5 WDR26 X 4 + DISPOSAL X 4 RUBAND DD56370	36.35	1266	0	0	1302.35
190207-00	SVC00221	03/09/2019	1H0368	IC-TRUCK FLE 186_INT	R	Clutch	1VT951	357105KM:	ADJUST CLUTCH	CHECK AND ADJUST THE CLUTCH AND CLUTCH BRAKE ADJUSTED THE BRAKES AND CHECKED THE LOCKING TABS	95.23	7.95	0	0	103.18
190306-00	SVC00222	03/09/2019	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	358905km:	CHECK COOLANT LOSS	Checked radiator cap and related hoses.ok. Replaced coolant over flow pipe as it had a split in it.	90.88	4.06	0	0	94.94
190306-00	SVC00222	03/09/2019	1H0368	IC-TRUCK FLE 186_INT	A	Bodywork	1VT951	358905 KM	Guard repairs	GUARD REPAIRS. REPLACED DAMAGED GUARD AND MUD FLAPS	181.75	128.47	0	9	319.22
190220-00	SVC00221	02/25/2019	1H0368	IC-TRUCK FLE 121_INT	R	Tyres	1VT951	357851	11R22.5 S/TRACK X 1 + DISPOSAL	11R22.5 S/TRACK X 1 + DISPOSAL CARRIED OUT BY RUBAND 54872	0	336.5	0	0	336.5
190107-00	SVC00218	01/11/2019	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	355172 km	S1 A SERVICE	S1 A SERVICE. COMPLETED SERVICE AS PER SERVICE SHEET. FREE UP CLUTCH AND ADJUST.	145.4	176.37	0	12	333.77
190107-00	SVC00218	01/11/2019	1H0368	IC-TRUCK FLE 186_INT	R	Suspensior	1VT951	355172 HR	Suspension repairs	SUSPENSION REPAIRS. REPLACED WORN SPRING BUFFER BLOCKS. RE-FITTED RHS REAR MUD FLAP. REMOVED DAMAGED 3RD AXLE GUARD AND ROTATED TO ALLOW NEW MUD FLAP TO FIT TO GUARD.	218.1	58.03	0	10.5	286.63
181203-00	SVC00216	01/10/2019	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	352934 KM	EXHAUST VIBRATION	EXHAUST VIBRATION. REMOVED LARGE ROCK CAUGHT IN THE EXHAUST SYSTEM AND REPLACED HEAD LIGHT PLUG.ORDERED SPARES.	45.05	72	0	0	117.05

190104-00	SVC00218	01/09/2019	1H0368	IC-TRUCK FLE 184_INT	R	Electrical	1VT951	355172 KM	REPAIR CRUISE CONTROL FAULT	CHECK REVS WON'T PICK UP ON BOWL CONTROLS, CHECK AND FOUND REVS NOT WORKING OF CRUISE CONTROL EITHER. CONNECT COMPUTER AND CHECK FAULT CODES, FOUND CODE ACTIVE BUT NO INFORMATION AVAILABLE ON HOW TO RECTIFY. DISCONNECT BATTERIES AND FOUND FAULT TO RECTIFY ITSELF, OPERATE UNIT AND TESTED OK	367.65	0	0	0	367.65
181119-00	SVC00216	11/28/2018	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	352021 KM	REPLACE RHS HEAD LIGHT	REPLACE RHS HEAD LIGHT. FITTED NEW HEAD LIGHT, ORDERED NEW ONE FOR SPARE.	72.7	708	0	0	780.7
181123-00	SVC00216	11/28/2018	1H0368	IC-TRUCK FLE 186_INT	R	Air Con	1VT951	352021km	Replace a/c compressor	Checked a/c, Compressor clutch faulty and close to collapsing. Supplied new compressor and reciever drier. Parts fitted by J Jackman, Fitted gauges, vacuummed system down, charged with 1000gm of r134a. Leak tested ok.	72.7	345.95	0	50	468.65
181123-00	SVC00216	11/28/2018	1H0368	IC-TRUCK FLE 186_INT	R	Brake	1VT951	352021 KM	replace brake relay valve	REPLACE BRAKE RELAY VALVE - TRACED AIR LEAK TO RELAY ALVE. REMOVED AND REPLACED VALVE. REPLACED MUD FLAP AND TOPPED UP THE COOLANT. ASSISTED WITH FITTING NEW A/C COMPRESSOR.	372.05	244	0	18	634.05
181128-00	SVC00216	11/28/2018	1H0368	IC-TRUCK FLE 121_INT	R	Tyres	1VT951	352026	CALLOUT PUNCTURE REPAIR	CALLOUT PUNCTURE REPAIR CARRIED OUT BY RUBAND	0	0	130	0	130
181113-00	SVC00215	11/20/2018	1H0368	IC-TRUCK FLE 186_INT	R	Steering	1VT951	350491 KM	STEERING ISSUES	STEERING ISSUES. CHECKED STEERING ON VEHICLE. NO ISSUES FOUND AT THE TIME OF INSPECTION OTHER THAN SMALL CRACK STARTING IN RHS FRONT CROSS MEMBER.	90.88	0	0	0	90.88
181010-00	SVC00214	11/16/2018	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	347766km	CHECK CRUISE FAULT	Checked cruise not working, Connected diagnostic equipment, Active fault code, when code is acitve cruise control is disabled. Checked VSS sensors on gearbox, gearbox wiring and connectors, harness to cab, all OK. Checked live data feed from clutch switch, accelerator switch and cruise switches, all working ok. Active fault gone. The truck will need to be looked at by Cummins to disable the fault code which disables cruise control.	290.8	0	0	15	305.8
181105-01	SVC00215	11/09/2018	1H0368	IC-TRUCK FLE 186_INT	R	Brake	1VT951	349523 KM	Brake repairs	REPLACED STEER AXLE BRAKES AND RESECURED MUD FLAP.	285.68	532.72	0	14	832.4
181020-00	SVC00214	11/08/2018	1H0368	IC-TRUCK FLE 186_INT	R	Clutch	1VT951	346915 KM	CLUTCH ADJUSTMENT	Check and adjust the clutch as required	36.35	0	0	0	36.35
181031-00	SVC00214	11/07/2018	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	349304 KM	S1 B SERVICE	S1 B SERVICE. COMPLETED SERVICE AS PER SERVICE SHEET. NOTE.REAR BUMPER BENT. ROCKER BOX BUSHES WORN.	327.15	255.92	0	18	601.07
181018-00	SVC00213	10/26/2018	1H0368	IC-TRUCK FLE 186_INT	R	Bodywork	1VT951		REPLACE DAMAGED GUARDS	REPLACED DAMAGED GUARDS,POLES,BRACKETS AND RAIN TRAP.	450.28	270.8	0	20	741.08

180927-00	SVC00213	10/19/2018	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	346915 KM	FUEL CONTAMINATION	FUEL CONTAMINATION. TRAVEL TO CAMBRIDGE AND CHECKED ENGINE NOT STARTING FAULT. TRACED TO PAPER TOWEL IN THE FUEL TANK. CLEANED AS MUCH AS POSSABLE OUT OF THE TANK AND BLED THE SYSTEM. VEHICLE RETURNED TO THE WORKSHOP. REMOVED THE FUEL TANK AND FLUSHED THE FUEL LINES. CLEANED OUT THE TANK AND REFITTED. FOUND FAULT WITH ELECTRIC FUEL PUMP. REPAIRED WIRING WITH THE FUEL PUMP AND REPLACED FILTER. CHECKED OPERATION.OK.	926.93	60.82	0	95	1082.75
180907-00	SVC00212	09/20/2018	1H0368	IC-TRUCK FLE 186_INT	R	Drive Line	1VT951	345156 km	REPLACE CENTRE BEARING		254.45	179.52	0	12	445.97
180907-00	SVC00212	09/20/2018	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	345156 km	S1 A SERVICE		148.98	201.32	0	10	360.3
180912-00	SVC00211	09/20/2018	1H0368	IC-TRUCK FLE 186_INT	R	Sundries	1VT951	345550km	Repairs as per Fault Book	Checked air con - working OK. Secured drivers side door trim back on. Checked for dash light fault and found no faults. Tightened sun visor screws. Checked fuel gauge and is accurate to what is in tank. Checked temp gauge, ran truck up to 90 degrees, compared gauge with temp gun, gauge working accurately.	254.45	27.46	0	10	291.91
180827-00	SVC00210	09/05/2018	1H0368	IC-TRUCK FLE 186_INT	R	Brake	1VT951	344268 KM	Brake adjustment	ADJUSTED THE BRAKES AND REPLACED TURBO O RING (PARTS EX STOCK)	72.7	0	0	0	72.7
180731-00	SVC00209	08/15/2018	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	342070 KM	Exhaust Manifold Leak	NOTE BRAKES WILL REQUIRE RELINE SOON. EXHAUST MANIFOLD LEAK CUT OFF DAMAGED BONNET HOLD DOWN CLAMPS AND FITTED NEW ONES ORDERED WITH THE SEAT COVER. REMOVED EXHAUST MANIFOLD AND TURBO. CHECKED MANIFLD FOR STRAIGHTNESS. FITTED NEW GASKETS AND REASSEMBLED. PARTS ORDERED PREVIOUS SERVICE CALL.	383.1	81.88	0	18	482.98
180731-00	SVC00209	08/07/2018	1H0368	IC-TRUCK FLE 186_INT	R	Suspension	1VT951	342070 KM	REPLACE LEVEING VALVE	REPLACE LEVEING VALVE. REPLACED FAULTY REAR SUSPENSION RIDE HEIGHT VALVE.	290.8	166.45	0	15	472.25
180628-00	SVC00207	07/26/2018	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	340433 km	REPAIR COOLANT LEAK	REPAIR COOLANT LEAK. TRAVELED TO SITE AND TEMP REPAIRED DAMAGED COOLANT FILTER TAP. ORDERED PARTS TO REPAIR. REMOVED HOUSING AND REPLACED DAMAGED PLASTIC TAP IN THE COOLANT FILTER HOUSING.REFITTED AND TOPPED UP THE COOLANT. ORDERED EXHAUST MANIFOLD GASKETS TO BE FITTED.	346.35	501.19	0	42	889.54
180711-00	SVC00208	07/26/2018	1H0368	IC-TRUCK FLE 186_INT	R	Sundries	1VT951	240433	REPLACE DRIVERS SIDE SEAT COVER	REPLACE DRIVERS SIDE SEAT COVER. ORDERED PARTS FOR EHICLE TO BE FITTED.	36.35	406.27	0	0	442.62

180717-00	SVC00208	07/23/2018	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	340891km	CHECK CRUISE CONTROL	Checked no cruise control, Not working when came in to workshop, Fitted diagnostic equipment, Various non active fault codes, cleared fault codes. Ran truck and checked current data from ECM, cruise working perfectly on truck and agitator. Keep running truck and trying to get to fault, shook wiring harness, no obvious harness issues. Intermittent problem could be from the on-going ECM fault with truck.	181.75	0	0	9	190.75
180717-00	SVC00208	07/19/2018	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	340868	Replace batteries	REMOVED AND REPLACED THE BATTERIES AS REQUIRED	36.35	239.4	0	0	275.75
180702-00	SVC00207	07/17/2018	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	340433	S1 B SERVICE	Carried out the required service and safety inspections as per service sheet Replaced the air and fuel filters Replaced the fire extinguisher and bracket	288.13	297.33	0	15	600.46
180507-00	SVC00204	06/22/2018	1H0368	IC-TRUCK FLE 182_INT	A	Sundries	1VT951		REPAIR DAMAGED STEP	Repair bent rear step.	71.35	0	0	30	101.35
180618-00	SVC00206	06/21/2018	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	338218 km	Replace wiper switch	Diagnosed and organised new wiper switch for truck. Disassembled the steering column and fitted new wiper switch assembly.	181.75	426.18	0	9	616.93
180522-00	SVC00205	05/25/2018	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	19133hrs 3	Check bowl operation	Check agitator controls stopped working. Checked rear pendant and inside controls, nothing working. Checked circuit breakers, found one to be popped. Re-set and controls came back, circuit breaker intermittently popping. Circuit breaker for cigarette lighters socket as well, check cig lighter, Found drivers 12v accessory plugged in to socket had a short circuit causing the whole circuit to drop out. Replaced cig lighter as precaution. All controls OK.	249.73	51.26	0	12	312.99
180510-00	SVC00204	05/16/2018	1H0368	IC-TRUCK FLE 182_INT	R	Milling	1VT951		MACHINE MANIFOLD	MACHINE MANIFOLD	178.38	0	0	9	187.38
180427-00	SVC00204	05/14/2018	1H0368	IC-TRUCK FLE 186_INT	R	Bodywork	1VT951	334404 KM	REPLACE TOP STEP DRIVERS SIDE	DRIVERS SIDE TOP STEP NEEDED REPAIRING. DISASSEMBLED AND DELIVERED TO THE WELDING SHOP FOR REPAIRS. REFITTED WHEN WELDING REPAIRS WERE COMPLETED.	107.03	0	0	0	107.03
180503-00	SVC00204	05/14/2018	1H0368	IC-TRUCK FLE 185MICKS	S	Service	1VT951	334404 KM	S1 A SERVICE	COMPLETED S1 A SERVICE AS PER SERVICE SHEET. ADJUSTED THE CLUTCH AND CLUTCH BRAKE. HAD TO CHANGE OVER ENGINE OIL DRUM DURING THE SERVICE.	285.4	176.49	0	19	480.89
180503-00	SVC00204	05/07/2018	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	334404km	CHECK GPS OPERATION	Collected truck from batch plant Checked GPS unit offline, Removed roof panel, locate unit. Unit lighting up indicating ok, Checked aeriels, GSM outside aerial broken off. Fitted new aerial (in stock spare item) Tested operation and confirmed by batch plant to be online and trackable. Put interior back together. Returned to batch plant.	107.03	0	0	10	117.03

180503-00	SVC00204	05/07/2018	1H0368	IC-TRUCK FLE 186_INT	R	Air Con	1VT951	334404km	CHECK A/C SYSTEM	Checked a/c system, fitted pressure gauges, getting cold but pressures slightly low. Removed remaining gas, 500gm. Supplied and fitted new reciever drier, changed o-rings. Vacuumed system down, pressure check - OK Ran truck and gassed with 1000gm of R134a gas. Leak checked - OK.	107.03	41	0	50	198.03
180323-00	SVC00202	04/06/2018	1H0368	IC-TRUCK FLE 186_INT	R	Brake	1VT951	330252 KM	REPLACE BRAKE BOOSTER 4TH LHS	REPLACED LEAKING BRAKE BOOSTER LHS 4 TH AXLE AND BROKEN PARK BRAKE SPRING BOOSTER RHS 4TH AXLE.ADJUSTED BRAKES.	258.73	98.38	0	10	367.11
180227-00	SVC00201	03/15/2018	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	328257 KM	S1 B SERVICE	COMPLETED SERVICE AS PER SERVICE SHEET. REMOVED BROKEN TIE BAR BETWEEN THE FRONT SPRING HANGERS. SENT TO WELDING SHOP FOR REPAIRS AND REFITTED.	299.63	233.79	0	20	553.42
180112-00	SVC00199	03/05/2018	1H0368	IC-TRUCK FLE 186_INT	R	Suspension	1VT951	328257 KM	REPLACE STEER AXLE SHOCK ABSOR	REPLACE STEER AXLE SHOCK ABSORBERS.	145.81	341.35	0	7.5	494.66
180213-00	SVC00200	02/20/2018	1H0368	IC-TRUCK FLE 181_INT	R	Bodywork	1VT951	326,675KM	SUPPLY COMPOUND AND BUFFING PA	PARTS ONLY -- SUPPLY COMPOUND AND BUFFING PAD SO AS DRIVER CAN TIDY UP PAINTWORK ON CAB	0	68.6	0	0	68.6
180213-00	SVC00200	02/19/2018	1H0368	IC-TRUCK FLE 186_INT	R	Bodywork	1VT951	326675 KM	AERIAL LEAK	REMOVED OVERHEAD CONSUL AND REMOVED BROKEN AERIAL AND REPLACED WITH NEW UNIT.	142.7	72.73	0	0	215.43
180111-00	SVC00198	01/17/2018	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	323367 KM	Cruise control	CRUISE CONTROL. CHECKED CRUISE CONTROL FAULT, CHECKED CODES FOUND 0242 VEHICLE SPEED SENSOR TAMPERING. SWAPPED OVER VSS CONNECTIONS AT THE SPEEDO PICK UP. RETESTED AND FOUND FAULT INTERMITTENT. CHECKED CLUTCH AND BRAKE SWITCHES AND OPERATION.OK SECURED LOOSE WIRING NEAR THE CLUTCH SWITCH. LUBRICATED CONNECTIONS AT THE GEAR BOX. RETESTED OK.	321.08	0	0	15	336.08
171215-00	SVC00197	01/16/2018	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	323369 KM	S1 A SERVICE	S1 A SERVICE. COMPLETED SERVICE AS PER SERVICE SHEET. REPLACED WIPER BLADES,CHECKED OIL LEAK AT THE ENGINE, FOUND OIL PRESSURE SWITCH LEAKING.CLEANED OFF AND TIGHTENED. CHECKED LEAKING REAR SHOCK ABSORBERS.NONE IN STOCK,WILL FIT WHEN THEY ARE AVAILABLE. CHECKED OIL LEAK AT POWER STEERING BOX, CLEANED OFF FOUND WEEPING AT HOSE NEEDS REPLACING. DRIVERS SEAT BASE NEEDS REPAIRING.	321.08	382.62	0	20	723.7
180115-00	SVC00198	01/16/2018	1H0368	IC-TRUCK FLE 186_INT	R	Bodywork	1VT951	323620 km	REPLACE BROKEN STEP BOLTS	Chizeled off broken bolts and nuts.cleaned out holes and replaced broken bolts in the top step drivers side.	53.51	0	0	0	53.51
171205-00	SVC00197	12/19/2017	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	320850km	CHECK CRUISE CONTROL FAULT	Checked cruise control intermittently dropping out. Connected diagnostic equipment. Checked switches activating to ecm - OK Found one of the cruise switches to be faulty. Supplied and fitted replacement. Replaced globe in switch. Ran truck and test - OK	178.38	95.57	0	8	281.95

171205-00	SVC001976	12/19/2017	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	320850km	CHECK ODOMETER FAULT	Checked odometer dropping out intermittently. Removed panel, check inputs - OK Problem in gauge. Supplied new gauge and organise to have programmed to original total kilometres. Fitted and test - OK	142.71	520.54	0	9	672.25
171113-01	SVC001957	11/28/2017	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	319394	S1 C SERVICE	CARRIED OUT THE REQUIRED SERVICE AND SAFETY INSPECTIONS AS PER SERVICE SHEET	462.68	472.62	0	20	955.3
171103-00	SVC001956	11/10/2017	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	318155km	Replace tail light	Check light fault, Problem in tail light, break off concrete, bolts seized, cold chisel off. Fit replacement. fit deutsch plug test - OK	125.95	296.9	0	6	428.85
171019-00	SVC001945	10/24/2017	1H0368	IC-TRUCK FLE 186_INT	R	Brake	1VT951	17998 HRS	BRAKE ADJUSTMENT/GREASE	CHECK OVER UNIT AND GREASE ADJUST THE BRAKES AS REQUIRED	71.35	0	0	5	76.35
171019-00	SVC001945	10/24/2017	1H0368	IC-TRUCK FLE 186_INT	R	Suspension	1VT951	17993 HRS	SUSPENSION AIR LEAK	REPLACED LEAKING SECTION OF AIR LINE.	71.35	7.36	0	0	78.71
170818-00	SVC001915	10/10/2017	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	17706hrs 3	Check Fault Codes	check low coolant level sensor fault codes, check coolant level - OK Compare live data - OK remove sensor plug, check - OK Pull out harness strip and inspect - OK Pin back to ECM plug - OK ECM bridging out 2 wires when plugged in, Fit spare ECM, fault gone. Truck will still shut down if coolant reaches critical level using original ECM, but brings on 'check engine' light reguarly. Recommend running truck with the spare ecm to test or fit new ECM.	446.1	0	0	20	466.1
170922-00	SVC001935	09/28/2017	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	315176 KM	ENGINE OIL LEAK	ENGINE OIL LEAK. CLEANED THE ENGINE AND FOUND LEAK FROM CRACKED ADAPTER THAT GOES FROM THE GAUGE MANIFOLD TO THE BLOCK OIL GALLERY. BUZZ HAD STEEL FITTING IN HIS TOOL BOX ORDERED AS A SPARE WHEN ANOTHER TRUCK CRACKED THE SAME BRASS FITTING.(WHAT A WINNER.) REASSEMBLED AND CHECKED. FOUND SECOND OIL LEAK AT THE DIP STICK TUBE. REMOVED AND FOUND PART OF THE TUBE BROKEN OFF INSIDE THE BLOCK. SEALED UP END OF THE TUBE AND REFITTED. SECURED WITH P CLAMPS TO STOP FROM MOVING .	356.76	3.46	0	0	360.22
170927-00	SVC001935	09/28/2017	1H0368	IC-TRUCK FLE 121_INT	R	Tyres	1VT951	315515	11R22.5 MICH XZY3 X 3 + BALANC	11R22.5 MICH XZY3 X 3 + BALANCE POWDER X 3 + DISPOSAL X 2 CARRIED OUT BY RUBAND DD 39149	0	1848	0	0	1848
170906-00	SVC001935	09/27/2017	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	17706hrs 3	CHECK FUEL & TEMP GAUGES	CHECK FUEL & TEMP GAUGES Checked fuel gauge only reading top 3/4 of tank. Checked connections on top of tank, OK Earthed out send wire, checked gauge and circuit - OK Removed fuel sender unit, Tested operation, fault in sender, supplied and fitted replacement. Checked temp gauge fault, Located temp sender, tested send wire for gauge and temp alarm, OK. Supplied and fitted replacement gauge.	535.13	97	0	26	658.13

170919-00	SVC00193	09/22/2017	1H0368	IC-TRUCK FLE 186_INT	R	Bodywork	1VT951	314885 KM	SECURE MIRRORS	UNSIZEZ MIRROR MOUNTING BOLTS,READJUSTED MIRRORS AND SECURED.	21.85	0	0	0	21.85
170906-00	SVC00192	09/20/2017	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	314464 KM	S1 B SERVICE	S1 B SERVICE. COMPLETED THE REQUIRED SERVICE AND SAFETY INSPECTIONS AS PER SERVICE SHEET. DROVE TO HBMI TO PICK UP THE AGITATOR FOR A SERVICE.	432.45	294.35	0	25	751.8
170818-00	SVC00191	08/28/2017	1H0368	IC-TRUCK FLE 186_INT	R	Suspensior	1VT951	17706 hrs	Replace torque rod bushes	REPLACE TORQUE ROD BUSHES. REMOVED TORQUE RODS,CUT OFF SIEZED BOLTS AND REMOVED BUSHES PRESSED IN NEW BUSHES. REFITTED RODS AND TENSIONED MOUNTING BOLTS.	218.4	350.52	0	10	578.92
170817-00	SVC00191	08/22/2017	1H0368	IC-TRUCK FLE 186_INT	R	Brake	1VT951	17706 HRS	Brake adjustment	CARRIED OUT BRAKE ADJUSTMENT AS REQUIRED.	30.05	0	0	0	30.05
170818-00	SVC00191	08/22/2017	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	17706 HRS	REPLACE FRONT ENGINE MOUNT	REPLACED WORN ENGINE MOUNT.PARTS EX STOCK.	136.5	0	0	7	143.5
170818-00	SVC00191	08/21/2017	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	17706hrs 3	LIGHT FAULTS	Repaired front park lights and mirror lights. Fitted new number plate light. Located broken wire at rear RHS tail light, Repaired wiring. Checked all lights OK.	242.6	22.25	0	12	276.85
170725-00	SVC00189	08/04/2017	1H0368	IC-TRUCK FLE 186_INT	R	Suspensior	1VT951	1759H 311	Replace torque rod bushes	REPLACE TORQUE ROD BUSHES. USED NEEDLE GUN TO REMOVE BUILT UP CONCRETE. USED OXY TO REMOVE SIEZED BOLTS. FITTED NEW BUSHES AND REFITTED TO THE VEHICLE.	188.63	350.52	0	9	548.15
170724-00	SVC00189	07/28/2017	1H0368	IC-TRUCK FLE 186_INT	R	Differential	1VT951	17579 hour	REPLACE AXLE LHS 4TH	REPLACE AXLE LHS 4TH. TRAVELED TO GORDON STREET.REMOVED BROKEN AXLE. TRAVELED TO THE WORKSHOP.REMOVED DIFF CENTRE AND CLEANED OUT THE HOUSING. CHECKED AXLE LOCK OPERATION.OK. REASSEMBLED WITH NEW AXLE. TOPPED UP THE DIFF OIL AND ADJUSTED THE BRAKES.	1423.42	551.73	0	75	2050.15
170720-00	SVC00189	07/26/2017	1H0368	IC-TRUCK FLE 121_INT	R	Tyres	1VT951	310560	W/POWER 11R22.5 WDR26 X 4	W/POWER 11R22.5 WDR26 X 4 + DISPOSAL X 4 RUBAND DD38373	0	2996	0	0	2996
170712-00	SVC00189	07/19/2017	1H0368	IC-TRUCK FLE 186_INT	R	Bodywork	1VT951	17510HOU	REPLACE GAURDS	CUT OFF SIEZED GUARD BOLTS, REMOVED BUILD UP OF CONCRETE FROM GUARD POLES, REMOVED THE BENT GUARD POLES AND BOLTS, DRILL OUT GUARDS AND REPLACED WITH NEW POLES AND GUARDS, ADJUST TO SUIT REPLACED 4 MUDFLAPS AS REQUIRED	334.88	529.4	0	0	864.28
170714-00	SVC00189	07/19/2017	1H0368	IC-TRUCK FLE 186_INT	PW	Bodywork	1VT951	17525HOU	POLICY GAURD REPAIRS	REMOVED AND REPLACED DAMAGED GUARD	53.55	53.32	0	0	106.87
170714-00	SVC00189	07/19/2017	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	17525 HOL	WORK LIGHT REPAIRS	REMOVED AND REPLACED FAULTY WORK LAMPS AS REQUIRED	139.9	30.5	0	0	170.4
170703-01	SVC00189	07/13/2017	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	17474 hrs	S1 A SERVICE	S1 A SERVICE. COMPLETED SERVICE AS PER SERVICE SHEET. ADJUSTED THE CLUTCH AND CLEANED UP NUMBER PLATE LIGHTS. NOTE ONE LIGHT NEEDS REPLACING.	174.88	173.99	0	9	357.87
170704-00	SVC00188	07/11/2017	1H0368	IC-TRUCK FLE 186_INT	R	Suspensior	1VT951	SE1 NOT TA	Ride height adjustment	RIDE HEIGHT ADJUSTMENT. REPLACED SIEZED REAR RIDE HEIGHT VALVE LINK ROD, ROSE JOINT ENDS AND ADJUSTED THE REAR SUSPENSION RIDE HEIGHT. REPLACED WORN BONNET ALIGNING MEMBER.	174.88	175.83	0	8	358.71
170621-00	SVC00188	06/27/2017	1H0368	IC-TRUCK FLE 186_INT	R	Brake	1VT951	308810 KM	Brake adjustment	ADJUSTED THE BRAKES, REPLACED REAR CLEARANCE PLATES, SECURES LOOSE DOOR TRIM AND TIGHTENED LOOSE DRIVE SHAFT BOLTS.	107.1	40	0	0	147.1

170529-00	SVC00186	05/29/2017	1H0368	IC-TRUCK FLE 121_INT	R	Tyres	1VT951	NOT TAKEN	CALLOUT FIT COP + DISPOSAL	CALLOUT TO FIT COP + DISPOSAL CARRIED OUT BY RUBAND	0	0	249	0	249
170511-00	SVC00186	05/15/2017	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	305084 17	S1 B SERVICE	S1 B SERVICE. Completed service as per service sheet.	231.28	278.09	0	0	509.37
161018-00	SVC00176	04/28/2017	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	292532km	check engine light	Checked engine light trouble shooted the system and repaired as required Fit laptop. low coolant fault codes. check top tank, full of coolant. remove low coolant level sensor plug - OK Remove ecm plugs, pin back to ecm - wiring OK inspect harness for damage - OK Drain coolant fit new low coolant level sensor. re-fill coolant. code inactive, clear codes.	734.48	72.75	0	0	807.23
170420-00	SVC00185	04/26/2017	1H0368	IC-TRUCK FLE 186_INT	R	Brake	1VT951	303434km	CHECK OUT FRONT BRAKES	Check unit for reported brake fault, adjusted the brakes and checked for movement in bushes all good	69.95	0	0	0	69.95
170322-00	SVC00184	03/30/2017	1H0368	IC-TRUCK FLE 186_INT	R	Suspension	1VT951	301393 KM	REPLACE BROKEN FRONT SPRING	REPLACE BROKEN FRONT SPRING. REPLACED BROKEN SPRING LHS SECOND STEER AXLE. NOTE. VEHICLE WILL REQUIRE SPRING AND WHEEL RETENSION.	748.07	2341.92	0	30	3119.99
170323-00	SVC00184	03/30/2017	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	301393 KM	CHECK BELL HOUSING BOLTS	REPLACED MISSING BOLTS AND CHECKED THE TENSION ON THE REMAINING BOLTS	115.31	0	0	6	121.31
170322-00	SVC00183	03/24/2017	1H0368	IC-TRUCK FLE 186_INT	A	Bodywork	1VT951	16965 HRS	REPLACE DAMAGED GAURD	REPLACED DAMAGED GAURD WITH SECOND HAND GAURD AND BRACKETS. FITTED NEW POLES.	142.08	50	0	7	199.08
170303-00	SVC00183	03/23/2017	1H0368	IC-TRUCK FLE 186_INT	R	Bodywork	1VT951	16882hrs 2	REPLACE MIRRORS	fit supplied replacement mirrors, wire heated mirror and park lights into cab.	104.93	548	0	0	652.93
170302-00	SVC00183	03/14/2017	1H0368	IC-TRUCK FLE 186_INT	R	Brake	1VT951	299520 KM	RELIN SECOND AXLE	REPLACED SECOND AXLE BRAKES AND DRUMS.	273.78	513.66	0	11	798.44
170302-00	SVC00183	03/10/2017	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	299520 KM	S1 A SERVICE	S1 A SERVICE. Completed service as per service sheet.	177.05	231.09	0	15	423.14
170308-00	SVC00182	03/10/2017	1H0368	IC-TRUCK FLE 186_INT	R	Brake	1VT951	16882 HRS	Replace brake booster	REPLACE BRAKE BOOSTER. TRAVELED TO SELFS POINT, CAGE UP BRAKE BOOSTER AND BLOCK OF AIR SUPPLY. WHEN VEHICLE RETURNED TO WORKSHOP REPLACED LHS 4TH AXLE BRAKE BOOSTER AND HOSE AFTER CLEANING OFF BUILD UP OF CEMENT.	214.2	63.83	0	10	288.03
170224-00	SVC00182	02/27/2017	1H0368	IC-TRUCK FLE 186_INT	R	Brake	1VT951	16817 HRS	Brake adjustment	BRAKE ADJUSTMENT. CHECKED AND ADJUSTED THE BRAKES. NOTE. SECOND STEER AXLE NEEDS BRAKES REPLACING.	52.46	0	0	0	52.46
170208-00	SVC00181	02/20/2017	1H0368	IC-TRUCK FLE 186_INT	R	Bodywork	1VT951	292532 km	REPAIR AIR DUCTING FOR CAB	REPAIR AIR DUCTING FOR CAB. CHECKED EXHAUST SYSTEM, NO LEAKS FOUND AT TIME OF INSPECTION. FOUND THE AIR INTAKE SYSTEM FOR THE CAB LOOSE ON THE FIRE WALL. REMOVED REPAIRED, DRILLED NEW MOUNTING HOLES AND CUT NEW SEAL TO SECURE TO THE FIRE WALL.	174.88	0	0	8.5	183.38
161219-00	SVC00179	12/21/2016	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	16713 HRS	ELECTRICAL REPAIRS	REPLACED BLOWN GLOBES AND REPAIRED COOLANT SENSOR.	177.93	0	0	9	186.93
161213-00	SVC00175	12/20/2016	1H0368	IC-TRUCK FLE 186_INT	R	Brake	1VT951		BRAKE INSPECTION AND ADJUSTMENT	INSPECT BRAKES AND ADJUST AS REQUIRED	26.78	0	0	0	26.78

161108-00	SVC00177	12/19/2016	1H0368	IC-TRUCK FLE 186_INT	R	Differential	1VT951	296685 KM	REPLACE REAR DIFF PINION SEAL	REPLACE REAR DIFF PINION SEAL. USED OXY TO CUT OUT SIEZED UNIVERSAL JOINT. PRESSED OUT SIEZED CAPS.PRESSED OFF SIEZED YOKE AFTER HEATING YOKE. FITTED NEW SEAL AND NUT. REFITTED THE SHAFT WITH NEW UNIVERSAL.	594.58	113.74	0	25	733.32
161215-00	SVC00179	12/19/2016	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	296685km	CHECK AGITATOR CONTROLS	Check faults in agitator controls in cab and rear, locate fault in rear plug connection, fit new plug, agitator remote faulty, swap out for repaired remote, run truck and test ok.	279.8	7.4	0	14	301.2
161108-00	SVC00177	11/11/2016	1H0368	IC-TRUCK FLE 186_INT	R	Brake	1VT951	16494 HRS	REPLACE RHS 4TH BRAKE BOOSTER	REPLACED BRAKE BOOSTER 4 TH AXLE RHS.	209.85	41.43	0	10	261.28
161026-00	SVC00176	11/10/2016	1H0368	IC-TRUCK FLE 186_INT	R	Suspensior	1VT951	16489 HRS	Replace air bag	REPLACED LEAKING AIR BAG RHS.	209.86	414.08	0	10	633.94
161108-00	SVC00177	11/10/2016	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	16494 HRS	S1 B SERVICE	CARRIED OUT THE REQUIRED SERVICE AND SAFETY INSPECTIONS AS PER SERVICE SCHEDULE	244.83	242.63	0	17	504.46
161108-00	SVC00177	11/10/2016	1H0368	IC-TRUCK FLE 186_INT	R	Steering	1VT951	16494 HRS	REPLACE STEERING UNIVERSAL	REMOVED STEERING SHAFT AND REPLACED UNIVERSAL.	69.95	15.49	0	0	85.44
161012-00	SVC00176	10/31/2016	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	164451 hrs	REPLACE EXHAUIST BRAKE	REPLACE EXHAUIST BRAKE. REPLACED EXHAUST BRAKE AND CLAMPS. ADJUSTED THE SERVICE BRAKES.. CHECKED FOR VIBRATION,CHECKED DRIVE LINE ,REPLACED SHOCK ABSORBER RUBBERS AND ADJUSTED REAR AXLES RIDE HEIGHT.	489.66	2270.49	0	25	2785.15
161018-00	SVC00176	10/24/2016	1H0368	IC-TRUCK FLE 186_INT	R	Brake	1VT951	292872 KM	REPAIR BRAKE AIR LEAK	REPAIR BRAKE AIR LEAK. CHECKED FOR AIR LEAK AND FOUND LEAKING SERVICE BRAKE RELAY VALVE FOR THE STEER AXLE. ORDERED NEW VALVE AND FITTED.CHECKED OK.	139.91	159.09	0	6.5	305.5
161019-00	SVC00176	10/24/2016	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	292872 KM	Headlight repairs	REPLACED GLOBE AND CLEANED UP CONTACTS.	34.98	16.57	0	0	51.55
161011-00	SVC00175	10/17/2016	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	16392 KMS	COOLANT LEAK	COOLANT LEAK. REPLACED LEAKING HEATER TAP TO ENGINE HOSE.	104.93	56.18	0	5	166.11
160915-00	SVC00175	10/13/2016	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	291729KM	check engine light	CEHCK ENGINE LIGHT- LOW COOLANT SENSOR, COOLANT OK, INSPECT WIRING HARNESS AND LOCATED FAULT ON PASSENGERS SIDE HANRESS, REMOVE AIR AND HYDRAULICS LINES, STRIP DOWN HARNESS AND LOCATED 7 EXPOSED AND BROKEN WIRES, REPAIR FAULTS AND REASSEMBLE, CONNECT LAPTOP, NO FAULTS PRESENTS	244.83	0	0	12	256.83
160901-00	SVC00175	10/06/2016	1H0368	IC-TRUCK FLE 186_INT	R	Bodywork	1VT951		SUPPLY WHEEL NUT COVERS	SUPPLY WHEEL NUT COVERS. SUPPLIED PARTS TO DRIVER AS REQUESTED BY TODD.	0	264.14	0	0	264.14
160928-00	SVC00175	10/05/2016	1H0368	IC-TRUCK FLE 186_INT		Electrical	1VT951	291729KM	ENGINE BRAKE, CHECK ENG LIGHT	CHECK ENGINE BRAKE, CHECK VOLTAGE OF SOLENOID 13.8V, TEST RUN UNIT AND FOUND BRAKE STICKING ON AS ENGINE GETS UP TO TEMP REFER TO MECHNICS CONNECT DIAGNOSTIC TOOL AND FOUND LOW COOLANT FAULT, CHECK HARNESS, LOCATED AND REPAIRED BROKEN WIRE, FIT NEW COOLANT LEVEL SENSOR AND TOP UP COOLANT, CLEAR ALL CODES ALL GOOD.	419.71	43.37	0	20	483.08
160929-00	SVC00175	10/05/2016	1H0368	IC-TRUCK FLE 121_INT	R	Tyres	1VT951	291754	11R22.5 X2Y3 MICHELIN X 1 +	11R22.5 X2Y3 MICHELIN X 1 + DISPOSAL + STRIP & FIT COP X 0		728.2	22	0	750.2
160929-00	SVC00175	09/30/2016	1H0368	IC-TRUCK FLE 186_INT	R	Brake	1VT951	291745KM	ADJUST BRAKES	1 + BALANCE POWDER X 2 RUBAND DD 29921 CHECK AND ADJUST THE BRAKES AS REQUIRED	104.93	0	0	0	104.93

160823-00	SVC00173	08/30/2016	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	16189 HRS	S1 A SERVICE	S1 A SERVICE. COMPLETED SERVICE AS PER SERVICE SHEET. FOLLOW UP JOBS. GLOVE BOX LOOSE,SCUTTLE BROKEN AND LOOSE,INTERCOOLER HOSE CLAMP MISSING,ENG OIL LEAKS,REAR DIFF OIL LEAK AND SECOND AXLE BRAKE LININGS GETTING LOW.	102.38	193.41	0	10	305.79
160825-00	SVC00173	08/30/2016	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	289478 KM	Light repairs	LIGHT REPAIRS. REPAIRED REVOLVING LIGHT, LEFT MIRROR CLEARANCE LIGHT, TIGHTENED LOOSE CHASSIS CROSS BAR AND REPLACED WORN LOWER SHOCK ABSORBER BUSHES.	136.5	0	0	10	146.5
160804-00	SVC00172	08/15/2016	1H0368	IC-TRUCK FLE 186_INT	R	Radiator	1VT951		COOLING SYSTEM REPAIR	CHECK FAULT CODES, LOCATE LEAK OUT OF COOLANT LEVEL SENSOR, FIT SENSOR AND SEAL UP LEAK, TOP UP COOLANT	68.25	43.37	0	0	111.62
160721-00	SVC00171	08/12/2016	1H0368	IC-TRUCK FLE 186_INT	R	Bodywork	1VT951		REPAIR DOOR LOCK OPERATION	REMOVED AND REPLACED BOTH DOOR BARRELS AND NEW PASSENDGER SIDE HANDLE	825.31	428.79	0	40	1294.1
160727-00	SVC00171	07/30/2016	1H0368	IC-TRUCK FLE 186_INT	R	Drive Line	1VT951	16044 hrs	REPLACE CENTRE BEARING	REPLACED CENTRE BEARING AS REQUIRED	204.75	222.8	0	10	437.55
160715-00	SVC00171	07/28/2016	1H0368	IC-TRUCK FLE 186_INT	R	Sundries	1VT951		REPAIR AIR LEAK UNDER CAB	REPAIR AIR LEAK UNDER CAB. REPAIRED AIR LEAK AT THE GEARBOX UNDER THE CAB.	68.25	0	0	0	68.25
160715-00	SVC00171	07/26/2016	1H0368	IC-TRUCK FLE 186_INT	R	Bodywork	1VT951	287400 KM	CLEAN AIR CON DRAIN HOSE OUT	CLEAN AIR CON DRAIN HOSE OUT. CLEANED OUT DRAIN HOLES AND RESEALED AIR BOX WITH SILICON DUE TO DISTORTION AND CRACKS. REPLACED LEAKING HEATER CONTROL. CLEANED OUT EXHASUT BRAKE SOLENOID EXHAUST BREATHER.	204.75	465.65	0	10	680.4
160721-00	SVC00171	07/26/2016	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	287400KM	CENTRAL LOCK, CHECK ECM CODES	CHECK UNIT CENTRAL LOCKING SYSTEM, RE PROGRAM THE REMOTE, REMOVE DOOR TRIM AND ADJUST ACTUATOR TO OPERAT DOOR LOCK, CHECK ECM CODES, COOLANT SENSOR CIRCUIT, REPAIR WIRING NEAR SENSOR, CLEAR CODES AND CHECK OPERATION ALL GOOD	102.38	0	0	5	107.38
160720-00	SVC00171	07/20/2016	1H0368	IC-TRUCK FLE 121_INT	R	Tyres	1VT951	287108	STRIP AND FIT X 4	STRIP AND FIT X 4 CARRIED OUT BY RUBAND	0	0	80	0	80
160708-00	SVC00170	07/12/2016	1H0368	IC-TRUCK FLE 186_INT	R	Brake	1VT951	15976 hr 2	Brake adjustment	Check and adjust brakes as required	34.13	0	0	0	34.13
160615-00	SVC00170	07/04/2016	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	258,081 Kl	CRUISE CONTROL NOT OPERATING	Check operation of cruise control, check and repair plugs on cruise control switches, test and adjust clutch switch, connect laptop and check for fault codes	409.5	0	0	20	429.5
160624-00	SVC00170	06/24/2016	1H0368	IC-TRUCK FLE 121_INT	R	Tyres	1VT951	285647	Puncture repair	PUNCTURE REPAIR CARRIED OUT BY RUBAND	0	0	45	0	45
160609-00	SVC00169	06/16/2016	1H0368	IC-TRUCK FLE 186_INT	R	Brake	1VT951	15845 HRS	Brake repairs	BRAKE REPAIRS. REPLACED LEAKING BRAKE BOOSTER SECOND AXLE RHS.	168	54.55	0	8	230.55
160616-00	SVC00169	06/16/2016	1H0368	IC-TRUCK FLE 121_INT	R	Tyres	1VT951	285048	Puncture repair	PUNCTURE REPAIR CARRIED OUT BY RUBAND	0	0	45	0	45
160608-00	SVC00169	06/15/2016	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	15845 HRS	S1 C SERVICE	CARRIED OUT THE REQUIRED SERVICE AND SAFETY INSPECTIONS AS PER SERVICE SCHEDULE	325.5	393.07	0	16	734.57
160609-00	SVC00169	06/15/2016	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	15845 HRS	Light repairs	LIGHT REPAIRS. REPLACED PLUG ON LHS HEATED MIRROR. REPLACED LHS MIRROR CLEARANCE LIGHT LENS AND GASKET. REPAIRED BROKEN WIRE IN THE DOOR FOR THE CLEARANCE LIGHT.	84	44.61	0	0	128.61
160609-00	SVC00169	06/15/2016	1H0368	IC-TRUCK FLE 186_INT	R	Clutch	1VT951		CLUTCH ADJUSTMENT	CLUTCH ADJUSTMENT	34.13	0	0	0	34.13
160610-00	SVC00169	06/10/2016	1H0368	IC-TRUCK FLE 121_INT	R	Tyres	1VT951	284327	FIT RUNOUT + DISPOSAL	FIT RUNOUT + DISPOSAL CARRIED OUT BY RUBAND	0	0	32	0	32
160504-00	SVC00167	05/13/2016	1H0368	IC-TRUCK FLE 186_INT	R	Bodywork	1VT951		SUPPLY CENTRE HUB COVERS	SUPPLY CENTRE HUB COVERS. DRIVER PICKED PARTS UP FROM CJD.	0	48.96	0	0	48.96

160511-00	SVC00167	05/13/2016	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	15700hrs	CHECK ENGINE FAULT LIGHT ISSUE	CHECK ENGINE FAULT LIGHT ISSUE. CHECKED CODES.LOW COOLANT.TOPPED UP,CHECKED FOR LEAKS AND CLEARED ALL CODES.	85.31	41.1	0	0	126.41
160427-00	SVC00167	05/10/2016	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	281,356 Klt	REPAIR INDICATORS	INSPECT OPERATION OF INDICATORS, FOUND FAULTY FLASHER UNIT, ORDER NEW, REMOVED CENTRE OF DASH AND FIT NEW FLASHER UNIT, REFIT CENTRE OF DASH, TEST ALL OK	102.38	21.5	0	5	128.88
160503-00	SVC00167	05/06/2016	1H0368	IC-TRUCK FLE 121_INT	R	Tyres	1VT951	281706	STRIP AND FIT + BALANCE POWDER	STRIP AND FIT + BALANCE POWDER X 4 CARRIED OUT BY RUBAND	0	0	0	0	0
160503-00	SVC00167	05/06/2016	1H0368	IC-TRUCK FLE 121_INT	R	Tyres	1VT951	281706	STRIP AND FIT + BALANCE POWDER	STRIP AND FIT + BALANCE POWDER X 4 CARRIED OUT BY RUBAND	0	180	0	0	180
160411-00	SVC00166	05/04/2016	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	279507 KM	S1 B SERVICE	S1 B SERVICE. COMPLETED SERVICE AS PER SERVICE SHEET. REPLACED AIR CLEANER. REPLACED BROKEN SCREW IN WINDOW REGULATOR HANDLE.	301.88	280.73	0	15	597.61
160503-00	SVC00167	05/04/2016	1H0368	IC-TRUCK FLE 186_INT	R	Bodywork	1VT951		SUPPLY WHEEL NUT COVERS	SUPPLY WHEEL NUT COVERS. SUPPLIED 40 WHEEL NUT COVERS AS REQUESTED BY TODD.	0	76.16	0	0	76.16
160411-00	SVC00166	04/26/2016	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	279,507 Klt	CHECK AND REPAIR LIGHTS R/HAND	CHECK AND REPAIR CONNECTIONS AT RH HEAD LIGHT INDICATOR ASSY. REPAIRED WIRING FOR WORK LIGHT ON AGITATOR FRAME. TEST OK.	238.88	0	0	12	250.88
160202-00	SVC00163	03/18/2016	1H0368	IC-TRUCK FLE 186_INT	R	Bodywork	1VT951	271548 KM	Guard repairs	REFITTED DAMAGED GAURD AND REPLACED WORN BONNET PARTS.	131.25	179.08	0	6.5	316.83
160302-00	SVC00164	03/03/2016	1H0368	IC-TRUCK FLE 186_INT	R	Brake	1VT951	15305 HRS	CHECK AND ADJUST BRAKES	CHECKED AND ADJUSTED THE BRAKES. FOUND BRAKE BOOSTER LEAKING LHS, 4TH AXLE. REMOVED BUILT UP CONCRETE TO REDUCE VEHICLE TARE WEIGHT AND GAIN ACCESS TO MOUNTING BOLTS. REPLACED BOOSTER AND TOPPED UP THE HYDRAULIC OIL.	180.09	54.55	0	9	243.64
160224-00	SVC00164	02/27/2016	1H0368	IC-TRUCK FLE 184_INT	R	Air Con	1VT951	274985 Klt	REPAIR AIR CON SYSTEM	REPAIRED GAS LEAK IN AIR CON SYSTEM TEST OPERATION FOR LEAKS ALL GOOD.	437.33	54.47	0	90	581.8
160122-00	SVC00162	02/02/2016	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	15112HRS	S1 A SERVICE	COMPLETED THE REQUIRED SERVICE SAFETY INSPECTION AS PER SERVICE SHCHEDULE	102.38	157.89	0	10	270.27
160122-00	SVC00162	02/02/2016	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	15112HRS	change coolant	DRAINED AND FILLED UNIT WITH NEW COOLANT	102.38	164.42	0	0	266.8
151030-00	SVC00159	01/08/2016	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	269,169 Klt	REPAIR REMOTE KEYLESS ENTRY	ORDER AND FIT NEW CENTRAL LOCKING SYSTEM. REMOVE AND REPLACE FAULTY AM/FM RADIO WITH NEW UNIT REMOVED THE BATTERIES AND CHARGED, REPLACED THE CHARGED BATTERIES UNING NEW HOLD DOWN BOLTS. REPLACED THE HEAD LIGHT RELAY FOR LH PARK LIGHTS CONNECT LAPTOP AND DOWNLOAD FAULTS AFTER ENGINE HAD BEEN REPLACED. REPLACED FAULTY COOLANT SENSOR.	1433.27	723.96	0	0	2157.23
151207-00	SVC00161	12/23/2015	1H0368	IC-TRUCK FLE 182_INT	R	Sundries	1VT951		WELDING REPAIRS AND STEP	Repairs to setp and spring eye bushes. Changed out the rear step and weld bushes into the spring eyes.	443.63	0	0	22	465.63
151016-00	SVC00159	12/21/2015	1H0368	IC-TRUCK FLE 186_INT	R	Steering	1VT951	269169 KM	REPLACE STEERING BOX	REPLACE STEERING BOX. REPLACED STEERING BOX,SECTOR SHAFT AND PITMAN ARM SPLINES WORN.	443.64	7296.79	0	20	7760.43

151027-00	SVC00159	12/21/2015	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	269713 KM	Engine rebuild	ENGINE REBUILD CHECKED ENGINE OIL LEAK,STEAM CLEANED AND CHECKED ENGINE POSITION SENSOR FOR LEAK AND OIL PRESSURE SWITCHES.FITTED OIL BOTTLE TO BREATHER,BOTTLE FILLED IN ONE RUN.STRIPPED DOWN ENGINE AND CLEANED.STARTED ENGINE ASSEMBLY AND FOUND REAR LINERS BELOW SPECS.REMOVED BONNET , REMOVED ENGINE,COMPLETELY DISASSEMBLED AND SENT OUT FOR MACHINING.REASSEMBLED THE ENGINE AND FOUND MACHINE SHOP HAD MACHINED THE BLOCK SO THERE WAS .0.001" TO 0.002" LINER PROTRUSION,LHS TO RHS.REMOVED BELL HOUSING DOWLES AND DIALED IN THE BELL HOUSING TO OBTAIN THE CORRECT SPECS.COMPLETED RENGINE REASSEMBLY AND REFITTED TO THE VEHICLE.REPLACED NO5 INJECTIR LINE AND TEST DROVE	12894.33	6617.15	411.82	50	19973.3
151211-00	SVC00160	12/15/2015	1H0368	IC-TRUCK FLE 184_INT	R	Air Con	1VT951	269799 KLI	REPAIR HOSE AND RECHARGE AIR C	REGAS AIR CON AFTER ENGINE REPAIRS, FOUND HIGH PRESSURE HOSE FROM COMPRESSOR TO CONDENSOR TO BE LEAKING, MAKE AND FIT NEW HOSE, REGAS SYSTEM, TEST OK.	354.38	42.7	0	78	475.08
151118-00	SVC00160	12/14/2015	1H0368	IC-TRUCK FLE 186_INT	R	Bodywork	1VT951	269169 KM	SEAT REPAIRS	SEAT REPAIRS. REMOVED WORN SEAT,DISASSEMBED AND DELIVERED TO RETRIM FOR REPAIRS. PICKED UP SEAT,REASSEMBLED AND FITTED TO VEHICLE.	238.88	0	250	10	498.88
151127-00	SVC00160	12/14/2015	1H0368	IC-TRUCK FLE 186_INT	R	Suspensior	1VT951	269169 KM	Suspension repairs	SUSPENSION REPAIRS. DISASSEMBLED SECOND AXLE SHACKLES.GROUND OFF WELDS,SET UP PRESS AND PRESSED OUT WORN BUSHES IN THE HANGER AND SPRING.PRESSED IN NEW BUSHES,WELDED IN PLACE AND FITTED NEW PINS.GREASED REMAINING SUSPESION PARTS.	750.76	369.88	0	37	1157.64
151124-00	SVC00159	11/27/2015	1H0368	IC-TRUCK FLE 184_INT	R	Drive Line	1VT951	269169 KLI	REPLACE UNIS IN AUX DRIVE LINE	REPLACED FAULTY UNI JOINT	118.13	34.6	0	6	158.73
151020-00	SVC00158	11/25/2015	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	269,169 KLI	DOWNLOAD ECU FAULTS,REPAIR AS	DOWNLOAD ECU FAULTS, COOLANT LEVEL SENSOR FAULT, REPLACE SENSOR, OLD ONE HAD BORKEN OFF IN RADIATOR, REMOVE AND CLEAN UP THREAD, FIT NEW SENSOR, FIT NEW PLUG AND PINS, TEST WIRING AND SWITCHES FOR CENTRAL LOCKING SYSTEM	1330.89	187.66	0	50	1568.55
150929-00	SVC00157	10/29/2015	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	267,550 KLI	REPAIR INTERIOR LIGHT NOT COMI	Central locking is not working nor the intier lighting. found issue in the left hand door pillar, this was repaired and the cab reassembled. Tested all ok.	409.51	0	0	20	429.51
151026-00	SVC00158	10/29/2015	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	14817 HRS	Replace water pump	REPLACE WATER PUMP. REPLACED LEAKING WATER PUMP.	238.88	258.81	0	12	509.69
150922-00	SVC00157	10/20/2015	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	266802 KM	REPAIR EXHAUST LEAK.	REPAIR EXHAUST LEAK.. CHECKED EXHAUST SYSTEM FOR LEAKING INTO THE CAB. FABRICATED AND FITTED NEW FOAM PAD TO THE AIR INTAKE BETWEEN THE BONNET AND THE CAB.	147	0	0	7	154

150928-00	SVC00157	10/20/2015	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	14813H 26	REPLACE BREATHER HOSE	REPLACE BREATHER HOSE. EXTENDED BREATHER HOSE AWAY FROM THE CAB AIR INTAKE AND CHECKED FOR BLOCKAGES AND LEAKS. IT WOULD APPEAR FORM THE EXCESSIVE ENGINE BLOW BY THAT THE ENGINE REQUIRES AN ENGINE REBUILD.NOTE THIS IS THE ENGINE THAT HAD THE INJECTOR FAILURE.	94.5	11.12	0	4.5	110.12
150929-00	SVC00157	10/20/2015	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	14817 hrs :	S1 B SERVICE	S1 B SERVICE. COMPLETED THE REQUIRED SERVICEAND SAFETY CHECKS AS PER SERVICE SHEET.	238.88	241.06	0	15	494.94
151016-00	SVC00158	10/20/2015	1H0368	IC-TRUCK FLE 186_INT	R	Brake	1VT951	14817 HRS	UNSIZEE TREADLE VALVE	UNSIZEE TREADLE VALVE. REMOVED BOLT FROM UNDER TREADLE VALVE AND FREE UP PIN.	34.13	0	0	0	34.13
150825-00	SVC00155	10/15/2015	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	14817 hrs :	REPLACE COMPRESSOR	REPLACE COMPRESSOR.REPLACED LEAKING ORIGINIAL COMPRESSOR.	341.26	1873.09	0	17	2231.35
150817-00	SVC00155	09/18/2015	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	262,845 Klt	REPAIRS TO CENTRAL LOCKING,	REMOVED CENTRAL LOCKING SYSTEM BOX FOR POWER AND SEND TO JLH FOR REPAIR, RECEIVED UNIT BACK AND CENTRAL LOCKING STILL NOT WORKING, LOCATE AND REPLACED FAULTY SWITCH IN DOOR PILLAR	477.75	20.93	132.25	20	650.93
150813-00	SVC00154	08/21/2015	1H0368	IC-TRUCK FLE 184_INT	R	Engine	1VT951	14538 HRS	CHECK REPORTED THROTTLE FAULT	TRAVELLED TO ROKEBY AND CHECKED UNIT FOR REPORTED THRITTLE FAULT, FOUED NOT TO BE REVING UP WHEN UNLOADING, MAKE TEMPORARY REPAIRS WHILE TRUCK IS UNLOADING AND FOLLOW BACK TO LA YARD.	236.25	0	0	78	314.25
150813-00	SVC00155	08/20/2015	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	262814 KM	ENGINE FAULT	ENGINE FAULT. CHECKED ENGINE FAULTS. REMOVED AND CLEANED LOW COOLANT SENSOR. CHECKED SPEED CONTROL. FOUND CRUISE CONTROL NOT ENABLED. TEST DROVE.	34.13	16.03	0	0	50.16
150807-00	SVC00154	08/18/2015	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	14502 HRS	REPLACE TURBO/ENG PIPE	REPLACE TURBO/ENG PIPE. CHECKED EXHAUST AND FOUND ENGINE PIPE BROKEN AND THE TURBO DAMAGED.PICKED UP AND FITTED NEW TURBO, REPLACED ENGINE PIPE.	341.26	2449.17	0	17	2807.43
150807-00	SVC00154	08/11/2015	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	14502 HRS	S1 A SERVICE	S1 A SERVICE. COMPLETED SERVICE AS PER SERVICE SHEET. REPLACED CLEARANCE LIGHT GLOBES.	136.5	174.82	0	11.5	322.82
150713-00	SVC00153	07/21/2015	1H0368	IC-TRUCK FLE 184_INT	R	Electrical	1VT951	260656 KLI	Replace U/S ALternator	WORKED ON TRUCK AT LAMPTON AVE, REPLACED FAULTY ALTERNATOR	240.45	167	0	12	419.45
150701-00	SVC00153	07/10/2015	1H0368	IC-TRUCK FLE 186_INT	R	Brake	1VT951	14296 HRS	REPAIR AIR LEAK	REPAIR AIR LEAK. CHECKED THE AIR SYSTEM FOR LEAKS.NOTHING FOUND.	68.25	0	0	0	68.25
150701-00	SVC00153	07/07/2015	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	259091 km	REPLACE LIGHT.	REPLACE LIGHT.. FITTED UP NEW BONNET INDICATOR AND WIRED IN.CHEKCED OPERATION.REPLACED MISSING CHUTE STRAPS.	68.25	5.16	0	0	73.41
150602-00	SVC00151	06/26/2015	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	14139 HRS	REPAIR LIGHTS/ELEC REPAIRS	HOOKED UP LAP TOP AND CHECKED FAULT CODES, FAULTS RELATED TO COOLANT SENSOR, CHECKED WIRING AND FOUND BROKEN WIRE, REPAIRED AND CLEARED FAULT CODES, ORDERED SIDE INDICATOR, TO BE FITTED	102.38	20.1	0	5	127.48
150609-00	SVC00151	06/12/2015	1H0368	IC-TRUCK FLE 186_INT	R	Bodywork	1VT951	257210 KM	REPLACE LHS BONNET BRACKET	REPLACE LHS BONNET BRACKET. REMOVED BROKEN BONNET MOUNTING BRACKET, REMOVED OPPOSITE SIDE TO USE AS A PATTERN TO FABRICATE A NEW ONE. FITTED NEW BRACKET AND ADJUSTED THE BONNET.	136.5	64.39	0	6.5	207.39

150602-00	SVC00151	06/11/2015	1H0368	IC-TRUCK FLE 186_INT	R	Suspensior	1VT951	256542 KM	REPLACE REAR SHOCK ABSORBERS	REPLACE REAR SHOCK ABSORBERS X2	204.76	399.72	0	10	614.48
150521-00	SVC00151	06/05/2015	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	14139 HRS	S1 B SERVICE	S1 B SERVICE. COMPLETED SERVICE AS PER SERVICE SHEET. NOTE. COOLANT LEAK FROM THE COOLANT FILTER HOUSING. COMPRESSOR HEAD GASKET LEAKING. COOLANT TEMP SENSOR DISCONNECTED. REPAIRED REVOLVING LIGHT.	307.13	284.13	0	20	611.26
150513-00	SVC00150	06/04/2015	1H0368	IC-TRUCK FLE 121_INT	R	Tyres	1VT951	255,202	MICH 11R22.5 XZY3 X 2 + BALANC	MICHELIN 11R22.5 XZY3 14/145K CRC X 2@ 600.00 EACH + 0 BALANCE POWDER X 2 @ 25.00 EACH + TYRE DISPOSAL @ 12.00 RUBAND DD 15285		1262	0	0	1262
150522-00	SVC00151	06/04/2015	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	14139 HRS	REPLACE DAMAGED FAN	REPLACE DAMAGED FAN. REMOVED THE BUMPER AND LOWER RADIATOR MOUNTS. DRAINED THE COOLANT AND REMOVED ALL HOSES. TILTED THE RADIATOR FORWARD TO ALLOW THE REMOVAL OF THE DAMAGED FAN. FITTED NEW FAN AND REASSEMBLED. WASHED OFF THE ENGINE AND CHECKED FOR LEAKS.	238.88	276.86	0	12	527.74
150521-00	SVC00151	05/28/2015	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	14082 HRS	ENGINE REPAIRS NO 2 INJECTOR	ENGINE REPAIRS NO 2 INJECTOR. DIAGNOSED ENGINE FAULT,PICKED UP AND REPLACED NUMBER TWO INJECTOR.REMOVED EXHAUST AND CLEANED OUT DIESEL.REFITTED THE EXHAUST AND TEST DROVE.	238.89	730.15	0	10	979.04
150522-00	SVC00151	05/28/2015	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	14082 HRS	COOLANT SENSOR REPAIRS	COOLANT SENSOR REPAIRS. HOOKED UP THE LAP TOP AND CHECKED FAULTS.FOUND LOW COOLANT SENSOR FAULT.TRACED TO BROKEN WIRES.REPAIRED AND CLEARED THE FAULTS.	68.25	0	0	0	68.25
150522-00	SVC00150	05/27/2015	1H0368	IC-TRUCK FLE 184_INT	R	Engine	1VT951	14085 HRS	CALL OUT - CHECK ENG LIGHT & S	CALLED OUT TO TRUCK ON BOOKER HWY, CHECKED OUT ENGINE FAULT AND COULD NOT FAULT, FOLLOWED TRUCK AND FAULT DEVELOPED AGAIN, EMPTIED LOUD AT JEPP PARADE AND FOT IT FLOATED BACK TO YARD ***FOUND TO BE U/S INJECTOR	420	0	0	5.5	425.5
150515-00	SVC00150	05/19/2015	1H0368	IC-TRUCK FLE 186_INT	R	Transmissio	1VT951		CLUTCH BRAKE REPAIRS	CHECKED FOR NOISE COMING FROM THE GEARBOX / BELL HOUSING AREA, TRACED FAULT TO CLUTCH BRAKE RATTLING.	89.25	0	0	0	89.25
150430-00	SVC00149	05/07/2015	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	254,517 Kl	CHECK LIGHTS REPAIR AS NECESSA	CHECK LIGHTS, REPAIRED WIRING FOR BOTH INDICATORS ON EITHER SIDE OF THE MUDGUARDS, ORDERED A REPLACEMENT INDICATOR TO BE REPLACED WHEN UNIT NEXT AVAILABLE, CHECK AND REPAIR PLUG AND WIRING FOR RH HEAD LIGHT	204.75	36.5	0	10	251.25
150422-00	SVC00149	04/30/2015	1H0368	IC-TRUCK FLE 121_INT	R	Tyres	1VT951	253702	CALLOUT TO REPLACE TYRE	CALLOUT TO REPLACE TYRE CARRIED OUT BY RUBAND 14859	0	437	0	0	437
150318-00	SVC00147	03/30/2015	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	13790 HRS	S1 A SERVICE	S1 A SERVICE. COMPLETED SERVICE AS PER SERVICE AS PER SERVICE SHEET. TIGHTENED LOOSE GAURDS.REPLACED BLOWN CLEARANCE LIGHTS.	144.38	181.8	0	11	337.18
150318-00	SVC00147	03/27/2015	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	251020	LHS HEAD LIGHT REPAIRS	LHS HEAD LIGHT REPAIRS. CHECKED HEAD LIGHTS, REPLACED PARK LIGHT GLOBES AND HEAD LIGHT GLOBE. TRACED FAULT ON THE LEFT HAND SIDE TO BAD EARTH. REPLACED BLOWN DASH LIGHT GLOBES.	144.38	14.19	0	7.5	166.07

150318-00	SVC00147	03/27/2015	1H0368	IC-TRUCK FLE 186_INT	R	Hydraulic	1VT951	251020	REPAIR HYDRAULIC LEAK AT HYD T	REPAIR HYDRAULIC LEAK AT HYD TANK. CHECKED FOR OIL LEAK, REPLACED SIGHT GLASS. CHECKED FOR OTHER LEAKS.TOPPED UP OIL.TESTED OPERATION.	55.13	39.38	0	0	94.51
150318-00	SVC00147	03/19/2015	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	13790H 25	REPAIR COOLANT LEAK	REPAIR COOLANT LEAK. REMOVED THE LEAKING TOP RADAITOR HOSE, SOURCED NEW HOSE FROM SPARE SECTIONS EX STOCK AND FITTED TO THE VEHICLE. TOPPED UP THE COOLANT AND WASHED DOWN THE ENGINE.	123.38	138.02	0	6	267.4
150304-00	SVC00146	03/06/2015	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	139719h 2	COOLANT LEAK	COOLANT LEAK. REPLACED LEAKING FITTING AT THE HEADER TANK,TOPPED UP COOLANT AND WASHED DOWN THE ENGINE.	68.25	0	0	3	71.25
150211-00	SVC00145	02/23/2015	1H0368	IC-TRUCK FLE 186_INT	R	Steering	1VT951	247653 km	STEERING CROSS MEMBER REPAIRS	STEERING CROSS MEMBER REPAIRS. REMOVED THE BONNET AND BUMPER. DRAINED THE COOLANT. REMOVED THE RADIATOR ASSEMBLY, SUPPORTED THE CHASSIS AND ENGINE. REMOVED THE STEERING BOX AND BROKEN CROSS MEMBER ASSEMBLY. FITTED RECONDITIONED CROSSMEMBER AND REASSEMBLED THE TRUCK. NOTE.SELF ADJUSTING RELIEFS ARE SIEZED AND THE STEERING BOX WILL NEEDED REPLACING SOON.	2005.51	48.57	0	50	2104.08
141028-00	SVC00140	01/16/2015	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	13166H 24	ENGINE OIL LEAKS	ENGINE OIL LEAKS. CLEANED THE ENGINE, REMOVED WIRING AND HOSES FROM UNDER THE SUMP AND REMOVED THE SUMP. CLEANED UP SURFACES AND REFITTED THE SUMP WITH A NEW GASKET (ORDERED PREVIOUS SERVICE CALL) RECONNECTED WIRING AND HOSES. TOPPED UP POWER STEERING OIL AND CHECKED FOR LEAKS.	420.01	91.68	0	21	532.69
150113-00	SVC00143	01/16/2015	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	13472H 24	S1 BSERVICE	COMPLETED SERVICE AND SAFETY CHECKS AS PER SERVICE SCHEDULE	160.13	245.62	0	11.5	417.25
150114-00	SVC00144	01/16/2015	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	13472H 24	REPAIR LIGHTS	REMOVE AND REPLACED FAULTY AIR FITTING REPLACED FAULTY GLOBE AND REPLACED CAP AS REQUIRED	21	0	0	0	21
150114-00	SVC00144	01/16/2015	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	13472H 24	CHECK OUT ENGINE OIL LEAK	WAS OFF OIL FROM ENGINE, TEST DRIVE UNIT AND CHECK FOR OIL LEAK, LOCATED AND TIGHTENED UP LOOSE FITTING ON ENGINE, RETEST ENGINE FOR LEAKS ALL GOOD.	135.19	3	0	6	144.19
141203-00	SVC00142	01/14/2015	1H0368	IC-TRUCK FLE 186_INT	R	Sundries	1VT951	243,535 Klt	REPAIR LEAKING HEATER CORE	REMOVE INSULATION AND PLATE FROM HEATER BOX ON FIREWALL, REMOVE HEATER CORE AND SENT OUT FOR REPAIRS, REFIT REPAIRED HEATER CORE AND REASSEMBLE FIREWALL, RECONNECT HOSES AND TOP UP WITH COOLANT. CHECK BRAKE LIGHT FAULT FOUND RUSTED OUT GLOBE HOLDERS, DISCUSSED WITH ADRIAN NORRIS, SUPPLIED AND FITTED 2 NEW LED REAR LAMPS AND TEST OPERATION ALL GOOD.	750.75	398.3	60	35	1244.05
141203-00	SVC00142	12/10/2014	1H0368	IC-TRUCK FLE 186_INT	R	Bodywork	1VT951	13343H 24	REPLACE MIRRORS	REPLACE MIRRORS. REPLACED HEATED AND SPOT MIRRORS ON THE LHS AND RHS.	170.63	74.94	0	8.5	254.07

141028-00	SVC00140	12/08/2014	1H0368	IC-TRUCK FLE 186_INT	R	Bodywork	1VT951	13166H 24	REPAIR WINDSCREEN WASHERS	REPAIR WINDSCREEN WASHERS. CHECKED WIPERWASHER OPERATION. CHECKED FOR POWER AT THE PLUG, OK.POWERED UP THE PUMP. FOUND TO BE FAULTY. FITTED NEW PUMP AND CHECKED OPERATION. PUMP WAS SLOW. CHECK ED SYSTEM AND FOUND VOLTAGE DROP AT THE PUMP. DISASSEMBLED THE COLUMN AND FOUND SWITCH ON THE STALK HAS A VOLTAGE DROP ACROSS IT. REASSEMBLED THE COLUMN AND HAD THE WIPERS WIRE IN A REMOTE SWITCH WHEN THE AUTO ELECT WERE AVAILABLE.	228.38	83.08	0	11	322.46
141203-00	SVC00142	12/08/2014	1H0368	IC-TRUCK FLE 186_INT	R	Brake	1VT951	13343 HRS	REPLACE LEAKING BRAKE RELAY VALVE	REPLACE LEAKING BRAKE RELAY VALVE. REPLACED LEAKING STEER AXLE SERVICE BRAKE RELAY VALVE.	136.51	122.72	0	6.5	265.73
141201-00	SVC00142	12/02/2014	1H0368	IC-TRUCK FLE 121ADMIN	R	Tyres	1VT951	243358	W/POWER WDR31 11R X 8 + DISPOS	W/POWER WDR31 11R X 8 + DISPOSAL X 6 RUBAND 12945	0	2752	0	0	2752
141028-00	SVC00140	10/30/2014	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	13166 HRS	S1 A SERVICE	S1 A SERVICE. Completed service as per service sheet.	131.25	182.17	0	13.5	326.92
141028-00	SVC00140	10/30/2014	1H0368	IC-TRUCK FLE 186_INT	R	Clutch	1VT951		CLUTCH ADJUSTMENT	CLUTCH ADJUSTMENT. TIGHTENED LOOSE ROSE JOINTS ON THE LINKS OFF THE FIRE WALL. CHECKED CLUTCH BRAKE RETAINING BOLT AND ADJUSTED THE CLUTCH AND CLUTCH BRAKE.	68.25	0	0	0	68.25
141024-00	SVC00140	10/29/2014	1H0368	IC-TRUCK FLE 186_INT	R	Transmissio	1VT951	13096 HRS	GEAR BOX REPAIRS	PARTS FITTED TO THE GEARBOX WHEN THE CLUTCH WAS REPLACED INCLUDING THE CLUTCH.	34.13	1640	0	0	1674.13
141015-00	SVC00139	10/24/2014	1H0368	IC-TRUCK FLE 186_INT	R	Clutch	1VT951	13096 HRS	Replace clutch	REPLACE CLUTCH. REMOVED GEAR BOX ASSEMBLY AND FAILED CLUTCH.REMOVED THE FLYWHEEL AND HAD MACHINED. REPLACED LEAKING REAR MAIN SEAL,AND FITTED NEW CLUTCH ASSEMBLY. ABS -- INSPECT FLYWHEEL FOR MACHINABILTY, REMOVED CLUTCH DIAPHRAGM DOWELLS AS REQUIRED, MACHINE AND INSPECT SURFACES, CHECK SURFACE OFF SETS (IF APPLICABLE)	1672.14	841.48	0	50	2563.62
141006-00	SVC00139	10/20/2014	1H0368	IC-TRUCK FLE 182_INT	R	Sundries	1VT951		REPAIRS TO CHUTES	CARRY OUT MODIFICATIONS TO CHUTES TO BE ABLE TO FIT TOGETHER	238.88	0	0	12	250.88
141006-00	SVC00139	10/07/2014	1H0368	IC-TRUCK FLE 121ADMIN	R	Tyres	1VT951	238,821	11R22.5 XZY3 X 2 + BAL POWDER	11R22.5 XZY3 X 2 + BAL POWDER X 2 + SCRAP X 2 RUBAND DD 12279	0	1274	0	0	1274
140925-00	SVC00138	09/26/2014	1H0368	IC-TRUCK FLE 184_INT	R	Brake	1VT951	13026 HRS	INSPECT BRAKE FAULT	TRAVEL TO NEW NORFOLK, INSPECT TREADLE VALVE FOUND TO BE STICKING, REMOE AND DISASSEMBLE TREADLE VALVE, CLEAN UP PARTS, REASSEMBLE, REFIT AND TEST OPERATION ALL OK, RETURN TRAVEL TO WORKSHOP	275.63	0	0	91	366.63

140911-00	SVC00138	09/25/2014	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	237,441 Klt	REPAIRS TO HEATER CONTROLS	REMOVED DASH FACIA AND GAUGE PANELS, DISCONNECT WIRING AND VENT HOSES FROM HEATER BOX, REMOVED GAS FROM AIR CON AND DISCONNECT HEATER HOSES, REMOVED INSULATION FROM FIRE WALL, REMOVED FRESH AIR VENT FRON UNDER BONNET, UNBOLT HEATER BOX FROM CABIN AND CUT THOUGH SIKAFLEX, DISMANTLED HEATER BOX AND CLEAN UP BARREL VALVE AND SUPPORTS, RELUBRICATE. CHECK OPERATION OF FRESH RECIRCULATE FLAP AND UNSEIZE AS REQUIRED, REASSEMBLED HEATER BOX AND TEST ALL FLAPS ALL OK, REFIT AND BOLT TO FIREWALL, REASSEMBLE DASH FACIA AND GAUGES, RECONNECT HEATER PLUGS. ***WORK COMPLETED OUTSIDE NORMAL WORKING HOURS	2328.91	358.99	0	140	2827.9
140818-00	SVC00136	09/24/2014	1H0368	IC-TRUCK FLE 186_INT	R	Drive Line	1VT951	237441 KM	REPLACE CENTRE BEARING	REPLACE CENTRE BEARING. REMOVED THE DRIVE SHAFT AND REPLACED THE CENTRE BEARING.	204.76	183.55	0	10	398.31
140917-00	SVC00138	09/24/2014	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	237441 KM	REPAIR OIL LEAK ATOIL COOLER	REPAIR OIL LEAK ATOIL COOLER. REMOVED THE OIL COOLER AND REPLACED THE COVER PLATE AND MOUNTING GASKET. REFITTED AND TOPPED UP THE COOLANT.	238.88	151.25	0	12	402.13
140821-00	SVC00136	09/16/2014	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	235,254 Klt	REPAIR REAR LIGHTS,L/HAND FRON	CHECK STOP LIGHTS REPORTED COMING ON AND OFF, REPAIRED WIRING AND CONNECTIONS, REPAIRED WIRING FOR LEFT HAND INDICATOR. CHECK HEATER AND AIR CON, REMOVED ELECTRONIC CONTROLS AND SENT TO JLH FOR REPAIRS ORDERED NEW ACTUATOR FOR VENT. REMOVE AND REPLACE CRUISE CONTROL SWITCH	307.13	466.74	372.5	15	1161.37
140820-00	SVC00136	08/27/2014	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	235767 KM	REPLACE WORN FAN BELT TENSIONE	REPLACED WORN FAN BELT TENSIONER.	85.32	326.98	0	0	412.3
140825-00	SVC00136	08/26/2014	1H0368	IC-TRUCK FLE 186_INT	R	Clutch	1VT951	12883 HRS	CHECK CLUTCH OPERATION	CHECK CLUTCH OPERATION. CHECKED CLUTCH OPERATION,FOUND CLUTCH BRAKE ADJUSTMENT BOLT AND LOCK NUT MISSING. GROUND UP NEW BOLT, FITTED AND ADJUSTED.	68.25	0	0	3	71.25
140815-00	SVC00136	08/22/2014	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	12839 HRS	S1 B SERVICE	S1 B SERVICE. COMPLETED SERVICE AS PER SERVICE SHEET. LISTED FAULTS TO BE COMPLETED AT A LATER DATE.	152.26	221.59	0	11	384.85
140709-00	SVC00134	08/21/2014	1H0368	IC-TRUCK FLE 186_INT	R	Sundries	1VT951	12839 HRS	REPAIR DRIVER SEAT	REPLACED DRIVERS SIDE SEAT BELT AND DRIVERS SEAT HEIGHT CONTROL	199.51	257.95	0	10	467.46
140820-00	SVC00136	08/20/2014	1H0368	IC-TRUCK FLE 121ADMIN	R	Tyres	1VT951	23518KM	PUNCTURE REPAIR RUBAND 109268	PUNCTURE REPAIR RUBAND 109268	0	0	40.91	0	40.91
140709-00	SVC00134	07/17/2014	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951		SUPPLY NUMBER PLATE LIGHT	Supply globes as required by driver	0	4.15	0	0	4.15
140626-00	SVC00133	07/08/2014	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	230,672 Klt	ENGINE NOT STOPPING,DOWN LOAD	DOWN LOAD ECM FAULTS, NON APPLICABLE, CHECK SYSTEM AND FOUND MANIFOLD HEATER STAYING ON, FOUND BOTH SOLENOIDS U/S REMOVE AND REPLACE AS REQUIRED, TEST OPERATION ALL GOOD	477.76	63.5	0	23	564.26
140627-00	SVC00133	06/30/2014	1H0368	IC-TRUCK FLE 186_INT	R	Clutch	1VT951	12581 HRS	ADJUST THE CLUTCH	ADJUST THE CLUTCH. CHECKED AND ADJUSTED THE CLUTCH. REPLACED RIGHT HAND SIDE REAR INDICATOR LENS. REPAIRED HYDRAULIC OIL LEAK. REPAIRED WINDOW REGULATOR HANDLE.	255.94	0	0	12	267.94
140603-00	SVC00133	06/27/2014	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951		REPLACE LEAKING SUMP GASKET	REMOVE AND REPLACE LEAKING SUMP GASKET	0	63.58	0	0	63.58

140603-00	SVC00132	06/23/2014	1H0368	IC-TRUCK FLE 186_INT	R	Bodywork	1VT951	12459 KMS	REPAIR WINDSCREEN WASHER OPERA	REPAIR WINDSCREEN WASHER OPERATION. CHECKED OPERATION OF THE AIR CON AND VENT CONTROLS.FOUND THE AC HEATER CONTROL ON THE DASH NOT OPERATING CORRECTLY.SOURCED NEW PART AND FOUND TO BE OVER \$1200.00.WILL TRY AND DISASSEMBLE TO REPAIR. ALSO THE HEATER CONTROL ACTUATOR IN THE HEATER BOX IS NOT OPERATING CORRECTLY.THIS PART CAN BE OBTAINED FOR LES THAN \$300.00.	233.63	16.22	0	12	261.85
140603-00	SVC00132	06/23/2014	1H0368	IC-TRUCK FLE 186_INT	R	Brake	1VT951	228,926 12	CHECK AND REPAIR AIR LOSS	CHECK AND REPAIR AIR LOSS. PICKED UP PARTS AND FITTED UP NEW PARK BRAKE CONTROL TEST OPERATION ALL GOOD.	212.63	63.58	0	11	287.21
140603-00	SVC00132	06/10/2014	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	228926KM	S1 A SERVICE	S1 A SERVICE. Completed service as per service sheet.	165.38	178.46	0	11.5	355.34
140603-00	SVC00132	06/10/2014	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	228926 KM	Replace fan belt	REPLACE FAN BELT. REMOVED OLD FAN BELT,CHECKED IDLER ALIGNMENT AND FITTED UP NEW BELT.	42	38.35	0	0	80.35
140605-00	SVC00132	06/10/2014	1H0368	IC-TRUCK FLE 184_INT	PW	Engine	1VT951	12473 HRS	REPLACE LEAKING OIL FILTER	TRAVELLED TO SITE IN TAROONA REMOVE LEAKING OIL FILTER, FOUND DIRT BETWEEN O RING AND FILTER HOUSING, CLEANED OFF HOUSING AND REPLACED FILTER, REMOVED DAMAGED BELT MATERIAL THAT WAS LEFT AROUND PULLEYS WHEN BELT WAS LAST CHANGED. UNIT WAS SERVICED AND BELT REPLACED 2 DAYS EARLIER IN WORKSHOP, POLICY AGAINST CC186	196.88	40.14	0	28.8	265.82
140320-00	SVC00129	05/02/2014	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951		REPAIR WINDOW WASHERS	REPAIR WINDOW WASHERS. REPLACED WASHER MOTOR AND REPAIRED WIRING TO THE WASHER MOTOR.ASSISTED MATT RILEY WITH PAPER WORK AND TOOLS TO REPLACE DISCHARGE CHUTE RUBBER.	115	41.73	0	5	161.73
140319-00	SVC00128	04/14/2014	1H0368	IC-TRUCK FLE 186_INT	R	Brake	1VT951	12080 HRS	Brake adjustment	BRAKE ADJUSTMENT. CHEDKED PARK BRAKE OPERATION AND FOUND THREE MAXI BRAKE BOOSTERS WITH BROKEN SPRINGS. REPLACED BOOSTERS, FITTED UP NEW CLEVIS AND PINS,ADJUSTED ALL BRAKES.	437.5	193.4	0	21.5	652.4
140320-00	SVC00128	04/11/2014	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	12080 HRS	REPLACE INTERCOOLER HOSE	REPLACE INTERCOOLER HOSE. REPLACED STEPPED INTERCOOLER HOSE ON THE INTERCOOLER OUTLET SIDE.	25	64.65	0	0	89.65
140320-00	SVC00128	04/08/2014	1H0368	IC-TRUCK FLE 186_INT	R	Bodywork	1VT951		REPLACE REAR MARKER PLATES	REPLACE REAR MARKER PLATES. REPLACED DELINIATED LINE AND DO NOT OVER TAKE TURNING VEHICLE SIGNS.	75	62.8	0	0	137.8
140319-00	SVC00128	03/28/2014	1H0368	IC-TRUCK FLE 186_INT	R	Air Con	1VT951	222,772 kn	CLEAN AIRCON DRAIN	REMOVED WASHER BOTTLE AND CLEAN DRAINS FOR AIR CON SYSTEM, RESEAL DRIP TRAU UNDER AIR CON BOX AS REQUIRED	260	79.9	0	13	352.9
140311-00	SVC00128	03/27/2014	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	221,914 Klt	ENGINE WONT START,BATTERIES	ATTEND UNIT NO START FAULT, REMOVE AND REPLACE BATTERIES CHECK CHARGE RATE ALL GOOD	130	267.74	0	0	397.74
140319-00	SVC00127	03/24/2014	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	12080H 22	S1 B SERVICE	COMPLETED SERVICE AS PER SERVICE SCHEDULE	315	289.19	0	13	617.19
140204-00	SVC00125	02/26/2014	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	219289 KM	REPAIR EXHAUST LEAK	REPAIR EXHAUST LEAK.. REMOVED EXHAUST MANIFOLD AND MEASURED RUN OUT IN THE MANIFOLD. HAD MANIFOLD MACHINED AND REASSEMBLED WITH NEW GASKETS AND RETAINING BOLTS. CHECK OPERATION.	357.5	357.23	150	17.5	882.23
140123-00	SVC00124	01/29/2014	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	217296KM:	S1 A SERVICE	CARRIED OUT A SERVICE AS PER SERVICE SHEET	100	148	0	8	256
140124-00	SVC00124	01/24/2014	1H0368	IC-TRUCK FLE 186_INT	R	Brake	1VT951	11786HRS	ADJUST BRAKES AND FREE UP SLAC	FREE UP SLACK ADJUSTER LOCKS AND ADJUST BRAKES	50	0	0	0	50

131218-00	SVC00123	12/27/2013	1H0368	IC-TRUCK FLE 186_INT	R	Ancillary Ec	1VT951	11611H 21	REPLACE BROKEN MUDGUARD	Removed bent mudguard pole ,Replaced mud guard bracket ,fitted new mudguard pole and replaced mudguard	130	78.06	0	6.5	214.56
131127-00	SVC00121	11/27/2013	1H0368	IC-TRUCK FLE 121ADMIN	R	Tyres	1VT951	212,113	PUNCTURE REPAIR + BALANCE POWD	PUNCTURE REPAIR + BALANCE POWDER RUBAND 04880	0	65	0	0	65
131120-00	SVC00121	11/25/2013	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951		S1 B SERVICE	S1 B SERVICE. COMPLETED SERVICE AS PER SERVICE SHEET. REPAIRED DAMAGED GREASE NIPPLE THREADS IN BONNET PIVOT.	227.5	182.37	0	14.5	424.37
131121-00	SVC00121	11/25/2013	1H0368	IC-TRUCK FLE 186_INT	R	Suspensior	1VT951		REPLACE DAMAGED SUSPENSION BUF	REPLACE DAMAGED SUSPENSION BUFFERS. REMOVED DAMAGED BUFFERS,(EARLY DESIGN) AND FITTED UP LATE MODEL ADAPTORS AND BUFFERS. WELDED ADAPTORS IN POSITION AND BOLTED UP BUFFERS.	325	487.51	0	15	827.51
131121-00	SVC00121	11/25/2013	1H0368	IC-TRUCK FLE 186_INT	R	Steering	1VT951	11436 HRS	REPLACE STEERING UNIVERSAL	REPLACE STEERING UNIVERSAL. REMOVED STEERING SHAFT AND REPLACED UNIVERSAL JOINT.	65	11.25	0	0	76.25
131111-00	SVC00121	11/19/2013	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	211,010 Klt	REPAIRS TO ENGINE SHUTTING DOW	REPAIRS TO ENGINE SHUTTING DOWN LOCATE FAULT WITH GPS/FMS SYSTEM ADVISE DAVE ELDRIGE WHO REPAIRED VEHICLE	130	0	0	0	130
131113-00	SVC00121	11/18/2013	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	11400 HRS	REPAIR ENG OIL LEAK	REPAIR ENG OIL LEAK. SEALED UP LEAKING ENGINE OIL COOLER BOLTS AND COOLANT LEAK.	130	20.86	0	6.5	157.36
131004-00	SVC00118	10/21/2013	1H0368	IC-TRUCK FLE 186_INT	R	Radio	1VT951	207,768 Klt	REPAIRS TO UHF RADIO,AM/FM RAD	CHECK UHF AND REPAIR MOUNTING BRACKET FOR SET, REPLACE FAULTY UHF AERIAL, REMOVE AND REPLACE RUSTED AM/FM AERIAL, CHECK AND REPAIR WIRING FOR REAR LIGHTS	390	177.55	0	19	586.55
131002-00	SVC00119	10/17/2013	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	11159 hrs :	S1 A SERVICE	Completed service as per service sheet. Note.Rocker box rubbers missing,engine oil leaks and blown exhaust manifold gaskets.	85	192.84	0	8	285.84
131002-00	SVC00118	10/17/2013	1H0368	IC-TRUCK FLE 186_INT	R	Sundries	1VT951	11159 hrs :	ADJUST CLUTCH AND REPAIRS AS	Adjusted the clutch,replaced blown globes,tightened loose gaurd poles and tightened intake pipe clamp.	40	0	0	2	42
130806-00	SVC00116	09/03/2013	1H0368	IC-TRUCK FLE 186_INT	R	Suspensior	1VT951		REPLACE SUSPENSION BUFFERS		65	642.68	0	0	707.68
130807-00	SVC00114	08/29/2013	1H0368	IC-TRUCK FLE 186_INT	F	Electrical	1VT951		FIT UP REVERS CAMERA	FIT UP REVERSE CAMERA AND RUN CABLE TO BACK OF CAB, UNIT STILL REQUIRES A POWER SUPPLY TO MONITOR, UNABLE TO FINISH JOB AS UNIT WAS REQUIRED TO WORK.	260	0	0	13	273
130724-00	SVC00114	08/15/2013	1H0368	IC-TRUCK FLE 182_INT	R	Sundries	1VT951		FABRICATE AND FIT TOW LUGGS	FABRICATE AND FIT TOW LUGGS AS REQUIRED	373.5	63.69	0	19	456.19
130716-00	SVC00114	08/09/2013	1H0368	IC-TRUCK FLE 186_INT	R	Differential	1VT951		REPLACE REAR DIFF CENTRE	REPLACE REAR DIFF CENTRE. Ordered diff and picked up from CJD when arrived. Removed diff centre,cleaned out housing and fitted new diff.Swapped over drive yokes and refitted the axles. Topped up diff oil and checked operation.	702.5	2717.29	0	0	3419.79
130805-00	SVC00115	08/09/2013	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	200441 km	S1 B SERVICE	S1 B SERVICE. Completed service as per service sheet.	320	184.8	0	0	504.8
130607-00	SVC00111	06/28/2013	1H0368	IC-TRUCK FLE 186_INT	R	Sundries	1VT951	194329km	DEFECT REPORT 13140	DEFECT REPORT 13140. Tightened engine mounting bolts. Checked the drive line for vibration. Repaired bonnet hinge lubrication points.	142	0	0	14	156
130611-00	SVC00111	06/17/2013	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	194950 km	REPLACE TURBO	REPLACE TURBO. Replaced engine turbo. Repaired heated mirror,tail lights and number plate lights.	597.5	2219.5	0	29	2846

130607-00	SVC00111	06/13/2013	1H0368	IC-TRUCK FLE 186HEAVY	S	Service	1VT951	194329 km	S1C SERVICE	S1C SERVICE. Completed service as per service sheet. Tightened transmission mount. Tightened loose coolant filter to stop leak. Note,spring buffers missing and need replacing. Shackle bushes worn. PLEASE NOTE USED 4 LTR ATF BUT UNABLE TO BOOK TO SERVICE CALL AS STORE DOES NOT HAVE ENOUGH STOCK	497	636.46	0	28	1161.46
130409-00	SVC00109	05/08/2013	1H0368	IC-TRUCK FLE 186_INT	A	Bodywork	1VT951	187128 km	REPLACE CRACKED WINDSCREEN	REPLACE CRACKED WINDSCREEN. Replaced missing speed units on the inside of the drivers side door panel and tightened.	150	8.35	536.36	0	694.71
130402-00	SVC00108	04/12/2013	1H0368	IC-TRUCK FLE 186_INT	A		1VT951	185755 km	REPLACE DAMAGED LENS	REPLACE DAMAGED LENS. Bend damaged bumper to allow removal of indicator lens. Removed lens,built up concrete and cleaned up wiring.Fitted new gasket and lens,checked operation.	32.5	8.25	0	0	40.75
130408-00	SVC00108	04/12/2013	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	10076 hrs	S1 B SERVICE	S1 B SERVICE. Completed service as per service sheet. Topped up powr steering oil,replaced rear shock absorber rubbers and blown dash warning light globes. Unsiezed brake slack adjusters and adjusted the brakes.	455	272.48	0	0	727.48
130404-00	SVC00108	04/11/2013	1H0368	IC-TRUCK FLE 184_INT	R	Engine	1VT951	10056	Replace fan belt	TRAVEL TO CLAREMONT, REPLACE FAN BELT AND BELT TENSIONER	153.5	477.96	0	14.4	645.86
130304-00	SVC00106	03/08/2013	1H0368	IC-TRUCK FLE 186_INT	R	Sundries	1VT951	9,883 km	FIT NEW DOOR LOCK	REMOVE DOOR LINING AND PANEL TO REPLACE DOOR LOCK ASSEMBLY. REPAIR REVERSE LIGHT WIRING AND REPLACE REVERSE ALARM AS REQUIRED	390	63.29	0	0	453.29
130121-01	SVC00103	02/19/2013	1H0368	IC-TRUCK FLE 186_INT	R	Suspensior	1VT951	9645HRS	CHECK FOR CRACKED FRONTCROSS M	CHECK FOR CRACKED FRONT CROSS MEMBER. Checked and adjusted the steering stops.	97.5	4.39	0	0	101.89
130124-00	SVC00103	02/08/2013	1H0368	IC-TRUCK FLE 186_INT	R	Tyres	1VT951		11R22.5 CM980 GR/W X 8 + DISPO	11R22.5 CM980 GR/W X 8 + DISPOSAL RUBANDS 73165	0	3096	0	0	3096
130104-00	SVC00103	01/30/2013	1H0368	IC-TRUCK FLE 186_INT	R	Sundries	1VT951	177,353 km	REPAIRS TO DOOR HANDEL	SUPPLY DOOR HANDLE AS REQUIRED	0	243.39	0	0	243.39
130111-00	SVC00103	01/15/2013	1H0368	IC-TRUCK FLE 186_INT	R	Tyres	1VT951	176,824	FIT RUN OUT X1 TYRE DISPOSALX1	FIT RUN OUT X1 TYRE DISPOSALX1 RUBAND D/D 72332	0	32	0	0	32
130109-00	SVC00103	01/11/2013	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	9564H	S1 B SERVICE	SERVICE UNIT AS REQUIRED	387.5	257.02	0	3.5	648.02
121213-00	SVC00102	12/21/2012	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	175,428 km	REPAIRS TO HEAD LIGHTS	CLEAN AND REPAIR PLUGS ON THE BACK OF HEAD LIGHTS.	130	6.5	0	0	136.5
121109-00	SVC00100	11/26/2012	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	9252 hrs	S1 B SERVICE	S1 B SERVICE. Completed service as per service sheet.	391.25	232.44	0	0	623.69
121029-01	SVC00099	11/09/2012	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	171288 KM	REPLACE TOP RADIATOR HOSE	REPLACE TOP RADIATOR HOSE. Pressure tested for coolant leak,drained coolant,replaced failed hose and refilled the radiator.	198.25	122.46	0	9.5	330.21
120726-00	SVC00093	10/31/2012	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	163,006 km	REPAIRS TO INDICATORS	REPAIRS TO INDICATORS AND REPAIRS TO CRUISE CONTROL AS REQUIRED. Problem pointed to computor , changed computers between trucks , didn't fix problem. Pulled out dash and tested and found problem.	905	4.28	0	0	909.28
121001-00	SVC00098	10/12/2012	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	8908 HRS	CHECK BOWL SPEED FAULT	CHECK BOWL SPEED FAULT. Checked wiring from pendant to control box and back to linear actuator.	195	9.5	0	0	204.5

121001-00	SVC00098	10/09/2012	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	8980 hrs 1	S1 B SERVICE	S1 B SERVICE. Completed service as per service sheet. Replaced worn shock absorber rubbers,reverse light lens,and buzzer.	435	335.24	0	3.5	773.74
120727-00	SVC00093	08/28/2012	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	8608 hrs 1	S1 B SERVICE	S1 B SERVICE. Completed service as per service sheet. Fabricated and fitted bonnet restraint bracket.	322.5	289.54	0	3.5	615.54
120809-00	SVC00094	08/28/2012	1H0368	IC-TRUCK FLE 186_INT	R	Brake	1VT951	8750 hrs 1	REPLACE TRAEDLE VALVE	REPLACE TREDLE VALVE AS REQUIRED	236	353.07	0	0	589.07
120727-00	SVC00094	08/06/2012	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	8608 hrs 1	CHECK EXHAUST LEAK	CHECK EXHAUST LEAK. Replaced exhaust flex and band clamps. Replaced steer axle guard. Tightened shock absorber mounts. Tightened loose bumper bar bolts.	409.25	251.27	0	0	660.52
120718-00	SVC00092	07/26/2012	1H0368	IC-TRUCK FLE 186_INT	R	Bodywork	1VT951		REPLACE WORN SEAT	REPLACE WORN SEAT SEAT COVERS AS REQUESTED BY TODD RUSHER 23/07/2012	93.75	1820.91	0	0	1914.66
120626-00	SVC00092	06/29/2012	1H0368	IC-TRUCK FLE 184_INT	S	Service	1VT951	157846 KLI	S1 B SERVICE	CARRIED OUT B SERVICE. REPLACE WIPER BLADES, CHECK BLACK FLAP ON BACK OF BONNET AND CHECK DEMISTER FAN NOISE. WORK CARRIED OUT BY CJD EQUIPMENT	59	0	717.25	0	776.25
120614-00	SVC00091	06/20/2012	1H0368	IC-TRUCK FLE 184_INT	R	Electrical	1VT951	155758 KLI	Repair starting fault	TRAVEL TO KINGSMEADOWS. CHECK AND FOUND BATTERIES U/S, REPLACE BATTERIES, FURTHER PROBLEM WITH ALTERNATOR, RETURN AND REPLACE. WORK CARRIED OUT BY CJD EQUIPMENT	59	0	1400.05	0	1459.05
120528-00	SVC00090	05/31/2012	1H0368	IC-TRUCK FLE 184_INT	R	Sundries	1VT951	8237	REPAIR HEATER AND VENTS	TRAVEL TO MUSSELROE. RE-SEALED OUTSIDE VENT FOR HEATERS. CHECK OVER UNIT. LOOKED AT TICKING NOISE IN HEATER BOX.	107	10	0	36	153
120508-00	SVC00089	05/15/2012	1H0368	IC-TRUCK FLE 184_INT	S	Service	1VT951	150582 KM	S1 B SERVICE	SERVICE UNIT AS REQUIRED CARRIED OUT BY CJD EQUIPMENT	59	0	835.8	0	894.8
120404-00	SVC00087	04/11/2012	1H0368	IC-TRUCK FLE 186_INT	R	Tyres	1VT951	7503636	Puncture repair	PUNCTURE REPAIR RUBAND	0	40	0	0	40
120215-00	SVC00084	03/20/2012	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	7706 hrs 1	RECORE LEAKING RADIATOR	Recore leaking radiator as required. Removed leaking radiator and delivered to be recored. Removed sump and replaced leaking gasket. Tightened loose front engine mount. Refitted recored radiator and refitted the bonnet.	1097.5	299.06	3450	0	4846.56
120215-00	SVC00086	03/20/2012	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951	7706 hrs 1	RECORE LEAKING RADIATOR	LABOUR OMITTED FROM SERVICE INVOICE SVC00084322 RECORE RADIATOR	210	0	0	0	210
120222-00	SVC00084	02/28/2012	1H0368	IC-TRUCK FLE 186_INT	R	Tyres	1VT951	145255	TYRE REPAIRS - RUBAND 64770	Supply and fit tyres as required	0	1234	0	0	1234
120215-00	SVC00084	02/22/2012	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	7706H 145	S1 B SERVICE	SERVICE VEHICLE AS REQUIRED	399	255.38	0	3	657.38
120109-00	SVC00083	02/17/2012	1H0368	IC-TRUCK FLE 187_INT	R	Electrical	1VT951	N/A	REPAIRS TO FAN	REPAIRS TO FAN CHECK CODING FAN FAULT, REPLACE BURNT CONNECTORS, INSULATE AND SECURE WIRING AND RETEST OK sublets - St. Leonards Auto Electrical PO# 3606203	0	0	54.85	0	54.85
120210-00	SVC00083	02/14/2012	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951		REPAIR COOLANT LEAK	Steam cleaned engine and inspect al hoses, road test unit could not locate any problems.	147.5	0	0	0	147.5
120103-00	SVC00082	01/23/2012	1H0368	IC-TRUCK FLE 186_INT	R	Electrical	1VT951	140,130 KLI	REPAIRS TO CR/CONTROL,ENGINE	CHECK ENGINE SYSTEM MODIFY CRUISE CONTROL SYSTEM ON ENGIN REVS CHECK ENGIN REVS ON BOWL OPERATION	118	0	0	0	118

111205-00	SVC00081	12/22/2011	1H0368	IC-TRUCK FLE 186_INT	R	Engine	1VT951		REPAIR ENGINE OIL LEAK	tightened sump bolts tightened radiator hose clamps fix leak at water fitting tighten power steering hose at pump tighten lower shock absorber mounts fix headlight make new battery box anchor bolt steam clean engine replaced engine front mount front outside door lock replaced a/c compressor mount repaired and painted lhr and rr shock absorbers replaced	1149.5	568.72	0	0	1718.22
111205-00	SVC00081	12/13/2011	1H0368	IC-TRUCK FLE 186_INT	S	Service	1VT951	7437 hrs	S1 B SERVICE	S1 B SERVICE. Completed service as per service sheet.	354	266.79	0	2.7	623.49
111118-00	SVC00079	11/22/2011	1H0368	IC-TRUCK FLE 184_INT	R	Brake	1VT951	135368 KM	REPLACE U/S BRAKE BOOSTER	REMOVE AND REPLACE RHF DRIVE AXLE BOOSTER ASSEMBLY, ADJUST BRAKES. REPLACE BRAKE HOSE. WORK CARRIED OUT BY CJD EQUIPMENT	29.5	0	254.45	0	283.95
111118-00	SVC00079	11/22/2011	1H0368	IC-TRUCK FLE 184_INT	R	Engine	1VT951	135579 KM	INSPECT SQUEALING ENGINE BELTS	CHECKED & RE-TENSIONED BELT ONLY. WORK CARRIED OUT BY CJD EQUIPMENT	29.5	0	38	0	67.5
111025-00	SVC00078	11/04/2011	1H0368	IC-TRUCK FLE 184_INT	R	Bodywork	1VT951	133087 KM	REPAIR RHR MUDGUARD BRACKETS	CJD EQUIPMENT REPLACED MUDGUARD BRACKET	29.5	0	125.8	0	155.3
111025-00	SVC00078	11/02/2011	1H0368	IC-TRUCK FLE 184_INT	S	Service	1VT951	133087 KM	S1 B SERVICE	CJD EQUIPMENT TO CARRY OUT B SERVICE AS PER SCHEDULE	29.5	0	862.05	0	891.55
111025-00	SVC00078	11/02/2011	1H0368	IC-TRUCK FLE 184_INT	R	Engine	1VT951	133087 KM	REPAIR COOLANT LEAK	SUBLET CJD EQUIPMENT TO REPAIR COOLANT LEAK	29.5	0	170.4	0	199.9
111025-00	SVC00078	11/02/2011	1H0368	IC-TRUCK FLE 184_INT	R	Bodywork	1VT951	133087 KM	REPLACE U/S LHS MIRROR ASSY	SUBLET CJD EQUIPMENT TO REPLACE MIRROR	29.5	0	264.7	0	294.2
111101-00	SVC00074	11/02/2011	1H0368	IC-TRUCK FLE 184_INT	R	Starter Mot	1VT951	7122 HRS	REPLACE U/S STARTER MOTOR	SUBLET JLH AUTO ELECTRICAL TO REPLACE U/S STARTER MOTOR	14.75	0	1120	0	1134.75
111101-00	SVC00074	11/02/2011	1H0368	IC-TRUCK FLE 184_INT	R	Ancillary Ec	1VT951	7122 HRS	REPAIR AIR CONDITION SYSTEM	SUBLET JLH AUTO ELECTRICAL TO REPAIR THERMON FAN OPERATION	14.75	0	369.07	0	383.82
111025-00	SVC00078	10/31/2011	1H0368	IC-TRUCK FLE 184_INT	R	Suspensior	1VT951	133087 KM	REPLACE U/S RIDE HEIGHT VALVE	CJD EQUIPMENT TO REPLACE HEIGHT VALVE	29.5	0	248.65	0	278.15
111011-00	SVC00078	10/13/2011	1H0368	IC-TRUCK FLE 184_INT	R	Electrical	1VT951	7062 HRS	REPAIR REMOTE CONTROL PENDANT	SUBLET ST LEONARDS AUTO ELECTRICAL TO REPAIR REMOTE CONTROL PENDANT	14.75	0	396.6	0	411.35
111004-00	SVC00077	10/07/2011	1H0368	IC-TRUCK FLE 184_INT	R	Electrical	1VT951	131621 KM	REPLACE FAULTY COOLANT SENSOR	CJD EQUIPMENT TO REPLACE U/S COOLANT SENSOR	29.5	0	346.8	0	376.3
111004-00	SVC00077	10/07/2011	1H0368	IC-TRUCK FLE 184_INT	R	Suspensior	1VT951	132422 KM	REPLACE RIDE HEIGHT VALVE	CJD EQUIPMENT TO REPLACE RIDE HEIGHT ON UNIT	29.5	0	240.35	0	269.85
110817-00	SVC00075	08/23/2011	1H0368	IC-TRUCK FLE 184_INT	S	Service	1VT951	6798 HRS 1	S1 C SERVICE	SUBLET CJD EQUIPMENT TO CARRY OUT ANNUAL MAJOR SERVICE	14.75	0	1233.5	0	1248.25
110817-00	SVC00075	08/23/2011	1H0368	IC-TRUCK FLE 184_INT	S	Engine	1VT951	6798 HRS 1	Carry out top end tune	SUBLET CJD EQUIPMENT TO CARRY OUT TOP END TUNE	14.75	0	294	0	308.75
110628-00	SVC00072	06/30/2011	1H0188	CONCRETE TF 184_INT	R	Electrical	1VT951	167742 KM	REPAIR HEADLIGHT WIRING FAULT	REPAIR HEADLIGHT CONNECTION FAULT ON UNIT	14.75	0	54	0	68.75
110601-00	SVC00071	06/21/2011	1H0188	CONCRETE TF 184_INT	R	Brake	1VT951	125488 KM	REPLACE BLOWN BRAKE BOOSTER	REPLACE BLOWN BRAKE BOOSTER - REMOVE AND REPLACE LEAKING BRAKE BOOSTER, DIFFICULT TO UNDO DUE TO DRY CONCRETE ON NUTS, FITTINGS AND PINS, REPLACE AIR SUPPLY HOSE AND SUPPLY GLOBES AS REQUESTED.	14.75	0	398.31	0	413.06
110419-00	SVC00068	04/29/2011	1H0188	CONCRETE TF 184_INT	S	Service	1VT951	6171 HRS 1	S1 B SERVICE	CARRIED OUT "" SERVICE AS PER SCHEDULE. CHANGED OILS AND FILTERS. PLATE LIGHT ASSEMBLY AND RIGHT HAND REAR SLACK ADJUSTER AND CHECKED OTHER ITEMS	0	0	1027.15	0	1027.15
110419-00	SVC00068	04/29/2011	1H0188	CONCRETE TF 184_INT	R	Engine	1VT951	6171 HRS 1	REPAIR OVERHEATING FAULT	TRAVELLED TO ST LEONARDS. CHECKED AND REPAIRED OVERHEATING FAULT	0	0	442.26	0	442.26
110419-00	SVC00068	04/29/2011	1H0188	CONCRETE TF 184_INT	R	Suspensior	1VT951	6171 HRS 1	REPLACE R/H/F SHOCK ABSORBER	REPLACE RIGHT HAND FRONT DRIVE AXLE SHOCK ABSORBER	0	0	268.4	0	268.4
110419-00	SVC00068	04/29/2011	1H0188	CONCRETE TF 184_INT	R	Ancillary Ec	1VT951	6171 HRS 1	REPAIR AIR CONDITIONING FAULT	CHECKED AND RE-GAS AIR CON	0	0	356.6	0	356.6

110419-00	SVC00068	04/29/2011	1H0188	CONCRETE TF 184_INT	R	Trimming	1VT951	121274 KM	REPAIR SEAT VALVE FAULT	REMOVED AND REPLACED SEAT AIR VALVE	0	0	45	0	45
110419-00	SVC00067	04/29/2011	1H0188	CONCRETE TF 184_INT	R	Differential	1VT951	121274 KM	REPLACE DIFF CROWNWHEEL BOLTS	DRAINED OIL FROM FRONT DIFFERENTIAL AFTER METAL PARTICLES FOUND ON MAGNETIC PLUG. REMOVED DRIVESHAFT AND POWER DIVIDER. FOUND CROWNWHEEL BOLTS HAD BROKEN BUT OTHERWISE UNDAMAGED. DISASSEMBLED AND CLEANED COMPONENTS AND REASSEMBLED WITH NEW BOLTS. CHECKED PRELOADS AND REFILLED WITH OIL AND TESTED OK.	0	0	1724.65	0	1724.65
110419-00	SVC00068	04/29/2011	1H0188	CONCRETE TF 184_INT	R	Engine	1VT951	121274 KM	REPLACE LEAKING INJECTOR TUBE	REPLACED LEAKING INJECTOR TUBE AND CLEAN UNDER BONNET	0	0	248.8	0	248.8
110420-01	SVC00068	04/26/2011	1H0188	CONCRETE TF 122_INT	R	Tyres	1VT951	N/A	TYRE REPAIR RUBANDS 57995	TYRE REPAIR RUBANDS 57995	0	110	0	0	110
110414-00	SVC00067	04/19/2011	1H0188	CONCRETE TF 122_INT	R	Tyres	1VT951	N/A	TYRE REPAIR RUBANDS 57646	TYRE REPAIR RUBANDS 57646	0	580	0	0	580
110107-00	SVC00064	02/25/2011	1H0188	CONCRETE TF 184_INT	R	Electrical	1VT951		Repair indicator fault	REPLACED INDICATOR LGHT GLOBE AND FLASHER UNIT - PARTS ONLY INVOICE	0	32.87	0	0	32.87
110215-00	SVC00060	02/18/2011	1H0188	CONCRETE TF 122_INT	R	Tyres	1VT951	N/A	TYRE REPAIRS RUBAND 56778	TYRE REPAIRS RUBAND 56778	0	415	0	0	415
100906-00	9469	02/01/2011	1H0188	CONCRETE TF 181_INT	A	Bodywork	1VT951		CARRY OUT REPAIRS TO ROLLED OV		0	0	0	0	0
100906-00	SVC00060	02/01/2011	1H0188	CONCRETE TF 181_INT	A	Bodywork	1VT951		CARRY OUT REPAIRS TO ROLLED OV	Repair the truck after a roll over. The cab and associated parts were repaired as required. The frame group and colour of the truck was chanegd from the quick mix to hb colours,	16247.5	17602.07	1672.27	580	36101.84
110111-00	SVC00063	01/27/2011	1H0188	CONCRETE TF 186_INT	B	Differential	1VT951		REPAIR FAILED AXLE	removed axles , lifted up truck on hoist and removed tailshaft,(caps on uni joints were rusted on and took some removing . removed the diff and cleaned out the housing and centre. installed diff and lhs axle , replaced rhs axle with new , filled with oil and installed drive shaft. road tested vehicle ok .	442.5	583.08	0	0	1025.58
110111-00	SVC00063	01/18/2011	1H0188	CONCRETE TF 184_INT	B	Differential	1VT951	5838 HRS	CHECK FOR BROKEN REAR AXLE	TRAVELLED TO BRENT ST. CHECKED BROKEN AXEL. REMOVED REAR DRIVE AXELS AND COVER HUB	138	0	0	9	147
101130-00	SVC00062	12/31/2010	1H0188	CONCRETE TF 186_INT	R	Service	1VT951		AIR WILL NOT PUMP UP	Air failed to pump up. Found an air bag nost sealing off on the base and a minor air leak on the chassis rail.	742.75	263.52	0	0	1006.27
101122-00	SVC00062	12/22/2010	1H0188	CONCRETE TF 186_INT	R	Engine	1VT951	5779HRS 1	FIT UP BONNET SPRINGS	Replaced the bonnet strap, investigated the rattle near the passenger seat, the coolant was replaced and the high beam globe was replaced in the dash board, the right hand steer guard was replaced and an air leak along the chassis was repaired.	413	275.25	0	0	688.25
100818-00	SVC00060	11/18/2010	1H0188	CONCRETE TF 186_INT	R	Sundries	1VT951		REPAIR ACCIDENT DAMAGE	Repair the truck after a roll over. The truck was disassembled and all damaged parts were inspected, to keep cost's down only the must have required parts were installed. The radiator and intercooler were damaged in the roll over how ever they were straightened and showed no signs of leaking hence they were reused. The truck was reassembled as required and a wheel alignment carried out.	16160.25	18545.03	1415	1345	37465.28
101115-00	SVC00060	11/17/2010	1H0188	CONCRETE TF 122_INT	R	Tyres	1VT951	114350	TYRE REPAIRS RUBAND 54296	TYRE REPAIRS RUBAND 54296	0	1240	0	0	1240
101026-00	SVC00059	11/04/2010	1H0188	CONCRETE TF 186_INT	S	Service	1VT951	5758 hrs 1	S1 B SERVICE	SERVICE UNIT AS REQUIRED	413	185.23	0	2.7	600.93
100930-00	SVC00058	09/30/2010	1H0188	CONCRETE TF 122_INT	R	Tyres	1VT951	LOOSE	ALLOY WHEEL REPAIR RUBAND	PUNCTURE REPAIR RUBAND	0	125	0	0	125
100318-00	SVC00046	09/07/2010	1H0188	CONCRETE TF 189_INT	W	Suspensior	1VT951		REPLACE REAR SHOCK MOUNTS	REPLACE REAR SHOCK ABSORBER MOUNTS - PARTS POLICY ON UNIT 1VT951	0	0	235.2	0	235.2

100812-00	SVC000557	08/13/2010	1H0188	CONCRETE TF 184_INT	S	Service	1VT951	5696 HRS	SI B SERVICE	SI B SERVICE - CHANGE ENGINE OIL AND FILTERS, GREASE, CHECK FLUIDS, LIGHTS, BELTS, BATTERY TERMINALS, OPERATING SYSTEMS, AIR AND HYDRAULIC LINES, WHEELS, SUSPENSION, DRIVELINE AND GENERAL ITEMS.	14.75	0	623.45	0	638.2
100727-00	SVC000557	08/05/2010	1H0188	CONCRETE TF 122_INT	R	Tyres	1VT951	N/A	TYRE REPAIRS RUBAND 51514	TYRE REPAIRS RUBAND 51514	0	3240	0	0	3240
100628-00	SVC000537	07/06/2010	1H0188	CONCRETE TF 184_INT	R	Electrical	1VT951	110115KM	Replace batteries	CARRY OUT REPAIRS TO REPLACE BATTERIES	14.75	0	357.8	0	372.55
100226-00	SVC000487	04/26/2010	1H0188	CONCRETE TF 184_INT	R	Ancillary Ec	1VT951	96943 kms	REPAIR AIR CONDITIONER FAULT	AIR CON NOT WORKING. SUBLET REPAIR TO JLH AUTO ELECTRICAL FROM CJD EQUIPMENT	13.75	8.34	150	0	172.09
100415-00	SVC000487	04/26/2010	1H0188	CONCRETE TF 184_INT	S	Service	1VT951	102372 km	S1 B SERVICE	CARRY OUT BASIC SERVICE CHANGE ENGINE OIL, GREASE , FILTERS, CHECK FLUIDS- TOP UP COOLANT, CHECK & REPLACE FAN BELT, CHECK ALL OPERATING SYSTEMS & ADJUST, INSPECT WHEELS, SUSPENSION, DRIVELINE & OTHER	13.75	0	621.05	0	634.8
100226-00	SVC000457	03/09/2010	1H0188	CONCRETE TF 184_INT	R	Sundries	1VT951	96943	REPAIR L/H REAR WHEEL SEAL	19/02/10 L/H REAR WHEEL SEAL LEAKING - REMOVE AXLE, CLEAN UP, RE-SEAL & REASSEMBLE. LEAK AT PRESSURE VALVE FOR WATER TANK. REMOVED, RESEALED & REFITTED	13.75	0	173.7	0	187.45
100216-00	SVC000447	02/23/2010	1H0188	CONCRETE TF 184_INT	S	Service	1VT951	93102 kms	S1 B - SERVICE	27/01/10 - CARRY OUT BASIC SERVICE PERFORMED BY CJD EQUIPMENT	13.75	0	660.1	0	673.85
100212-00	SVC000447	02/16/2010	1H0188	CONCRETE TF 184_INT	R	Brake	1VT951	92850 kms	REPLACE L/H REAR BRAKE BOOSTER	20/01/10 - FOUND BROKEN SPRING IN L/H REAR BRAKE CHAMBER. REMOVED & REPLACED CHAMBER.	13.75	0	220.15	0	233.9
100115-00	SVC000437	01/29/2010	1H0188	CONCRETE TF 122_INT	R	Tyres	1VT951	NA	SECOND HAND TYRE	SECOND HAND TYRE	0	120	0	0	120
100129-00	SVC000437	01/29/2010	1H0188	CONCRETE TF 122_INT	R	Tyres	1VT951	929719	FIT CUSTOMER OWN PRODUCT	FIT CUSTOMER OWN PRODUCT	0	120	0	0	120
100104-00	SVC000427	01/20/2010	1H0188	CONCRETE TF 184_INT	R	Sundries	1VT951		REPLACE AIR REGULATOR VALVE	REPLAE AIR REGULATOR VALVE - PARTS ONLY INVOICE	0	94.6	0	0	94.6
091204-00	SVC000407	01/08/2010	1H0188	CONCRETE TF 122_INT	R	Tyres	1VT951	NA	ROAD SIDE SERVICE	ROAD SIDE SERVICE	0	215	0	0	215
091210-00	SVC000417	12/21/2009	1H0188	CONCRETE TF 184_INT	R	Engine	1VT951	88743 kms	FRONT CRANKSHAFT SEAL OIL LEAK	04/12/09 - FRONT CRANKSHAFT SEAL OIL LEAK REMOVED RADIATOR & BALANCER ECT REMOVED TIMING COVER REMOVED LEAKING SEAL CLEANED COVER FITTED NEW SEAL REFITTED COVER BALANCER & RADIATOR ECT. AND FILLED WITH COOLANT TEST OK.	13.75	0	743.55	0	757.3
091110-00	SVC000397	11/20/2009	1H0188	CONCRETE TF 184_INT	S	Service	1VT951	86383	S1 B SERVICE	CARRY OUT PM 2 SERVICE REPAIR TO BROKEN EXHAUST BRACKET REPLACE BLOWN MIRROR LIGHT REPAIRED TAIL LIGHT ASSY	13.75	0	854.51	0	868.26
090907-00	SVC000357	09/29/2009	1H0369	NOTHERN TRU 184_INT	R	Engine	1VT951	82243 KMS	REPAIR LEAKING MANIFOLD GASKET	REMEDY MANFOLD GASKET LEAK REMOVE EXHAUST MANIFOLD , REMOVE OLD GASKET AND CLEAN SURFACE , FIT NEW GASKET , RE-FIT MANFOLD AND TEST.	13.75	0	484.2	0	497.95
090813-00	SVC000347	08/18/2009	1H0369	NOTHERN TRU 184_INT	B	Trimming	1VT951	81669	FIT NEW OVERHEAD CONSOLE ETC	REMOVE OVERHEAD CONSOLE AND CHANGE PARTS FROM OLD TO NEW CONSOLE AND FIT UP , FIT NEW UHF.	13.75	0	1233.36	0	1247.11
090813-00	SVC000347	08/18/2009	1H0369	NOTHERN TRU 184_INT	S	Service	1VT951	81669KMS	S1 B SERVICE	CARRY OUT BASIC SERVICE , CHANGED ENGINE OIL , GREASE AND FILTERS , CHECKED FLUIDS , LIGHTS , CONTROLS , BELTS , OPERATING SYSTEMS , WHEELS , STEERING , SUPENSION , DRIVELINE AND REMOVE SIDE COVERS AND CHECK/LUBE LIVE DRIVE SHAFT.	13.75	0	697.84	0	711.59
090529-00	SVC000307	06/26/2009	1H0369	NOTHERN TRU 122_INT	R	Sundries	1VT951		S.HUDSON REQ 25650 MAY CHUTE L	S.HUDSON REQ 25650 MAY CHUTE LINERS	0	320	0	0	320
090526-00	SVC000307	06/04/2009	1H0369	NOTHERN TRU 184_INT	S	Service	1VT951	4020	S1 A SERVICE	CARRY OUT S1-A SERVICE AS PER SCHEDULE	13.75	0	485.35	0	499.1
090430-00	SVC000287	05/06/2009	1H0368	SOUTHERN TF 184_INT	R	Ancillary Ec	1VT951	75307	REPLACE AGIATOR HOLD DOWN BOLT	REPLACE AGITATOR TO CHASSIS TO HOLD DOWN BOLTS	13.75	0	64.32	0	78.07

090423-00	SVC00028	04/28/2009	1H0368	SOUTHERN TF 184_INT	S	Service	1VT951	72869	S1 B Service and repairs	CARRY OUT SERVICE AS PER SCHEDULE, CHECK OPERATING SYSTEMS, DRIVELINE AND ADJUST C-BELT, RESEAL LEFT HAND AIR TANK, CHECK HEATER CONTROLS AND TIGHTEN CABLES AND FITTINGS ON TACHO AND SPEEDO.	0	0	586.58	0	586.58
090107-00	SVC00023	01/28/2009	1H0368	SOUTHERN TF 184_INT	S	Service	1VT951	66343	S1B SERVICE.	CARRY OUT S1-B SERVICE AS PER SCHEDULE AND REPLACE ANY FAULTY FAN BELTS	12.5	0	1600.45	0	1612.95
081128-00	SVC00023	01/27/2009	1H0368	SOUTHERN TF 122_INT	R	Tyres	1VT951	63050	TYRE REPAIRS RUBAND 38720	TYRE REPAIRS RUBAND 38720	0	1130	0	0	1130
090107-00	SVC00022	01/13/2009	1H0368	SOUTHERN TF 184_INT	R	Brake	1VT951	63823	Replace leaking Brake Booster.	REPLACE LEAKING BRAKE BOOSTER AS REQUIRED	12.5	0	248.4	0	260.9
081113-00	SVC00022	01/12/2009	1H0368	SOUTHERN TF 186_INT	R	Electrical	1VT951		CHECK OPERATION OF UHF RADIO	Repair two way system.	50	0	45	0	95
081204-00	SVC00021	12/05/2008	1H0368	SOUTHERN TF 184_INT	R	Electrical	1VT951	3343 HRS	UHF UNIT FAULTY	TRAVELLED TO ST LEONARDS. CHECK OVER UHF SYSTEM AND FOUND UNIT FAULTY. FITTED TEMP UHF TX3200 TO UNIT. HAVE SENT ORIGINAL UHF OFF FOR REPAIRS	65	0	0	22.5	87.5
081031-00	SVC00019	11/05/2008	1H0368	SOUTHERN TF 184_INT	R	Clutch	1VT951	59885	Check and Adjust Clutch	CARRY OUT CLUTCH ADJUSTMENT AND CHECK OPERATION	0	0	42.5	15	57.5
080926-00	SVC00018	10/27/2008	1H0368	SOUTHERN TF 184_INT	S	Service	1VT951	3163hrs	S1 B SERVICE	CARRY OUT S1-B SERVICE AS PER SCHEDULE	536	326.73	0	182.7	1045.43
080611-00	SVC00013	08/11/2008	1H0368	SOUTHERN TF 184_INT	S	Service	1VT951	2595	S1 B SERVICE.	TRAVELLED TO BELL BAY AND CARRIED OUT SERVICE ON UNIT AS PER SCHEDULE	142.5	223.03	0	82.8	448.33
080611-00	SVC00015	08/11/2008	1H0368	SOUTHERN TF 184_INT	S	Service	1VT951	2595	S1 B SERVICE.	***LABOUR MISSED OFF SVC00013639***	82.5	0	0	0	82.5
080630-00	SVC00014	08/08/2008	1H0368	SOUTHERN TF 184_INT	R	Electrical	1VT951	49472	REPLACE BATTERIES & TEST.	TESTED BATTERIES, FOUND PROBLEM WITH ONE, FITTED NEW BATTERY	0	0	185.78	0	185.78
080502-00	SVC00009	05/02/2008	1H0368	SOUTHERN TF 122_INT	F	Tyres	1VT951		SUPPLY AND FIT 2 TYRES	1VT951	0	1113	0	0	1113
080416-01	SVC00009	04/29/2008	1H0368	SOUTHERN TF 184_INT	S	Service	1VT951	2280 HRS	S1 B SERVICE.	RUBAND TYRES SUPPLY AND FIT 2 TYRES TRAVELLED TO ST LEONARDS, CARRIED OUT SERVICE ON UTE AND REPAIRED LIGHT	205	178.23	0	120	503.23
080220-00	SVC00005	02/25/2008	1H0368	SOUTHERN TF 186_INT	S	Service	1VT951	1959 HOUF	B TYPE SERVICE	CARRY OUT SERVICE AS PER SCHEDULE, MINOR REPAIRS TO TRUCK	369.5	173.83	0	0	543.33
080201-00	SVC00005	02/18/2008	1H0368	SOUTHERN TF 186_INT	R	Electrical	1VT951		REPAIR PENDANT CONTROLS	Replace pendant control	45	1040	0	0	1085
071218-00	SVC00000	01/09/2008	1H0368	SOUTHERN TF 186_INT	S	Service	1VT951	1650hr	B TYPE SERVICE	odometer: 1650HR	265.63	214.25	0	2	481.88
080103-00	SVC00001	01/03/2008	1H0368	SOUTHERN TF 122	PROCU R	Tyres	1VT951		Puncture repair	Carry out service as requested. 1VT951 ODO - 27218	0	30	0	0	30
071206-00	SVC00000	12/10/2007	1H0368	SOUTHERN TF 184_INT	R	Hydraulic	1VT951		REPLACE RADIATOR HOSE JOINER	RUBAND TYRES PUNCTURE REPAIR TRAVELLED TO SUNDERLAND ST. REPLACE DAMAGED BOTTOM RADIATOR HOSE JOINER AND REFILL COOLANT	45	234.36	0	0	279.36
071113-00	SVC00001	11/13/2007	1H0368	SOUTHERN TF 184_INT	R	Electrical	1VT951	951	REPAIR HYDRAULIC THERMOSTATE	TRAVEL TO HBMI. REPAIR HYDRAULIC THERMOSTAT FAN, LOCATE STICKING RELAY	45	0	0	19.2	64.2

Applied filters:Posted_Date is on or after 01/01/1900Equipment_ID is 1VT951