

Service Job	Invoice No	Date	Customer Id	Customer Name	Cost Cent	Prob	Type of Call	Equip ID	Hrs	Kms	Job Description	Work Done	Labor Cost	Material Cost	Subcontractor Cost	Other Cost	Total Cost
98046		09/21/2026	1HM775HBG	ID - BEAUTY F	184G	R	Engine	1VT485	1578.0000	0	REPLACE BATTERIES (PARTS ON SERVICE JOB 97532		378	0	0	0	378
86592	104721	03/06/2026	1HM775HBG	ID - BEAUTY F	192G	R	Suspensor	1VT485	1565.0000	0	Inspect broken mount	START VEHICLE AND BUILT UP AIR. DROVE INTO SHED AND CARRIED OUT INSPECTION. TO NOTIFY WHEN LIST OF REPAIRS TO BE CARRIED OUT.	100	0	0	0	100
85604	104088	02/17/2026	1HM775HBG	ID - BEAUTY F	192G	R	Drive Line	1VT485	1565.0000	0	Broken drive shaft	REMOVE DRIVE SHAFT TO GET REPAIRED BY SUBLET - (DYNAMIC) TRAVEL TO SITE. FIT NEW AIR PRESSURE VALVE AND TESTED FOR BUILD UP OF AIR. FIT NEW DRIVE SHAFT AND TENSIONED UP CAP BOLTS.	803.5	2168.47	0	374	3345.97
84061	101806	01/20/2026	1HM775HBG	ID - BEAUTY F	192G	R	Brake	1VT485	0.0000	0	Replace booster and repair air leak	NOTES: MISSING BOLTS FOR TORQUE ROD & BUSHES NEED REPLACING. SUSPENSION EQUALISER ROD HANGER CRACKED AND NEEDS REPAIR. REMOVED OLD BOOSTER. FIT NEW BOOSTER & TESTED - ALL OK. REPAIRED AIR LEAK ON LINE TO 2ND BOOSTER.	480.5	1075.56	0	215	1771.06
80142	100531	10/30/2025	1HM775HBG	ID - BEAUTY F	192G	R	Suspensor	1VT485	0.0000	1406	Inspect suspension and air leak	REMOVED REAR SUSPENSION BEAM & HANGERS. ORDERED NEW PARTS. NEW PARTS SOURCED AND WELDING WORKS FABRICATED SOME PARTS. TRAVEL TO SITE AND REFIT SUSPENSION BEAM, SPRING AND HANGERS BACK INTO PLACE. MANITOU REQUIRED TO LIFT DIFFS TO GET HANGERS UNDER SPRINGS. BOLTED SPRINGS USING U-BOLTS. LOWERED AXLES BACK ONTO GROUND. FIT OUTER COVERS & PACKED BOTH SIDES WITH GREASE. REFIT RH GUARDS, ROAD TESTED OPERATION - ALL OK. TIGHTENED LOOSE AIR FITTING. NOTES: CRACKED SUSPENSION HANGER.	5032.75	4339.73	0	297	9669.48
78543	93940	09/26/2025	1HM775HBG	ID - BEAUTY F	192G	R	Electrical	1VT485	1405.0000	1410	Alternator not charging	FOUND ALTERNATOR NOT CHARGING IN LOW IDLE BUT VOLTAGE INCREASED WHEN ACCELERATED. ADJUSTED REUS - CHARGING ALL OPERATIONAL.	450	0	0	0	450

69633	85639	04/10/2025	1HM775HBG	ID - BEAUTY F192G	R	Sundries	1VT485	1410.0000	0	Water pipe on spray bar broken	INSPECT REAR PIPING ON WATERCART. FOUND FITTING HAD COME OUT OF "T" FITTING. REMOVED FITTINGS AND SOURCED NEW FITTINGS. TRAVEL TO SITE FIT NEW FITTINGS AND BOLTED ALL BACK TOGETHER. TEST NEEDS TO BE CARRIED OUT TO MAKE SURE NO LEAKS PRESENT.	932.5	582.71	0	170	1685.21
68807	82375	03/26/2025	1HM775HBG	ID - BEAUTY F192G	R	Sundries	1VT485	1267.0000	0	Inspect A/C, inspect rear diff	TRAVEL TO SITE. INSPECT AIRCON SYSTEM FOR PARTS. INSPECT HOLE IN REAR DIFF. BUSH IN REAR END NEEDS REPLACING - POSSIBLE BROKEN SUB FRAME.	143.28	0	0	130	273.28
67578	80486	03/04/2025	1HM775HBG	ID - BEAUTY F192G	R	Sundries	1VT485	1267.0000	0	supply coolant	SUPPLY COOLANT	45.05	440	0	0	485.05
67251	80492	02/26/2025	1HM775HBG	ID - BEAUTY F192G	R	Electrical	1VT485	1267.0000	0	Alternator not charging	DIAGNOSE ALTERNATOR ISSUE & SUPPLY	139.92	386.5	0	0	526.42
66864	80432	02/19/2025	1HM775HBG	ID - BEAUTY F192G	R	Electrical	1VT485	0.0000	757303	Fit fans to cab	MOUNT FAN IN CAB AND WIRE IN - TEST - ALL OK. INSPECT OIL LEAK COMING FROM FRONT OF MOTOR. INSPECT OIL LEAK COMING FROM REAR DIFF. NOTES: FRONT MAIN SEAL LEAKING	184.97	182.14	0	15	382.11
66133	80869	02/06/2025	1HM775HBG	ID - BEAUTY F192G	R	Bodywork	1VT485	1267.0000	0	Fumes entering cab	INSPECTED EXHAUST FOUND LARGE HOLE. REMOVED EXHAUST AND HAD NEW PIPE & FLEX HOSE FABRICATED. FIT NEW EXHAUST PIPE. TESTED FOR LEAKS - ALL OK.	324.89	529.04	0	15	868.93
65350	78570	01/23/2025	1HM775HBG	ID - BEAUTY F192G	R	Drive Line	1VT485	0.0000	1316	Broken axle oil cap	TRAVEL TO SITE. INCORRECT HUB CAP SUPPLIED. REPAIRED OLD HUB CAP & REFIT . FILLED WITH OIL. REMOVED OLD HUB CAP & REPLACED WITH NEW. SEALED HUB CAP & TOPPED UP OIL	536.36	225.68	0	151	913.04
63075	77538	12/16/2024	1HM775HBG	ID - BEAUTY F192G	S	Service Ear	1VT485	1267.0000	1174	Requires 250hr service	CARRIED OUT 250 HR SERVICE & CHECKS AS REQUIRED - ALL OK	183.38	0	0	165.14	348.52
60556	72872	10/31/2024	1HM775HBG	ID - BEAUTY F192G	R	Suspensior	1VT485	1174.0000	0	front hub leaking	HOLE IN DUMP PIPE RESEAL FILLER POINT ON FRONT HUB. TOP UP WITH GEAR OIL.	93.28	2.48	0	0.25	96.01
55913	67444	07/30/2024	1HM775HBG	ID - BEAUTY F184G	R	Electrical	1VT485	0.0000	0	3G/4G TRACKER REPLACEMENT	CARRY OUT 3G TO 4G TRACKER UPGRADE. ACTIVATE NEW TRACKER AND TEST OPERATION ALL OK	186.56	0	0	170	356.56
54679	65554	07/08/2024	1HM775HBG	ID - BEAUTY F192G	R	Engine	1VT485	753.1000	0	repairs to cracked housing (missed off service job 41977)		0	0	453.78	0	453.78
54626	66033	07/08/2024	1HM775HBG	ID - BEAUTY F192G	R	Electrical	1VT485	753.1000	0	replace isolator	REMOVE & REPLACE BATTERY ISOLATOR	93.28	46.25	0	5	144.53

41977	65240	11/01/2023	1HM775HBG	ID - BEAUTY F192G	R	Sundries	1VT485	753.1000	0	List of repairs	REMOVED & REPLACED DRIVE SHAFT UNI'S. REPLACED 2ND STEER SHOCKS,WASHERS,NUTS. REMOVED & STARTED WORK ON GUARDS. REPLACE 2 GUARDS & FLAPS. CARRIED OUT STERING HUBS SERVICE. REMOVED TORQUE RODS. REPLACE BUSHES & REFIT. REMOVED STEERING RAM FOR REPAIR. FOUND LEAKS ON FUEL PUMP & CAB TILT PUMP. REPAIR AS REQUIRED. REASSEMBLED AIR CLEANER HOUSING WITH NEW FILTER INTERNALLY + NEW WASHERS, NUTS FOR MOUNT & SEAL. TIGHTENED SNORKEL CLAMPS. CUT & REMOUNTED IN NEW MOUNT BRACKETS. DRAINED AND REPLACED DIFF, ENGINE & TRANSMISSION OILS. LEAK FIXED IN CAB TILT PUMP. REPLACED SEALS & RINGS. REPLACED FUEL HOSES THAT WERE CHAFFED. REMOVED FUEL PUMP , RESEALED & FITTED. CHECK FOR LEAKS - OK. TIDY UP WIRING ON ENGINE BAY. FITTED NEW BALL JOINT ENDS TO STEERING	16734.5	6818.39	0	667.67	24220.56
26174	32432	02/16/2023	1HM775HBG	ID - BEAUTY F192G	R	Engine	1VT485	0.0000	0	List Of Works	QUANTITY & REFIT LIST OF REPAIRS TRY TO START TRUCK WOULD CRANK BUT NO START CHECKED BATTERY'S AND CHECKED AIR CLEANERS TRY STARTING OFF BRAKE CLEAN BUT STILL WOULDNT START CRACKED INJECTORS OFF BT GOT NO FUEL TOOK FUEL FILTERS OFF AND PRESSURISED TANK STILL NO FUEL TOOK FUEL LINE OFF AT TANK AND PRESSURISED CARRIED OUT FURTHER TESTING AND INSPECTIONS FOR FAULT, PASS ON FINDINGS TO WORKSHOP MANAGER	2251.71	98	0	100	2449.71
25738	30011	02/07/2023	1HM775HBG	ID - BEAUTY F121G	R	Sundries	1VT485	753.1000	0	SPARE PARTS		0	1130	0	0	1130
24425	32431	01/04/2023	1HM775HBG	ID - BEAUTY F192G	R	Engine	1VT485	753.1000	0	Supply Degreaser	PARTS ONLY - SUPPLY DEGREASER	0	161	0	0	161
20450	23718	09/28/2022	1HM775HBG	ID - BEAUTY F192G	R	Engine	1VT485	753.1000	0	ATTEND TO STUCK THROTTLE	HRS: 984 OD: 753.10 TRAVEL TO BPS FOUND NO RETURN SPRING ON THROTTLE LIKAGE FITTED SPRING TO THROTTLE LIKAGE TESTED OK	324.53	36	0	88.75	449.28

18483	24780	08/17/2022	1HM775HBG	ID - BEAUTY F192G	R	Sundries	1VT485	0.0000	0	ENGINE MOUNTS	REMOVED BRACKET DRILLED HOLE INTO BROKEN BOLT HEADED UP BOLT, STILL WOUND NOT COME OUT REFITTED ENGINE MOUNT BRACKET REMOVED GEARBOX CLEANED GEARBOX WHILE OUT RE-TAPPED THREAD IN TOUNGE CONVERTOR FILLED UP GEAR BOX FIT GEARBOX BACK INTO TRUCK TEST DRIVEN BY JERROD RE-MOUNTED TAIL SHAFT TOPPED UP HYD OIL	2199.66	292.05	0	75	2566.71
18220	22157	08/11/2022	1HM775HBG	ID - BEAUTY F192G	R	Sundries	1VT485	0.0000	0	CHECK OIL LEAK	FOUND OIL LEAK ENGINE RESEALDED & FIXED	93.44	0	0	150	243.44
16411	19684	07/04/2022	1HM775HBG	ID - BEAUTY F192G	R	Sundries	1VT485	753.1000	0	RHS SHOCK REPLACEMENT AND WELD MOUNT	HRS: 954 REMOVED MUDGUARD FROM TRUCK TO GAIN ACCESS TO MOUNT REMOVED BROKEN BOLT FROM BOUNT & CHASSIS REMOVED DAMAGED SHOCKY BOLTED DAMAGED SHOCKY BOLTED MOUNT UP WITH NEW BOLT REFITTED MUDGUARD	214.09	0	0	103.25	317.34
14549	16892	05/23/2022	1HM775HBG	ID - BEAUTY F192G	R	Sundries	1VT485	0.0000	0	STOP CABLE REPAIRS	HRS: 9399 STOP CABLE REPAIRS INSPECTED NO STOP ISSUE FOUND CABLE NOT SECURED SECURED CABLE SO STOP CABLE WORKS ALL OK	128.13	0	0	79	207.13
13100	15088	04/14/2022	1HM775HBG	ID - BEAUTY F186G	R	Tyres	1VT485	0.0000	0	R/OUT X2 STEER, X2 DRIVE, BAL X2, DIS X4		0	266	0	0	266
11339	17052	03/07/2022	1HM775HBG	ID - BEAUTY F192G	R	Engine	1VT485	753.1000	0	ATTEND TO STICKING THROTTLE	OD: 753,10 FUEL PUMP THROTTLE STICKING REMOVED & REPAIRED FUEL PUMP TESTED OK	3498.59	8049.58	0	195	11743.17
10519	12391	02/17/2022	1HM775HBG	ID - BEAUTY F192G	R	Bodywork	1VT485	753.1000	0	REPAIR SEAT AND GENERAL REPAIRS	HRS: 923 OD: 757303 REMOVED AND REPLACED DAMAGED SEAT FITTED SEAT COVER TO PASSENGER SEAT FOUND SHOCKY SLASH MOUNT FITTING MISSING TWO BOLTS FITTED NEW BOLTS REPLACED BOOSTER AIRLINE WITH JOINER IN IT	2724.77	0	0	122.5	2847.27

10275	11654	02/10/2022	1HM775HBG	ID - BEAUTY F192G	R	Brake	1VT485	753.1000	0	FIX AIR LEAK CHASSIS AREA	INSPECT REPORTED AIR LEAK AT REAR OF TRUCK FOUND DAGED SECTION OF HOSES. CUT OU AND REPLACE REPAIRED DAMAGED ARLINE GOING TO A BOOSTER	213.55	0	0	92.5	306.05
9269	10607	01/20/2022	1HM775HBG	ID - BEAUTY F192G	R	Brake	1VT485	753.1000	0	POOR BRAKING INSPECT AND REPAIR	1VT485 HRS: 892 OD: 753.10	540.46	90.91	0	27.05	658.42
8039	9056	12/13/2021	1HM775HBG	ID - BEAUTY F186G	INT-R	Service Trai	1VT485	0.0000	0	S1 B SERVICE	POOR BRAKING INSPECT & REPAIR FUEL FILTER FF5348 WATER SEPARATOR FS1219 OIL FILTER LF3379 AIR CON BELT 13A1055	298.97	306.29	0	14.9	620.16
7548	8267	12/01/2021	1HM775HBG	ID - BEAUTY F192G	R	Sundries	1VT485	753.1000	0	REPAIRS TO PTO ISSUE	WEBSTER FILTER KIT - 57GC2136C FUEL FILTER - 483GB441 1VT485 OD: 753.10	341.68	0	0	162	503.68
											REPAIRS TO PTO ISSUE					
											FOUND COUPLERS TO BE OUT OF ALIGMENT RE ALIGNED TESTED OK					
5897	5941	10/20/2021	1HM775HBG	ID - BEAUTY F192G	R	Sundries	1VT485	753.1000	0	WATER LEAKS AT TANK	1VT485 WATER LEAKS IN TANK	170.84	0	0	202.54	373.38
4371	4627	09/10/2021	1HM775HBG	ID - BEAUTY F192G	R	Sundries	1VT485	753.1000	0	REPAIR AIR LINES TO SPRAYS	1VT485 REPAIR AIR LINES TO SPRAYS	190.03	0	0	174	364.03
2045	2823	07/16/2021	1HM775HBG	ID - BEAUTY F192G	R	Electrical	1VT485	753.1000	0	Replace starter motor		2579.58	929.1	719.55	50	4408.23

210312-00 SVC00256: 07/15/2021 1H0775 BEAUTY POIN 192_INT R Brake 1VT485 REPAIRS										REPAIRS	8982.7	5516.32	0	50	14549.02
										REPAIRS TO BRAKES					
										HYD OIL LEAKS					
										TRANS OIL LEAK					
										LOW PUMP PRESSURE					
										AIR LEAKS					
										WATER SPRAYS					
										INSPECTED BRAKE BOOSTERS AND SLACK					
										ADJUSTERS, HAD FOUND POS 6 SLACK					
										ADJUSTER WAS SEIZED INTERNALLY. A NEW					
										SLACK WAS FITTED, ALL BRAKES ADJUSTED.					
										WATER PUMP ON TRUCK WAS REMOVED DUE					
										TO BEING DAMAGED INTERNALLY.					
										NEW WATER PUMP WAS ORDERED, TOOK A					
										COUPLE OF MONTHS TO TURN UP.					
										BOLTED NEW WATER PUMP ONTO TRUCK					
										WITH A BIGGER Y FILTER AND PLUMBED IN					
										REMOVED PIPING AND WELDED UP FITTINGS					
										THAT HAD BEEN LEAKING. REFITTED PIPING.					
										CUT HOLE IN MAIN PIPING AT REAR OF TRUCK					
										TO FIT NEW SPRAY UNTIL SETUP.					
										GOT 3 METRE LENGTH OF 4 INCH PIPING					
										WELDED 90 DEGREE FITTING ONE END AND					
										WELDED FLANGE ONTO THE OTHERSIDE.					
										WELDED 90 DEGREE ELBOW WITH FLANHE					
										ONTO TRUCK. ORDERED BUTTERFLY VALVE					
										TO GO BETWEEN FLANGES	784.77	219.37	0	39.24	1043.38
1298	1276	06/29/2021	1HM775HBG	ID - BEAUTY F192G	R	Engine	1VT485	753.1000	0	AIR START FAILURE					

210112-00 SVC00258: 03/25/2021	1H0775	BEAUTY POIN 192_INT	R	Steering	1VT485		POWER STEER ISSUES	POWER STEER ISSUES	1284.35	154.56	0	467.5	1906.41
								ATTEND SITE @ BPSP FOR POWER STEERING FAULT. FOUND NO DIPSTICK/CAP OVER RESERVOIR AND FLUID HAD TURNED TO WHITE SLUDGE DUE TO WATER INGRESS. DRAIN RESERVOIR & HOSES. REMOVED FILTER ELEMENT & CLEAN WITH BRAKE CLEAN AND COMPRESSED AIR. CLEAN OUT SLUDGE FROM RESERVOIR AND FILL WITH OIL. REMOVED RETURN HOSE AND PUT IN BUCKET. OVERFILL SYSTEM WITH CLEAN OIL AFTER BLOCKING OFF PORT IN TANK. RUN TRUCK & FILL RESEVOIR AS SYSTEM RUNS. SHUT DOWN AND CHANGE RETURN HOSE WITH CASE DRAIN & REPEAT PROCESS. REFIT OLD FILTER & CONTINUE TO RUN SYSTEM, TURNING WHEELS TO FLUSH ENTIRE SYSTEM. AGAIN DRAINED RESERVOIR & REFILL. NOW OUT OF OIL. TEST STEERING - IS NOW WORKING OK - OIL IS STILL DARK MILKY COLOUR. RECOMMEND ANOTHER FLUSH WITH 20L OIL AND REPLACE FILTER IN 2-3 DAYS TIME.					
210225-00 SVC00260: 03/04/2021	1H0775	BEAUTY POIN 192_INT	R	Ancillary Ec	1VT485		CLEAN UNIT FOR INSPECTION	NOTE: SPENT 2 HRS TRYING TO LOCATE PARTS IN TOWN BEFORE TRAVELLING TO SITE. ALSO CLEAN UNIT FOR INSPECTION	563.96	0	0	28.2	592.16
201216-00 SVC00257: 02/23/2021	1H0775	BEAUTY POIN 192_INT	R	Ancillary Ec	1VT485		INSPECT FAULTS	THOROUGHLY CLEANED THE BODY - AWAITING DIRECTION FROM C. BEAMS TRAVEL TO BEAUTY POINT, CHECK OVER TRUCK FOR LIST OF FAULTS	72.7	0	0	125	197.7
201113-00 SVC00255: 01/06/2021	1H0775	BEAUTY POIN 192_INT	R	Engine	1VT485		BREAKDOWN NO FUEL	TRAVELLED TO SITE INSPECTED TRUCK AND DIAGNOSED ISSUE - FUEL ISSUE TRAVELLED TO PICK UP PARTS REQUIRED TRAVELLED BACK TO SITE OF TRUCK REPAIRED FITTING LIFT PUMP - FUEL LINES - FILTER HOUSINGS REPAIRED HANDRAIL LIFT AIR SUPPLY LINE TESTED - ALL OK AT TIME OPF TESTING TRAVELLED BACK TO WORKSHOP	879.13	185.91	0	275	1340.04
200909-00 SVC00252: 09/16/2020	1H0775	BEAUTY POIN 192_INT	R	Engine	1VT485	585 HR	START UNIT- NO AIR	TRAVEL TO BEAUTY POINT, REPLACED AIR HOSE	145.4	0	0	125	270.4
200724-00 SVC00249: 08/19/2020	1H0775	BEAUTY POIN 192_INT	R	Ancillary Ec	1VT485		WATER PUMP PRESSURE	TRAVEL TO BEAUTY POINT. INSPECT WATER PUMP PRESSURE AT SPRAYS. CHECK SPRAYS AND FILTER ALL OK. FOUND RETURN BUTTERFLY IN OPEN POSITION, TURN OFF, ALL TEST OK.	157.8	0	0	75	232.8

200706-00 SVC00248	07/16/2020	1H0345	IC - HBMI - Q 192_INT	R	Electrical	1VT485	577	JUMP START	TRIED JUMP STARTING TRUCK, TRIED CRACKING INJECTOR LINES OFF AND PUMPING AIR INTO THE FUEL TANK. TRUCK STARTED.	163.4	0	0	0	163.4
200325-00 SVC00243	07/15/2020	1H0345	IC - HBMI - Q 192_INT	R	Bodywork	1VT485	565 HRS	REPAIRS AS PER J HAZELL	GREASED WHOLE TRUCK AND FIXED AIR LEAKS, AIR LEAKING VALVE ON BOTTOM OF TANK, BLANKED OFF TO STOP LEAKING, IDENTIFY AIRLINES NOT CONNECTED TO ANYTHING UNDER THE TRUCK AND REMOVE IF NOT NEEDED, FOLLOW ELCTRICAL LINES AND IF NOT CONNECTED THEN REMOVED ALSO, LEFT OVER AIR LINES AND ELECTRICAL LINES THAT WERE STILL CONNECTED WERE CLEANED UP AND CABLE TIED INTO PLACE, PLUMB UP AND FIT FRONT SPRAY BAR, FIT UP NEW BUTTERFLY VALVE AND SWITCHES, FIT 3" WATER HOSE TO REAR OF TRUCK AND PLUMB UP AND SECURE IN PLACE, TIDY UP UNDER DASH AND REWIRED PTO SWITCH.	2791.48	3136.11	90	0	6017.59
200611-00 SVC00247	06/29/2020	1H0345	IC - HBMI - Q 192_INT	R	Ancillary Ec	1VT485	577	LOOK AT FANS	TRAVEL TO BEAUTY POINT, INSPECT REPORTED BLOCKED FANS AT REAR, PULLED THEM APART AND UPON INSPECTION THEY WERE NOT BLOCKED, WILL HAVE TO LOOK INTO FURTHER WHEN UNIT AVAILABLE.	145.4	0	0	62.5	207.9
200521-00 SVC00246	05/28/2020	1H0345	IC - HBMI - Q 192_INT	R	Engine	1VT485	573	NO START	TRAVEL TO BEAUTY POINT, CHECK TRUCK NOT STARTING, CONNECT AIR SUPPLY AND BUILD UP AIR PRESSURE, START RUN AND TEST OK.	145.4	0	0	125	270.4
191016-00 SVC00237	02/04/2020	1H0345	IC - HBMI - Q 192_INT	R	Ancillary Ec	1VT485		REPAIR PUMP HOSING	PUMP ON WATER TRUCK HAD LOST SUCTION, DIAGNOSED FAILURE TO BEING THAT SCREEN WAS MISSING IN Y FILTER, ALLOWING ROCKS INTO PUMP AND DAMAGING HOUSING, REMOVED OLD PUMP FROM WATER TRUCK, REMOVED ALL PARTS FROM PUMP NEEDED FOR NEW PUMP AND FITTED THEM, BOLTED NEW PUMP UP TO TRUCK, FITTED N Y FILTER AND LENGTH OF HOSE, DRIVE WATER TRUCK TO WATER SUPPLY PRIMED UP PUMP AND TESTED PUMP AFTER ABOUT 5/10 MINUTES IT STOPPED PUMPING AT ITS FULL POTENTIAL DUE TO THE SCREEN IN THE Y FILTER BEING TO FINE AND BLOCKINGUP TO EASILY REMOVED FILTER AND PUT IN A MORE COURSE FILTER, TESTED PUMP AND ALL WORKING OK, TEST SPRAYERS HOSE BLOW OUT AND REPLACED WITH STRONGER HOSE, PIRTEK SUPPLY HYD HOSE FOR WATERCART AT BEAUTY POINT SAND PIT AS REQUESTED BY DALLAS.	1555.78	4579.48	0	1028.19	7163.45

191127-00 SVC00236	01/31/2020	1H0345	IC - HBMI - Q 192_INT	R	Hydraulic	1VT485		PIRTEK TO REPAIR PUMP	FLOW TEST CIRCUIT, ORGANISE PUMP TO HANDLE JOB, FABRICATE BRACKET, FIT UP PUMP TO TRUCK AND SET RELIEF, CARRIED OUT BY PIRTEK LAUNCESTON	0	27.12	3642.85	0	3669.97
191129-00 SVC00237	12/17/2019	1H0345	IC - HBMI - Q 192_INT	S	Service	1VT485	512	S1A SERVICE	CARRIED OUT SERVICE AS PER SHEET	207.25	233.05	0	10	450.3
191108-00 SVC00235	11/27/2019	1H0345	IC - HBMI - Q 192_INT	R	Ancillary Ec	1VT485		SPRAY BAR NOT WORKING	LOOK FOR CAUSE OF FAILURE OF PUMP. FOUND ISSUE TO BE BROKEN PUMP COUPLING. REMOVED PUMP AND COUPLINGS. FOT NEW COUPLING FROM TAS BEARING & CHAIN. REPLACE BROKEN COUPLING WITH NEW. FIT NEW SPRAY BAR TO REAR. ATTEMPT TO HOT WIRE TRUCK DUE TO OPERATOR LOSING KEYS. TEST ALL OK.	1679.26	301.55	0	50	2030.81
191119-00 SVC00236	11/27/2019	1H0345	IC - HBMI - Q 192_INT	R	Electrical	1VT485	442 hr	REPLACE IGN SWITCH- KEY STOLEN	TRAVEL TO BEAUTY POINT, REPLACED IGNITION BARREL AFTER KEY HAD BEEN STOLEN.	109.05	89	0	150	348.05
191030-00 SVC00235	11/04/2019	1H0345	IC - HBMI - Q 192_INT	R	Engine	1VT485		FUEL LEAK AT FUEL PUMP	ATTEND TO HAZELL BROS SITE IN BEAUTY POINT, REMOVE REMAKE AND REPLACE FUEL HOSE ON WATER TANKER, TEST RAN TRUCK WITH NO LEAKS PRESENT. WORK CARRIED OUT BY PIRTEK LAUNCESTON.	0	0	365.52	0	365.52
191007-00 SVC00234	10/22/2019	1H0345	IC - HBMI - Q 192_INT	R	Hydraulic	1VT485		LEAK AT PTO	INSPECT UNDER TRUCK AND FOUND BUNG UNDERNEATH WAS LEAKING, CHECKED BUNG WITH BAR AND BUNG WAS STILL TIGHT, BUNG NEEDS RESEALING.	61.45	0	0	0	61.45
191008-00 SVC00234	10/22/2019	1H0345	IC - HBMI - Q 192_INT	R	Differential	1VT485		AIR LEAK TO POWER DIVIDER	FOUND AIR LEAK GOING TO POWER DIVIDER, CUT OUT SECTION OF AIR LINE WITH HOLES RUBBED THROUGH THEM AND JOINED LINE BACK TOGETHER WITH JOINER, CABLE TIED LINES UP SO THEY WOULDN'T RUB ANY MORE, STARTED TRUCK AND TEST OK.	157.5	78	0	10	245.5
190916-00 SVC00232	09/30/2019	1H0345	IC - HBMI - Q 192_INT	R	Engine	1VT485		NO START	FIT NEW DRAIN VALVE AND RUN SUPPLY TO AIRSTART TANK.	227.4	44.02	0	8.5	279.92
190926-00 SVC00233	09/30/2019	1H0345	IC - HBMI - Q 192_INT	R	Brake	1VT485		Brake repairs	REPAIR 2 X AIRLEAKS. FOUND HOSE FROM CHASSIS TO QR SPLIT, TAKE TO PIRTEK TO FAB NEW HOSE, RETURN AND FIT HOSE TO TRUCK, BUILD UP AIR AND TEST ALL GOOD.	379	0	177.82	19	575.82
190917-00 SVC00233	09/27/2019	1H0345	IC - HBMI - Q 192_INT	R	Ancillary Ec	1VT485	423HRS	SUPPLY FOOT VALVE AND HOSE	SUPPLY FOOT VALVE AND HOSE AND DELIVER TO SITE.	151.6	739.22	0	132.5	1023.32
190923-00 SVC00233	09/27/2019	1H0345	IC - HBMI - Q 184_INT	R	Sundries	1VT485		REPAIR PTO AIR LEAK	CHECK PTO NOT ENGAGING, FOUND AIR LINE LEAKING TO CONTROL . REPAIRED AIR LEAK AND OPERATED OK	211.75	0	0	125	336.75
190913-00 SVC00232	09/17/2019	1H0345	IC - HBMI - Q 184_INT	R	Transmissio	1VT485		CHANGE TRANSMISSION OIL	TRAVEL BEAUTY POINT AND RETURN TRAVEL TO HBMI, CHECK TRANSMISSION OIL LEVEL, HAD TO CHANGE OIL BECAUSE OF CONTAMINATION WITH WATER	81.7	91	0	37.5	210.2

190418-00 SVC00224	05/10/2019	1H0103	ID - EARTHMO	184_INT	R	Electrical	1VT485		CHECK PTO FAULT AND FIT BATTER	1VT485 - 306 HRS	542.3	409.16	0	85	1036.46
										TRAVEL TO HBMI, INSPECT PTO FAULT, TRACE FAULT BACK INTO CAB, FOUND TO HAVE A FAULTY AIR SOLENOID, ORDER PARTS. TRAVEL BACK TO HBMI WHEN PARTS ARRIVED, FIT NEW SOLENOID AND TEST OPERATION, ALL OK, FIT LOCKABLE BATTERY ISOLATOR, TRAVEL BACK TO WORKSHOP.					
190319-00 SVC00223	03/28/2019	1H0103	ID - EARTHMO	184_INT	R	Sundries	1VT485		SUPPLY PUMP UP HOSE	SUPPLY PUMP UP HOSE AS REQUESTED	0	68.83	0	0	68.83
190121-00 SVC00218	03/05/2019	1H0103	ID - EARTHMO	184_INT	S	Service	1VT485	8828 HR	S1 B SERVICE	TRAVELLED TO HBMI	460.6	297.99	0	98	856.59
										CARRIED OUT THE REQUIRED SERVICE AND SAFETY INSPECTIONS AS PER SERVICE SHEET					
190228-00 SVC00221	03/05/2019	1H0103	ID - EARTHMO	184_INT	R	Engine	1VT485		BLEED FUEL SYSTEM AND START	BLEED FUEL SYSTEM AND START AFTER UNIT RAN OUT OF FUEL. FOUND FAULY FUEL LIFT PUMP. REMOVE AND REPLACE LIFT PUMP REMOVE FILTERS AND FILL WITH FUEL, REMOVE FUEL LINES AND BLOW OUT WITH AIR TO REMOVE RUBBISH SUCKED UP FROM BOTTOM OF FUEL TANK . BLEED FUEL SYSTEM AGAIN AND START TRAVEL HBMI AND RETURN	854.5	41.13	0	115	1010.63
190205-00 SVC00220	02/22/2019	1H0103	ID - EARTHMO	184_INT	R	Electrical	1VT485		CHECK SHORT CIRCUIT IN IGNITIO	CHECK SHORT CIRCUIT IN IGNITION CHECK IGNITION NOT WORKING, FOUND CIRCUIT BREAKER BLOWN. CHECK AND FOUND SHORT CIRCUIT IN GEAR SELECTOR WIRING. , REPAIRED WIRING AND TESTED OK. CHECK REVERSE ALARM NOT WORKING, REPAIRED BAD CONNECTION AT REVERSE LIGHT SWITCH . TESTED OK TRAVEL HBMI	326.8	0	0	52.5	379.3
190204-00 SVC00219	02/12/2019	1H0103	ID - EARTHMO	121_INT	R	Tyres	1VT485		295/80/22.5 BYS98 STRAK X 1 +	295/80/22.5 BYS98 STRAK X 1 + CALLOUT X 1.5 + DISPOSAL X 1 CARRIED OUT BY RUBAND 51338	0	879.5	295	0	1174.5
190118-00 SVC00218	01/30/2019	1H0103	ID - EARTHMO	184_INT	R	Air Con	1VT485		CHECK AIR CON SYSTEM	CHECK AIR CON SYSTEM NOT WORKING, FOUND SYSTEM TO BE OPERATING OK BUT NO AIR FLOW TO DRIVER DUE TO DESIGN OF DASH. FIT FAN ON DASH AND WIRE UP TO ALLOW AIR FLOW TO REACH OPERATOR. TESTED OK	204.25	141	0	10	355.25
190115-00 SVC00218	01/16/2019	1H0103	ID - EARTHMO	121_INT	R	Tyres	1VT485		295/80R22.5 S/TRAK BYS 98 X +	295/80R22.5 S/TRAK BYS 98 X + DISPOSAL X 1 + SERVICE CALL X1.5 RUBAND 51332	0	456.5	0	0	456.5
181217-00 SVC00217	12/18/2018	1H0103	ID - EARTHMO	184_INT	R	Air Con	1VT485		CHECK AIRCON SYSTEM	CHECK AIRCON SYSTEM NOT WORKING, FOUND HEATER FAN NOT TURNING ON. REPAIRED CONNECTIONS ON FAN SWITCH AND TESTED OK TRAVEL HBMI	81.7	0	0	0	81.7

181130-00	SVC00216	12/12/2018	1H0103	ID - EARTHMO	186_INT	R	Electrical	1VT485	8586hrs	JUMP START AND CHECK OVER	Checked lights on truck. Indicators not working. Checked fuses - OK. Checked switch, switch working but shorting out to horn circuit. Looked for flasher unit, no flasher found. Removed dash/interior panels. Fitted flasher, wired in to switch. bridged wiring from switch to relays, horn still coming on. Found new power source, wired to indicators, indicators working. Truck lost ignition, Bus bar arking/throwing sparks. Disconnected battery, removed bus bar, contacts heavily corroded, coated board with contact cleaner and cleaned corrosion off. Re-fitted, still no ignition. Removed again, pulled whole bar out, found ignition wire wasn't locking into its spot. Cut off terminal, crimped on new and re-fitted parts. Fault repaired.	822.15	34.19	0	40	896.34
181114-00	SVC00215	11/21/2018	1H0103	ID - EARTHMO	186_INT	R	Engine	1VT485		STARTER VALVE FAULT	STARTER VALVE FAULT. CHECKED FOR LEAKS ON THE AIR STARTER CIRCUIT. TRACED TO STARTER VALVE. REMOVED THE AIR TANK AND REMOVED THE STARTER VALVE. PICKED UP NEW ORINGS AND FITTED. TESTED FOR LEAKS AND REFITTED THE TANK.	436.21	6.15	0	21	463.36
181121-00	SVC00215	11/21/2018	1H0103	ID - EARTHMO	121_INT	R	Tyres	1VT485	757303	Puncture repair	PUNCTURE REPAIR + VALVE + FIT COP X 1 CARRIED OUT BY RUBAND	0	0	90.5	0	90.5
181109-00	SVC00215	11/14/2018	1H0103	ID - EARTHMO	184_INT	R	Sundries	1VT485	8160 hrs	PUMP UP WITH AIR AND START	PUMP UP WITH AIR AND START UNIT IN BACK YARD AS REQUESTED	39.45	0	0	0	39.45
181022-00	SVC00214	11/06/2018	1H0103	ID - EARTHMO	186_INT	R	Electrical	1VT485		CHECK CHARGE RATE	Go to yard, Checked charge rate, not enough air to start truck, Returned with service truck, supply air. Started and tested charge rate, charging ok, gauge in dash faulty.	218.1	50	0	0	268.1

180919-00 SVC00212	10/22/2018	1H0103	ID - EARTHMO	186_INT	R	Sundries	1VT485	WATER PUMP OPERATION	WATER PUMP OPERATION. CHECKED PUMP OPERATION AND FOUND PRESSURE AT THE FANS. CHECKED FLOW CONTROL VALVE OPERATION.OK. CHECKED FOR RESTRICTIONS TO THE WATER PUMP ON THE SUCTION SIDE.OK REMOVED THE WATER PUMP AND DISASSEMBLED.OK. REDUCED CLEARANCE BETWEEN THE IMPELLER AND THE HOUSING AND REASSEMBLED. CHECKED ROTATION SPEED. REMOVED FLOW DIVIDER AND RETESTED. ORDERED SMALLER CAPACITY MOTOR TO DRIVE THE PUMP FASTER. FITTED AND CHECKED OPERATION.WORKS WELL. NOTE THE DRIBBLE BAR WILL NOW HAVE TOO MUCH FLOW FOR PROPPER USE.	1374.53	605.49	0	50	2030.02
180718-00 SVC00208	10/16/2018	1H0103	ID - EARTHMO	186_INT	R	Brake	1VT485	Repair air leaks	REPAIR AIR LEAKS CHECKED FOR AIR LEAKS.REPLACED LEAKING BRAKE BOOSTER. REPLACED LEAKING HEATER HOSE INTO CAB. REPLACED LEAKING FITTINGS UNDER THE DASH AND SIDE PANEL. PLACED DECALS ON SWITCHED FOR THE SPRAY UNIT. REPLACED AIR LINES CHAFFED ON THE CHASSIS IUNDER THE WATER TANK. REPLACED CHAFFED AIR HOSES UNDER THE CAB. REPAIRED CAB LOCK.	1641.83	692.31	0	50	2384.14
180912-00 SVC00212	10/02/2018	1H0103	ID - EARTHMO	186_INT	R	Engine	1VT485	Replace water pump	REPLACE WATER PUMP. REPLACED LEAKING ENGINE WATER PUMP AND RELATING HOSES. TOPPED UP COOLANT AND CHECKED FOR LEAKS.	617.95	513.96	0	30	1161.91
180808-00 SVC00210	09/11/2018	1H0103	ID - EARTHMO	186_INT	R	Sundries	1VT485	Air con repairs	AIR CON REPAIRS. CHECKED AIR CON, FOUND THE BELT BROKEN AND PUMP SIEZED. REPLACED COMPRESSOR AND BELT. FITTED NEW DRYER AND REPLACED SPLIT HOSE. COVERED EXHAUST AND REPAIRED CLAMP. VACUUMED SYTEM AND CHARGED. TESTED OK.	922.65	346.72	0	92.5	1361.87
180816-00 SVC00211	09/05/2018	1H0103	ID - EARTHMO	186_INT	R	Bodywork	1VT485	WINDSCREEN WIPER WASHER REP	REPLUMBED WASHERS AND REPAIRED WIRING TO THE MOTOR.	167.85	0	0	8	175.85

180713-00 SVC00208	08/29/2018	1H0103	ID - EARTHMO	186_INT	S	Service	1VT485		S1 B SERVICE	S1 B SERVICE. COMPLETED THE REQUIRED SERVICE AND SAFETY INSPECTIONS AS PER SERVICE SHEET.. REPLACED WIPERS WITH 20 INCH KENWORTH AFTERMARKET TYPE. CHECKED OIL LEAKS AT THE ENGINE.TIGHTENED SUMP,COMPRESSOR AND POWER STEERING MOUNTING BOLTS.	637.39	342.57	0	30	1009.96
180808-00 SVC00210	08/27/2018	1H0103	ID - EARTHMO	186_INT	R	Transmissio	1VT485		NEUTRAL START / REVERSE SWITCH	NEUTRAL START / REVERSE SWITCH. SOURCE INFORMATION ON SWITCHES ON THE TRANSMISSION. IDENTIFIED NEUTRAL START SWITCH AND REVERSE SWITCH. WIRED THE SWITCHES BACK INTO THE SYSTEM SO THE REVERSE LIGHTS WORKED AND THE ENGINE ONLY STARTED IN NEUTRAL. FITTED REVERSE BUZZER AND LIGHT. ADJUSTED GEAR SHIFT.	632.22	49.6	0	20	701.82
180713-00 SVC00208	07/18/2018	1H0103	ID - EARTHMO	184_INT	R	Electrical	1VT485	8475 HRS	JUMP START UNIT AT MARGATE YAR	TRAVELLED TO MARGATE YARD, JUMP START UNIT READY FOR TRANSPORT TO LAMPTON AVENUE	204.25	4.09	0	62.5	270.84
180709-00 SVC00208	07/10/2018	1H0103	ID - EARTHMO	184_INT	R	Sundries	1VT485	NA	START UNIT AND CHECK OVER	TRAVELLED TO MARGATE, PUMP UP AIR TANK AND BLEED FUEL SYSTEM, START UNIT READY FOR TRANSPORT TO LA	81.7	0	0	37.5	119.2
160422-00 SVC00166	04/27/2016	1H0103	ID - EARTHMO	184_INT	R	Electrical	1VT485	7991 HR	Jump start unit	TRAVELLED TO CLAREMONT, INSPECT FOR START FAULT, CHECKED VOLTAGE, JUMP STARTED UNIT, CHECKED CHARGE RATE ALL OK	118.13	0	0	22	140.13
160324-00 SVC00165	04/12/2016	1H0103	ID - EARTHMO	184_INT	R	Sundries	1VT485	757412	MAKE REMOTE AIR LINE START TRU	MAKE REMOTE AIR LINE AND JUMP START TRUCK	78.75	20	0	0	98.75
160315-00 SVC00164	03/16/2016	1H0103	ID - EARTHMO	184_INT	R	Sundries	1VT485	7896	CALL OUT - FILL UP START AIR T	CALL OUT TO ELWICK ROAD, REFILLED START TANK WITH AIR AND STARTED.	420	0	0	42	462
160316-00 SVC00165	03/16/2016	1H0103	ID - EARTHMO	121_INT	R	Tyres	1VT485	757303	FIT COP + DISPOSAL	FIT COP + DISPOSAL CARRIED OUT BY RUBAND	0	32	0	0	32
160304-00 SVC00164	03/08/2016	1H0103	ID - EARTHMO	184_INT	R	Sundries	1VT485	78654 HM	CLEAN PUMP FILTER	CLEANED OUT SUCTION FILTER ON WATER PUMP	39.38	0	0	0	39.38
160114-00 SVC00162	01/27/2016	1H0103	ID - EARTHMO	184_INT	R	Engine	1VT485	7714 HRS	Repair starting fault	TRAVELLED TO TUNBRIDGE, CHECKED STARTING FAULT, FOUND NO FUEL GETTING TO INJECTORS, BLOW LINES BACK THROUGH TO TANK, BLEED SYSTEM AND CHECK OK, CHECKED HR METER NOT WORKING, FOUND BAD CONNECTION ON BACK OF HR METER, REPAIRED AND TESTED OK, FOUND COOLANT LEAK IN PIPE FROM COOLANT FILTER HOUSING TO BLOCK, REQUIRES REPLACING.	433.13	0	0	142.5	575.63

160112-00 SVC00161	01/19/2016	1H0103	ID - EARTHMO	184_INT	R	Brake	1VT485	7714	REPLACE LEAKING PARK BRAKE VAL	TRAVEL TO TUNBRIDGE, CHECKED FOR PTO FAULT, FOUND BLOWN CIRCUIT BREAKER, CHECKED FOR CHAFFES ETC, COULD NOT FAULT, TRAVELLED BACK TO SITE, REPLACED LEAKING PARK BRAKE VALVE, CLEANED OUT FILTER FOR PUMP SPRAYERS ETC, TEST OPERATION.	472.51	129.96	0	326	928.47
151110-00 SVC00160	11/30/2015	1H0103	ID - EARTHMO	186_INT	R	Electrical	1VT485	757,303 KLI	AUTO/ELECT REPAIRS	REMOVE TRANSMISSION RETARDER FOOT OPERATED SWITCH, MODIFIED AND FITTED SPRING TO ENABLE PEDAL TO BE SPRING LOADED, REFIT AND TEST, LIGHT COMING ON AND GOING OFF OK, REMOTE AUTO G/SHIFT LEVER AND CONSOLE, CHECKED OPERATION OF SWITCH U/S, REMOVED OPERATING BOLT, REPAIRED HEAD TO MAKE SWITCH WORK, REFIT AND FIT NEW SWITCH, REASSEMBLED LEVER ETC, REVERSE ALARM FOUND U/S, REMOVED AND REPLACED, REPLACED BLOWN AND MISSING GLOBES IN GAUGES/WARNING LIGHTS, REPAIRED WIRING FOR FUEL GAUGE BETWEEN DASH AND SENDER UNIT, TEST TEMP GAUGES, SENDER UNIT U/S, ORDER AND FIT REPLACEMENT, REPLACED END ON UHF RADIO AERIAL LEAD, ORDER AND FIT NEW PROBE FOR THE PYRO, REMOVE AND FIT NEW ONE.	1829.64	374.81	0	50	2254.45
151106-00 SVC00159	11/23/2015	1H0103	ID - EARTHMO	186_INT	R	Service	1VT485	72855 KMS	PRE INSPECTION	PRE INSPECTION. REPLACED BROKEN SEAT BELT .PARTS EX STOCK.GREASED TRUCK DRAINED AIR RECIEVERS OF WATER CHECKED FLUID LEVELS AND LIGHTS CUT AND FITTED MISSING PLATE FOR FILL OPENING ON TOP OF THE WATER TANK. CHECKED OPERATION OF FANS AND DRIBBLE BAR.OPERATED FLOW CONTROL TO DROP PRESSURE TO DRIBBLE BAR.NOTE FAN OPERATION IS REDUCED WHEN TRAVELING.	375.4	35.03	0	18	428.43
151111-00 SVC00153	11/23/2015	1H0103	ID - EARTHMO	186_INT	R	Steering	1VT485	72855 KMS	WHEEL ALIGNMENT	WHEEL ALIGNMENT. REPLACED 1ST STEER AXLE DRAG LINK END.ADJUSTED TOW IN 1ST AND 2ND AXLE.PHASED THE TWO AXLES TOGETHER.ADJUSTED TYRE PRESSURES. NOTE.STEERING IDLER SHAFT AND STEERING ASSIST CYLINDER ARE WORN.	467.26	95.1	0	20	582.36
150720-00 SVC00153	07/21/2015	1H0103	ID - EARTHMO	184_INT	R	Engine	1VT485	757303 KLI	BLEEED UP FUEL SYSTEM & PUMP U	TRAVELED TO KEMPTON TO BLEED UP FUEL SYSTEM AND CHARGE AIR TANK, START AND CHECK OPERATION	196.88	0	0	65	261.88
150701-00 SVC00152	07/15/2015	1H0101	ID - TRANSPC	184_INT	R	Sundries	1VT485	6968 HRS	grease and inspection		78.75	17.5	0	37	133.25
150707-00 SVC00153	07/14/2015	1H0101	ID - TRANSPC	184_INT	S	Service	1VT485	6974 HRS	S1 B SERVICE	TRAVELED TO KEMPTON TO DO S1 B SERVICE AS PER SERVICE SHEET, TOPPED UP REAR DIFF, REPAIRED LIGHTS	519.23	410.17	0	119	1048.4

150706-00 SVC00153	07/09/2015	1H0101	ID - TRANSPC 184_INT	R	Sundries	1VT485	6973 HRS	PUMP UP STARTER AIR TANK	1/7/15 TRAVELED TO KEMPTON TO CHECK COLD START OPERATION, ASSIST IN REPAIRS. 3/7/15 TRAVELED TO KEMPTON TO PUMP UP AIR TANK AND PRIME FUEL SYSTEM	354.38	0	0	99.5	453.88
150624-00 SVC00152	06/30/2015	1H0101	ID - TRANSPC 184_INT	R	Engine	1VT485	6963 HRS	REPAIR HAND THROTTLE	TRAVELLED TO KEMPTON AND INSPECT UNIT FOR REPORTED STARTING FAULT, REFIT HAND THROTTLE AND TOP UP ENGINE OIL, TOP UP COOLANT AND CAB LIFT PUMP.	118.13	0	0	25	143.13
150603-00 SVC00151	06/19/2015	1H0101	ID - TRANSPC 184_INT	R	Engine	1VT485	6956 HRS	INSPECT START FAULT	TRAVELED TO KEMPTON GOT TRUCK GOING AGAIN AFTER FUEL BLEED BACK, FILL START TANK WITH AIR, START AND CHECK OPERATION	236.25	0	0	100	336.25
150527-00 SVC00151	05/27/2015	1H0101	ID - TRANSPC 184_INT	R	Engine	1VT485	6954 HR	PUMP UP AIR TANK AND START	TRAVELLED TO KEMPTON, CHARGED UP AIR TANK AND STARTED	98.44	0	0	44	142.44
150407-00 SVC00148	04/08/2015	1H0101	ID - TRANSPC 184_INT	R	Sundries	1VT485	6787 HR	REPAIR AIR LEAK AT SPRAY BAR C	TRAVELLED TO MIDLANDS HWY, REPAIRED BLOWN AIR LINE IN CHASSIS	86.1	0	0	59	145.1
150320-00 SVC00147	03/31/2015	1H0101	ID - TRANSPC 184_INT	R	Electrical	1VT485	278168	Repair Revolving light	TRAVELLED TO SPRING HILL, CHECKED FOR REVOLVING LAMP FAULT, CHECKED FOR BROKEN WIRING IN CHASSIS AND REPAIRED, REPLACED BLOWN PARK LIGHT GLOBES	236.25	0	0	34	270.25
150327-00 SVC00147	03/31/2015	1H0101	ID - TRANSPC 184_INT	R	Sundries	1VT485	6749	REPLACE WATER HOSES & REPAIR	REPLACE WATER HOSES & REPAIRED WATER PIPEWORK -- MAKE NEW RUBBER GASKETS FOR SCREW ON FITTINGS, REPLACE WIPER BLADES, TOPPED UP ENGINE OIL	712.43	239.5	0	36	987.93
150326-00 SVC00147	03/26/2015	1H0101	ID - TRANSPC 121ADMIN	R	Sundries	1VT485		SUPPLY GREASE AND RAGS	SUPPLY GREASE AND RAGS 103-8813	0	60.2	0	0	60.2
150313-00 SVC00147	03/24/2015	1H0101	ID - TRANSPC 184_INT	R	Brake	1VT485	6717	REPLACE FAULTY RETARDER SOLENO	TRAVELLED TO SPRING HILL, INSPECTED RETARDER FAULT, FOUND FAULTY SOLENOID, TRAVEL BACK TO SITE AND FIT NEW RETARDER SOLENOID	318.68	183.71	0	126	628.39
150109-00 SVC00144	03/18/2015	1H0101	ID - TRANSPC 186_INT	R	Engine	1VT485		BLEED FUEL FUEL SYSTEM	BLEED FUEL FUEL SYSTEM. BLED UP THE FUEL SYSTEM AND CHECKED FOR LEAKS.	102.38	0	0	0	102.38
150223-00 SVC00146	03/12/2015	1H0101	ID - TRANSPC 184_INT	S	Service	1VT485	6596 hrs	S1 B SERVICE & ENG BELTS	TRAVELLED TO SPRING HILL, CARRIED OUT S1 B SERVICE AS PER SCHEDULE AND REPLACED ENGINE BELTS AS REQUIRED	620.56	415.94	0	183	1219.5
150216-00 SVC00145	02/27/2015	1H0101	ID - TRANSPC 184_INT	R	Sundries	1VT485	6481	SUPPLY JUMP START AIR LINE	TRAVELLED TO SPRING HILL, FABIRCATE NEW AIR LINE FOR START TANK	118.13	35.66	0	50	203.79
150216-00 SVC00145	02/25/2015	1H0101	ID - TRANSPC 184_INT	R	Sundries	1VT485	6481	REPAIR THROTTLE CABLE, REVERSE	TRAVELLED TO SPRING HILL, REMOVED BREATHER FOR REPLACEMENT, REPAIRED REVERSE BEEPER WIRING, REPAIRED THROTTLE CABLE WORN IN BRACKET	177.19	73.11	0	140.5	390.8
150210-00 SVC00145	02/20/2015	1H0101	ID - TRANSPC 184_INT	R	Electrical	1VT485	6449	Check starting fault	TRAVELLED TO SPRING HILL, PULL APART DASH AND INSPECT WIRING FOR STARTING CIRCUIT	236.25	3.5	0	149.5	389.25
150202-00 SVC00144	02/16/2015	1H0101	ID - TRANSPC 186_INT	R	Steering	1VT485	6453 HRS 7	REPLACE LHS KING PIN	REPLACE LHS KING PIN. REMOVED BOTH WORN KING PINS ON THE SECOND AXLE. REPLACED BUSHES AND BEARINGS AND REASSEMBLED. STRAIGHTENED BENT TIE ROD.	1308.57	534.49	0	50	1893.06

150202-00 SVC00145	02/05/2015	1H0101	ID - TRANSPC 184_INT	R	Electrical	1VT485	6442 HRS	REPAIR ELECTRICAL FAULT IN DAS	TRAVELLED TO SPRING HILL, CHECKED FOR TAIL LAMP FAULT AND REPAIRED WIRING, CHECKED FOR FAULT WITH WATER SPRAY SYSTEM, LOCATED BROKEN WIRES IN DASH AND REPAIR AND TEST	315	0	0	104	419
150130-00 SVC00144	01/30/2015	1H0101	ID - TRANSPC 184_INT	R	Steering	1VT485	6448	Inspect steering fault	TRAVELLED TO SPRING HILL, INSPECTED STEER ISSUE WITH WATER CART, FOUND EXCESSIVE MOVEMENT IN LH REAR KING PIN, MOVEMENT IN BALL JOINTS, BENT TIE ROD, SHOCKY RUBBERS WORN ETC, FURTHER REPAIRS REQUIRED ON TRUCK	236.25	0	0	55	291.25
150127-00 SVC00144	01/29/2015	1H0101	ID - TRANSPC 184_INT	R	Sundries	1VT485	6394	INSPECT REPORTED PTO FAULT	INSPECT REPORTED PTO / NO PUMP OPERATION FAULT, FOUND TO BE OPERATOR ERROR, DRIVER HAD NOT ENGAGED PTO TO OPERATE WATER PUMP, CHARGES TO GO TO MIDLANDS HWY SOUTH OF SPRING HILL PROJECT, JOB CALLED IN BY ANDREW CLARK, CHARGES TO CIVIL AUTHORISED BY PAUL KELLEHER	157.5	0	0	96	253.5
150113-00 SVC00143	01/14/2015	1H0101	ID - TRANSPC 184_INT	R	Sundries	1VT485		INSPECT WATER PUMP PICK UP FAU	TRAVELLED TO LOVELY BANKS, ASSIST PAUL KELLEHER TO INSPECT WATER PUMP PICK UP FAULT	78.75	0	0	27.5	106.25
141126-00 SVC00141	11/28/2014	1H0101	ID - TRANSPC 186_INT	R	Sundries	1VT485	6379 HRS	REPAIR AIR LEAK		136.5	0	0	0	136.5
141126-00 SVC00141	11/28/2014	1H0101	ID - TRANSPC 186_INT	R	Sundries	1VT485	6379 HRS	REPAIR AIR LEAK	REPAIR AIR LEAK. CHECKED THE VEHICLE FOR AIR LOSS, TRACED FAULT TO THE AIR ACCELLERATOR. CHECKED THE OPERATION OF THE SYSTEM AND FOUND DIRT IN THE SYSTEM. CLEANED AND RECHECKED.	102.38	0	0	0	102.38
141031-00 SVC00140	11/27/2014	1H0101	ID - TRANSPC 186_INT	R	Sundries	1VT485	6379 HRS	SUPPLY AND FIT WATER PUMP	SUPPLY AND FIT WATER PUMP. SWAPPED OVER FITTINGS AND PUMP DRIVE FROM THE U/S PUMP TO THE NEW PUMP. CUT SHIMS TO ALIGN THE PUMP AND DRIVE MOTOR. FITTED UP INLINE STRAINER TO REDUCE THE RISK OF THE NEW PUMP BEING DAMAGED BY DEBRIS IN THE SUCTION HOSE. FILLED TANK WITH WATER AND CHECKED OPERATION. FOUND TWO HOSES TO THE SPRAY BAR LEAKING AND REPLACED THE HOSES.	1074.95	3672.87	0	50	4797.82

141121-00	SVC00141	11/27/2014	1H0101	ID - TRANSPC 186_INT	R	Engine	1VT485	6379 HRS	Repair starting fault	REPAIR STARTING FAULT. CHECKED THE FUEL TANK AND FOUND RUBBISH IN THE BOTTOM OF THE TANK. CLEANED OUT THE TANK. REMOVED THE FILTERS AND CLEANED OUT THE SUPPLY FUEL HOSES. CHECKED LIFT PUMP OPERATION AND BLEED UP THE SYSTEM. CHECKED BUILT UP RUST ON AIR STARTER TANK. FOUND THE TANK TO HAVE A HOLE IN IT. FOUND SECOND HAND TANK IN THE BARN, SWAPPED OVER VALVES AND FITTINGS, REPLACED MISSING RUBBERS AND FITTED TANK. STARTED ENGINE AND CHECKED FOR LEAKS OF FUEL AND AIR.OK.	618.2	11.78	0	30	659.98
141126-00	SVC00141	11/27/2014	1H0101	ID - TRANSPC 186_INT	R	Steering	1VT485	6379. HRS	STEERING REPAIR	STEERING REPAIR. REMOVED BENT TIE ROD FROM THE FIRST STEER AXLE,PRESSED IT STRAIGHT AND REFITTED. ATTEMPTED TO DO THE JOB IN CHASSIS BUT THE ROD WAS SIEZED AND THE TAPER WAS SPINNING IN THE STEERING ARM.	204.75	0	0	0	204.75
141126-00	9714	11/27/2014	1H0101	ID - TRANSPC 186_INT	R	Drive Line	1VT485	6379. HRS	DRIVE LINE REPAIRS		0	0	0	0	0
141126-00	SVC00141	11/27/2014	1H0101	ID - TRANSPC 186_INT	R	Drive Line	1VT485	6379. HRS	DRIVE LINE REPAIRS	REMOVED AND REPLACED LOOSE BOLTS ON THE FLANGE COUPLINGS ON THE DRIVE LINE.	170.63	0	0	8.5	179.13
140828-00	SVC00136	10/30/2014	1H0101	ID - TRANSPC 186_INT	R	Sundries	1VT485	6189 HRS	REPAIR WATER PUMP OPERATION	REPAIR WATER PUMP OPERATION. CHECKED WATER PUMP OPERATION AND TRACED TO BROKEN WIRING IN THE CHASSIS RAIL. REPAIRED WIRING AND FILLED TANK WITH WATER TO CHECK OPERATION.PUMP WOULD NOT OPERATE. DISCONNECTED THE HYDRAULIC MOTOR AND FOUND PUMP SIEZED. REMOVED THE PUMP AND DISASSEMBLED. FOUND BEARINGS SIEZED AND WORE OUT HOUSING AND IMPELLER INTURN HAD DAMAGED THE CENTRIFUGAL HOUSING BEYOND REPAIR. NEEDS COMPLETE WATER PUMP.	733.69	0	0	35	768.69

140815-00 SVC00136	08/27/2014	1H0101	ID - TRANSPC 186_INT	R	Engine	1VT485	757303K 6:	ENGINE MOUNT REPAIRS	ENGINE MOUNT REPAIRS. FOUND LHS REAR ENGINE MOUNT BROKEN AWAY FROM THE BELL HOUSING. SUPPOR THE TRANSMISSION AND REMOVED THE BRACKET. FOUND BOLTS BROKEN OFF IN THE BELLHOUSING. REMOVED THE PUMP AND HOSES, LOWERED THE REAR OF THE TRANSMISSION AND JACKED THE TRANSMISSION TO GIVE THE GREATEST AMOUNT OF ROOM TO REMOVE THE BROKEN BOLTS. SUBCONTRACTOR WAS ONLY ABLE TO REMOVE THREE OF THE FOUR BOLTS. CLEANED THE SURFACES AND APPLIED ADHESIVE TO THE SIDE OF THE MOUNT .FITTED AND ALLOWED TIME TO CURE. REPLACED WORN MOUNTING RUBBERS (PARTS EX STOCK) AND REASSEMBLED THE MOUNTS ON BOTH SIDES. GREASED THE VEHICLE.	1191.77	8.95	200	50	1450.72
140820-00 SVC00136	08/27/2014	1H0101	ID - TRANSPC 186_INT	R	Electrical	1VT485	6189 HRS 7	REPLACE DAMAGED REVERSE LIGHT	REPLACE DAMAGED REVERSE LIGHT. REPLACED LIGHT AND REPAIRED WIRING TO LIGHT AND ALARM.	102.38	54.95	0	5	162.33
140820-00 SVC00136	08/26/2014	1H0101	ID - TRANSPC 186_INT	R	Bodywork	1VT485	6189 HRS 7	REPLACE MISSING BASHER PLATE	REPLACE MISSING BASHER PLATE. REMOVED BROKEN MOUNTING BOLTS AND FABRICATED AND FITTED BASHER PLATE TO PROTECT THE FUEL FILTERS.	514.51	0	0	112.5	627.01
140811-00 SVC00135	08/21/2014	1H0101	ID - TRANSPC 184_INT	R	Engine	1VT485	6374	REPLACE DAMAGED FUEL FILTER	TRAVEL TO PIPELINE, CHECKED FILTER DAMAGE AND REMOVED FILTERS, CHASED UP NEW HOUSING, REMOVE SECOND HAND HOUSING FROM WRECK AT HBMI, FIT TO UNIT WITH NEW FILTERS AND BLEED UP SYSTEM	515.57	39.45	0	59	614.02
140728-01 SVC00135	07/30/2014	1H0101	ID - TRANSPC 184_INT	R	Electrical	1VT485	6357 hrs	REPAIR NO IGNITION POWER FAULT	TRAVEL TO PIPELINE SITE, CHECK FOR STARTING FAULT, REPAIR ALTERNATOR WIRNG AND TEST OK.	236.25	0	0	67	303.25
140717-00 SVC00134	07/18/2014	1H0101	ID - TRANSPC 184_INT	R	Transmissio	1VT485	6351 HRS	REPLACE G'BOX MOUNT BOLT	TRAVEL TO PIPELINE, REFITTED REAR GEARBOX MOUNT BOLTS THAT WERE MISSING.	78.75	0	0	33	111.75
140710-00 SVC00134	07/14/2014	1H0101	ID - TRANSPC 184_INT	R	Engine	1VT485	6327 HRS	REPLACE DAMAGED FUEL FILTER	TRAVEL TO DAMSITE PIPELINE, INSPECT UNIT FOR FUEL LEAK, FOUND DAMAGED FUEL FILTER, REMOVE FILTER. ORDER NEW PART. TRAVEL BACK TO SITE. REPLACED FUEL FILTER AND BLED FUEL SYSTEM AS REQUIRED.	236.25	22.65	0	122	380.9
140626-00 SVC00133	06/30/2014	1H0101	ID - TRANSPC 184_INT	R	Sundries	1VT485	6280 HR	REPLACE MUD GUARD BRACKETS	TRAVEL TO PIPELINE, REPLACED LHR MUDGUARD BRACKETS AND SHORTENED MUD FLAPS.	118.13	0	0	44.4	162.53

140620-00 SVC00133	06/27/2014	1H0101	ID - TRANSPC 186_INT	S	Service	1VT485	6251 HRS	S1 B SERVICE	S1 B SERVICE. COMPLETED SERVICE AS PER SERRVICE SHEET. REPAIRED AIR LEAK IN CENTRE CONSUL,REPLACED TWO LEAKING TEE FITTINGS. REPLACED STEER AXLE HUB BUNGS. FITTED A FIRE EXTINGUISHER. NOTE. POWER STEERING BOX OIL LEAK,FUEL TANK STRAPS DAMAGED.NO WINDSCREEN WASHERS.	341.25	354.42	0	20.5	716.17
140623-00 SVC00133	06/27/2014	1H0101	ID - TRANSPC 186_INT	R	Transmissio	1VT485	6251 HRS	TRANSMISSION ADJUSTMENT	TRANSMISSION ADJUSTMENT. ADJUSTED THE TRANSMISSION NEUTRAL AND TESTED OPERATION.	102.38	0	0	0	102.38
140623-00 SVC00133	06/27/2014	1H0101	ID - TRANSPC 186_INT	R	Brake	1VT485	6251 HRS	Replace brake booster	REPLACE BRAKE BOOSTER. REPLACED LEAKING BRAKE BOOSTER.	68.25	41.4	0	0	109.65
140619-00 SVC00132	06/23/2014	1H0101	ID - TRANSPC 186_INT	R	Brake	1VT485	757303 KM	Park brake repairs	PARK BRAKE REPAIRS. REMOVED THE DASH,DISCONNECTED AIR HOSES,SWAPPED OVER FITTINGS AND FITTED NEW PARK BRAKE VALVE. CHECKED OPERATION.	147	116.22	0	7	270.22
140603-00 SVC00132	06/12/2014	1H0101	ID - TRANSPC 186_INT	R	Bodywork	1VT485		REPLACE DAMAGED MUD FLAPS	REPLACE DAMAGED MUD FLAPS. ROTATAED DAMAGED REAR GAURD AND FITTED UP TWO NEW MUD FLAPS.	131.25	36.65	0	6.5	174.4
140508-00 SVC00130	05/28/2014	1H0101	ID - TRANSPC 186_INT	R	Transmissio	1VT485	757303KM	REPAIR TRANS OIL LEAK	REPAIR TRANS OIL LEAK. CLEAN OFF THE TRANSMISSION AREA AND CHECKED FOR OIL LEAK. FOUND TO BE LEAKING FROM FILLER AREA. REMOVED THE TRANSMISSION PAN AND CRACK TESTED. HAD WELDERS CUT OUT AND REWELD FILLER TUBE. STRAIGHTENED THE PAN AND CLEANED THE TRANS SUMP AREA. REFITTED THE PAN WITH NEW GASKET AND FILLER WITH OIL. TEST DROVE AND RECHECKED OIL LEVEL.	716.63	155.21	0	35	906.84
140508-00 SVC00130	05/20/2014	1H0101	ID - TRANSPC 186_INT	R	Engine	1VT485	757303 KM	REPLACE ENGINE CABLE	REATTACHED THE HAND THROTTLE TO THE FUEL PUMP AND CHECKED OPERATION.	52.5	37.47	0	0	89.97
140516-00 SVC00130	05/19/2014	1H0101	ID - TRANSPC 187_INT	R	Sundries	1VT485	N/A	REPLACE SUCTION HOSE	REPLACE SUCTION HOSE AND CLAMPS PARTS ONLY FROM TOTAL RUBBER MISSED FROM SC140203-0018	0	72.81	0	0	72.81
140512-00 SVC00130	05/13/2014	1H0101	ID - TRANSPC 182_INT	R	Transmissio	1VT485		CLEAN & WELD UP CRACK IN SUMP	CLEAN & WELD UP CRACK IN SUMP	381.68	0	0	19	400.68
140507-00 SVC00130	05/08/2014	1H0101	ID - TRANSPC 187_INT	R	Exhaust	1VT485		REPLACE EXHAUST SHROUD	REPLACE EXHAUST SHROUD	170.63	0	0	8.5	179.13

140203-00	SVC00125	02/19/2014	1H0101	ID - TRANSPC 187_INT	R	Electrical	1VT485	67882 kms	REPAIRS TO WATERPUMP	REPAIRS TO WATERPUMP TRAVEL TO TARKINE AND CHECK OPERATION OF WATER PUMP. CHECK ALL WIRING AND SWITCHES, FOUND BROKEN WIRE. REPAIR AND TEST. INTERMITTANT OPERATION. PTO PUMP LOADING UP. TEST SOLENOID AND FOUND TO BE FAULTY. REMOVE AND RETURN FOR SPARES.. RETURN TO TARKINE AND REFIT AND TEST SOLENOID.	2160.5	923.37	0	116	3199.87
131209-00	SVC00123	02/18/2014	1H0101	ID - TRANSPC 187_INT	R	Transmissio	1VT485	67,862KM	REPAIR TRANSMISSION	STRIP AND QUOTE FOR REPAIRS ON TRANSMISSION CARRIED OUT BY MTU DETROIT AS FOLLOWS, FIT TRANSMISSION TO STAND, REMOVED TORQUE CONVERTER, OIL PUMP MODULE, SUMP, VALVE BODY, FORWARD CLUTCH AND TURBINE SHAFT ASSEMBLY, 4TH CLUTCH, THIRD CLUTCH, CENTRE SUPPORT AND GEAR UNIT ASSEMBLY, STRIP TO SUB ASSEMBLIES AND FOUND TWO FRICTION AND ONE STEEL PLATE WORN OUT ON NUMBER 4 CLUTCH, FOUND SUN GEAR SHAFT BUSHES SPLIT AND WORN BADLY, FIRST CLUTCH HAS SOME FRICTION PLATES WITH EXCESSIVE WEAR. REMOVE TRANSMISSION FOR REPAIRS SEND TO BE REPAIRED. RECEIVE TRANNY BACK AND REFIT TO TRUCK. REPLACE WORN PIPES AND HOSES. REPLACE WIRING AND FILL WITH OIL. REPLUMB PTO FOR AIR OPERATION. TESTS AND REPAIR LEAKING AIR LINES. DRAIN OIL AND FLUSH COOLER. TEST TRAVEL TO TARKINE AND CHECK PTO OPERATION AND ORDER AND REPLACE SOLENOID VALVE. FIT UP DRAIN FOR PTO LINES. REPAIR SPEED SWITCH. AND REPLACE SPEED SOLENOID. TEST.	5734	4336.43	6327.12	260	16657.55
140128-00	SVC00125	02/18/2014	1H0101	ID - TRANSPC 187_INT	S	Service	1VT485	67826 kms	S1 B SERVICE	S1 B SERVICE SERVICE AS PER SHEET. ENG OIL AND FILTER, CHECK FLUID LEVELS AND BRAKES. LIGHTS AND GREASE. CHECK DRIVELINE AND SUSPENSION	218.5	280.89	0	158.5	657.89
140129-00	SVC00125	02/18/2014	1H0101	ID - TRANSPC 187_INT	R	Brake	1VT485	67826 kms	REPAIR AIR LEAK	REPAIR AIR LEAK CHECK FOR AIR LEAK. LOCATE BROKEN BRAKE LINE. REMOVE AND REPLACE.	225	70.59	0	108	403.59
140121-00	SVC00124	01/23/2014	1H0101	ID - TRANSPC 187_INT	R	Sundries	1VT485	67,862KM	MUDGUARD REPAIRS	MUDGUARD REPAIRS REPLACE MUDGUARD BRACKETS	0	52	0	0	52
131211-00	SVC00122	01/16/2014	1H0101	ID - TRANSPC 187_INT	R	Engine	1VT485	67,862KM	ENGINE MOUNT REPAIRS	ENGINE MOUNT REPAIRS INSPECT ENGINE MOUNTS. FOUND BROKEN BOLTS IN ENGINE MOUNT IN BELL HOUSING. DRILL OUT BROKEN BOLTS AND REPLACE.	487.5	0	0	20	507.5
131216-00	SVC00123	01/16/2014	1H0101	ID - TRANSPC 187_INT	R	Hydraulic	1VT485	67,862KM	REPAIR DRIVE PUMP AND SHAFT	REPAIR DRIVE PUMP AND SHAFT STRIP PTO DRIVE PUMP AND SHAFT.	195	0	0	20	215

131211-00 SVC00122	12/30/2013	1H0101	ID - TRANSPC 187_INT	R	Exhaust	1VT485	67,862KM	EXHAUST REPAIRS	EXHAUST REPAIRS EXHAUST RUSTED OUT AND MUFFLER LEAKING AT WELDS. REMOVE AND REPLACE MUFFLER AND MAKE UP NEW EXHAUST SECTION.	325	350	0	40	715
131128-00 SVC00122	11/29/2013	1H0101	ID - TRANSPC 187_INT	R	Sundries	1VT485	TBA	REPAIR TANK	REPAIR TANK SUBLET ALAN LORD HOLDINGS WELD UP CRACKS IN ALUMINIUM TANK. FABRICATE AND FIT MESH GUARD OVER HYDRAULIC MOTOR COUPLING. REPAIR BROKE LH MUDGUARD BRACKETS. REPAIR CRACKED OUTLET ON AND UNDER SIDE FRONT OF TANK.	0	0	603.9	0	603.9
131129-00 SVC00122	11/29/2013	1H0101	ID - TRANSPC 187_INT	R	Transmissio	1VT485	5588 hrs	TRANSMISSION FAULT	TRANSMISSION FAULT TRAVEL TO TARKINE AND CHECK TRANSMISSION FAULT. NO DRIVE. CHECK OIL LEVEL. INSPECT FOR ANY MAJOR LEAKS, CHECK GEAR SELECTOR POSITION AND CONDITION,AND IT WAS SELECTING GEARS. TRACED FAULT TO INTERNAL SLIPPAGE IN CLUTCH PACKS, AFTER CONSULTATION WITH ALAN DONAHUE. OIL WAS BLACK AND BURNT.TRANS LEVEL WAS BROUGHT TO OVER FULL BECAUSE OF ON SIDE OF ROAD ON AN ANGLE.	303.5	0	0	212	515.5
131115-00 SVC00121	11/20/2013	1H0101	ID - TRANSPC 121ADMIN	R	Tyres	1VT485	757,303KM	CALLOUT REPLACE TYRE 295/80R	CALLOUT REPLACE TYRE 295/80R REGIONAL RHS II 152/148M H + FITTING + DISPOSAL + TRAVEL CARRIED OUT BY BEAUREPAIRS SMITHON	0	916.52	0	0	916.52
131115-00 SVC00121	11/19/2013	1H0101	ID - TRANSPC 187_INT	F	Sundries	1VT485	5778 hrs	REPLACE SPILL KIT , FIRE EXT.	REPLACE SPILL KIT , FIRE EXT. REPLACE SPILL KIT AN DFIRE EXTINGUISHER	0	85.41	0	0	85.41
131031-00 SVC00120	11/11/2013	1H0101	ID - TRANSPC 187_INT	R	Ancillary Ec	1VT485	N/A	WATER PUMP SEIZED	WATER PUMP SEIZED TRAVEL TO TARKINE AND CHECK WATER PUMP NOT WORKING. CHECK HYD , VALVE AND CONTROL. REMOVE PUMP AND RETURN TO BURNIE. STRIP PUMP AND FOUND STRIP OV METAL JAMMED BEHIND IMPELLER. REMOVE AND REASSEMBLE. RETURN TO TARKINE AND FIT PUMP. TEST.	1095.5	0	0	404	1499.5
131107-00 SVC00120	11/11/2013	1H0101	ID - TRANSPC 187_INT	R	Electrical	1VT485	5778 hrs	Water Pump Fault	WATER PUMP FAULT TRAVEL TO TARKINE AND CHECK WATER PUMP NOT WORKING. TRACE FAULT TO BROKEN WIRE ON SWITCH NOT SUPPLING POWER TO WATER DIVERTER VALVE. REPAIR WIRING AND TEST OPERATION OF PTO TO HYD MOTOR. REPLACE SWITCH	321	0	0	232	553

131024-00 SVC00120: 10/31/2013	1H0101	ID - TRANSPC 187_INT	R	Drive Line	1VT485	757,303 km	LH WHEEL SEAL	LH WHEEL SEAL TRAVEL TO TARKINBE AND CHECK LH REAR WHEEL SEAL. FOUND WHEEL NUT AND LOCK WASHER HAD COME UNDONE AND ALLOWED THE WHEEL TO COME LOOSE. REMOVE AND REPLACE BRAKE SHOES AND REAR SEAL. CHECK BRGS AND CHASE UP THREADS, REFIT WHEEL AND LOCK NUT. TEST.	755	178.25	0	136	1069.25
131024-00 SVC00120: 10/31/2013	1H0101	ID - TRANSPC 187_INT	R	Sundries	1VT485	757,303 km	REPLACE HOSE REEL	REPLACE HOSE REEL TRAVEL TPO TARKINE AND REPLACE HOSE REEL.	693.5	0	0	252	945.5
131017-00 SVC00119: 10/30/2013	1H0101	ID - TRANSPC 187_INT	A	Tyres	1VT485	TBA	WHEEL DAMAGE	WHEEL DAMAGE TRAVEL TO TARKINE AND REPAIR MUDGUARDS AND MUDFLAPS.ORGANISE FOR DOWLINGS TO COME AND REPLACE TYRE AND WHEEL. 2 X RUNOUT TYRES, 1 X S/HAND SPIDER WHEEL	327.5	642.5	0	212	1182
131011-00 SVC00119: 10/22/2013	1H0101	ID - TRANSPC 187_INT	R	Sundries	1VT485	5695 HRS 7	REPAIR LEAKING VALVE ON SPRAY	REPLACE LEAKING BUTTERFLY VALVE FOR SPRAY BAR CONTROL TRAVEL TO TARKINE AND CHECK SPRAY BAR OPERATION NOT CLOSING OFF, REMOVE VALVE AND DISASSEMBLE AND INSPECT FOR WEAR. FOUND BUTTERFLY AND SEAL WORN , NOT SHUTTING OFF PROPERLY.	722.5	357.12	0	424	1503.62
131018-00 SVC00119: 10/22/2013	1H0101	ID - TRANSPC 187_INT	R	Sundries	1VT485	5706 hrs	REPAIR HAND THROTTLE	REPAIR HAND THROTTLE TRAVEL TO TARKINE AND CHECK HAND THROTTLE. REPAIR BRACKET, REFIT CABLE AND ADJUST.	225	0	0	116	341
131018-00 SVC00119: 10/22/2013	1H0101	ID - TRANSPC 187_INT	R	Transmissio	1VT485	5706 hrs	REPAIR TRANNY SHIFT CABLE	REPAIR TRANNY SHIFT CABLE TRAVEL TO TARKINE AND CHECK TRANNY SHIFT CABLE. FRE UP AND LUBRICATE, REFIT TO TRUCK AND TEST.ADJUST.	242.5	0	0	116	358.5
130926-00 SVC00118: 10/16/2013	1H0101	ID - TRANSPC 186_INT	R	Hydraulic	1VT485	737303km	REPAIR PUMP OPERATION	Removed and resealed spray bar tap air cylinder.Check and lable all air controls for the pump and sprayer operation. Replaced ball valve on the water pump.Removed and resealed LHS spray fan. Replaced 1" wash down hose on the rear of the truck.Repaired water leaks on main spray bar. Replaced air control for the hand rail. Replaced air switches in cab for spray bar and checked operation. Replaced faulty check valve at the wet tank.Fitted window lock.	1140.5	394.65	0	50	1585.15
131010-00 SVC00118: 10/14/2013	1H0101	ID - TRANSPC 182_INT	R	Sundries	1VT485		WELD CRACKS, REPLACE GUARD MO	WELD CRACKS, REPLACE GUARD MOUNTS & REMOUNT NEW GUARDS AS REQUIRED.	691.5	0	0	35	726.5

130920-00	SVC001186	10/11/2013	1H0101	ID - TRANSPC 186_INT	R	Engine	1VT485	5687 hrs 7	REPAIR COOLANT LEAK	REPAIR COOLANT LEAK. Tightened leaking heater hoses. Tightened loose engine and transmission sump bolts. Removed broken bracket that retains the transmission cooler.Repaired thread holes and refitted. Freed up cab LHS cab lock down cylinder.	425	6.59	0	21	452.59
130927-00	SVC001186	10/07/2013	1H0101	ID - TRANSPC 186_INT	R	Electrical	1VT485	737,303 Klu	REPAIR WIRING BEHIND DASH	REMOVE LOWER PANEL IN DASH, REPAIR WIRING AND PLUG FOR WARNING LIGHTS, REMOUNT CIRCUIT BOARD BEHIND DASH, REFIT LOWER PANEL AS REQUIRED	65	0	0	0	65
130918-00	SVC001186	09/26/2013	1H0101	ID - TRANSPC 186_INT	R	Electrical	1VT485	757,303 Klu	REPAIR LIGHTS AS NECESSARY	REMOVED OLD GLOBE NUMBER PLATE LIGHT ASSEMBLY AS IT WAS RUSTED OUT AND REPLACED WITH A SEALED LED UNIT, REPAIRED WIRING ACROSS THE REAR OF VEHICLE. REMOVED RIGHT HAND MIRROR, DISMANTLED AND REPLACED CLEARANCE LIGHTS, REASSEMBLED WITH NEW RUBBERS AND 1 NEW END CAP, REFITTED TO VEHICLE, REPLACE TOP END CAP ON LEFT HAND MIRROR. REMOVED GRILL AND FIT UP NEW LETTERS. FIT NEW CLIPS TO UHF BRACKET AND FIT NEW PL259 TO AERIAL END.	1040	290.19	0	50	1380.19
130924-00	SVC001186	09/26/2013	1H0101	ID - TRANSPC 186_INT	R	Sundries	1VT485		REPAIR CAM LOCK ENDS	REPAIR CAM LOCK ENDS. Replaced damaged cam lock end and replaced missing seals.	75	35.03	0	0	110.03
130903-00	SVC001166	09/24/2013	1H0101	ID - TRANSPC 181_INT	R	Bodywork	1VT485		CARRY OUT REPAIRS TO TRUCK AS	CARRY OUT REPAIRS TO TRUCK AS REQUIRED PRESSURE WASH TRUCK CHASSIS AND WHEELS REPAIR PANEL DAMAGE TO CAB PREP AND RESPRAY CAB WHITE PAINT CHASSIS AND WHEELS SILVER EXTRA AMOUNT TO REMOVE OLD GUARDS ,SUPPLY AND FIT NEW RED PLASTIC GUARDS MODIFY GUARD BRACKETS AND CUT GUARDS TO FIT AS REQUIRED EXTRA TO REPLACE DOOR LOCKS AND FIT NEW BULB RUBBER AROUND DOOR JAMBS SUPPLY AND FIT NEW WINDSCREEN REPLACE ALL RUSTED BOLTS IN CAB,BUMPER ETC WITH BOLTS THAT WONT RUST FIT NEW MUDFLAPS AND MAKE UP RUBBER FLAPS TO FILL GAP BEHIND CAB	6423	1381.84	490.91	260	8555.75

130619-00	SVC00112	08/29/2013	1H0101	ID - TRANSPC 186_INT	R	Suspensor	1VT485	757303 km	REPLACE BROKEN REAR SPRING	REPLACE BROKEN REAR SPRING. Removed LHS rear camel back spring and fitted second hand one from the quarry. Replaced dead shaft bushes and seals. Reassembled after crack was welded up on the pedalstal.	1592.5	288.91	0	50	1931.41
130619-00	SVC00112	08/29/2013	1H0101	ID - TRANSPC 186_INT	R	Brake	1VT485	757303 km	Brake repairs	BRAKE REPAIRS.. Replaced faulty slack adjuster and hose. Removed second axle brakes and found drums were oversize.Relined brakes and fitted second hand hubs from the quarry. Adjusted remainig brakes.	1052.5	333.03	26.15	40	1451.68
130619-00	SVC00112	08/29/2013	1H0101	ID - TRANSPC 186_INT	R	Engine	1VT485	757303 km	Repair starting fault	Replaced hand primer bled fuel system and started , all ok .	65	37.23	0	0	102.23
130619-00	SVC00112	08/29/2013	1H0101	ID - TRANSPC 186_INT	R	Bodywork	1VT485	757303 km	REPAIR GAURDS AND MIRROR	Re-frilled holes in guards . Replaced reverse alarm Replaced work light	80	42.95	0	0	122.95
130619-00	SVC00112	08/29/2013	1H0101	ID - TRANSPC 186_INT	R	Sundries	1VT485	757303 km	RPAIR WATER LEAKS,DRIBBLE BAR	Repaired water leaks on spray bar , replaced hose and clamps.	205	28.12	0	10	243.12
130731-00	SVC00114	08/29/2013	1H0101	ID - TRANSPC 186_INT	R	Drive Line	1VT485	757303 km	REPLACE FAILED UNIVERSAL JOINT	REPLACE FAILED UNIVERSAL JOINT. Cut out siezed universal joint,found drive shaft out of phase and removed drive shaft to disassemble. Pressed apart drive shaft and found ends cracked.Found drive shaft ex kenworth and had shortened to correct length. Fitted drive shaft with new universals. Replaced park light globe. Unloaded front suspension and removed siezed spring pins.Drilled out grease holes and refitted.	1657.5	118.22	0	50	1825.72
130815-00	SVC00115	08/15/2013	1H0101	ID - TRANSPC 182_INT	R	Lathe	1VT485		SHORTEN TAILSHAFT AS REQUIRED	SHORTEN TAILSHAFT AS REQUIRED	195	0	0	10	205
130711-00	SVC00113	07/30/2013	1H0101	ID - TRANSPC 182_INT	R	Lathe	1VT485		MACHINE SPRING HANGER SPACERS	MACHINE SPRING HANGER SPACERS	107.5	48.35	0	6	161.85
130628-00	SVC00112	07/09/2013	1H0101	ID - TRANSPC 182_INT	R	Sundries	1VT485		WELD UP CRACKS ON SUSPENSION	WELD UP CRACKS ON SUSPENSION	145	0	0	7.5	152.5
130620-00	SVC00112	06/25/2013	1H0101	ID - TRANSPC 184_INT	R	Sundries	1VT485	N/A	REMOVE SPARE PARTS FROM WRECK	REMOVE SPARE PARTS FROM WRECK DOWN AT HBMI TO FIT TO 1VT485, WORKSHOP REPAIRING SPRING, BRAKES, GUARDS, WATER LEAKS ETC AFTER RETURNING FROM MUSSELROE BAY, PARTS REMOVED FROM WRECK ARE SPRING, HOSES, BRAKES.	487.5	0	0	60.48	547.98
130506-00	SVC00110	06/11/2013	1H0101	ID - TRANSPC 184_INT	R	Steering	1VT485		REPLACE BROKEN TIE ROD END	REPLACE BROKEN TIE ROD END COMPLETED BY ATH ENGINEERING	65	279.22	748.5	0	1092.72
130422-00	SVC00110	05/31/2013	1H0101	ID - TRANSPC 184_INT	R	Service	1VT485	5526	S1 B SERVICE	CARRIED OUT SERVICE AS PER SCHEDULE, COMPLETED BY ATH ENGINEERING	65	370.87	511.5	0	947.37
130118-00	SVC00103	03/22/2013	1H0101	ID - TRANSPC 184_INT	R	Steering	1VT485	3937	REPLACE UNIVERSAL & TIE ROD	REPAIRS TO WATER TRUCK AS REQUIRED. WORK CARRIED OUT BY ATH ENGINEERING.	65	616.44	2457	0	3138.44

130313-00 SVC00107	03/20/2013	1H0101	ID - TRANSPC 184_INT	R	Bodywork	1VT485	5276	REPLACE LHR MUDGUARD	TRAVEL TO MUSSELROE, REPLACED LHR GUARD AND TIGHTENED LOOSE EXHAUST AND CLEAN UP AREA AND UNIT	450	76.5	0	172.8	699.3
130215-00 SVC00105	03/18/2013	1H0101	ID - TRANSPC 184_INT	R	Tyres	1VT485	NOT SUPPL	REPLACE FRONT STEER TYRES	REPLACE FRONT STEER TYRES FIELD SERVICE DELIVERED TYRES TO MUSSELROE BAY, COST FOR FITTMENT HAS BEEN CHARGED TO 130228-0067	140	760	0	0	900
130228-00 SVC00105	03/06/2013	1H0101	ID - TRANSPC 186_INT	R	Tyres	1VT485		BEAUREPAIRS PUNCTURE REPAIR +	BEAUREPAIRS PUNCTURE REPAIR + CALL OUT TO WINDFARM BY RICK DION MORGAN APPROVED	0	509.09	0	0	509.09
130218-00 SVC00105	02/28/2013	1H0101	ID - TRANSPC 184_INT	R	Sundries	1VT485	5115	CHECK WHEEL ALIGNMENT & REPAIR	TRAVELLED TO MUSSELROE. CARRIED OUT WHEEL ALIGNMENT ON TRUCK. REPLACED MIRROR, REPLACED DRIBBLE BAR SWITCH. WENT TO REPLACE CAB HOOK BUT WRONG ONE WAS SUPPLIED.	781.5	21.02	0	240	1042.52
130115-00 SVC00103	02/15/2013	1H0101	ID - TRANSPC 184_INT	R	Transmissio	1VT485	4936 HRS	REPLACE PTO PUMP BYPASSING INT	TRAVEL TO MUSSELROE. CHANGED TRANSMISSION OIL AND FILTER. LOOKED AT DRIVELINE AND REMOVED PTO PUMP.	485	1126.21	0	192	1803.21
130206-00 SVC00104	02/08/2013	1H0101	ID - TRANSPC 184_INT	R	Electrical	1VT485	NOT SUPPL	Repair starting fault	REPAIR CHARGIN CIRCUIT AND REPLACE LUGS ON EARTH LEAD. WORK CARRIED OUT BY DMC AUTO ELECTRICAL SERVICES	32.5	0	97.5	0	130
130115-00 SVC00103	01/29/2013	1H0101	ID - TRANSPC 184_INT	S	Service	1VT485	4936 HRS	S1 B SERVICE	TRAVEL TO MUSSELROE. CARRIED OUT SERVICE ON UNIT AS PER SCHEDULE. REPAIRED FAULTS AS REQUIRED.	757	522.25	0	192	1471.25
130114-00 SVC00103	01/18/2013	1H0101	ID - TRANSPC 184_INT	R	Differential	1VT485	4928	REPAIR DRIVE LINE FAULTS	TRAVEL TO MUSSELROE. REPAIR DRIVE LINE FAULTS, TIGHTENED TRANSMISSION FLANGE BOLTS AND CENTRE BEARING BOLTS.	187.5	10	0	96	293.5
130117-00 SVC00103	01/18/2013	1H0101	ID - TRANSPC 184_INT	R	Hydraulic	1VT485	NOT SUPPL	REPLACE HYD HOSE & FITTINGS	REPLACE HOSE AND FITTINGS ON MACK WATER TRUCK AT RUSHY LAGOON. WORK CARRIED OUT BY ENZED LAUNCESTON.	65	0	656.72	0	721.72
130111-00 SVC00103	01/15/2013	1H0101	ID - TRANSPC 184_INT	R	Engine	1VT485	NOT SUPPL	SUPPLY & TOP UP ENGINE OIL	SUPPLY & TOP UP ENGINE OIL. WORK CARRIED OUT BY ATH ENGINEERING.	32.5	0	179.5	0	212
121213-00 SVC00102	01/08/2013	1H0101	ID - TRANSPC 186_INT	R	Tyres	1VT485		295/80-22.5 BDRHT BANDAG CUS +	295/80-22.5 BDRHT BANDAG CUS + FITTING + SCRAP + CASE STOCK 295-80R22.5 + LABOUR(TRAVEL)	0	1326.8	0	0	1326.8
121210-00 SVC00101	12/20/2012	1H0101	ID - TRANSPC 184_INT	R	Sundries	1VT485		TIGHTEN LOOSE DRIBBLE BAR	TRAVEL TO MUSSELROE. TIGHTEN LOSE DRIBBLE BAR. UNBLOCK REAR WATER PIPE ASSEMBLY.	419.5	10	0	48	477.5
121015-00 SVC00098	11/27/2012	1H0101	ID - TRANSPC 184_INT	R	Engine	1VT485	NOT SUPPL	REPAIR HEAT EXCHANGER LEAK	TRAVELLED TO MUSSELROE. CHECKED FOR COOLANT LOSS. REMOVED HEAT EXCHANGER. REFITTED HEAT EXCHANGER. REFILLED UNIT WITH COOLANT.	975	197.08	85	72	1329.08

121106-00 SVC00100	11/27/2012	1H0101	ID - TRANSPC 184_INT	R	Steering	1VT485		REPAIR REAR STEERING ASSIST	TRAVELLED TO MUSSELROE. INSPECTED FOR FAULTY BALL JOINT. REMOVED TIE ROD LH SIDE AND DISASSEMBLE. INCORRECT KIT FOR BALL JOINT. REMOVED RH STEER CYLINDER BALL JOINT AND REKIT. REASSEMBLE. REPAIR AIR LEAK ON DIFF LOCK. FITTED UP CORRECT BALL JOINT AND GREASED AS NECESSARY.	1166	412.64	0	48	1626.64
121107-00 SVC00100	11/27/2012	1H0101	ID - TRANSPC 184_INT	R	Suspensior	1VT485	757303 KLI	REPAIR BROKEN RHR STEER SPRING	REPAIR BROKEN RHR STEER SPRING. WORK CARRIED OUT BY AUSPRING.	65	0	601.81	0	666.81
121125-00 SVC00100	11/27/2012	1H0101	ID - TRANSPC 184_INT	R	Electrical	1VT485	4640 HRS	REPAIR REVOLVING LIGHT & WIRE	TRAVELLED TO MUSSELROE. REPAIRED REVOLVING LIGHT AS REQUIRED.	73.5	10	0	48	131.5
121001-00 SVC00099	10/30/2012	1H0101	ID - TRANSPC 184_INT	R	Trimming	1VT485	4386	REPLACE SEAT	TRAVELLED TO MUSSELROE. MEASURED UP SEAT FOR REPLACEMENT SEAT. TOPPED UP ENGINE OIL/HYDRAULIC OIL. TRAVEL BACK TO SITE. DISMANTLE AND REMOVE SEAT. FIT UP NEW SEAT AND PUMP UP AIR AND TEST OPERATION.	356.25	1423.2	0	129.6	1909.05
121009-00 SVC00098	10/10/2012	1H0101	ID - TRANSPC 184_INT	S	Service	1VT485	757303	S1 B SERVICE	SERVICE, GREASE AND CHECK OVER UNIT AS PER SCHEDULE. WORK CARRIED OUT BY AB ENGINEERING.	65	0	451.98	0	516.98
121009-00 SVC00098	10/10/2012	1H0101	ID - TRANSPC 184_INT	R	Sundries	1VT485	757303	REPAIR CAB JACK & MISC REPAIRS	REPAIR GUARD BRACKETS AND REPLACE BOLTS. FIT CAB JACK PARTS, ORGANISE MACHINING REPAIR STARTER SYSTEM AND STOPPER SYSTEM. STOP AND REPAIR LH CAB LOCK AS IT SEIZED UP WHEN FITTED. NEW PARTS TO RH SIDE. WORK CARRIED OUT BY AB ENGINEERING.	65	0	797.5	0	862.5
120904-00 SVC00096	09/12/2012	1H0101	ID - TRANSPC 184_INT	R	Engine	1VT485	NOT SUPPL	REPLACE STOPPER CABLE	TRAVELLED TO MUSSELROE. FOUND BROKEN STOPPER CABLE. REPLACED CABLE AND TEST.	145	177.09	0	48	370.09
120831-00 SVC00096	09/04/2012	1H0101	ID - TRANSPC 184_INT	R	Sundries	1VT485		REPAIR WATER TANK WATER PUMP	TRAVELLED TO MUSSELROE. CHECK OVER WATER PUMP. DISMANTLE PUMP AND REMOVE STEEL FROM INSIDE IMPELLA, REASSEMBLE AND TEST.	424.5	46.06	0	48	518.56
120813-00 SVC00094	08/16/2012	1H0101	ID - TRANSPC 184_INT	R	Sundries	1VT485	4061	REPLACE SUPPLIED WATER HOSE	TRAVELLED TO MUSSELROE. REPLACED LEAKING WATER PIPE AND CHECKED OVER UNIT.	214	0	0	45	259
120806-00 SVC00094	08/07/2012	1H0101	ID - TRANSPC 184_INT	R	Engine	1VT485	4284	TOP UP ENGINE OIL AND CHECK	TRAVELLED TO MUSSELROE. TOPPED UP ENGINE OIL. DID GENERAL CHECKOVER	138	34.83	0	22.5	195.33
120618-00 SVC00092	07/11/2012	1H0101	ID - TRANSPC 184_INT	R	Sundries	1VT485	4511	REPLACE U/S DELIVERY HOSE	TRAVEL TO MUSSELROE. REMOVE BROKEN BOLT FROM SPRAY BAR. REFIT NEW BOLT.	181.5	10	0	45	236.5
120704-00 SVC00092	07/04/2012	1H0101	ID - TRANSPC 184_INT	R	Suspensior	1VT485	NOT SUPPL	REPLACE WORN SPRING PARTS	MAKE TEMPORARY REPAIRS TO CAB MOUNT. TOOK TO AUSPING, STRIPPED FRONT END, REPLACED COMPONENTS THAT WERE WORN OUT. WE RETRIEVED TO SCOTTSDALE. GREASED AND CHECKED OVER. WORK CARRIED OUT BY AB ENGINEERING.	59	0	2958.06	0	3017.06
120518-00 SVC00089	05/23/2012	1H0101	ID - TRANSPC 186_INT	R	Tyres	1VT485		TYRE DISPOSAL X 10	TYRE DISPOSAL X 10 RUBAND 67177 18/05/2012	0	120	0	0	120

120521-00 SVC00089	05/23/2012	1H0101	ID - TRANSPC 186_INT	R	Tyres	1VT485		REPLACE TYRES & PUNCTURE	REPLACE TYRES & PUNCTURE REPAIR BEAUREPAIRS INVOICES 6403449219 \$197.54 6403387845 \$1834.36 6403425505 \$1052.96	0	2804.41	0	0	2804.41
120511-00 SVC00089	05/21/2012	1H0101	ID - TRANSPC 184_INT	R	Electrical	1VT485	4053 HRS	REPAIR STARTING FAULT & REPAIR	TRAVEL TO MUSSELROE BAY. RE-CLAMP HOSES, MAKE ADAPTORS AND TIGHTEN REAR GUARDS. REPAIR STARTER NEUTRAL SWITCH WIRING	329	97.51	0	27	453.51
120516-00 SVC00089	05/18/2012	1H0101	ID - TRANSPC 184_INT	R	Hydraulic	1VT485	757303 KLI	Replace hydraulic hose	MADE HYDRAULIC HOSE FOR UNIT. WORK CARRIED OUT BY ENZED.	59	0	56.12	0	115.12
120501-00 SVC00088	05/08/2012	1H0101	ID - TRANSPC 186_INT	R	Sundries	1VT485		SUPPLY ENGINE OIL & HYD OIL	SUPPLY ENGINE OIL & HYD OIL AS REQUESTED BY JASON CARNES 101-6122	0	148.4	0	0	148.4
120426-01 SVC00088	04/28/2012	1H0101	ID - TRANSPC 184_INT	R	Sundries	1VT485	3990	WELD UP GUARD BRACKETS	WELD GUARD FRAME MOUNTS AND BRACKETS, CHECK OUT FRONT END, MASSIVE TYRE WEAR ON REAR STEER AXLE, FRONT SPRING HANGER BUSHES IN REAR STEER U/S	276	25	0	18	319
120426-01 SVC00088	04/27/2012	1H0101	ID - TRANSPC 186_INT	R	Tyres	1VT485		TYRE REPAIRS - BEAUREPAIRS	SUPPLY 295/80R22.5 152/148K SP382 DUN 11R22.5 REMINGTON R377 148/145L 16 TL CALLOUT TO WINDFARM TUBLESS VALVE TRUCK FITTING	0	1365.4	0	0	1365.4
120405-00 SVC00087	04/17/2012	1H0101	ID - TRANSPC 184_INT	R	Transmissio	1VT485		Top up transmission oil	ONSITE AT MUSSELROE BAY. TOPPED UP TRANSMISSION OIL AND CHECKED FOR LEAKS	69	116.6	0	0	185.6
120414-00 SVC00087	04/17/2012	1H0101	ID - TRANSPC 184_INT	R	Sundries	1VT485	3941 HRS	WELD BROKEN MUD GUARD BRACKETS	ONSITE AT MUSSELROE BAY. WELD BROKEN MUD GUARD BRACKETS	217.5	20	0	0	237.5
120405-00 SVC00087	04/13/2012	1H0101	ID - TRANSPC 186_INT	R	Tyres	1VT485	N/A	TYRE REPAIRS - RUBAND 66385	SUPPLY AND FIT 4 TYRES AS REQUIRED	0	1000	0	0	1000
120105-00 SVC00085	03/20/2012	1H0101	ID - TRANSPC 184_INT	S	Service	1VT485	3808 HRS	S1 B SERVICE	TRAVELLED TO PULP MILL SITE. CARRIED OUT SERVICE AS PER SCHEDULE. INSPECT CAB JACK FAULT. INSPECT TANK MOUNT CRACKS AND BEGIN WORK ON GETTING CAB UP. UNHOOK BROKEN CAB LOCK AND BLEED JACK SYSTEM.	890.5	281.09	0	138.5	1310.09
111004-00 SVC00077	10/07/2011	1H0101	ID - TRANSPC 184_INT	R	Electrical	1VT485	NOT SUPPL	JUMP START FLAT BATTERIES	CJD EQUIPMENT TO JUMP START UNIT	29.5	0	605.61	0	635.11
110805-00 SVC00075	08/17/2011	1H0101	ID - TRANSPC 187_INT	F	Electrical	1VT485	757,303 kn	FIT UP HEATER LOOM	FIT UP HEATER LOOM. Travel to breadalbane and check heater. Run new loom for heater into cab. Heater from Ashdowns.	207	172	0	90	469
110708-00 SVC00073	07/20/2011	1H0101	ID - TRANSPC 186_INT	R	Sundries	1VT485		CHECK OVER READY FOR WORK	REMOVE AND REPLACE U/S BATTERY AS REQUIRED	677	333.55	0	0	1010.55
110512-00 SVC00071	06/16/2011	1H0101	ID - TRANSPC 186_INT	R	Engine	1VT485		CHECK AIR STARTER SYSTEM	REMOVE TAIL LIGHTS AND FIT NEW LED'S tested operation , checked for leaks , checked condition of components, all ok .	65	0	0	0	65

110303-00 SVC00068	05/10/2011	1H0101	ID - TRANSPC 186_INT	S	Service	1VT485	3400 hrs	S1 B SERVICE	S1 B SERVICE. Completed service as per service sheet. Tightened loose fuel lines near pump and power steering hoses. Straighten left hand fornt mud gaurd bracket. Repaired lights and fitted new pump out lot hose.	713	257.91	0	2.7	973.61
110225-00 SVC00065	02/28/2011	1H0101	ID - TRANSPC 122_INT	R	Tyres	1VT485	NA	TYRE REPAIRS RUBAND 56031	TYRE REPAIRS RUBAND 56031	0	115	0	0	115
110225-00 SVC00065	02/28/2011	1H0101	ID - TRANSPC 122_INT	R	Tyres	1VT485	3359	TYRE REPAIRS RUBAND 56809	TYRE REPAIRS RUBAND 56809	0	100	0	0	100
110207-00 SVC00064	02/22/2011	1H0101	ID - TRANSPC 184_INT	R	Brake	1VT485	3266	Replace leaking brake booster	7/2/11 - TRAVELLED TO BRIGHTON AND CHECKED AIR LEAK WHICH WAS FOUND IN RIGHT HAND REAR BOOSTER. 8/2/11 - TRAVELLED TO BRIGHTON AND REMOVED AND REPLACED RIGHT HAND REAR BRAKE BOOSTER	241.5	60	0	58.5	360
110112-00 SVC00056	02/16/2011	1H0101	ID - TRANSPC 186_INT	R	Sundries	1VT485	757,303K 3	REPAIR THE A/C SYSTEM.	The truck was brought in for an air conditioner repair, the system was disassembled. The operator carried on and wanted the vehicle. Hence the system is still in parts and the truck was returned to service with out a air conditioner.	1334	403.88	0	0	1737.88
110110-00 SVC00063	01/25/2011	1H0101	ID - TRANSPC 186_INT	S	Service	1VT485	3111hrs 7	B SERVICE	Carry out the required service and repairs. Broken wheel stud was removed and replaced. Repaired the reverse lights. Straightened the lh guard. The seat base was sent out to be recovered. The water tank had to be drained. The a/c system was tested. The cab lift system was repaired.	872	494.77	275	0	1641.77
110112-00 SVC00063	01/20/2011	1H0101	ID - TRANSPC 122_INT	R	Tyres	1VT485	757302	TYRE REPAIRS RUBAND 54344	TYRE REPAIRS RUBAND 54344	0	40	0	0	40
101123-00 SVC00061	11/29/2010	1H0101	ID - TRANSPC 122_INT	R	Tyres	1VT485	217200- H	TYRE REPAIRS RUBAND 53980	TYRE REPAIRS RUBAND 53980	0	475	0	0	475
101105-00 SVC00060	11/17/2010	1H0101	ID - TRANSPC 184_INT	R	Engine	1VT485	2776HRS	CHECK AND REPAIR FUEL LEAK	TRAVELLED TO BRIGHTON. CHECKED FUEL LEAK AND FOUND FUEL FILTER LEAKING. PICKED UP FILTER FROM WORKSHOP AND FITTED FILTER TO UNIT AND BLED	176	0	0	51.3	227.3
101117-00 SVC00060	11/17/2010	1H0101	ID - TRANSPC 122_INT	R	Sundries	1VT485		STORE ISSUE NOV PG 101-3453	STORE ISSUE NOV PG 101-3453	0	6.08	0	0	6.08
101101-00 SVC00060	11/12/2010	1H0101	ID - TRANSPC 186_INT	S	Service	1VT485	2746 hrs 7	S1 B SERVICE	S1 B SERVICE Completed service a sper service sheet. Repair pipe and water hose leak. Repair leak at header tank. Reseal leaking bearing cover caps steer axle.	480.5	265.15	0	2.7	748.35
101110-00 SVC00060	11/10/2010	1H0101	ID - TRANSPC 122_INT	R	Tyres	1VT485	2768HRS	FIT CUSTOMER OWN PRODUCT	FIT CUSTOMER OWN PRODUCT	0	135	0	0	135
101026-00 SVC00059	11/04/2010	1H0101	ID - TRANSPC 184_INT	R	Electrical	1VT485	27072HRS	REPLACE DEFECTIVE ALTERNATOR	TRAVELLED TO BRIGHTON. CHECK NON START FAULT. FOUND ALTERNATOR NOT CHARGING. FIT NEW ALTERNATOR AND CHECK CHARGE RATE. REPAIRED AIR LEAK ON CHASSIS	310.5	191.67	0	0	502.17
100928-00 SVC00058	10/28/2010	1H0101	ID - TRANSPC 182_INT	R	Sundries	1VT485		REPAIR ALLY SUB FRAME	REPAIR ALLY SUB FRAME	118	0	0	0	118

100930-00 SVC00058	10/27/2010	1H0101	ID - TRANSPC 186_INT	R	Brake	1VT485	757,303km	REPLACE COMPRESSOR	Replaced compressor, celaned oil build up from wet tank, run in compressor and check for leaks. Compressor is not easy to change as it is situated down behind the chassis rails.	888	1643.28	0	0	2531.28
101014-00 SVC00059	10/15/2010	1H0101	ID - TRANSPC 184_INT	R	Engine	1VT485	2636 HRS	FILL AIR SYSTEM AND START UNIT	TRAVELLED TO BRIGHTON. RECHARGE AIR AND START. TOPPED UP ENGINE OIL	103.5	18.78	0	17.1	139.38
100927-00 SVC00058	09/30/2010	1H0101	ID - TRANSPC 186_INT	R	Sundries	1VT485	2625hr	Repairs as per list	Repairs as per the fault sheet. Checked the front end and greased.. Resealed the front wheel caps due to an oil leak. Retensioned the fuel filter. Checked the second axle for damage, and checked the wheels for a wobble. Repaired the brake light wiring and replaced a globe. The frame was welded the hose real was tensioned, oil leaking at the top of the steering box was cleaned.	442.5	3.55	0	0	446.05
100910-00 SVC00057	09/10/2010	1H0101	ID - TIP TRUC 184_INT	R	Engine	1VT485	2443 HRS	CHECK & REPAIR FUEL LEAK	TRAVELLED TO BRIGHTON. PUMP UP AIR TANK AND BLEED FUEL SYSTEM	143.5	0	0	40.5	184
100830-00 SVC00056	09/03/2010	1H0101	ID - TIP TRUC 184_INT	R	Engine	1VT485	2437	CHECK UNIT FOR START FAULT	TRAVELLED TO BRIGHTON. CHECK START FAULT AND RECHARGE AIR SYSTEM	98.5	15.73	0	34.2	148.43
100813-00 SVC00056	08/23/2010	1H0101	ID - TIP TRUC 186_INT	R	Sundries	1VT485	2366 hr 75	Repairs as per list	Repair the reverse lights.	29.5	0	0	0	29.5
100813-00 SVC00055	08/23/2010	1H0101	ID - TIP TRUC 186_INT	S	Service	1VT485	757303 LKI	S1 B SERVICE	Service unit as required. The central max filter was not replaced, In the attemp to undo the filter two filter straps were broken and an hoor lost in tring to remove the filter. The power steering pump was retensioned. The window washer system was repaired.	772.75	257.71	0	2.7	1033.16
100820-00 SVC00056	08/23/2010	1H0101	ID - TIP TRUC 184_INT	R	Radio	1VT485	2341 HRS	REPAIR UHF RADIO OPERATION	ONSITE AT BRIGHTON. CHECKED RADIO OPERATION AND FOUND AERIAL UNSERVICABLE. PICK UP AERIAL FROM HUB WORKSHOP AND TRAVEL TO INTERCHANGE AND FIT TO TRUCK. RECHARGE AIR SYSTEM TO START UNIT	98.5	0	0	0	98.5
100813-00 SVC00055	08/16/2010	1H0101	ID - TIP TRUC 184_INT	R	Engine	1VT485	2293 HRS	PUMP UP TANK & START UNIT	TRAVELLED TO BRIGHTON. PUMP UP AIR TANK AND START UNIT	105.5	0	0	18	123.5
100709-00 SVC00055	08/05/2010	1H0101	ID - TIP TRUC 184_INT	R	Engine	1VT485	2130 HRS	PUMP UP TANK AND START UNIT	FABRICATE AIR FITTING, PUMP UP AIR TANK AND START UNIT	140	113.35	0	0	253.35
100723-00 SVC00054	07/27/2010	1H0101	ID - TIP TRUC 184_INT	R	Electrical	1VT485	4304 HR	JUMP START & CHECK CHARGE RATE	TRAVELLED TO BRIGHTON. JUMP START UNIT AND CHECK CHARGE RATE AND TOP UP ENGINE OIL	102	12.68	0	18	132.68
100720-00 SVC00054	07/23/2010	1H0101	ID - TIP TRUC 122_INT	R	Tyres	1VT485	N/A	TYRE REPAIRS RUBAND 49959	TYRE REPAIRS RUBAND 49959 + REFER DARREN JACOBS - 2801451	0	450	0	0	450
100719-00 SVC00054	07/20/2010	1H0101	ID - TIP TRUC 184_INT	R	Bodywork	1VT485	14855 HRS	REPAIR R/H DOOR LOCK ETC	TRAVELLED TO BRIGHTON. REMOVE DRIVER DOOR LOCK AND CARRY OUT TEMP REPAIRS. REFIT NEW LOCK AND REFIT DOOR. PUMP AIR TANK AND START. ADJUST DOOR STRICKER	350.5	0	0	24.3	374.8

100719-00 SVC00054	07/19/2010	1H0101	ID - TIP TRUC 184_INT	R	Engine	1VT485		Check engine oil level	TRAVELLED TO WORKSHOP AND CHECK ENGINE OIL LEVEL AND TOP UP	34.5	6.46	0	3.6	44.56
100621-00 SVC00053	07/16/2010	1H0101	ID - TIP TRUC 186_INT	R	Suspensor	1VT485		Repair broken spring	Remove and repair broken spring Replace left brake hub Repaired fuel leak Straighten bent tie rod on second axle	2198	132.71	0	0	2330.71
100621-00 SVC00054	07/16/2010	1H0101	ID - TIP TRUC 186_INT	R	Suspensor	1VT485		Repair broken spring	RETURN ON INSULATOR SVC00053322	0	-108	0	0	-108
100708-00 SVC00053	07/14/2010	1H0101	ID - TIP TRUC 122_INT	R	Tyres	1VT485	213000	TYRE REPAIRS RUBAND 50572	TYRE REPAIRS RUBAND 50572	0	475	0	0	475
100423-00 SVC00048	07/08/2010	1H0101	ID - TIP TRUC 186_INT	S	Service	1VT485	1640hr 757	S1 B SERVICE	Carry out the required service and minor faults. Several brake air lines were replaced.	787	554.14	0	2.7	1343.84
100423-00 SVC00053	07/08/2010	1H0101	ID - TIP TRUC 186_INT	S	Service	1VT485	1640hr 757	S1 B SERVICE	LABOUR MISSING FROM ORIGINAL SERVICE INVOICE SVC00048564	444	0	0	0	444
100624-00 SVC00052	06/29/2010	1H0101	ID - TIP TRUC 182_INT	R	Sundries	1VT485		REPAIR SPRING HANGER	REPAIR SPRING HANGER AS NEEDED	27.5	0	0	0	27.5
100625-00 SVC00052	06/29/2010	1H0101	ID - TIP TRUC 184_INT	R	Engine	1VT485	14841 HRS	RECHARGE & START UNIT	CHANGE AIR TANKS TO START UNIT	63.5	0	0	0	63.5
100615-00 SVC00052	06/16/2010	1H0101	ID - TIP TRUC 186_INT	R	Steering	1VT485		REPLACE STEERING BOX	Remove the steering box from the dead truck and fitted to the water cart.	260	31.68	0	0	291.68
100520-00 SVC00050	05/27/2010	1H0101	ID - TIP TRUC 186_INT	R	Steering	1VT485	14830	REPAIR LEAK AT STEERING BOX	Remove and repair the steering box, repair the axle cover oil leak. Topped up oils and tested all ok.	472.5	164.69	0	0	637.19
100517-01 SVC00050	05/18/2010	1H0101	ID - TIP TRUC 184_INT	R	Hydraulic	1VT485		REPAIR OIL LEAK FROM PTO PUMP	TRAVELLED TO BRIGHTON. REPAIR OIL LEAK FOR PTO PUMP. PUMP UP FLAT TYRE	99	0	0	13.5	112.5
100517-01 SVC00050	05/18/2010	1H0101	ID - TIP TRUC 184_INT	R	Tyres	1VT485		PUMP UP RHRF DRIVE TYRE	TRAVELLED TO MACHINE. PUMP UP RIGHT HAND REAR DRIVE TYRE AND TOP UP ENGINE OIL	66	9.72	0	0	75.72
100518-00 SVC00050	05/18/2010	1H0101	ID - TIP TRUC 184_INT	R	Ancillary Ec	1VT485		REPAIR LHF GUARD	TRAVELLED TO BRIGHTON. JUMP START WATER CART. REPAIR LEFT HAND FRONT GUARD AND REPAIR MIRROR BRACKET	168	0	0	22.5	190.5
100517-01 SVC00049	05/17/2010	1H0101	ID - TIP TRUC 184_INT	R	Tyres	1VT485		INFLATED POS 3 TYRE	TRAVELLED TO UNIT AND PUMP UP POSITION 3 TYRE	66	0	0	0	66
100507-00 SVC00049	05/13/2010	1H0101	ID - TIP TRUC 184_INT	R	Brake	1VT485	1640 hrs	REPLACE AIR BRAKE HOSES	24/04/2010 - REPLACE AIRBRAKE HOSES ON UNIT AT WORKSHOP	13.75	0	309.66	0	323.41
100427-00 SVC00049	05/10/2010	1H0101	ID - TIP TRUC 122_INT	R	Tyres	1VT485	NA	FIT CUSTOMER OWN PRODUCT	FIT CUSTOMER OWN PRODUCT	0	20	0	0	20
100331-00 SVC00048	04/26/2010	1H0101	ID - TIP TRUC 184_INT	R	Engine	1VT485	1466	REPLACE BROKEN ENGINE MT BOLTS	TRAVELLED TO BRIGHTON. REMOVE SPRING HANGER PIN FROM WRECK IN WORKSHOP. REMOVE ENGINE MOUNTS AND BROKEN BOLTS. REPAIR REAR MUDGUARD BRACKETS. REPAIR ENGINE MOUNT BOLT ON RIGHT HAND SIDE AND REFIT. REPLACE RIGHT HAND SPRING HANGER PIN	1096.5	0	225	63	1384.5
100401-01 SVC00048	04/21/2010	1H0101	ID - TIP TRUC 122	PROCU R	Tyres	1VT485	757302	TYRE REPAIRS RUBAND 49130	TYRE REPAIRS RUBAND 49130	0	3790	0	0	3790
100331-00 SVC00047	04/13/2010	1H0101	ID - TIP TRUC 122_INT	R	Tyres	1VT485	NA	FIT CUSTOPMER OWN PRODUCT	FIT CUSTOPMER OWN PRODUCT	0	90	0	0	90
100331-00 SVC00047	04/13/2010	1H0101	ID - TIP TRUC 122_INT	R	Tyres	1VT485	NA	FIT CUSTOMER OWN PRODUCT	FIT CUSTOMER OWN PRODUCT	0	90	0	0	90
100316-00 SVC00046	03/30/2010	1H0101	ID - TIP TRUC 184_INT	R	Sundries	1VT485	1377 HRS	Repairs to spray bar	TRAVELLED TO BRIGHTON AND CHANGE OUT AIR FITTING FOR SPRAY BAR	93.5	29.84	0	13.5	136.84
100319-00 SVC00046	03/30/2010	1H0101	ID - TIP TRUC 186_INT	S	Service	1VT485	1384hrs 7	CARRY OUT SERVICE	Carried out B service as per service sheet. Repair various air leaks on water fansand seat. Repaired water leak at rear fan. Tightened uni joint at gearbox.	121	165.61	0	2.7	289.31

100322-00 SVC00046	03/30/2010	1H0101	ID - TIP TRUC 182_INT	R	Trays/Buck	1VT485		WELD UP CRACKS IN TANK CHASIS	WELD UP CRACKS IN TANK CHASSIS	259	0	0	0	259
100209-00 SVC00044	03/24/2010	1H0101	ID - TIP TRUC 122_INT	R	Tyres	1VT485	12414	TYRE REPAIRS RUBAND 47428	TYRE REPAIRS RUBAND 47428	0	230	0	0	230
100323-00 SVC00046	03/24/2010	1H0101	ID - TIP TRUC 184_INT	R	Electrical	1VT485	1225	JUMP START UNIT ETC	TRAVELLED TO BRIGHTON AND JUMP START UNIT AND PUMP UP TYRES	135.5	0	0	13.5	149
100211-00 CR000123	03/16/2010	1H0101	ID - TIP TRUC 184FIELDS	R	Tyres	1VT485	N/A	PUMP UP FLATE TYRE	Credit invoice SVC00044166 charged to John Holland Hazell Bros Joint Venture, reinvoice to 1H0101 as per Wayne Goss	0	0	0	0	0
100211-00 SVC00044	03/16/2010	1H0101	ID - TIP TRUC 184FIELDS	R	Tyres	1VT485	N/A	PUMP UP FLATE TYRE	UNIT: 1VT485	60	0	0	0.02	60.02
									ODOMETER NOT AVAILABLE					
									TRAVELLED TO BRIGHTON TO PUMP UP FLAT TYRE					
100211-00 SVC00046	03/16/2010	1H0101	ID - TIP TRUC 184FIELDS	R	Tyres	1VT485	N/A	PUMP UP FLATE TYRE	Travelled to Brighton to pump up flat tyre	55	0	0	13.5	68.5
100217-00 SVC00044	03/15/2010	1H0101	ID - TIP TRUC 184_INT	R	Electrical	1VT485	1202	Replace batteries	TRAVELLED TO BRIGHTON AND CHANGE OUT BATTERY, REPLACE BROKEN BOLTS IN STEER ASSIST CYLINDER AND SHOCKIE MOUNT AND JUMP START UNIT	364	122.8	0	63	549.8
100305-00 SVC00046	03/12/2010	1H0101	ID - TIP TRUC 122_INT	R	Tyres	1VT485	10416	FIT CUSTOMER OWN PRODUCT	FIT CUSTOMER OWN PRODUCT	0	90	0	0	90
100305-00 SVC00046	03/11/2010	1H0101	ID - TIP TRUC 122_INT	R	Tyres	1VT485	757303	FIT CUSTOMER OWN PRODUCT	FIT CUSTOMER OWN PRODUCT	0	110	0	0	110
091215-00 SVC00044	02/17/2010	1H0101	ID - TIP TRUC 186_INT	R	Sundries	1VT485	757,302KM	VEHICLE INSPECTION	Inspect and carry out minor repairs.	750.75	195.83	0	0	946.58
									Greased the unit Repaired the tail lights					
									Replaced the reverse beeper checked for air leaks.					
									Replaced the quick release valve with s second hand unit.					
100210-00 SVC00044	02/17/2010	1H0101	ID - TIP TRUC 186_INT	R	Suspensior	1VT485		Suspension repairs	Removed the right front spring hanger from the spare parts truck, the failed unit came in and the broken parts were removed the second hand parts were installed and the unit inspected and greased.	1719	36.94	0	0	1755.94
100209-00 SVC00044	02/16/2010	1H0101	ID - TIP TRUC 184_INT	R	Sundries	1VT485	1137	REPLACE OUTER HUB SEAL	TRAVELLED TO BRIGHTON AND INSPECT LEAKING RIGHT HAND SIDE 2ND STEER OUTER HUB SEAL. FOUND TO HAVE CRACKED SIGHT GLASS. SOURCE NEW HIUB SEAL AND FIT. TOP UP WITH OIL AND CHECK FOR CRACKS	201	24.5	0	27	252.5
100129-01 SVC00043	02/09/2010	1H0101	ID - TIP TRUC 186_INT	S	Service	1VT485	1077h 757,	S1 B SERVICE	Service unit as required "B" type	193	227.91	0	2.7	423.61
100205-00 SVC00044	02/09/2010	1H0101	ID - TIP TRUC 184_INT	R	Engine	1VT485	1055	CHECK OVERHEATING FAULT	TRAVELLED TO BRIGHTON AND CHECK OVER AIR CON AND BLOW OUT AND TEST	126.5	0	0	13.5	140
100129-00 SVC00043	02/05/2010	1H0101	ID - TIP TRUC 122_INT	R	Tyres	1VT485	8547	Puncture repair	PUNCTURE REPAIR	0	95	0	0	95
100201-01 SVC00043	02/04/2010	1H0101	ID - TIP TRUC 184_INT	R	Sundries	1VT485	1019	REMOVE BROKEN STEP SPRAY BAR	ONSITE AT BRIGHTON TO REMOVE BROKEN STEP FROM REAR SPRAY BAR	63.5	0	0	0	63.5
100115-00 SVC00042	01/29/2010	1H0101	ID - TIP TRUC 122_INT	R	Sundries	1VT485		PARTS AS PER REQ 101-1567	PARTS AS PER REQ 101-1567	0	148.31	0	0	148.31
100122-00 SVC00043	01/29/2010	1H0101	ID - TIP TRUC 122_INT	R	Tyres	1VT485	8126	Puncture repair	PUNCTURE REPAIR	0	110	0	0	110
100129-00 SVC00043	01/29/2010	1H0101	ID - TIP TRUC 122_INT	R	Tyres	1VT485	8247	FIT CUSTOMER OWN PRODUCT	FIT CUSTOMER OWN PRODUCT	0	80	0	0	80
091218-00 SVC00041	01/11/2010	1H0101	ID - TIP TRUC 122_INT	R	Sundries	1VT485		STORE ISSUE DEC.PG REQ.1422,	STORE ISSUE DEC.PG REQ.1422,	0	68.48	0	0	68.48
091023-00 SVC00038	12/23/2009	1H0101	ID - TIP TRUC 184_INT	R	Bodywork	1VT485	531HRS	SUPPLY & FIT LHD SCREEN	cut supply & fit left hand screen	13.75	54	421.61	0	489.36
091221-00 SVC00041	12/22/2009	1H0101	ID - TIP TRUC 187_INT	R	Ancillary Ec	1VT485		S/C 091108-0002 SUBLET QUINN	S/C 091108-0002 SUBLET QUINN	0	0	566	0	566

091029-00 SVC00039	11/27/2009	1H0101	ID - TIP TRUC 184_INT	R	Bodywork	1VT485		REPAIRS TO DOOR LATCH	REPAIRS TO DOOR LATCH. check locking mechanism and order new lock wedge. put in temp wedge. 6/11/09 fit new wedge to door and adapt bracket to hold in lock. parts from websters	124	17.17	0	0	141.17
091106-00 SVC00039	11/27/2009	1H0101	ID - TIP TRUC 184_INT	S	Service	1VT485	651 hrs 48¢	SERVICE B	CARRY OUT SERVICE B AS PER SCHEDULE. grease adjust brakes. check eng oil leak, no major leaks found, front seal leaking slightly. batteries down need to replace in future.	55	233.85	0	0	288.85
091108-00 SVC00040	11/27/2009	1H0101	ID - TIP TRUC 184_INT	R	Electrical	1VT485	654 hrs	REPLACE REVOLVING LIGHT ON REAR	CARRY OUT REPAIRS TO REPLACE REVOLVING LIGHT ON REAR.parts through ashdowns travel 60 kms	165	103.65	0	54	322.65
091120-00 SVC00040	11/27/2009	1H0101	ID - TIP TRUC 184_INT	R	Sundries	1VT485	725 hrs	REPLACE SEAT BELT DRIVERS SIDE	REPLACE SEAT BELT DRIVERS SIDE. Travel to Deloraine and replace seat belt, parts supplied through NWTC	82.5	90	0	54	226.5
091029-00 SVC00039	11/11/2009	1H0101	ID - TIP TRUC 184_INT	R	Electrical	1VT485	651 hrs	REPAIRS TO REVERSE LIGHT	REPAIRS TO REVERSE LIGHT. check switch and order new one through websters. 6/11/09 fit switch to shift controls. adapt mount.	168.5	88.84	0	0	257.34
091108-00 SVC00039	11/11/2009	1H0101	ID - TIP TRUC 184_INT	R	Electrical	1VT485	651 hrs	CHECK STARTING AND REPLACE IGN	CHECK STARTING AND REPLACE IGNITION SWITCH. parts from websters. switch charged out on s/c 091029-0081 repair wiring	192.5	0	0	0	192.5
091108-00 SVC00039	11/11/2009	1H0101	ID - TIP TRUC 184_INT	R	Ancillary Ec	1VT485	651 hrs	REPAIRS TO WATERPUMP ON REAR	REPAIRS TO WATERPUMP ON REAR.get truck to burnie. check operation of waterpump and hydraulic motor. found to be seized up. remove pump and impeller and found bits of aluminium behind impeller. reassembled and got quinn eng to repair impeller bearing mount and ,make and fit better pump mount and drive guard. shim up hyd motor and test operation. M.Laatz to get flanges made up in hobart for easy pump removal.	302.5	0	0	0	302.5
091029-00 SVC00038	11/04/2009	1H0101	ID - TIP TRUC 184_INT	R	Ancillary Ec	1VT485		DRIVE COUPLING REPLACED ON WAT	DRIVE COUPLING REPLACED ON WATER PUMP. Travel to Deloraine and check coupling between hyd motor and waterpump. remove travel 240kms 28/10/09 get coupling from fluidpower services and take to deloraine and fit travel 240kms	388.5	132.6	0	432	953.1
091014-00 SVC00038	10/27/2009	1H0101	ID - TIP TRUC 184_INT	R	Bodywork	1VT485	531 hrs	REPLACE REAR MUDGUARDS	SUPPLY AND REPLACE REAR MUDGUARDS	691	200	0	0	891

091007-00 SVC00038	10/26/2009	1H0101	ID - TIP TRUC 184_INT	R	Hydraulic	1VT485	531	CHECK & REPAIR PTO OPERATION	CHECK & REPAIR PTO OPERATION. travel to deloraine and check pto operation. test wiring, switches ,solenoid, oil level.pressure to and from solenoid. output of hydraulic pump and hoses. truck sent to w/shop in burnie. travel 240 kms 08/10/09 remove pto and pump from truck, found both drive shafts worn beyond repair. strip pto and order parts through peter stelfox. 13/10/09 reassembled pto with supplied parts and replaced hydraulic pump. fitted up to unit and tested ok.	966.5	2025	0	216	3207.5
090515-00 SVC00029	09/22/2009	1H0101	ID - TIP TRUC 184_INT	R	Ancillary Ec	1VT485	3337	FIT UP L/H WIPER ARM & LOCKS	FIT UP L/H WIPER ARM & LOCKS : TRAVEL TO DELORAINE. FIT UP NEW L/H WIPER ARM ASSEMBLY AND NEW L/H AND R/H DOOR LOCKS.	168.5	0	0	108	276.5
090903-00 SVC00035	09/04/2009	1H0101	ID - TIP TRUC 122_INT	R	Tyres	1VT485	2717	REFIT STEER WHEELS	REFIT STEER WHEELS	0	27.27	0	0	27.27
090817-00 SVC00034	08/27/2009	1H0101	ID - TIP TRUC 184_INT	R	Electrical	1VT485	2657	REPAIR INDICATOR LEVER	REPAIR INDICATOR LEVER : WHILEIST AT DELORAINE. CARRIED OUT REPAIRS TO INDICATOR LEVER ASSEMBLY AND TEST.	137.5	0	0	54	191.5
090701-00 SVC00032	07/06/2009	1H0101	ID - TIP TRUC 184_INT	R	Engine	1VT485	2,266 KMS	RE-SEAL TURBO DRAIN FITTING	RE-SEAL TURBO DRAIN FITTING : TRAVEL TO DELORAINE. REMOVE FITTING FROM TURBO DRAIN HOSE AND TOP OF FILTER HOUSING CLEAN UP RE-SEAL AND FIT UP .	165	0	0	54	219
090629-00 SVC00031	06/30/2009	1H0101	ID - TIP TRUC 184_INT	R	Engine	1VT485	2,074 KMS	ENGINE OIL LEAK FROM HOUSEING	ENGINE OIL LEAK FROM HOUSEING : TRAVEL TO DELORAINE. RESEAL HOUSING AND RETENSION BOLTS AND FIT UP AND TEST.	113.5	0	0	54	167.5
090521-00 SVC00029	06/18/2009	1H0101	ID - TIP TRUC 184_INT	S	Service	1VT485	3337 HRS	S1 B SERVICE	S1 B SERVICE : TRAVEL TO DELORAINE SITE. CARRY OUT B - TYPE SERVICE AND CHECKS. * ALL PARTS SUPPLIED THROUGH WEBSTERS BURNIE - ORDERD THROUGH SIMON NICHOLS !	533.5	232.71	0	135	901.21
090609-00 SVC00030	06/16/2009	1H0101	ID - TIP TRUC 184_INT	R	Engine	1VT485	1559	REPLACE LEAKING TURBO HOSE	REPLACE LEAKING TURBO CHARGER HOSE	13.75	0	355.02	0	368.77
090604-00 SVC00030	06/10/2009	1H0101	ID - TIP TRUC 184_INT	R	Hydraulic	1VT485	155900	REPLACE HOSE ON BRAKE BOOSTER	REPLACE HOSE ON BRAKE BOOSTER	13.75	0	154.78	0	168.53
090609-00 SVC00030	06/10/2009	1H0101	ID - TIP TRUC 184_INT	R	Electrical	1VT485	1,646 KMS	REPAIR WIRING	REPAIR WIRING : TRAVEL TO DELORAINE. CARRY OUT WIRE REPAIRS TO FLASHING LIGHT MOUNTED THROUGH ROOF.	55	0	0	45	100

090403-00 SVC00028	05/13/2009	1H0101	ID - TIP TRUC 184_INT	R	Bodywork	1VT485	000,000 KM	HUB METER & REPAIRS AS LIST	HUB METER & REPAIRS AS LIST : 16/4/09 - TRAVEL TO DELORAINE. FIT UP NEW HUB METER,REMOVE THREE WAY VALVE CLEAN OUT DEBRI FREE UP AND REFIT AND DRIAN HYDRAULIC OIL FROM RESIVOR TO REQUIRED LEVEL. * METRE SUPPLIED THROUGH PETER STELFOX ! TRAVEL DISTANCE 110 KMS 1/5/09 - TRAVEL TO DELORAINE. REMOVE AND REPLACE PLASTIC BALL VALVE TO A METAL VALVE AND TEST AT 401 KMS - READING FROM HUB METRE. * 3" BALL VALVE SUPPLIED THROUGH PURPLE PIG SOMERSET - SIMON NICHOLS. TRAVEL DISTANCE 50 KMS	347.5	1226.13	0	45	1618.63
090302-00 SVC00025	04/30/2009	1H0101	ID - TIP TRUC 186_INT	S	Service	1VT485	757276 KM	S1 B SERVICE	Carry out a "b" service and repairs. The service was completed the coolant was replaced and a new taco cable was installed. this was installed to get the hour meter working.	528	697.92	0	2.7	1228.62
090302-00 SVC00025	04/30/2009	1H0101	ID - TIP TRUC 186_INT	R	Sundries	1VT485	757302 KM	Repairs as per list	Repair the water cart as required. The rear axle beam had stripped off the outer nuts these were reinstalled and weled inplace the support for the spring pack has worn through the bushing, the rear end of the truck is worn out. The engine oil leaks, hydraulic oil leaks and the gear box leak were repaired. The guards were adjusted and turned around the guard supports were reattached to the chassis. The rear spray bar was reworked and the air system was plumbed in as required.	2270	1206.73	0	0	3476.73
090325-00 SVC00028	04/29/2009	1H0101	ID - TIP TRUC 184_INT	R	Electrical	1VT485	752,307 km	REPLACE REVOLVING LIGHT	REPLACE REVOLVING LIGHT : TRAVEL TO DELORAINE. REMOVE AND REPLACE REVOLVING LIGHT.	141	140	0	90	371
090422-00 SVC00027	04/22/2009	1H0101	ID - TIP TRUC 122_INT	R	Tyres	1VT485	NA	FIT CUSTOMER OWN PRODUCT	FIT CUSTOMER OWN PRODUCT	0	40	0	0	40
090325-00 SVC00026	04/21/2009	1H0101	ID - TIP TRUC 184_INT	R	Bodywork	1VT485		FABRICATE ALLY HANDLE FOR TANK	FABRICATE ALUMINIUM HANDLE FOR WATER TANKER	13.75	0	185	0	198.75
090212-00 SVC00024	03/31/2009	1H0101	ID - TIP TRUC 184_INT	R	Ancillary Ec	1VT485	757,302 KM	REPLACE W/PUMP HOSE	REPLACE W/PUMP HOSE : TRAVEL SISTERS HILLS REMOVE AND REPLACE HOSE ON WATER TANK WATER PUMP AND TRAVEL BACK TO BURNIE W/SHOP. M WILLIAMS RAISED P/ORDER 4600066 AND PUT ON CIVIL JOB 4713	278.5	0	0	99	377.5
090217-00 SVC00025	03/19/2009	1H0101	ID - TIP TRUC 122_INT	R	Tyres	1VT485	757302	TYRE REPAIRS DOWLING MCCARTHY	TYRE REPAIRS DOWLING MCCARTHY	0	570	0	0	570
090303-00 SVC00025	03/17/2009	1H0101	ID - TIP TRUC 182_INT	R	Trays/Buck	1VT485		REPAIR HANDRAIL SPRAY BAR AND	REPAIR HANDRAIL SPRAY BAR AND TOOL BOX HINGES	1515.5	1307.51	0	0	2823.01

090303-00 SVC00025	03/17/2009	1H0101	ID - TIP TRUC 186_INT	R	Electrical	1VT485		CHECK WIRING REPAIR AS	Wire in the water cart as required. after the unit was up and running several changes had to be made to have the unit operational, and two switch's had to be changed out.	550	134.78	0	0	684.78
090224-00 SVC00025	03/16/2009	1H0101	ID - TIP TRUC 184_INT	R	Trays/Buck	1VT485	757450	WELDING REPAIRS TO WATER TANK	WELDING REPAIRS TO WATER TANK	13.75	0	605	0	618.75
090313-00 SVC00025	03/16/2009	1H0101	ID - TIP TRUC 184_INT	R	Ancillary Ec	1VT485	757,302 KM	TEST WATER PUMP & SPRAYS	TEST WATER PUMP & SPRAYS : TRAVEL TO DELORAINE. TEST AND CHECK FAULT WITH SLOW WATER PRESSURE TO REAR SPRAYS.	220	0	0	135	355
090306-00 SVC00025	03/13/2009	1H0101	ID - TIP TRUC 182_INT	PW	Trays/Buck	1VT485		REWORK REAR SPRAY BAR	REWORK REAR SPRAY BAR DUE TO IN CORRECT MOUNTING OF SPRAY BAR (MARTIN WOODS)	62	0	0	0	62
090302-00 SVC00025	03/11/2009	1H0101	ID - TIP TRUC 186_INT	R	Sundries	1VT485		COLLECT TANK FROM SITE	Travel to site to drop off the new water cart. bring the old cart back.	794.5	0	0	0	794.5
090209-00 SVC00024	02/27/2009	1H0101	ID - TIP TRUC 184_INT	R	Brake	1VT485		CHECK AND ADJUST BRAKES	CHECK AND ADJUST BRAKES ON UNIT	124	0	0	0	124
090209-00 SVC00024	02/26/2009	1H0101	ID - TIP TRUC 184_INT	R	Engine	1VT485	757,302 KM	FUEL FITTING LEAK	FUEL FITTING LEAK : TRAVEL TO SISTERS HILLS RESEAL FUEL HOSE FITTING AND TRAVEL BACK TO W/SHOP. * NO PARTS USED ! REPLACE STUDS ELBOWS SUPPLIED BY PIRTEK	141	9.52	0	99	249.52
090121-00 SVC00023	01/28/2009	1H0101	ID - TIP TRUC 184_INT	R	Hydraulic	1VT485	757481	REPLACE U/S HYD HOSE.	REPLACEMENT OF UNSERVICABLE HYDRAULIC HOSE	12.5	0	229.3	0	241.8
081209-00 SVC00023	01/27/2009	1H0101	ID - TIP TRUC 122_INT	R	Tyres	1VT485	N/A	TYRE REPAIR DOWLING 46769	TYRE REPAIR DOWLING 46769	0	545	0	0	545
081209-00 SVC00023	01/27/2009	1H0101	ID - TIP TRUC 122_INT	R	Tyres	1VT485	N/A	TYRE REPAIRS DOWLING 46824	TYRE REPAIRS DOWLING 46824	0	505	0	0	505
090116-00 SVC00022	01/20/2009	1H0101	ID - TIP TRUC 184_INT	R	Engine	1VT485	757,276 KM	FUEL HOSE LEAK	FUEL HOSE LEAK : TRAVEL TO SISTERS HILLS REMOVE FUEL FITTING AND RESEAL AND TIGHTEN CLAMP ON FUEL HOSE	75	0	0	49.5	124.5
090119-00 SVC00022	01/20/2009	1H0101	ID - TIP TRUC 184_INT	R	Hydraulic	1VT485	N/A	Replace hydraulic hose	TRAVELLED TO SISTERS HILLS AND PIRTEK. REPLACE HYDRAULIC HOSE	603	268	0	432	1303
081024-00 SVC00021	01/14/2009	1H0101	ID - TIP TRUC 184_INT	R	Engine	1VT485		REPLACE MANIFOLD GASKETS ETC	REPLACE MANIFOLD GASKET - PARTS ONLY	0	112.6	0	0	112.6
090105-00 SVC00022	01/12/2009	1H0101	ID - TIP TRUC 184_INT	R	Engine	1VT485	757276	BLOWN WATER HOSE	BLOWN WATER HOSE TRAVEL TO SISTERS HILLSX2 TRAVEL TO PIRTECK TO MAKE HOSE	500	209.26	0	207	916.26
081216-00 SVC00021	12/30/2008	1H0101	ID - TIP TRUC 184_INT	R	Hydraulic	1VT485	N/A	ADJUST BRAKES AND CHECK OVER	ADJUST BRAKES AND CHECK OVER travel to sisters hills , adjust brakes, repair hydraulic leak	300	0	0	36	336
081229-00 SVC00022	12/29/2008	1H0101	ID - TIP TRUC 184_INT	R	Brake	1VT485	757000	ADJUST REAR BRAKES	CARRY OUT REPAIRS TO ADJUST REAR BRAKES ON WATER CART	100	0	0	0	100
081127-00 SVC00021	12/05/2008	1H0101	ID - TIP TRUC 184_INT	R	Sundries	1VT485	756,001 KM	CLEAN DEBRI FROM WATERPUMP	CLEAN DEBRI FROM WATERPUMP: TRAVELLED TO SISTERS HILLS REMOVED,DISASSEMBLED WATER PUMP FROM WATER TANK SECTION , CLEANED OUT DEBRI FROM PUMP REASSEMBLED AND REFITTED TO UNIT AND TESTED.	385.5	0	0	49.5	435
081119-00 SVC00020	11/25/2008	1H0101	ID - TIP TRUC 184_INT	R	Hydraulic	1VT485	755518	REPLACE HYDRAULIC FILTER	TRAVELLED TO SISTERS HILLS. REPLACE HYDRAULIC FILTER DUE TO RUBBING THROUGH ON GUARD MOUNT	278.5	245.33	0	153	676.83

080908-00 SVC00019	11/13/2008	1H0101	ID - TIP TRUC 184_INT	R	Electrical	1VT485	752304	ELE FAULT FUEL TANK LOCK REQ	ELE FAULT FUEL TANK LOCK REQ ELECTRIC FLASHING LIGHT SWITCH FAULT NEW LOCKABLE FUEL LOCK FITTED LOCK SUPPLIEDBY WEBSTERS TRAVEL TO SISTERS HILLS	325	114.68	0	58.5	498.18
081103-00 SVC00019	11/05/2008	1H0101	ID - TIP TRUC 184_INT	R	Hydraulic	1VT485	736211	REPAIR OIL LEAK	TRAVELLED TO SISTERS HILLS TO REPAIR OIL LEAK FROM FLOW VALVE	150	0	0	47.7	197.7
081103-00 SVC00019	11/05/2008	1H0101	ID - TIP TRUC 184_INT	R	Electrical	1VT485	736211	REPAIR HEATER WIRING	TRAVELLED TO SISTERS HILLS. REPAIR WIRING FOR HEATER AND FLOW CONTROL VALVE	187.5	0	0	46.8	234.3
081027-00 SVC00018	10/27/2008	1H0101	ID - TIP TRUC 184_INT	R	Engine	1VT485	752304	MISSING LABOUR 080912-0060	MISSING LABOUR FROM SERVICE CALL 080912-0060	100	0	0	0	100
080926-00 SVC00017	09/30/2008	1H0101	ID - TIP TRUC 184_INT	S	Brake	1VT485	752030	ADJUST BRAKES	CARRY OUT ADJUSTMENT TO BRAKES	100	0	0	0	100
080912-00 SVC00016	09/17/2008	1H0101	ID - TIP TRUC 184_INT	R	Engine	1VT485	751677.	REFIT RING GEAR BOLTS.	TRAVELLED TO SISTERS HILLS AND INSPECT ENGINE NOISE. UPON INSPECTION IT WAS FOUND THAT THE RING BEAR BOLT HAD COME OUT, REPLACED BOLTS AND LOCTITE IN POSITION	0	0	595.5	15	610.5
080704-00 SVC00014	07/26/2008	1H0101	ID - TIP TRUC 184_INT	R	Engine	1VT485	751596.	BLEED FUEL SYSTEM AND START.	TRAVEL TO SISTERS HILLS AND BLEED FUEL SYSTEM AND START.	0	0	273	0	273
080610-00 SVC00013	07/15/2008	1H0101	ID - TIP TRUC 184_INT	R	Engine	1VT485	750222.	CHECK AND REPAIR ENGINE NOISE	TRAVELLED TO SISTERS HILLS. CHECK OVER ENGINE FOR NOISE, CHECKED VALVES AND TURBO, COULD NOT FIND PROBLEM, NOISE DISAPPEARED, SUSPECTED PISTON HITTING CARBON ON HEAD, FITTED NEW FUEL CAP	447.5	227.98	0	177.3	852.78
080711-00 SVC00013	07/15/2008	1H0101	ID - TIP TRUC 184_INT	R	Bodywork	1VT485	752108	REPAIR AND REFIT MIRROR BRACKE	REPAIR AND REFIT MIRROR BRACKETS AND REPAIR DOOR LOCKS	112.5	0	0	0	112.5
080613-00 SVC00012	06/19/2008	1H0101	ID - TIP TRUC 184_INT	S	Service	1VT485	751392.	S1 B SERVICE & MAJOR REPAIRS.	Perform removal of hydraulic tank and carry out welding to lid where hose fits into tank. Remove driver door lock Remove all wheels and replace tyres Rewire fuel gauge Remove and replace tie rod ends Remove and replace flexiable exhaust at turbo charger Perform "B" service and check all brakes	0	0	3033.52	0	3033.52
080424-00 SVC00009	06/03/2008	1H0101	ID - TIP TRUC 122PROCU R		Service	1VT485		11R 22S ZP	BARRY PARKER TYRE SERVICE PUNCTURE REPAIR	0	35	0	0	35
080527-00 SVC00011	06/03/2008	1H0101	ID - TIP TRUC 122_INT	R	Tyres	1VT485		SERVICE CALL 45261	1VT485 ODO - 751392 KMS	0	2160	0	0	2160
080410-00 SVC00008	04/17/2008	1H0101	ID - TIP TRUC 184_INT	R	Suspensior	1VT485	749753.	REPLACE R/H FRONT SPRING PIN.	DOWLING McCARTHY TYRES SUPPLY AND FIT 8 TYRES TRAVELLED TO ULVERSTONE ROAD WORKS. REPLACE FRONT RIGHT HAND SPRING PIN. REMOVE AND REPAIR SCALES	0	0	324.5	0	324.5

080220-00	SVC00006	03/14/2008	1H0101	ID - TIP TRUC 184_INT	R	Bodywork	1VT485		WELDING REPAIRS TO WATER TANK	WELD CRACKS INSIDE TANK AND COVER WITH PLATE. CHANGE OVER GATE VALVE AND AIR UNIT TO MAKE VALVE WORK. UNABLE TO REPAIR OIL LEAK ON OIL TANK, NEED TO REMOVE OIL TANK MAKE SOIL PROB.	0	0	1747.27	0	1747.27
080206-00	SVC00006	03/12/2008	1H0101	ID - TIP TRUC 122_INT	R	Tyres	1VT485		TYRE AND REPAIRS 82914	1VT 485	0	469	0	0	469
080303-00	SVC00006	03/07/2008	1H0101	ID - TIP TRUC 122_INT	R	Sundries	1VT485		PARTS REQ 17158 DARREN	BARRY PARKER TYRE SERVICE SUPPLY AND FIT 1 TYRE	0	30.72	0	0	30.72
080222-00	SVC00005	02/27/2008	1H0101	ID - TIP TRUC 184_INT	R	Engine	1VT485	748103	REPLACE FUEL PRESSURE VALVE.	ASSESS FUEL LEAKS. FUEL PRESSURE RELIEF VALVE WAS LEAKING, TEMP REPAIR UNITLL NEW PART ARRIVES. RETURN TO SITE WITH NEW PART AND FIT NEW VALVE.	0	0	655	0	655
080119-00	SVC00004	01/24/2008	1H0101	ID - TIP TRUC 184_INT	R	Bodywork	1VT485	746767	WELDING REPAIRS TO FRAME ETC.	WELDING REPAIRS TO REAR MOUNTING SUPPORTS ON REAR OF WATER TANK. MANUFACTURE SLIDING STYLE LID FOR TOP OF TANK FOR FILLING THAT IS LOCKABLE. SUPPLY AND FIT MUDFLAPS TO BOTH SECOND STEER AXLES. REMOVE HYDRAULIC MOTOR FOR WATER PUMP AND RESEAL. REPLACE U/S AIR BRAKE HOSE ON STEER AXLE. MANUFACTURE NEW BRAKE HOSE. REGAS AIR CONDITIONING.	0	0	2457.32	0	2457.32
080108-00	SVC00003	01/11/2008	1H0101	ID - TIP TRUC 122_INT	R	Tyres	1VT485		DELIVERY ADVICE 82203	EO2814	0	0	30	0	30
071206-00	SVC00000	01/09/2008	1H0101	ID - TIP TRUC 122_INT	R	Tyres	1VT485		SERVICE CALL 80983	BARRRY PARKER TYRE SERVICE WHEEL ALIGNMENT	0	5.9	100	0	105.9
071220-00	SVC00001	01/04/2008	1H0101	ID - TIP TRUC 184_INT	R	Engine	1VT485	746447	REPLACE TOP RADIATOR HOSE.	REPLACE TOP RADIATOR HOSE AS REQUIRED. WORK COMPLETED BY AJL.	0	0	149.48	0	149.48
071129-00	SVC00000	12/07/2007	1H0101	ID - TIP TRUC 184_INT	R	Hydraulic	1VT485	745569	REPAIR DRIVE MOTOR FITTINGS.	TRAVEL TO ULVERSTONE ROADWORKS AND CARRY OUT AND REPAIR HYDRAULIC DRIVE MOTOR FITTINGS ON MAIN WATER PUMP ASSEMBLY	0	0	180	0	180
071101-00	SVC00001	11/09/2007	1H0101	ID - TIP TRUC 184_INT	R	Ancillary Ec	1VT485	743792	REPAIR CART WATER PUMP.		0	0	1749.6	0	1749.6
071101-01	SVC00001	11/09/2007	1H0101	ID - TIP TRUC 184_INT	R	Engine	1VT485	743930	REPLACE NO5 INJECTOR LINE.		0	0	360	0	360

Applied filters:Posted_Date is on or after 01/01/1900Equipment_ID is 1VT485