

Service Job	Invoice No	Date	Customer Id	Customer Name	Cost Cent	Prob	Type of Call	Equip ID	Hrs	Kms	Job Description	Work Done	Labor Cost	Material Cost	Subcontra ctor Cost	Other Cost	Total Cost
92597	111540	06/18/2026	1HM103HBG	ID - EARTHMOVING	186G	R	Electrical	1VT816	0.0000	352727	Revolving light repair	REPLACED FUSE IN WRONG SPOT AND RECRIMPED DAMAGE WIRING ENDS	192	0	0	0	192
92520	110979	06/17/2026	1HM103HBG	ID - EARTHMOVING	186G	R	Transmissi on	1VT816	0.0000	0	PTO REPAIRS	REMOVE AND REPLACE DAMAGED PLUG AT PTO TEST OPERATION ALL OK	576	25.95	0	20	601.95
91099	110109	05/25/2026	1HM103HBG	ID - EARTHMOVING	186G	R	Clutch	1VT816	0.0000	0	Replace U/S clutch		2584.5	1484.8	0	100	4069.3
89768	108190	05/04/2026	1HM103HBG	ID - EARTHMOVING	186G	R	Exhaust	1VT816	352527.0000	0	INSPECT AND REPAIR EXHAUST BRAKE NOT WORKING	- REPLACED BROKEN AIR LINE CAUSING EXHAUST BRAKE MALFUNCTION TEST OPERATION ALL OK	96	1.78	0	0	97.78
89764	108191	05/04/2026	1HM103HBG	ID - EARTHMOVING	186G	R	Clutch	1VT816	352527.0000	0	INSPECT AND REPAIR CLUTCH STICKING FAULT	CARRY OUT TEST DRIVE RECCOMMEND CLUTCH TO BE REPLACED	120	0	0	0	120
89754	109152	05/04/2026	1HM103HBG	ID - EARTHMOVING	186G	S	Service Transport C	1VT816	352527.0000	0	c service	L001 LUBE KIT RANGER PRO HDA5887 AIR FILTER CARRY OUT SERVICE AND VEHICLE INSPECTION. CHECK ALL LIGHTS, CHECK FLUID LEVELS. CHECK SUSPENSION, BRAKES AND TYRES NOTES: - SEAT BELT FRAYED - NEEDS WINDSCREEN WIPERS REPLACED - CHIP IN WINDSCREEN - FIRE EXTINGUSIHER TO BE FITTED - DRIVE AND A/C BELT NEED TO BE REPLACED - OIL LEAK COMING FROM PTO MOUNT GASKET AREA - NUMBER PLATE LIGHT NEEDS TO BE REWIRED - FRONT SPRING BUSHES HAVE EXCESSIVE MOVEMENT - REAR MUDFLAPS NEED REPLACING - FRONT TYRES ARE GETTING LOW - REAR FUEL TANK STRAP	792	1724.6	0	98	2564.6
84887	102015	02/04/2026	1HM103HBG	ID - EARTHMOVING	182G	R	Trays/Buckets	1VT816	338949.0000	0	FIT SPREADER CHAINS		288	73.99	0	50	361.99
79569	99268	10/20/2025	1HM103HBG	ID - EARTHMOVING	186G	R	Chassis	1VT816	338949.0000	0	Pre Disposal Inspection	CARRY OUT PRE DISPOSAL INSPECTION - REMOVED TRACKED - FLIPPED MUDFLAPS AS BLANK NOT AVAILABLE NOTES: - TRAY CROSSMEMBER IS CRACKED - TOPPED UP ENGINE OIL - HIAB CONTROL STICK ON A LITTLE - TRUCK HAS RETURNED TO WORK	581	36.2	0	30	617.2

75076	91530	07/25/2025	1HM103HB G	ID - EARTHMOVING	186G	R	Chassis	1VT816	0.0000	341797	EXHAUST LEAK	ATTEND TO EXHAUST LEAK - REMOVE EXHASUT MANIFOLD - REMOVE TURBO DRAIN COOLANT - DRILL OUT BROKEN STUDS AND REPAIR THREADS - INSTALL NEW STUDS AND GASKETS - REFIT MANIFOLD, TURBO AND FILL COOLANT TEST DRIVE ALL OK	2944	1752.46	0	150	4696.46
70621	85541	05/05/2025	1HM103HB G	ID - EARTHMOVING	182G	R	Trays/Buc kets	1VT816	338949.00 0 00		REPAIR TAILGATE	NOTES: EXTREME DIFFICULTY REMOVING BROKEN STUDS, EXCESSIVE ADDITIONAL TIME TAKEN STRAIGHTEN HINGES ON TAILGATE HAD TO TAKE OFF OLD HINGE OFF TAIL CLEAN UP AND READY FOR NEW HINGE AND BRACKETS MAKE UP BRACKETS FOR HINGE STRAIGHTEN OUT TOOL BOX MOUNT, BOLT TOOLBOX MOUNTS FIT TOOLBOX AND BOLT IN PLACE SET UP LOWER HINGE AND TEST PULLED END CAP OFF THE BOTTOM CORNER CUT OFF HUINGES TO RESET RESTE HINGES AFTER REPAIRING BOTTOM CORNER OF TAILGATE TEST AND RETEST TO TAILGATE SWINGS, WELD HINGE CLEAN UP AREA PREP HINGE AND PAINT.	1992	0	0	250	2242
70507	85304	05/01/2025	1HM103HB G	ID - EARTHMOVING	186G	R	Sundries	1VT816	0.0000	338949	PMI + Repair list	CARRY OU TPMI GREASE ADJUST BRAKES REPLACE FUEL LINE REPLACE LIGHT UNABLE TO FAULT REVERSE BUZZER OR TRAY ALARM AT TIME	672	261.79	0	30	963.79
69326	85784	04/04/2025	1HM103HB G	ID - EARTHMOVING	186G	R	Electrical	1VT816	338949.00 0 00		Inspect Batteries all ok		96	0	0	0	96
65519	78125	01/28/2025	1HM103HB G	ID - EARTHMOVING	186G	S	Service Transport B	1VT816	0.0000	338949	B Service,Plug at Brake Survo,Replace Trailer Plug,Fit Fuel Line.	CARRY OUT SERVICE AND VEHICLE INSPECTION. CHECK ALL LIGHTS, CHECK FLUID LEVELS. CHECK SUSPENSION, BRAKES AND TYRES - REPLACE FUEL LINE - REPLACE TRAILER PLUG	758.43	259.58	0	51	1069.01
61104	73705	11/11/2024	1HM103HB G	ID - EARTHMOVING	186G	R	Engine	1VT816	337553.00 0 00	337553	FUEL LEAK	ATTEND TO VEHICLE AT KINGSTON WITH FUEL LEAK FOUND HARD LINE SPLIT FROM LIFT PUMP TO FUEL FILTER ATTEMPT TEMP REPAIRS TO GET BACK TO WORKSHOP REPAIR DID NOT HOLD ARRANGE TOW TRUCK AND WAIT TO ASSIST TOW TRUCK AS REQUESTED ARRANGE NEW FUEL PIP MADE NEW TEEL FUEL PIPE TILL NEW PIPE ARRIVES	671.78	225.43	0	125	1022.21

58768	71077	09/25/2024	1HM103HB G	ID - EARTHMOVI NG	184G	R	Drive Line	1VT816	220.9000	334490	TAIL SHAFT FALLEN OUT - 331 DAVEY ST	TRAVEL TO DAVEY STREET FOUND TAIL SHAFT UNIS SNAPPED AND TAIL SHAFT NOT ATTACHED. TI EUP TAILSHAFT AND HAND OVER TO TOW TRUCK PUSH TRUCK INTO WORKSHOP, REMOVE DAMAGED TAILSHAFT FOR REPAIRS REFIT REPAIRED TAILSHAFT AND TENSION BOLTS TO SPEC TEST DRIVE VEHICLE ALL OK	752.34	3790.46	0	140	4682.8
57106	69992	08/21/2024	1HM103HB G	ID - EARTHMOVI NG	186G	R	Sundries	1VT816	220.9000	333373	HYDRAULIC LEAK, WINDOW INOP, A/C LEAKING INTO CAB	INSPECT AND CLEAN HYDRAULIC VALVE TIGHTEN RETURN HOSE REFIT DRAIN PIPE TO A/C CHECK OPERATION OF WINDOW REGULATOR FIT NEW WINDOW WINDER AND TEST	315.35	86.58	0	0	401.93
56302	67477	08/06/2024	1HM103HB G	ID - EARTHMOVI NG	186G	R	Engine	1VT816	0.0000	332721	COOLANT LEAK	REMOVE DAMAGED COOLANT PIPE SILVER SOLDER CRACK IN PIPE CONNECT PIPE, FILL WITH COOLANYT. PRESSURE TEST ALL OK	438.31	0	0	15	453.31
55685	66651	07/25/2024	1HM103HB G	ID - EARTHMOVI NG	192G	R	Tyres	1VT816	220.9000	331808	new tyre (tyreright)		45.05	430	0	0	475.05
54171	64929	06/27/2024	1HM103HB G	ID - EARTHMOVI NG	186G	R	Sundries	1VT816	220.9000	0	Job Open For Parts Missed On Job 49705		0	386	0	0	386
53273	64926	06/11/2024	1HM182HB G	ID - WORKSHO P - WELDING	182G	PW	Sundries	1VT816	0.0000	0	REWORK ON TRAY		4234.7	0	0	0	4234.7
53126	64968	06/05/2024	1HM103HB G	ID - EARTHMOVI NG	181G	R	Bodywork	1VT816	0.0000	0	PAINT TAILGATE	PAINT TAILGATE	364.91	141.09	0	65	571

51325	64925	05/01/2024	1HM103HB G	ID - EARTHMOVING	182G	R	Trays/Buckets	1VT816	220.9000	0	REPAIRS TO TRAY	CUT AND REMOVE WELDED TOGETHER TRAY SIDES. REPAIR HINGE SECTIONS OF TRAY SIDES. STRAIGHTEN AND REPAIR BENT AND DAMAGED SIDES AND LOCKING CATCHES. CUT AND REMOVE DAMAGED REAR TAILGATE FROM TRAY. FABRICATE AND BUILD A NEW TAILGATE TO SUIT TRAY. STRAIGHTEN BENT AND DAMAGED REAR POSTS. PLATE INNER SECTION OF REAR POST. CUT AND REMOVE REAR CROSS BEAM AND LOCKING MECHANISM FROM UNDER REAR SECTION OF TRAY. STRAIGHTEN UNDERSIDE OF REAR SECTION OF TRAY. FABRICATE AND FIT NEW CHANNEL BEAM SECTION INTO REAR SECTION. FIT AND FREE UP TAILGATE LOCKING MECHANISM. FABRICATE AND FIT TAILGATE TO REAR OF TRAY USING NEW HINGES. TEST TIPPING ACTION OF TAILGATE. REPAIR VARIOUS CRACKING IN AND AROUND THE TRAY AND SUB FRAME. PREP TRAY FOR PAINTING.	6032.2	347.52	0	150	6529.72
48676	58953	03/26/2024	1HM103HB G	ID - EARTHMOVING	186G	S	Engine	1VT816	0.0000	327939	B' SERVICE	CARRY OUT SERVICE AND VEHICLE INSPECTION. CHECK ALL LIGHTS, CHECK FLUID LEVELS. CHECK SUSPENSION, BRAKES AND TYRES - ADJUST CLUTH - REPOSITION AIR INTAKE PIPE - GREASE CRANE - ADJUST HAND BRAKE	510	162.73	0	38	710.73
49705	61808	03/26/2024	1HM103HB G	ID - EARTHMOVING	186G	R	Air Con	1VT816	220.9000	0	A/C Repairs.	ATTENDED TO A/C FAULT. DIAGNOSED FAULTY A/C COMPRESSOR. REPLACED A/C COMPRESSOR AND CARRIED OUT A/C SERVICE. TESTED A/C, FOUND OPERATIONAL. BUT NOT CORRECTLY. FOUND THERMISTOR TO BE FAULTY. REMOVED RADIO, UHF, FRONT PANEL, WIRING, HEATER BOX AND OTHER HVAC COMPONENTS. REMOVED AND REPLACED TX VALVE. RE-ASSEMBLED DASH AND OTHER COMPONENTS. RE-GASSED SYSTEM AND CARRIED OUT LEAK TESTS, ALL OK. TEST A/C SYSTEM FOR CORRECT OPERATION, ALL OK.	2039	739.33	0	240	3018.33
45621	54612	01/24/2024	1HM103HB G	ID - EARTHMOVING	186G	R	Brake	1VT816	0.0000	32436	Brake Air Leak	AIR LEAK PRESENT AT BRAKE VALVE UNDER CAB. REMOVED DAMAGED AIRLINE AND MADE NEW LENGHT UP. FITTED AND CHECKED FOR ANY FURTHER LEAKS.	85	2.86	0	5	92.86
41699	55390	10/24/2023	1HM103HB G	ID - EARTHMOVING	186G	R	Electrical	1VT816	0.0000	320174	ELECTRICAL REPAIRS	INSPECTED NO BRAKE LIGHT FAULT TESTED WIRING AND REPLACED FAULTY PLUGS REPAIRED WIRING AROUND TRAILER BREAK VALVE TEST- ALL OK	510	44.39	0	25	579.39

38403	46819	08/18/2023	1HM103HB G	ID - EARTHMOVI NG	182G	R	Trays/Buc kets	1VT816	220.9000	0	REPAIRS TO TRAY	REPAIRS TO TRAY - SETUP WORK AREA, REMOVE BENT SNORKEL HOLDER, MANUF NEW SNOREL HOLDER, WELD OUT & PAINT,CUT OFF SPARE WHEEL CARRIER& SAND, STRAIGTEN EAR QUARTER OF TRAY, REPAIR CRACKS	2249.75	98	0	100	2447.75
38314	45067	08/17/2023	1HM103HB G	ID - EARTHMOVI NG	186G	R	Chassis	1VT816	0.0000	317099	Repairs as per inspection	REMOVE SEAT CHECK OPERATION OF AIR SYSTEM IN BASE, FREE UP VALVE AND TEST OK REFIT SEAT TIGHTEN DOOR LATCH REPAIR TIE ROD FAULT, REMOVED INSIDE WHEEL WEIGHT AND PLACE OUT SIDE TO PREVENT RUBBING DIAGNOSED A/C FAULT - NEED TO COMPRESSOR TIGHTEN LEFT HANGER PIN	1599.75	694.53	0	20	2314.28
38165	44301	08/15/2023	1HM103HB G	ID - EARTHMOVI NG	181G	F	Bodywork	1VT816	0.0000	0	REMOVE HAZELL DECALS AND FIT CROSSROADS DECALS	REMOVE HAZELL DECALS AND FIT CROSSROADS DECALS	42.5	0	0	0	42.5
37764	43914	08/07/2023	1HM103HB G	ID - EARTHMOVI NG	186G	R	WHEEL_A LIGNMENT	1VT816	220.9000	317017	WHEEL ALIGNMENT (MR) + REPLACE TIE ROD ENDS + STEER ROTATION	CARRIED OUT WHEEL ALIGNMENT AS PER SPEC SHEET FLIPPED RH FRONT WHEEL ON RIM & ADJUSTED CASTER STRAIGHTENED BENT TIE ROD REPLACED LEFT & RIGHT TIE ROD ENDS (CHARGED OUT ON 37336)	280.5	30	0	0	310.5
37336	45295	07/28/2023	1HM103HB G	ID - EARTHMOVI NG	186G	S	Service Transport D	1VT816	220.9000	0	sevice and check rear springs	CARRY OUT SERVICE AND VEHICLE INSPECTION. CHECK ALL LIGHTS, CHECK FLUID LEVELS. CHECK SUSPENSION, BRAKES AND TYRES	498	922.63	0	20	1440.63
24937	29913	01/18/2023	1HM103HB G	ID - EARTHMOVI NG	482G	R	Sundries	1VT816	220.9000	0	Filters		0	167.23	0	0	167.23
23617	28284	12/07/2022	1HM103HB G	ID - EARTHMOVI NG	482G	R	Sundries	1VT816	220.9000	0	Repair Works to Truck		0	796.12	0	0	796.12
23186	27067	11/29/2022	1HM103HB G	ID - EARTHMOVI NG	482G	R	Sundries	1VT816	220.9000	0	Service, repairs & UHF		514.79	0	0	0	514.79
21506	24515	10/21/2022	1HM103HB G	ID - EARTHMOVI NG	482G	INT-R	Tyres	1VT816	220.9000	0	Tyres		0	1385.48	0	0	1385.48
8850	10750	01/11/2022	1HM103HB G	ID - EARTHMOVI NG	192G	R	Sundries	1VT816	220.9000	0	REPAIR PTO FAULT	1VT816 OD: 220.90	128.13	341.97	0	6.4	476.5
6417	6732	11/03/2021	1HM103HB G	ID - EARTHMOVI NG	192G	R	Electrical	1VT816	220.8000	0	REPAIRS	REPAIR PTO FAULT FA6587 REPAIRS FLASHING INDICATORS ON RHS REPLEACED LOAD RESSISIR ON THE LHS INDIDCATOR	284.23	17.9	0	14.2	316.33
5999	6719	10/22/2021	1HM103HB G	ID - EARTHMOVI NG	192G	R	Transmissi on	1VT816	220.8000	0	GEAR CABLE BROKEN	1VT816 GEAR CABLE BROKEN	481.36	1115.93	0	52.9	1650.19

5226	5884	10/01/2021	1HM103HB G	ID - EARTHMOVI NG	192G	S	Service Transport B	1VT816	220.8000	0	S1B SERVICE	1VT816 OD: 220.80 S1 SERVICE COMPLETE SERVICE AND SAFETY CHECKS AS PER REQUIRED SCHEDULE. GREASE ALL LUBRICATION POINTS. CHANGE ENGINE OIL AND FILTER. CHANGE AIR FILTER. CHANGE FUEL FILTER. CHECK ALL OTHER FLUID LEVELS	269.77	75.65	0	177.56	522.98
3927	3867	08/31/2021	1HM103HB G	ID - EARTHMOVI NG	192G	R	Brake	1VT816	220.8000	0	BRAKES AND GEAR LINKAGES	1VT816 BRAKES & GEAR LINKAGES	304.04	0	0	0	304.04
1758	1547	07/09/2021	1HM103HB G	ID - EARTHMOVI NG	192G	B	Transmissi on	1VT816	220.8000	0	REPAIR GEARSTICK		671.51	1344.09	0	33.58	2049.18
1302	1278	06/29/2021	1HM103HB G	ID - EARTHMOVI NG	192G	R	Transmissi on	1VT816	220.8000	0	REPAIR GEARSTICK		57.24	0	0	2.87	60.11
1095	1536	06/24/2021	1HM103HB G	ID - EARTHMOVI NG	192G	R	Trays/Buc kets	1VT816	213.2000	298392	TAILGATE TIGHT TO CLOSE		933.64	0	0	106.69	1040.33
951	1302	06/22/2021	1HM103HB G	ID - EARTHMOVI NG	192G	R	Transmissi on	1VT816	209.4000	298334	INSPECT GEARBOX OPERATION		223.11	0	0	11.16	234.27
210525- 0054	SVC00264 961	06/08/2021	1H0103	ID - EARTHMOVI NG	192_INT	R	Tyres	1VT816			REPLACE STEER TYRES	REPLACE STEER TYRES - SUBLET TO TYRE RIGHT	39.45	818.2	0	1.98	859.63
210401- 0070	SVC00263 257	05/19/2021	1H0103	ID - EARTHMOVI NG	192_INT	R	Hydraulic	1VT816	295483		BLEED HYD SYSTEM	BLEED HYD SYSTEM BRING TRUCK INTO WORKSHOP AS THERE WERE REPORTS THAT THE HIAB WAS NOT WORKING. PUT TRUCK UNDER LOAD WITH 2 X TYRE AND PERFORMED A SERIES OF TESTS.	184.85	25.52	0	9.25	219.62
210326- 0062	SVC00261 880	04/15/2021	1H0103	ID - EARTHMOVI NG	192_INT	R	Trays/Buc kets	1VT816	295144		REPAIR TAILGATE	ALL WORKING OK REPAIR TAILGATE REPAIR G/STICK BOOT REPAIR HYDRAULIC HOSES ON HIAB FIT VEHICLE TRACKER AFTER SERVICE LAST TIME FOUND HYDRAULIC HOSE TO BE DAMAGED. REMOVED HOSE AND REPLACED WITH NEW. CLEANED UP TAIL GATE WHERE WELDS WERE CRACKED. REPAIRED & TESTED - OK FIT TRACKER TO TRUCK & ACTIVATE.	290.8	0	0	14.54	305.34

210208-0041	SVC00259 539	03/10/2021	1H0103	ID - EARTHMOVING	192_INT	S	Service	1VT816	242786	S1C SERVICE	S1 C SERVICE - COACH AND TRUCK	1248.3	587.52	0	50	1885.82
											COMPLETE SERVICE AND SAFETY CHECKS AS PER REQUIRED SCHEDULE. REMOVED AND INSPECTED ALL COMPONENTS. ADJUSTED BRAKES & HAND BRAKE. GREASE ALL LUBRICATION POINTS. CHANGE ENGINE OIL AND FILTERS. CHANGE FUEL FILTERS. CHANGE GEAR BOX FILTER. CHANGED COOLANT CHANGED GEAR BOX OIL. CHANGED DIFF OIL. CHECK ALL OTHER FLUID LEVELS. REPAIRED LIGHT BAR. TEST DRIVE - ALL OK					
											9/3 - WS QUERIED WITH DALLAS THE AMOUNT OF LABOUR ON THE SERVICE CALL, HE HAS PROVIDED THIS EXTRA INFO					
											**					
											DRAIN AND FLUSH RADIATOR (RUSTY WATER) 1.5HR BLOW OUT RADIATOR CORE AND INTERCOOLER 1.5HR C SERVICE 8.0HR C SERVICE ON CRANE AND FREE LEVERS					
210125-0004	SVC00258 799	02/26/2021	1H0103	ID - EARTHMOVING	192_INT	R	Brake	1VT816		BRAKE FAULT	INSPECT TRUCK WITH LOCKING BRAKE AND PULLING INTO THE NEXT LANE FAULT, JACK UP AND REMOVE WHEELS AND DRUMS, FOUND BRAKES TO HAVE HEAT DAMAGE, REMOVE BRAKE ASSY AND WHEEL BEARINGS, CLEANED PARTS, REASSEMBLED WITH NEW BRAKES & BEARINGS, ADJUST BRAKES, REMOVE TAILSHAFT AND PARK BRAKE ASSY, FOUND HANDBRAKE BRACKET BROKEN AND BROKEN BOLTS IN YOKE, REPLACE AND REASSEMBLE, TEST OPERATION, ALL OK.	2524.72	3238.41	522.73	50	6335.86
210216-0006	SVC00259 956	02/25/2021	1H0103	ID - EARTHMOVING	192_INT	R	Electrical	1VT816	293,053	REPAIRS TO FLASHING LIGHT	INSPECT FLASHING LIGHT, FOUND BROKEN WIRES AND JOIN TOGETHER AND TEST, REPLACED BLOWN FUSES	109.05	0	0	0	109.05
201126-0025	SVC00256 240	12/09/2020	1H0103	ID - EARTHMOVING	192_INT	R	Trays/Buckets	1VT816		WELD UP TRAY SIDE	WELD UP TRAY SIDES SO THEY STOP FALLING OPEN	154.7	0	0	0	154.7
201012-0097	SVC00253 913	11/25/2020	1H0103	ID - EARTHMOVING	192_INT	R	Bodywork	1VT816	288,016	REPAIRS	REPLACE FUEL BOWL REPLACE REV BEEPER REPLACE GEAR STICK BOOT STRAIGHTEN TAIL GATE REPLACE WINDSCREEN	1059.55	1559.55	0	50	2669.1
201106-0001	SVC00255 173	11/12/2020	1H0103	ID - EARTHMOVING	192_INT	R	Ancillary Equip	1VT816	289088KM	FUEL UP UNIT	FUEL UP TRUCK AS REQUESTED	39.45	0	0	171	210.45

201021-0082	SVC00254384	10/23/2020	1H0103	ID - EARTHMOVING	192_INT	R	Brake	1VT816	288,550 KM	REPAIR HAND BRAKE ASSY	HAND BRAKE NOT HOLDING PROPERLY. TRIED TO TIGHTEN ADJUSTER NOT IN CORRECT POSITION. DROPPED DRIVESHAFT OFF AND REMOVED BRAKE CLEAN. FOUND ADJUSTER FLOATING AROUND IN SHOES. FREED UP ADJUSTER AND REINSTALLED INTO BRAKE PADS. RESET DRUM AND ADJUSTED SHOES UP. REFIT DRIVESHAFT AND TENSION BOLTS.	235.5	0	0	20	255.5
200806-0026	SVC00250452	09/24/2020	1H0103	ID - EARTHMOVING	192_INT	R	Transmission	1VT816		GEAR LINKAGES	Repair gear linkages, they were binding.	176.23	0	0	0	176.23
200827-0088	SVC00251502	09/09/2020	1H0103	ID - EARTHMOVING	192_INT	R	Electrical	1VT816	287,357	BRAKE LIGHTS STUCK ON	DRIVER COMPLAINED OF BRAKE LIGHT STUCK ON, FOLLOWED WIRING AND FOUND 1 BRAKE SWITCH WAS AIR ACTIVATED AND LEAD TO THE TRAILER AIR SUPPLY, CAUSING BRAKE LIGHTS TO COME ON, TURNED TRAILER SUPPLY LEVER OFF AND BRAKE LIGHTS WENT OUT.	67.58	0	0	0	67.58
200729-0059	SVC00250177	08/18/2020	1H0103	ID - EARTHMOVING	192_INT	R	Bodywork	1VT816	287207km	REPAIRS AS PER PRESTART	inspection and repairs. Checked all oil levels and topped what was required. Greased the vehicle. The radio was not working this was repaired. add to the fule panel as there was no avaiable spaces. The inner door handle was repaired as it would nt work. Checked and repaired the fuel leak at the filter head. Repalced the missing first aid kit replaced the fire extingusher	363.5	142.36	0	57.8	563.66
200619-0058	SVC00247853	07/08/2020	1H0103	ID - EARTHMOVING	192_INT	R	Brake	1VT816	285,743	EXHAUST BRAKE AND BRAKES	CHECK ENGINE BRAKE FRO SQAULING NOISE WHEN ACTIVATES, JACK UP MACHINE AND INSPECT, FOUND BOTTOM OF FLANGE NUT HAS FALLEN OFF, DAMAGED THREADS AND ALLOWED FLANGE TO SPREAD, METAL GASKET APPEAR TO BE INTACT, TRIM OFF DAMAGED THREAD WITH GRINDER AND FIT NUT AND TIGHTENED OK, ROAD TEST AND CHECK OPERATION, CHECK BRAKES AS DRIVER REPORTED PULLING TO THE RIGHT, INSPECT OUTER COMPONENTS, NOTICED BRAKES ADJUSTMENT INCONSISTENT, READJUST BRAKES, ROAD TEST AND FOUND RHR LOCKING UP AND PULLING TRUCK TO THE RIGHT, NEEDS FURTHER ATTENTION WHEN AVAILABLE, UNIT CAME BACK IN AND TAKE FOR ROAD TEST, STILL PULLING TO THE RIGHT, REMOVED RHR HUB ASSY AND CHECKED BRAKE COMPONENTS ALL LOOKED OK MOVING FREELY, REASSEMBLED HUB ASSY AND ADJUSTED BRAKES AGAIN, TEST DRIVE ALL OK.	412.33	0	0	10	422.33
200622-0108	SVC00247960	07/08/2020	1H0103	ID - EARTHMOVING	192_INT	R	Electrical	1VT816	285,743	NO START- BATTERY FIRE	INSPECT TRUCK NOT STARTING, TRIED ROLL STARTING AND JUMP STARTING, FOUND BATTERIES LEAKING, REMOVE AND REPLACE BATTERIES, REPLACED FUSE BLOWN IN BOX, REPAIRED WIRING ON BATTERY BOX, TEST ALL OK.	453.93	339.96	0	10	803.89

200604-0075	SVC00247115	06/29/2020	1H0103	ID - EARTHMOVING	192_INT	R	Drive Line	1VT816	285,425 KM	PTO SHAFT REPAIRS	INSPECT CLUNKING NOISE IN PTO SHAFT, INSPECT AND FOUND 2 BOLTS COMPLETELY FALLEN OUT OF FLANGE AND REMAINING BOLTS HALF FALLEN OUT AND BENT, ALSO FOUND CENTRE BEARING BRACKET CRACKED ALONG GUSSET AND MOVEMENT IN PTO BEARING, TRUCK NEEDED NEXT DAY SO REPLACED 4 BOLTS AND TIGHTENED, TAGGED OUT PTO AND DISCONNECT SWITCH UNTIL TRUCK WAS AVAILABLE, TRUCK RETURNED TO WSHOP, DISASSEMBLED, GOUGED OUT AND WELD REPAIR CRACKED BUCKET IN 4 SPOTS, GRIND FLAT AND REPAIR BOLT HOLES AND PAINT, DISASSEMBLED PTO ADAPTOR PLATE, FOUND BEARING LOOSE IN HOUSING, APPLY DEVCON TO HOUSING, REFIT BEARING AND REASSEMBLE PTO, LOCTITE FLANGE BOLTS, REMOUNT CENTRE BEARING AND TIGHTEN ALL BOLTS, GREASED COMPLETE SHAFT AND CHECK OPERATION ALL OK.	730.68	120.61	0	0	851.29
200615-0107	SVC00247567	06/29/2020	1H0103	ID - EARTHMOVING	192_INT	R	Electrical	1VT816		ELEC PLUG FOR TRAILER	FIT UP NEW ELETCRICAL PLUG FOR TRAILER	83.93	18.48	0	0	102.41
200508-0015	SVC00245448	05/28/2020	1H0103	ID - EARTHMOVING	192_INT	R	Trays/Buckets	1VT816		REPAIR SIDE GATES	DROP SIDEGATES AND REMOVE BUILD UP OF DEBRIS FROM HINGES AND TRAY, FREE UP HINGES AND LOCK MECHANISM, REMOVE DAMAGED MATERIAL FROM TAIL GATE SUPPORT FOR EASIER CLOSING, RE ALIGN LEFT SIDEGATE, AND RIGHT SIDE NEEDS STRAIGHTENED.	145.4	0	0	0	145.4
200115-0046	SVC00239123	04/29/2020	1H0103	ID - EARTHMOVING	192_INT	R	Engine	1VT816	281000	NO POWER ON HILLS	ROAD TEST FOR NO POWER ON HILLS, REPLACED FUEL FILTERS, DRAIN FUEL TANK AND INSPECT, REMOVE SLUDGE FROM TANK AND REFILL, CHECK FUEL DELIVERY LINES, REMOVE DEBRIS BUILD UP FROM GAUGE STRAINER, MODIFY AND REPOSITION FUEL LINES, BLLED AND PRIME FUEL SYSTEM, CHECK AIR INTAKE SYSTEM, ADAPT AND FIT BOOST GAUGE TO BOOST SIDE AND ROAD TEST, REMOVE INTERCOOLER AND FIT NEW, ROAD TEST ON HILL ALL OK.	2577.91	685.8	0	50	3313.71
200319-0053	SVC00242878	04/28/2020	1H0103	ID - EARTHMOVING	192_INT	R	Bodywork	1VT816		REPLACE LOCKABLE FUEL CAP	REPLACE LOCKABLE FUEL CAP	36.35	141.59	0	0	177.94
200408-0025	SVC00243646	04/28/2020	1H0103	ID - EARTHMOVING	192_INT	R	Brake	1VT816		REPAIRS	ADJUST BRAKES, REMOVE LH WHEEL ASSY DUE TO WHEEL CYLINDERS LEAKING, REMOVE WHEEL CYLINDERS AND CLEAN UP READY FOR NEW PARTS, FIT NEW WHEEL CYLINDERS AND SHOES AND WHEEL ASSYS, BLEED BRAKES, REPAIRED TAILGATE AND ADJUST CAB LOCK.	562.71	465.24	0	28	1055.95
200420-0076	SVC00244456	04/22/2020	1H0103	ID - EARTHMOVING	192_INT	S	Service	1VT816	283,200	S1B SERV	CARRIED OUT S1 B SERVICE AS PER SCHEDULE. REFIT MUDFLAP. REPAIR SIDE INDICATOR AND PTO SWITCH.	344.08	127.93	0	17	489.01
191105-0073	SVC00235706	01/17/2020	1H0103	ID - EARTHMOVING	192_INT	R	Engine	1VT816	276,592 KM	LIMP MODE ISSUE/ NO POWER	INSPECT VEHICLE FOR LACK OF POWER, REMOVE FUEL FILTERS AND INSPECT, SOURCE AND PICK UP NEW FILTERS AND FIT TO VEHICLE, TEST OK	221.2	90.1	0	10	321.3

191216-0088	SVC00237 959	01/17/2020	1H0103	ID - EARTHMOVING	192_INT	R	Transmission	1VT816	279,151 KM	REPAIR GEARSTICK FALLING OUT	CHECK REPORT GEARSTICK FALLS OUT, FOUND SOCKET BUSH WORN AND SIDE BUSHING HAD FALLEN OUT OF ARM, FOUND ARM HOLE WORN FROM USE WITHOUT BUSHING IN IT, TRAVEL TO FRM TO PICK UP NEW PARTS, MAKE PLATE TO PREVENT SIDE BUSH FALLING OUT, NEW BUSH FITTED IN MUCH TIGHTER, PLATE NOT REQUIRED, REFIT NEW BUSHES AND BOOT, ROAD TEST ALL OK	436.2	177.37	0	20	633.57
191111-0122	SVC00235 966	01/07/2020	1H0103	ID - EARTHMOVING	192_INT	A	Trays/Buckets	1VT816	276612 km	REPAIRS TO TAILGATE	REMOVED GEAR STICK, CLEANED UP MOUNTING SURFACE, REMOVED TAIL GATE LOCK ON REAR OF TRAY AND CLEANED MOUNTING PLATE, DISCONNECT TAIL GATE LOCKS TO BE ABLE TO SWING TAIL GATE, WELD ON NEW LOCK TO TRAY, TEST LOCK FOR TAIL GATE, TIGHTEN J BRACKETS FOR FUEL TANK AND TRY TO STRAIGHTEN.	528.5	70	0	26	624.5
190924-0011	SVC00233 390	11/22/2019	1H0103	ID - EARTHMOVING	186_INT	S	Service	1VT816	275188KMS	CHECK OVER	INSPECTED UNIT FOR FAULTS A COUPLE OF MINOR THINGS WERE REPAIRED. FAULTS ARE: TAIL GATE BENT WINDSCREEN CRACKED INPUT SHAFT ON HYDRAULIC PUMP WORN HYDRAULIC CONTROL VALVE LEAKING OIL ENGINE BREATHER TUBE LEAKING	218.1	0	0	0	218.1
191028-0035	SVC00235 111	11/19/2019	1H0103	ID - EARTHMOVING	192_INT	R	Bodywork	1VT816	276,050	REPAIR LH DOOR LOCK	REPAIR REPORTED DOOR LOCK N/W. WENT TO FIT NEW DOOR LOCK ASSY. INCORRECT PART ORDERED RH DOOR LOCK BUT FAULTY DOOR ON LHS. REMOVE DOOR TRIM AND INSPECT LATCH ASSY. FOUND PLASTIC WASHER MISSING FROM ONE OF THE RODS CONNECTING LOCK BARREL. REMOVED LOCK ASSY, FIT STEEL WASHER TO BACK OF ROD, CLEANED AND LUBED ASSY, REFIT TO DOOR, REFIT DOOR TRIM AND CHECK OPERATION ALL OK, PUT NEW LOCK BACK IN BAG AND BOX TO BE SENT BACK FOR CREDIT.	36.35	0	0	0	36.35
191018-0008	SVC00234 739	11/12/2019	1H0103	ID - EARTHMOVING	192_INT	R	Transmission	1VT816	276,050 KM	PTO LIVE DRIVE	POSITION TRUCK INTO SHED, INSPECT PTO SHAFT, FOUND UNIS TO BE WORN, SENT SHAFT TO DYNAMIC BALANCING TO REPAIR PTO DRIVESHAFT, REFIT PTO SHAFT AND REPLACE FRONTBEARING IN PTO MOUNTING, CHECK OPERATION ALL OK.	730.1	0	726	36.5	1492.6
190926-0013	SVC00233 543	10/31/2019	1H0103	ID - EARTHMOVING	182_INT	A	Sundries	1VT816		REPAIR TAILGATE	Repair accident damage to the tail gate on 1VT816 Removed the gate and straightened as needed welded cracks and posts. Reassembled and tested	1228.2	0	0	150	1378.2
190930-0094	SVC00235 190	10/29/2019	1H0103	ID - EARTHMOVING	181_INT	R	Bodywork	1VT816	275,188 KM	FIT NEW RHS DOOR LOCK	FIT NEW RHS DOOR LOCK LOCK TO BE FITTED UP NORTH	36.35	393.45	0	0	429.8

190717-0028	SVC00229 589	07/23/2019	1H0103	ID - EARTHMOVING	186_INT	R	Brake	1VT816	273641KMS	CHECK OUT BRAKES	CHECK OUT BRAKES. TEST DROVE TO CHECK FOR BRAKES STICKING. TRACED TO LHS STEER AXLE. REMOVED HUB AND CHECKED. GREASED THE WHEEL BEARINGS AND READJUSTED. RETESTED.OK.	254.45	0	0	12	266.45
190710-0036	SVC00229 360	07/12/2019	1H0103	ID - EARTHMOVING	186_INT	S	Service	1VT816	273602 kms	S1 A SERVICE	S1 A SERVICE. COMPLETED SERVICE AS PER SERVICE SHEET. SERVICED CRANE. REPLACED DAMAGED REAR MUD FLAPS. NOTE: PTO DRIVE SHAFT NEEDS REPLACING. WINDSCREEN CRACKED.	383.68	132.14	0	17	532.82
190501-0019	SVC00225 584	05/31/2019	1H0103	ID - EARTHMOVING	186_INT	R	Sundries	1VT816	270835km	Repairs as per list	Checked LHF wheel seal leaking. Removed wheel, inspected brakes and wheel beairngs. Brake lines both U/S, bent brake line causing brake fluid to divert to one cylinder and leak. Cage on wheel beearring damaged. Bearing seized on, removed brake assembly, pryed roller off.	363.5	375.31	0	18	756.81
190429-0086	SVC00225 574	05/15/2019	1H0103	ID - EARTHMOVING	186_INT	R	Electrical	1VT816	270834km	CHECK WARNING BUZZER + UHF	Checked UHF, mounts broken off, fitted new mounts and secured UHF. Checked warning buzzer coming on constantly, checked air pressure, OK. wiring broken off air tank, repaired as required. Located brake fluid resivoir, fluid low bringing warning buzzer on. Topped up fluid. Low air alarm not coming on with low air pressure, Fault in dash, wired in aftermarket buzzer, tested OK. Checked tray up light, lifted tray, no power to limit switch. Wiring disconnected, re-connected light and powered up switch, tested OK.	617.95	128.34	0	31	777.29
190213-0059	SVC00220 465	03/09/2019	1H0103	ID - EARTHMOVING	186_INT	A	Brake	1VT816	267458	Brake repairs	BRAKE REPAIRS REMOVED ALL WHEELS AND HUBS AND INSPECT BRAKES. REMOVED ALL BRAKES AND WHEEL CYLINDERS REPLACED ALL WHEEL CYLINDERS AND RELINED ALL BRAKES .HAD FRONT BRAKE DRUMS MACHINED, FITTED NEW BRAKE DRUMS TO REAR. REPACKED ALL WHEEL BEARINGS AND FITTED NEW HUB SEALS. ADJUST ALL BRAKES AND BLEED . REPLACED HAND BRAKE LININGS .VEHICLE TAKEN FOR TEST ,ALL OK	1771.39	1884.2	355.8	50	4061.39
190219-0073	SVC00221 339	02/27/2019	1H0103	ID - EARTHMOVING	186_INT	R	Ancillary Equip	1VT816	267458	REPLACE REAR MUDFLAPS	REMOVED AND REPLACED REAR MUDFLAPS WITH NEW	72.7	29.9	0	0	102.6

181122-0047	SVC00216318	11/28/2018	1H0103	ID - EARTHMOVING	186_INT	R	Hydraulic	1VT816	264997kms	CRANE LEVER REPAIRS	CRANE LEVER REPAIRS. DISASSEMBLED LEVER BOXES FOR SLEW AND EXTENSION CYLINDERS. REPLACED DAMAGED BOOT (PARTS EX STOCK) AND REMOVED PIVOT PINS. CLEANED UP PINS AND LEVERS AND REASSEMBLED. CHECKED OPERATION.OK	103.93	0	0	5	108.93
181112-0023	SVC00215591	11/16/2018	1H0103	ID - EARTHMOVING	186_INT	S	Service	1VT816	264061KMS	S1 B SERVICE	S1 B SERVICE. COMPLETED SERVICE AS PER SERVICE SHEET. CHECKED CRANE OPERATION. FOUND SLEW LEVER STICKING AND NOT SPRING CENTERING. ATTEMPTED TO FREE UP LEVER. DRIVER CAME TO PICK UP TRUCK. TAGGED OUT CRANE TO RETURN FOR FOLLOW UP REPAIRS.	363.5	135.24	0	15	513.74
181024-0074	SVC00214344	10/26/2018	1H0103	ID - EARTHMOVING	186_INT	R	Electrical	1VT816	263215	Check flashing light	Checked flashing light out, Checked fuses, blown fuse. Replaced fuse, not blowing fuses, checked wiring around cab, OK. Removed light, checked wiring, bare wires causing intermittent short. Repaired wiring and re-fitted light. Rested - OK	109.05	0	0	5	114.05
181001-0006	SVC00213021	10/24/2018	1H0103	ID - EARTHMOVING	186_INT	R	Sundries	1VT816	261314KMS	GENERAL CHECK OVER	GENERAL CHECK OVER AND SAFETY INSPECTIONS BEFORE RETURNING TO WORK.	109.05	0	0	0	109.05
180620-0035	SVC00207476	09/28/2018	1H0103	ID - EARTHMOVING	186_INT	R	Electrical	1VT816	258999km	CHECK STEREO & SPEAKERS	Checked stereo and speakers, replaced rhs speaker. speakers still not working. removed dash and stereo, found poor wiring job for stereo. Cut out crimp connectors, fitted plugs, mounted volatge reducer that was floating around in dash. tidied wiring. re-wired rhs speaker as orignal wiring U/S. reassembled and test operation all good	218.1	15.4	0	10	243.5
180928-0002	SVC00212733	09/28/2018	1H0103	ID - EARTHMOVING	121_INT	R	Tyres	1VT816	261265	9.5 R17.5 KRA11 X 2 + BALANCE	9.5 R17.5 KRA11 X 2 + BALANCE POWDER X 2 + DISPOSAL X 2 RUBAND 51874	0	823	0	0	823
180907-0009	SVC00211710	09/12/2018	1H0103	ID - EARTHMOVING	186_INT	R	Electrical	1VT816	260000KM	Check light faults	Checked RHS hi-beam and light bar not working, Checked fuses, some missing and in wrong positions, corrected. Checked globes - OK Tested power to headlight, no power on hi beam. located hi-beam relay, tested OK Located wiring information, studied. Suspected fault from relay output to RHS headlight fuse, bridged RHS to LHS headlight fuse. Ran wire to headlight to pick up hi-beam for lightbar. Tested lighting, all working OK.	327.15	0	0	15	342.15

180905-0066	SVC00211618	09/11/2018	1H0103	ID - EARTHMOVING	186_INT	R	Brake	1VT816	260369KMS	Park brake repairs	PARK BRAKE REPAIRS. REMOVED DRIVE SHAFT AND CHECKED OPERATION.LININGS FOUND TO BE WORN. TRAVELED TO ABS AND SOURCED NEW PARK BRAKE LININGS. FITTED LININGS AND ADJUSTED THE CABLE AND ADJUSTER. FOUND DRIVE SHAFT CENTRE BEARING U/S. TRAVELED TO HARDY SPICER AND PICKED UP NEW BEARING. FITTED TO DRIVE SHAFT AND REFITTED DRIVE SHAFT TO THE VEHICLE. FABRICATED NEW SPACERS TO REPOSITION THE TRAILER PARK BRAKE LEVER AWAY FROM THE GEAR SHIFT. FITTED STROBING REVOLING LIGHT AND REWIRED TO ALLOW THE STROBING LIGHT TO OPERATE WITHOUT THE IGNITION ON.	654.91	277.91	0	30	962.82
180807-0019	SVC00209573	08/30/2018	1H0103	ID - EARTHMOVING	182_INT	R	Sundries	1VT816		REPAIRS TO TRAY	Repair damaged hinges. Straighten bent side. Fit tiedowns into tray floor. Paint repair.	252.9	160.71	0	12	425.61
180802-0016	SVC00209526	08/07/2018	1H0103	ID - EARTHMOVING	186_INT	R	Electrical	1VT816	259561KMS	REVOLVING LIGHT REPAIRS	REVOLVING LIGHT REPAIRS. CHECKED REVOLVING LIGHT OPERATION. CHECKED POWER TO THE SWITCH. CHECKED FUSES. FOUND FAULT WITH WIRING INTO FUSE BOX, WIRING TO SWITCH AND ON TO REVOLVING LIGHT. REPLACED ALL WIRING AND REPLACED FAULTY SWITCH. CHECKED CLUTCH ADJUSTMENT.WEAR IN CLEVIS AND BUSHES.ADJUSTMENT OK. REPLACED FAULTY FUSEABLE LINK FOR AUXILLATY CURCUIT.	407	12.75	0	20	439.75
180709-0066	SVC00208860	07/30/2018	1H0103	ID - EARTHMOVING	186_INT	R	Engine	1VT816	259222kms	CHECK FOR LOW POWER	CHECK FOR LOW POWER BLOWING SMOKE. TEST DROVE, REPLACED FUEL FILTERS, NO CHANGE. CHECKED AIR CLEANER. REPLACED WORN ACCELERATOR CABLE AND ADJUSTED.PRESSURE TESTED THE INTER COOLER.FOUND LEAKING. SENT OUT FOR REPAIRS. CHECKED FAULT CODES. CHECKED WIRING AND FOUND RACK SENSOR LOOSE AND OUT OF CALIBRATION. SPOKE TO INJECTION SHOP AND INDICATED THAT IT WOULD HAVE TO BE SET UP ON A BENCH. REMOVED PUMP AND SENT TO HAVE REPAIRES COMPLETED. REFITTED PUMP AND TEST DROVE.OK SET IDLE SPEED.	2526.33	2414.93	0	50	4991.26

180726-0056	SVC00209 123	07/30/2018	1H0103	ID - EARTHMOVING	186_INT	R	Electrical	1VT816	259222 kms	REPLACE STARTER	REPLACE STARTER. REMOVED LOOSE STARTER MOTOR. FOUND STARTER DAMAGED AND BELL HOUSING CHAFFED. REMOVED HIGH SPOTS AND APPLIED SEALANT ON LOW SPOTS TO HELP STOP THE STARTER MOTOR COMING LOOSE AGAIN.	363.5	284.25	0	17	664.75
180606-0075	SVC00206 632	06/26/2018	1H0103	ID - EARTHMOVING	186_INT	R	Sundries	1VT816	258636 KMS	CHECK COOLANT LEAK IN CAB	Checked coolant leak in the cab.Traced fault to faulty heater. Ordered new core. Disassembled dash completely to access the heater core. Fitted new core and reassembled the dash.Topped up the coolant and checked for leaks. Checked a/c electrical fault found when heater core replaced. A/c fuse blowing, found fault in A/C compressor clutch. Disconnected compressor (no belts were on compressor)	742.3	650.3	0	197.5	1590.1
180618-0069	SVC00207 290	06/26/2018	1H0103	ID - EARTHMOVING	186_INT	F	Electrical	1VT816	258999km	FIT UP LIGHT BAR	Supplied and fitted light bar, mounted to bull bar. Ran wiring into cab. Mounted relay and switch, ran wiring to switch, fitted fuse holders. Secured wiring. Tested light bar, OK.	254.45	119.5	0	14	387.95
180615-0025	SVC00207 013	06/21/2018	1H0103	ID - EARTHMOVING	186_INT	R	Electrical	1VT816	258995 KMS	REPLACE RHS HEAD LIGHT	REPLACE RHS HEAD LIGHT. REMOVED THE HEADLIGHT, DISASSEMBLED AND ATTEMPTED TO CLEAN THE REFLECTIVE AREA OF THE HEAD LIGHT. UNABLE TO IMPROVE. FITTED NEW HEADLIGHT AND ALIGNED. REFITED THE BULL BAR.	254.45	601.11	0	12	867.56
180516-0031	SVC00204 879	05/31/2018	1H0103	ID - EARTHMOVING	184_INT	R	Sundries	1VT816	256563 KM	FIT TOW HITCH	FIT TOW HITCH REMOVE AND REPLACE TOW HITCH WITH TOW BALL TYPE COUPLING TRAVEL YORK PLAINS	131.78	229.53	0	137.5	498.81
180509-0039	SVC00204 671	05/15/2018	1H0103	ID - EARTHMOVING	186_INT	S	Service	1VT816	254681 kms	S1 A SERVICE	S1 A SERVICE. COMPLETED SERVICE AS PER SERVICE SHEET. CLEANED OFF ENGINE AND CHECKED OIL LEAK AND FOUND TO BE LEAKING BETWEEN THE FUEL INJECTION PUMP AND GOVERNOR HOUSING. CHECKED AND LUBRICATED THE CRANE. REPLACED THE AIR CLEANER. NOTE.CENTRE BEARING WILL NEED REPLACING NEXT SERVICE.	285.4	182.2	0	10	477.6
180418-0010	SVC00203 887	04/30/2018	1H0103	ID - EARTHMOVING	184_INT	R	Electrical	1VT816	250843 KM	REPAIR SHORT IN VOLTAGE REDUCE	TRAVELLED TO YORK PLAINS, CHECK UHF NOT WORKING, FOUND NO POWER TO UNIT, DISMANTLE DASH AND FOUND FUSE TO VOLTAGE REDUCER BLOWN, CHECK WIRING AND FOUND TO BE SHORTING OUT, REMOVE DAMAGED WIRING AND UNIT TESTED OK	171.96	0	0	133.5	305.46

180319-0011	SVC00202 655	04/18/2018	1H0103	ID - EARTHMOVING	186_INT	R	Trays/Buckets	1VT816	249198 KMS	TOOL BOX REPAIRS	TOOL BOX REPAIRS. REMOVED THE LHS TOOL BOX FOR THE BRACKETS. HAD TO CUT OFF BOLTS AS THEY WERE SIEZED. CUT OF BRACKETS FROM THE CHASSIS. REDRILLED AND LOWERED THE TOOL BOX SO IT COULD BE OPENED WITH THE TRAY DOWN. COMPLETED REASSEMBLY AND FITTED. MACHINED NEW SWINGING TAIL GATE PIN AND FTTED.	255.93	0	0	15	270.93
180319-0009	SVC00201 854	03/22/2018	1H0103	ID - EARTHMOVING	186_INT	R	Engine	1VT816	249198 KMS	AIR CON BELTS,CHECK	REPLACED WORN FAN BELTS AND ADJUSTED THE AIR CON BELT.	107.03	41.24	0	0	148.27
180319-0010	SVC00202 069	03/22/2018	1H0103	ID - EARTHMOVING	186_INT	R	Electrical	1VT816	249198 KMS	REVERSE BUZZER INTERMITTENT	CHECKED OPERATION OF REVERSE BUZZER. REPAIRED POOR EARTH. REPLACED FAULTY PLUGS. REPLACED DAMAGED TRAILER PLUG.	214.05	96.44	0	11	321.49
180208-0007	SVC00201 419	03/21/2018	1H0103	ID - EARTHMOVING	181_INT	R	Bodywork	1VT816		CARRY OUT BODYWORK REPAIRS TO	CARRY OUT BODYWORK REPAIRS TO TRUCK PRESSURE WASH TO REMOVE GREASE AND OIL FROM CRANE BEFORE SAND BLASTING MASK UP AREAS OF CRANE BEFORE BLASTING TO PREVENT DAMAGE BODY FILL RUSTED AREAS OF CRANE AND REPAINT ORANGE REPAIR RUST IN BACK OF CAB AND REPAINT CUT AND POLISH REMAINDER OF CAB TOUCH UP SCRATCHES AND CHIPS IN CAB REPAIR TAILGATE, TAILBOARD, GUARDS AND SIDES OF TRAY REFIT DOOR ON TOOLBOX PAINT TRAY WHITE PAINT CHASSIS BLACK PAINT WHEELS SILVER FIT NEW DECALS TO CRANE FIT NEW LHS EXTERIOR DOOR HANDLE	6671.25	858.61	1200	210	8939.86
171206-0072	SVC00197 659	01/17/2018	1H0103	ID - EARTHMOVING	186_INT	R	Sundries	1VT816	249102 kms	REPLACE FRONT SPRINGS	REPLACE FRONT SPRINGS SUPPLY FIRST AID KIT. REMOVED AND REPLACED FRONT SPRINGS. REPLACED SHACKLE BUSHES AND U BOLTS. TEST DROVE AND RETENSIONED U BOLTS.	1444.85	1573.33	0	50	3068.18
180104-0040	SVC00198 691	01/17/2018	1H0103	ID - EARTHMOVING	186_INT	R	Bodywork	1VT816	249102 kms	REPLACE CAB MOUNT RHS	REPLACE CAB MOUNT RHS. DISASSEMBLED FRONT OF THE CAB. CUT OUT DAMAGED MOUNT AND PRESSED IN NEW MOUNT. REASSEMBLED THE CAB AND REFITTED THE BULL BAR.	606.48	381.88	0	30	1018.36
171219-0040	SVC00198 008	01/10/2018	1H0103	ID - EARTHMOVING	186_INT	R	Electrical	1VT816	249102km	CHECK BATTERIES	Jump started truck, Checked charge rate - OK Checked battery drain off - OK Seperated and checked batteries, one battery down on charge, Charged up as needed. Tested start - OK	142.7	0	0	0	142.7
180102-0054	SVC00198 307	01/09/2018	1H0103	ID - EARTHMOVING	186_INT	S	Service	1VT816	249102 kms	S1 B SERVICE	CARRIED OUT THE REQUIRED SERVICE AND SAFETY INSPECTIONS AS PER SERVICE SHCEDULE	142.7	96.75	0	5	244.45

171221-0049	SVC00197 802	01/08/2018	1H0103	ID - EARTHMOVING	186_INT	R	Brake	1VT816	249102 kms	REPLACE LEAKING BRAKE CYL	REPLACE LEAKING BRAKE CYL. CHECKED FOR FLUID LEAK AT THE RHS REAR WHEEL. FOUND TO BE BRAKE FLUID. DISASSEMBLED THE HUB AND REPLACED BOTH WHEEL CYLINDERS. CLEANED UP THE BRAKE DRUM AND SHOES. REASSEMBLED AND FITTED THE WHEELS. ADJUSTED THE BRAKES AND BLED UP THE SYSTEM. TEST DROVE OK. CLEANED OFF THE OUTSIDE OF THE HOUSING.	499.45	309.95	0	25	834.4
171129-0001	SVC00196 688	11/30/2017	1H0103	ID - EARTHMOVING	121_INT	R	Tyres	1VT816	248427	KUITRO 9.5R17.5 KRD02 X 4 +	KUITRO 9.5R17.5 KRD02 X 4 +DISPOSAL CARRIED OUT BY RUBAND 45909	0	1546	0	0	1546
171108-0009	SVC00195 636	11/28/2017	1H0103	ID - EARTHMOVING	186_INT	B	Engine	1VT816	248648	REPAIR OIL PRESSURE FAULT	UNIT WAS TOWED INTO THE WORKSHOP DUE TO LOW OIL PRESSURE, FOUND TO BE CAUSED BY SUMP IMPACT BREADKING THE PICK UP REPLACED PICK UP AND O-RING AS REQUIRED AND REINSTALLED SUMP WITH NEW GASKET AND TENSION BOLTS, FIT OIL PRESSURE GAUGE AND CHECK OIL PRESSURE ON START UP FOUND TO BE GOOD FOUND STSRTER MOTOR TO BE LOOSE AND TIGHTEN ROAD TEST UNIT ALL GOOD. REPAIR OIL PRESSURE FAULT, CHARGES TO MMG PROJECT, TRUCK ON DRY HIRE AND HAD SUMP STOWED IN BREAKING OFF OIL PICK UP, AS PER DALE BERRY AND JASON HAZELL TIM FORDS TIIME TO INSPECT FAULT AT MMG	790.94	306.89	0	50	1147.83
171107-0046	SVC00195 395	11/22/2017	1H0103	ID - EARTHMOVING	187_INT	R	Tyres	1VT816	246263	REMOVE ROCKS JAMMED BETWEEN	REMOVE ROCKS JAMMED BETWEEN REAR WHEELS AT MMG AS PER DALE BERRY, UNIT ON DRY HIRE DRIVEN BY CIVIL EMPLOYEES AND LABOUR HIRE.	80.35	0	0	0	80.35
170526-0046	SVC00186 748	06/19/2017	1H0103	ID - EARTHMOVING	187_INT	R	Starter Motor	1VT816	246842	REPLACE U/S STARTER MOTOR	REPLACE U/S STARTER MOTOR AND ADJUST BRAKES WASHED DOWN AROUND THE STARTER MOTOR AND CHASSIS. FOUND THE STARTER MOTOR MOUNTING BOLTS TO BE LOOSE, TIGHTENED THE BOLTS AND RECHECKED, FOUND THE STARTER TO BE U/S, REPLACED THE STARTER MOTOR. WHASHED DOWN THE WHEEL AND ADJUSTED THE BRAKES	241.05	293	0	12	546.05
170228-0012	SVC00182 345	03/21/2017	1H0103	ID - EARTHMOVING	187_INT	R	Brake	1VT816	244516	REPAIR TRAILER BRAKE OPERATION	REPAIR TRAILER BRAKE OPERATION	327.15	0	0	16	343.15
161202-0050	SVC00178 326	01/23/2017	1H0103	ID - EARTHMOVING	187_INT	S	Service	1VT816	243625	S1 B SERVICE	CARRIED OUT S1 B SERVICE AS PER SCHEDULE, GREASED ALL LUBE POINTS AND CHECKED FLUID LEVELS, REPLACED ENG OIL AND OIL FILTER, REPLACED FUEL FILTER AND CHECKED BRAKES AND PARK BRAKE.	330.03	103.62	0	5	438.65

170113-0014	SVC00179 816	01/23/2017	1H0103	ID - EARTHMOVING	187_INT	R	Air Con	1VT816	243625 KLMS	CHECK AIR CON FAULT	CHECKED AC NOT WORKING , CHECKED OPERATING PRESSURES, FOUND AC CONDENSOR CORE BLOCKED WITH MUD, CLEANED OUT AND RECHECKED	80.35	0	0	0	80.35
161205-0078	SVC00176 308	12/06/2016	1H0103	ID - EARTHMOVING	187_INT	R	Engine	1VT816	242419	ADJUST LOOSE THROTTLE CABLE	ADJUST AND TIGHTEN LOOSE THROTTLE CABLE	80.35	0	0	0	80.35
161115-0055	SVC00177 564	11/21/2016	1H0103	ID - EARTHMOVING	187_INT	R	Electrical	1VT816	241081	JUMP START & CHECK CHARGE RATE	JUMP START & CHECK CHARGE RATE	40.18	0	0	0	40.18
161025-0076	SVC00176 363	10/31/2016	1H0103	ID - EARTHMOVING	187_INT	R	Electrical	1VT816	241058 KLMS	REPAIR HEADLIGHT & TAILLIGHT W	CHECKED WIRING FAULT WITH TAIL LIGHTS AND FOUND WIRING DAMAGED, REPAIRED AND RE CHECK ALL OK	241.05	0	0	12	253.05
160923-0034	SVC00174 739	09/30/2016	1H0103	ID - EARTHMOVING	187_INT	R	Electrical	1VT816	239214	REPLACE AM/FM CD PLAYER	REPLACE AM/FM CD PLAYER AND WIRE IN TO SUIT, TEST OEPRATION ALL GOOD	200.88	161.77	0	10	372.65
160913-0018	SVC00169 373	09/21/2016	1H0103	ID - EARTHMOVING	187_INT	R	Sundries	1VT816	239055	PMI GREASE AND CHECK OVER, ADJ	PMI GREASE AND CHECK OVER AND ADJUST BRAKES, REMOVED LH SIDE DOOR HANDLE AND UNSEIZE AND REFIT, WASH OUT RADIATOR INTERCOOLER	501.18	0	0	25	526.18
160621-0025	SVC00169 863	08/17/2016	1H0103	ID - EARTHMOVING	187_INT	R	Starter Motor	1VT816	238853	Replace starter motor	REPLACE STARTER MOTOR, CHECK STARTING FAULT, JUMP START UNIT, CHECK CHARGING SYSTEM, CHECK STATER MOTOR OPERATION, STARTER FOUND TO HAVE AN INTERMINTANT FAULT, ORDER IN NEW STARTER, REPLACE STARTER MOTOR, TEST OPERATION	486.16	415	0	24.5	925.66
160624-0069	SVC00170 076	08/17/2016	1H0103	ID - EARTHMOVING	187_INT	R	Sundries	1VT816	238998	GREASE AND CHECK OVER	GREASE AND CHECK OVER	34.13	6.96	0	0	41.09
160706-0048	SVC00170 725	08/17/2016	1H0103	ID - EARTHMOVING	187_INT	R	Electrical	1VT816	238916	FIT VOLTAGE REDUCER	FIT VOLTAGE REDUCER TO RUN 12 VOLT AUX FUEL PUMPS IN TRAY AT MMG	118.13	400	0	6	524.13
160701-0078	SVC00171 515	08/03/2016	1H0103	ID - EARTHMOVING	187_INT	R	Electrical	1VT816	238865	REPAIR ISOLATOR FAULT	INSPECT ISOLATOR FOUND TO BE U/S REMOVE AND REPLACE AS REQUIRED, REPAIR WIRING LOOM AROUND THE BATTERY TERMINALS	354.38	108.25	0	0	462.63
160520-0013	SVC00168 314	06/20/2016	1H0103	ID - EARTHMOVING	187_INT	R	Electrical	1VT816	238516 KMS	REPLACE BATTERIES WITH HEAVY D	REPLACE BATTERIES WITH HEAVY DUTY ONES TO ALLOW FOR THE EXTRA CURRENT DRAW WITH 2 AUX FUEL TANKS IN THE TRAY AT MMG	111.3	298.38	0	5.5	415.18
160523-0096	SVC00168 464	06/17/2016	1H0103	ID - EARTHMOVING	187_INT	R	Transmissi on	1VT816	238801 kms	TRANSMISSION FAULT	TRANSMISSION FAULT TRAVEL TO TULLAH AND ATTEMPT TO RECTIFY FAULT WITH GEAR SLECTOR FOUND THAT SLECTOR ROD HAD SNAPPED ARRANGE FLOAT TO BURNIE AND MANUFACTURE AND FIT NEW ROD ASSY AND BALL JOINTS	771.75	36.42	350	255	1413.17
160519-0025	SVC00168 272	05/30/2016	1H0103	ID - EARTHMOVING	187_INT	R	Transmissi on	1VT816	238367	REPAIR GEAR SHIFT FAULT	TRAVELLED TO MMG, REPAIRED GEAR STICK LINKAGES, REFITTED TO UNIT, ADJUSTED AND TEST OK.	200.55	10.67	0	32	243.22
160418-0003	SVC00166 467	05/11/2016	1H0103	ID - EARTHMOVING	187_INT	F	Electrical	1VT816	238158	FIT UP AUX FUEL PUMP WIRING &	FIT UP AUX FUEL PUMP WIRING & BREATHER	236.25	64.85	0	0	301.1
160201-0045	SVC00162 921	04/26/2016	1H0103	ID - EARTHMOVING	186_INT	R	Tyres	1VT816		REPLACE DAMAGED TYRE	REPLACE DAMAGED TYRE KUHMO 9.5 R17.5 KRS03 X 1 RUBAND 21984	0	325	0	0	325

160212-0039	SVC00163 372	02/29/2016	1H0103	ID - EARTHMOVING	187_INT	F	Sundries	1VT816	237,978KM	FIT UP FOR MMG PROJECT	Set up for MMG project second fire extinguisher etc.	196.88	0	0	75	271.88
160229-0061	SVC00164 253	02/29/2016	1H0103	ID - EARTHMOVING	183_INT	R	Tyres	1VT816		REPAIR PUNTURED TYRE	1VT816 HINO TIPPER	0	0	28	0	28
160215-0096	SVC00163 840	02/23/2016	1H0103	ID - EARTHMOVING	186_INT	R	Sundries	1VT816		SUPPLY FILTERS	REPAIR PUNTURED TYRE. PARTS ONLY --SUPPLY FILTERS	0	46.82	0	0	46.82
160127-0008	SVC00162 952	02/12/2016	1H0103	ID - EARTHMOVING	186_INT	S	Service	1VT816	237974 kms	PRE AND POST INSPECTION	PRE AND POST INSPECTION. COMPLETED PRE AND POST INSPECTION. REPLACED MISSING MUD FLAP,CHECKED CRANE OPERATION,TIGHTENED DIFF BOLTS,CHECKED HOIST OPERATION AND REPLACED MISSING GREASE NIPPLES. FITTED UP UHF AND SPARE TYRE.	1147.14	1075.77	0	50	2272.91
160201-0052	SVC00162 858	02/10/2016	1H0103	ID - EARTHMOVING	182_INT	R	Sundries	1VT816		REPAIRS TO BROKEN LATCH ON TOO	REPAIR BROKEN LATCH ON TOOL BOX	78.75	0	0	0	78.75
160202-0046	SVC00162 984	02/05/2016	1H0103	ID - EARTHMOVING	181_INT	F	Sundries	1VT816	237976 KM	FIT REFLECTIVE TAPE TO SIDES O	FIT REFLECTIVE TAPE TO SIDES OF TRUCK TRAY AND CAB	68.25	0	0	0	68.25
160127-0073	SVC00162 960	02/04/2016	1H0103	ID - EARTHMOVING	186_INT	R	Engine	1VT816	237974KMS	REPLACE FUEL TANK BRACKETS	REPLACED THE FUEL TANK BRACKETS AND STRAPS REPLACED CAB TITL HANDLE	238.88	794.62	0	12	1045.5
151214-0050	SVC00161 116	12/21/2015	1H0103	ID - EARTHMOVING	186_INT	R		1VT816	237917 KMS	Repair Revolving light	REPAIR REVOLVING LIGHT. TRACED WIRING TO FUSE BOX.FOUND POWER SUPPLY DISCONNECTED.REFITTED WIRING AND SECURED TO WIRING LOOM.SECURED LOOSE WIRING OUTSIDE CAB AND REPLACED FAULTY GLOBE.	84	9.89	0	4	97.89
151214-0072	SVC00161 098	12/18/2015	1H0103	ID - EARTHMOVING	186_INT	S	Service	1VT816	237918 KMS	S1 A SERVICE	S1 A SERVICE. Completed service as per service sheet.	98.7	83.62	0	10	192.32
151008-0047	SVC00157 982	10/29/2015	1H0103	ID - EARTHMOVING	186_INT	R	Engine	1VT816	236516 KMS	REPLACE ENGINE PIPE	REPLACE ENGINE PIPE. REMOVED ENGINE PIPE AND TURBO OUTLET.DRILLED OUT SIEZED STUNS AND FITTED NEW PARTS.REFITTED OUTLET WITH NEW ENGINE PIPE.ADJUSTED MUFFLER TO LINE UP WITHE ENGINE PIPE. REPLACED LHS DOOR LOCK AND BARREL.REFITTED PANELS. CHECKED CRANE OPERATION AND GREASED.	417.38	1372.97	0	20	1810.35
150727-0013	SVC00154 085	07/30/2015	1H0103	ID - EARTHMOVING	182_INT	R	Sundries	1VT816		INSPECT TRAY FOR CORRECT OPERA	INSPECT TRAY FOR CORRECT OPERATION OF RETAINING LOCKS	68.25	0	0	0	68.25
150615-0051	SVC00151 888	06/23/2015	1H0103	ID - EARTHMOVING	182_INT	R	Trays/Buckets	1VT816	235447	REPAIRS TO TAILGATE, SIDES & T	REPAIRS TO TAILGATE, REPOSITION HINGE POINT, REMOVE BROKEN TAILGATE LATCH & WELD ON NEW LATCH ASSY, REMOVE SIDES, TAKE DOWN TO PRESS & WITH ASSISTANCE STRAIGHTEN BOTH SIDES OUT, REPAIRS TO TOOLBOX HINGE & REPLACE TOOLBOX T LATCH	1795.5	98.12	0	50	1943.62

150610-0074	SVC00151 850	06/19/2015	1H0103	ID - EARTHMOVING	186_INT	R	Hydraulic	1VT816	235447 KMS	REPLACE HYD PUMP	REPLACE HYD PUMP. FLOW TESTED THE PUMP AND FOUND U/S.REMOVED THE PUMP, DRAINED THE TANK, CLEANED RETURN FILTER AND REPLACED BEARING IN PUMP SHAFT SUPPORT. FITTED NEW PUMP, FILLED HYDRAULIC TANK AND CHECKED RELIEF PRESSURE.3000 PSI.	460.69	999.63	0	23	1483.32
150610-0038	SVC00151 615	06/15/2015	1H0103	ID - EARTHMOVING	186_INT	S	Service	1VT816	235446 kms	S1 C SERVICE	S1 C SERVICE. COMPLETED SERVICE AS PER SERVICE SHEET. REPLACED GREASE NIPPLES ON CLUTCH THROW OUT. REPLACED MISSING FIRST AID KIT. FITTED MIRROR. NOTE.TAIL GATE,TOOL BOX AND SIDE BOARDS BENT.	307.13	307.34	0	62.64	677.11
150421-0010	SVC00149 523	04/30/2015	1H0103	ID - EARTHMOVING	105_HBG NYR	R	Electrical	1VT816		REPLACE FAILED BATTERIES	1VT816 JOB CARRIED OUT - TEST BATTERIES, FOUND MELTED POST. COLLECT BATTERIES FROM LA, FIT NEW BATTERIES AND REPAIR LEADS.	136.5	201.9	0	0	338.4
141113-0042	SVC00140 986	11/28/2014	1H0103	ID - EARTHMOVING	186_INT	R	Electrical	1VT816	233,959 km	REVERSE ALARME NOT WORKING	LOCATE AND REPAIR SHORT IN WIRING TO REVERSE ALARM, ALARM STILL NOT WORKING, REPLACE AND FIT WARNING LIGHT UNDER DASH, RUN CABLE FROM LIGHT TO ALARM TO LIMIT SWITCH UNDER TRAY, WIRE UP TO SUIT, MOUNT SWITCH TO ALLOW FOR LIGHT AND BUZZER TO COME ON WHEN TRAY GOES UP.	580.13	126.1	0	29	735.23
141114-0030	SVC00141 127	11/18/2014	1H0103	ID - EARTHMOVING	186_INT	R	Service	1VT816	233974 kms	GENERAL CHECK OVER	GENERAL CHECK OVER UNIT, GREASE AND ADJUST THE BRAKES.	102.38	0	0	5	107.38
140924-0040	SVC00139 052	10/22/2014	1H0103	ID - EARTHMOVING	184_INT	S	Service	1VT816	231530	S1 B SERVICE 10,000KM	COMPLETED SERVICE AS PER SERVICE SCHEDULE CARRIED OUT BY SPECIALIST ACCESS EQUIPMENT	0	0	679.6	0	679.6
141022-0021	SVC00139 841	10/22/2014	1H0103	ID - EARTHMOVING	184_INT	R	Exhaust	1VT816	231530	REPAIR EXHAUST AND REPLACE RUB	COMPLETED EXHAUST REPAIRS AND REPLACE RUBBER CARRIED OUT BY SPECIALIST ACCESS EQUIPMENT AS PER GREG REID	0	0	190	0	190
140929-0069	SVC00138 937	10/20/2014	1H0103	ID - EARTHMOVING	186_INT	R	Electrical	1VT816	232,168 Klms	REPAIR ROTATING LIGHT,	CHECK ROTATING LIGHT NOT WORKING, CHECK SWITCH, TRACE WIRING IN AND OUTSIDE OF CAB AND LOCATED BROKEN WIRING UNDER THE FLOOR MAT, REPAIR WIRING AND TEST OPERATION ALL GOOD. REMOVE AND REPLACE BROKEN NUMBER PLATE LIGHT, REPLACE WITH LED	170.63	22	0	8.5	201.13
140929-0031	SVC00138 665	10/07/2014	1H0103	ID - EARTHMOVING	186_INT	R	Sundries	1VT816	232168 kms	PRE INSPECTION CHECK	PRE INSPECTION CHECK. REPLACED MISSING MUD FLAPS. CLEANED OUT THE CAB. FABRICATED AND FITTED NEW NUMBER PLATE LIGHT BRACKETS. NOTE,WINDSCREEN CRACKED,FUEL TANK STRAP BENT.	157.5	28.04	0	7.5	193.04
140523-0030	SVC00131 595	05/29/2014	1H0103	ID - EARTHMOVING	186_INT	R	Electrical	1VT816	228,542 Klms	REPAIRS TO ROTATING LIGHT	CHECK ROTATING LIGHT U/S, LOCATED OPEN CIRCUIT IN WIRING BETWEEN POWER AND SWITCH, REPAIR AS REQUIRED CHECK ALL LIGHTS ALL GOOD	204.75	0	0	10	214.75

140408-0007	SVC00128 947	04/23/2014	1H0103	ID - EARTHMOVING	182_INT	F	Sundries	1VT816		MEASURE UP & QUOTE FOR BARTLET	MEASURE UP & QUOTE FOR BARTLETT BALL FITUP	71	0	0	0	71
140327-0035	SVC00128 449	03/29/2014	1H0103	ID - EARTHMOVING	121ADMIN	R	Tyres	1VT816		Puncture repair	PUNCTURE REPAIR RUBAND	0	40	0	0	40
140114-0023	SVC00124 525	01/24/2014	1H0103	ID - EARTHMOVING	181_INT	F	Sundries	1VT816		FIT HB DECALS TO TRUCK	FIT HB DECALS AS REQUIRED	32.5	0	0	0	32.5
131104-0047	SVC00120 812	12/12/2013	1H0103	ID - EARTHMOVING	186_INT	R	Brake	1VT816	224,853 KMS	CHECK FOR BRAKE INBALANCE	CHECK FOR BRAKE INBALANCE. CHECKED BRAKE ADJUSTMENT AND LININGS. FOUND LEAKING CYLINDERS ON THE STEER AXLE. REPLACED CYLINDERS AND HUB SEALS. STILL LOCKED REAR AXLE WITH NO LOAD. SWAPPED OVER TREADLE VALVE AIR LINES. NO CHANGE. SWAPPED OVER MASTER SERVOS AND NO CHANGE. SENT TO MOTORS FOR BRAKE TEST. BRAKE TEST OK. WEIGHT BECAUSE OF THE CRANE IS GREATER THAN THE REAR AXLE. MAY NEED TO SET UP AN ADJUSTABLE BRAKE BIAS VALVE.TO DO SO WOULD REQUIRE A MODIFICATION PLATE AND THE INSPECTION PROCESS.	440	300.33	131	6	877.33
131104-0044	SVC00121 571	11/22/2013	1H0103	ID - EARTHMOVING	186_INT	R	Steering	1VT816	224853 KMS	Replace drag link	REPLACED WORN DRAG LINK.ONLY ABLE TO PURCHACE AS A COMPLETE ASSEMBLY.	60	1250	0	0	1310
131104-0046	SVC00120 463	11/22/2013	1H0103	ID - EARTHMOVING	186_INT	S	Service	1VT816	224853 KMS	PRE AND POST INSPECTION	PRE AND POST INSPECTION. COMPLETED PRE AND POST INSPECTION. FOUND LARGE CUT IN SIDE WALL OF STEER TYRE.HAD REPLACED.	60	387	0	0	447
131112-0092	SVC00121 568	11/22/2013	1H0103	ID - EARTHMOVING	186_INT	R	Bodywork	1VT816	224853 KMS	REPLACE DAMAGED MUD FLAPS	REPLACE DAMAGED MUD FLAPS	20	28.04	0	0	48.04
131021-0026	9672	10/29/2013	1H0103	ID - EARTHMOVING	186_INT	S	Service	1VT816		S1 B SERVICE		0	0	0	0	0
130812-0112	SVC00115 302	09/04/2013	1H0101	ID - TRANSPORT	186_INT	R	Service	1VT816	223019KM	PRE AND POST INSPECTION	CARRIED OUT INSPECTIONS AS REQUIRED TOPPED UP ENGINE OIL REPAIRED REVERSE ALARM THAT WAS NOT WORKING	60	12.3	0	0	72.3
130715-0064	SVC00113 321	07/25/2013	1H0101	ID - TRANSPORT	186_INT	R	Brake	1VT816	221568KMS	CHECK OUT BRAKE LOCK	CHECK OUT BRAKE LOCK. Checked operation and repaired sticking solenoid.	162.5	0	0	8	170.5
130617-0004	SVC00111 654	06/28/2013	1H0101	ID - TRANSPORT	182_INT	A	Sundries	1VT816		REPAIRS TO BULL BAR & TRAY AS	REPAIRS TO BULL BAR & TRAY AS REQUIRED	1740	124.11	0	50	1914.11

121112-0065	SVC00100003	06/19/2013	1H0101	ID - TRANSPORT	186_INT	R	Engine	1VT816	220945 kms	Engine rebuild	ENGINE REBUILD. Cleaned parts and assembled short motor.Had to set ring gaps and big end pip and crush.Replaced bent con rod. Disassemble damaged cylinder head,machine shop assembled bare head and fitted new injector tubes. Replaced all exhaust manifold studs and fitted head fitted to short motor.Had cam box threads hellicoiled.Fitted new cam and completed assembly with new turbo.Fitted new crank seals and clutch and flywheel assembly. Refitted engine to chassis and reconnected cables and hoses.Refitted the gearbox and completed drive train assembly. Checked engine oil pressure and test drove to burn out built up oil in the exhaust system. Steam cleaned chassis and vehicle to remove built up mud. Cleaned out the rubbish from the cab. Replaced missing decals on the crane,resecurd hoses and protected chaffing hoses. Load tested the crane,extended jib,steam cleaned grit built up on boom sections and relubricated. Cleaned tray.Replaced faulty exhaust brake cylinder. Note.Engine has water in the cooling system and needs to be changed to hino coolant.	4166.75	11358.64	1428.6	0	16953.99
130611-0006	SVC00111636	06/17/2013	1H0101	ID - TRANSPORT	186_INT	R	Brake	1VT816		CLUTCH REPAIRS	CLUTCH REPAIRS. Bled up clutch system and checked for leaks in the system.	97.5	0	0	0	97.5
130529-0079	SVC00111285	06/13/2013	1H0101	ID - TRANSPORT	186_INT	S	Service	1VT816	220945 kms	S1 B SERVICE	SERVICED UNIT AS REQUIRED	312.5	349.54	0	18.5	680.54
120404-0032	SVC00087320	07/23/2012	1H0101	ID - TRANSPORT	186_INT	R	Engine	1VT816		REPAIR ENGINE FAILURE	Truck arrived from Musselroe with suspected engine failure. Removed inlet hose and inspected turbo found turbo to be u/s. Being the turbo had de-cintergrated and metal had entered engine. We removed hose to inlet manifold all of the inlet manifold was full of metal. The cylinder head was removed and the engin internals examined. The cylinder head is u/s. The engine was removed from the truck and dis-assembled. Pistons had failed. This engine needs rebuilding or replacing The fuel pump and injectors were sent and tested , some repairs were done The engine is still in a dis-assembled state at the moment.	1048.5	584.85	3106.82	0	4740.17

120618-0093	SVC00091 417	06/29/2012	1H0101	ID - TRANSPORT	186_INT	R	Tyres	1VT816		TYRES RUBAND - 68180	TYRES RUBAND - 68180	0	312	0	0	312
120411-0058	SVC00087 321	04/30/2012	1H0101	ID - TRANSPORT	182_INT	R	Lathe	1VT816		MACHINE CYLINDER LINER REMOVAL	MACHINE CYLINDER LINER REMOVAL TOOL	147.5	10	0	0	157.5
120330-0004	SVC00086 805	03/30/2012	1H0101	ID - TRANSPORT	184_INT	R	Suspension/UC	1VT816	219715	REPLACE SPRING BUSHES & PINS		59	0	2587.64	0	2646.64
120228-0101	SVC00085 200	02/29/2012	1H0101	ID - TRANSPORT	184_INT	R	Sundries	1VT816	219540	INSPECT AND GREASE TRUCK	INSPECT AND GREASE TRUCK - CHECK FLUID LEVELS, TOP UP ENGINE OIL AND COOLANT, ADJUST PARK BRAKE, GREASE TRUCK AND CARRY OUT GENERAL INSPECTION	107	23.17	0	9	139.17
110919-0023	SVC00081 931	01/24/2012	1H0101	ID - TRANSPORT	186_INT	S	Service	1VT816		S1 B SERVICE	SERVICE UNIT AS REQUIRED	147.5	110.34	0	2.7	260.54
111107-0061	SVC00079 556	11/22/2011	1H0101	ID - TRANSPORT	186_INT	R	Tyres	1VT816		TYRE REPAIRS	SUPPLY AND FIT NEW TYRES	0	1648	0	0	1648
110824-0017	SVC00076 028	08/31/2011	1H0101	ID - TRANSPORT	122_INT	R	Tyres	1VT816		TYRE REPAIRS RUBAND 59133	TYRE REPAIRS RUBAND 59133	0	370	0	0	370
110830-0099	SVC00075 971	08/31/2011	1H0101	ID - TRANSPORT	184_INT	R	Sundries	1VT816	N/A	RETRIEVE LOCKED IN KEYS	TRAVEL TO HOBART AIRPORT. REMOVE KEYS THAT WERE LOCKED IN UNIT.	152	0	0	54	206
110721-0045	SVC00074 820	08/12/2011	1H0101	ID - TRANSPORT	186_INT	R	Electrical	1VT816	213,330 Kims	REPLACE REAR LIGHTS WITH LED'S	REMOVE OLD REAR LIGHTS AND REPLACE WITH LED'S AS REQUIRED	236	307	0	0	543
110721-0060	SVC00073 574	07/29/2011	1H0101	ID - TRANSPORT	182_INT	R	Trays/Buckets	1VT816		FABRICATE TAIL LIGHT GUARD	fabricate tail light guard	65	11.34	0	0	76.34
110720-0048	SVC00073 666	07/25/2011	1H0101	ID - TRANSPORT	186_INT	R	Sundries	1VT816	213330KMS	PRE HIRE INSPECTION REPORT	INSPECT UNIT INSIDE AND OUT SIDE PRIOR TO HIRE REPLACED PARK LIGHT AND HEAD LIGHT GLOBES ON RHS TOP UP ENGINE OIL REMOVE AND REPLACE REAR MUD GUARD FLAPS WELD FAULTY TAIL LIGHT BRACKET ON LHS	78	63.46	0	0	141.46
110530-0026	SVC00070 872	06/07/2011	1H0102	DRY HIRE EQUIPMENT	122_INT	R	Tyres	1VT816	212387	TYRE REPAIRS RUBAND 57287	TYRE REPAIRS RUBAND 57287	0	130	0	0	130
110516-0073	SVC00069 924	05/24/2011	1H0102	DRY HIRE EQUIPMENT	184_INT	R	Drive Line	1VT816	212842	REPLACE DRIVELINE BOLTS	TRAVELLED TO CASCADE BREWERY. FIT TAILSHAFT BACK ONTO UNIT. FIT TEMP BOLTS TO GET TRUCK OUT OF TIP. ESCORT TRUCK TO JOB SITE AND TAG OUT. FIT GENUINE BOLTS TO TAIL SHAFT	310.5	54.56	0	36	401.06
110301-0031	SVC00067 725	04/13/2011	1H0102	DRY HIRE EQUIPMENT	181_INT	A	Bodywork	1VT816	210862KM	BODYWORK REPAIRS TO RHS AS QUO	BODYWORK REPAIRS TO RHS OF TRUCK PAINT NEW RH DOOR AND FIT UP FIT NEW HAZELL DECALS TO DOORS REMOVE OLD MUDFLAPS FROM REAR AND FIT NEW MUDFLAPS	590	2038.49	0	0	2628.49
110321-0045	SVC00066 834	03/29/2011	1H0102	DRY HIRE EQUIPMENT	187_INT	A	Electrical	1VT816	210713kms	Repair PTO	REPAIR PTO. travel to wesley vale and repair, and check wiring and switches. trace wiring and locate open circuit in loom where wire had been broken off. Repair and test. Return to burnie.	276	0	0	120	396

110217-0064	SVC00063 348	03/11/2011	1H0102	DRY HIRE EQUIPMENT	186_INT	A	Steering	1VT816	210149 kms	STEERNG REPAIRS	STEERNG REPAIRS Checked steering after accidient with the right hand side door. Found pump had failed. Disassembled,cleaned and replaced pump cartridge. Cleaned out supply,suction and return hoses. Checked operation OK.	472	568.49	0	0	1040.49
110217-0065	SVC00065 579	03/04/2011	1H0102	DRY HIRE EQUIPMENT	186_INT	B	Clutch	1VT816	210149 kms	REPLACE ABUSED CLUTCH	REPLACE ABUSED CLUTCH Replaced abused clutch.Clutch would not drive vehicle,had been overheated.	708	934.54	0	0	1642.54
110216-0040	SVC00065 058	02/23/2011	1H0102	DRY HIRE EQUIPMENT	186_INT	S	Service	1VT816	210148km	S1 B SERVICE	Carry out the required "b" service. Had very loose wheel nuts on the rear of the truck. Replaced the number plate light globe. Replaced the revolving light. serviced the crane greased and inspected. Topped up the coolant as it was low.	354	244.85	0	2.7	601.55
101022-0044	SVC00059 676	01/07/2011	1H0471	IC - HBCC ADMIN	122_INT	R	Sundries	1VT816		STORE ISSUE OCT PG 103-3306	STORE ISSUE OCT PG 103-3306	0	300	0	0	300
101230-0027	SVC00062 894	12/31/2010	1H0471	IC - HBCC ADMIN	184_INT	R	Brake	1VT816	208968	REPAIR BRAKE STICKING FAULT	14/12 - TRAVELLED TO TAROONA TO CHECK BRAKE STICKING FAULT. TOOK UNIT FOR TEST DRIVE BUT COULD NOT FAULT. 20/12 - TRAVELLED TO HBMI TO CHECK FAULT AGAIN. TOOK FOR SECOND TEST DRIVE AND AGAIN COULD NOT FAULT. LOCATED DRIVER AND WENT FOR THIRD TEST DRIVE. FOUND HILL START PARK BRAKE SWITCH (WHICH LOCKS THE BACK BRAKES) BEING MISTAKEN FOR PTO SWITCH. INSTRUCTED DRIVER ON CORRECT APPLICATIONS OK.	276	0	0	63	339
101101-0054	SVC00060 604	11/23/2010	1H0471	IC - HBCC ADMIN	186_INT	R	Bodywork	1VT816	208034 kms	CHECK SEAT MOVEMENT	Replace the suspension base.	94	1725	0	0	1819
101028-0017	SVC00060 007	11/22/2010	1H0471	IC - HBCC ADMIN	186_INT	R	Bodywork	1VT816	208,032k m	REPLACE DRIVERS SIDE WINDOW	Remove and replace damaged door window as required	177	504.24	0	0	681.24
101027-0062	SVC00059 625	11/08/2010	1H0471	IC - HBCC ADMIN	184_INT	R	Engine	1VT816	2080hrs	CHECK AND REPAIR FUEL LEAK	TRAVELLED TO TAROONA. CHECKED FUEL LEAK . FOUND FUEL FILTER SPLIT. FITTED NEW FILTER AND BLED SYSTEM	176	0	0	32.4	208.4
101025-0088	SVC00059 756	10/29/2010	1H0471	IC - HBCC ADMIN	186_INT	R	Bodywork	1VT816	207930 kms	REPAIR DRIVER SIDE DOOR	REPAIR DRIVER SIDE DOOR Removed drivers side door panel and removed broken door restraint.Removed door restraint from wrecked toyota ute and fitted.Refitted door panel.	59	0	0	0	59
100713-0059	SVC00053 851	07/21/2010	1H0471	IC - HBCC ADMIN	186_INT	S	Service	1VT816	202816 kms	S1 B SERVICE	CARRY OUT B SERVICE AS PER SCHEDULE	235	90.18	0	0	325.18
100506-0027	SVC00049 284	05/27/2010	1H0471	IC - HBCC ADMIN	186_INT	R	Hydraulic	1VT816	200139 kms	CHECK HOIST PRESSURE	Checked the hoist operation. Found that relief pressure was low. removed the relief valve to find the seals had erroded off the valve. New seals were installed and lasted no tiome at all. A new valve was arranged and installed, the pressures were rechecked and adjusted as required, the tray decent valve was adjusted as required.	440	63.43	0	0	503.43

100525-0049	SVC00050803	05/26/2010	1H0471	IC - HBCC ADMIN	184_INT	R	Brake	1VT816	200344	REPAIR BRAKE FAULT	TRAVELLED TO CATAGUNYA. CHECKED BRAKES STICKING ON AND FOUND PARK BRAKE HAD BEEN ADJUSTED INCORRECTLY AND JAMMING. ADJUSTED PARK BRAKE CORRECTLY AND RECHECKED	99	0	0	32.4	131.4
100430-0024	SVC00049364	05/19/2010	1H0471	IC - HBCC ADMIN	184_INT	R	Starter Motor	1VT816	200112	CHECK STARTER MOTOR FAULT	TRAVELLED TO MONTROSE. CHECK FOR STARTING FAULT AND LOCATE FAULTY STARTER. REMOVE AND PICK UP ITEM FROM ASHDOWN AND RETURN TO JOB SITE. REFIT NEW STARTER AND TEST	261.5	1000	0	21.6	1283.1
100209-0046	SVC00044081	03/19/2010	1H0471	IC - HBCC ADMIN	186_INT	R	Bodywork	1VT816		REPAIR CABMOUNT	Repair as required. replace cab mounts repalce hydraulic hose and reapi the door assemblies. The exhaust manifold was resealed, many other minor repairs were completed.	1559.25	734.2	187.62	0	2481.07
100209-0046	SVC00046616	03/19/2010	1H0471	IC - HBCC ADMIN	186_INT	R	Bodywork	1VT816		REPAIR CABMOUNT	Hydraulic oil omitted from service invoice SVC00044081	0	49.2	0	0	49.2
100209-0027	SVC00045064	02/24/2010	1H0471	IC - HBCC ADMIN	186_INT	R	Electrical	1VT816	19,961 Klms	CHECK ELECTRICAL SYSTEM REPAIR	Check and repair high beam, replaced reverse beeper and repaired wiring at rear of vehicle.	302.5	7.25	0	0	309.75
091217-0110	SVC00042389	01/11/2010	1H0471	IC - HBCC ADMIN	122_INT	R	Tyres	1VT816	NA	FOREIGN BRAND TYRES	FOREIGN BRAND TYRES	0	498.36	0	0	498.36
091217-0111	SVC00042390	01/11/2010	1H0471	IC - HBCC ADMIN	122_INT	R	Tyres	1VT816	NA	DU 9.5R17.5 143/141J SP252 DUN	DU 9.5R17.5 143/141J SP252 DUN	0	397.91	0	0	397.91
100105-0080	SVC00042055	01/06/2010	1H0471	IC - HBCC ADMIN	184_INT	R	Tyres	1VT816	197,033	CHANGE FLAT TYRE	Travelled to Musscle Roe and chang flat tyre as required LH front.	99	0	0	76.5	175.5
091108-0015	SVC00040099	11/27/2009	1H0471	IC - HBCC ADMIN	184_INT	R	Bodywork	1VT816	196847 kms	REPAIR LHF GUARD	TRAVELLED TO UNIT. CARRY OUT REPAIRS TO LEFT HAND FRONT GUARD	110	0	0	90	200
090507-0063	SVC00034381	09/18/2009	1H0471	IC - HBCC ADMIN	184_INT	S	Radio	1VT816	194653	Replace UHF microphone	TRAVELLED TO MUSSELROE BAY. REPLACE UHF MICROPHONE	66	182.68	0	18	266.68
090821-0020	SVC00035337	09/03/2009	1H0471	IC - HBCC ADMIN	184_INT	R	Bodywork	1VT816	194010	REPLACE WIPER ARM ASSEMBLY	REPLACE WIPER ARM ASSEMBLY : 18/8/09 - TRAVEL TO M.R.B TEST CHECK REVERSE BEEPER FAULT FOUND LOOSE WIRE,ORDER NEW WIPER ARM. * NO PARTS USED ! TRAVEL DISTANCE 100 KMS 27/9/09 - TRAVEL TO M.R.B FIT UP NEW L/H/S WIPER ASSEMBLEY AND TEST. * ALL PARTS SUPPLIED THROUGH F.R.M DEVONPORT ! TRAVEL DISTANCE 50 KMS	227	260	0	0	487
090826-0062	SVC00035335	09/03/2009	1H0471	IC - HBCC ADMIN	184_INT	R	Electrical	1VT816	194346	Replace u/s Batteries.	REPLACE U/S BATTERIES : TRAVEL TO M.R.B TEST BATTERY'S ORGANIZE WITH P/STELFOX FOR PICK UP IN LAUNCESTON AND TRAVEL BACK TO M.R.B. * ALL BATTERIES SUPPLIED THROUGH EXIDE LAUNCESTON ! TRAVEL DISTANCE 250 KMS	437	198.66	0	225	860.66
090820-0072	SVC00034695	08/24/2009	1H0471	IC - HBCC ADMIN	184_INT	R	Electrical	1VT816	194117	JUMP START UNIT ETC	TRAVELLED TO MUSSLEROE BAY. CHECK BATTERY FLUID, TIGHTEN BATTERY CLAMPS, JUMP START AND CHECK CHARGE RATE. REPLACED BLOWN UHF AND REVOLVING LIGHT FUSE	135.5	0	0	45	180.5
090709-0067	SVC00032442	08/21/2009	1H0471	IC - HBCC ADMIN	181_INT	R	Trays/Buc kets	1VT816		STEAM CLEAN,SANDBLAST AND	Sand blast and repaint the tray as required. Clean up the truck and paint as well.	2200	458.87	380	0	3038.87
090805-0008	SVC00034394	08/19/2009	1H0471	IC - HBCC ADMIN	186_INT	R	Electrical	1VT816	193,720 Klms	CHECK AND CHARGE BATTERIES	Assess batteries. Charge and test batteries as required	55	0	0	0	55

090803-0058	SVC00034	08/18/2009	1H0471	IC - HBCC ADMIN	182_INT	R	Sundries	1VT816		MODIFY EXHAUST	MODIFY AND FIT NEW EXHAUST JA2 REPLACE CRANE SAFETY LATCH.	538.5	122.72	0	0	661.22
090718-0001	SVC00032	07/30/2009	1H0471	IC - HBCC ADMIN	182_INT	R	Trays/Buckets	1VT816		FABRICATE AND FIT NEW GUARDS	FABRICATE AND FIT NEW GUARDS	865	260.04	0	0	1125.04
090706-0017	SVC00032	07/28/2009	1H0471	IC - HBCC ADMIN	186_INT	R	Clutch	1VT816	194004km	CHECK AND REPAIR CLUTCH	Clutch repair, The exhaust was seized and had to be cut from the truck. The gear box was removed and it was noted the throw out bearing had seized. The fly wheel was machined and a new clutch was installed. The unit was reassembled and a new section of exhaust was fitted..	1127.5	1458.12	0	0	2585.62
090706-0077	SVC00032	07/27/2009	1H0471	IC - HBCC ADMIN	186_INT	S	Service	1VT816	194004 kms	S1 D SERVICE	Service unit as per service schedule Replaced battery terminals Repaired diff as required Drain coolant and flush engine Adjust valve clearance	660	330.21	0	2.7	992.91
090724-0043	SVC00033	07/24/2009	1H0471	IC - HBCC ADMIN	184_INT	R	Tyres	1VT816	193699	CHANGE TYRES	TRAVELLED TO MUSSELROE BAY. PICK UP AND CHANGE TYRE	99	0	0	135	234
090522-0043	SVC00029	05/26/2009	1H0471	IC - HBCC ADMIN	184_INT	R	Hydraulic	1VT816	192378	REPAIR LEAKING PIPE ON HAIB	TRAVELLED TO MUSSELROE BAY. REMOVE LEAKING PIPE ON HIAB, REPAIR DAMAGED PIPE AND REFIT. INSPECT SUSPENSION FOR NOISE AND VIBRATION, FOUND UNSERVICABLE FRONT SHOCK ABSORBERS	337	0	0	27	364
090518-0016	SVC00029	05/25/2009	1H0471	IC - HBCC ADMIN	184_INT	R	Suspension/UC	1VT816	192703	REPLACE FRONT SHOCK ABSORBERS	TRAVELLED TO MUSSLEROE BAY. PICK UP NEW SHOCK ABSORBERS AND FIT TO UNIT	231.5	218.46	0	180	629.96
090127-0086	SVC00025	03/13/2009	1H0471	IC - HBCC ADMIN	181_INT	A	Bodywork	1VT816		TIDY UP TRAY AS REQUIRED	TOUCH UP TRAY WHERE WELDED ADDITIONAL MECHANICAL WORK	287	15.41	634.03	0	936.44
090130-0037	SVC00024	03/12/2009	1H0471	IC - HBCC ADMIN	182_INT	R	Lathe	1VT816		PTO SHAFT, DAMAGED THREAD	REPAIR DAMAGED THREAD ON PTO SHAFT AS REQUESTED	25	0	0	20	45
090119-0029	SVC00022	02/27/2009	1H0471	IC - HBCC ADMIN	182_INT	R	Trays/Buckets	1VT816	188569	REPAIR TALGATE HINGES ETC	REPAIR TALGATE HINGES, REPAIR BENT SIDES MODIFY HINGES AND TIDY UP TRAY FOR PAINTING	2192.5	34.4	0	0	2226.9
090108-0022	SVC00023	02/12/2009	1H0471	IC - HBCC ADMIN	186_INT	R	Bodywork	1VT816	188564 kms	Repairs as per list	Replace wheel cylinders and brake linings Replace rear and outer hub seals replace air cleaner Replace sump plug Remove seat, repair seat base and replace seat Test hydraulic system and increase relief valve for hoist to 2600psi Test hoist operation OK Inspect and grease unit around Hiab Remove hydraulic pump shaft and reseal, modify brack for hydraulic pump and re install.	2071.5	1126.87	195	0	3393.37
081218-0065	SVC00022	01/14/2009	1H0471	IC - HBCC ADMIN	184_INT	R	Electrical	1VT816	186300	REPAIR ELECTRICAL FAULTS ETC	REPAIR ELECTRICAL PROBLEMS WITH UNIT	12.5	0	162.5	0	175
081203-0024	SVC00021	12/03/2008	1H0471	IC - HBCC ADMIN	122_INT	R	Tyres	1VT816	NA	PUNCTURE REPAIR, CALL OUT		0	95	0	0	95
080828-0077	SVC00015	09/17/2008	1H0471	IC - HBCC ADMIN	184_INT	S	Service	1VT816	186010.	S1 B SERVICE.	TRAVELLED TO BELL BAY AND CARRIED OUT S1-B TYPE SERVICE AS PER SCHEDULE	245	115.51	0	81	441.51

080625-0014	SVC00013 090	07/04/2008	1H0471	IC - HBCC ADMIN	184_INT	R	Brake	1VT816	182654	CHECK & REPAIR BRAKE OPERATION	TEST DRIVE TRUCK AND FOUND BRAKES REQUIRE ADJUSTING. FOUND ADJUSTERS SEIZED OM FRONT STEER WHEEL AND RIGHT HAND DRIVE WHEEL. FOUND WHEEL SEAL LEAING ON REAR DRIVE WHEEL,REMOVE ALL WHEELS AND CLEAN PARTS.REPACK ALL BEARINGS AND FREE UP BRAKE ADJUSTERS,DISMANTLE ALL BRAKE ADJUSTERS, CLEAN AND FREE UP BINDING THREADS, APPLY ANTI COI COROSION COMPOUND TO THREADS AND REASSEMBLE. FIT BOTH STEER WHEELS AND ADJUST BRAKES. TEST DRIVE OK	0	0	643.46	3.5	646.96
080428-0041	SVC00009 404	05/12/2008	1H0471	IC - HBCC ADMIN	184_INT	R	Electrical	1VT816	181232	Replace u/s Batteries.	TRAVELLED TO ALINTA. PICK UP NEW BATTERITES AND FIT TO UNIT, CLEAN UP ALL LEADS AND PUMP UP TYRES	125	201.84	0	74	400.84
080414-0016	SVC00008 599	04/29/2008	1H0471	IC - HBCC ADMIN	184_INT	R	Electrical	1VT816	180601	REPLACE U/S TAIL LIGHT ASSY.	TRAVELLED TO BELL BAY. CHANGE OUT BROKEN REAR LIGHT ASSEMBLIES, REPAIR DAMAGED WIRING,FITTED TWO NEW MUDFLAPS TO REAR OF VEHICLE	125	80.63	0	40	245.63
080130-0071	SVC00004 824	02/26/2008	1H0471	IC - HBCC ADMIN	184_INT	R	Brake	1VT816	179281	Replace leaking brake booster	TRAVELLED TO BELL BAY. ADJUST BELTS, TOP UP BRAKE FLUID AND ADJUST HAND BRAKE, CHANGE OUT PARK BRAKE SHOES AND ADJUST, REMOVE BRAKE BOOSTER AND DISMANTLE, UN-SERVICEABLE.	407.5	2322.04	0	87.2	2816.74
071130-0042	SVC00002 869	02/07/2008	1H0471	IC - HBCC ADMIN	184_INT	S	Service	1VT816	176001	SERVICE AND ASSESS BRAKES	UNIT NUMBER 1VT816 ODOMETER 176001 TRAVELLED TO ZEEHAN CHANGE OUT FLAT TYRE AND DROP OFF AT BP ZEEHAN FOR REPAIRS, SERVICE UNIT AS REQUIRED - FILTERS SUPPLIED ALREADY . ASSESS BRAKE FAULT EXPLAINED HOW ELECTRIC BRAKE WORKS TO OPERATOR	175	29.15	0	80	284.15
071130-0042	SVC00006 01	02/07/2008	1H0471	IC - HBCC ADMIN	184_INT	S	Service	1VT816	176001	SERVICE AND ASSESS BRAKES	ODOMETER: 17601	176.25	0	0	2	178.25
080108-0001	SVC00003 528	01/11/2008	1H0471	IC - HBCC ADMIN	122_INT	R	Tyres	1VT816		DELIVERY ADVICE 82186	SERVICE AND ASSESS BRAKES. FA6587	0	0	562	0	562
071115-0046	SVC00002 035	11/16/2007	1H0471	IC - HBCC ADMIN	184_INT	F	Electrical	1VT816		FIT AND WIRE IN DRIVING LIGHTS	BARRRY PARKER TYRE SERVICE SUPPLY AND FIT 2 TYRES UNIT 1VT816 FIT AND WIRE IN DRIVING LAMPS	0	0	364	0	364
071026-0027	SVC00001 410	11/12/2007	1H0471	IC - HBCC ADMIN	184_INT	R	Brake	1VT816		REPAIR BRAKES, EXHAUST ETC.	REPAIR BROKEN WIRES AT M/C. ADJUST REAR BRAKES. LOCATE AND REPAIR WIRING FAULT.	0	0	254.2	0	254.2

Applied
filters:
Posted_Date is on or
after
01/01/190
0
Equipment_ID is
1VT816