

Service Job	Invoice No	Date	Customer Id	Cost Cent	Prob	Type of Call	Equip ID	Hrs	Kms	Job Description	Work Done	Labor Cost	Material Cost	Subcontractor Cost	Other Cost	Total Cost
97548		09/11/2026	1HM105HBC181G		R	Bodywork	1ME737	0.0000	0	REMOVE SIGNAGE FROM TRUCK		1488	0	0	0	1488
97531	116867	09/10/2026	1HM105HBC184G		S	Service Earl	1ME737	20617.0000	0	PMI SERVICE	TRAVELLED TO HBMI CARRIED OUT PRE-DISPOSAL / PMI AS REQUIRED -- INSPECTED E03 TRANS CODE FOUND TRAY POTENTIOMETER MISSING.	252	163.4	0	200	595.4
79238	95371	10/09/2025	1HM105HBC186G		R	Sundries	1ME737	20552.0000	0	Parts missed off job #72664		0	4477.53	0	0	4477.53
78683	95793	09/29/2025	1HM105HBC105G		S	Sundries	1ME737	20552.0000	0	OCTOBER WEEKLY PMI'S	1ME737	576	0	0	0	576
78599	95292	09/29/2025	1HM105HBC105G		R	Sundries	1ME737	17372.0000	0	DIAGNOSE SHAFT MOVEMENT UNDER BONNET - KOMATSU	JOB CARRIED OUT - CARRY OUT PMI'S IN OCTOBER. INSPECT AND DIAGNOSE DAMPER FAILURE, REMOVE ASSEMBLY AND STRIP DOWN FOR INSPECTION	0	0	830.01	0	830.01
77904	99094	09/12/2025	1HM105HBC105G		R	Drive Line	1ME737	20500.0000	0	Excess Movement in Front Driveshaft	ATTEND TO EXCESSIVE MOVEMENT IN FRONT DRIVESHFT - REMOVE DAMPER, DISASSEMBLE AND INSPECT - ARRANGE FOR REQUIRED PARTS TO COMPELTE REPAIRS - REPLACES BEARINGS - REPLACED RUBBRS - REPLACED SEALS - REASSEMBLE DAMPER AND REFIT INTO ENGINE - REFIT UNI AND DRIVE SHAFT - TENSION ALL TO SPEC AND GREASE TEST OPERATION ALL OK	1032	5564.6	0	0	6596.6
77614	92831	09/09/2025	1HM105HBC105G		R	Hydraulic	1ME737	20500.0000	0	SUBLET MISSED FROM CALL 76501	1ME737	0	805	0	0	805
77441	93489	09/07/2025	1HM105HBC105G		S	Service Earl	1ME737	20500.0000	0	500HR SERVICE (20,500HR)	JOB CARRIED OUT - HYDRAULINK SUBLET MISSED FROM CALL 76501. CARRY OUT SERVICE AND VEHICLE INSPECTION. CHECK ALL LIGHTS, CHECK FLUID LEVELS. CHECK SUSPENSION, BRAKES AND TYRES	528	967.24	0	0	1495.24
77440	94245	09/07/2025	1HM105HBC105G		R	Hydraulic	1ME737	20500.0000	0	REPAIR MULTIPLE HYD OIL LEAK UNDER CAB (HOSES)	REPAIR MULTIPLE HYD OIL LEAK UNDER CAB (HOSES)	5760	1582.41	0	0	7342.41
77443	93562	09/07/2025	1HM105HBC105G		R	Transmissio	1ME737	20500.0000	0	TRANS ROUGH WHEN CHANGING UP & DOWN GEARS	FOUND VIBRATION ON DRIVESHAFT REMOVED UN, DAMPER AND DISASSEMBLE TO INSPECT FOUND SPLINES ON SHAFT WORN WAITING ON PARTS TESTDRIVE AFTER CALIBRATION OF TRANSMISSION, TOP UP ALL OILS ALL OK	576	865.95	0	0	1441.95

77049	94160	09/01/2025	1HM105HBC105G	R	Engine	1ME737	20504.000	PIN HOLE IN FILTER	1ME737	0	56.8	160	0	216.8
									ODOMETER - 20504 HOURS					
									JOB CARRIED OUT - PIN HOLE IN FILTER. REPLACE FUEL FILTER AND CHECK SYSTEM FOR LEAKS.					
76856	93568	08/27/2025	1HM105HBC105G	S	Sundries	1ME737	20504.000	SEPTEMBER PMIS		96	0	0	0	96
76501	92185	08/20/2025	1HM105HBC182G	R	Sundries	1ME737	20504.000	REPAIR LEAKING BRAKE COOLANT LINE		480	180.8	0	100	660.8
76253	92232	08/15/2025	1HM105HBC105G	R	Hydraulic	1ME737	20504.000	ATTEND TO OIL LEAK AND VIBRATION UNDER CAB	1ME737	4464	3373.05	1729.88	0	9566.93
									ODOMETER - 20504 HOURS					
									JOB CARRIED OUT - HYD HARD LINE UNDER RHS CAB HAS 2 PIN HOLES, OIL LEAKING UNDER HIGH PRESSURE. VIBRATION FROM OUTPUT YOKE FROM GEARBOX HAS INTERNAL PLAY. NEEDS TO BE STRIPPED OUT AND INSPECTED, SENDING TO LA FOR REPAIRS.					
76045	92198	08/12/2025	1HM105HBC182G	R	Trays/Buck	1ME737	20475.000	REPAIRS TO TAILGATE		1611	424.04	0	150	2035.04
73597	89735	06/30/2025	1HM105HBC105G	R	Sundries	1ME737	20475.000	freight for suspension cylinder return	1ME737	0	0	0	124.48	124.48
									JOB CARRIED OUT - FREIGHT FOR SUSPENSION CYLINDER RETURN.					

72664	91936	06/12/2025	1HM105HBC186G	R	Chassis	1ME737	204778.00(0	CARRY OUT PMI	CARRY OUT PMI INSPECTION AND NOTE LIST OF DEFECTS - PARK BRAKE PADS U/S - ELEPHANT FEET SPLIT AT BOTTOM U/S X2 - AIR INTAKE PIPES TO TURBO U/S - BRAKE COOLER HOSE ON CENTRE DIFF SPLIT - DIFF GETTING FILLED UP WITH BRAKE COOLER OIL - BONNET HINGES ARE SEIZED - ACCUMULATOR NEEDS TO BE RECHARGED - SUSPENSION CYLINDERS ON REAR NEED RECHARGING - TAIL LIGHTS ON REAR NEEDS REPLACING, SOME LIGHTS ARE INP AND APPEAR TO BE GETTING HOT. COVERS HAVE STARTED TO MELT - CAB NEEDS TO BE TILTED TO INSPECT UNDERSIDE AND GREASE DRIVE SHAFT - STEER CYLINDERS NEED PINS AND BUSHES - TAKE VEHICLE TO WASH BAY AND GIVE AND EXTENSIVE DEEP CLEAN - PUT IN WORKSHOP, JACK UP AND REMOVE CENTRE AXLE WHEELS - REMOVE FILLER PLUG FOR AIFF AND LET ENGINE RUN, ONCE RUN FOR 30 MINUTES REMOVE FILLER BUNG AND DRAIN 3-4 LITRE OF OIL SO DUO SEALS IN FD'S HAD LET GO - DRAIN ALL OILS FROM CENTRE AXLE - ORDER ALL PARTS NEEDED FOR FINAL DRIVE RESEAL - TAKE DOWN FDS AS PER MANUAL AND CLEAN - CLEAN DOWN AND PLACE AND WRAP ON PALLET TO KEEP DUST ETC OFF	19865	21149.58	0	1410	41424.58
72356	87898	06/05/2025	1HM105HBC182G	R	Trays/Buck	1ME737	20475.000(0	REPAIR BENT TAILGATE ARM		3966	60.95	0	350	4376.95
72058	86733	06/02/2025	1HM105HBC105G	R	Electrical	1ME737	20475.000(0	STARTER MOTOR FAILURE / REPLACE STARTER MOTOR	1ME737 ODOMETER - 20475 HOURS	384	1235.5	0	30	1649.5
71070	86401	05/13/2025	1HM105HBC182G	R	Sundries	1ME737	20460.000(0	LANCE OUT PINS		942	0	0	290	1232
69994	85764	04/16/2025	1HM105HBC105G	R	Hydraulic	1ME737	20460.000(0	Replace Leaking/Damaged Hoses	1ME737 ODOMETER - 20460 HOURS	0	6372.84	0	0	6372.84
69597	88120	04/09/2025	1HM105HBC105G	R	Suspension	1ME737	20460.000(0	Replace Rear Suspension Cylinders	1ME737 ODOMETER - 20460 HOURS JOB CARRIED OUT - REAR SUSPENSION CYLINDER PINS TO BE REMOVED AND REPLACED. L/H BUSH COLLAPSED ON CYLINDER PIN. LANCE PINS OUT. REPLACE REAR SUSPENSION CYLINDERS.	5640	18794.97	0	0	24434.97

69311	84450	04/04/2025	1HM105HBC105G	S	Service Earl	1ME737	20460.000	0	APRIL - PMI	1ME737	192	0	0	120	312
68021	82520	03/12/2025	1HM105HBC105G	R	Engine	1ME737	0.0000	0	EXHAUST LEAK	JOB CARRIED OUT - CARRY OUT PMI. 1ME737	968.58	975.43	0	30	1974.01
										ODOMETER - 20418 HOURS					
										JOB CARRIED OUT - INSPECT FOR EXHAUST LEAK. REMOVED MANIFOLD COVERS TO INSPECT GASKETS, OK. INSPECT EGR TUBE, FOUND TUBE BROKEN ON FLEX. COLLECTED PARTS AND STARTED PULLING HEAT SHIELDS OFF. REMOVED BOLTS, 2 WERE STUCK. CLEANED SURFACES AND USED ANTI-SIEZE ON ALL NEW BOLTS. FITTED EGR PIPE AND TESTED, NO LEAKS.					
67869	81834	03/11/2025	1HM105HBC105G	R	Electrical	1ME737	20418.000	0	NO EMERGENCY STEERING	1ME737	901	4716.64	320	30	5967.64
										ODOMETER - 20418 HOURS					
										JOB CARRIED OUT - CALL IN FOR NO EMERGENCY STEERING. REMOVE PUMP AND FIT NEW PUMP. LIFTED UP CAB, CHISEL BOLT HEADS CLEAN FROM PRODUCT BUILD UP TO BE ABLE TO REMOVE.					
67682	82015	03/06/2025	1HM105HBC105G	S	Service Earl	1ME737	20418.000	0	PMI - MARCH	1ME737	450.5	51.3	0	30	531.8
										JOB CARRIED OUT - CARRY OUT PMI'S DURING MARCH.					
66598	80721	02/17/2025	1HM105HBC105G	S	Sundries	1ME737	0.0000	0	FEBRUARY PMI	1ME737	270.3	12.75	0	30	313.05
										JOB CARRIED OUT - CARRY OUT PMI'S DURING FEBRUARY. REPLACED WIPER BLADE.					
65157	78045	01/20/2025	1HM105HBC182G	R	Sundries	1ME737	23210.000	0	LANCE AND REMOVE PINS, SETUP & MACHINE, WELD & FINISH MACHINE HOIST CYL PIN BORE, FIT NEW BEARINGS		1187.2	0	0	120	1307.2
64026	86508	01/16/2025	1HM105HBC186G	R	Sundries	1ME737	0.0000	0	PMI inspection	COMPLETED PMI AND NUMEROUS SMALL JOBS ON VEHICEL INCLUDING INSTALLING BIN SHIMS	2311.07	70	0	100	2481.07
63549	77332	01/07/2025	1HM105HBC184G	R	Sundries	1ME737	20206.000	0	GEAR SHIFT FAULT	ATTEND TO GEAR SHFIT FAULT - TOPPED UP TRANSMISSION OIL AND CLEAN UNDER BRAKE PEDAL TAKE FOR TEST RUN ALL OK	186.56	102.6	0	40	329.16
63367	77024	12/30/2024	1HM105HBC105G	R	Hydraulic	1ME737	20206.000	0	top up trans oil	1ME737	225.25	55.8	0	30	311.05
62979	77283	12/13/2024	1HM105HBC105G	S	Service Earl	1ME737	20206.000	0	PMI-DECEMBER	JOB CARRIED OUT - TOP UP TRANS OIL. 1ME737	135.15	0	0	0	135.15
										JOB CARRIED OUT - CARRY OUT PMI.					

62974	76302	12/13/2024	1HM105HBC105G	S	Service Earl	1ME737	20206.000(0	CARRY OUT 250 HOUR SERVICE	1ME737	90.1	32	0	30	152.1
62975	76301	12/13/2024	1HM105HBC105G	R	Electrical	1ME737	20206.000(0	REPLACED BECON LIGHT DUE TO WATER INGRESS	1ME737	90.1	133	0	30	253.1
62884	79586	12/12/2024	1HM105HBC105G	R	Bodywork	1ME737	20051.500(0	Replace broken Pre Cleaner	1ME737	45.05	0	0	30	75.05
61587	76320	11/19/2024	1HM105HBC105G	R	Electrical	1ME737	20051.500(0	Emergency steering light on	1ME737	135.15	1907.34	480	200	2722.49
61443	77293	11/18/2024	1HM105HBC105G	R	Electrical	1ME737	20051.500(0	REPLACE BATTERIES CALLOUT	1ME737	360.4	0	0	200	560.4
54675	69534	07/08/2024	1HM103HBC184G	R	Sundries	1ME737	20000.000(0	Diagnoise Trans Fault	INSPECT DUMP TRUCK NOT GOING INTO DRIVE ACTIVE FAULT FOR SHIFTER ASSEMBLY FITTED SPART SHIFTER FUALS TILL PRESENT REMOVE INERIOR TESTING WIRING TO ECM OK FIT SPART TRANS ECM FAULT STILL PRESENT SUSPECT WIRING ISSUE FOUND OUT ABOUT ISSUE WITH DUMPER AND CHECKED OUT INSPECT LOOM UNDER CAB ETC AND FOUND/REPAIRED WIRING FAULTS CLEAN UP CAB EARTH POINT AND TEST ALL OK REASSEMBLE CAB	2202.15	59.9	0	65	2327.05
53697	64372	06/18/2024	1HM103HBC105G	R	Transmissio	1ME737	20000.000(0	DIAGNOSE TRANSMISSION FAULT	1ME737	1170.51	0	240	0	1410.51
53240	64771	06/07/2024	1HM103HBC184G	S	Service Earl	1ME737	20000.000(0	D Service - 20,000 hours	CARRY OUT SERVICE AND VEHICLE INSPECTION. CHECK ALL LIGHTS, CHECK FLUID LEVELS. CHECK SUSPENSION, BRAKES AND TYRES NOTES: PRE CLEANER NEEDS REPLACING	1259.28	3353.39	0	300	4912.67
52622	62648	05/28/2024	1HM103HBC182G	R	Sundries	1ME737	19750.000(0	MODIFY HEAD LIGHT MOUNTS	MODIFY HEAD LIGHT MOUNTS	315.35	0	0	30	345.35
52580	64205	05/27/2024	1HM103HBC184G	R	Electrical	1ME737	19750.000(0	LED light upgrade	REPLACE WIRE IN AND TEST LED TAIL LIGHTS	419.76	932.25	0	20	1372.01

51350	61260	05/01/2024	1HM103HBC 184G	S	Service Earl	1ME737	19750.000	0	A Service 19,750 hours	CARRY OUT SAMPLE SERVICE REPAIRED ROTATING LIGHT	419.76	197.53	0	70	687.29
										NOTES: - PRE CLEANER NEEDS REPLACING - CAB FILTERS NEED TO BE REPLACED - TAIL GATE SEAL - FRONT DIFF HAS LEAKS - VARIOUS OIL LEAKS					
50813	59894	04/19/2024	1HM103HBC 105G	R	Transmissio	1ME737	19729.000	0	DIAGNOSE TRANSMISSION CONCERN (JUMPING IN AND OUR OF GEAR)	1ME737 JOB CARRIED OUT - INSPECT FOR JUMPING IN AND OUT OF GEAR. FOUND OIL LEVEL TOO LOW. TOPPED UP TRANS. TEST DROVE OK.	778.57	0	0	50	828.57
50571	59940	04/16/2024	1HM103HBC 105G	R	Hydraulic	1ME737	19729.000	0	REPLACE FAILED STEER HOSE ENZED ONLY	1ME737 JOB CARRIED OUT - ENZED REPLACED FAILED STEER HOSE.	0	167.84	0	0	167.84
48353	58812	03/19/2024	1HM103HBC 184G	R	Electrical	1ME737	19729.000	0	REPLACE REVERSE ALARM	REPAIRED/REPLACED REVERSE BEEPER AND REPAIRED OIL LEAK AND CENTRE AXLE	396	82.46	0	35	513.46
47880	64661	03/08/2024	1HM103HBC 184G	R	Sundries	1ME737	0.0000	0	INSPECT ACCUMMULATOR FAULT	ODOMETER: 19729 HRS INSPECTED ACCUMMULATOR FAULT. CHISELLED OUT BUILD UP AROUND ACCUMMULATORS. REPLACED FRONT ACCUMMULATOR. FAULT STILL NOT CLEARED. CHECKED ACCUMULATOR PROCESSOR AND FOUND OTHER SIDE LEAKING. PUT BACK OLD PROCESSOR ON AND ADJUSTED PRESSURE, FAULT STILL COMING ON. CARRIED OUT TESTS AND REPLACED PRESSURE SWITCH.	1559	7692.5	0	105	9356.5
46438	54984	02/09/2024	1HM103HBC 105G	R	Sundries	1ME737	19500.000	0	REPAIR WIPER AS REQUIRED	1ME737 JOB CARRIED OUT - TIGHTENED WIPER MOTOR RETAINING BOLTS.	127.5	0	0	0	127.5
46382	54993	02/09/2024	1HM103HBC 105G	R	Engine	1ME737	19500.000	0	DIAGNOSE LOW COOLANT ALARM	1ME737 JOB CARRIED OUT - ATTEND TO COOLANT ALARM. TOPPED UP COOLANT. FIXED WIPER MOTOR.	212.5	0	0	50	262.5

45451	62622	01/21/2024	1HM103HBC184G	R	Sundries	1ME737	0.0000	0	Required Repairs as per PMI	CARRIED OUT AND IDENTIFIED FAULTS DURING PMI REPLACED - A/C CONDENSOR AND RE-GAS SYSTEM 1000GM R134A SEAT BELT WINDOW WASHER RADIATOR CAP DOOR STRUT GREASED TRUCK AS WELL TESTED OK	493.5	1904.26	0	75	2472.76
45140	55361	01/15/2024	1HM103HBC184G	R	Sundries	1ME737	19500.000	0	PMI	CARRIED OUT PMI AS REQUIRED. REPORTED FINDINGS TO SUPERVISOR.	836	584.09	0	40	1460.09
43134	52350	11/22/2023	1HM103HBC184G	R	Hydraulic	1ME737	19500.000	0	Hydraulic Leak repair	RAISED CAB, REMOVED AND MANUFACTURED HOSES REFITTED / REPLACED - CHECKED OPERATION ALL OK	1603	241.41	0	210	2054.41
41064	49568	10/11/2023	1HM103HBC184G	S	Service Earl	1ME737	19500.000	0	Carry out B Service - 19,500 hours	CARRY OUT SERVICE AND VEHICLE INSPECTION. CHECK ALL LIGHTS, CHECK FLUID LEVELS. CHECK SUSPENSION, BRAKES AND TYRES - UNBLOCKED DIFF BREATHERS - REPLACED BROKEN GREASE NIPPLES - TAKE 12 OIL SAMPLES	1012	1239.08	0	90	2341.08
39783	46692	09/18/2023	1HM103HBC184G	R	Sundries	1ME737	19449.000	0	BONNET AND CHECK OVER	CHECK AND LUBRICATE HINGES. NOTES: NEW BONNET HINGES REQUIRED	176	0	0	70	246
36971	42854	07/24/2023	1HM103HBC184G	R	Electrical	1ME737	16906.000	0	203370 INSPECT HIGH IDLE	CHECKED HIGH IDLE STUCK ON REMOVED DASH BOARD & PANELS REPAIRED WIRING FAULT FOR IDLE SWITCH TESTED OPERATION - ALL OK REASSEMBLED DASH & RETESTED - ALL OK PACKED UP & RETURNED TO SERVICE	176	0	0	10	186
36281	42162	07/10/2023	1HM103HBC184G	R	Sundries	1ME737	0.0000	0	top up coolant	TOP UP COOLANT LEVEL	92.75	0	0	0	92.75
34022	38263	05/29/2023	1HM103HBC184G	R	Electrical	1ME737	0.0000	0	CHECK/REPLACE LIGHTS AND INSPECT RADIO	TRAVEL TO IMPACT INSPECT RADIO INOP TRACE WIRING AND CARRY OUT TESTS FOUND BREAK IN WIRING FIXED WIRING ALL TEST OK FOUND FRONT INDICATOR AND PARK LIGHT TO BE NOT BOLTED IN MOUNT LIGHTS FOUND BOTH SIDE INDICATORS TO NOT BE MOUNTED SEND TYLER OVER TO MOUNT LIGHTS CORECTLY	642.23	0	0	45	687.23

32074	37654	05/10/2023	1HM103HBC 184G	S	Service Earl	1ME737	0.0000	0	CARRY OUT C SERVICE	CARRIED OUT C-TYPE SERVICE	697.46	2479.01	0	125	3301.47
										INSPECTED/DISCOVERED BROKEN LIGHTS					
										REPLACED LIGHTS WHERE REQUIRED					
										COOLANT LEAKS OUT AT LHS RADIATOR CAP					
										NEEDS NEW CAP					
31539	37085	05/01/2023	1HM103HBC 121G	R	Tyres	1ME737	0.0000	0	SUPPLY AND FIR TYRES (4)		0	10904.18	1900	0	12804.18
31470	35901	04/28/2023	1HM103HBC 184G	R	Sundries	1ME737	0.0000	0	SUPPLY SPARE FILTERS FOR IMPACT BOAT		0	242.26	0	0	242.26
31155	35822	04/19/2023	1HM103HBC 184G	R	Sundries	1ME737	0.0000	0	REPLACE SEAT VALVE		220.9	165.64	0	0	386.54
28977	33663	03/27/2023	1HM103HBC 184G	R	Sundries	1ME737	18902.000	0	INSPECT TAILGATE AFTER ROLL OVER	INSPECT TAILGATE AFTER ROLL OVER, ALL OK AT TIME	85.63	0	0	15	100.63
28561	35899	03/16/2023	1HM103HBC 183G	R	Transmissio	1ME737	18744.000	0	INSPECT TRANSMISSION FAULT - KOMATSU	TRAVEL TO SITE AND DIAGNOSE TRANSMISSION REVERSE FAULT TOP UP TRANSMISSION OIL LEVEL INSPECT AND TEST FUSES AND WIRING FOUND TO HAVE SMALL FAULT BETWEEN SHIFT LEVER AND CONTROLLER REMOVE CONSOLE CLUSTER AND COVER FOR TESTING RETURN TO SITE AND REPAIR BAD CONNECTION FOR TRANSMISSION CONTROLLER TEST OPERATION FOR AN HOUR ONCE HOT, ALL OK, UNABLE TO FAULT	0	889.8	0	0	889.8
28448	33611	03/14/2023	1HM103HBC 184G	R	Steering	1ME737	0.0000	0	RESEAL RHS STEER CYLINDER - KOMATSU		0	1576.63	0	0	1576.63
28343	33896	03/10/2023	1HM103HBC 184G	S	Service Earl	1ME737	0.0000	18902	B Service 250 hour	CARRY OUT SERVICE AND VEHICLE INSPECTION. CHECK ALL LIGHTS, CHECK FLUID LEVELS. CHECK SUSPENSION, BRAKES AND TYRES	140.86	296.17	0	100	537.03
27362	31903	02/20/2023	1HM103HBC 105G	R	Sundries	1ME737	18180.000	0	weekly pmi inspection	1ME737	455.24	159.6	0	0	614.84
25832	30073	02/08/2023	1HM103HBC 105G	R	Electrical	1ME737	18180.000	0	replace uhf aerial	JOB CARRIED OUT - CARRY OUT PMI'S. 1ME737	82.77	30	0	0	112.77
										JOB CARRIED OUT - REPLACE FAILED UHF AERIAL.					

23987	35856	12/15/2022	1HM103HBC 184G	INT-R	Sundries	1ME737	18180.000	0	Repairs as per safety issues list	INSPECTED DUMP TRUCK, REPORTED ISSUES TO ERNIE BRUSH. REPLACED THE FOLLOWING ITEMS SEAT ASSEMBLY HEAD LIGHT X2 WINDOW REGULATOR AND MOTOR WINDOW SEALS AND RUNNER INSIDE AND OUTSIDE DOOR HANDLES REMOVED FAULTY HEAD LIGHT HARNESS, PARTIALLY RE-WIRED/REPAIRED FAULTS. FITTED NEW DEUTSCH PLUGS AS REQUIRED. REPLACED HEADLIGHT RELAY. TESTED OK.	1076.01	8420.51	0	60	9556.52
22862	28930	11/21/2022	1HM103HBC 105G	R	Air Con	1ME737	18180.000	0	ASSESS A/C OPERATION	1ME737 JOB CARRIED OUT - DIAGNOSE FAILED A/C COMPRESSOR. REPLACE COMPRESSOR AND REGAS SYSTEM.	0	1613.12	350	0	1963.12
22466	26828	11/14/2022	1HM103HBC 105G	R	Sundries	1ME737	18180.000	0	NOVEMBER MONTHLY PMI'S	1ME737 JOB CARRIED OUT - CARRY OUT PMI'S DURING NOVEMBER.	415.29	0	0	0	415.29
22125	26173	11/07/2022	1HM103HBC 182G	R	Sundries	1ME737	0.0000	0	REPAIR LEAKING HYDRAULIC TANK	REPAIR LEAKING HYDRAULIC TANK - TRAVEL TO MPWTS, SETUP & WAIT FOR FIRE WQADEN PERSON, PREP TANK FOR WELDING, MARK & CUT OUT PATCH, WELD ON, CLEANUP & TRAVEL BACK TO LAMPTON AVE	803.48	0	0	77	880.48
20437	24991	09/28/2022	1HM103HBC 184G	S	Service Earl	1ME737	0.0000	0	CARRY OUT S1 B SERVICE	CARRY OUT S1 B SERVICE AS PER SERVICE SHEET REPAIR COOLANT LEAK TRAVEL IMPACT AND RETURN	513.78	790.33	0	50	1354.11
19775	29273	09/13/2022	1HM103HBC 184G	INT-R	Steering	1ME737	0.0000	0	RESEAL STEERING CYLINDER	RESEALED STEERING CYLINDER AS REQUIRED TESTED OK	385.34	808.2	0	15	1208.54
19262	23013	09/02/2022	1HM103HBC 105G	R	Sundries	1ME737	18180.000	0	SEPTEMBER MONTHLY PMIS	1ME737 JOB CARRIED OUT - CARRY OUT PMI'S DURING SEPTEMBER.	82.77	0	0	0	82.77
18304	21382	08/15/2022	1HM103HBC 184G	R	Electrical	1ME737	18180.000	0	INSPECT BATTERIES	INSPECT BATTERIES AND CHECK OVER MACHINE TRAVEL NYRSTAR	128.45	0	0	15	143.45
18110	21837	08/09/2022	1HM103HBC 105G	S	Service Earl	1ME737	18180.000	0	AUGUST PMI'S	1ME737 JOB CARRIED OUT - CARRY OUT PMI'S DURING AUGUST.	372.47	0	0	0	372.47
17547	21644	07/28/2022	1HM103HBC 186G	INT-R	Electrical	1ME737	18151.000	0	GPS tracker repairs	REPLACE PLANT TRACKER WITH NEWER UNIT FOR BETTER PERFORMANCE ACTIVATE AND CHECK OPERATION ALL OK	82.77	352	0	5	439.77
17465	20749	07/27/2022	1HM103HBC 105G	R	Sundries	1ME737	18127.000	0	FIT UP MIRRORS	1ME737 JOB CARRIED OUT - FIT UP MIRRORS.	331.09	155.72	0	0	486.81

17279	20697	07/22/2022	1HM103HBG 105G	R	Sundries	1ME737	18127.000	0	COMPLETE JULY MONTHLY PMIS	1ME737	579.4	350.6	0	100	1030
										JOB CARRIED OUT - CARRY OUT PMI'S DURING JULY. FIT NEW ASSET ID NUMBERS.					
17301	23863	07/22/2022	1HM103HBG 182G	R	Trays/Buck	1ME737	18127.000	0	REPAIR CRACKS IN TRAY	REPAIR CRACKS IN TRAY	5204.26	265.13	0	400	5869.39
										GOUGE OUT ALL VISABLE CRACKS, DYE CHECK AROUND CRACKED AREA.					
										FOUND AND GOUGED OUT ADDITIONAL CRACKS AND WELD UP GOUGED AREAS AND TIDY. OUGE OUT TOP SIDE OF CRACKS AND DYE CHECK AREA AROUND. WELD UP CRACKS AS NEEDED AND TIDY UP					
17093	20028	07/18/2022	1HM103HBG 105G	R	Electrical	1ME737	18127.000	0	REPLACE FAILED HEAD UNIT	1ME737	82.77	0	210	50	342.77
										JOB CARRIED OUT - REMOVE DASH AND FIT NEW AM/FM RADIO.					
14814	16843	05/27/2022	1HM103HBG 121G	R	Tyres	1ME737	18127.000	0	SUPPLY AND FIT TYRES - BSELECT MOONAH	SUPPLY AND FIT 2 NEW TYRES TO POS 1 & 2	0	7858.92	0	0	7858.92
										ROTATE TYRES FROM POS 1 & 2 TO 5 & 6					
14589	16835	05/23/2022	1HM103HBG 105G	R	Sundries	1ME737	18074.000	0	COMPLETE PMI ISNPECTION	1ME737	76.01	0	105	0	181.01
										JOB CARRIED OUT - CARRY OUT PMI'S DURING MAY.					
12209	14471	03/25/2022	1HM103HBG 105G	R	Sundries	1ME737	18074.000	0	COMPLETE WEEKLY PMI INSPECTION	1ME737	228.04	31.36	0	50	309.4
										JOB CARRIED OUT - CARRY OUT PMI'S DURING MARCH.					
11727	13191	03/15/2022	1HM103HBG 184G	R	Bodywork	1ME737	18073.000	0	free up door hinges	FREE UP DOOR HINGES AND CHECK OVER AFTER IMPACT INLOAD	135.97	0	0	10	145.97
9917		02/03/2022	1HM103HBG 105G	R	Sundries	1ME737	17758.000	0	1ME737 COMPLETE PMI	1ME737	0	0	0	0	0
										JOB CARRIED OUT - CARRY OUT PMI.					
9920		02/03/2022	1HM103HBG 105G	R	Air Con	1ME737	17758.000	0	1ME737 SERVICE A/C	1ME737	0	0	0	0	0
										JOB CARRIED OUT - PRESSURE TEST SYTEM WUTH NITROGEN, UNABLE TO FIND LEAK. RECOVER NITROGEN. CHARGE SYSTEM WITH HYDRIOGEN MIX AND LEAK TEST. FOUND THE EVAPORATOR LEAKING. REMOVE COVERS FROM HEATER/AC ASSY , EVAPORATOR IS WRONG. ORDER CORRECT PART.					
9655	12604	01/31/2022	1HM103HBG 184G	R	Electrical	1ME737	0.0000	17930	FIT NEW BATTERIES INTO MACHINE	REMOVE AND REPLACE FAULTY BATTERIES,START UNIT AND CHECK CHARGE RATE	170.84	0	0	22.5	193.34
										TRAVEL NYRSTAR AND RETURN					
9282		01/20/2022	1HM103HBG 105G	R	Electrical	1ME737	17758.000	0	REPLACE DEAD BATTERIES	1ME737	0	0	0	0	0
										JOB CARRIED OUT - REMOVE BATTERIES AT WHARF, ALL CLAMPS AND TERMINALS SEIZED. FIT NEW BATTERIES.					
9271	13201	01/20/2022	1HM103HBG 184G	S	Service Earl	1ME737	0.0000	0	S1 D SERVICE	CARRY OUT S1 D SERVICE AS PER SERVICE SHEET	1028.96	2298.45	0	64.5	3391.91
										LIFT CAB FOR TOM SUTCLIFF TO CARRY OUT AIR CON REPAIRS					
										TRAVEL NYRSTAR AND RETURN 18005 HRS					

9294		01/20/2022	1HM103HBC 105G	R	Sundries	1ME737	17758.000	0	COMPLETE PMI'S TO HM300'S	1ME737	0	0	0	0	0
8274	11756	12/16/2021	1HM103HBC 184G	R	Air Con	1ME737	0.0000	0	INSPECT AIR CON ISSUE	JOB CARRIED OUT - CARRY OUT PMI'S. INSPECT AIR CON ISSUE, FOUND TO NEED HEATER BOX PULLING APART TO CLEAN . EVAPORATOR AND TX VALVE NEED REPLACING, WORK TO BE CARRIED OUT AT LATER DATE WHEN UNIT AVAILABLE	260.18	0	0	0	260.18
7248	8289	11/24/2021	1HM103HBC 184G	R	Sundries	1ME737	17758.000	0	REPLACE LIFT CYLINDER BEARING AND PIN	TRY TO REMOVE CYLINDER RETAINING PIN AND FOUND SIEZED, HAVE PIN LANCED OUT REMOVE AND REPLACE BEARING IN END OF CYLINDER, REFIT CYLINDER INTO EYE ON TRAY AND FIT NEW PIN, GREASE JOINTS TRAVEL IMPACT AND RETURN	633.22	286.83	0	46.5	966.55
7251	8866	11/24/2021	1HM103HBC 182G	R	Sundries	1ME737	17597.000	0	LANCE OUT PIN	LANCE OUT PIN - TRAVEL TO AREA BEHIND IMPACT FERT, MAKE SURE NO FLAMABLES ARE AROUND AREA, SETUP & LANCE OUT SEIZED PIN	491.29	0	0	33.7	524.99
6249	8056	10/29/2021	1HM103HBC 184G	S	Service Earl	1ME737	0.0000	17758	S1 A SERVICE	CARRY OUT SERVICE AS PER SERVICE SHEET REMOVE AND REPLACE FAULTY REVOLVING LIGHT REPAIR WORK LIGHTS TRAVEL NYRSTAR AND RETURN 17758 HRS	469.81	516.97	0	38.5	1025.28
5242	5607	10/04/2021	1HM103HBC 184G	R	Electrical	1ME737	17597.000	0	REFIT TAIL LIGHT	REPLACE BROKEN BOLTS IN TAIL LIGHT MOUNTING TRAVEL NYRSTAR	85.42	0	0	19.5	104.92
210420-00	(SVC00262	09/27/2021	1H0103 121_INT	R	Tyres	1ME737			REPAIR TYRE & REPLACE ORING ON	REPAIR TYRE REPLACE ORING ONLHF DONE AT NYRSTAR SITE 10/2/21 ARRANGED BY ERNIE BRUSCH AS PER BRIDGESTONE WORK ORDER 36981	0	276.36	0	0	276.36
3915	3665	08/31/2021	1HM103HBC 184G	S	Service Earl	1ME737	17482.000	0	S1 B SERVICE	S1 B SERVICE AS PER SERVICE SHEET	469.81	698.8	0	0	1168.61
3086	4873	08/11/2021	1HM103HBC 184G	R	Differential	1ME737	0.0000	17483	REPAIR OIL LEAKS FROM FRONT HUBS	JACK UP MACHIONE AND REMOVE FRONT WHEELS DIG PRODUCT FROM AROUND BOLTS AND BRAKE PIPES REMOVE LEFT HAND FINAL DRIVE AND CLEAN READY FOR REPAIRS STRIP FINAL DRIVE, CLEAN AND INSPECT PARTS, REASSEMBLE FINAL DRIVE WITH NEW SEALS AND O RINGS. CLEAN UP AXLE STUB AND REFIT FINAL DRIVE AND DRIVE SHAFT. REMOVE R IGH T HAND FINAL DRIVE ,STRIP CLEAN AND INSPECT PARTS FOUND REAR PLATE DAMAGED. REASSEMBLE WITH NEW SEALS,O RING AND NEW REAR PLATE, CLEAN UP AXLE STUB AND REFIT FINAL DRIVE AND DRIVE SHAFT. RECONNECT DRIVE SHAFTS TO DIFF FLANGES AND FILL FINAL DRIVES WITH OIL. REMOVE CENTRE AXLE PLANETARY COVERS AND RESEAL SHAFTS REPLACE ALL DIFF BREATHERS AND CHECK ALL OIL LEVELS REFIT FRONT WHEELS AND PUMP UP TYRES. RUN UNIT AROUND YARD AND PRESSURE CLEAN	8606.08	6038.12	0	0	14644.2

2376	4900	07/26/2021	1HM103HBC184G	R	Electrical	1ME737	0.0000	17454	inspect tray light on display	CHECK CODE ON DISPLAY, REMOVE MATERIAL FROM AROUND TRAY SENSOR AND CHECK ADJUSTMENT STRAIGHTEN ROD AND READJUST TRAY SENSOR REMOVE AND REPLACE TRAY SENSOR, ADJUST ROD TO SUIT TRAVEL GLENORCHY TIP AND RETURN	726.07	564.08	0	14.5	1304.65
210310-00	SVC002617	07/22/2021	1H0103	105_HBGN'S	Service	1ME737			S1C - 1000 HR SERVICE	1ME737	727	1339.66	0	60	2126.66
										ODOMETER - 17036 HOURS					
210517-00	SVC002652	07/22/2021	1H0103	105_HBGN'R	Engine	1ME737	17262HRS		DIAGNOSE LOW COOLANT	JOB CARRIED OUT - CARRY OUT SERVICE. 1ME737	36.35	0	0	50	86.35
										ODOMETER - 17262 HOURS					
										JOB CARRIED OUT - REPORTED LOW COOLANT ALARM. TOPPED UP OVERFLOW BOTTLE. CHECKED RADIATOR LEVEL.					
2267	1779	07/21/2021	1HM103HBC181G	R	Bodywork	1ME737	17394.000(0		TRAVEL TO GLENORCHY TIP AND RESEAL FRONT WINDOW	TRAVEL TO GLENORCHY TIP AND RESEAL FRONT WINDSCREEN AS WELL AS POSSIBLE WITHOUT REMOVING SCREEN	152.02	25.73	0	0	177.75
1399	1820	07/01/2021	1HM103HBC184G	INT-R	Electrical	1ME737	17394.000(0		ELECTRICAL REPAIRS	Checked reverse camera not working. Obvious damage to camera, replacement not available as older unit. Supplied and fitted new screen, camera and cable. Wired in, tested ok. Replaced battery isolator as was extremely hard to turn. Bonnet hard to open and close, free'd up lateches, coper coated and penetrened moving parts. Low coolant alarm on dash, topped up coolant.	836.67	551.93	0	0	1388.6
1238	1033	06/28/2021	1HM103HBC105G	INT-R	Radiator	1ME737	17390.200(0		TOP UP LOW COOLENT LEVEL	1ME737	148.74	95.3	0	0	244.04
										JOB CARRIED OUT - SOURCED COOLANT AND DROVE TO IMPACT. TOP UP LOW COOLANT LEVEL. NO LEAKS PRESENT.					
210312-00	SVC002612	06/23/2021	1H0103	184_INT	R	Air Con	1ME737	NOT SUPPL	REPAIR AIR CON SYSTEM	REPAIR AIR CON SYSTEM, BLOW OUT COOLERS AND CAB FILTERS. RECHARGE A/C SYSTEM AND TESTED OK TRAVEL NYRSTAR AND RETURN	285.95	0	0	12.5	298.45
850	909	06/21/2021	1HM103HBC105G	INT-R	Tyres	1ME737	17359.300(0		CHECK TYRE PRESSURES AND PUMP UP	1ME737	74.37	0	0	0	74.37
										JOB CARRIED OUT - CHECK TYRE PRESSURES AND PUMP UP LH REAR, DOWN BY 40 PSI.					
210301-00	SVC002605	05/29/2021	1H0103	105_HBGN'R	Sundries	1ME737			REPLACE WIPER BLADES	1ME737	22.53	0	0	20	42.53
										ODOMETER - 17032 HOURS					
										JOB CARRIED OUT - FIT WIPER BLADE.					

210302-00	SVC002607	05/29/2021	1H0103	105_HBGN	R	Engine	1ME737	17032 HRS	DIAGNOSE E03 CODE CA274	1ME737	290.8	0	0	60	350.8
										ODOMETER - 17032 HOURS					
										JOB CARRIED OUT - DIAGNOSE E03 CODE. FLOOW KOMATSUMANUAL WHEN TESTING. FOUND NO SIGNAL FROM DCV2 TO ENGINE CONTROLLER. FITTED JUMP WIRE TO REPLACE BROKEN WIRE IN HARNESS.					
210305-00	SVC002617	05/29/2021	1H0103	105_HBGN	R	Sundries	1ME737		MONTHLY PMI'S & REPAIRS	1ME737	436.2	0	0	100	536.2
										ODOMETER - 17144 HOURS					
										JOB CARRIED OUT - MONTHLY PMI'S AND REPAIR TAIL GATE CHAINS.					
210311-00	SVC002621	05/29/2021	1H0103	105_HBGN	R	Electrical	1ME737		REPLACE HEAD LIGHTS WITH LED'S	1ME737	0	55.5	210	30	295.5
										ODOMETER - 17036 HOURS					
										JOB CARRIED OUT - FIT NEW LED HEAD LIGHTS. TRAVEL NYRSTAR					
210514-00	SVC002643	05/26/2021	1H0103	184_INT	S	Service	1ME737	17,248 HRS	S1 A SERVICE	TRAVEL NYRSTAR CARRY OUT S1 A SERVICE AS PER SERVICE SHEET CHECK OPERATORS DOOR OPERATION RESEAL FRONT SCREEN RETURN TRAVEL	408.5	314.09	0	12.5	735.09
201222-00	SVC002578	01/29/2021	1H0103	105_HBGN	R	Sundries	1ME737	16848	TOP UP COOLENT /BONNET REPAIRS	1ME737	72.7	0	0	40	112.7
										ODOMETER - 16848 HOURS					
										JOB CARRIED OUT - BONNET WON'T OPEN, FOUND IT WAS CLSED INCORRECTLY. REPAIR & TEST OK. TOP UP LOW COOLANT.					
210118-00	SVC002590	01/29/2021	1H0103	105_HBGN	R	Drive Line	1ME737	16869	DIAGNOSE NOISE IN REAR DIFF	1ME737	399.85	833.08	0	0	1232.93
										ODOMETER - 16869 HOURS					
										JOB CARRIED OUT - NOISE REPORTED IN REAR DIFF AREA. COLLECT OIL SAMPLES OF ALL REAR DIFFS AND FINAL DRIVES. DRAIN ALL OILS AND CHECK, ALL LOOKED OK. REPLACE AND USE CAT ADDITIVE. CHECK TAIL SHAFTS AND GREASE. CARRYOUT PMI.					
200511-01	SVC002455	01/28/2021	1H0103	121_INT	R	Tyres	1ME737		23.5R25 ** HALITRAX HR25	23.5R25 ** HALITRAX HR25 + DISPOALS CARRIED OUT BY B 0 SELECT MOONAH		10140	1380.14	0	11520.14
										QUOTED PRICE APPROVED BY DYLAN HARPER					
201203-00	SVC002570	12/16/2020	1H0103	105_HBGN	S	Service	1ME737	16830	S1A - 250 HR SERVICE	1ME737	290.8	51.02	0	50	391.82
										ODOMETER - 16830 HOURS					
										JOB CARRIED OUT - CARRY OUT S1A SERVICE.					

201030-00	SVC00254	11/16/2020	1H0103	105_HBGN	R	Sundries	1ME737	16767	REPAIR BENT BONNET & LATCH	1ME737	363.5	0	0	60	423.5
										ODOMETER - 16767 HOURS					
										JOB CARRIED OUT - BONNET ALL BENT AND WON'T OPEN, DUE TO MIDDLE BEING BENT IN. FORCE BONNET OPEN. STRAIGHTEN BONNET, MIDDLE SUPPORT BROKEN. REPAIR AND WELD UP. UNSEIZE HINGES AND LATCHES.					
201030-00	SVC00254	11/16/2020	1H0103	105_HBGN	R	Electrical	1ME737	16767	REPAIR LIGHT WIRING ISSUES	1ME737	363.5	0	0	100	463.5
										ODOMETER - 16767 HOURS					
										JOB CARRIED OUT - DIAGNOSE HEAD LIGHT FAULT, BREAK IN WIRING HARNESS. FIND BREAK AND REPAIR. REMOVED PARK LIGHTS AND REPAIRED WIRING TO PARK LIGHTS. REPAIRED WIRING TO SIDE INDICATORS AND REAR WORK LIGHTS.					
201009-00	SVC00254	10/21/2020	1H0103	105_HBGN	R	Sundries	1ME737	16685	REPAIR SIEZED BATTERY BOX LID	1ME737	218.1	0	0	30	248.1
										ODOMETER - 16685 HOURS					
										JOB CARRIED OUT - REMOVED BATTERY BOX LID AND ATTEMPTED TO UNSEIZE HINGES. HAD TO GRIND AND MODIFY HINGES SO THEY WOULD MOVE FREELY. STRAIGHTENED OUT MOUNTS AND HINGES. ALIGNED BOX AS BEST AS POSSIBLE.					
201012-00	SVC00254	10/21/2020	1H0103	105_HBGN	R	Sundries	1ME737	16685	COMPLETE PMI INSPECTION	1ME737	72.7	0	0	30	102.7
										ODOMETER - 16685 HOURS					
										JOB CARRIED OUT - CARRY OUT PMI. LH HEADLIGHT WIRING ISSUE. LH CAB SIDE MARKER WIRING ISSUE.					
200922-00	SVC00253	10/20/2020	1H0103	184_INT	R	Hydraulic	1ME737	NOT SUPPL	REPLACE HYDRAULIC SITE GLASS	REPLACE HYDRAULIC SITE GLASS, PART SUPPLIED TO DYLAN HARPER	0	234.87	0	0	234.87
200806-00	SVC00250	08/20/2020	1H0103	184_INT	S	Service	1ME737	16,596 hrs	S1 B SERVICE		326.8	881.61	0	40	1248.41
200526-00	SVC00246	07/10/2020	1H0103	105_HBGN	R	Sundries	1ME737		REPAIR FRONT WINDOW	1ME737	0	290.91	0	0	290.91
										JOB CARRIED OUT - ORGANISED HOBART AUTO GLASS TO RE-SEAL FRONT WINDOW.					
200706-00	SVC00248	07/08/2020	1H0103	105_HBGN	R	Tyres	1ME737		CHECK TYRE PRESSURES	1ME737	0	75	0	0	75
										JOB CARRIED OUT - B'SELECT CHECKED TYRE PRESSURES.					

200528-001	SVC002448	06/26/2020	1H0103	105_HBGN	R	Sundries	1ME737	16499	REPLACE MUFFLER ASSEMBLY	1ME737	1744.8	1759.94	0	80	3584.74
										ODOMETER - 16499 HOURS					
										JOB CARRIED OUT - EXHAUST LEAKING. MUFFLER RUSTED OUT, REMOVED AND REPLACED. PIPE FROM MUFFLER TO DUMP PIPE RUSTED OUT. LIFT CAB TO ACCESS, BORROW JIB FROM LA. REMOVE EXHAUST, TAKE TO LA TO WELD SHOP TO REPAIR. REFIT EXHAUST, WRAP WITH EXHAUST WRAP.					
200409-001	SVC002450	06/23/2020	1H0103	182_INT	R	Sundries	1ME737		FABRICATE HAND RAILS	MEASURE UP AND SET OUT LOCATION OF RAIL MOUNT ON DUMPER. BEND PIPE RAIL SECTIONS PRESS SWAGED WIRE VIB MOUNTS AND WELD TO PIPE RAIL SECTIONS. CUT AND FABRICATE BASE PLATES WITH TAPPED MOUNTING HOLES. WELD OUT RAIL. PREP AND PAINT. FIT UP COMPLETED RAILS ONSITE AT NYSTAR.	223.8	0	0	75	298.8
200526-001	SVC002465	06/23/2020	1H0103	105_HBGN	R	Engine	1ME737	16499	LOW POWER ISSUES	1ME737	508.9	787.1	0	100	1396
										ODOMETER - 16499 HOURS					
										JOB CARRIED OUT - SOURCE REPLACEMENT HOSES. INSPECT LOW POWER, FOUND X2 SILICONE HOSES U/S, REMOVE AND REPLACE. REMOVED PIPING AND CHECKED TURBO END FLOAT, ALL OK. REMOVED FUEL FILTERS AND FLUSHED ALL LINES. REMOVED AND CLEANED FUEL SCREENS. REMOVED AND CLEANED FUEL TAP AND CHECKED OPERATION. REFITTED ALL LINES AND FILTERS AND BLEED SYSTEM. TESTED OPERATION, ALL OK AT TIME OF TESTING.					
200609-011	SVC002472	06/23/2020	1H0103	182_INT	R	Sundries	1ME737	16499	REPAIR EXHAUST	FABRICATE AND SET UP JIG AS TO RETAIN SHAPE OF OLD EXHAUST. CUT AND FABRICATE NEW BRACKETS AND FLANGES. CUT AND PROCESS PIPE SECTIONS TO SUIT. FABRICATE EXHAUST COMPONENTS. WELD OUT ALL FABRICATED COMPONENTS. CUT AND FIT NEW FLEX JOINT AND CLAMPS.	1526.7	47.24	0	75	1648.94
200501-001	SVC002462	05/22/2020	1H0103	105_HBGN	R	Sundries	1ME737		MAY - MONTHLY PMI'S	1ME737	181.75	0	0	0	181.75
										ODOMETER - 16418 HOURS					
200506-001	SVC002452	05/13/2020	1H0103	121_INT	R	Tyres	1ME737	LOCKED	CHECK & ADJUST TYRE PRESSURES	JOB CARRIED OUT - CARRY OUT PMI. CHECK & ADJUST TYRE PRESSURES CARRIED OUT BY B SELECT MOONAH	0	0	82.5	0	82.5

200408-00	SVC00245	05/07/2020	1H0103	105_HBGN	R	Sundries	1ME737		APRIL - MONTHLY PMI'S	1ME737	290.8	0	0	0	290.8
										JOB CARRIED OUT - CARRY OUT PMI'S DURING APRIL. CUT OFF CHAIN ON HAND RAIL.					
200204-00	SVC00241	04/28/2020	1H0103	105_HBGN	S	Service	1ME737	16312	S1B 500 HR SERVICE	1ME737	872.4	958.6	0	100	1931
										ODOMETER - 16312 HOURS					
										JOB CARRIED OUT - CARRY OUT SERVICE. REPLACED WIPER. DRAINED RHF FINAL DRIVE. REFILLED AND TEST DROVE. RE-SAMPLED OIL.					
200320-00	SVC00243	04/16/2020	1H0103	105_HBGN	R	Sundries	1ME737		MARCH - PMI'S	1ME737	72.7	0	0	10	82.7
										JOB CARRIED OUT - CARRY OUT PMI'S DURING MARCH.					
200320-00	SVC00243	03/29/2020	1H0103	105_HBGN	R	Engine	1ME737	16315	REPAIR FUEL LEAK	1ME737	72.7	0	0	20	92.7
										ODOMETER - 16315 HOURS					
										JOB CARRIED OUT - REPAIR FUEL LEAK TO FILLER CAP.					
200128-01	SVC00240	03/18/2020	1H0103	105_HBGN	R	Sundries	1ME737	16205	FEBRUARY - PMI'S	1ME737	581.6	80.73	140	20	822.33
										ODOMETER - 16205 HOURS					
										JOB CARRIED OUT - CARRY OUT PMI. WASH OUT RADIATOR CCORES. REPLACE HEAD LIGHT GLOBE. REPLACED AIR FILTER.					
200227-00	SVC00241	03/18/2020	1H0103	105_HBGN	R	Sundries	1ME737	16298	REPLACE TORSION ARM BOLTS	1ME737	181.75	18.36	0	40	240.11
										ODOMETER - 16298 HOURS					
										JOB CARRIED OUT - REMOVE DAMAGED MIDDLE STABALIZER BOLTS. DROVE TO NUTS & BOLTS TO SOURCE NEW BOLTS. INSTALLED BOLTS.					
191211-00	SVC00239	01/24/2020	1H0103	105_HBGN	R	Engine	1ME737	16136	REPAIR COOLING CORES	1ME737	2762.6	7725.16	0	483.16	10970.92
										ODOMETER - 16136 HOURS					
										JOB CARRIED OUT - REPORTED COOLANT LEAK FROM RADIATOR. COOLANT LEAK RH CORE. REMOVED CORE AND TOOK TO NEW NORFOLK FOR INSPECTION AND REPAIR. MEASURE AND MAKE UP RADIATOR LOCATORS AT LA MACHINE SHOP. MODIFY RADIATOR HOUSING TO FIT NEW CORES. FIT UP NEW CORES, FILL COOLANT AND BLEED. TEST AND GREASE MACHINE.					
200113-00	SVC00238	01/22/2020	1H0103	182_INT	R	Lathe	1ME737		MACHINE RADIATOR RETAINING PIN	MACHINE RADIATOR RETAINING PINS	72.7	4.5	0	0	77.2

191210-00	SVC00239	01/20/2020	1H0103	105_HBGN' R	Sundries	1ME737		COMPLETE DECEMBER PMI'S	1ME737	109.05	0	0	30	139.05
									JOB CARRIED OUT - CARRY OUT PMI'S DURING DECEMBER. REMOVE GRILL AND WASH CORES.					
191203-00	SVC00237	12/06/2019	1H0103	105_HBGN' R	Sundries	1ME737		ASSESS SEAT OPERATION	1ME737	72.7	0	0	0	72.7
									ODOMETER - 16101 HOURS					
									JOB CARRIED OUT - REPORTED SEAT BOTTOM OUT BY OPERATOR/EB. INSPECTED, WORKING OK. AIR BAG HOLDING AIR, TESTED ALL FUNCTIONS.					
191010-00	SVC00237	12/04/2019	1H0103	105_HBGN' R	Engine	1ME737	16101	REMOVE/CLEAN COOLING CORES	1ME737	3344.2	1327.03	1110	120	5901.23
									ODOMETER - 16101 HOURS					
									JOB CARRIED OUT - REMOVE INTERCOOLER AND RADIATOR. DELIVER AND COLLECT FROM NEW NORFOLK RADIATORS FOR CLEANING AND INSPECTION. REMOVE AND REPLACE WORN DRIVE BELTS X2, AND A/C BELT. CLEAN OUT PRODUCT FROM RADIATOR FRAME AND UNDER FRAME. PAINT INTERCOOLER AND RADIATOR CORES BEFORE INSTALLING. REFIT CORES, FILL WITH COOLANT AND BLEED. RE-CHECK BELT TENSION.					
191010-00	SVC00235	12/04/2019	1H0103	105_HBGN' R	Air Con	1ME737	16101	REPLACE A/C CONDENSOR	1ME737	399.85	595.21	0	0	995.06
									ODOMETER - 16101 HOURS					
									JOB CARRIED OUT - REPLACE A/C CONDENSOR. SET JOB UP, COMPLETE SWMS AND THA. RECOVER A/C REFRIDGERANT. REMOVE AND REPLACE CONDENSOR AND RECEIVER DRIER. REGAS SYSTEM. CARRY OUT LEAK TEST.					
191031-00	SVC00235	11/27/2019	1H0103	105_HBGN' R	Sundries	1ME737		NOVEMBER - PMI'S	1ME737	799.7	0	0	60	859.7
									JOB CARRIED OUT - CARRY OUT PMI'S DURING NOVEMBER. TIGHTENED BELTS, REPLACED AIR FILTER, REWIRED RH BRAKE LIGHT.					
191021-00	SVC00235	11/06/2019	1H0103	105_HBGN' S	Service	1ME737		S1A - 250HR SERVICE	1ME737	436.2	258.63	0	30	724.83
									JOB CARRIED OUT - CARRY OUT SERVICE AND CHECKOVER. REPLACED TOP LEFT SIDE FRONT HEAD LIGHT WITH NEW LED LIGHT. TOPPED UP OILS. CLEANED OUT CORES.					
190925-00	SVC00233	10/30/2019	1H0103	105_HBGN' R	Sundries	1ME737		COMPLETE SEPTEMBER PMI	1ME737	327.15	0	210	30	567.15
									ODOMETER - 15916 HOURS					
									JOB CARRIED OUT - CARRY OUT PMI'S X4. HOT WASH COOLING CORES. INSPECT DRIVE LINE UNI JOINTS.					

190821-00	SVC002315	10/03/2019	1H0103	184_INT	R	Drive Line	1ME737	REPAIR RIGHT HAND FRONT DRIVE	REMOVE FRONT RIGHT HAND WHEEL, REMOVE FINAL DRIVE ASSEMBLY AND REPLACE INNER SEAL AND BUSH. HAVE END OF DRIVE SHAFT MACHINED AND FIT NEW UNI JOINTS. REFIT DRIVE SHAFT AND FINAL DRIVE ASSEMBLY TO MACHINE. FILL WITH OIL AND REFIT WHEEL. TENSION WHEEL BOLTS AND PARK UNIT OUTSIDE WORKSHOP.	2458.5	733.52	0	50	3242.02
190829-00	SVC002320	09/11/2019	1H0103	182_INT	R	Lathe	1ME737	MACHINE TAILSHAFT YOKE & SEAL	MACHINE TAILSHAFT YOKE & SEAL INSTALATION TOOL	333.78	0	0	10	343.78
190827-00	SVC002315	09/04/2019	1H0103	184_INT	S	Service	1ME737	S1 D SERVICE	CARRIED OUT THE REQUIRED "D" SEWRVICE AND SAFETY INSPECTIONS AS PER SERVICE SHEET REPLACED LEFT HAND MIRROR	534.8	1842.54	0	25	2402.34
190821-00	SVC002315	08/23/2019	1H0103	105_HBGN	R	Front Axle	1ME737	INSPECT FRONT R/H DRIVE AXLE	1ME737 JOB CARRIED OUT - LOCATED HM300 AT IMPACT. ASSESS RH FRONT DRIVE SHAFT NOISE. FOUND OUTER UNI JOINT MISSING AND BROKEN BOLTS. POSSIBLE DAMAGE TO OUTER DRIVE SHAFT YOKE. ORGANISE FLAT TRAY TO PICK UP FROM IMPACT. TAKEN TO LA WORKSHOP FOR REPAIRS.	218.1	0	0	0	218.1
190815-00	SVC002314	08/20/2019	1H0103	105_HBGN	R	Sundries	1ME737	6 MONTH TEST FIRE EXTINGUISHER	1ME737 JOB CARRIED OUT - CARRY OUT 6 MONTHLY CHECK ON FIRE EXTINGUISHER.	36.35	0	0	0	36.35
190806-00	SVC002307	08/19/2019	1H0103	184_INT	R	Sundries	1ME737	CHECK OVER BEFORE WORK	TRAVEL TO NYRSTAR CHECK OVER BEFORE WORK REPLACE BLOWN HEADLIGHT GLOBE REPLACE REAR CAB WORK LIGHT REPAIR STEERING COLUMN ADJUSTER REPLACE BROKEN WASHER JET AND CHECK A/C SYSTEM	490.2	154.76	0	30.75	675.71
190724-00	SVC002304	08/15/2019	1H0103	105_HBGN	R	Electrical	1ME737	Repair head light fault	1ME737 JOB CARRIED OUT - REMOVE SEIZED STEERING WHEEL WITH HYD PULLER. REMOVE COVERS AND FIR NEW HEAD LIGHT SWITCH. REFIT COVERS AND STEERING WHEEL.	0	246.69	254.53	25	526.22
190726-00	SVC002302	08/08/2019	1H0103	105_HBGN	R	Sundries	1ME737	New Windscreen	1ME737 JOB CARRIED OUT - SUPPLY AND FIT NEW WINDSCREEN.	0	107	604.55	0	711.55
190722-01	SVC002295	07/31/2019	1H0103	105_HBGN	R	Sundries	1ME737	Replace Wiper Blade	1ME737 JOB CARRIED OUT - FIT NEW WIPER BLADE, ACID WASH WINDSCREEN.	0	0	31.82	38	69.82

190712-00	SVC00202	07/29/2019	1H0103	105_HBGN	R	Sundries	1ME737	15774	JULY - COMPLETE PMI'S	1ME737	109.05	0	0	20	129.05
										ODOMETER - 15774 HOURS					
190620-00	SVC00228	06/21/2019	1H0103	121_INT	R	Tyres	1ME737		PUNCTURE REPAIR CARRIED OUT	JOB CARRIED OUT - CARRIED OUT PMI. PUNCTURE REPAIR CARRIED OUT BY B SELECT MOONAH WORK ORDER 21487	0	0	276.36	0	276.36
190228-00	SVC00221	06/20/2019	1H0103	105_HBGN	R	Tyres	1ME737		RETENSION WHEEL NUTS	1ME737	0	70	0	0	70
190527-00	SVC00227	06/06/2019	1H0103	184_INT	R	Air Con	1ME737		CHECK AIR CON FAULT	JOB CARRIED OUT - RETENSION WHEEL NUTS. CHECK AIR CON FAULT, FOUND TO BE LOW ON GAS. TEST FOR LEAKS BUT NONE FOUND WITH OUT LIFTING CAB LIFT CAB AND TEST SYSTEM,, FOUND LEAK COMING FROM HEATER BOX. REMOVE HEATER BOX AND STRIP , FOUND EVAPORATOR CORRODED AND LEAKING CLEAN OUT HEATER BOX AND FIT NEW EVAPORATOR, REASSEMBLE HEATER BOX . REFIT HEATER BOX INTO MACHINE AND CONNECY HOSES . REGAS MACHINE AND TEST OPERATION LOWER AND SECURE CAB TRAVEL NYRSTAR AND RETURN THREE TIMES	1649	491.41	0	77.5	2217.91
190218-00	SVC00220	05/29/2019	1H0103	182_INT	R	Sundries	1ME737		REPAIR DAMAGED GUARD	Cut and remove rusted and damaged front panel. Fabricate and fold new panel. Tack weld new panel into frame of existing side panel. Test fit new side panel on unit. Weld out and prep for paint. Refit completed panel.	366.39	82.94	60	50	559.33
190507-00	SVC00225	05/19/2019	1H0103	184_INT	R	Bodywork	1ME737	15694 HR	REPLACE DOOR HANDLE & ROD	REPLACE DOOR HANDLE & ROD CHECK DOOR LOCK AND LUBRICATE LINKAGES, LOCATE PARTS NEEDED FOR FINAL REPAIRS FIT NEW DOOR HANDLE AND LINKAGES TO LEFT HAND SIDE DOOR TRAVEL NYRSTAR AND RETURN	204.25	270.77	0	12.5	487.52
190423-00	SVC00224	05/10/2019	1H0103	184_INT	R	Air Con	1ME737		REPAIR AIR CON FAULTS	1ME737 - 15659 HRS 23/4/19 - TRAVEL TO NYRSTAR AND INSPECT A/C, FOUND TO BE LOW ON GASAND LEAKING FROM TX VALVE, REMOVE AND ORDER IN PARTS, TRAVEL BACK TO WORKSHOP. 30/4/19 - TRAVEL BACK TO NYRSTAR, REPLACE TX VALVE AND VAC DOWN SYSTEM TO CHECK FOR LEAKS, REGASSED AND CHECKED OPERATION, ALL OK, TRAVEL BACK TO WORKSHOP.	449.35	254.17	0	91.25	794.77
190423-00	SVC00224	05/03/2019	1H0103	184_INT	S	Service	1ME737		S1 A SERVICE	TRAVEL TO NYRSTAR. CARRIED OUT S1 A SERVICE AS PER SERVICE SHEET.	285.95	284.38	0	37.75	608.08
190409-00	SVC00224	04/16/2019	1H0103	121_INT	R	Tyres	1ME737		PRESSURE CHECK TYRES AND ADJ	PRESSURE CHECK TYRES AND ADJUST ON THE FRONT AS ARRANGED BY ERNIE CARRIED OUT BY B SELECT MOONAH WORK ORDER 19739	0	0	100	0	100

190329-00	SVC002232	04/13/2019	1H0103	184_INT	R	Sundries	1ME737	CHECK OVER BEFORE WORK	CHECK OVER BEFORE WORK, REPLACE ENGINE AIR INTAKE AND CAB FILTERS REPLACE REAR CAB WORK LIGHT , REPLACE OUT OF DATE FIRE EXTINGUISHER CHECK ALL WHEEL NUTS REMOVED AND REPLACED CORRODED BRAKE COOLING PIPES, TOP UP TRANSMISSION OIL AND TEST OPERATE UNIT TRAVEL NYRSTAR AND RETURN	1511.45	2249.04	0	81.25	3841.74
190318-00	SVC002226	04/11/2019	1H0103	105_HBGN	R	Air Con	1ME737	A/C FAULTS - LOW GAS	1ME737 ODOMETER - JOB CARRIED OUT - TEST A/C, FOUND IT WAS LOW IN GAS, CHECK SYSTEM FOR LEAKS, FOUND A SLIGHT LEAK IN THE EVAPORATOR, RECOVER GAS VACUUM SYSTEM AND ADD SEALING ADDITIVE THEN REGAS.	0	0	281.79	25	306.79
190225-01	SVC002214	03/08/2019	1H0103	105_HBGN	R	Air Con	1ME737	REPAIR A/C SYSTEM	1ME737 JOB CARRIED OUT - TEST A/C, FOUND THE HIGH SIDE VALVE WAS LEAKING. REPLACE VALVE, VACUUM SYSTEM AND RETEST FOR LEAKS, NO LEAKS. REGAS. REMOVE GRILL AND HOT PRESSURE WASH THE CONDENSOR AND COOLING CORES.	109.05	155.98	254.52	0	519.55
190308-00	SVC002220	03/08/2019	1H0103	105_HBGN	R	Air Con	1ME737	PARTS FOR A/C REPAIRS	1ME737 JOB CARRIED OUT - PARTS ONLY, NOT INCLUDED IN ORIGINAL CALL FOR A/C REPAIRS.	0	239.48	0	0	239.48
190129-00	SVC002197	02/28/2019	1H0103	105_HBGN	R	Bodywork	1ME737	REPLACE LHS WINDOW/CAB	1ME737 JOB CARRIED OUT - REPLACE LH SIDE CAB WINDOW.	145.4	564.1	0	0	709.5
190122-00	SVC002190	02/27/2019	1H0103	184_INT	R	Bodywork	1ME737	REPLACE LEFT HAND DOOR LOCK	REPLACE LEFT HAND DOOR LOCK AND FIT NEW RETAINING HOOK TRAVEL NYRSTAR	81.7	488.77	0	12.5	582.97

190208-00	SVC002212	02/27/2019	1H0103	186_INT	R	Differential	1ME737		REASSEMBLE FRONT END	REASSEMBLE FRONT END SET UNIT UP IN WORKSHOP RESET L/HAND FRONT HUB BEARING PRELOAD. REPLACE WORN THRUST PLATES . REPLACE INPUT SHAFT SEALS AND BUSHES, REFIT INPUT SHAFT AND REFIT PLANNETARIES. FIT LEFT FRONT DRIVE SHAFT REMOVE RIGHT FRONT WHEEL ASSEMBLY, REMOVE PLANETARY COVER AND PLANETARY BASKET , REMOVEWORN OUTER HUB BEARING FROM PLANETARY BASKET AND FIT NEW BEARING. CLEAN OUT HUB ASSEMBLY AND FIT NEW BEARING CUP. REFIT BASKET TO HUB AND ADJUST BEARING PRE LOAD. FIT NEW RIGHT HAND DRIVE SHAFT. STRIP PLANETARY AND REPLACE BEARINGS IN BULL GEARS,REFIT PANETARY TO HUB. FILL BOTH HUBS WITH OIL. REMOVE LEFT HAND CAT WALK GUARD , HAVE REPAIRED AND REFIT, REFIT INNER GUARDS. CHANGE WHEELS BETWEEN FRONT AND REAR AXLES REPAIR WORK LIGHT WIRING, FREE UP BATTERY BOX LID AND FIT NEW STRUTT . FIT NEW BATTERY HOLD DOWN CLAMPS	4219.63	1259.5	1849.85	100	7428.98
190118-00	SVC002193	02/21/2019	1H0103	105_HBGN	R	Sundries	1ME737		REPAIR FRONT FINAL DRIVES	1ME737 JOB CARRIED OUT - REPORTEFD BAD FRONT FINAL DRIVE SAMPLES. REMOVE BUNGS TO INSPECT, RH SIDE SHOWING METAL. TAGGED OUT MACHINE, DRAIN RH AND LH FINAL DRIVE FOR REMOVAL. FOUND RH SPACER WORN DOWN, REMOVED RH DRIVE SHAFT TO INSPECT BUSH DIAMETER WEAR. REMOVED LH SIDE AXLE AND SHAFT FOR BUSH AND SEALREMOVSAL. WASH FOR SITE REMOVAL. LA TO COMPLETE JOB.	1817.5	2303.08	0	25	4145.58
190124-00	SVC002193	01/31/2019	1H0103	184_INT	R	Electrical	1ME737	15458 HRS	REPLACE UHF ANTENNA AND CABLE	CHECK UHF OPERATION, REPLACE FAULTY UHF ANTENNA AND LEAD. TESTED OK TRAVEL NYRSTAR	163.4	47	0	6.25	216.65
190114-00	SVC002143	01/24/2019	1H0103	184_INT	R	Sundries	1ME737		REPAIRS BEFORE WORK	TRAVEL NYRSTAR AND RETURN REPAIR OPERATORS DOOR LOCK CHECK AIR CON AND FOUND LOW ON GAS. CHECKED FOR LEAKS AND RECHARGED SYSTEM. TESTED OK REPAIRED TAIL LIGHT WIRING FIT UHF SUPPLIED BY ERNIE	798.65	0	0	108.25	906.9
190115-00	SVC002188	01/18/2019	1H0103	105_HBGN	R	Sundries	1ME737	15427HRS	REPLACE MISSING FINAL DRIVE BU	1ME737 ODOMETER - 15427 HOURS JOB CARRIED OUT - L/H SIDE INTERMEDIATE AXLE DRIVE BUNG MISSING. FOUND BUNG 500M AWAY FROM MACHINE. CHECKED ALL LEVELS, REFITTED BUNG AND CHECKED ALL OTHERS.	72.7	0	0	0	72.7

190110-00	SVC002186	01/16/2019	1H0103	184_INT	S	Service	1ME737	15426 HRS	S1 B SERVICE	S1 B SERVICE AS PER SERVICE SHEET TRAVEL NYRSTAR AND RETURN	490.2	739.19	0	36.5	1265.89
181121-00	SVC002158	11/21/2018	1H0103	121_INT	R	Tyres	1ME737		HAILTRAX 23.5 R25 HR25 L3/E3 X	HAILTRAX 23.5 R25 HR25 L3/E3 X 2 E/MOVER SEALING O-RING X 2 FIT OTR TYRE X 2 OTR SVCRATE NORM X 10 CARRIED OUT BY B SELECT WORK ORDER 16269	0	5502.72	0	0	5502.72
181026-00	SVC002148	11/12/2018	1H0103	184_INT	R	Electrical	1ME737	15196 HRS	CHECK FAULT WITH WINDOW WIPERS	TRAVEL TO NYRSTAR, CHECK FAULT WITH WINDOW WIPERS, FOUND SHAFT SIEZED, LOOSEN LOCKING NUT TO ALLOW SHAFT TO TURN AND WIPERS TO WORK UNTIL NEW PARTS AVAILABLE. TRAVEL BACK TO NYRSTAR, REMOVE AND REPLACE WIPER MOTOR ASSEMBLY, REPLACE ARM AND BLADE.	408.5	861.9	0	45	1315.4
181031-00	SVC002151	11/07/2018	1H0103	105_HBGN	R	Sundries	1ME737	15219	COMPLETE PMI INSPECTION	1ME737 JOB CARRIED OUT - CARRY OUT PMI. REPLACED BLOCKED CABIN FILTER. LH SIDE DOOR HARD TO OPEN. BOOST PIPE NEEDS REPLACING. RADIATOR NEEDS REMOVING TO CLEAN OFF HARD PRODUCT.	145.4	75.93	0	10	231.33
181018-00	SVC002138	10/19/2018	1H0103	183SERVIC	R	Electrical	1ME737	15967	CALL OUT - WIPER FAULT	CALLOUT 17/10/2018 8.00 p.m. REPORTED FAILED SCREEN WIPER. REMOVE ACCESS PANEL TO FIND NUT FALLEN OFF AND WIPER ARM NO LONGER ATTACHED. REMOVED MOTOR AND CLEANED SPLINES. FOUND NUT LOOSE ON DRIVE SPLINE THROUGH CAB. TIGHTEN NUT AND TEST. *NOTE* BEARINGS ON SHAFT GOING THROUGH CAB MAY BE SIEZED, FURTHER DIAGNOSIS REQUIRED.	433.8	0	0	25	458.8
180829-00	SVC002108	09/19/2018	1H0103	184_INT	R	Bodywork	1ME737	15118 HRS	REPLACE DOOR SEAL	TRAVELLED TO NYRSTAR, TEMPORARY REPAIR DOOR SEAL UNTIL NEW PART ARRIVES, TRAVEL BACK TO SITE AND REMOVE AND REPLACE DOOR SEAL, ADJUST DOOR LOCK TO SUIT	245.1	435.37	0	24.5	704.97
180807-00	SVC002096	09/06/2018	1H0103	105_HBGN	R	Transmissio	1ME737	15069 HRS	Inspect drive fault		72.7	0	0	25	97.7
180801-00	SVC002093	08/23/2018	1H0103	184_INT	S	Service	1ME737	15070 HRS	S1 C SERVICE	CALL OUT 11/08/2018 , CHECK DRIVE FAULT . FOUND TRANSMISSION LOW ON OIL . AS UNIT DUE FOR SERVICE CHANGED TRANSMISSION OIL AND FILLED TO CORRECT LEVEL. TESTED OK TRAVEL NYRSTAR CARRIED OUT THE REQUIRED SERVICE AND SAFETY INSPECTIONS AS PER SERVICE SHEET REPAIRED WORK LIGHT AND WIRING ON RIGHT HAND MIRROR TRAVEL NYRSTAR AND RETURN 13/08/18	870.5	1393.9	0	71.25	2335.65
180710-00	SVC002083	07/18/2018	1H0103	184_INT	R	Electrical	1ME737	14947 HRS	REPAIR LIGHTS AND DOOR SEAL	TRAVELLED TOO NYRSTAR, REPLACE UHF RETAINING CLIPS, REPLACE RIGHT HAND HEAD LIGHT GLOBE AND REGLUE DOOR SEAL ON DRIVERS SIDE DOOR .	81.7	51.22	0	12.5	145.42
180717-00	SVC002084	07/18/2018	1H0103	184_INT	R	Brake	1ME737	14956	CALL OUT - REPLACE BLOWN BRAKE	CALL OUT TO IMPACT, REMOVE AND REPLACE BLOWN HYDRAULIC HOSE, TOP UP HYDRAULIC OIL AND TEST OPERATION ALL OK.	433.8	43.8	0	84	561.6

180712-00\	SVC00208\	07/13/2018	1H0103	105_HBGN'	R	Hydraulic	1ME737		INSPECT OIL LEAK	1ME737	72.7	0	0	0	72.7
										JOB CARRIED OUT - INSPECT OIL LEAK. CHECKED OVER VEHICLE, ALL OILS OK. WATER ONLY DRIPPING FROM VEHICLE.					
180604-00\	SVC00206\	06/06/2018	1H0103	184_INT	R	Electrical	1ME737	14806 HRS	CHECK FAULT CODE FOR BRAKE COO	CHECK FAULT CODE FOR BRAKE COOLING TEMPERATURE SENSOR, WAIT FOR TRAY TO BE EMPTIED OUT . LIFT TRAY AND CHECK WIRING ON BRAKE COOLING PIPES. REPAIR BROKEN WIRING AT SENSOR AND TESTED OK LOWER TRAY AND RETURN UNIT TO WORK	441.93	0	0	20	461.93
180604-00\	SVC00206\	06/04/2018	1H0103	121_INT	R	Tyres	1ME737	10300	CALLOUT PUNCTURE REPAIR	MINOR PUNCUTE REPAIR CARRIED OUT AT MIDNIGHT AT IMPACT BY BSELECT	0	16.36	423.6	0	439.96
180531-00\	SVC00205\	05/31/2018	1H0103	121_INT	R	Tyres	1ME737		FIT OTR TYRE X 2 + O-RING X 2	FIT OTR TYRE X 2 + O-RING X 2 + CALLOUT TO NYRSTAR WHARF AS REQUESTED BY JASON HAZELL CARRIED OUT BY B SELECT MOONAH- WORK ORDER 12712	0	32.72	627.2	0	659.92
180516-00\	SVC00205\	05/22/2018	1H0103	184_INT	S	Service	1ME737	14806 HRS	S1 A SERVICE	TRAVELLED TO NYRSTAR, CARRIED OUT S1 A SERVICE AS PER SERVICE SHEET, REMOVE CLEAN AND REFIT DIFF BREATHERS	284.98	277.07	0	31.5	593.55
180319-00\	SVC00202\	04/23/2018	1H0103	184_INT	R	Suspension	1ME737	14736 HRS	REGAS STRUTS	TRAVELLED TO IMPACT, REMOVE LEAKING CHARGE VALVE AND CHECK, FOUND SEAT DAMAGED. SUPPLIED NEW VALVE AND KOMATSU TO FIT NEW VALVE AND RECHARGE STRUT REPAIR AND REGAS SUSPENSION STRUTTS CARRIED OUT BY KOMATSU	80.35	0	1158.37	12.5	1251.22
180316-00\	SVC00202\	03/27/2018	1H0103	184_INT	R	Electrical	1ME737	14736 HRS	REPAIR CODE ON DISPLAY DKHOKX	TRAVELLED TO NYRSTAR, REPAIR CODE ON DISPLAY (DKHOKX) FOUND CODE REFERED TO INCLAMATION SENSOR OUT OF RANGE. CHECKED AND FOUND NO POWER TO SENSOR. REMOVE PRODUCT BUILD UP AROUND WIRING LOOM AND CHECK LOOM FOR DAMAGE, FOUND BREAK IN WIRING ALONG CHASSIS RAIL. REPAIR WIRING AND TEST OPERATION ALL OK.	441.93	0	0	34.5	476.43
180313-00\	SVC00201\	03/20/2018	1H0103	105_HBGN'	R	Engine	1ME737		DIAGNOSE EO1 FAULT CODE	1ME737	71.35	0	0	0	71.35
										JOB CARRIED OUT - DIAGNOSE FAULT CODE. CLEAR CODES AND CARRY OUT PMI.					
180319-00\	SVC00201\	03/20/2018	1H0103	105_HBGN'	R	Bodywork	1ME737		REPAIR RHS TOOL BOX AT STEP	1ME737	178.38	0	0	20	198.38
										JOB CARRIED OUT - CUT OUT PLATE AND CLEAN PRODUCT FROM AROUND OPENING. CUT OLD HINGE OFF, WELD PLATE OVER OPENING OF TOOL BOX.					
180313-00\	SVC00201\	03/13/2018	1H0103	184_INT	R	Trays/Buck	1ME737	14736 HRS	REPLACE TAIL BOARD SEAL	TRAVELLED TO IMPACT FERTILISERS, REMOVE AND REPLACE DAMAGED TAIL BOARD SEALING RUBBER	200.88	0	0	22.5	223.38
180214-00\	SVC00200\	02/27/2018	1H0103	182_INT	R	Sundries	1ME737		FABRICATE BATTERY CLAMPS	FABRICATE BATTERY CLAMPS AS REQUIRED	71.35	0	0	0	71.35

180130-00'SVC001995	02/21/2018	1H0103	184_INT	S	Service	1ME737	14604 HRS	S1 B SERVICE	TRAVELLED TO IMPACT, CARRIED OUT S1 B SERVICE AS PER SERVICE SHEET, DIG PRODUCT OUT FROM AROUND TAIL SHAFT AND DRAIN PLUGS, BLOW OUT RADIATOR AND COOLER CORES AS WELL AS POSSIBLE, GREASE ALL NIPPLES AND REPAIR WORK LIGHT WIRING.	522.28	754.72	0	43.5	1320.5
180130-00'SVC001995	02/06/2018	1H0103	184_INT	R	Electrical	1ME737	NOT SUPPL	REPLACE FAULTY BATTERIES	TRAVELLED TO NYRSTAR, LOCK OUT MACHINE AND REFIT BATTERIES INTO 1ME645 THAT WERE CHANGED OVER INTO 1ME737 TO ALLOW UNIT TO BE WORKED AT IMPACT FERTILISERS OVER THE WEEK END. REMOVE ISOLATION LOCKS FROM MACHINES.	316.91	395.68	0	28.5	741.09
180115-00'SVC001987	01/18/2018	1H0103	105_HBGN'	R	Engine	1ME737	14551	low engine oil	1ME737	35.68	16.28	0	0	51.96
									ODOMETER - 14551 HOURS					
171212-00'SVC001972	12/12/2017	1H0103	121_INT	R	Tyres	1ME737		CALLOUT TO REDUCE TYRE PRESSUR	JOB CARRIED OUT - TOP UP LOW ENGINE OIL. CALLOUT TO REDUCE TYRE PRESSURES FOR UNIT AT SEVEN MILE BEACH TO ENABLE SAND WORKS	0	0	105	0	105
171109-00'SVC001955	11/10/2017	1H0103	105_HBGN'	R	Electrical	1ME737	14319 HRS	FITUP DAYTIME RUNNING LIGHTS	1ME737	178.38	0	0	20	198.38
									ODOMETER - 14319 HOURS					
									JOB CARRIED OUT - FIT UP OF DAYTIME RUNNING LIGHTS.					
171101-00'SVC001953	11/06/2017	1H0103	184_INT	R	Bodywork	1ME737	14318 hrs	REPLACE FAULTY WINDOW REGULATO	TRAVEL TO NYRSTAR. CHECKED WINDOW OPERATION AND FOUND MOTOR BURNT OUT , FORCE WINDOW CLOSED AND TAPE CLOSED UNTIL NEW PART ARRIVES. REMOVE DOOR PANEL AND REMOVE REGULATOR , FIT NEW REGULATOR AND BOLT INTO PLACE , TEST OPERATION AND REFIT PANE	232.05	871.76	0	12.5	1116.31
171024-00'SVC001946	11/03/2017	1H0103	105_HBGN'	R	Brake	1ME737	14271HR	DIAGNOSE PARK BRAKE FAULTS	1ME737	35.68	0	0	0	35.68
									ODOMETER - 14271 HOURS					
									JOB CARRIED OUT - DIAGNOSE PARK BRAKE FAULT. FOUND TO HAVE RETARDER LEVER ENGAGED.					
171024-00'SVC001950	11/03/2017	1H0103	105_HBGN'	R	Brake	1ME737	14271HR	DIAGNOSE PARK BRAKE FAULTS	1ME737	35.68	0	0	0	35.68
									JOB CARRIED OUT - DIAGNOSE AND REPAIR PARK BRAKE FAULTS.					

171023-00	SVC00194	10/30/2017	1H0103	184_INT	R	Sundries	1ME737	14270 HRS	CARRY OUT PMI INSPECTION AND F	TRAVELLED TO NYRSTAR, CARRIED OUT PMI INSPECTION AND REPAIR TAIL GATE SEAL, GREASE MACHINE AND CHECK OVER. FIT NEW LOCKABLE BATTERY ISOLATOR SWITCH AND WIRE INTO SYSTEM , REMOVE AND REPLACE ELECTRONIC BATTERY ISOLATOR. CHECK ALL LIGHTS AND BRAKE LIGHTS OUT , DIG PRODUCT FROM AROUND WIRING LOOM AND REPAIR CORRODED WIRING. REMOVE AND REPLACE BROKEN DIFF BREATHER HOSES AND UNBLOCKED BREATHERS AND FITTINGS. ADJUST PARK BRAKE AND TEST OPERATE UNIT TO CHECK REPAIRS. TESTED OK. CLEAN UP WORK AREA AFTER REPAIRS	1088.49	289.15	0	75	1452.64
171012-00	SVC00190	10/25/2017	1H0103	184_INT	R	Bodywork	1ME737	14276 HRS	REPAIR L/HAND DOOR LATCHES	REPAIR L/HAND DOOR LATCHES REMOVE AND REPLACE DOOR LOCK AND LATCH, REPLACE HOOKS ON ENDS OF CONNECTING RODS TRAVEL NYRSTAR AND RETURN	160.7	586.34	0	0	747.04
171011-00	SVC00194	10/13/2017	1H0103	105_HBGN	R	Sundries	1ME737	14262HRS	INSPECT DOOR LATCH ASSY	INSPECT RHS DOOR OPERATION. REMOVE DOOR SKIN, INSPECT LINKAGES AND INTERNAL DOOR LOCK MECHANISM.	71.35	0	0	0	71.35
170911-00	SVC00193	10/26/2017	1H0103	184_INT	S	Service	1ME737	14222 HRS	S1 A SERVICE	TRAVELLED TO NYRSTAR, CARRIED OUT S1 A SERVICE AS PER SERVICE SHEET, REPLACE BLOWN WORK LIGHT GLOBES, REMOVE AND REPLACE DIFF BREATHERS, CHECK TAIL GATE SEAL AND GREASE UNIT, CLEAN WORK AREA AFTER REPAIRS	453.19	275.9	0	40	769.09
170907-00	SVC00192	09/08/2017	1H0103	105_HBGN	R	Trays/Buck	1ME737	14146	INSPECT TRAY PINS ON ALL HM'S	1ME737 - DUMP TRUCK ODOMETER - 14146 JOB CARRIED OUT - INSPECTED ALL SITE HAVC TRUCKS. LIFT CHAINS FOR TAIL GATE ARE OK, TRAY PINS ARE OK. COMPLETED VEHICLE CHECKS.	214.05	0	0	0	214.05
170712-00	SVC00189	07/28/2017	1H0103	105	R	Electrical	1ME737	14065	ASSESS FAULT CODE	ASSESS FAULT CODE ON DUMP TRUCK 1ME737.	34.98	0	0	0	34.98
170727-00	SVC00189	07/27/2017	1H0103	121_INT	R	Tyres	1ME737	14004 HOU	Puncture repair	PUNCTURE REPAIR CARRIED OUT BY B SELECT MOONAH AS PER WORK ORDER 6556	0	32.72	283.6	0	316.32
170718-00	SVC00189	07/25/2017	1H0103	184_INT	R	Bodywork	1ME737	14107 HRS	REPAIR BONNET CATCH	TRAVELLED TO NYRSTAR, MOVED DUMPER TO WORKSHOP, REMOVE AND REPLACE DAMAGED BONNET RELEASE CABLE, REMOVE AND REPLACE BONNET LOCK, REMOVE RUBBISH FROM AND FREE UP BONNET RELEASE CATCH, RETURN UNIT TO WHARF AREA AFTER REPAIRS.	361.58	384.1	0	36.75	782.43
170630-00	SVC00187	07/17/2017	1H0103	184_INT	S	Service	1ME737	14004 HRS	S1 D SERVICE	TRAVELLED TO NYRSTAR, CARRIED OUT S1 D SERVICE AS PER SERVICE SHEET, REMOVE CLEAN AND REFIT DIFF BREATHERS. REPAIR WORK LIGHT WIRING AND CLEAN PRODUCT FROM AROUND BRAKE PEDAL. WASH OUT RADIATOR CORE.	823.63	2343.67	0	53.5	3220.8
170630-00	SVC00179	07/04/2017	1H0103	121_INT	R	Tyres	1ME737		CALLOUT TYRE REPAIRS	CALLOUT TYRE REPAIRS CARRIED OUT BY BRIDGESTONE AUSTRALIA	0	10321	0	0	10321
170619-00	SVC00187	06/19/2017	1H0103	184_INT	R	Sundries	1ME737	13902 HRS	CHECK OVER BEFORE WORK	TRAVELLED TO NYRSTAR, CHECKED OVER UNIT BEFORE WORK AS REQUESTED	160.7	0	0	18.5	179.2

170403-00\	SVC001842	06/08/2017	1H0103	184_INT	R	Sundries	1ME737	13767 HRS	REMOVE , REPAIR AND REFIT SEAT	TRAVEL IMPACT REMOVE , REPAIR AND REFIT SEAT	166.45	0	0	6.25	172.7
170403-00\	SVC001875	06/08/2017	1H0103	184_INT	R	Sundries	1ME737	13767 HRS	REMOVE , REPAIR AND REFIT SEAT	SEAT REPAIRS CARRIED OUT BY P.BAKER TO SEAT OF DUMPER AND FITTED IN APRIL AS PER INVOICE SVC00184237	0	0	300	0	300
170601-00\	SVC001871	06/06/2017	1H0103	184_INT	R	Sundries	1ME737	13871 HRS	CHECK OVER BEFORE WORK	TRAVEL TO NYRSTAR, CHECK OVER UNIT BEFORE GOING TO WORK, ADJUST FAN BELTS AS REQUIRED	120.53	0	0	12.5	133.03
170518-00\	SVC001864	05/22/2017	1H0103	105	A	Electrical	1ME737	13843	REVOLVING LIGHT - DAMAGED	1ME737	104.93	39.95	0	0	144.88
										ODOMETER - 13843 HOURS					
170518-00\	SVC001864	05/22/2017	1H0103	105_HBGN'	R	Brake	1ME737	13843	ADJUST HANDBRAKE	JOB CARRIED OUT - REPLACE DAMAGED LIGHT. 1ME737	139.9	0	0	0	139.9
										ODOMETER - 13843 HOURS					
										JOB CARRIED OUT - CLEAN, TEST AND ADJUST PARK BRAKE.					
170322-00\	SVC001835	04/21/2017	1H0103	184_INT	R	Electrical	1ME737	13743 HRS	REPAIR LIGHTS	TRAVELLED TO NYRSTAR, CHECKED FRONT CAB LIGHT NOT WORKING, FOUND LIGHT TO BE FAULTY, REMOVED AND REPLACED LIGHT AND TESTED OK	80.35	29	0	12.5	121.85
170405-00\	SVC001845	04/13/2017	1H0103	105_HBGN'	R	Hydraulic	1ME737	13770	DIAGNOSE STEER RAM HYD LEAK	1ME737	34.98	0	0	0	34.98
										ODOMETER - 13770 HOURS					
										JOB CARRIED OUT - ASSESS HYD OIL LEAK. LH STEER CYLINDER SEALS LEAKING. COMMUNICATED TO WORKSHOP TO COMPLETE REPAIR.					
170406-00\	SVC001845	04/11/2017	1H0103	184_INT	R	Hydraulic	1ME737	13820 HRS	REMOVE, RESEAL AND REFIT STEER	TRAVELLED TO NYRSTAR, REMOVE, RESEAL AND REFIT STEERING CYLINDER L/HAND SIDE AND REPAIR OPERATORS DOOR LOCK	846.55	752.64	0	42	1641.19
170216-00\	SVC001815	03/28/2017	1H0103	184_INT	S	Service	1ME737	13648 HRS	S1 B SERVICE	TRAVELLED TO NYRSTAR, CARRIED OUT S1 B SERVICE AS PER SERVICE SHEET AND REPLACED WIPER ARM ASSEMBLY	536.65	744.12	0	44.5	1325.27
170131-00\	SVC001811	02/22/2017	1H0103	184_INT	R	Sundries	1ME737	13590 HRS	CHECK OVER BEFORE WORK	TRAVELLED TO NYRSTAR, CHECK OVER BEFORE WORK AND CLEAN ALL FILTERS	241.05	371.21	0	24.5	636.76
										REPLACE OUT OF DATE FIRE EXTINGUISHER					
										MAKE TEMPORARY REPAIRS TO FRONT WIPER ARM UNTIL NEW PART ARRIVES					
170116-00\	SVC001803	01/17/2017	1H0103	184_INT	R	Tyres	1ME737	13477 HRS	Pump up flat tyre	TRAVELLED TO IMPACT FERTILIZERS AND PUMP UP L/HAND FRONT TYRE	123.4	0	0	12.5	135.9
170109-00\	SVC001800	01/13/2017	1H0103	105_HBGN'	R	Electrical	1ME737		CALL OUT - DASH FAULTS	1ME737	214.2	0	0	0	214.2
										JOB CARRIED OUT - CALL OUT - FAULT CODE EOL DASH FAULTS. CLEARED AND TESTED, NO FAULT FOUND.					
170110-00\	SVC001800	01/12/2017	1H0103	105_HBGN'	R	Bodywork	1ME737		FIT UP MISSING MIRROR	1ME737	34.98	0	0	0	34.98
										JOB CARRIED OUT - REMOVE BROKEN MIRROR, FIT UP MIRROR FRO 1ME730.					

161128-00	SVC001781	12/06/2016	1H0103	184_INT	S	Service	1ME737	13480HRS	S1 A SERVICE	TRAVELLED TO NYRSTAR, CARRIED OUT S1 A SERVICE AS PER SHEET	348.68	231.22	0	41.25	621.15
161128-00	SVC001784	11/30/2016	1H0103	105_HBGN	R	Sundries	1ME737		FIT UP NEW WIPER BLADE	1ME737	69.95	0	0	15	84.95
161121-00	SVC001778	11/29/2016	1H0103	184_INT	R	Trays/Buck	1ME737	13356 HRS	RESEAL TAIL GATE AND PMI INSPE	JOB CARRIED OUT - FIT UP NEW WIPER BLADE. CHECKED AND REPLACED TAIL GATE SEALING RUBBER, CARRIED OUT PMI INSPECTION BEFORE WORK, REPLACE FAULTY REVERSE ALARM	766.21	212.39	0	38	1016.6
161117-00	SVC001776	11/24/2016	1H0103	182_INT	R	Trays/Buck	1ME737		REPAIR CRACKS IN THE REAR OF T	REPAIR CRACKS IN THE REAR OF TRAY FLOOR (TEMPORARY REPAIR) MACHINE WILL NEED TO COME BACK INTO WORKSHOP TO HAVE A SCECTION OF THE FLOOR REPLACED.	1315.43	0	0	50	1365.43
161025-00	SVC001768	11/07/2016	1H0103	186_INT	R	Sundries	1ME737		REPLACE COOLER UNIT	Replaced the cooler unit as required	0	0	1060.1	0	1060.1
161007-00	SVC001758	10/07/2016	1H0109	184_INT	R	Engine	1ME737	13287	top up coolant	TOP UP COOLANT, PARTS ONLY	0	90.3	0	0	90.3
160810-00	SVC001728	09/26/2016	1H0109	186_INT	R	Engine	1ME737	13267 hrs £	REMOVE CORES CLEAN AND REFIT	PARK UNIT IN WORKSHOP, REMOVE COOLANT AND A/C GAS, REMOVE RADIATOR, AFTER COOLER AND A/C CONDERSOR, SEPARATE CORES FOR CLEANING, PRESSURE TEST COOLER CORE TO LOCATE LEAK AND HAVE WELDERS REPAIR, LIFT CAB AND STRIP OUT EXHAUST SYSTEM, MANUFACTURE NEW EXHAUST SYSTEM AND REFIT, CLEAN OUT AROUND MUFFLER, FIT NEW HEAT PROTECTION BANDAGE AND REFIT COVERS, CLEAN PRODUCT FROM AROUND FRONT DIFF AND REPAIR OIL LEAKS AT BRAKE COOLER PIPES, REASSEMBLE RADIATOR WITH NEW PACKING AND REFIT TO MACHINE, REFIT FAN AND GUARDING, REFIT AFTER COOLER AND A/C CONDERSOR FILLED WITH COOLANT AND RECHARGE A/C CHECK ENGINE VIBRATION, REMOVED TAIL SHAFT AND DAMPER, STRIP DAMPER AND CLEAN ALL PARTS, HAVE DRIVE SHAFT REPAIRED, REASSEMBLE DAMPER UNIT AND REFIT TO MACHINE, REFIT TAIL SHAFT AND TEST OPERATION, LOWER AND SECURE CAB, PARK UNIT IN BACK YARD	5857.76	1940.42	275	70	8143.18
160607-00	SVC001693	08/11/2016	1H0109	182_INT	A	Trays/Buck	1ME737		REPAIR TAILGATE MOUNT AND FAB	Damaged tail gate. The tail gate was removed with both sides. New sides had to be fabricated from scratch. The pin and bearing mounts were both damaged, damaging the mount plates behind the pin support. The mounts were fabricated for both sides with new pins. New bearings were arrange and installed into the mounts. The new arms were fitted and the tail gate installed onto the machine. This was adjusted as needed to get the tail gate to tray clearance right. the raise chains were installed and tensioned to spec.	4668.86	2275.01	0	0	6943.87

160721-00	SVC001716	08/11/2016	1H0109	184_INT	R	Brake	1ME737	13196 HR	CHECK BRAKE AND TRANSMISSION	TRAVELLED TO IMPACT, INSPECT REPORTED OVER HEATING FAULT, FOUND TRANSMISSION TO BE OVER FILLED, DRAINED 70 LITRES OUT TO BRING BACK TO CORRECT LEVEL, OPERATOR ADVISED MECHANIC HE FILLED THE TRANSMISSION AND CLEANED AROUND BRAKE PEDAL, TEST RUN UNIT AND SEND BACK TO WORK	419.48	0	0	37.5	456.98
160721-00	SVC001721	08/11/2016	1H0109	184_INT	R	Brake	1ME737	13196 HR	CHECK BRAKE AND TRANSMISSION	UNIT 1ME737 ODOMETER 13196H TRAVELLED TO IMPACT FOR REPORTED OVER HEATING FAULT, FOUND TRANSMISSION TO BE OVERFILLED, DRAINED 70 LITRES OUT TO BRING BACK TO CORRECT LEVEL, THE OPERATOR ADVISED THE MECHANIC THAT HE FILLED THE TRANSMISSION AND CLEANED AROUND THE BRAKE PEDAL, TEST RUN UNIT AND SEND BACK TO WORK.	341.25	0	0	22	363.25
160725-00	SVC001717	08/03/2016	1H0109	184_INT	R	Hydraulic	1ME737	13228 hr	REPLACE CRACKED HYDRAULIC TUBE	REPLACE CRACKED HYDRAULIC TUBE LIFT CAB , REMOVE CRACKED STEEL TUBE ON AMPLIFIER VALE AND REPLACE WITH NEW TUBE REMOVE AND REPLACE LEAKING HYDRAULIC HOSES AT PUMPS REMOVE, RESEAL AND REFIT DIVERTER BLOCKS REMOVE CRACKED VALVE BLOCK FROM PUMP HAVE REPAIRED AND REFIT TEST RUN UNIT TO CHECK FOR FURTHER LEAKS FOUND OK LOWER CAB AND SECURE TOP UP HYDRAULIC OIL	912.98	601.33	269.49	45	1828.8
160725-00	SVC001716	08/03/2016	1H0109	184_INT	S	Service	1ME737	13228 KM	S1 D SERVICE	CARRIED OUT THE REQUIRED "D" SERVICE AND SAFETY INSPECTIONS AS PER SERVICE SCHEDULE	1968.77	2157.14	0	50	4175.91
160718-01	SVC001714	07/25/2016	1H0109	184_INT	R	Electrical	1ME737	13181 HR	CHECK REPORTED FAULT CODE	TRAVELLED TO IMPACT, CHECKED REPORTED CODE ON DASH, FOUND CODE ACTIVATED 2 HRS BEFORE REPORTED, CLEAR CODE AND CHECKED ALL OK	78.75	0	0	5.5	84.25
160711-00	SVC001714	07/21/2016	1H0109	105_HBGN	R	Air Con	1ME737	13089HRS	CALL OUT - A/C FAULTS	1ME737 ODOMETER - 13089 HOURS JOB CARRIED OUT - CALL OUT - FOUND CONDENSOR BLOCKED AND DAMAGED. EVAPORATOR BLOCKED RESTRICTING AIR FLOW TO VENTS. CLEAN CONDENSOR, PARTS NEED TO BE ORDERED.	351.75	0	0	66	417.75
160701-00	SVC001706	07/13/2016	1H0109	186_INT	R	Hydraulic	1ME737	13016 HR	REPAIR OIL LEAK UNDER CAB	RAISE CAB AND INSPECT FOR OIL LEAK, FOUND STEERING AMPLIFIER VALVE LEAKING, REMOVE AND RESEAL VALVE, REMOVED AND REPLACED HOSE TO LIFT CYLINDER IN ARTIC AREA, CLEAN RADIATOR, AFTER COOLER AND AIR CON CORES, GREASE MACHINE, TOPPED UP ALL OIL LEVELS AND RETURN UNIT TO WORK	1204.89	477.77	301.51	50	2034.17
160707-00	SVC001707	07/13/2016	1H0109	184_INT	R	Electrical	1ME737	13056 HR	REPLACE REVOLVING LIGHT	CHECKED ROTATING LIGHT NOT WORKING, FOUND TO BE U/S, REPLACED LIGHT ASSY AND TEST OK, CHECKED UHF ANTENNA CONNECTION MISSING, FOUND CABLE TO BEEN RIPPED OFF, FITTED NEW CONNECTION AND REPLACED FAULTY UHF MOUNT.	78.75	23.86	0	0	102.61

160624-00\	SVC00170\	06/28/2016	1H0109	181_INT	R	Sundries	1ME737		PAINT NEW TAILGATE	136.5	20.08	0	10	166.58	
160331-00\	SVC00165\	06/23/2016	1H0109	184_INT	R	Hydraulic	1ME737	12258	RESEAL BOTH STEER CYLINDERS	TRAVELLED TO IMPACT, RESEALED BOTH STEER CYLINDERS	593.25	234.36	0	40.5	868.11
160603-00\	SVC00169\	06/16/2016	1H0109	184_INT	R	Tyres	1ME737		SUPPLY 4 X TYRES	SUPPLY AND FIT 4 TYRES AS REQUIRED BY PAUL KELLEHER	0	10806.12	560	0	11366.12
160516-00\	SVC00166\	06/07/2016	1H0109	184FIELDSIB		Bodywork	1ME737	12799	CALL OUT - IMPACT DAMAGE BENT	UNIT 1ME737 ODOMETER 12799	420	0	0	77	497
										CALLOUT 12/05/2016 TO TAILGATE DAMAGED BY IMPACT OPERATOR TRAVEL TO SITE STRAIGHTEN TAIL BOARD ON UNIT AS GOOD AS POSSIBLE TO ALLOW UNIT TO RETURN TO WORK, FURTHER REPAQIRS WILL BE REQUIRED.					
160520-00\	SVC00168\	06/07/2016	1H0109	184_INT	R	Trays/Bucks	1ME737	12877 hr	STRAIGHTEN TAIL BOARD ARMS	UNIT 1ME737 ODOMETER 12877 HOURS	558.6	0	0	16.51	575.11
										TRAVEL TO IMPACT FERTILISERS AND REMOVE SIDE ARM FOR TAIL BOARD RETURN TO LA AND STRAIGHTEN ARM UNDER PRESS, RETURN TO UNIT AND REFIT ARM AND ADJUST TO FIT CORRECTLY					
160524-00\	SVC00166\	06/06/2016	1H0109	184_INT	S	Service	1ME737	12903 HR	S1 A SERVICE	CARRIED OUT S1 A SERVICE AS PER SERVICE SHEET.	275.63	174.51	0	19	469.14
160324-00\	SVC00161\	05/30/2016	1H0109	184_INT	R	Hydraulic	1ME737	12192	REPLACE LEAKING HYDRAULIC HOSE	TRAVELLED TO IMPACT, LIFTED CAB TO REPLACE LEAKING HOSES, TEST ALL OK, LOWER CAB, CHECKED TAILGATE RUBBER ETC AS REQUIRED	812.71	136	0	68	1016.71
160511-00\	SVC00167\	05/23/2016	1H0109	184FIELDSIB		Electrical	1ME737	127780hr	REPAIR EO1 CODE	UNIT 1ME737 ODOMETER 12780H	78.75	0	0	5.5	84.25
										TRAVELLED TO IMPACT, CHECKED FAULT CODE ON DASH, FOUND CODE DGR3L8 PRESENT, CHECKED BRAKE TEMPERATURE ON CENTRE AXLE AND FOUND TO BE HOT, REMOVED FLOOR MAT AND CLEANED DIRT FROM UNDER BRAKE PEDAL, CAUSING BRAKES TO STICK ON, ERASED CODE AND TEST OK.					
160429-00\	SVC00167\	05/17/2016	1H0109	184_INT	R	Electrical	1ME737	12640	REPLACE FAULTY STARTER MOTOR	TRAVELLED TO IMPACT, REMOVED AND REPLACED STARTER MOTOR DUE TO BEING FAULTY	157.51	960.03	0	13.5	1131.04
160516-00\	SVC00168\	05/16/2016	1H0109	184_INT	R	Electrical	1ME737	12780	REPAIR HEADLIGHT FAULT & WIPER	TRAVELLED TO IMPACT, REPAIRED HEADLIGHT WIRING AND REPLACED GLOBE AS REQUIRED, REPLACED WIPER BLADES AS REQUIRED.	196.88	39.97	0	21	257.85
160429-00\	SVC00167\	05/04/2016	1H0109	184_INT	B	Electrical	1ME737	12602 HR	REPAIR DERATE FAULT	REPAIR DERATE FAULT CHECK FAULT CODE ON DASH FOUND TO BE BRAKE OIL TEMP SENSOR ALARM FAULT CAUSED BY BRAKES PARTLY ACTIVATED BY BUILD UP OF MATERIAL UNDER BRAKE PEDAL CLEANED MATERIAL FROM UNDER PEDAL CLEARED CODE ON DASH AND RETESTED OK	118.13	0	0	16	134.13
160415-00\	SVC00166\	04/27/2016	1H0109	184_INT	S	Service	1ME737	12467	S1 B SERVICE	TRAVELLED TO IMPACT, CARRIED OUT SERVICE AS PER SCHEDULE, UNSEIZE TRAY SAFETY PINS, FIT PRE CLEANER TAKEN FROMN M645, FIT TOP HAT TO M645	519.23	737.87	0	42	1299.1
160420-00\	SVC00166\	04/27/2016	1H0109	184_INT	R	Electrical	1ME737	12481 HR	JUMP START (CALL OUT)	CALL OUT TO IMPACT TO JUMP START UNIT AND CHECK CHARGE RATE	129.15	0	0	33	162.15

160414-00	SVC00166	04/20/2016	1H0109	184_INT	R	Electrical	1ME737	12432 HRS	REPLACE HEADLIGHT GLOBE	TRAVEL TO IMPACT, REPLACED THE HEAD LIGHT GLOBE, REMOVE WINDOW COVERS AND PUT ALL THE WAY UP, DISCONNECT SWITCH. CHECK OVER UNIT	118.13	18.48	0	16.5	153.11
160330-00	SVC00165	04/08/2016	1H0109	105	R	Electrical	1ME737		REPAIR HEADLIGHTS	LOCATE AND REPAIRED BURNT PLUG TO HEAD LIGHTS, CHANGE HEAD LIGHT GLOBES, TEST OPERATION ALL GOOD.	68.25	18.48	0	0	86.73
160330-00	SVC00165	04/08/2016	1H0109	105	R	Hydraulic	1ME737		C/OUT, CRACKED HYD PIPE FLANGE	TRAVEL TO NYRSTAR AND DIAGNOSE HYDRAULIC OIL LEAK, FOUND TO BE COMING FROM TOP OF HYD PUMP, REMOVED HOSE FLANGE AND CLAMPS, REPLACED DAMAGED O-RING THEN FOUND TO BE LEAKING FROM FLANGE WELD, WELD HOLE IN FLANGE AND TEST OPERATION ALL GOOD,, LOWER CAB AND CLEAN OFF MACHINE	409.5	72.6	417.27	0	899.37
160329-00	SVC00165	04/05/2016	1H0109	184_INT	R	Hydraulic	1ME737	12201	REPAIR OIL LEAK UNDER CAB	TRAVELLED TO NYRSTAR, LIFT CAB, FIND OIL LEAK, REMOVE HOSE AND PIPING, REWELD CRACKED PIPE AND REFIT, REPLACED CONNECTOR FOR LH HEADLIGHT EATEN AWAY BY PRODUCT, TOPPED UP HYD OIL.	562.28	76.4	0	61	699.68
160309-00	SVC00164	03/16/2016	1H0109	184_INT	R	Bodywork	1ME737	12080	REPAIR DOOR HINGE AND WINDOW R	TRAVELLED TO IMPACT, REMOVED DOOR AND DAMAGED HINGE, MACHINE NEW HINGE, REMOVED ELECTRIC WINDOW MECHANISM AND ORDER REPLACEMENT PARTS. REASSEMBLED WINDOW WITH NEW REGULATOR AND DOOR TO WORKING ORDER, TRAVELLED TO IMPACT.	927.69	368	0	68	1363.69
160229-00	SVC00164	03/08/2016	1H0109	184_INT	R	Electrical	1ME737	12006 HRS	REPLACE REVOLVING LIGHT	REPLACED REVOLVING LIGHT AS REQUIRED.	157.5	19.8	0	8	185.3
160219-00	SVC00163	02/29/2016	1H0109	184_INT	R	Hydraulic	1ME737	11941	REPAIR HYDRAULIC OIL LEAK	TRAVEL TO IMPACT, TOP UP HYDRAULIC OIL AND INSPECT FOR LEAK UNDER THE CAB, LIFT CAB AND REMOVED LEAKING VALVE, REMOVED CRACKED EXHAUST AND ORDER REPLACEMENT PARTS, REPAIR AND REFIT LEAKING HYDRAULIC VALVE,REPAIRS TO EXHAUST, RELAY, REFIT TO TRACK TOP UP HYDRAULIC OIL AND TEST OPERATION, LOWER CAB. LIFT CAB AND PROP UP, LOWER CAB BOLT UP AND CLEAN UP, PICK UP VALVE CLEAN UP VALVE MOUNT, REPLACE O-RINGS, FIT NEWLY REPAIRD VALVE, PICK UP EXHAUST FLEX AND DROP OFF FOR REPAIR WELDING SHOP.	1608.09	1349.08	0	33	2990.17
160223-00	SVC00163	02/27/2016	1H0109	184_INT	R	Electrical	1ME737	11981	INSPECT REVERSE CAMERA FAULT	ONSITE AT IMPACT, CHECK REVERSE CAMERA NOT OPERATING, FOUND TO HAVE DAMAGED CABLE IN ARTICULATION ON MACHINE, REPAIR WIRING AND TEST OPERATION ALL GOOD	157.5	0	0	7.5	165
160218-00	SVC00163	02/24/2016	1H0109	184_INT	S	Service	1ME737	11938	S1 A SERVICE	TRAVELLED TO IMPACT, CARRIED OUT S1 A SERVICE AS PER SHEET. REPLACED TRANSMISSION OIL. REPAIRED FAULTY LIGHTS. PARTS BOOKED TO PREVIOUS JOB	401.1	232.8	0	41	674.9

160122-00	SVC001625	02/17/2016	1H0109	105_HBGN	R	Hydraulic	1ME737	11559HRS	CALL OUT - ARTIC HYD HOSE	1ME737	78.75	0	1008.59	0	1087.34
										ODOMETER - 11559 HOURS					
										JOB CARRIED OUT - CALL OUT - FAILED HYDRAULIC HOSE IN ARTICULATING AREA. ARRANGED ENZED TO REPAIR ON SITE AFTER HOURS.					
160128-00	SVC001627	02/17/2016	1H0109	105	R	Sundries	1ME737		DELIVER MACHINES TO IMPACT	JOB CARRIED OUT - DELIVER HM300'S TO IMPACT FERTILISERS, READY FOR SHIPPING.	204.76	0	0	0	204.76
160128-00	SVC001627	02/17/2016	1H0109	105	R	Steering	1ME737		ADJUST/REPAIR STEERING COLUMB	1ME737	68.26	0	0	0	68.26
										JOB CARRIED OUT - TIGHTENED ADJUSTING BOLT IN STEERING COLUMN.					
160128-00	SVC001625	01/29/2016	1H0109	184_INT	R	Trays/Buck	1ME737	11665	CLEAN OUT & REPAIR TRAY SEAL	TRAVEL TO IMPACT, CLEAN OUT THE REAR OF TRAY, REMOVE AND REPLACED DAMAGED TAIL GATE SCD, CLEAN UP THE TRUCK	537.61	0	0	43.5	581.11
160104-00	SVC001615	01/28/2016	1H0109	184_INT	R	Hydraulic	1ME737	11414	CALL OUT - HYD LEAK UNDER CAB	CALL OUT TO IMPACT, INSPECT OIL LEAK UNDER CAB, LIFT CAB, REMOVED LEAKING CRACKED VALVE, PREP AND RE WELD, REASSEMBLED LOWER CAB, TOPPED UP HYD OIL AND TEST OPERATION.	577.5	0	720	240.2	1537.7
160119-00	SVC001625	01/28/2016	1H0109	184_INT	R	Trays/Buck	1ME737	11548	REPAIR BENT TAILGATE	REPAIR BENT TAILGATE	1410.16	55	0	50	1515.16
160128-00	SVC001625	01/28/2016	1H0109	184_INT	R	Air Con	1ME737	11665	CHECK AIR CON OPERATION	TRAVELLED TO IMPACT FERTILISERS, CHECKED AIR CON OPERATION, FOUND AC SWITCH TO BE TURNED OFF, CHECKED PRESSURES ALL OK, CHECKED CAB FILTERS - REQUIRE REPLACING	340.73	0	0	28	368.73
160121-00	SVC001624	01/27/2016	1H0109	184_INT	R	Hydraulic	1ME737	11549	REPLACE LEAKING HYD HOSE	REMOVE LEAKING HYD HOSE AND REFIT WITH NEW HOSE FABRICATED BY HARDY SPICER	211.58	0	642.09	10.5	864.17
160121-00	SVC001624	01/27/2016	1H0109	182_INT	R	Lathe	1ME737		MACHINE PINS & SPACERS FOR TAI	MACHINE PINS & SPACERS FOR TAILGATE PIVOT	204.75	30.74	0	10	245.49
160105-00	SVC001617	01/19/2016	1H0109	184_INT	R	Electrical	1ME737	11426	REPLACE ALTERNATOR BELTS	TRAVEL TO IMPACT, CHECKED ALTERNATOR BELTS AND REPLACED AS REQUIRED.	322.35	75.19	0	27	424.54
160106-00	SVC001617	01/13/2016	1H0109	184_INT	S	Service	1ME737	11426 HRS	S1 C SERVICE	TRAVELLED TO IMPACT, CARRIED OUT S1 C SERVICE AS PER SERVICE SHEET.	469.36	1579.63	0	39.5	2088.49
151130-01	SVC001602	12/15/2015	1H0109	105	R	Engine	1ME737		DIAGNOSE LOW POWER FAULTS	1ME737	136.5	0	0	0	136.5
										JOB CARRIED OUT - DIAGNOSE LOW POWER FAULTS. TEST RETARDER AND SERVICE BRAKE OPERATION, WHICH TESTED OK. PARK BRAKE WORKING OK. FAULT FOUND TO BE PRODUCT BUILD UP UNDER PEDAL.					
151210-00	SVC001607	12/15/2015	1H0109	184_INT	R	Electrical	1ME737	11213	Repair headlight fault	TRAVELLED TO IMPACT, REPLACED HEADLIGHT GLOBES, CHECKED WINDOW FAULT AND FOUND COG ON MECHANISM TO BE STRIPPED OUT.	78.75	8.95	0	5.5	93.2
151117-00	SVC001595	11/30/2015	1H0109	184_INT	R	Hydraulic	1ME737	10937	REPLACE LEAKING BRAKE LINE	TRAVELLED TO IMPACT, REPLACED LEAKING LHM BREAK HOSE AND TOPPED UP TRANSMISSION OIL.	200.55	0	91.22	21	312.77
151113-00	SVC001557	11/23/2015	1H0109	184_INT	R	Electrical	1ME737	10876	REPAIR BLOWN WORK & HEADLIGHTS	Travel to Impact and replaced blown light globes, topped up engine oil and gave a general check over, unable to find the reported E01 fault code	118.13	0	0	21	139.13

151012-00	SVC00157	11/11/2015	1H0109	184_INT	R	Electrical	1ME737	10792	FIT UP REVERSE CAMERA	REMOVE REVERSE CAMERA FROM 1ME648 FIT UP REVERSE CAMERA AND WORK/REVERSE LIGHTS ON MIRROR BRACKETS TO 1ME737 FOR IMPACT (CAMERA REMOVED FROM 1ME648, CAMERA OWNED BY IMPACT)	2012.35	102.12	0	50	2164.47
151029-00	SVC00158	11/09/2015	1H0109	186_INT	R	Trays/Buck	1ME737	10835 hr	REMOVE AND STRAIGHTER TAIL BOA	REMOVE AND STRAIGHTER TAIL BOARD REMOVE TAIL BOARD STRAIGHTEN SIDE ARMS AND REFIT TO MACHINE	682.51	0	0	30	712.51
151013-00	SVC00158	10/20/2015	1H0109	186_INT	R	Tyres	1ME737		STRIP AND FIT TYRES FROM	STRIP AND FIT 6 TYRES	0	90	480	0	570
151001-00	SVC00157	10/07/2015	1H0103	184_INT	R	Sundries	1ME737	10770	PRE OUTLOAD INSPECTION	TRAVEL TO NYRSTAR AND CHECK OVER UNIT, TOP UP COOLANT	39.38	0	0	5.5	44.88
150930-00	SVC00157	09/30/2015	1H0103	105	R	Sundries	1ME737	10770HRS	PMI - CLEAN WINDOWS	1ME737	34.13	0	0	0	34.13
										ODOMETER - 10770 HOURS					
										JOB CARRIED OUT - CLEAN SUPER PHOSPHATE OFF WINDSCREEN.					
150903-00	SVC00156	09/16/2015	1H0103	184_INT	R	Engine	1ME737	10757	REPLACE WORN INTER COOLER HOSE	TRAVELLED TO IMPACT AND REPLACED BLOWN RH SIDE INTERCOOLER HOSE	59.06	478.29	0	11	548.35
150825-00	SVC00155	09/10/2015	1H0103	184_INT	S	Service	1ME737	10757	S1 A SERVICE	TRAVELLED TO IMPACT AND COMPLETED THE REQUIRED SERVICE AND SAFETY CHECKS AS PER SERVICE SCHEDULE, ADJUSTED ALL BELTS.	334.69	266.15	0	33	633.84
150811-00	SVC00154	08/27/2015	1H0103	105	R	Engine	1ME737		REPAIR EXHAUST LEAK	1ME737	976.51	76.12	0	22	1074.63
										JOB CARRIED OUT - DIAGNOSE EXHAUST LEAK. REMOVED CAB MOUNTING BOLTS TO TILT CAB FOR REPAIRS. REMOVED FAILED EXHAUST FOR WELDING. REMOVED BROKEN BOLT. REPAIRED BROKEN FLANGE.					
150820-00	SVC00155	08/27/2015	1H0103	105_HBGN	R	Sundries	1ME737	10686HR	COMPLETE PMI'S	1ME737	112.88	0	0	0	112.88
										ODOMETER - 10465 HOURS					
150805-00	SVC00154	08/12/2015	1H0103	105	R	Sundries	1ME737	10621	PRESSURE WASH RADIATOR AND PMI	JOB CARRIED OUT - COMPLETE PMI TO UNIT. 1ME737	307.13	0	0	0	307.13
										ODOMETER - 10621					
										JOB CARRIED OUT - PMI INSPECTION, STEAM CLEAN RADIATOR CORES. GREASE MACHINE. CLEAN WINDOW AND MAKE OPERATIONAL.					
150617-00	SVC00152	06/30/2015	1H0103	182_INT	R	Lathe	1ME737		MACHINE 2 SOLID TAILGATE PIVOT	MACHINE 2 SOLID TAILGATE PIVOT PINS	392.44	215.15	0	19	626.59
150629-00	SVC00152	06/30/2015	1H0103	184_INT	R	Trays/Buck	1ME737	10579	REPLACE TAILGATE PIVOT PINS	TRAVELED TO NYSTAR TO REMOVE AND REPLACE TAILGATE PINS WITH ONE PIECE PINS (PARTS SUPPLIED BY MACHINE SHOP)	472.5	0	0	42	514.5

150624-00\	SVC001523	06/25/2015	1H0103	105	R	Sundries	1ME737		REPLACE BROKEN UHF AERIAL	1ME737	68.25	18	0	0	86.25
										JOB CARRIED OUT - RESOLDER AERIAL LEAD INTO BASE, FIT NEW AERIAL.					
150529-00\	SVC001512	05/29/2015	1H0103	184_INT	R	Engine	1ME737	10521	REPAIR ENGINE OIL LEAK	INSPECT ENGINE OIL LEAK, FOUND AND TIGHTENED LOOSE OIL FILTER, CLEANED UP OIL AND TESTED FOR LEAKS	39.38	3.48	0	0	42.86
150519-00\	SVC001503	05/27/2015	1H0103	184_INT	R	Hydraulic	1ME737	10494	REPLACE LEAKING BRAKE PIPE CEN	TRAVELLED TO IMPACT X 2 REMOVED LEAKING BRAKE PIPE FROM UNIT AND LOCATE LEAK, FABRICATE HOSE AND FIT TO UNIT, BLEED BRAKES AND TEST OPERATION.	397.44	19.96	0	63	480.4
150511-00\	SVC001501	05/14/2015	1H0103	186_INT	S	Service	1ME737	10465 HR	S1 B SERVICE	CHECK TAIL GATE NOT CLOSING, FOUND TRAY BACK PACKED WITH DIRT, CLEAN OUT TRAY WITH DIGGER, CLEAN UP WASH BAY,CARRIED OUT S1 B SERVICE AS PER SCHEDULE, DRAINED AND REFILLED ENG OIL, REPLACED OIL FILTER AND FUEL SEDIMENT FILTER, CHECKED ALL LEVELS AND TAKE 12 COMPARTMENT OIL SAMPLES, GREASED ALL LUBE POINTS, REPLACED GREASE NIPPLES ON REAR SUSPENSION STRUTS, TIGHTEN CENTRE DIFF DOGBONE MOUNTING BOLTS, REPAIRED RIGHT REAR WORK LIGHT, UNBLOCKED FRONT AND REAR SCREEN WASHER NOZZLES, REPLACED WIPER BLADES, REPAIRED LOOSE A/C VENTS, CHECKED HOIST FAULT, FOUND TO BE OPERATING AT TIME OF INSPECTION.	583.29	658.54	0	34	1275.83
150511-00\	SVC001501	05/14/2015	1H0103	186_INT	R	Bodywork	1ME737	10465 HR	REPAIR WINDOW FAULT REPAIR OI	REMOVED REAR OPERATOR CAB WINDOW PROTECTOR TRY TO CLEAN WINDOW, REMOVED OPERATORS CAB DOOR FACIA, CHECKED WINDOW POWER MOTOR, REMOVED POWER WINDOW MECHANISM, REPAIRED BROKEN MOTOR MOUNT AND REFITTED TO DOOR, ADJUST AND CHECK OPERATION, CLEANED CAB WINDOWS AND FIT REAR CAB PROTECTOR	583.29	134.09	0	29	746.38
150504-00\	SVC001497	05/05/2015	1H0103	184_INT	R	Hydraulic	1ME737	NOT SUPPL	Replace hydraulic hose	REPLACED BLOWN HOSE AS REQUESTED, TEST OPERATION ALL OK. WORK COMPLETED BY PIRTEK LAUNCESTON	0	0	1467.18	0	1467.18
150319-00\	SVC001472	03/30/2015	1H0103	184_INT	S	Service	1ME737	10270	S1 A SERVICE	TRAVELLED TO KEMPTON, CARRIED OUT S1 A SERVICE AS PER SCHEDULE	315	266.73	0	101.5	683.23
150310-00\	SVC001468	03/17/2015	1H0103	186_INT	R	Air Con	1ME737	NOT SUPPL	REPLACE AIR CON FILTERS	REPLACE AIR CON FILTERS - PART ONLY	0	195.91	0	0	195.91
150306-00\	SVC001467	03/12/2015	1H0103	184_INT	R	Sundries	1ME737	10108	PRE IMPACT INLOAD INSPECTION	TRAVEL TO IMPACT, CHECKED TAILGATE SEAL, GREASE MACHINE, INSPECTED AND TOPPED UP FLUIDS, CLEAN AIR FILTER	157.5	90.08	0	19	266.58
140926-00\	SVC001386	02/13/2015	1H0103	186_INT	R	Bodywork	1ME737	9860 HR	REPAIR CAB DOORS AND WINDOWS	REMOVED OPERATORS CAB DOOR FACIA, REMOVED WINDOW AND REPAIRED, REASSEMBLED WINDOW AND ADJUST, REPLACED WINDOW FRAME CHANNEL	1399.13	0	0	50	1449.13
150105-00\	SVC001438	01/14/2015	1H0103	105_HBGN	R	Bodywork	1ME737		Replace Broken Mirrors	1ME737	68.25	204.62	0	0	272.87
										JOB CARRIED OUT - REMOVE OLD MIRROR, MODIFY MOUNTS TO NEW MIRROR AND FIT.					

141110-00	SVC001407	11/13/2014	1H0103	184_INT	R	Tyres	1ME737	9870	CALL OUT - RETENSION WHEELS	TRAVEL TO NYRSTAR, RETENSION WHEEL NUTS ON FRONT AND REAR AXLE, TOPPED UP HYD OIL	105	54.45	0	16	175.45
140819-00	SVC001376	10/31/2014	1H0103	186_INT	R	Brake	1ME737	9860	CHECK TRANSMISSION SHIFT FAULT	CHECKED TRANSMISSION SHIFT FAULT, REPLACED FAULTY BRAKE LIGHT SWITCH	204.75	263.82	0	10	478.57
140908-00	SVC001375	10/31/2014	1H0103	186_INT	R	Trays/Buck	1ME737	9860	CHECK AND REPAIR TRAY PIVOT PO	CHECK AND REPAIR TRAY PIVOT POINTS TRAY NOT SITTING ON CHASSIS PROPERLY: MOVE MACHINE INTO WORKSHOP AND SET UP, CHECKED MOVEMENT IN TRAY PIVOT BUSHES, REMOVE PINS AND LIFT AND SUPPORT TRAY FOR MACHINING, ORDER PARTS FOR REPAIR, FIT NEW TRAY PIVOT BUSHES TO CHASSIS USING LIQUID NITROGEN, FIT NEW SEALS, LOWER TRAY AND CONNECT PINS, SHIM TO SPEC, REMOVE LH TOP LIFT CYL PIN, REMOVE LINER BEARING, CLEAN UP SURFACE AREAS, CLEAN L & R TOP PIN BOSSES AND MEASURE, FIT NEW SPHERICAL BEARING TO LH LIFT CYL BOSS, FIT LH LIFT CYL AND CONNECT TO TRAY, REMOVE TRAY PADS, CLEAN AND STRAIGHTEN MOUNTS, MEASURE CORRECT TRAY HEIGHT, FIT 2 NEW TRAY PADS TO FRONT OF TRAY, SHIM HEIGHTS.	3269.72	2251.88	0	50	5571.6
141014-00	SVC001394	10/31/2014	1H0103	186_INT	R	Air Con	1ME737	9862	CLEAN OUT INTERCOOLER	REMOVE CONDENSOR, DISCONNECT INTERCOOLER PIPES, REMOVE INTERCOOLER FOR CLEANING, FOUND ENG OIL IN COOLER AND INTAKE HOSES, REMOVE FEE PIPES FROM TURBO, CHECK SHAFT ON TURBO PLAY, MEASURE WITHIN SPEC, FIT UP INTERCOOLER, CHECK AND TENSION FEED HOSE CLAMPS, DEGAS AC, LIFT AND SUPPORT LHF OF MACHINE, REMOVE WHEEL ASSEMBLY AND FIT TO LHR DRIVE, FIT NEW TYRE AND WHEEL ASSEMBLY TO FRONT, LOWER LEFT FRONT TO GROUND, JACK UP AND SUPPORT RH FRONT, REMOVE WHEEL ASSEMBLY AND FIT TO RIGHT REAR, FIT NEW TYRE AND WHEEL ASSEMBLY TO RIGHT FRONT, LOWER MACHINE TO GROUND, MODIFIED AIR CON, CONDENSOR BRACKET TO FIT NEW UNIT, REMOVE RECEIVER DRYER AND MOUNTING BRACKET, MODIFIED MOUNTING BRACKET TO FIT NEW UNIT, FIT TO MACHINE, EVAC AC SYSTEM AND REGAS, CHECK OPERATION, OPERATING TEMP 4.5 DEG	1613.34	1290.06	100	125	3128.4
141024-00	SVC001395	10/28/2014	1H0103	121ADMIN	R	Tyres	1ME737	9860	REPLACE TWO TYRES AEOLUS 23.5R	REPLACE TWO TYRES AEOLUS 23.5R25 AL37 + ORING AS PER PAUL KELLEHER	0	4430	0	0	4430
141013-00	SVC001395	10/27/2014	1H0103	186_INT	R	Differential	1ME737	9860 HR	RESEAL CENTRE AXLE COVERS	RESEAL CENTRE AXLE COVERS DRAIN BOTH FINAL DRIVES AND REMOVE AXLE COVERS REMOVE AND REPLACE SEALING O RINGS AND REFIT COVERS REFILL WITH OIL AND TEST FOR LEAKS	753.91	63.04	0	37	853.95

140911-00	SVC00137	10/20/2014	1H0103	182_INT	R	Line Boring	1ME737		LINEBORE TRAY PIVOT EARS & BUS	LINEBORE TRAY PIVOT EARS & BUSHING BORES (BUSH LOOSE & WALKING OUT), LINEBORE HOIST CYLINDER MOUNTS ON TRAY	4109.19	0	0	50	4159.19
141006-00	SVC00138	10/20/2014	1H0103	182_INT	R	Sundries	1ME737		REMOVE & STRAIGHTEN TAILGATE A	REMOVE & STRAIGHTEN TAILGATE ARMS	1296.75	0	0	50	1346.75
140910-00	SVC00138	09/26/2014	1H0103	186_INT	S	Service	1ME737	9860 HR	S1 D SERVICE	COMPLETED D SERVICE AS PER SERVICE SCHEDULE	1169.71	1459.44	0	53.5	2682.65
140827-00	SVC00136	08/27/2014	1H0103	105_HBGN	R	Bodywork	1ME737	9844	INSPECT DMG TAIL GATE	CHECK UNIT OVER WITH TAIL GATE DAMAGE	68.25	0	0	0	68.25
140819-00	SVC00136	08/19/2014	1H0103	105	R	Sundries	1ME737		IMPACT INSPECTIONS	1ME737	102.38	0	0	0	102.38
140703-00	SVC00135	07/31/2014	1H0103	184_INT	R	Electrical	1ME737	9677 HR	REPLACE R/HAND HEAD LIGHT GLOB	TRAVEL TO PIPELINE, REPLACE R/HAND HEAD LIGHT GLOBE	78.75	22.75	0	22	123.5
140612-00	SVC00132	06/17/2014	1H0103	184_INT	S	Service	1ME737	9659	S1 B SERVICE	TRAVEL TO TEA TEA TREE, CARRIED OUT S1 B SERVICE AS PER SERVICE SCHEDULE.	525	690.83	0	106.3	1322.13
140526-00	SVC00131	05/28/2014	1H0103	184_INT	R	Trays/Buck	1ME737	9530	INSPECT PIN NOISE & GREASE	TRAVELLED TO PIPELINE, INSPECT PIN NOISE & GREASE TRAY PINS ETC	78.75	0	0	38.4	117.15
140505-01	SVC00130	05/09/2014	1H0103	105_HBGN	R	Electrical	1ME737		REPLACE LED FLASHING LIGHT	1ME737	68.25	0	0	0	68.25
140327-00	SVC00128	03/29/2014	1H0103	184_INT	R	Electrical	1ME737	9370	REPAIR SEAT SUSPENSION FAULT	JOB CARRIED OUT - FIT UP BEACON LIGHT. TRAVELLED TO IMPACT AND CHECKED SEAT OPERATION, REMOVE AND REPLACED U/S SEAT SWITCH AS REQUIRED	150	0	0	67.1	217.1
140311-01	SVC00127	03/19/2014	1H0103	184_INT	S	Service	1ME737	9355	S1 B - 500 HR SERVICE	TRAVEL TO NYRSTAR, CARRY OUT S1 B - 500 HR SERVICE. ***OIL FILTER WAS OLD EX COTTER DAM STOCK THAT WAS UNOPENED ***FILTER NOT CHARGED OUT.	341	652.98	0	30.1	1024.08
140218-00	SVC00125	03/12/2014	1H0103	184_INT	R	Trays/Buck	1ME737	9295	WELD UP DRAIN HOLE IN TRAY	TRAVEL TO NYRSTAR, WELD UP DRAIN HOLE AS REQUIRED.	157	33.72	0	22.4	213.12
140307-00	SVC00127	03/12/2014	1H0103	105	R	Engine	1ME737	9355	PRESSURE CLEAN COOLING CORES	1ME737	97.5	0	0	0	97.5
										ODOMETER - 9355 HOURS					
										JOB CARRIED OUT - PRESSURE CLEAN COOLING CORES DUE TO PRODUCT BUILD UP. CARRY OUT PREVENTATIVE MAINTENANCE INSPECTION.					
140129-00	SVC00124	02/12/2014	1H0103	184_INT	R	Hydraulic	1ME737	9284	REPAIR LEAKING STEER CYLINDER	TRAVEL TO IMPACT, REPAIR LEAKING STEER CYLINDER AS REQUIRED.	525	1243.28	0	35.6	1803.88

131204-01	SVC001222	12/19/2013	1H0103	184_INT	R	Electrical	1ME737	9147	REPAIR DIFF LOCK FAULT	TRAVEL TO IMPACT. CHECK WIRING FOR DIFF LOCK AS REQUIRED. TRAVEL TO KOMATSU TO PICK UP SPEED SENSOR. FIT TO MACHINE AND CLEAR FAULT CODES AND TEST. HAVE KOMATSU MECHANIC CHECK MACHINE FOR TRANSMISSION SHIFT FAULT AND RETARDER COMING ONSTART TO CARRY OUT TRANSMISSION TUNE UNIT UNIT STARTED WORKING OK SO PUT BACK TO WORK ON LOAD OUT UNIT LATER STARTED PLAYING UP AGAIN MECHANIC RETURNED TO MACHINE AND NOTICED TAGGED OUT BUT BRAKE LIGHTS ON FOUND FAULT IN BRAKE LIGHT SWITCHES CAUSING PROBLEM DISCONNECT WIRING TO SWITCHES AND FAULT DISAPPEARED REPLACED SWITCHES LATER WHEN BRAKE LIGHTS ARE ON TRANSMISSION WILL NOT SHIFT ABOVE 3RD AND RETARDER WILL COME ON AUTOMATTICALY KOMATSU'S INVOICE DESCRIPTION, TRAVEL TO JOB SITE AND INVESTIGATE TRANSMISSION FAULT (TRANS HOLDING, GEARS NOT SHIFTING AT CORRECT TIME). HAZELL BROS HAD RECENTLY FITTED A SPEED SENSOR FOR TRANSMISSION. CARRY OUT FIRST STAGE FOR TRANS TUNE TO CALIBRATE SPEED SENSOR. MADE NO DIFFERENCE TO PERFORMANCE. REQUESTED TO CHECK THE TRANSMISSION SUCTION SCREEN BUT WAS INFORMED THAT IT WAS SERVICED RECENTLY. RETURN TRAVEL TO WORKSHOP TO AWAIT INSTRUCTION ON	787.5	245.68	1308.62	38.4	2380.2
131202-00	SVC001221	12/18/2013	1H0103	186_INT	R	Electrical	1ME737	9123 HRS	CALL OUT- DIFF LOCK FAULT CODE	CALL OUT TO IMPACT FERTILISER. DIFF LOCK LIGHT SHOWING ON DASH. DOWNLOAD FAULTS. TRACE FAULT TO OPEN CIRCUIT AT DIFF LOCK SENSOR. REPAIR AND TEST OK.	400	0	0	10	410
131203-00	SVC001222	12/17/2013	1H0103	184_INT	S	Service	1ME737	9147	S1 C - 1000 HR SERVICE	CARRIED OUT S1 C - 1000 HR SERVICE AS PER SCHEDULE. DISPOSE OF WASTE OILS AS REQUIRED.	528.5	1737.67	0	3.5	2269.67
131204-00	SVC001222	12/17/2013	1H0103	182_INT	R	Trays/Buck	1ME737		RESEAL TAILGATE - NEW STEEL ST	RESEAL TAILGATE - NEW STEEL STRIP & RUBBER, CHRIS COWEN TO INSPECT AND ASSIST	1823.5	17.01	0	50	1890.51
131210-00	SVC001222	12/16/2013	1H0103	184_INT	R	Brake	1ME737	9220 hr	REPAIR TRANSMISSION SHIFT FAUL	TRAVEL TO IMPACT FERTILISER, WAIT FOR MACHINE, CARRY OUT REPAIRS CLEARE FAULT CODES AND CHECK AND ADVISE OF WARNING EMBLEM.	300	240.6	0	0	540.6
120221-00	SVC000861	12/10/2013	1H0103	186_INT	R	Electrical	1ME737	48,454 km	FIND BRAKE RETARDER FAULT	FOLLOW WORKSHOP TROUBLE SHOOTING PROCEDURE TO LOCATE FAULT, EVERYTHING TESTED OK. SWAP ECM FROM 1ME737 TO 1ME740 TO TEST ECM, TESTED OK, TEST BRAKE LIGHT CIRCUIT AND FOUND A FAULTY SERVICE BRAKE SWITCH, REMOVE AND REPLACE FAULTY SWITCH.	1447.5	281.42	0	0	1728.92
131206-00	SVC001222	12/09/2013	1H0103	186_INT	R	Trays/Buck	1ME737		CHECK AND REPLACE SPACER PLATE	CHECK AND REPLACE SPACER PLATES UNDER TRAY LIFT TRAY BODY AND LOCK REMOVE TRAY PADS LOWER TRAY AND MEASURE, CLEAN PAD AREA AND FIT NEW SHIMS, CHECK AS REQUIRED	195	0	0	9.5	204.5

131127-00	SVC00122	11/29/2013	1H0103	105	R	Transmissio	1ME737		T/M OUT PUT SHAFT SPEED FAULT	1ME737	65	0	0	0	65
										JOB CARRIED OUT - T/M OUTPUT SHAFT SPEED SENSOR FAULT, CLEAR FAULT CODE AND TEST.					
131127-00	SVC00122	11/29/2013	1H0103	105	R	Transmissio	1ME737		CALL OUT - FAULT CODES	1ME737	260	0	0	0	260
										JOB CARRIED OUT - CALL OUT - CHECK AND CLEAR T/M OUTPUT SHAFT SPEED SENSOR FAULTS.					
131101-00	SVC00120	11/13/2013	1H0103	184_INT	R	Bodywork	1ME737	9061	REPLACE DOOR SEAL	TRAVEL TO NYRSTAR. REMOVE OLD DOOR SEALS. CLEAN UP DOOR. FIT NEW DOOR SEAL AS REQUIRED. DRIVERS SIDE ONLY	140	557.05	0	14.6	711.65
130925-00	SVC00118	09/27/2013	1H0103	105_HBGN	R	Transmissio	1ME737	9000	T/M OUTPUT SHAFT SPEED SENSOR	1ME737	195	0	0	0	195
										ODOMETER - 9000					
										JOB CARRIED OUT - DIAGNOSE T/M OUTPUT SHAFT FAULT, CLEAR CODE AND RECHECK ON EMMS SYSTEM. CHECK OTHER FAULT CODES ON SYSTEM.					
130910-00	SVC00117	09/20/2013	1H0103	182_INT	A	Trays/Buck	1ME737		REPAIRS TO BENT UP TAILBOARD	REPAIRS TO BENT UP TAILBOARD AS REQUIRED.	782	0	0	40	822
130918-00	SVC00117	09/20/2013	1H0103	105	R	Electrical	1ME737		DIFF SPEED SENSOR CIRIUT FAULT	1ME737	32.5	0	0	0	32.5
										JOB CARRIED OUT - DIFF SPEED SENSOR CIRCUIT FAULT. CHECK AND CLEAR FAULT CODE. COMMUNICATED TO RICKI DODGE.					
130829-00	SVC00116	09/11/2013	1H0103	105	R	Electrical	1ME737	8897	DIFF SPEED SENSOR CIRCUT FAULT	1ME737	357.5	0	0	0	357.5
										ODOMETER - 8897 HOURS					
										JOB CARRIED OUT - DIFFERENTIAL SPEED SENSOR FAULT. DELETED FAULT CODES, COMPLETED MINOR CHECK AND ADJUSTMENTS, TESTED OPERATION.					
130902-00	SVC00116	09/03/2013	1H0103	186_INT	R	Electrical	1ME737	61,119 km	CHECK FAULT CODE	CHECK FAULT CODE ON DASH, IT WAS INACTIVER, CLEAR FAULT AND LET UNIT BACK TO WORK	100	0	0	0	100
130723-00	SVC00113	07/25/2013	1H0103	184_INT	R	Trays/Buck	1ME737	8848	INSPECT TAILGATE ALIGNMENT	TRAVEL TO IMPACT, INSPECT TAILGATE ALIGNMENT AND CHECK BOLT TENSION, CHECK SEAL BETWEEN TAILGATE AND TRAY	107.5	0	0	9.6	117.1
130704-00	SVC00113	07/17/2013	1H0103	184_INT	S	Service	1ME737	8827	S1 A - 250 HR SERVICE	TRAVEL TO NYRSTAR, CARRIED OUT S1 A - 250 HR SERVICE AS PER SCHEDULE, REPLACE WORK LIGHT GLOBES, INSPECT TRANSMISSION FAULT CODE, CLEAN OUT SENSOR PLUGS, RESET CODES, TESTED OK.	515	256.8	0	14.4	786.2
130517-00	SVC00110	05/29/2013	1H0103	184_INT	R	Transmissio	1ME737	8671	CARRY OUT TRANSMISSION TUNE UP	TRAVEL TO IMPACT, CARRY OUT TRANSMISSION TUNE UP	432.5	0	0	14.4	446.9
130520-00	SVC00110	05/29/2013	1H0103	184_INT	R	Electrical	1ME737	8671 HR	REPAIR HEAD LIGHTS AND REV ALA	ONSITE AT IMPACT, REPAIR HEAD LIGHTS AND REV ALARM	182.5	0	0	0	182.5
130520-00	SVC00110	05/21/2013	1H0103	184_INT	R	Electrical	1ME737	8683 HR	Check Fault Codes	TRAVEL TO IMPACT. CHECK FAULT CODES. CLEANED OUT TRANS SPEED SENSOR AND CLEARED CODE.	132.5	0	0	19.2	151.7

130321-00	SVC001072	04/12/2013	1H0103	186_INT	R	Tyres	1ME737		23.5R25 DOUBLE COIN REM X 6 +	23.5R25 DOUBLE COIN REM X 6 + FITTING RUBAND	0	14850	0	0	14850
130227-00	SVC001060	03/18/2013	1H0103	184_INT	R	Bodywork	1ME737	8468	REPAIR LHS DOOR HANDLE ASSY	TRAVEL TO IMPACT, CHECK DOOR LOCK ASSEMBLY, FIT NEW PARTS TO DOOR LOCK AND OPENING MECHANISM	639.5	345.65	0	9.6	994.75
130306-00	SVC001064	03/18/2013	1H0103	184_INT	R	Transmissio	1ME737	8451	INSPECT ROUGH GEAR CHANGES	TRAVEL TO IMPACT, WARM UP MACHINE AND TUNE TRANSMISSION WITH AUTO TUNE FUNCTION	487.5	0	0	9.6	497.1
130220-00	SVC001053	02/28/2013	1H0103	184_INT	S	Service	1ME737	8420	S1 B - 500 HR SERVICE	CARRIED OUT 250 HR SERVICE AS PER SCHEDULE.	382.5	670.08	0	0	1052.58
130114-00	SVC001035	01/18/2013	1H0103	184_INT	R	Transmissio	1ME737	8236	TRANSMISSION TUNE UP	TRAVEL TO IMPACT. CARRIED OUT GEAR CHANGE TUNE UP ON TRANSMISSION.	225	0	0	9.6	234.6
121102-00	SVC001006	11/27/2012	1H0103	184_INT	R	Trays/Buck	1ME737	8095	INSPECT TRAY LOWER FAULT	TRAVELLED TO MUSSELROE. INSPECTED TRAY LOWERING FAULT. ADJUST TRAY POSITION SENSOR.	191	0	0	14.4	205.4
121018-00	SVC000985	10/23/2012	1H0103	184_INT	R	Sundries	1ME737	8092	REPAIR LOOSE SEAT BASE	TRAVELLED TO IMPACT. REPAIRED LOOSE SEAT BASE. DISASSEMBLE SEAT AND SHIM UP LOOSE PIVOT POINTS. WELD UP CRACK AND REASSEMBLE.	225	0	0	14.4	239.4
120928-00	SVC000987	10/19/2012	1H0103	105	R	Engine	1ME737		LOW COOLANT, CHECK FOR LEAKS	1ME737	32.5	22.49	0	0	54.99
121016-00	SVC000987	10/19/2012	1H0103	186_INT	R	Tyres	1ME737		TYRES RUBAND D/D 70842	TYRES RUBAND D/D 70842 DISPOSAL OF TYRE APPROVED BRENT CLIFFORD	0	150	0	0	150
121008-00	SVC000984	10/16/2012	1H0103	184_INT	R	Transmissio	1ME737		CHANGE TRANS OIL - BAD SAMPLE	TRAVELLED TO IMPACT. TAKE TRANSMISSION SAMPLE AS REQUIRED. THEN TRAVEL BACK TO SITE AND CHANGE TRANSMISSION OIL AND FILTERS.	220	463.58	0	14.4	697.98
120921-00	SVC000975	09/28/2012	1H0103	186_INT	R	Tyres	1ME737	N/A	TYRES RUBAND D/D 69859	TYRES RUBAND D/D 69859 2 X FITTING EARTHMOVER TYRES 2 X O RINGS 1 X EARTHMOVER TYRE DISPOSAL BRIAN POLLEY	0	330	0	0	330
120827-01	SVC000963	09/25/2012	1H0103	184_INT	S	Service	1ME737	8006	S1 D - 2000 HR SERVICE	CARRIED OUT 2000 HR SERVICE AS PER SCHEDULE.	1459.5	2299.21	0	0	3758.71
120815-00	SVC000947	08/17/2012	1H0103	184_INT	R	Bodywork	1ME737	7980 HRS	CALL OUT - BROKEN MIRRORS	CALLED OUT TO IMPACT. REMOVED MIRROR FROM 1ME648 AND FITTED TO 1ME737. MIRROR WAS BROKEN DURING OUTLOAD. TRAVELLED BACK TO SITE AND FITTED NEW MIRROR AS REQUIRED.	379.5	161.74	0	81	622.24
120808-00	SVC000947	08/16/2012	1H0103	184_INT	R	Electrical	1ME737	7869	REPLACE REVOLVING LIGHT AND	TRAVELLED TO IMPACT. REPAIRED UHF COAX CABLE AND FITTINGS. REPLACED UHF AERIAL. REPLACED REVOLVING LIGHT AND REPAIRED WIRING. REPLACE WIPER BLADES AS REQUIRED.	214	127.62	0	9	350.62
120702-00	SVC000930	08/07/2012	1H0103	187_INT	S	Service	1ME737	7741 hrs	S1 A SERVICE 250 HRS	S1 A SERVICE 250 HR SCKS AS PER SHEET.	167.5	325.05	0	75.5	568.05
120727-00	SVC000942	08/03/2012	1H0103	184_INT	R	Bodywork	1ME737	7857	REPLACE BROKEN BONNET CABLE	TRAVELED TO NYRSTAR. REPLACED BONNET CABLE. CHECKED LOG BOOK REPAIRS. STRAIGHTENED RHS MIRROR. CHECKED TAIL GATE CHAINS. REPAIRED LIGHTS.	305.5	22.65	0	13.5	341.65
120531-00	SVC000935	07/31/2012	1H0103	186_INT	R	Trays/Buck	1ME737		FIT TAIL BOARD	FIT TAILBOARD AS REQUIRED	92	0	0	0	92

120717-001	SVC000932	07/31/2012	1H0103	186_INT	R	Tyres	1ME737		SUPPLY TYRE AS REQUIRED	PUNCTURE REPAIR LHF PATCH TYRE AND SUPPLY TUBE 9.5/10.5/12.5-18/20 TR15CW SUPPLY RIMHM HM300 DUMPER WORK ORDER 60736 B SELECT ARRANGED BY ANDREW COAD	0	2399.08	0	0	2399.08
120720-001	SVC000934	07/31/2012	1H0103	184_INT	R	Electrical	1ME737	UNAVAILAB	REPLACE BLOWN HEADLIGHT GLOBES	TRAVELLED TO IMPACT. FITTED NEW HEADLIGHT GLOBE.	103.5	97.38	0	13.5	214.38
120719-001	SVC000932	07/24/2012	1H0103	184_INT	R	Electrical	1ME737	7760	REPLACE U/S BATTERIES	CHECKED UNIT FOR STARTING FAULT. LOCATED FAULTY BATTERIES. REPAIRED WORK LIGHTS AS REQUIRED.	348.5	437.14	0	0	785.64
120723-001	SVC000932	07/24/2012	1H0103	184_INT	R	Trays/Buck	1ME737	7791	CALL OUT - STRAIGHTEN TAILGATE REPLACE TWO TYRES	CALL OUT TO S/T W/SHOP. STRAIGHTEN TAILGATE AS REQUIRED.	368	0	0	27	395
120510-001	9595	06/20/2012	1H0103	186_INT	R	Tyres	1ME737				0	0	0	0	0
120521-001	SVC000897	06/13/2012	1H0103	186_INT	R	Tyres	1ME737		CALLOUT FIT TYRE TUBLESS	CALLOUT FIT TYRE TUBLESS IDS/AGS 18+ B SELECT MOONAH WORK ORDER 60325 INVOICE 159527	0	796.32	0	0	796.32
120521-001	SVC000895	06/04/2012	1H0103	184_INT	R	Hydraulic	1ME737	7602	REPAIR OIL LEAK AT HYD TANK	C/OUT TO IMPACT. INSPECT FOR HYDRAULIC OIL LEAK. TIGHTEN LOOSE PIPE CLAMP ON RETURN LINE.	368	0	0	90	458
120521-001	SVC000905	06/04/2012	1H0103	184_INT	R	Hydraulic	1ME737	7602	REPAIR OIL LEAK AT HYD TANK	LABOUR OMITTED FROM SVC00089528	69	0	0	0	69
120518-001	SVC000903	05/31/2012	1H0103	186_INT	R	Sundries	1ME737		CONSUMABLES MAY 2012	MAY CONSUMABLES	0	47.34	0	0	47.34
120508-001	SVC000886	05/28/2012	1H0103	182_INT	R	Lathe	1ME737		CLEAN UP THREAD ON TAILGATE PI	CLEAN UP THREAD ON TAILGATE PIVOT PIN	72	4	0	0	76
120511-001	SVC000885	05/28/2012	1H0103	182_INT	R	Milling	1ME737		REPAIRS TO BROKEN TORSION BAR	REPAIRS TO BROKEN TORSION BAR - NEW TORSION BAR MANUFACTURED FROM 100MM WELDOX 700. SUBLET SAUNDERS & WARD	1507.5	459.01	350	0	2316.51
120430-001	SVC000895	05/25/2012	1H0103	186_INT	R	Trays/Buck	1ME737		REMOVE TAIL BOARD	REMOVE TAIL BOARD AS REQUIRED AND SUPPLY AIR CLEANER	179.5	86.14	0	0	265.64
120522-001	SVC000895	05/22/2012	1H0103	184_INT	R	Suspension	1ME737	7106	FIT NEW TORSION BAR	TRAVELLED TO LONG HILL. FIT NEW TORSION BAR, PARTS SUPPLIED BY FITTING SHOP.	172.5	10	0	45	227.5
120510-001	SVC000892	05/18/2012	1H0103	187_INT	R	Suspension	1ME737	7601 hrs	TORSION BAR BROKEN	TORSION BAR BROKEN TRAVEL TO LONGHILL AND REMOVE BROKEN TORSION BAR. SEND TO HOBART FOR REMAKE.	69	20	0	27	116
120427-001	SVC000887	05/09/2012	1H0103	184_INT	R	Transmissio	1ME737		CHANGE TRANSMISSION OIL	TRAVELLED TO UNIT CHANGE TRANSMISSION OIL DUE TO BAD OIL SAMPLE CHANGE OUT WIPER BLADES AS REQUESTED	172.5	349.44	0	18	539.94
120418-001	SVC000880	04/30/2012	1H0103	186_INT	R	Trays/Buck	1ME737	7522	REMOVE TAIL BOARD	REMOVE TAILGATE FROM UNIT AS REQUIRED	292.5	8.55	0	0	301.05
120418-001	SVC000884	04/30/2012	1H0103	186_INT	R	Trays/Buck	1ME737	7522	REMOVE TAIL BOARD	Labour omitted from service invoice svc00088034 remove tail gate	104	0	0	0	104
120424-001	SVC000875	04/30/2012	1H0103	186_INT	R	Sundries	1ME737		APRIL CONSUMABLES 2012	APRIL CONSUMABLES 2012 103-6072 - BRENT CLIFFORD	0	59.32	0	0	59.32
120426-001	SVC000880	04/30/2012	1H0103	182_INT	R	Trays/Buck	1ME737		STRAIGHTEN DUMPER TAILGATE	STRAIGHTEN DUMPER TAILGATE	359	15	0	0	374
120330-001	SVC000871	04/10/2012	1H0103	184_INT	S	Service	1ME737	7504	S1 B - 500 HR SERVICE	TRAVELLED TO NYRSTAR. CARRIED OUT 500HR SERVICE AS PER SCHEDULE	431.5	657.77	0	12.5	1101.77

120117-00\	SVC000825	03/27/2012	1H0103	186_INT	S	Service	1ME737		S1 250HR SERVICE	PERFORMED 250 HR SERVICE AS PER SCHEDULE. CHANGED OIL AND FILTER , TOOK OIL SAMPLE OF ENGINE. INSPECTED MACHINE ,LIGHTS , ANY LEAKS , TYRES ETC. TESTED OPERATION	698	240.36	0	3	941.36
120220-00\	SVC000860	03/20/2012	1H0103	186_INT	R	Trays/Buck	1ME737		REMOVE REPLACE TAIL GATE	REMOVE AND REPLACE TAILGATE AS REQUIRED	413	15	0	0	428
120201-00\	SVC000843	03/15/2012	1H0103	186_INT	R	Tyres	1ME737		SUPPLY TYRES	SUPPLY TYRES AS REQUESTED BY BRIAN POLLEY	0	7308	0	0	7308
120223-00\	SVC000846	02/29/2012	1H0103	186_INT	R	Sundries	1ME737		FEBRUARY CONSUMABLES 2012	FEBRUARY CONSUMABLES 2012 103-5778 - BRENT CLIFFORD	0	25.52	0	0	25.52
120109-00\	SVC000824	02/16/2012	1H0103	186_INT	R	Trays/Buck	1ME737		REMOVE AND REPLACE TAILGATE	REMOVE AND REPLACE TAIL GATE AS REQUIRED	364.5	80	0	0	444.5
120103-00\	SVC000829	01/31/2012	1H0103	186_INT	R	Sundries	1ME737		JANUARY 2012 CONSUMABLES	JANUARY 2012 CONSUMABLES 103-5554 - B CLIFFORD 103-5614 - B CLIFFORD	0	445.82	0	0	445.82
120119-00\	SVC000827	01/31/2012	1H0103	186_INT	R	Electrical	1ME737		REPLACE BOTH TAIL LIGHTS	REMOVED OLD UNSERVICABLE TAIL LIGHTS AD FITTED NEW LED TAIL LIGHTS	147.5	171.58	0	0	319.08
120107-00\	SVC000822	01/11/2012	1H0103	184_INT	R	Brake	1ME737	6976	INSPECT BRAKE FAULT AND CODES	INSPECT BRAKE FAULT AND CODES - 28/11/2011 - TRAVELLED TO HBMI. BLEED AIR OUT OF BRAKE CIRCUIT, CHECK FOR LEAKS AND TEST OPERATION, LIFT CAB AND CHECK FOR LOOSE PLUGS AND CHECK WIRING HARNESS FOR BREAKS	624.5	0	0	109.8	734.3
111128-00\	SVC000806	12/20/2011	1H0103	186_INT	R	Trays/Buck	1ME737		REMOVE TAIL GATE.AND REFIT	REMOVE AND REFIT TAILGATE AS REQUIRED	323	0	0	0	323
111026-00\	SVC000789	11/29/2011	1H0103	184_INT	S	Service	1ME737	6967	S1 C - 1000 HR SERVICE	S1 C - 1000 HR SERVICE TRAVELLED TO SITE AND SERVICE UNIT AS REQUIRED 103-5330 BRENT CLIFFORD	586.5	1805.5	0	16.2	2408.2
111108-00\	SVC000792	11/17/2011	1H0103	184_INT	R	Electrical	1ME737	6843	REPAIR BRAKE FAULT CODE	2/11 - TRAVEL TO IMPACT. CHECK MONITOR FAULT. ERASE ELECTRICAL FAULT AND RECHECK. 4/11 - TRAVEL BACK TO IMPACT. CHECK ELECTRICAL FAULT DX12K4. FRONT BRAKE PROPORTIONAL VALVE. CHECKED SOLENOIDS. DISASSEMBLED AND CLEAN SCREENS. CHECK SOLENOID CONDINUITY. CHECKED WIRING FOR DAMAGE. PUT MACHINE BACK TO WORK AND MONITOR. 2/11 - CHECK OVER ALARM FOR BRAKE 8/11 - TRAVEL TO SOUTH HOBART TIP. REMOVE FRONT BRAKE BIAS SOLENOID ASSEMBLY FROM M648 AND FIT. CHECK OPERATION.. FOUND NO CHANGE FAULT CODE. DX12K4 STILL ACTIVE	1190.5	0	0	54	1244.5
111031-01\	SVC000779	11/08/2011	1H0103	186_INT	R	Trays/Buck	1ME737	6819 hrs	REASSEMBLE AND FIT TAIL GATE	REASSEMBLE AND FIT TAIL GATE	259.5	0	0	0	259.5
111031-00\	SVC000740	11/04/2011	1H0103	184_INT	R	Electrical	1ME737	6729	REPLACE FAULTY RETARDER SWITCH	KOMATSU TO REPLACE FAULTY RETARDER SWITCH	14.75	0	1804.36	0	1819.11
110908-00\	SVC000782	10/14/2011	1H0103	184_INT	R	Electrical	1ME737		FIT TRAVEL ALARM FOR PULP MILL	FIT UP PULP MILL TRAVEL ALARM. PART REMOVED FROM ANOTHER UNIT.	118	0	0	0	118
111004-00\	SVC000779	10/14/2011	1H0103	184_INT	S	Service	1ME737	6688	S1 B - 500 HR SERVICE	TRAVEL TO BELL BAY. CARRY OUT 500 HR SERVICE AS PER SCHEDULE. ADJUST BONNET CATCH	758	946.79	0	185	1889.79

110504-00	SVC00069	10/13/2011	1H0103	184_INT	S	Service	1ME737	6443	S1 D - 2000 HR SERVICE	CARRIED OUT 2000HR SERVICE AS PER SCHEDULE. REMOVED AIR FILTER MUSHROOM AND MEASURE UP FOR PRE CLEANER. LOOSEN OFF MIRRORS AND TURN IN FOR TRANSPORTATION. ASSIST WITH TAILGATE REMOVAL. FILTER KIT SUPPLIED ON PREVIOUS SERVICE CALL	981	863.79	0	0	1844.79
110615-00	SVC00071	10/13/2011	1H0103	187_INT	S	Service	1ME737	6255	S1 A SERVICE 250 HR	TRAVELLED TO LONGHILL QUARRY. CARRIED OUT 250HR SERVICE AS PER SCHEDULE AND REPLACED RIGHT HAND HEADLIGHT GLOBE	279.5	298.24	0	108	685.74
111007-00	SVC00078	10/13/2011	1H0103	184_INT	R	Electrical	1ME737	6612	INSPECT FAULT CODE FAULT	SUBLET KOMATSU TO CHECK FAULT CODES ON UNIT	29.5	0	331.88	0	361.38
110520-00	SVC00069	06/15/2011	1H0103	182_INT	R	Lathe	1ME737		MACHINE 2 TAILGATE THREADED PI	MACHINE 2 TAILGATE THREADED PINS	216.5	76.56	0	0	293.06
110505-00	SVC00070	06/10/2011	1H0103	186_INT	R	Trays/Buck	1ME737	6193 HRS	REMOVE TAIL GATE	remove tailgate , refit tailgate . check and repair lights. replace fire extinguisher crack test supposed cracks in front and rear of tray Mirror on lhs lower was also replaced due to no glass.	984	318.34	0	0	1302.34
110421-00	SVC00068	04/26/2011	1H0103	122_INT	R	Sundries	1ME737		PARTS REQ APRIL 103-4317	PARTS REQ APRIL 103-4317	0	25.01	0	0	25.01
110304-00	SVC00065	03/29/2011	1H0103	182_INT	R	Trays/Buck	1ME737		STRAIGHTEN TAILGATE SIDE & REF	STRAIGHTEN TAILGATE SIDE, MACHINE NEW PINS & REFIT TO MACHINE	1717	44.37	0	0	1761.37
110303-00	SVC00066	03/22/2011	1H0103	184_INT	R	Trays/Buck	1ME737	5955	REMOVE TAILGATE FOR REPAIRS	TRAVELLED TO IMPACT. REMOVED DAMAGED TAILGATE FROM TRAY FOR REPAIRS	417.5	0	0	23.4	440.9
110318-00	SVC00066	03/21/2011	1H0103	184_INT	R	Electrical	1ME737	5979	DISCONNECT CAB WINDOWS ETC	CHECKED CAB ELECTRIC WINDOW AND ISOLATE POWER SUPPLY. START TO CLEAN BUILD UP OF MATERIAL FROM RADIATOR AREA. FINISH CLEANING RADIATOR AREA AND FITTED MESH SCREEN TO FRONT OF UNIT TO STOP MATERIAL ENTERING RADIATOR AREA. TRAVELLED TO IMPACT AND CHANGED CAB FILTER AND AIR FILTER. EXTRACT CODES FROM MONITOR	521	0	0	13.5	534.5
110207-00	SVC00060	02/22/2011	1H0103	184_INT	S	Service	1ME737	5902	S1 A - 250 HR SERVICE	TRAVELLED TO IMPACT AND CARRIED OUT 250HR SERVICE AS PER SCHEDULE	379.5	632.46	0	0	1011.96
110211-00	SVC00055	02/21/2011	1H0103	182_INT	B	Trays/Buck	1ME737		REPAIRS TO BENT TAILGATE	REPAIRS TO BENT TAILGATE	550	0	0	0	550
110119-00	SVC00063	01/20/2011	1H0103	122_INT	R	Sundries	1ME737		STORE ISSUE JAN PG 103-3783	STORE ISSUE JAN PG 103-3783	0	19.2	0	0	19.2
101223-00	SVC00063	01/07/2011	1H0103	122_INT	R	Sundries	1ME737		STORE ISSUE DEC PG 103-3676	STORE ISSUE DEC PG 103-3676	0	8.14	0	0	8.14
100812-00	SVC00056	12/31/2010	1H0103	182_INT	R	Trays/Buck	1ME737		SEAL TAILGATE AS DISCUSSED WIT	REPAIR BENT TAILGATE ARMS, FIT FLATBAR TO BOLT RUBBER DOWN TO SEAL TAILGATE AS REQUESTED BY DAVE LANGDON	1835.5	41.52	0	0	1877.02
101029-00	SVC00059	10/29/2010	1H0103	184_INT	R	Bodywork	1ME737	5501HRS	C/OUT REPLACE BROKEN MIRROR	CALLOUT TO UNIT. REPLACE BROKEN MIRROR ON LEFT HAND SIDE. REMOVED FROM 1ME645	368	0	0	0	368
100810-00	SVC00058	10/26/2010	1H0103	186_INT	R	Sundries	1ME737	5087h 34,7	GENERAL REPAIRS	Fitted mirror and greased the machine.	162.25	265.12	0	0	427.37

100913-001	SVC000584	10/07/2010	1H0103	184_INT	S	Service	1ME737	5454	S1 B - 500 HR SERVICE	29/09 - SERVICED UNIT AS PER SCHEDULE. 30/09 - REPAIRED BRAKE AND TAIL LIGHTS AND WIRING. REMOVED FRONT DRIVESHAFTS TO ACCESS FAULTY GREASE NIPPLES AND REPLACED. REFITTED DRIVELINES AND LUBRICATED OK.	857	776.43	0	2.7	1636.13
100827-001	SVC000570	09/28/2010	1H0103	184_INT	S	Service	1ME737	5203	S1 A - 250 HR SERVICE	TRAVELLED TO IMPACT FERTILIZER. CARRIED OUT 250HR SERVICE AS PER SCHEDULE	338.5	460.58	0	18	817.08
100922-001	SVC000577	09/23/2010	1H0103	184_INT	R	Brake	1ME737	5390	Check Brake operation	TRAVELLED TO IMPACT FERTILISER AND INSPECTED BRAKE OPERATION. CHECKED AND ADJUSTED PARK BRAKE AND ROAD TESTED UNIT. NO FAULT FOUND.	138	0	0	9	147
100916-001	SVC000574	09/17/2010	1H0103	184_INT	R	Electrical	1ME737	5427	CHECK INTERMITTENT CODE FAULT	TRAVELLED TO IMPACT. CHECK FOR RETARDER FAULT. LOCATE FAULTY SWITCH AND TEST ALL SENSOR WIRING AND PLUGS. RETARDER SWITCH TO BE REPLACED IF CODE FAULT BECOMES MORE FREQUENT	305.5	0	0	9	314.5
100830-001	SVC000566	09/14/2010	1H0103	182_INT	R	Trays/Buck	1ME737		FIT UP HUNGRY BOARDS AS REQUESTED	MEASURE UP DUMPER AT IMPACT. SOURCE MATERIAL AT QUARRY, STRIP INTO SECTIONS AND CLEAN UP DUMPER WELD ON	2949.5	46.02	0	0	2995.52
100908-001	SVC000571	09/09/2010	1H0103	184_INT	R	Electrical	1ME737	5204	REPLACE BROKEN TAIL LIGHTS	REMOVED BROKEN TAIL LIGHT ASSEMBLY AND DRILLED OUT BROKEN BOLTS. FIT NEW ASSEMBLY	133	0	0	0	133
100907-001	SVC000570	09/08/2010	1H0103	184_INT	R	Engine	1ME737	5203	REPAIR BROKEN ALTERNATOR BKT	TRAVELLED TO IMPACT FERTILIZER. REMOVE ALTERNATOR, WELD UP BROKEN BELT COVER AND REFIT ALTERNATOR AND ADJUST. DROP FRONT BELLY PLATE, REPLACE DAMAGED COOLER HOSE CLAMP AND REASSEMBLE	450.5	0	0	18	468.5
100708-001	SVC000549	08/06/2010	1H0103	184_INT	R	Trimming	1ME737	4923	REPLACE SEAT SHOCK ABSORBERS	DISMANTLE AND REPLACE SEAT DAMPENERS, REASSEMBLE AND REFIT SEAT	243	269.51	0	0	512.51
100714-001	SVC000549	07/30/2010	1H0103	184_INT	R	Trays/Buck	1ME737	4933	SEAL TAILGATE ON UNIT	TRAVELLED TO NYRSTAR AND SEALED OFF TALGATE WITH RUBBER STRIP. RETURNED TO UNIT AND SEALED WITH PREFABRICATED CHUTEX STRIP.	369.5	70.01	990	31.5	1461.01
100726-001	SVC000548	07/27/2010	1H0103	122_INT	R	Sundries	1ME737		REQ JULY 2010 1032758 J.J	REQ JULY 2010 1032758 J.J	0	28.28	0	0	28.28
100723-001	SVC000549	07/26/2010	1H0103	184_INT	R	Electrical	1ME737	4914	REPLACE U/S REVOLVING LIGHT	TRAVELLED TO BRIGHTON. REMOVED UNSERVICABLE REVOLVING LIGHT AND FIT NEW ONE	98.5	103.65	0	0	202.15
100713-001	SVC000539	07/20/2010	1H0103	184_INT	S	Service	1ME737	4923	S1 C - 1000 HR SERVICE	CARRY OUT 1000HR SERVICE AS PER SCHEDULE	438.5	1747.19	0	0	2185.69
100712-001	SVC000539	07/14/2010	1H0103	122_INT	R	Sundries	1ME737		PARTS REQ JULY 103-2632	PARTS REQ JULY 103-2632	0	321.84	0	0	321.84
100428-001	SVC000488	05/27/2010	1H0103	122_INT	R	Sundries	1ME737		STORE ISSUE APRIL PG.103-2162,	STORE ISSUE APRIL PG.103-2162,	0	110.64	0	0	110.64
100401-001	SVC000478	04/14/2010	1H0103	184_INT	R	Bodywork	1ME737	4338	REPLACE U/S BONNET LATCH	TRAVELLED TO BRIGHTON AND CHECK OVER AFTER ROLL OVER OF TRUCK. REPLACED BONNET STICKER AND LATCH ASSEMBLY HAD BEEN ADJUSTED	159.5	503.43	0	13.5	676.43
100330-001	SVC000474	04/13/2010	1H0103	184_INT	S	Service	1ME737	4312	S1 A - 250 HR SERVICE	CARRIED OUT 250HR SERVICE AS PER SCHEDULE. REPAIRED WIRING FAULT ON RIGHT HAND READ BRACKET LIGHT. REPLACE BROKEN GREASE NIPPLES ON PARK BRAKE PIVOT AND TAIL GATE PIVOT	286	229.04	0	0	515.04
100212-001	SVC000442	03/26/2010	1H0103	184_INT	S	Service	1ME737	4047	S1 D - 2000 HR SERVICE	TRAVELLED TO BRIGHTON AND CARRY OUT 2000HR SERVICE AS PER SCHEDULE	571	2630.29	0	27	3228.29

100212-00\	SVC000465	03/26/2010	1H0103	184_INT	S	Service	1ME737	4047	S1 D - 2000 HR SERVICE	ASSISTED WITH 2000HR SERVICE AS PER SCHEDULE. CHANGED COOLANT, DIFF AND PLANETARY OILS	55	0	281.02	0	336.02
100323-00\	SVC000471	03/26/2010	1H0103	122_INT	R	Tyres	1ME737	4129.8 HRS	TYRE REPAIRS B SELECT X 3	TYRE REPAIRS B SELECT X 3	0	1107.76	0	0	1107.76
100316-00\	SVC000463	03/16/2010	1H0103	184_INT	R	Tyres	1ME737	4072	REMOVE & REPLACE FLAT TYRE	TRAVELLED TO BRIGHTON AND CHANGE OUT FLAT TYRE	342.5	0	0	13.5	356
100121-00\	SVC000462	03/15/2010	1H0103	184_INT	R	Trimming	1ME737	3908	REPLACE L/H DOOR WINDOW SEAL	TRAVELLED TO BRIGHTON AND INSPECT FAULTY WINDOW OPERATION. WINDOW RUBBER FOUND TO BE UNSERVICABLE AND JAMMIN UP ELECTRIC WINDOW	60.5	74.58	0	4.5	139.58
100301-00\	SVC000462	03/12/2010	1H0103	122_INT	R	Tyres	1ME737		TYRE REPAIRS MICHELIN B POLLY	TYRE REPAIRS MICHELIN B POLLY	0	20550	0	0	20550
100108-00\	SVC000447	02/24/2010	1H0103	122_INT	R	Tyres	1ME737	3777.6 HRS	TYRE REPAIRS B SELECT 44843	TYRE REPAIRS B SELECT 44843	0	572.72	0	0	572.72
091223-00\	SVC000422	02/04/2010	1H0103	184_INT	R	Trays/Buck	1ME737	3775	REFIT TAILGATE TO TRAY	TRAVELLED TO BRIGHTON AND FIT TAILGATE TO TRAY	790	305.15	0	71.1	1166.25
091218-00\	SVC000414	01/29/2010	1H0103	122_INT	R	Sundries	1ME737		STORE ISSUE DEC.PG REQ.1399,	STORE ISSUE DEC.PG REQ.1399,	0	115.79	0	0	115.79
100108-00\	SVC000422	01/29/2010	1H0103	122_INT	R	Sundries	1ME737		PARTS REQ JAN 103-1495	PARTS REQ JAN 103-1495	0	71	0	0	71
100118-00\	SVC000435	01/29/2010	1H0103	122_INT	R	Tyres	1ME737	3810 HRS	TYRE REPAIRS BSELECT 45010	TYRE REPAIRS BSELECT 45010	0	366.36	0	0	366.36
091218-00\	SVC000414	01/15/2010	1H0103	184_INT	S	Service	1ME737	3775	S1 A - 250 HR SERVICE	TRAVELLED TO BRIGHTON AND CARRIED OUT 250HR SERVICE AND CHECKS AS PER SCHEDULE	328	246.04	0	36	610.04
091113-00\	SVC000410	12/10/2009	1H0103	184_INT	R	Electrical	1ME737	4631	REPLACE U/S TAIL LIGHT ASSY'S	TRAVELLED TO BRIGHTON. REPAIR BRAKE LIGHTS AND TEST. FITTED NEW GLOBES	99.5	184.85	0	31.5	315.85
091102-00\	SVC000388	11/10/2009	1H0103	184_INT	S	Service	1ME737	3495	S1 B - 500 HR SERVICE	TRAVELLED TO BRIGHTON AND CARRIED OUT 500HR SERVICE AS PER SCHEDULE. INSPECT FAULTY AIR CON OPERATION AND FOUND BROKEN WIR TO COMPRESSOR	440.5	715.69	0	36	1192.19
091026-00\	SVC000381	11/06/2009	1H0103	182_INT	A	Trays/Buck	1ME737		REPAIR BENT TAIL GATE	REMOVE AND STRAIGHTEN BENT TAIL GATE ARMS	1121	0	0	0	1121
091008-00\	SVC000373	10/23/2009	1H0103	122_INT	R	Sundries	1ME737		STORE ISSUE OCT PG.REQ.906	STORE ISSUE OCT PG.REQ.906	0	424.95	0	0	424.95
090911-00\	SVC000367	09/30/2009	1H0103	181_INT	A	Bodywork	1ME737		ALIGN BONNET AND FIT NEW MIRRO	repair accident damage to the bonnet. realign the bonnet as required,	93	192	0	0	285
090915-00\	SVC000361	09/23/2009	1H0103	184_INT	R	Engine	1ME737		CHECK FOR LOW POWER FAULT	TRAVELLED TO HBMI. CHECK OVER POWER FAULT AND FOUND MUD STUCK UNDERNEATH BRAKE PEDAL. WHICH WERE HOLDING BRAKES ON. CLEANED OUT AND TEST	357.5	279.54	0	55.8	692.84
090706-01\	SVC000321	09/03/2009	1H0103	122_INT	R	Sundries	1ME737		REFER JULY REQ.PG 25192	REFER JULY REQ.PG 25192	0	76.29	0	0	76.29
090818-00\	SVC000342	08/25/2009	1H0103	184_INT	S	Service	1ME737	3221	S1 A - 250 HR SERVICE	TRAVELLED TO SOUTH ARM. CARRIED OUT 250HR SERVICE AS PER SCHEDULE	352	355.89	0	110.7	818.59
090709-00\	SVC000340	08/13/2009	1H0103	122_INT	R	Tyres	1ME737		TYRE REPAIRS B SELECT 41504		0	216.36	0	0	216.36
090625-00\	SVC000315	06/30/2009	1H0103	184_INT	R	Bodywork	1ME737	3022	REPLACE R/H REAR VISION MIRROR	TRAVELLED TO HBMI. CHANGE RIGHT HAND SIDE MIRROR AND ADJUST	129.5	243.39	0	50.4	423.29
090604-00\	SVC000303	06/19/2009	1H0103	184_INT	S	Service	1ME737	2971	S1 C - 1000 HR SERVICE	TRAVELLED TO HBMI TO CARRY OUT 1000HR SERVICE AS PER SCHEDULE	463	1616.68	0	38.7	2118.38

090612-00\	SVC000307	06/12/2009	1H0103	184_INT	R	Electrical	1ME737	2958	REPAIR REVERSE ALARM	TRAVELLED TO HBMI. REPAIR REVERSE ALARM AND REFIT MIRROR GLASS	132	0	0	21.6	153.6
090609-00\	SVC000305	06/09/2009	1H0103	184_INT	R	Electrical	1ME737	2873	REPLACE REVOLVING LIGHT GLOBE	TRAVELLED TO ORFORD AND FITTED NEW REVOLVING LIGHT GLOBE TO UNIT	33	0	0	13.5	46.5
090520-00\	SVC000294	05/28/2009	1H0103	122_INT	R	Sundries	1ME737		REFER MAY REQ.PG 25176	REFER MAY REQ.PG 25176	0	176.58	0	0	176.58
090514-00\	SVC000292	05/19/2009	1H0103	186_INT	R	Engine	1ME737	2869.9HOL	CHECK FOR OIL LEAKS & REPAIR	Clean the machine then test fro hydraulic oil leaks. The truck was greased and all oil levels were checked.	407	0	0	0	407
090519-00\	SVC000293	05/19/2009	1H0103	184_INT	R	Sundries	1ME737	2840	FIT NUMBER PLATES	TRAVELLED TO BRIGHTON. FIT NUMBER PLATE AND REGO LABLE TO UNIT	66	0	0	45	111
090409-00\	SVC000275	04/17/2009	1H0103	105	R	Trays/Buck	1ME737	2721	ADJUST MIRRORS,	1ME737	55	0	0	0	55
										ODOMETER - 2721					
										AGJUST MIRRORS, REMOVE REAR PADS FOR CORRECT TRAY SEALING					
090325-00\	SVC000266	03/31/2009	1H0103	184_INT	R	Bodywork	1ME737	2732	Replace broken mirror	ONSITE AT DOVER. REPLACE BROKEN MIRROR	88	240.68	0	0	328.68
090227-00\	SVC000251	03/04/2009	1H0103	184_INT	R	Engine	1ME737	2699	CLEAN OUT COOLING SYSTEMS	CLEANED OUT 3 TIMES IN ONE WEEK DUE TO DIRTY WORKING CONDITIONS	280.5	0	0	13.5	294
090223-00\	SVC000247	02/25/2009	1H0103	186_INT	R	Sundries	1ME737	2699 HOUF	REPAIR TAIL GATE	Replace the tail board as required. New side arms were fitted and the unit was attached to the tray of the truck. NOTE. the tail gate structure is bent out of shape and is not a 100% fit to the tray.	528	0	0	0	528
090212-00\	SVC000241	02/18/2009	1H0103	184_INT	S	Service	1ME737	2722	S1 A - 250 HR SERVICE	CARRY OUT S1-A 250HR SERVICE AS PER SCHEDULE	253	201.52	0	38.7	493.22
081203-00\	SVC000210	01/27/2009	1H0103	122_INT	R	Sundries	1ME737		REFER DEC REQ.26765 PG	REFER DEC REQ.26765 PG	0	100.38	0	0	100.38
081201-00\	SVC000211	01/13/2009	1H0103	184_INT	R	Hydraulic	1ME737	2490	REPLACE STEERING CYL FITTING	TRAVELLED TO HBMI AND REMOVED BROKEN L/H STEERING CYLINDER FITTING OFF UNIT. REMOVED ONE FROM M740 TO ENABLE THE UNIT TO WORK. REMOVED A SECOND FITTING FROM M739 IN THE WORKSHOP TO FIT TO M740 AFTER DETERMINING THAT A NEW FITTING WAS 10 - 14 DAYS AWAY. FITTED NEW FITTING ON ARRIVAL TO M739.	660	255.86	0	136.8	1052.66
081128-00\	SVC000205	11/28/2008	1H0103	184_INT	R	Trays/Buck	1ME737	2465.	WELD CRACKS IN TRAY.	TRAVELLED TO HBMI. REPAIR CRACKS IN TAIL BOARD MOUNT AND STRENGTHEN UP, REPLACED HEATER TAP	320	0	0	27	347
081021-00\	SVC000187	10/30/2008	1H0103	184_INT	S	Service	1ME737	2401	S1 B - 500 HR SERVICE.	TRAVELLED TO CATAGUNYA. CARRIED OUT S1-B 500HR SERVICE AS PER SCHEDULE	350	689.36	0	102.6	1141.96
081022-00\	SVC000185	10/22/2008	1H0103	184_INT	R	Trays/Buck	1ME737	2268 HRS	REMOVE TAIL BOARD	TRAVELLED TO CATAGUNYA. REMOVE TAIL BOARD AS REQUESTED	150	0	0	76.5	226.5
080911-00\	SVC000165	10/09/2008	1H0103	184_INT	R	Electrical	1ME737	2293	REPLACE REVERSE ALARM.	TRAVELLED TO CATAGUNYA. CHECK FAULT WITH REVERSE ALARM, FOUND THAT UNIT NEEDS REPLACING, AND CHECK HOSES AT BACK OF CAB LIFT TRAY	305	365.45	0	99	769.45
080911-00\	SVC000174	09/25/2008	1H0103	122_INT	R	Tyres	1ME737	2212 HRS	REPAIR AND REFIT TYRE	REPAIR AND REFIT TYRE	0	284.24	0	0	284.24

080918-00	SVC00016	09/25/2008	1H0102	122_INT	R	Sundries	1ME737		REFER REQ.13338 SEPT PG	REFER REQ.13338 SEPT PG	0	127.48	0	0	127.48
080922-00	SVC00017	09/25/2008	1H0103	122_INT	R	Tyres	1ME737		TYRE REPAIRS BRIDGESTONE 36012	TYRE REPAIRS BRIDGESTONE 36012	0	0	0	0	0
080829-00	SVC00015	08/29/2008	1H0103	184_INT	R	Trays/Buck	1ME737	2132.	REPLACE TRAY TURNBUCKLES.	TRAVELLED TO CATAGUNYA. SOURCE NEW TURN BUCKLES FOR TAILGATE ARMS, REMOVE BROKEN TURNBUCKLES, CUT DOWN NEW BUCKLES TO SUIT LENGTH AND FIT, MAKE FINAL ADJUSTMENTS, HAVE OPERATOR TIP 5 LOADS WHILE WAITING TO CHECK OPERATION	460	0	0	207	667
080818-00	SVC00015	08/28/2008	1H0103	184_INT	S	Service	1ME737	2124 HRS	S1 A - 250 HR SERVICE.	TRAVELLED TO CATAGUNYA. CARRY OUT SERVICE AS PER SCHEDULE, DISPOSE OF WASTE OILS AND FILTERS AND REPAIR BENT SHOCKIE COVER	367.5	240.52	0	110.7	718.72
080819-00	SVC00015	08/28/2008	1H0102	122_INT	R	Sundries	1ME737		REFER REQ.13331 PG	REFER REQ.13331 PG	0	18.42	0	0	18.42
080612-00	SVC00012	07/05/2008	1H0102	122_INT	R	Sundries	1ME737		REFER REQ13310	REFER TO REQ 13310	0	6.45	0	0	6.45
080604-00	SVC00012	06/24/2008	1H0103	186_INT	R	Brake	1ME737	1946	REPAIR PARK BRAKE & TRAY PIN	REPAIR PARK BRAKE & TRAY PIN Perform inspection on the park brake operation. Found the park brake did not really hold the machine at all. Inspected the caliper found it was way out of adjustment found slack adjuster to be faulty removed and replaced. readjusted and tested. Remove bent tray lock pin and have a new one frabricated paint and install.	244.25	0	0	2	246.25
080617-00	SVC00012	06/17/2008	1H0102	122_INT	R	Sundries	1ME737		REFER REQ.13311		0	3.2	0	0	3.2
080529-00	SVC00011	06/04/2008	1H0103	184_INT	S	Service	1ME737	1924	S1 D - 2000 HR SERVICE.	TRAVELLED TO HBMI. LOCATE OILS AND FILTERS, CARRY OUT SERVICE AS PER SCHEDUEL	707.5	1947.15	0	49.6	2704.25
080528-00	SVC00011	06/03/2008	1H0103	184_INT	R	Brake	1ME737	1924	CHECK AND ADJUST PARK BRAKE.	TRAVELLED TO HBMI. CHECKED AND ADJUSTED PARK BRAKE AND GREASED UNIT	100	179.36	0	49.6	328.96
080528-00	SVC00011	05/29/2008	1H0103	122_INT	F	Tyres	1ME737		FIT MAJOR REPAIR	1ME737 ODO - 1863.7 HRS DUGGAN AND PARKER TYRE SERVICE TRAVEL TO DEE LAGOON FIT MAJOR REPAIR TO POS 6 ARRANGED BY DARREN McCONNON	0	293.24	0	0	293.24
080514-00	SVC00010	05/19/2008	1H0103	122_INT	R	Sundries	1ME737		PARTS AS 17193		0	289.29	0	0	289.29
080415-00	SVC00008	05/14/2008	1H0102	184_INT	S	Service	1ME737	1796	S1 A - 250 HR SERVICE.	CARRIED OUT SERVICE AS PER SCHEDULE	181.25	198.86	0	0	380.11
080327-00	SVC00007	05/04/2008	1H0102	182_INT	R	Trays/Buck	1ME737		REPAIR BENT TAILGATE ARM	REPAIR BENT TAIL GATE, MACHINE NEW PIN AS PER SAMPLE	1175.5	156.54	0	0	1332.04
080417-00	SVC00009	05/04/2008	1H0102	122_INT	R	Sundries	1ME737		TYRE REPAIRS @ DEE LAGOON	1ME737 ODO - 1717 HRS DUGGAN AND PARKER TYRE SERVICE TRAVEL TO DEE LAGOON REPAIR TYRE ON RHR	0	228.68	0	0	228.68
080311-00	SVC00008	05/04/2008	1H0102	184_INT	R	Bodywork	1ME737		REPLACE FUEL CAP	REPLACE FUEL CAP - PARTS ONLY	0	348.92	0	0	348.92

071213-00	SVC000010	02/06/2008	1H0102	184_INT	R	Electrical	1ME737	1215	ELACTRICAL FAULT	ASSESS NO POWER TO DASH OR IGNITION. FOEND BLOWN FUSE IN CAB ON TERMINAL B. REPLACED FUSE AND CHECKED WIRING HARNESS AND SOLINIDS.	0	0	253.05	0	253.05
080129-00	SVC000045	02/05/2008	1H0102	122_INT	R	Sundries	1ME737		TYRE REPAIRS @ HBMI	M737 ODO - 1426 HRS	0	201.4	0	0	201.4
080111-00	SVC000036	01/23/2008	1H0103	184_INT	S	Service	1ME737	1426	S1 A - 250 HR SERVICE.	DUGGAN AND PARKER TYRE SERVICE TRAVEL TO HBMI REPAIR TYRE IN 2 PLACES ON POS:4 ARRANGED BY BADEN FIELDING TRAVELLED TO HBMI. CARRIED OUT SERVICE AS PER SERVICE SCHEDULEL	157.5	190.47	0	26	373.97
071219-00	SVC000008	12/21/2007	1H0102	182WELDI	W	Trays/Buck	1ME737	1339	REPAIR CRACK AND STRENGTHEN	UNIT: 1ME737 ODOMETER: 1339 REPAIR CRACK AND STRENGTHEN	1123.75	0	0	0	1123.75
071217-00	18	12/18/2007	1H0102	182_INT	R	Trays/Buck	1ME737		REPAIR CRACK & STRENGTHEN		0	0	0	0	0
071004-00	SVC000002	12/10/2007	1H0102	184_INT	S	Service	1ME737		SERVICE S1 C	SUPPLY OIL FOR SERVICE BY KOMATSU AS REQUIRED	0	114.4	0	0	114.4
071210-00	SVC000002	12/10/2007	1H0102	184_INT	R	Brake	1ME737	1213 HRS	CHECK AND ADJUST HANDBRAKE	TRAVELLED TO CAMBRIDGE. CHECK OVER AND ADJUST HANDBRAKE	67.5	0	0	12.25	79.75

Applied filters:Posted_Date is on or after 01/01/1900Equipment_ID is 1ME737