

Service Job	Invoice No	Date	Customer Id	Cost Cent	Prob	Type of Call	Equip ID	Hrs	Kms	Job Description	Work Done	Labor Cost	Material Cost	Subcontractor Cost	Other Cost	Total Cost
97529	116885	09/10/2026	1HM105HBG	184G	S	Service Ear	1ME645	22071.000	0	PMI SERVICE	TRAVELLED TO HBMI CARRIED OUT PREDISPOSAL & INSPECTION AS REQUIRED - JUMP STARTED & CHECKED CHARGE RATE - ALL OK - CHECKED BATTERY HEALTH - FOUND TO BE U/S RETURNED TO WORKSHOP TO SOURCE REPLACEMENTS TRAVELLED BACK TO HBMI & REPLACED BATTERIES. - BATTERY HOLD DOWN CLAMPS BADLY CORRODED & SEIZED EXTRA TIME REQUIRED TO UN-SEIZE USING OXY TORCH. - REPLACED 2x BATTERY TERMINALS DUE TO BEING SEIZED & DAMAGED DURING REMOVAL.	668	861.5	0	390	1889.5
90674	109519	05/18/2026	1HM105HBG	105G	R	Electrical	1ME645	22064.000	0	REPLACE FAILED BATTERIES DUE TO AGE	1ME645 ODOMETER - 22064 HOURS JOB CARRIED OUT - REPLACE FAILED BATTERIES DUE TO AGE.	96	1089.4	0	0	1185.4
89169	107148	04/23/2026	1HM105HBG	105G	R	Engine	1ME645	22064.000	0	STARTING FAULTS - FUEL DRAIN BACK ISSUES		288	0	0	0	288
80061	95988	10/29/2025	1HM105HBG	105G	R	Tyres	1ME645	22000.000	0	REPLACE TYRES	1ME645	0	0	700	0	700
74606	89931	07/16/2025	1HM105HBG	105G	R	Hydraulic	1ME645	22000.000	0	CALL OUT - TRAY STUCK IN AIR	JOB CARRIED OUT - FIT TYRES. 1ME645 ODOMETER - 22000 HOURS JOB CARRIED OUT - CALL OUT - TRAY STUCK IN THE AIR. ON THE WAY TO SITE, RECEIVED A CALL TO CANCEL CALL OUT.	384	0	0	0	384
74426	90765	07/14/2025	1HM105HBG	105G	S	Service Ear	1ME645	22000.000	0	2000hr D Service	1ME645 ODOMETER - 22036 HOURS JOB CARRIED OUT - 2000 HOUR D SERVICE.	840	3516.78	1392.5	0	5749.28
74041	90738	07/07/2025	1HM105HBG	105G	S	Sundries	1ME645	21900.000	0	JULY PMI'S	1ME645 ODOMETER - 21900 HOURS JOB CARRIED OUT - CARRY OUT PMI'S.	384	82.8	0	0	466.8
73814	92235	07/02/2025	1HM105HBG	105G	R	Electrical	1ME645	21900.000	0	Replace Transmission sensor	1ME645 ODOMETER - 21900 HOURS JOB CARRIED OUT - REPLACE TRANSMISSION SENSOR.	96	498.89	0	0	594.89

73793	92208	07/02/2025	1HM105HBG	105G	R	Electrical	1ME645	21900.000	Indicators not operating correctly - Flasher unit	1ME645	192	231.7	0	0	423.7
										ODOMETER - 21900 HOURS					
										JOB CARRIED OUT - INDICATORS NOT OPERATING CORRECTLY. FIT NEW FLASHER UNIT AND TEST OPERATION.					
72566	88365	06/11/2025	1HM105HBG	105G	S	Sundries	1ME645	21900.000	JUNE - PMI	1ME645	96	0	240	60	396
										JOB CARRIED OUT - CARRY OUT PMI'S DURING JUNE.					
72567	87846	06/11/2025	1HM105HBG	105G	R	Electrical	1ME645	21900.000	ATTEND TO WORK LIGHTS FAULT CODE	1ME645	0	44.5	200	30	274.5
										ODOMETER - 21900 HOURS					
										JOB CARRIED OUT - WORK LIGHT FAULT CODE. FOUND A BROKEN WIRE ON THE HYD SENSOR. REPALCE WORK LIGHT.					
72161	87443	06/03/2025	1HM105HBG	105G	R	Electrical	1ME645	21894.000	NOT CHANGING UP GEARS	1ME645	0	0	160	30	190
										ODOMETER - 21894 HOURS					
										JOB CARRIED OUT - NOT CHANGING UP GEARS. CLEAN DIRT BUILD UP FROM UNDER BRAKE PEDAL STOPPING THE PEDAL FROM COMING ALL THE WAY UP, AND NOT ALLOWING IT TO CHANGE PAST SECOND GEAR.					
71850	87787	05/27/2025	1HM105HBG	105G	R	Electrical	1ME645	21819.000	Indicators Inoperative	1ME645	0	0	160	30	190
										ODOMETER - 21819 HOURS					
										JOB CARRIED OUT - INDICATORS INOPERATIVE, RH SIDE NOT FLASHING. TESTED FLASHER, SUSPECT LEVER ON STEERING IS FAULTY.					
70778	85333	05/07/2025	1HM105HBG	105G	R	Bodywork	1ME645	21819.000	ADJUST DRIVER DOOR LATCH	1ME645	144	0	0	30	174
										ODOMETER - 21819 HOURS					
										JOB CARRIED OUT - ADJUST DRIVERS SIDE DOOR LATCH.					
70387	86363	04/29/2025	1HM105HBG	105G	S	Sundries	1ME645	21773.000	May Monthly PMI's	1ME645	672	0	80	0	752
										JOB CARRIED OUT - CARRY OUT PMI'S DURING MAY.					
70293	84432	04/28/2025	1HM105HBG	105G	R	Sundries	1ME645	21773.000	REPLACE WIPERBLADE	1ME645	96	68.52	0	30	194.52
										ODOMETER - 21773 HOURS					
										JOB CARRIED OUT - REPLACE WIPER BLADE.					
70053	84498	04/17/2025	1HM105HBG	105G	R	Electrical	1ME645	21773.000	REPLACE BACKUP ALARM	1ME645	96	47.75	0	30	173.75
										ODOMETER - 21773 HOURS					
										JOB CARRIED OUT - REPLACE BACKUP ALARM.					

69314	84453	04/04/2025	1HM105HBG	105G	S	Service Ear		1ME645	21746.000	0	APRIL - PMI	1ME645	336	824.96	0	0	1160.96
													JOB CARRIED OUT - CARRY OUT PMI'S DURING APRIL.				
69315	83721	04/04/2025	1HM105HBG	105G	S	Service Ear		1ME645	21746.000	0	500 HR SERVICE AND BONNET LATCH REPAIRS	1ME645	312	454.04	0	30	796.04
													ODOMETER - 21746 HOURS				
													JOB CARRIED OUT - 500 HOUR SERVICE. BONNET LATCH UNABLE TO OPEN, ADJUST ROD.				
68557	82509	03/24/2025	1HM105HBG	105G	R	Hydraulic		1ME645	21660.000	0	REPAIR MULTIPLE OIL LEAKS	1ME645	1982.2	4980.46	240	100	7302.66
													JOB CARRIED OUT - REPAIR MULTIPLE OIL LEAKS.				
67810	82005	03/07/2025	1HM105HBG	105G	S	Sundries		1ME645	21660.000	0	MARCH PMI	1ME645	180.2	0	0	30	210.2
													JOB CARRIED OUT - CARRY OUT PMI.				
67184	80718	02/25/2025	1HM105HBG	105G	S	Sundries		1ME645	21660.000	0	CARRY OUT FEBRUARY PMI	1ME645	135.15	0	0	30	165.15
													ODOMETER - 21660 HOURS				
													JOB CARRIED OUT - CARRY OUT PMI.				
66699		02/18/2025	1HM105HBG	105G	R	Air Con		1ME645	21581.000	0	PARTS MISSED FROM CALL 62146	1ME645	0	0	0	0	0
													JOB CARRIED OUT - PARTS MISSED FROM CALL 62146.				
66477	80732	02/13/2025	1HM105HBG	105G	R	Tyres		1ME645	21581.000	0	REPLACE X4 TYRES	1ME645	0	0	13593	0	13593
													JOB CARRIED OUT - SUBLET FITTED X4 NEW TYRES.				
66387	79748	02/12/2025	1HM105HBG	105G	R	Suspensior		1ME645	21581.000	0	REPLACE REAR STABILIZER ARM BUSHES	1ME645	1260.87	1786.62	0	60	3107.49
													ODOMETER - 21581 HOURS				
													JOB CARRIED OUT - REPLACE REAR STABALISER ARM BUSHES.				
66182	79524	02/07/2025	1HM105HBG	182G	R	Sundries		1ME645	21581.000	0	WELD AIRCON FITTING		180.2	0	0	20	200.2
65912	82589	02/03/2025	1HM105HBG	105G	R	Air Con		1ME645	21581.000	0	INSPECT FOR A/C INOPRABLE	1ME645	0	0	1187.95	30	1217.95
													ODOMETER - 21581 HOURS				
													JOB CARRIED OUT - INSPECT FOR A/C INOPERABLE. LEAKIGN HOSE FROM COMPRESSOR TO THE CONDENSOR. DIG OUT PRODUCT AROUND HOSE. MAKE AND FIT NEW HOSE. VACUUM SYSTEM AND LEAK TEST. NO LEAKS FOUND, REGAS SYSTEM.				
65441	80747	01/24/2025	1HM105HBG	105G	R	Hydraulic		1ME645	21581.000	0	Replace hydraulic hose	1ME645	180.2	57.12	0	0	237.32
													JOB CARRIED OUT - REPLACE HYDRAULIC HOSE.				
64122	79546	01/17/2025	1HM105HBG	105G	R	Brake		1ME645	21581.000	0	Reseal Final Drive/Brake Assembly	1ME645	4685.2	7017	240	0	11942.2
													ODOMETER - 21581 HOURS				
													JOB CARRIED OUT - RESEAL FINAL DRIVE/BRAKE ASSEMBLY.				

64141	78128	01/17/2025	1HM105HBG	105G	S	Service Ear	1ME645	21581.000	0	CARRY OUT SERVICE	1ME645	1036.15	1327.03	0	30	2393.18
											ODOMETER - 21581 HOURS					
63650	77218	01/08/2025	1HM105HBG	105G	R	Bodywork	1ME645	21581.000	0	REPAIR TAILGATE	1ME645	315.35	0	0	200	515.35
											JOB CARRIED OUT - CARRY OUT SERVICE.					
											1ME645					
											JOB CARRIED OUT - REFITTED TAIL GATE OBTO PIVOT PIN. CLEANED AND REMOVED WELDS. MADE NEW RETAINER WASHER AND WELDED TO PIN.					
63119	76336	12/17/2024	1HM105HBG	105G	R	Sundries	1ME645	21355.000	0	RESEAL TAILGATE	1ME645	1261.4	0	0	300	1561.4
											JOB CARRIED OUT - RESEAL TAILGATE.					
62940	78871	12/13/2024	1HM105HBG	105G	R	Hydraulic	1ME645	21355.000	0	Replace hydraulic hose	1ME645	180.2	320.83	0	30	531.03
											JOB CARRIED OUT - REMOVE ND REPLACE HYD RETURN HOSE TO LIFT CYLINDER.					
62150	76334	11/28/2024	1HM105HBG	105G	S	Sundries	1ME645	21355.000	0	Weekly PMI	1ME645	608.18	0	0	0	608.18
											JOB CARRIED OUT - CARRY OUT PMI'S DURING NOVEMBER.					
62146	77498	11/28/2024	1HM105HBG	184G	INT-R	Air Con	1ME645	21355.000	0	REPLACE AIR CON CONDENSER/RECEIVER DRYER		606.32	0	880	0	1486.32
61496	74417	11/18/2024	1HM105HBG	184G	R	Electrical	1ME645	0.0000	21441	Repalce Accumulators Sensors x2	REPLACED ACUMULATOR SENSORS TO REPAIR FOULTS ON DAHS	373.12	2278.53	0	57.5	2709.15
											TEST OPERATION ALL OK					
61241	74938	11/13/2024	1HM105HBG	105G	R	Bodywork	1ME645	21355.000	0	Guard repairs	1ME645	2162.4	0	0	30	2192.4
											JOB CARRIED OUT - CARRY OUT REPAIRS TO GUARD.					
61184	73119	11/12/2024	1HM105HBG	184G	R	Sundries	1ME645	21355.000	0	Part missed off service job # 55958. Park brake Switch		0	1561.28	0	0	1561.28
60839	74180	11/05/2024	1HM103HBG	184G	R	Sundries	1ME645	0.0000	21441	REPAIR EXHAUST & WIRING FAULTS	- REPLACE EXHASUT MUFFLER	1699.19	70.97	0	100	1870.16
											FAIR BIT OF WORK INVOLVED IN DOING SO DUE TO CONITION/ENVIRONMENT MACHINE WORKS IN					
											- MOUNTED NEW WIRING HARDNESS FOR BRAKE ACUMULATORS/PARK BRAKE					
											- REPLACED PARK BRAKE SOLENOID					
											- ADJUST PARK BRAKE AND TESTED ALL OK					
											CHECKED PARK BRAKE COMPONENTS DUE TO IT BEING DRIVEN THROUGH PARK BRAKE TO WORKSHOP WORKING OKAY					
59738	71804	10/14/2024	1HM103HBG	105G	R	Electrical	1ME645	21355.000	0	TAIL LIGHT BRACKET	1ME645	500.32	0	0	0	500.32
											ODOMETER - 21355 HOURS					
											JOB CARRIED OUT - CALL IN - REPAIR TAIL LIGHT BRACKET, REPAIRED MOUNTS AND CONFIRMED OPERATION.					

59407	72428	10/07/2024	1HM103HBG	182G	R	Sundries	1ME645	21355.000	0	FIT NEW TAILGATE SEAL	TRAVEL TO SITE TO MEASURE AND PLAN OUT REPAIRS TO RESEAL TAILGATE. CUT AND REMOVE OLD SEAL RETAINER REMNANTS AND CLAMPING FLAT BAR SYSTEM. CUT AND FABRICATE NEW CLAMPING BAR WITH RETAINER NUT WELDED TO THE INSIDE. FIT AND WELD FIXED CLAMPING BAR TO THE TAILGATE SECTION. CUT AND FIT RUBBER SEAL TO SUIT PROFILE OF TAILGATE. FIT AND BOLT TOP CLAMPING BAR TO HOLD SEAL INTO POSITION. FIT CORNER HOLDING BARS TO SUPPORT THE ANGLE CHANGE AND PUSH THE SEAL INTO THE TRAT CORNERS. TEST AND COMPLETE FINAL INSPECTION.	1750.59	157.6	0	220	2128.19
58795	72240	09/25/2024	1HM103HBG	184G	S	Service Ear	1ME645	21355.000	0	CARRY OUT PMI INSPECTION	CARRY OUT PMI AND MINOR REPAIRS	186.56	161.71	0	60	408.27
58533	70470	09/19/2024	1HM103HBG	184G	R	Electrical	1ME645	21355.000	0	ELETRICAL REPAIRS	INSPECT LIGHTING FAULTS FIT LED HEADLIGHTS OFF 1ME780 REPLACED WOIRKLIGHT, REPAIRED WIRING FAULT FIT DEUSTCH PLUGS TO HEADLIGHTS CHECKED OIL PRESSURE FAULT CODE TESTED OIL PRESSURE SWITCES AND ENGINE BAY WIRING FOUND SWITCHES TO BE FAULTY, REMOVE AND REPLACED	93.28	218.6	0	200	511.88
58125	70220	09/10/2024	1HM103HBG	184G	R	Drive Line	1ME645	21355.000	0	WONT SELECT GEARS @ NYSTAR	INSPECT REPORTED FAULT CLEAN OUT PRODUCT AND GREASE TEST ALL OK	373.12	0	0	20	393.12
58136	73672	09/10/2024	1HM103HBG	184G	S	Service Ear	1ME645	0.0000	142589	A SERVICE + FUEL FILTERS - 21,357 HRS	CARRY OUT SERVICE AND VEHICLE INSPECTION. CHECK ALL LIGHTS, CHECK FLUID LEVELS. CHECK SUSPENSION, BRAKES AND TYRES NOTES: STEERING CYLINDERS HAVE LOTS OF MOVEMENT NO FRONT PARK OR LOW BEAM X1 HIGH BEAM INOP X1 REAR PARK/BRAKE INOP X1 REVERSE LIGHT INOP DRIVERS SIDE WHEEL ARCH/FLARE RUSTED/FALLING OFF REAR LOWER SUSPENSION STRUT NIPPLES WONT TAKE GREASE NO FIRE EXTINGUISHER ON THE MACHINE MANIFOLD HEAT SHEILD IS CRACKED AIRBOX LID CLIP IS MISSING	326.48	585.5	0	85	996.98
56191	68345	08/05/2024	1HM103HBG	105G	S	Service Ear	1ME645	20419.000	0	PMI AUGUST	1ME645 ODOMETER - 20419 HOURS JOB CARRIED OUT - CARRY OUT PMI'S DURING AUGUST.	180.2	0	0	50	230.2

55958	72198	07/30/2024	1HM103HBG	105G	R	Electrical	1ME645	20419.000	0	DIAGNOSE PARK BRAKE FAULT	1ME645	1361.04	0	880	40	2281.04
											ODOMETER - 20419 HOURS					
											JOB CARRIED OUT - DIAGNOSE PARK BRAKE FAULT. BACK PARK BRAKE OFF SO TRUCK COULD BE TAKEN TO THE WORKSHOP. TEST CIRCUIT, FOUND NO POWER GETTING TO THE BRAKE VALVE. USE WIRING DIAGRAM TO LOCATE CIRCUIT FROM THE SWITCH TO THE VALVE. FOUND CORROSION IN PLUG UNDER THE CAB, CAUSING AN OPEN CIRCUIT. THE FRONT ACCUMULATOR PRESSURE SWITCH HAS FAILED. REPLACE PRESSURE SWITCH, PARK BRAKE NOW WORKING OK.					
55800	66599	07/29/2024	1HM103HBG	105G	R	Hydraulic	1ME645	20419.000	0	CALL OUT FOR BRAKE OIL OVERHEATING	1ME645	413.4	0	0	0	413.4
											ODOMETER - 20419 HOURS					
											JOB CARRIED OUT - CALL OUT - INSPECT BRAKE OIL TEMP. FOUND ALL TEMPS WITHIN RANGE. INSPECTED GAUGE AND FOUND FAULT WITH TEMP GAUGE FOR BRAKE OIL.					
55791	66596	07/29/2024	1HM103HBG	105G	R	Electrical	1ME645	20419.000	0	INSPECTION FOR NO REVERSE ALARM	1ME645	90.1	0	0	0	90.1
											ODOMETER - 20419 HOURS					
											JOB CARRIED OUT - INSPECT FOR NO REVERSE ALARM.					
54467	67506	07/03/2024	1HM103HBG	105G	R	Hydraulic	1ME645	20419.000	0	repair failed brake hose	1ME645	405.45	674.83	0	50	1130.28
											JOB CARRIED OUT - REPAIR FAILED BRAKE HOSE. CARRY OUT INSPECTION AND REPORT ON MACHINE	2351.09	0	0	60	2411.09
53088	64907	06/05/2024	1HM103HBG	182G	R	Sundries	1ME645	20419.000	0	REPAIR LEAKING HYDRAULIC TANK	TRAVEL TO NYRSTAR AND COMPLETE TEMP REPAIRS ON LEAKING OIL TANK	4687.99	329.12	0	150	5167.11
											MACHIN EBOUGHT TO WORKSHOP CUT AND REMOVE SIDE OF OIL TANK CLEAN OUT TANK AND ALL RUSTED AREAS FABRICATE AND FIT NEW PLATE IN TANK WELD NEW SECTION INTO POSITION PRESSURE TEST TANK FOR LEAKS PREP AND PAINT WELDED AREAS REASSEMBLE AND REFILL WITH OIL					
52403	64774	05/23/2024	1HM103HBG	184G	R	Sundries	1ME645	0.0000	21094	Replace hydraulic temp sensor	CARRY OUT TESTS AND HYDRAULIC TEMP SENSOR FOUND U/S REMOVE AND REPLACED, TEST ALL OK REPAIRED WINDSCREEN WASHER	326.48	806.95	0	40	1173.43

50992	61261	04/23/2024	1HM103HBG	184G	INT-R	Air Con	1ME645	0.0000	0	REPAIR AIR CON SYSTEM	INSPECT FOR REPORTED A/C NOT WORKING - WAS TOLD BY NYRSTAR IT HAS A LEAKING AVAPORATOR - REMOVED INTERIOR EXTENSIVELEY TO ACCESS - NO LEAKS FOUND - RESEALED EVAPORATOR AND REPLACED O-RINGS WHILST PULLED APART - PRESSURE TEST SYSTEM, FOUND LEAKING HOSE AT CONDENSOR - REPLACEDMENT HOSES EX JAPAN. - CUT HOSE FITTINGS OFF AND HAD FLARES WELDED ON, ADDITIONAL TIME SPENT FITTING AND REMOVING HOSE AS WELD KEPT LEAKING - GASED SYSTEM - REFITTED INTERIOR - TEST OPERATION ALL OK	3264.15	91.68	0	306	3661.83
50385	59728	04/11/2024	1HM103HBG	184G	R	Sundries	1ME645	20419.000	0	Missed off job number 46167	NOTES: GENUINE HOSES TO BE ORDERED AND REPLACED	0	208.46	0	0	208.46
49831	59558	03/28/2024	1HM103HBG	186G	R	Air Con	1ME645	20419.000	0	Check A/C operation.	INSPECTED AND REPAIRED A/C SYSTEM.	132	0	0	0	132
48548	57599	03/22/2024	1HM103HBG	105G	R	Air Con	1ME645	20419.000	0	DIAGNOSE A/C LOW GAS	1ME645	0	0	120	50	170
47969	57159	03/12/2024	1HM103HBG	105G	R	Air Con	1ME645	20419.000	0	ATTEND TO AIR CONDITIONING	JOB CARRIED OUT - REGAS A/C SYSTEM. 1ME645	0	0	160	0	160
46866	55768	02/20/2024	1HM103HBG	105G	R	Air Con	1ME645	20419.000	0	DIAGNOSE A/C FAULT	JOB CARRIED OUT - TEST A/C, FOUND IT LOW IN GAS. TEST FOR LEAKS, FOUND THE PIPE TO THE EVAPORATOR LEAKING. 1ME645	0	0	640	0	640
46642	56927	02/15/2024	1HM103HBG	182G	R	Sundries	1ME645	20419.000	0	REMOVE BROKEN BOLT FROM AXLE	JOB CARRIED OUT - TEST A/C, FOUND LOW IN GAS. USE HYDROGEN TRACE GAS TO FIND TWO LEAKING O-RINGS SOLID LINE TO THE EVAPORATOR LEAKING. FIT NEW O-RINGS AND VACUUM SYSTEM. ADD LEAK ADDITIVE. REMOVE BROKEN BOLT FROM AXLE - PACK TRUCK & TRAVEL TO NYSTAR, HEAT HOUSING & TRY TO REMOVE BOLT, REMOVE WHEEL FOR BETTER ACCESS, REHEAT HOUSING & REMOVE BOLT, PUT IN NEW BOLT & TIGHTEN	746.5	0	300	40	1086.5
46275		02/07/2024	1HM103HBG	105G	R	Air Con	1ME645	20419.000	0	REPLACE EVAPORATOR	1ME645	0	0	0	0	0
46167	55929	02/06/2024	1HM103HBG	184G	S	Service Ear	1ME645	0.0000	20931	Carry out C Servie 1,000h	JOB CARRIED OUT - REPLACED FAILED EVAPORATOR. CARRIED OUT 1000HR C SERVICE AS REQUIRED.	1741.5	2145.71	0	110	3997.21
46052		02/05/2024	1HM103HBG	105G	INT-R	Bodywork	1ME645	20419.000	0	HOOD LATCH WILL NOT OPEN	- REPLACED LOOSE CROSS MEMBER BOLTS. 1ME645	0	0	0	0	0
											JOB CARRIED OUT - REMOVED SEIZED BONNET LATCH.					

46055	54920	02/05/2024	1HM103HBG	105G	R	Electrical	1ME645	20419.000	0	INSPECT FOR UNIT NOT STARTING	CC105 - 1ME645	552.5	0	0	50	602.5
											JOB CARRIED OUT - INSPECT FOR UNIT NOT STARTING, FOUND BROKEN TERMINAL TO STARTER RELAY, FITTED KNOWN GOOD RELAY.					
45932	59533	02/01/2024	1HM103HBG	105G	R	Service Ear	1ME645	20419.000	0	REPLACE 300AMP BATTERY RELAY	1ME645	675	696.44	0	50	1421.44
											JOB CARRIED OUT - REPLACE 300 AMP BATTERY RELAY.					
45531	62028	01/23/2024	1HM103HBG	184G	R	Sundries	1ME645	20419.000	0	SUPPLY ONLY NUTS, BOLTS PINS ETC		0	1356.44	0	0	1356.44
45138	55359	01/15/2024	1HM103HBG	184G	R	Sundries	1ME645	20419.000	0	PMI	CARRIED OUT PMI AS REQUIRED. REPORTED FINDINGS TO SUPERVISOR.	1629.25	761.62	0	90	2480.87
43666	53937	12/04/2023	1HM103HBG	182G	INT-R	Trays/Buck	1ME645	0.0000	0	TRAVEL TO IMPACT & EPAIRS TO TAILGATE SEAL	TRAVEL TO SITE AND REPAIR BEANT AND LEAKING TAILGATE SEAL.	264	0	0	95	359
42499	51557	11/10/2023	1HM103HBG	105G	S	Service Ear	1ME645	20419.000	0	PMI FOR NOVEMBER	1ME645 - KOMATSU HM300-1	425	0	0	0	425
											JOB CARRIED OUT - NOVEMBER PMI'S					
42222	51190	11/06/2023	1HM103HBG	105G	R	Differential	1ME645	20419.000	0	ADD ADDITIVE TO DIFFS	1ME645	85	0	0	0	85
											JOB CARRIED OUT - PUT DIFF ADDITIVE IN DIFFS.					
42242	52017	11/06/2023	1HM103HBG	184G	R	Hydraulic	1ME645	0.0000	20753	Re-Seal LHS Steering cylinder	REMOVED AND RESEALED LHS STEER CYLINDER	1590.75	360	0	100	2050.75
41802	51130	10/26/2023	1HM103HBG	105G	R	Service Ear	1ME645	20419.000	0	SERVICE AS REQUIRED AND REPAIR DRIVE CONCERN	1ME645	425	687.4	0	30	1142.4
											JOB CARRIED OUT - CARRY OUT SERVICE. REPAIR DRIVE CONCERN.					
41636	49925	10/23/2023	1HM103HBG	105G	R	Electrical	1ME645	20419.000	0	ATTEND TO REVOLVING LIGHT INOP	1ME645	0	74.7	80	0	154.7
											JOB CARRIED OUT - REPLACE FAILED REVOLVING LIGHT. REPAIR BREAK IN POWER SUPPLY.					
41224	49040	10/16/2023	1HM103HBG	105G	R	Electrical	1ME645	20419.000	0	DIAGNOSE TRANS FAULT CODES	1ME645	0	0	408.48	0	408.48
											JOB CARRIED OUT - CALL OUT NO DRIVE. TEST OPERATION, FAULT CODE PRESENT ON DASH. CHECK CODES IN BOOK, CLUTCH 1 AND 2 NOT ENGAGING. RETURN TO TRUCK, FAULT CODES ARE NOW INACTIVE. CLEAR CODES AND TEST DRIVE.					
40395	49933	09/28/2023	1HM103HBG	105G	R	Sundries	1ME645	20419.000	0	PMI OCTOBER	1ME645	595	26.2	120	0	741.2
											JOB CARRIED OUT - CARRY OUT PMI'S DURING OCTOBER.					
39328	46093	09/07/2023	1HM103HBG	105G	R	Electrical	1ME645	20419.000	0	replace failed alternator motor	1ME645	340	691	0	128.48	1159.48
											JOB CARRIED OUT - CALL OUT - REPLACE FAILED ALTERNATOR.					
39080	46512	09/04/2023	1HM103HBG	105G	R	Sundries	1ME645	20419.000	0	complete weekly pmi inspections	1ME645	425	0	0	0	425
											JOB CARRIED OUT - CARRY OUT PMI'S DURING SEPTEMBER.					
37394	44978	07/31/2023	1HM105HBG	105G	S	Service Ear	1ME645	20419.000	0	PMI AS REQUIRED	1ME645	170	0	0	0	170
											JOB CARRIED OUT - CARRY OUT PMI'S DURING AUGUST.					
36799	43364	07/19/2023	1HM103HBG	184G	R	Sundries	1ME645	0.0000	0	ACCUMULATOR LABOUR MISSED OFF JOB 25675 - KOMATSU		0	2053.35	0	0	2053.35

35022	41488	06/19/2023	1HM103HBG	184G	R	Sundries	1ME645	0.0000	0	CHECK WIPER FAULT	TRAVELLED TO IMPACT & INSPECTED REPORTED WIPER FAULT CARRIED OUT TEMPORARY REPAIR & ORDERED NEW HEAD PACKED UP & RETURNED TO WORKSHOP	214.08	0	0	25	239.08
32421	38197	05/16/2023	1HM103HBG	182G	R	Exhaust	1ME645	20361.000	0	REPAIR EXHAUST / REPAIR CRACKS IN TRAY	FABRICATE TEMPLATE AND JIG ON BENCH OF WORN EXHAUST SECTION. CUT AND PROCESS MATERIALS AND ELBOW SECTIONS. FABRICATE NEW EXHAUST IN JIG. FIT NEW FLANGES. WELD OUT. FIT UP TO TRUCK. INSPECT TRAY FOR CRACKING AND WEAR. WELD REPAIR VARIOUS CRACKING IN AND AROUND REAR PIVOT AND BACK SECTION OF TRAY. PAINT ALL WELD REPAIRS.	2506.2	365	0	100	2971.2
32058	38246	05/10/2023	1HM103HBG	184G	S	Service Ear	1ME645	20361.000	0	CARRY OUT A SERVICE	CARRIED OUT SERVICE & VEHICLE INSPECTION. CHECKED ALL LIGHTS, CHECKED FLUID LEVELS. CHECKED SUSPENSION, BELTS, BRAKES & TYRES. ROAD TESTED - ALL OK AT TIME OF TESTING	256.89	719.56	0	15	991.45
32059	39635	05/10/2023	1HM103HBG	184G	R	Sundries	1ME645	20361.000	0	CARRY OUT REPAIRS AS PER FAULT SHEET	MOVED TO WASH BAY & STEAM CLEANED, MOVED INTO WORKSHOP - REMOVED & REPLACED O-RINGS ON LH FRONT & LH MIDDLE FINAL DRIVE PINS & REFILLED OIL. - REPAIRED EXHAUST LEAK AT RH SIDE OF CAB (HAD TO REMOVE SIGNIFICANT PRODUCT BUILD-UP TO ACCESS) - REMOVED & RESEALED LH STEER CYLINDER - CHECKED TAILGATE SEAL & BEARINGS, REWELDED CAP / COVER ON TAILGATE BEARING HOUSING ON RH SIDE OF MACHINE. TESTED OPERATION - ALL OK TESTED FOR BEARING MOVEMENT - ALL OK	4591.15	585.6	605.93	75	5857.68
31441	36161	04/27/2023	1HM103HBG	181G	R	Bodywork	1ME645	0.0000	0	SANDBLAST AND REPAIR EXHAUST	TAKE EXHAUST TO SANDBLASTERS AND HAVE IT BLASTED WELD UP EXHAUST AND PAINT BLACK	413.85	130.59	0	20	564.44
31170	35915	04/20/2023	1HM103HBG	184G	R	Electrical	1ME645	0.0000	0	CHECK LIGHTS ON DASH	INSPECTED FOR REPORTED FAULT LIGHT/S ON DASH - UNABLE TO FAULT. SUSPECT TO BE BRAKE PRESSURE ALARM ON FIRST START UP. SENT BACK TO WORK ON TEST	55.23	0	0	0	55.23
28979	33666	03/27/2023	1HM103HBG	184G	R	Sundries	1ME645	20161.000	0	TAIL GATE REPAIRS	TRAVEL TO IMPACT, INSPECT AND REPAIRED TAILGATE BRACKET	226.49	0	0	25	251.49
28684	33651	03/20/2023	1HM103HBG	105G	R	Service Ear	1ME645	19927.000	0	MARCH PMI	1ME645 JOB CARRIED OUT - CARRY OUT PMI.	82.77	0	0	0	82.77
28239	33051	03/09/2023	1HM103HBG	182G	R	Sundries	1ME645	19927.000	0	LANCE OUT PIN	LANCE OUT PIN - TRAVEL TO MPWTS & LANCE OUT LIFT CYLINDER PIN, REMOVE PIN, REMOVE LIFT CYLINDER & RETURN CYLINDER TO WORKSHOP FOR REPAIR	379.76	0	0	64	443.76
28114	33079	03/07/2023	1HM103HBG	182G	INT-R	Milling	1ME645	0.0000	0	REPAIR BEARING BORE LH SIDE LIFT CYLINDER TUBE END	REPAIR BEARING BORE LH SIDE LIFT CYLINDER TUBE END	990.92	0	0	100	1090.92

28019	35110	03/06/2023	1HM103HBG	186G	R	Electrical	1ME645	0.0000	19817	Tracker	CHECKED TRACKER, FOUND POOR RECEPTION REPLACED TRACKER 8407 WITH NEW TRACKER 18731 RELOCATED TRACKER TO BELOW STEP TESTED - ALL OK AT TIME OF TESTING	517.17	399.54	0	55	971.71
27950	35992	03/02/2023	1HM103HBG	184G	R	Hydraulic	1ME645	0.0000	0	Repair Lift and Steer Cylinders	INSPECT REPORTED LIFT FAULT. FOUND FAULT WITH LIFT CYLINDER BEARING, UNABLE TO REMOVE FAB SHOP TO ATTEND SITE AND CUT OFF DAMAGED CYLINDER. REPLACE U/S BEARING AND REFIT REPAIRED CYLINDER	1376.93	1216.91	0	240	2833.84
25675	35987	02/06/2023	1HM103HBG	184G	R	Brake	1ME645	0.0000	0	Repair / Reseal Accumulator	Seal Kit payed on credit card due to stop credit with Komatsu - \$770 + GST KOMATSU INVOICE 003080649	0	0	0	709	709
25086	29428	01/23/2023	1HM103HBG	105G	R	Brake	1ME645	19927.000	0	diagnose brake fault clean around pedals	1ME645	289.7	243.65	0	0	533.35
24840		01/17/2023	1HM103HBG	105G	INT-R	Hydraulic	1ME645	19927.000	0	REPAIR HYDRAULIC HOSE LEAK	JOB CARRIED OUT - DIAGNOSE BRAKE FAULT. CLEAN AROUND PEDALS. CHISEL AND VACUUM ALL PRODUCT BUILD UP. FILLED TRANS OIL. 1ME645	0	0	0	0	0
23496	31377	12/06/2022	1HM103HBG	105G	R	Sundries	1ME645	19927.000	0	MONTHLY PMI INSPECTION DECEMBER	JOB CARRIED OUT - REPAIR HYDRAULIC HOSE. 1ME645	620.78	0	0	0	620.78
23234	28578	11/30/2022	1HM103HBG	184G	INT-S	Service Trai	1ME645	0.0000	0	S1 D SERVICE	JOB CARRIED OUT - CARRY OUT PMI'S DURING DECEMBER. COMPLETE D SERVICE	1071.62	3768.16	0	40	4879.78
22469	26822	11/14/2022	1HM103HBG	105G	R	Sundries	1ME645	19927.000	0	COMPLETE MONTHLY PMI INSPECTION	1ME645	289.7	0	0	0	289.7
20221	34309	09/23/2022	1HM103HBG	182G	R	Trays/Buck	1ME645	19927.000	0	STRAIGHTEN LUGS ON REAR OF TRAY	JOB CARRIED OUT - CARRY OUT MONTHLY PMI INSPECTIONS DURING NOVEMBER. HEAT AND STRAIGHTEN REAR TRAY LOCKING LUGS	141.84	0	0	40	181.84
19691	33678	09/12/2022	1HM103HBG	184G	INT-R	Differential	1ME645	0.0000	0	REPAIR FINAL DRIVE OIL LEAKS	RESEAL LEAKING FINAL DRIVES	3158.4	753.6	0	35	3947
19261	23014	09/02/2022	1HM103HBG	105G	R	Sundries	1ME645	19927.000	0	SEPTEMPER MONTHLY PMIS	1ME645	82.77	0	0	0	82.77
18305	21381	08/15/2022	1HM103HBG	184G	R	Electrical	1ME645	19927.000	0	INSPECT BATTERIES	JOB CARRIED OUT - CARRY OUT PMI'S DURING SEPTEMBER. INSPECTED BATTERIES AND CHECKED OVER MACHINE TRAVEL NYRSTAR	128.45	0	0	15	143.45
18111	21838	08/09/2022	1HM103HBG	105G	S	Service Ear	1ME645	19927.000	0	AUGUST PMI'S	1ME645	413.85	0	0	0	413.85
17978	20737	08/08/2022	1HM103HBG	105G	R	Electrical	1ME645	19925.000	0	ATTEND TO WARNING LIGHTS	JOB CARRIED OUT - CARRY OUT PMI'S DURING AUGUST. 1ME645	82.77	0	0	0	82.77
17282	20695	07/22/2022	1HM103HBG	105G	R	Sundries	1ME645	19917.000	0	COMPLET JULY MONTHLY PMIS	JOB CARRIED OUT - ATTEND TO WARNING LIGHTS ON DASH. CAPTURED FAULT CODE, QUERIED WORKSHOP MANUAL. 1ME645	538.01	350.6	0	100	988.61
											JOB CARRIED OUT - CARRY OUT PMI'S DURING JULY. FIT NEW ASSET ID NUMBERS.					

17177	19560	07/20/2022	1HM103HBG	105G	R	Electrical	1ME645	19917.000	0	REPAIR WIRING TO REVOLVING LIGHTS	1ME645	165.54	0	0	0	165.54
											JOB CARRIED OUT - REPAIR WIRING TO REVOLVING LIGHTS.					
17036	19553	07/18/2022	1HM103HBG	105G	R	Electrical	1ME645	19917.000	0	diagnose e03 tray potentiometer	1ME645	0	0	528.47	0	528.47
											JOB CARRIED OUT - CALL OUT - E03 FAULT CODE. TRAY UP POTENTIOMETER OUT OF SPEC. HOOK UP MULTIMETER AND ADJUST BACK INTO RANGE.					
15105	25024	06/02/2022	1HM103HBG	184G	R	Sundries	1ME645	0.0000	0	INSPECT CODE ON DISPLAY	INSPECT CODE ON DISPLAY, REMOVE PRODUCT BUILD UP AROUND TRAY POTENTIOMETRE TRAVEL NYRSTAR AND RETURN	93.26	0	0	20	113.26
14813	16842	05/27/2022	1HM103HBG	121G	R	Tyres	1ME645	19886.000	0	SUPPLY AND FIT TYRES - BSELECT MOONAH	SUPPLY AND FIT 2 NEW TYRES TO POS 1 & 2 ROTATE POS 1 & 2 TYRES AND FOR TO POS 5 & 6	0	8067.82	0	0	8067.82
14591	16834	05/23/2022	1HM103HBG	105G	R	Sundries	1ME645	19886.000	0	COMPLETE PMI INSPECTION	1ME645	76.01	0	105	0	181.01
											JOB CARRIED OUT - CARRY OUT PMI'S DURING MAY.					
14312		05/17/2022	1HM103HBG	105G	INT-R	Sundries	1ME645	19886.000	0	SUPPLY AND FIT NEW SEAT BELT	1ME645	0	0	0	0	0
											JOB CARRIED OUT - SUPPLY AND FIT NEW SEAT BELT.					
14103	16027	05/12/2022	1HM103HBG	184G	R	Brake	1ME645	0.0000	0	REPAIR BRAKE ISSUES	INSPECT HIGH BRAKE OIL TEMPERATURE ISSUE, INSPECT SENSOR AND TESTED OK. INSPECT WIRING AND FOUND BROKEN WIRES AT BACK OF CENTRE DIFFERENTIAL, REPAIRE WIRING AND UNIT TESTED OK REMOVE REAR BRAKE ACCUMULATOR , DISMANTLE ,CLEAN PARTS AND REASSEMBLE WITH NEW PISTON AND SEALS. REFIT ACCUMULATOR TO MACHINE AND RECHARGE WITH NITROGEN, TEST OPERATE MACHINE AND TESTED OK TRAVEL NYRSTAR AND RETURN TWICE	1114.85	13.58	0	76.1	1204.53
12239	14569	03/28/2022	1HM103HBG	186G	S	Service Ear	1ME645	19882.000	133512	PMI inspection	INSPECT FLUIDS & GREASE	114.02	0	0	5	119.02
11971	13671	03/21/2022	1HM103HBG	181G	R	Bodywork	1ME645	19882.000	133512	REPAIRS TO BONNET AND LHS DOOR LOCK	REMOVE BONNET FROM TRUCK CUT OUT DAMAGED SECTION OF RHS AND WELD IN NEW SECTION IN FRONT OF BONNET REPAIR HINGES AND REFIT BONNET TO TRUCK FIT NEW LOCK TO LHS DOOR ON CAB	2257.23	389.02	0	30	2676.25
10614	14720	02/18/2022	1HM103HBG	105G	R	Electrical	1ME645	19805.000	0	REPLACE FAILED BATTERY ISOLATOR	1ME645	0	149.01	0	0	149.01
											JOB CARRIED OUT - PARTS ONLY - SUPPLY BATTERY ISOLATOR.					
10039		02/07/2022	1HM103HBG	105G	R	Sundries	1ME645	19805.000	0	REPLACED FAILED SEAT	1ME645	0	0	0	0	0
											JOB CARRIED OUT - REMOVE AND FIT UP SEAT. COMPLETE PMI.					
9980	12447	02/04/2022	1HM103HBG	184G	R	Bodywork	1ME645	0.0000	0	REPLACE DAMAGED OPERATORS SEAT	SUPPLY NEW OPERATORS SEAT SEAT FITTED AT NYRSTAR	0	3683.1	0	0	3683.1
9911		02/03/2022	1HM103HBG	105G	R	Sundries	1ME645	19805.000	0	1ME645 COMPLETE PMI	1ME645	0	0	0	0	0
											JOB CARRIED OUT - CARRY OUT PMI.					

9921		02/03/2022	1HM103HBG	105G	R	Air Con	1ME645	19805.000	0	1ME645 SERVICE A/C	1ME645	0	0	0	0	0
8294	9401	12/17/2021	1HM103HBG	184G	S	Service Ear	1ME645	19805.000	0	S1 A SERVICE	JOB CARRIED OUT - TEST OPERATION OF A/C. ALL WORKING CORRECTLY. VENT TEMP 10C. CARRY OUT S1 A SERVICE AS PER SERVICE SHEET TRAVEL NYRSTAR	256.26	284.86	0	22.25	563.37
8275	10258	12/16/2021	1HM103HBG	184G	R	Electrical	1ME645	19805.000	0	INSPECT E03 ERROR CODE ON DISPLAY	REPLACE LIFT CYLINDER GREASE NIPPLE INSPECT CODES ON DISPLAY , FOUND CODE FOR ALTERNATOR COMING ON AT START UP BUT ALTERNATOR CHARGING, FOUND REAR BRAKE ACCUMULATOR LOW ON GAS. RECHARGED ACCUMULATOR AND FOUND OK A COUPLE OF DAYS LATER TRAVEL NYRSTAR AND RETURN TWICE SEALS FOR ACCUMULATOR SUPPLIED ON THIS JOB, WILL RESEAL ACCUMULATOR AFTER NEXT OUTLOAD	341.68	595.79	0	34.5	971.97
7372	14163	11/29/2021	1HM103HBG	105G	R	Sundries	1ME645	19555.000	0	ASSESS FAULT CODE DK54KX	1ME645	114.02	1106.03	583.48	0	1803.53
6732	8716	11/11/2021	1HM103HBG	184G	R	Electrical	1ME645	0.0000	19716	INSPECT ENGINE BOOST SENSOR ISSUE	JOB CARRIED OUT - ASSESS FAULT CODE DK54KX. TEST HARNESS AS PER WORK INSTRUCTIONS. FOUND THE POTENTIOMETER FOR TRAY UP HAS FAILES. FIT NEW POTENTIOMETER. INSPECT OIL LEAKS AND REPLACE LEAKING HYDRAULIC COUPLINGS INSPECT BOOST SENSOR FAULT, TRACED WIRING HARNESS AND FOUND CHAFFED AND BROKEN WIRING, REPAIRED WIRING HARNESS AND CLEARED ACTIVE CODES. UNIT TESTED OK TRAVEL NYRSTAR AND RETURN TWICE 19716 HRS	1809.5	980.03	0	79	2868.53
5963	6152	10/21/2021	1HM103HBG	105G	INT-R	Sundries	1ME645	19555.000	0	REPAIR JAMMED BONNET LATCH	1ME645	76.01	0	0	30	106.01
5564	6868	10/11/2021	1HM103HBG	184G	R	Electrical	1ME645	0.0000	19633	REPLACE FAULTY BRAKE TEMPERATURE SENSOR	JOB CARRIED OUT - REPAIR JAMMED BONNET LATCH. LOCATE AND REPLACE BRAKE TEMPERATURE SENSOR , REPLACE CONNECTING PLUG ON HARNESS TRAVEL NYRSTAR AND RETURN	170.84	137.6	0	23.5	331.94
210420-00	SVC00263	09/27/2021	1H0103	121_INT	R	Tyres	1ME645			CARRY OUT PRESSURE CHECK & ADJ	CARRY OUT PRESSURE CHECK ADJUST ON M645 DONE AT NYRSTAR SITE 3/2/21 ARRANGED BY ERNIE BRUSCH AS PER WORK ORDER 36371	0	100	0	0	100
4519	5724	09/15/2021	1HM103HBG	184G	R	Hydraulic	1ME645	19555.000	0	REPAIR OIL LEAK UNDER CAB	LIFT CAB AND REPLACE LEAKING O RINGS AND PIPE GASKETS NEAR AMPLIFIER VALVE, CLEANED WORK AREA AND TESTED OK, LOWER AND SECURE CAB CHECK FOR SECOND OIL LEAK, WASH AREA AND TEST RUN UNIT. FOUND LEAK NEAR HYDRAULIC TANK, REMOVED PIPE AND REPLACED SEALING GASKETS. REFIT PIPE AND TOP UP WITH HYDRAULIC OIL . TESTED UNIT AND FOUND NO LEAKS TRAVEL NYRSTAR AND RETURN THREE TIMES	1259.95	416.6	0	29	1705.55

3973	4896	09/02/2021	1HM103HBG	184G	R	Electrical	1ME645	0.0000	19348	INSPECT TRAY LIFT ISSUE	INSPECT TRAY LIFT ISSUE,JACK UP CAB AND CHECK AND CHECK HYDRAULIC PRESSURE AND PILOT PRESSURE. TEST WIRING AND CONTINUITY OF COILS. FIIT NEW COIL AND TRAY WOULD OPERATE UP AND DOWN BUT NOT USING SIGNAL FROM COMPUTER, CARRY OUT MORE TEST TO CONFIRM FAULT WITH COMPUTER. SWAP COMPUTERS WITH M740 AT HBMI TO CONFIRM COMPUTER FAILURE, FIT NEW COMPUTER AND TEST OPERATION , FAULT GONE, LOWER AND SECURE CAB , REPAIR STEERING COLUMN, REMOVE TEST FITTING TRAVEL HBMI AND RETURN, TRAVEL NYRSTAR	2028.73	5922.45	0	145	8096.18
3913	4831	08/31/2021	1HM103HBG	105G	INT-R	Electrical	1ME645	19332.000	0	REPAIR TRAY UP FAULT	1ME645	228.03	20	665	0	913.03
											JOB CARRIED OUT - TEST TRAY NOT OPERATING FAULT. ALTERNATOR HAD LOW OUTPUT ON R TERMINAL, REPLACE ALTERNATOR. FAULT CODE DW73KZ NOW ACTIVE. TEST AS PER KOMATSU FLOW CHART. CHART IS INDICATING THAT THE DUMP SELECTORR VALVE SOLENOID HAS FAILED.					
3846	3743	08/30/2021	1HM103HBG	105G	INT-R	Sundries	1ME645	19332.000	0	COMPLETE PMI & REPAIRS	1ME645	190.03	38.4	0	50	278.43
3717	4011	08/26/2021	1HM103HBG	184G	S	Service Ear	1ME645	0.0000	0	S1 B SERVICE	JOB CARRIED OUT - CARRY OUT PMI. S1 B SERVICE AS PER SERVICE SHEET TRAVEL IMPACT AND RETURN	384.39	705.53	0	14.5	1104.42
210217-00	SVC002605	07/22/2021	1H0103	105_HBGN	R	Sundries	1ME645			MONTHLY PMI CHECKS & REPAIRS	1ME645	508.9	13.5	0	0	522.4
											JOB CARRIED OUT - COMPLETE WEEKLY PMI AND REPAIRS. REPLACE BLOWN LH HEAD LIGHT GLOBE. CLEAN STEPS AND ADHESIVE GRIP TAPE TO STOP SLIPS. REPLACE INSIDE CAB FILTER. INSPECT A/C FAULT REPORTED, NO FAULT FOUND. TOP UP LOW ENGINE OIL.					
210311-00	SVC002621	07/22/2021	1H0103	105_HBGN	R	Air Con	1ME645			ASSESS/REPAIR A/C FAULTS	1ME645	0	549.67	1155	0	1704.67
											ODOMETER - 19136 HOURS					
											JOB CARRIED OUT - TEST A/C, FOUND LOW IN GAS. COLLECT AND DEGAS SYSTEM, LEAK TEST AND REGAS. PRESSURE IS INDICATING THAT THE TX VALVE IS FAILING. REMOVE A/C ASSY AND FIT NEW TX VALVE AND EVAPORATOR. FLUSH ALL LINES AND CONDENSOR. REFIT AND REGAS SYSTEM.					
1683		07/08/2021	1HM103HBG	182G	INT-R	Lathe	1ME645	19332.000	0	REPAIRS TO PIVOTS AND MACHINE HAT BUSHES TO SUIT	REPAIRS TO TRAY PIVOTS AND MACHINE HAT BUSHES TO SUIT	0	0	0	0	0
1488	1213	07/05/2021	1HM103HBG	184G	R	Hydraulic	1ME645	0.0000	0	REPLACE BLOWN HOSE UNDER CAB	INSPECT OIL LEAK, LIFT CAB , REMOVE AND REPLACE BLOWN HYDRAULIC HOSE. LOWER CAB AND TEST OPERATION, TOP UP HYDRAULIC TRAVEL ORFORD AND RETURN	626.85	305.04	0	217.5	1149.39

1498	2240	07/05/2021	1HM103HBG	184G	R	Trays/Buck	1ME645	19332.000	0	REMOVE TAIL BOARD	REMOVE TAIL GATE FOR ORFORD JOB REMOVE DAMAGED TAIL GATE SEAL AND STRAIGHTEN MOUNTING PLATES, FIT NEW SEALING RUBBER REPLACE TAIL GATE PIVOT PIVOT BUSHES AND PINS, REFIT TAIL GATE AND ADJUST TRAVEL MORNINGTON AND RETURN	1521.92	0	0	58	1579.92
210323-00	SVC002616	06/24/2021	1H0103	184_INT	S	Service	1ME645	19236HR		C TYPE SERVICE	S1 C SERVICE AS PER SERVICE SHEET TRAVEL NYRSTAR AND RETURN	538.55	1668.71	0	35	2242.26
886	911	06/21/2021	1HM103HBG	105G	INT-R	Sundries	1ME645	19332.000	0	COMPLETE PMI AND REPAIRS	1ME645	148.74	0	0	0	148.74
766	1507	06/17/2021	1HM103HBG	105G	INT-R	Electrical	1ME645	19330.000	0	REPLACE FAILED STARTOR MOTOR	JOB CARRIED OUT - COMPLETE PMI'S. 1ME645	228.03	711.39	0	0	939.42
684	5362	06/16/2021	1HM103HBG	121G	R	Tyres	1ME645	19330.000	129459	REPLACE FRONT TYRES ON M645	REPLACE FRONT TYRES ON 1ME645 AT NYRSTAR	0	0	6923.45	0	6923.45
210524-00	SVC002647	06/10/2021	1H0103	184_INT	R	Trays/Buck	1ME645	19,369 HR		INSPECT TAIL GATE PIVOTS	TRIED TO DISMANTLE PIVOTS BUT FOUND PINS SIEZED, UNIT NEEDS TO GO TO WORKSHOP FOR FURTHER REPAIRS	122.55	0	0	0	122.55
210305-00	SVC002621	05/29/2021	1H0103	105_HBGN	R	Sundries	1ME645			MONTHLY PMI'S & REPAIRS	1ME645	327.15	0	175	50	552.15
											ODOMETER - 19235 HOURS					
210311-00	SVC002621	05/29/2021	1H0103	105_HBGN	R	Electrical	1ME645			REPLACE HEAD LIGHTS WITH LED'S	JOB CARRIED OUT - MOVED FLASHING LIGHT WIRING FROM ROOF TOP TO UNDER THE ROOF, TO STOP DAMAGE. COMPLETE PMI. REPLACE BROKEN GREASE NIPPLES. 1ME645	0	55.5	210	30	295.5
											ODOMETER - 19136 HOURS					
210406-00	SVC002627	04/22/2021	1H0103	184_INT	R	Hydraulic	1ME645	19,304 HRS		RESEAL LIFT CYLINDER	JOB CARRIED OUT - FIT NEW LED HEAD LIGHTS. POLISH HEAD LIGHT LENSE. REMOVE RIGHT HAND SIDE LIFT CYLINDER,(HAD TO GOUGE OUT PINS TO REMOVE CYLINDER) TRAVEL NYRSTAR AND RETURN STRIP CYLINDER AND CLEAN PARTS READY FOR REASSEMBLY RESEAL CYLINDER AND REFIT TO MACHINE, TOP UP HYDRAULIC OIL AND TEST OPERATION TRAVEL NYRSTAR AND RETURN	1660.73	880.51	0	100	2641.24
210408-00	SVC002624	04/21/2021	1H0103	182_INT	R	Milling	1ME645			REPAIR CYLINDER TUBE BEARING	SETUP CYLINDER TUBE IN MILL, PREMACHINE BEARING BORE, WELD UP & REMACHINE BORE & CIRCLIP GROOVE TO SUIT BEARING, MACHINE 2 NEW CYLINDER RETAINING PINS, SUPPLY & MACHINE NEW CYLINDER GLAND GLACIER BUSH	1241.51	140.34	0	0	1381.85
210217-00	SVC002605	03/15/2021	1H0103	105_HBGN	R	Tyres	1ME645	19057HRS		CALL-OUT PUMP UP L/H REAR TYRE	CALL OUT TO PUMP UP LEFT HAND REAR TYRE	290.8	0	0	0	290.8
210301-00	SVC002605	03/03/2021	1H0103	121_INT	R	Tyres	1ME645			REPAIR TYRE & REPLACE ORING ON	REPAIR TYRE & REPLACE ORING ON RHR DONE AT NYRSTAR SITE 10/2/21	0	0	261.36	0	261.36
210106-00	SVC002580	01/21/2021	1H0103	184_INT	R	Tyres	1ME645			CHANGE WHEEL/TYRE RH INTER	REMOVE AND REPLACE TYRE AND RIM ON RIGHT HAND CENTRE AXLE TRAVEL NYRSTAR AND RETURN	553.9	0	0	12.5	566.4

201203-00: SVC002570	12/16/2020	1H0103	105_HBGN	S	Service	1ME645	18950	S1A - 250 HR SERVICE	1ME645	181.75	51.02	0	50	282.77
ODOMETER - 18950 HOURS														
201113-00: SVC002555	11/20/2020	1H0103	105_HBGN	R	Sundries	1ME645	18902	REPLACE BROCKEN BOLTS	JOB CARRIED OUT - CARRY OUT S1A SERVICE. 1ME645	763.35	34.74	0	20	818.09
ODOMETER - 18902 HOURS														
JOB CARRIED OUT - CARRY OUT PMI. FOUND LHR INDICATOR NOT WORKING. LIFTED TRAY AND TRACED FAULT TO PLUG UNDER TRAY. FOUND CENTRE TORQUE ROD BOLTS LOOSE. CUT BOLT AND WENT TO NUTS AND BOLTS TO GET NEW ONES. 1 BOLT IS SEIZED, REPLACED OTHER BOLT. NEEDS WHEEL REMOVED TO REMOVE AND UNSEIZE BOLT.														
200729-00: SVC002492	10/21/2020	1H0103	184_INT	S	Service	1ME645	18,731 HRS	S1 service	CARRIED OUT S1 SERVICE AS PER SERVICE SHEET	327.15	364.62	0	15	706.77
200828-00: SVC002517	09/29/2020	1H0103	105_HBGN	R	Electrical	1ME645	18735	REPAIR FAULT CODES	1ME645	1090.5	236.63	0	0	1327.13
ODOMETER - 18735 HOURS														
JOB CARRIED OUT - ASSESS FAULT CODE. TESTED TRAY PROXIMETY SWITCH. RESET PARAMETERS AND TESTED OPERATION.														
200825-00: SVC002515	08/31/2020	1H0103	105_HBGN	R	Electrical	1ME645	18735	CHECK E01 CODE	1ME645	145.4	0	0	0	145.4
ODOMETER - 18735 HOURS														
JOB CARRIED OUT - ASSESS FAULT CODE. TESTED MACHINE OPERATION, NO FAULT FOUND AT TIME OF TESTING.														
200729-00: SVC002495	08/28/2020	1H0103	184_INT	R	Brake	1ME645	18732 hr	REPAIR PARK BRAKE FAULT	REPAIR PARK BRAKE FAULT	1381.3	1655.96	0	50	3087.26
CHECK PRESSURE AND REMOVE FRONT BRAKE ACCUMULATOR, STRIP ACCUMULATOR AND CLEAN PARTS READY TO BE RESEALED. RESEAL NEW PISTON AND ASSEMBLE ACCUMULATOR, CHARGE ACCUMULATOR TO 640PSI AND MONITOR TO CHECK IF DROPPING PRESSURE. REFIT ACCUMULATOR TO MACHINE AND CONNECT HOSES. CHECK AND ADJUST PRESSURE IN REAR ACCUMULATOR. ADJUST PARK BRAKE CLEARANCE AND TOP UP HYDRAULIC OIL . TOP UP TRANSMISSION OIL AND TEST OPERATION REFIT ACCUMULATOR COVER AND CHECK DIFFERENTIAL AND ENGINE OIL LEVELS CHECK LIGHTS AND CLEAN UP WORK AREA														

200715-00: SVC002486	07/30/2020	1H0103	184_INT	R	Electrical	1ME645	18727hrs	CHECK TRAY SWITCH FAULT	CHECK TRAY SWITCH FAULT CHECKED FAULT WITH HM300, CHECKED CODE, HOIST FAULT, ECM READING TRAY IN THE AIR LOCATED POTENTIOMETER FOR TRAY LEVEL, DISCONNECTED ARM FROM TRAY, CHECKED IF FAULT WOULD GO AWAY, STILL FAULTING. WIRING HARNESSSES FROM CAB TO REAR IN POOR CONDITION, WIRE BREAKS AND NO INSULATION. REMOVED HARNESSSES, FOUND X4 BROKEN WIRES AND X2 CHAFFED WIRES, CUT OUT DAMAGE AND REPAIRED. TAPED HARNESSSES USING HIGH TEMP CLOTH TAPE, FITTED NEW SPLIT TUBE, TAPED AGAIN. FITTED NEW DEUTSCH PLUG ENDS.	3273.05	94.03	0	159.5	3526.58
200715-00: SVC002492	07/28/2020	1H0103	182_INT	R	Lathe	1ME645	18727	MACHINE 2 TRAY SAFETY PINS	MACHINE 2 TRAY SAFETY PINS	290.8	207.84	0	15	513.64
200701-00: SVC002491	07/15/2020	1H0103	184_INT	R	Electrical	1ME645	18708km	REPLACE FAULTY BATTERIES	REPLACE FAULTY BATTERIES CHECK STARTING FAULT AND REPLACE BLOWN FUSE. FOUND BATTERIES TO BE FAULTY. REMOVE AND REPLACE FAULTY BATTERIES TRAVEL MORNINGTON AND RETURN	490.2	424.86	0	37.5	952.56
200706-00: SVC002487	07/08/2020	1H0103	105_HBGN	R	Tyres	1ME645		CHECK TYRE PRESSURES	1ME645	0	75	0	0	75
200629-00: SVC002482	06/30/2020	1H0103	184_INT	R	Electrical	1ME645	18702 hrs	JUMP START AND CHECK CHARGE	JOB CARRIED OUT - B'SELECT CHECKED TYRE PRESSURES. JUMP START UNIT AND CHECK CHARGE RATE AFTER ISOLATOR LEFT TURNED ON TRAVEL MORNINGTON	122.55	0	0	25	147.55
200327-00: SVC002433	06/23/2020	1H0103	182_INT	R	Sundries	1ME645	18465	MODS TO HANDRAIL	MEASURE UP AND SET OUT LOCATION OF RAIL MOUNT ON DUMPER. BEND PIPE RAIL SECTIONS PRESS SWAGED WIRE VIB MOUNTS AND WELD TO PIPE RAIL SECTIONS. CUT AND FABRICATE BASE PLATES WITH TAPPED MOUNTING HOLES. WELD OUT RAIL. PREP AND PAINT. FIT UP COMPLETED RAILS ONSITE AT NYSTAR.	1038.32	283.54	0	75	1396.86
200506-00: SVC002458	05/27/2020	1H0103	105_HBGN	R	Engine	1ME645	18548	CHANGE OUT INTERCOOLER	1ME645 ODOMETER - 18548 HOURS JOB CARRIED OUT - REMOVE A/C CONDENSOR. UNBOLTED INTERCOOLER AND REMOVED. INSTALLED NEW INTERCOOLER AND TESTED OPERATION.	254.45	0	0	0	254.45
200501-00: SVC002462	05/22/2020	1H0103	105_HBGN	R	Sundries	1ME645		MAY - MONTHLY PMI'S	1ME645 JOB CARRIED OUT - CARRY OUT PMI.	72.7	0	0	0	72.7

200507-00: SVC002456	05/14/2020	1H0103	105_HBGN`R	Hydraulic	1ME645	18548	REPAIR HYD OIL LEAK UNDER CAB	1ME645	763.35	83.5	0	80	926.85
								ODOMETER - 18548 HOURS					
								JOB CARRIED OUT - DIAGNOSE HYD LEAK FROM UNDER CAB. UNBOLTED AND LIFTED CAB. FOUND WHICH HOSE WAS LEAKING AND REMOVED. DROVE TO ENXED TO GET NEW ONE MADE. INSTALLED HOSE AND NEW O-RINGS. STEAM CLEANED UNDER CAB ETC. BOLTED CAB BACK DOWN. DROVE BACK TO WHARF.					
200506-00: SVC002456	05/13/2020	1H0103	121_INT`R	Tyres	1ME645	LOCKED	CHECK AND ADJUST TYRE PRESSURE	CHECK & ADJUST TYRE PRESSURES CARRIED OUT BY B	0	0	82.5	0	82.5
200420-00: SVC002456	05/07/2020	1H0103	105_HBGN`R	Sundries	1ME645		APRIL - MONTHLY PMI'S	SELECT MOONAH					
								1ME645	290.8	8.31	0	0	299.11
								JOB CARRIED OUT - CARRY OUT PMI'S DURING APRIL. REPLACE WIPER.					
200211-00: SVC002411	04/28/2020	1H0103	105_HBGN`R	Tyres	1ME645		CHECK & ADJUST HM300 TIRE PRES	1ME645	145.4	0	0	0	145.4
								JOB CARRIED OUT - CHECK AND ADJUST HM300 TYRE PRESSURES. CHECK CONDITION OF TYRES.					
200225-00: SVC002416	04/16/2020	1H0103	105_HBGN`R	Hydraulic	1ME645	18419	REPLACE LEAKING HYD HOSES	1ME645	436.2	1548.52	0	30	2014.72
								ODOMETER - 18419 HOURS					
								JOB CARRIED OUT - DIAGNOSE HYD OIL LEAK. REMOVED SEIZED CLAMPS IN ARTIC JOINT. REMOVE SPIRAL WRAP AND PROTECTIVE SLEEVE. REMOVE X2 HYD HOSES. FIT UP X2 HYD HOSES AND ASSOCIATED COMPONENTS.					
200311-00: SVC002431	04/16/2020	1H0103	105_HBGN`R	Sundries	1ME645		MARCH - PMI'S	1ME645	109.05	0	0	20	129.05
								JOB CARRIED OUT - CARRY OUT PMI'S DURING MARCH.					
200324-00: SVC002436	04/16/2020	1H0103	105_HBGN`R	Hydraulic	1ME645	18465	FIT UP HYD CAB LIFT FITTINGS	1ME645	72.7	82.26	0	20	174.96
								ODOMETER - 18465 HOURS					
								JOB CARRIED OUT - COLLECT AND FIT UP CAB LIFTER ADAPTOR FITTINGS TO ATTACH PORTAPOWER.					
200324-00: SVC002436	04/16/2020	1H0103	105_HBGN`R	Hydraulic	1ME645	18465	REPAIR HYD LEAK UNDER CAB	1ME645	145.4	147.4	0	50	342.8
								ODOMETER - 18465 HOURS					
								JOB CARRIED OUT - HYD LEAK UNDER CAB. PREP CAB TO LIFT. COLLECT FITTING FROM ENXED TO CONNECT TO CAB JACK. LEAK FROM LH FRONT STEER HOSE. REMOVED AND PIRTEK MADE NEW HOSE. INSTALLED HOSE AND TEST OPERATION.					

200408-00: SVC002441	04/16/2020	1H0103	105_HBGN`S	Service	1ME645	18474	S1A - 250HR SERVICE	1ME645	181.75	32	0	0	213.75
ODOMETER - 18474 HOURS													
200128-01: SVC002401	03/18/2020	1H0103	105_HBGN`R	Sundries	1ME645		FEBRUARY - PMI'S	1ME645	436.2	89.98	455	70	1051.18
JOB CARRIED OUT - CARRY OUT SERVICE AND CHECKOVER. CUT OFF CHAIN ON HAND RAIL.													
JOB CARRIED OUT - CARRY OUT PMI. REMOVE TAIL LIGHT BRACKET TO TEST WIRING. RH TAIL LIGHT IS U/S. TAIL GATE PIVOT PINS NOT TAKING GREASE. NEEDS TWO TRAY SAFETY PINS. CARRY OUT PMI AND CORE WASH.													
200219-00: SVC002411	02/26/2020	1H0103	105_HBGN`S	Service	1ME645	18405	S1B - 500HR SERVICE	1ME645	272.63	545.24	175	0	992.87
ODOMETER - 18405 HOURS													
200129-00: SVC002401	02/18/2020	1H0103	105_HBGN`R	Electrical	1ME645		REPLACE FAILED TAIL LIGHT ASSY	1ME645	0	103	140	20	263
ODOMETER - 18371 HOURS													
JOB CARRIED OUT - CARRY OUT S1B SERVICE.													
200131-00: SVC002401	02/18/2020	1H0103	105_HBGN`R	Air Con	1ME645		REPLACE FAILED COMPRESSOR	1ME645	254.45	670.8	350	100	1375.25
ODOMETER - 18371 HOURS													
JOB CARRIED OUT - REPLACE FAILED TAIL LIGHT ASSY. CUT OUT OLD PLUG AND FIT NEW PLUG.													
JOB CARRIED OUT - COLLECT PARTS. ASSIST WITH REPAIRS AND DIAGNOSTICS OF A/C UNIT. REMOVE FAILED COMPRESSOR AND RECEIVER DRYER. FLUSH ALL A/C LINES. FIT NEW COMPRESSOR AND RECEIVER DRYER. VACUUM SYSTEM AND REGAS.													
200108-00: SVC002391	01/30/2020	1H0103	105_HBGN`R	Sundries	1ME645		JANUARY - PMI'S	1ME645	290.8	0	0	50	340.8
JOB CARRIED OUT - CARRY OUT PMI'S DURING JANUARY. WASH OUT CORES.													
191202-00: SVC002391	01/20/2020	1H0103	105_HBGN`R	Sundries	1ME645		COMPLETE DECEMBER PMI'S	1ME645	181.75	0	0	30	211.75
JOB CARRIED OUT - CARRY OUT PMI'S DURING DECEMBER.													
200108-00: SVC002391	01/20/2020	1H0103	105_HBGN`R	Electrical	1ME645		REPLACE DAMAGED HORN BUTTON	1ME645	109.05	152.48	0	20	281.53
ODOMETER - 18318 HOURS													
JOB CARRIED OUT - REPLACE DAMAGED HORN BUTTON.													

191031-00	SVC002354	12/04/2019	1H0103	105_HBGN	R	Sundries	1ME645		NOVEMBER - PMI'S	1ME645	836.05	296.96	0	80	1213.01
										JOB CARRIED OUT - CARRY OUT PMI'S DURING NOVEMBER. FABRICATE MESH FRAME TO GO BETWEEN RADIATORS AND AFTER COOLER. REPAIRED WIRING TO LH SIDE INDICATOR. RETROFITTED NEW WASHER JET TO WIPER ARM. REFITTED RH HOSE HANGER BEHIND CAB. WASHED CORES X 4 TIMES.					
190925-00	SVC002337	10/30/2019	1H0103	105_HBGN	R	Sundries	1ME645	18202	COMPLETE SEP PMI	1ME645	399.85	39	70	40	548.85
										ODOMETER - 18202 HOURS					
										JOB CARRIED OUT - CARRY OUT PMI'S DURING OCTOBER. HOT WASHED CORES. TOPPED UP LOW HYD OIL. LUBRICATED BONNET LATCH. REPLACED WIPER BLADES.					
191010-00	SVC002347	10/30/2019	1H0103	105_HBGN	R	Engine	1ME645	18202	REMOVE/CLEAN COOLING CORES	1ME645	981.45	280	245	50	1556.45
										ODOMETER - 18202 HOURS					
										JOB CARRIED OUT - REMOVE FRONT BONNET GRILL TO ACCESS RADIATORS. REMOVED AFTER COOLERS FOR CLEANING AT NEW NORFOLK RADIATORS. PRESSURE WASHED RADIATOR CORES, REFIT CLEANED AFTER COOLER. CLEANED OUT RADIATOR MESH ON GRILL.					
191010-00	SVC002353	10/30/2019	1H0103	105_HBGN	R	Air Con	1ME645	18202	REPLACE A/C CONDENSOR	1ME645	218.1	673.69	260	60	1211.79
										ODOMETER - 18202 HOURS					
										JOB CARRIED OUT - RECOVER GAS AND REMOVE CONDENSOR/RECEIVER DRYER, FIT NEW ONES. LEAK TEST, FOUND SMALL LEAK IN THE EVAPORATOR. USE ADDITIVE TO SEAL LEAK. REGAS AND TEST.					
191021-00	SVC002352	10/30/2019	1H0103	105_HBGN	S	Service	1ME645	18202	S1A - 250HR SERVICE	1ME645	254.45	305.42	140	40	739.87
										ODOMETER - 18202 HOURS					
										JOB CARRIED OUT - CARRY OUT SERVICE AND CHECK OVER.					
190927-00	SVC002337	10/03/2019	1H0103	105_HBGN	R	Hydraulic	1ME645		DIAGNOSE HYD LEAK UNDER CAB	1ME645	1026.8	76.2	280	50	1433
										JOB CARRIED OUT - ORGANISED FIELD SERVICE TO ASSIST WITH CAB LIFT USING HIAB CRANE. DIAGNOSED HYD LEAK, COMING FROM STEERING VALVE UNDER CAB. REMOVED ALL CLAMPS AND A/C HOSES TO ACCESS HOSE. REPLACED O-RING AND REFITTED ALL CLAMPS. TEST OPERATION.					
190822-00	SVC002316	09/30/2019	1H0103	184_INT	R	Bodywork	1ME645		REPLACE DAMAGED MIRROR	REPLACE DAMAGED MIRROR	61.28	266.4	0	0	327.68
										REMOVE AND REPLACE DAMAGED MIRROR ASSEMBLY					

190923-00: SVC002336	09/30/2019	1H0103	105_HBGN	R	Electrical	1ME645	FAULT CODE; DGR3L8, MONIOUR	1ME645	290.8	0	0	0	290.8	
									JOB CARRIED OUT - FAULT CODE DGR3L8. LOOKED UP CODE, REAR CENTRE AXLE SENSOR FAULT. CHECKED ALL FUSES, OK. VISUALLY CHECKED SENSOR WIRING TO CENTRE DIFF, OK. CHECKED CENTRE DIFF TEMPERATIRES, OK. ORGANISED TO BE BOUGHT TO WORKSHOP IF FAULT CODES RE-OCCURS. REPLACE BROKEN AND CORRODED WIRING TO CENTRE DIFF SENSOR.					
190819-00: SVC002314	08/30/2019	1H0103	184_INT	R	Trays/Buck	1ME645	18006 HRS	CHECK TAIL GATE SEAL	CHECK TAIL GATE SEAL, FOUNT TO BE GETTING TWISTED UP .	248.85	0	0	0	248.85
190821-00: SVC002317	08/23/2019	1H0103	105_HBGN	A	Sundries	1ME645		SWAP OVER DAMAGED MIRROR	1ME645	145.4	0	0	0	145.4
									ODOMETER - 18056 HOURS					
190806-00: SVC002307	08/20/2019	1H0103	182_INT	R	Lathe	1ME645		MACHINE 2 TRAY SAFETY PINS	MACHINE 2 TRAY SAFETY PINS WITH RETAINING CLIPS	290.8	16.08	0	14.5	321.38
190815-00: SVC002314	08/20/2019	1H0103	105_HBGN	R	Sundries	1ME645		6 MONTH TEST FIRE EXTINGUISHER	1ME645	36.35	0	0	0	36.35
									JOB CARRIED OUT - CARRIED OUT 6 MONTHLY CHECK ON FIRE EXTINGUISHER.					
190801-00: SVC002311	08/19/2019	1H0103	184_INT	S	Service	1ME645		S1 D SERVICE	TRAVEL TO NYRSTAR, CARRIED OUT S1 D SERVICE AS PER SERVICE SHEET, CHECK AND REPAIR OIL LEAK UNDER CAB	1225.5	1321.86	0	67.5	2614.86
190806-00: SVC002307	08/19/2019	1H0103	184_INT	R	Electrical	1ME645		FIT UP ISOLATION SWITCH	TRAVEL TO NYRSTAR, FIT BATTERY ISOLATOR SWITCH AND CHECK AIR CON SYSTEM	204.25	108.05	0	16.25	328.55
190725-00: SVC002300	08/14/2019	1H0103	184_INT	R	Grease Line	1ME645	17970	REPLACE LIFT CYLINDER GREASE L	1ME645-17970 HRS	81.7	65.83	0	18.75	166.28
									TRAVEL TO NYRSTAR AND REPLACE MISSING GREASE LINE, GREASE MACHINE AND TRAVEL BACK TO WORKSHOP.					
190719-00: SVC002295	07/29/2019	1H0103	105_HBGN	R	Electrical	1ME645	17946HRS	DIAGNOSE HORN FAULT	1ME645	0	0	127.28	0	127.28
									ODOMETER - 17946 HOURS					
									JOB CARRIED OUT - DISMANTLE AND CLEAN HORN CONTACTS IN STEERING WHEEL AND REASSEMBLE.					
190619-00: SVC002285	06/28/2019	1H0103	105_HBGN	R	Hydraulic	1ME645		LOW HYD OIL	1ME645	72.7	0	0	38.3	111
									ODOMETER - 17,901					
									JOB CARRIED OUT - DROVE TO WHARF AND CHECKED OIL LEVEL. CHECKED FOR ANY CISUAL OIL LEAKDS, NONE FOUND. TOPPED UP HYD OIL.					

190410-00: SVC002241	05/10/2019	1H0103	184_INT	R	Engine	1ME645		REPLACE FAN BELTS & OIL LEAK	1ME645-17814 HRS	531.05	135.2	533.9	51.25	1251.4
									REPLACE FAN BELTS REMOVE AND REPLACE FAN BELTS LIFT CAB AND REPAIR OIL LEAK AT ORBITAL VALVE, LOWER AND SECURE CAB TRAVEL NYRSTAR AND RETURN					
190403-00: SVC002238	04/24/2019	1H0103	105_HBGN	R	Tyres	1ME645		REPLACE WORN TYRES	1ME645	0	9625.45	0	0	9625.45
190417-00: SVC002247	04/24/2019	1H0103	121_INT	R	Tyres	1ME645	16880	FIT OTR TYRE X 4 + O-RING 25"	JOB CARRIED OUT - REPLACE WORN TYRES. FIT OTR TYRE X 4 + O-RING 25" THICK X 4 + OTR SERVICE NORM 4 WORK ORDER 19998 B SELECT MOONAH	0	0	1065.44	0	1065.44
190423-00: SVC002215	04/24/2019	1H0103	105_HBGN	R	Hydraulic	1ME645		CALL OUT - HYD LEAK UNDER CAB	1ME645	162.68	0	0	0	162.68
									JOB CARRIED OUT - CALL OUT - IDENTIFIED REPORTED OIL LEAK UNDER CAB OF HM300. REPAIR COULDN'T BE COMPLETED DUE TO THE CAB NEEDING LIFTING.					
190409-00: SVC002240	04/18/2019	1H0103	184_INT	R	Hydraulic	1ME645		REPAIR OIL LEAKS UNDER CAB	REPAIR OIL LEAKS UNDER CAB LIFT CAB AND CHECK OIL LEAKS, REMOVE AND REPLACE FOUR LEAKING HOSES. REMOVE AND REPLACE GASKET RINGS ON HYDRAULIC TUBES TO AMPLIFIER VALVE. RUN UNIT AND CHECK FOR LEAKS, FOUND LEAKS UNDER CAB REPAIRED. LOWER CAB AND SECURE IN PLACE REMOVE BELLY PLATE AND CHECK OIL LEAK UNDER ENGINE, REMOVE AND REPLACE LEAKING GASKET RINGS ON HYDRAULIC TUBES INSIDE CHASSIS. TEST RUN UNIT TO CHECK FOR FURTHER LEAKS AND REFIT BELLY PLATE TRAVEL NYRSTAR AND RETURN TWICE	701.95	554.34	305.2	53.75	1615.24
190329-00: SVC002232	04/13/2019	1H0103	184_INT	R	Sundries	1ME645		REPAIR REVOLVING LIGHTS AND CH	REPAIR REVOLVING LIGHTS AND CHECK OVER REMOVE AND REPLACE BOTH REVOLVING LIGHTS. REPLACE AIR FILTER AND TOP UP COOLANT AND HYDRAULIC OIL CLEAN PRODUCT FROM AROUND BRAKE PEDAL TRAVEL NYRSTAR AND RETURN	245.1	553.92	0	17	816.02
190401-00: SVC002235	04/09/2019	1H0103	184_INT	S	Service	1ME645		S1 A SERVICE	S1 A SERVICE AS PER SERVICE SHEET RETENSION WHEEL BOLTS AFTER NEW TYRES FITTED TRAVEL NYRSTAR AND RETURN	245.1	284.89	0	24.5	554.49
190204-01: SVC002201	02/28/2019	1H0103	105_HBGN	R	Bodywork	1ME645		REPLACE LHS CAB WINDOW	1ME645	109.05	564.1	0	0	673.15
									JOB CARRIED OUT - REPLACE LH SIDE CAB WINDOW.					
190204-00: SVC002195	02/06/2019	1H0103	121_INT	R	Tyres	1ME645		PUNCTURE REPAIR POS 3	PUNCTURE REPAIR POS 3 CARRIED OUT BY B SELECT MOONAH WORK ORDER 18055	0	0	276.36	0	276.36
190124-00: SVC002193	02/05/2019	1H0103	184_INT	R	Electrical	1ME645	17554 HRS	REPLACE UHF ANTENNA AND CABLE	REPLACE UHF ANTENNA AND CABLE, TESTED OK AFTER REPAIRS TRAVEL NYRSTAR	133.8	42	0	6.25	182.05

190123-00	SVC002192	01/31/2019	1H0103	184_INT	S	Service	1ME645		S1 B SERVICE	CARRIED OUT THE REQUIRED SERVICE AND SAFETY INSPECTIONS AS PER SERVICE SHEET	664.85	944.59	0	42.5	1651.94
190103-00	SVC002183	01/09/2019	1H0103	184_INT	R	Drive Line	1ME645	17517 hrs	REPAIR REAR TAIL SHAFT	TRAVEL TO NYRSTAR REMOVE REAR TAIL SHAFT AND HAVE REBUILT , REMOVE BROKEN BOLTS FROM REAR DIFF FLAMGE REFIT REPAIRED TAIL SHAFT AND GREASE UNIT	408.5	0	1446.94	20	1875.44
181030-00	SVC002148	11/30/2018	1H0103	184_INT	R	Transmissi	1ME645	17335 HR	REPAIR OIL LEAK	LIFT CAB AND RUN UNIT TO LOCATE OIL LEAKS, REMOVE AND REPLACE O RINGS LEAKING ON STEERING VALVE, REMOVE LEAKING HOSE, HAVE NEW HOSE MADE AND FIT TO MACHINE. WASH UNIT UNDER CAB AND CHECK FOR FURTHER LEAKS . TESTED OK , LOWER CAB AND SECURE IN PLACE	694.45	428.94	74.84	35	1233.23
181030-00	SVC002148	11/13/2018	1H0103	184_INT	S	Service	1ME645	17335 HRS	S1 A SERVICE	CARRIED OUT S1 A SERVICE AS PER SERVICE SHEET BODYWORKS REPAIRED R/HAND DOOR LOCK	251.85	283.7	0	12.51	548.06
181102-00	SVC002150	11/07/2018	1H0103	105_HBGN	R	Sundries	1ME645	17336	COMPLETE PMI INSPECTION	1ME645 ODOMETER - 17336 HOURS JOB CARRIED OUT - CARRIED OUT PMI. TIPPER LINKJ ROPE ONLY TAKING LOAD ON RHS. LHS IS PROBABLY STRETCHED. LH SIDE LIGHT NOT WORKING, POWER IS PRESENT WHEN TESTED.	145.4	0	0	0	145.4
180713-00	SVC002088	07/25/2018	1H0103	184_INT	R	Electrical	1ME645	17108 HRS	repair head lights	TRAVELLED TO NYRSTAR, CHECKED R/HAND LOW BEAM NOT WORKING, FOUND NO POWER GOING TO LIGHT, TRACED WIRING AND FOUND BREAK IN FRONT OF RADIATOR, REMOVED COVERS AND REPAIRED WIRING, TEST OPERATION AND REFIT COVERS.	408.5	0	0	33	441.5
180710-00	SVC002083	07/18/2018	1H0103	184_INT	S	Service	1ME645	17108	S1 C SERVICE	TRAVELLED TO NYRSTAR, CARRIED OUT S1 C SERVICE AS PER SERVICE SHEET	501.45	1523.69	0	42.5	2067.64
180709-01	SVC002082	07/13/2018	1H0103	105_HBGN	R	Hydraulic	1ME645	17097	LOW HYD OIL	1ME645 ODOMETER - 17097 HOURS JOB CARRIED OUT - TOPPED UP LOW HYDRAULIC OIL.	72.7	36.9	0	0	109.6
180710-00	SVC002082	07/13/2018	1H0103	105_HBGN	R	Engine	1ME645		low engine oil	1ME645 JOB CARRIED OUT - TOPPED UP LOW ENGINE OIL.	36.35	20.6	0	0	56.95
180411-00	SVC002041	06/19/2018	1H0103	184_INT	R	Sundries	1ME645		SUPPLY SPARE COOLER AND RIM	SUPPLY SPARE COOLER AND RIM	0	0	276.08	4000	4276.08
180613-00	SVC002068	06/19/2018	1H0103	105_HBGN	R	Hydraulic	1ME645	17002	LOW HYD OIL LEVEL	1ME645 ODOMETER - 17002 HOURS JOB CARRIED OUT - TOPPED UP LOW HYDRAULIC OIL.	36.35	109.8	0	0	146.15

180301-00	SVC00201	04/18/2018	1H0103	184_INT	R	Hydraulic	1ME645	16797 HRS	CHECK HOIST LOWERING FAULT	TRAVELLED TO NYRSTAR, CHECK HOIST LOWERING FAULT, CHECK HYDRAULIC CONTROLS, TEST PROXIMITY SWITCH OPERATION, CHECK FOR BENT CYLINDER ROD, REMOVE ANCHOR PINS AND CHECK SELF ALIGNING BEARINGS	910.11	20.12	0	58	988.23
180321-00	SVC00202	04/16/2018	1H0103	184_INT	R	Hydraulic	1ME645	16797 HRS	RESEAL L/HAND LIFT CYLINDER	TRAVELLED TO NYRSTAR, REMOVED L/HAND LIFT CYLINDER AND STRIP , CLEAN AND CHECK ALL PARTS FOR WEAR, RESEAL CYLINDER AND REFIT TO MACHINE, TOP UP HYDRAULIC OIL AND TEST OPERATION ALL OK.	1736.06	715.79	0	68.75	2520.6
180319-00	SVC00201	03/20/2018	1H0103	105_HBGN	R	Hydraulic	1ME645		LOW HYD OIL TOP UP	1ME645	35.68	36.2	0	0	71.88
180301-00	SVC00200	03/13/2018	1H0103	105_HBGN	R	Hydraulic	1ME645		REPAIR OIL LEAKS	JOB CARRIED OUT - TOP UP HYD OIL. 1ME645	249.73	72.4	0	0	322.13
180308-01	SVC00201	03/13/2018	1H0103	105_HBGN	R	Service	1ME645		REPAIR ACCESS STEPS	1ME645	71.35	0	0	0	71.35
180308-00	SVC00201	03/09/2018	1H0103	121_INT	R	Tyres	1ME645	16790 HOL	SUPERHAWK 23.5R25**HK1 TL E3	JOB CARRIED OUT - REPAIR ACCESS STEPS. SUPERHAWK 23.5R25**HK1 TL E3 x 4 PLUS O-RINGS AND FITTING CARRIED OUT BY B SELECT MOONAH	0	9630	0	0	9630
180206-00	SVC00199	02/27/2018	1H0103	186_INT	S	Service	1ME645	16790 HRS	S1 A SERVICE AS PER SERVICE S	CARRIED OUT S1 A SERVICE AS PER SERVICE SHEET, REPLACE MISSING BOLTS IN REAR DRIVE SHAFT, REPLACE FIRE EXTINGUISHER, MODIFY REAR WINDOW COVER TO ALLOW ACCESS FOR CLEANING	142.7	486.97	0	12	641.67

180206-00: SVC001998	02/27/2018	1H0103	186_INT	R	Engine	1ME645	16790 HRS	REPAIR OIL LEAKS	REMOVE BELLY PLATE, REMOVE AND REPLACE LEAKING FUEL HOSE, RAISE AND SUPPORT R/HAND FRONT OF MACHINE, REMOVE WHEEL ASSEMBLY, LIFT OPERATORS CAB, INSPECT AND REPLACE LEAKING STEERING HOSES FROM HMU TO BLOCK, MAKE UP AND FIT STEERING HOSES, REMOVE LEAKING HOSES FROM COOLER TO HYD TANK, MAKE UP AND FIT NEW HOSES REMOVE PARK BRAKE VALVE ASSEMBLY, DISMANTLE AND REPLACE HARD O RING, REASSEMBLE AND REFIT VALVE, REPLACE LEAKING HOSES BETWEEN STEERING AMPLIFIER AND HMU HOSE BLOCK, REMOVE P6 PUMP ASSEMBLY, DISMANTLE AND REBUILD WITH NEW PLATES AND SEALS, REMOVE PIPE JOINING COUPLING FROM BRAKE COOLING PIPE AND REPLACE FLANGE SEALS, REASSEMBLE, DRAIN TRANSMISSION, REMOVE BOTH PUMP AND CONVERTER SUCTION PIPES AND REPLACE COUPLING SEALS, REFILL TRANSMISSION AND CHECK FOR LEAKS, REPLACE BROKEN HINGES ON BELLY PLATE AND REFIT TO MACHINE, ROTATE FRONT AND REAR AXLE WHEELS AS REQUESTED BY JASON, FILL HYDRAULIC TANK WITH OIL AND TEST OPERATION UNIT, TESTED OK.	1569.71	2631.68	50.29	50	4301.68
180206-00: SVC002007	02/27/2018	1H0103	184_INT	R	Engine	1ME645	16790 HRS	CLEAN COOLER CORES	REMOVE COOLER CORE AND PIPING, CLEAN CORE READY TO BE REFITTED. CLEAN DIRT FROM RADIATOR AND A/C CONDENSOR CORES, REMOVE COVERS FROM FRONT OF BELLY PLATE TO ALLOW PRODUCT TO FALL THROUGH. REFIT COOLER AND PIPING, REPLACE LEAKING FUEL LINES, REPLACE WORN HOSES NEAR CORES	5365.79	205.21	0	50	5621
180216-00: SVC002002	02/26/2018	1H0103	182_INT	A	Sundries	1ME645		REPAIR TAILGATE SEAL	Clean and remove product build up from tailgate. Cut and remove rubber seal frame work damaged by rock. Fabricate new frame work. Punch and drill new rubber retaining holes in clamping bars. Cut and punch rubber seal to suit tailgate. Test fit seal. Weld out all new frame work. Fit up seal and fasten into position. Fit up resealed tailgate to truck.	1558.98	93.5	0	150	1802.48
180108-00: SVC001983	01/09/2018	1H0103	105_HBGN	R	Sundries	1ME645	16684HRS	DIAGNOSE TRAY LOWER FAULTS	1ME645 ODOMETER - 16684 HOURS JOB CARRIED OUT - CALL OUT - TRAVEL TO NYRSTAR, ASSESS TRAY GETTING STUCK UP IN THE AIR. INSPECTED AND OPERATED FOR AGES, UNABLE TO GET TRAY TO STICK.	428.4	0	0	50	478.4
171221-00: SVC001977	12/28/2017	1H0103	184_INT	R	Trays/Buck	1ME645	16674 HRS	REPAIR TAIL GATE SEAL	CHECKED TAILGATE SEAL AND FOUND TO BE FAULTY, REPLACED AS REQUIRED TOPPED UP HYDRAULIC OIL AND COOLANT	361.58	72.4	0	100	533.98

171211-00	SVC001976	12/20/2017	1H0103	184_INT	R	Tyres	1ME645	16586 HRS	LOWER TYRE PRESSURE	TRAVELLED TO CAMBRIDGE, LOWER TYRE PRESSURE TO ALLOW UNIT TO OPERATE IN SAND AND THEN TRAVEL BACK AT LATER DATE TO REINFLATE TYRES WHEN JOB FINISHED	120.53	0	0	50	170.53
171205-00	SVC001965	12/12/2017	1H0103	184_INT	R	Engine	1ME645	16592 HRS	top up coolant	TRAVELLED TO HOBART AIRPORT, TOPPED UP COOLANT LEVEL AS REQUESTED & ALSO TOP UP COOLANT IN 1ME908 WHILE ON SITE	200.88	91.58	0	80	372.46
171124-00	SVC001963	12/05/2017	1H0103	184_INT	R	Transmissi	1ME645		CHANGE TRANSMISSION OIL AFTER	TRAVELLED TO NYRSTAR, CHANGE TRANSMISSION OIL AFTER BAD SAMPLE	200.88	347.2	0	11.25	559.33
171030-00	SVC001945	11/23/2017	1H0103	184_INT	S	Service	1ME645	16534 HR	S1 B SERVICE	S1 B SERVICE AS PER SERVICE SHEET CLEAN ALL DIFF BREATHERS GREASE DRIVE LINE CLEAN UP AFTER WORK	482.1	971.9	0	25	1479
171109-00	SVC001955	11/10/2017	1H0103	105_HBGN	R	Electrical	1ME645	16543 HRS	FITUP DAYTIME RUNNING LIGHTS	1ME645	178.38	0	0	20	198.38
										ODOMETER - 16543 HOURS					
										JOB CARRIED OUT - FITUP OF DAY TIME RUNNING LIGHTS.					
170904-00	SVC001921	11/02/2017	1H0103	184_INT	R	Differential	1ME645	16302 HRS	RESEAL BOTH CENTRE AXLE HUB	REMOVE BOTH CENTRE AXLE FINAL DRIVES , STRIP ,CLEAN AND RESEAL. REFIT FINAL DRIVES AND FILL WITH OIL. REMOVE DAMAGED TAIL GATE SEAL AND FIT NEW RUBBER SEAL. REMOVE CORRODED BRAKE COOLING LINES AND TRY TO REPAIR, FOUND TO CORRODED. REMOVE COOLING PIPES FROM 1ME648 AND FIT TO 1ME645 TO ALLOW UNIT TO GO TO WORK. FIT NEW PIPES TO 1ME648 WHEN PARTS ARRIVED TOP UP TRANSMISSION OIL	2761.93	1539.2	180.33	134.8	4616.26
170904-00	SVC001951	11/02/2017	1H0103	184_INT	R	Differential	1ME645	16302 HRS	RESEAL BOTH CENTRE AXLE HUB	CREDIT FOR OVERCHARGE ON HYDRAULIC PARTS	0	0	-59.73	0	-59.73
171019-00	SVC001943	11/02/2017	1H0103	184_INT	R	Engine	1ME645	16503 HRS	REPLACE BROKEN BELT ADJUSTER	REPLACE BROKEN BELT ADJUSTER REMOVE BROKEN FAN BELT ADJUSTER AND FIT NEW ONE , ADJUST BELT AND LOCK OFF ADJUSTER TRAVEL CAMBRIDGE.	160.7	84.42	0	33	278.12
171023-00	SVC001945	11/02/2017	1H0103	184_INT	R	Steering	1ME645	16503 HRS	REMOVE ,RESEAL AND REFIT STEER	REMOVE, RESEAL AND REFIT STEERING CYLINDER. CHECK OVER UNIT BEFORE OUTLOAD, FOUND BROKEN BOLT IN DIFFERENTIAL YOKE, REMOVE YOKE AND DRILL OUT BROKEN BOLT . REFIT YOKE AND TAIL SHAFT, GREASE UNIT AND REPLACE LOOSE BOLT IN MAIN CROSS BRACE. TOP UP HYDRAULIC OIL. TRAVEL CAMBRIDGE AND RETURN X 2	942.78	577.91	0	145	1665.69
170918-01	SVC001927	10/24/2017	1H0103	184_INT	R	Bodywork	1ME645	16396 HRS	REPLACE BONNET CATCH	REPLACE BONNET CATCH AND RADIATOR SUPPORT RUBBERS CHECK BONNET LATCH AND LUBRICATE TO ALLOW UNIT TO KEEP WORKING UNTIL NEW PART ARRIVES. REMOVE AND REPLACE FAULTY BONNET LATCH, ADJUST TO SUIT STRIKER PIN. REMOVE AND REPLACE MISSING AND DAMAGED BONNET STAY RUBBERS TRAVEL CAMBRIDGE AND RETURN	441.93	388.99	0	75	905.92

170925-00	SVC001931	09/27/2017	1H0103	184_INT	R	Trays/Buck	1ME645	19764 HRS	REPLACE TAIL GATE SEAL	TRAVELLED TO HBMI, REMOVE DAMAGED TAIL GATE SEALING RUBBER, STRAIGHTEN BENT MOUNTING PLATE AND RETAINER AND FIT NEW RUBBER SEAL, CHECK OVER UNIT BEFORE BEING FLOATED TO NYRSTAR	321.4	385	0	53.5	759.9
170829-00	SVC001916	09/12/2017	1H0103	184_INT	S	Service	1ME645	16312 hrs	S1 A SERVICE	CARRIED OUT S1 A SERVICE AS PER SERVICE SHEET, TOPPED UP COOLANT LEVEL AND CHECK FOR EXTERNAL LEAKS, TIGHTEN HOSE CLAMPS.	361.59	268.63	0	23	653.22
170808-00	SVC001906	08/09/2017	1H0103	121_INT	R	Engine	1ME645		SUPPLY ENGINE OIL, COOLANT & G	SUPPLY ENGINE OIL, COOLANT & GREASE	0	175.9	0	0	175.9
170803-00	SVC001905	08/08/2017	1H0103	184_INT	R	Bodywork	1ME645	16223hrs	ADJUST BONNET , REPAIR CATCH	STRAIGHTEN BRACKET UNDER AIR CLEANER, PUSH BONNET SIDES BACK INTO POSITION AND ADJUST BONNET STRIKER. ADJUST AND LUBRICATE BONNET CATCH. OPERATION ALL OK.	160.7	0	0	8	168.7
170616-00	SVC001878	07/26/2017	1H0103	184_INT	R	Bodywork	1ME645	16013 HRS	REPAIR L/HAND ACCESS STEP	TRAVELLED TO NYRSTAR, CHECKED DAMAGE TO LEFT HAND STEP, REMOVE STEP FROM R/HAND SIDE TO L/HAND SIDE AS REQUESTED UNTIL NEW PARTS ARRIVE, TRAVELLED BACK TO SITE, ASSEMBLE STEP WITH NEW PARTS AND REFIT TO MACHINE.	200.89	332.7	0	22.5	556.09
170710-00	SVC001891	07/26/2017	1H0103	184_INT	R	Sundries	1ME645	16187 HRS	CHECK OIL LEAK FROM UNDER CAB	10/7/17 TRAVEL TO TRANMERE AND CHECK OIL LEAK DRIPPING FROM BELLY PLATE, FOUND LEAK TO BE COMING DOWN FROM UNDER CAB, RETURN TO LA. UNIT RETURNED TO LA WSHOP A WEEK LATER. PARK UNIT IN WORKSHOP AND LIFT CAB. RUN UNIT AND TRACE OIL LEAK TO TWO LEAKING HOSES AND O RINGS ON STEERING VALVE. REMOVE HOSES AND HAVE NEW ONES MADE, REFIT HOSES AND REPLACE O RINGS ON VALVE. RUN UNIT FOR PERIOD OF TIME UNDER LOAD TO CHECK FOR FURTHER LEAKS. TESTED OK. LOWER AND SECURE CAB , PARK UNIT OUTSIDE READY FOR WORK	817.66	1012.25	0	91	1920.91
170718-00	SVC001893	07/26/2017	1H0103	186_INT	S	Service	1ME645	16223 hrs 1	S1 D SERVICE	CARRIED OUT S1 D SERVICE AS PER SERVICE SHEET	733.08	1942	0	125.8	2800.88
170630-00	SVC001883	07/04/2017	1H0103	184_INT	R	Hydraulic	1ME645	16116 HRS	REPAIR HYD LEAK & CHECK COOLAN	TRAVELLED TO NYRSTAR, INSPECT OIL LEAK AND REPLACED LEAKING O RING UNDER REAR OF CAB, CHECKED FOR COOLANT LEAK AND TOP UP COOLANT.	160.7	0	0	20.5	181.2
170630-00	SVC001885	07/04/2017	1H0103	121_INT	R	Tyres	1ME645		HALITRAC 23.5R25 TYRES +	HALITRAC 23.5R25 TYRES + CALLOUT CARRIED OUT BY BRIDGESTONE	0	10321	0	0	10321
170619-00	SVC001879	06/19/2017	1H0103	184_INT	R	Sundries	1ME645	16001 HRS	CHECK OVER BEFORE WORK	TRAVELLED TO NYRSTAR, CHECKED OVER UNIT BEFORE WORK AS REQUESTED	120.53	0	0	18.5	139.03
170531-00	SVC001870	06/06/2017	1H0103	184_INT	S	Service	1ME645	15976 HRS	S1 B SERVICE	TRAVELLED TO NYRSTAR, CARRIED OUT S1 B SERVICE AS PER SERVICE SHEET. ADJUST ALL BELTS AND REPLACE DIFF BREATHERS. CLEANED OUT COOLING CORES DUE TO UNIT OVER HEATING.	657.18	735.31	0	56.75	1449.24
170523-00	SVC001867	05/29/2017	1H0103	121_INT	R	Tyres	1ME645	NOT RECOI	CALL OUT TO REPAIR LHF DRIVE T	CALL OUT TO REPAIR LHF DRIVE TYRE	0	0	280.86	0	280.86

170502-00\	SVC001855	05/24/2017	1H0103	184_INT	R	Hydraulic	1ME645	15952 HRS	REPAIR OIL LEAKS UNDER CAB	TRAVELLED TO NYRSTAR, SMILEY CRANES CALLED IN TO LIFT CAB, CHECKED FOR OIL LEAKS, FOUND HOSES CHAFED IN CHASSIS, REMOVE HOSES AND HAVE NEW ONES MADE TO SAMPLE BY HARDY SPICER, REFIT HOSES AND TOP UP HYDRAULIC OIL, TEST RUN UNIT AND CHECK FOR LEAKS, TRAVELLED BACK TO NYRSTAR, LIFT CAB AND REPLACE TWO MORE HYDRAULIC HOSES IN CHASSIS, TEST RUN UNIT AND CHECK FOR LEAKS, TESTED OK, LOWER CAB AND RETURN UNIT TO WORK	2097.74	298.14	696.39	87.5	3179.77
170322-00\	SVC001835	03/28/2017	1H0103	184_INT	R	Service	1ME645	15839 HRS	PMI CHECK OVER BEFORE WORK	TRAVELLED TO NYRSTAR, CARRIED OUT PMI CHECK OVER BEFORE WORK, TOP UP OIL LEVELS USED NYRSTAR STOCK	200.88	0	0	18.75	219.63
170327-00\	SVC001835	03/28/2017	1H0103	184_INT	R	Hydraulic	1ME645	15842 HRS	REPLACE BLOWN HOSE UNDER CAB	TRAVELLED TO NYRSTAR, REMOVE BLOWN HYDRAULIC HOSE UNDER CAB, FABRICATE NEW HOSE AND FIT	856.8	24.81	0	43	924.61
170306-01\	SVC001835	03/21/2017	1H0103	184_INT	R	Electrical	1ME645	15833 HRS	repair window fault	TRAVELLED TO NYRSTAR, INSPECT WINDOW FAULT, REMOVE DOOR COVER AND CHECK OPERATION . FOUND BOTH WINDOWS SECURED IN CLOSED POSITION DUE TO FAULTY MOTORS, REPLACED REGULATOR ASSEMBLY IN L/HAND WINDOW, TEST OPERATION ALL OK	321.41	848.05	0	53.5	1222.96
170223-00\	SVC001825	02/28/2017	1H0103	184_INT	R	Hydraulic	1ME645	15814 HR	REPLACE BLOWN HYD HOSE		200.88	129.65	0	28.75	359.28
170227-00\	SVC001825	02/27/2017	1H0103	184_INT	R	Engine	1ME645	15812 HRS	top up coolant	TOP UP COOLANT AND CHECK FOR LEAKS	40.18	9.14	0	12.5	61.82
170131-00\	SVC001815	02/09/2017	1H0103	184_INT	R	Sundries	1ME645	15753 HRS	CHECK OVER BEFORE WORK	CHECK OVER BEFORE WORK . CLEANED AIR FILTERS , REMOVED AND REPLACED OUT OF DATE FIRE EXTINGUISHER . REPLACED RIGHT HAND SIDE INDICATOR ASSEMBLY , REPLACED R/HAND SIDE WORK LIGHT WIRING PLUG	241.05	80	0	12	333.05
170201-00\	SVC001815	02/06/2017	1H0103	121_INT	R	Tyres	1ME645		STRIP & FIT X 4 + O-RING X 4	STRIP & FIT X 4 + O-RING X 4	0	60	320	0	380
170119-00\	SVC001805	01/27/2017	1H0103	105_HBGN	R	Engine	1ME645		LOW COOLANT- TOP UP	1ME645	104.93	45.69	0	0	150.62
161220-00\	SVC001795	01/25/2017	1H0103	184_INT	S	Service	1ME645	15720 HRS	S1 A SERVICE	JOB CARRIED OUT - DIAGNOSE COOLANT LIGHT FAULT. TOPPED UP LOW COOLANT. HEAT UP ENGINE AND CHECK FOR LEAKS. TIGHTEN UP LOOSE HOSE CLAMP ON HEADER TANK HOSE. TRAVELLED TO NYRSTAR, CARRIED OUT S1 A SERVICE AS PER SERVICE SHEET	241.06	251.47	0	29.5	522.03
161208-00\	SVC001795	12/15/2016	1H0103	105_HBGN	R	Trays/Buck	1ME645	NA	ADJUST AND MODIFY T/GATE SEAL	1ME645	69.95	0	0	0	69.95
161212-00\	SVC001795	12/15/2016	1H0103	105_HBGN	R	Bodywork	1ME645	15580	CHECK, TIGHTEN LOOSE MIRRORS	JOB CARRIED OUT - ADJUST AND MODIFY CORNER OF TAIL GATE SEAL, TO STOP LEAKS. 1ME645	34.98	0	0	0	34.98
161212-00\	SVC001795	12/15/2016	1H0103	105	R	Trays/Buck	1ME645	15580	C/OUT - TAIL GATE SEAL REPAIR	JOB CARRIED OUT - LOOSE LH SIDE MIRROR, RETENSION LOCKING NUTS. 1ME645	214.2	0	0	0	214.2
										ODOMETER - 15580 HOURS					
										JOB CARRIED OUT - CALL OUT - TAIL GATE NOT SEALING, REMOVE PRODUCT AND ADJUST TAIL GATE SEAL.					

161121-00: SVC001778	12/14/2016	1H0103	184_INT	R	Air Con	1ME645	15562	REPLACE A/C CONDENSOR	REPLACE AIR CON CONDENSOR TRAVEL TO IMPACT AND CHECK OVER MACHINE BEFORE WORK. CLEANED ALL FILTERS , REPLACE EXPIRED FIRE EXTINGUISHER . CHECK AIR CON SYSTEM AND FOUND CONDENSER FAULTY . REMOVE AND REPLACE CONDENSER , RECHARGE AIR CON SYSTEM TESTED OK	401.76	590.3	0	81.25	1073.31
161130-00: SVC001784	12/14/2016	1H0103	184_INT	R	Electrical	1ME645	15643 HRS	repair head lights	TRAVEL TO IMPACT AND REPLACE L/HAND HEAD LIGHT ASSEMBLY BECAUSE BACK OF LIGHT DAMAGED	40.18	215.14	0	6.25	261.57
161201-00: SVC001784	12/06/2016	1H0103	186_INT	R	Bodywork	1ME645		REPLACE FRONT SCREEN	REPLACE FRONT SCREEN WORK DONE BY HOBART AUTO GLASS	0	0	800	0	800
161201-00: SVC001785	12/06/2016	1H0103	184_INT	R	Brake	1ME645		CHECK REPORTED CODE RECHARGE	TRAVELLED TO IMPACT, CHECKED REPORTED CODE RECHARGE REAR ACCUMULATOR, CHECKED CODES ON DASH, TOPPED UP COOLANT TO REMOVE ONE CODE, TRACE OTHER CODE TO LOW ACCUMULATOR PRESSURE, RECHARGE ACCUMULATORS AND TESTED OK	241.05	1.77	0	24.5	267.32
161128-00: SVC001786	11/28/2016	1H0103	184_INT	R	Sundries	1ME645	15592 HRS	CHECK TAIL GATE SEAL	TRAVELLED TO NYRSTAR, CHECKED TAIL GATE SEAL AND STRAIGHTEN BRACKET	80.35	0	0	12.5	92.85
161108-00: SVC001775	11/15/2016	1H0103	184_INT	R	Sundries	1ME645	15516 HRS	CHECK SEAL ON TAIL BOARD	TRAVELLED TO NYRSTAR, REMOVED OLD SEALING RUBBER AND BRACKETS, STRAIGHTEN BRACKETS AND REFIT WITH NEW SEALING RUBBER, TEST OPERATION TO ENSURE NEW RUBBER SEALING ON TRAY, DIG PRODUCT OUT OF TRAY TO ALLOW PROPER SEAL	321.4	0	0	34.75	356.15
161104-00: SVC001772	11/09/2016	1H0103	105_HBGN	R	Brake	1ME645		BRAKE COOLING FILTER LEAK	1ME645 JOB CARRIED OUT - DIAGNOSE BRAKE COOLING FILTER LEAK, SOURCE PARTS FROM LA. REMOVE FILTER HOUSING, TO REMOVE SEIZED FILTER. REPLACE PINCHED ORINGS. FIT FILTER HOUSING AND BLEED SYSTEM.	454.68	3.24	0	0	457.92
161018-00: SVC001761	10/31/2016	1H0103	184_INT	S	Service	1ME645	15500 hrs	S1 C SERVICE	TRAVELLED TO NYRSTAR, CARRIED OUT S1 C SERVICE AS PER SERVICE SHEET	803.5	1762.87	0	82.5	2648.87
161019-00: SVC001765	10/28/2016	1H0103	105_HBGN	R	Electrical	1ME645		REPAIR FAULTY LIGHTS	1ME645 JOB CARRIED OUT - HEAD LIGHTS NOT WORKING, FOUND BURNT HARNESS UNDER PRODUCT BUILD UP. WASH OUT PRODUCT AND REPAIR HARNESS.	454.68	141	0	0	595.68
161021-00: SVC001761	10/27/2016	1H0103	182_INT	R	Lathe	1ME645		MACHINE HANDLE FROM OILON	MACHINE HANDLE FROM OILON	52.46	0	0	0	52.46
160927-00: SVC001756	10/13/2016	1H0103	105_HBGN	R	Engine	1ME645	15483	DIAGNOSE FUEL/PRESSURE FAULTS	1ME645 ODOMETER - 15483 HOURS JOB CARRIED OUT - DIAGNOSE ENGINE POWER FAULTS. FIT NEW COMMON RAIL SENSOR AND TEST OPERATION.	734.49	754.83	0	0	1489.32

160926-00: SVC00174	09/27/2016	1H0103	184_INT	R	Electrical	1ME645	15379 HRS	CHECK ENGINE FUEL PROBLEM	TRAVELLED TO NYRSTAR, CHECK FAULT CODES ON DASH CAUSING LIGHT TO FLASH, TRACED TO COMMON RAIL PRESSURE SENSOR, REMOVED PLUGS AND CLEANED UP WIRING TO STOP LIGHT FLASHING	53.55	0	0	12.5	66.05
160920-00: SVC00174	09/23/2016	1H0103	105_HBGN	F	Electrical	1ME645	15345HRS	FIT UP NEW LED LIGHTS X2	ME645 ODOMETER - 15345 HOURS JOB CARRIED OUT - FIT NEW REVOLVING LIGHTS AND BRACKETS ON EITHER SIDE OF CAB.	209.85	121.6	0	0	331.45
160712-00: SVC00171	08/09/2016	1H0103	184_INT	R	Sundries	1ME645	15265 HR	REPLACE BROKEN SEAT CONTROL S	TRAVEL TO NYRSTAR, REPLACED BROKEN SEAT CONTROL SWITCH, TOPPED UP COOLANT AND CHECKED FOR LEAKS	164.85	406.47	0	13.5	584.82
160801-00: SVC00172	08/09/2016	1H0103	184_INT	R	Hydraulic	1ME645	15286 KM	REPLACE BLOWN LIFT CYLINDER HO	TRAVELLED TO IMPACT, INSPECT FOR OIL LEAK, FOUND BLOWN LIFT CYLINDER HOSE, HARDY SPICER TO FABRICATE NEW HOSE, FIT TO MACHINE, TOPPED UP HYDRAULIC OIL AND TEST OPERATION	236.25	76.4	231.87	28.5	573.02
160729-00: SVC00172	08/02/2016	1H0103	184_INT	R	Electrical	1ME645	15283 HRS	CHECK ALL LIGHTS BEFORE WORK	CHECK ALL LIGHTS BEFORE WORK AND REPAIR HEAD LIGHT WIRING CLEANED AIR FILTERS AND REPLACE UHF HAND PIECE	275.63	0	0	17.5	293.13
160711-00: SVC00170	07/14/2016	1H0103	105_HBGN	R	Sundries	1ME645		DIAGNOSE FAULTY SEAT SWITCH	1ME645 JOB CARRIED OUT - DIAGNOSE SEAT AIR BAG SUSPENSION FAULT. REPAIR SWITCH TO ALLOW SEAT TO PUMP UP. SWITCH NEEDS REPLACING, UNABLE TO LEVER SEAT.	136.5	0	0	0	136.5
160601-00: SVC00169	06/22/2016	1H0103	184_INT	S	Service	1ME645	15186 HR	S1 A SERVICE	TRAVELLED TO NYRSTAR, CARRIED OUT S1 A SERVICE AS PER SHEET.	275.63	230.46	0	35.5	541.59
160531-00: SVC00169	06/15/2016	1H0103	184_INT	R	Electrical	1ME645	15184 HR	REPAIR LIGHTS CHECK CODES	TRAVELLED TO NYRSTAR, CHECK LIGHTS, REPLACED TWO FAULTY WORK LIGHTS AND REPLACED BLOWN HEADLIGHT GLOBES. FOUND HORNS FAULTY. REMOVED HORNS AND TRAVELLED TO KOMATSU TO GET NEW. TRAVELLED BACK TO NYRSTAR AND FIT NEW HORNS. CHECK CODES ON DASH PANEL. FOUND TO HAVE FAULTY BODY POSSITION SENSOR. REMOVED AND TRAVELLED BACK TO KOMATSU TO GET NEW SENSOR. TRAVELLED BACK TO NYRSTAR TO FIT NEW SENSOR. TEST OPERATION ALL OK	1102.5	1336.5	0	116	2555
160523-00: SVC00168	06/14/2016	1H0103	105	R	Engine	1ME645		LOW ENGINE OIL, PMI FOR O/LOAD	1ME645 JOB CARRIED OUT - CARRY OUT PMI, TOP UP LOW ENGINE OIL.	136.5	40.7	0	0	177.2
160526-00: SVC00168	05/31/2016	1H0103	105	R	Electrical	1ME645	15164	HEADLIGHTS & CHECK W/LIGHTS	1ME645 JOB CARRIED OUT - REPAIR WIRING TO HEAD LIGHTS.	141.76	0	0	0	141.76

160504-00: SVC001677	05/11/2016	1H0103	186_INT	R	Engine	1ME645	14998 HR	CLEAN RADIATOR CORE	CLEAN RADIATOR CORE REMOVR GRILL AND COVERS WASH OUT MATERIAL BUILD UP IN FRONT OF RADIATOR CLEAN RADIATOR AND COOLER CORES CLEAN CONDENSOR CORE AND REFIT COVERS AND GRILL	546	23.91	0	26	595.91
160318-00: SVC001651	05/03/2016	1H0103	184_INT	S	Hydraulic	1ME645	14467	RESEAL LHS STEER CYLINDER	TRAVELLED TO IMPACT, WASH MACHINE, REMOVED LH STEER CYLINDER, RETURN TO WSHOP AND DISASSEMBLE ADN RESEAL CYLINDER, RETURNED TO IMPACT AND REFIT CYLINDER, TOPPED UP HYD OIL, TEST OPERATION.	393.75	943.86	0	30.5	1368.11
160411-00: SVC001663	04/20/2016	1H0103	105	R	Engine	1ME645		TOP UP COOLANT BEFORE OUTLOAD	1ME645	34.13	41.1	0	0	75.23
160324-00: SVC001654	04/12/2016	1H0103	184_INT	R	Trays/Buck	1ME645	14875	REPLACE TAIL GATE SEAL	JOB CARRIED OUT - TOPPED UP COOLANT. TRAVELLED TO NYRSTAR. FIX UP TAILGATE RUBBER TO LAST OUT FOR INLOAD, CLEANED PRODUCT BUILD UP FROM REAR OF TRAY.	472.5	285	0	45.5	803
160401-00: SVC001658	04/12/2016	1H0103	184_INT	R	Electrical	1ME645	14938	REPLACE REVOLVING LIGHT	REPLACED REVOLVING LIGHT AS REQUIRED	39.38	105	0	0	144.38
160321-00: SVC001654	03/24/2016	1H0103	105_HBGN	R	Electrical	1ME645	14780	C/OUT - TRAY SENSOR FAULT	1ME645	210	0	0	22	232
									ODOMETER - 14780 HOURS					
160315-00: SVC001645	03/23/2016	1H0103	184_INT	R	Electrical	1ME645	14781	INSPECT REPORTED E03 ERROR COD	JOB CARRIED OUT - CALL OUT - ASSESS TRAY UP OPERATION. CLEANED PRODUCT FROM AROUND POTENTIOMETER. TRAVEL TO NYRSTAR. INSPECT REPORTED E03 ERROR CODES, CHECKED FOR ACTIVE FAULT CODES NONE PRESENT, CHECKED OPERATION OF ALL FUNCTIONS, NO FAULTS FOUND	78.75	0	0	11	89.75
160315-00: SVC001650	03/23/2016	1H0103	184_INT	S	Service	1ME645	14836	S1 B SERVICE	TRAVELLED TO NYRSTAR. CARRIED OUT S1 B 500 HR SERVICE AS PER SERVICE SHEET	472.5	670.14	0	43.9	1186.54
160304-00: SVC001646	03/10/2016	1H0103	184_INT	R	Hydraulic	1ME645	14781	REPLACE BLOWN BRAKE PIPE	TRAVEL TO IMPACT, FABRICATE AND REPLACED LHM DIFF BRAKE HOSE AND TOPPED UP OIL AS REQUIRED	204.23	181.5	0	32	417.73
160219-00: SVC001641	02/27/2016	1H0103	184_INT	R	Starter Mot	1ME645	14612	REPLACE U/S STARTER MOTOR	TRAVELLED TO IMPACT, CHECK UNIT FOR STARTING FAULT, INSUFFICIENT VOLTAGE AT BATTERIES WHILE CRANKING, ATTEMPT TO JUMP START UNIT STILL UNABLE TO START CHECK BATTERY ISOLATOR AND WIRING ALL GOOD., CHECK STARTER MOTOR AND FOUND TO BE GETTING VERY HOT, REMOVED AND DISMANTLED, FOUND REAR BEARING TO HAVE FAILED AND DESTROYED INTERNAL OF STARTER MOTOR, REPLACED WITH NEW UNIT AND TEST OPERATION ALL GOOD.	551.26	975	0	58	1584.26
160217-00: SVC001635	02/24/2016	1H0103	184_INT	R	Electrical	1ME645	14595	JUMP START & CHECK CHARGE RATE	TRAVELLED TO IMPACT, JUMP START UNIT AND TEST ALL OK, UNIT WAS NOT GIVEN TIME TO CHARGE, TRAVELLED BACK AGAIN, JUMP START UNIT AGAIN, CHECKED FOR VOLTAGE DROP ETC COULD NOT FAULT CHECKED CHARGE RATE.	275.63	7.49	0	25	308.12
160202-00: SVC001625	02/23/2016	1H0103	184_INT	S	Service	1ME645	14591	S1 A SERVICE	TRAVELLED TO IMPACT, CARRIED OUT S1 A SERVICE AS PER SERVICE SHEET.	275.63	354.34	0	30	659.97

160106-00: SVC00161	02/16/2016	1H0103	186_INT	R	Electrical	1ME645	14591	REPLACE HEADLIGHT LENSES	ON SITE AT IMPACT, REPLACED HEADLIGHT LENSES AND REPLACED BROKEN ADJUSTER ROD ON ALTERNATOR	78.75	233.98	0	0	312.73
160212-00: SVC00163	02/16/2016	1H0103	184_INT	R	Electrical	1ME645	14591	REPLACE U/S BATTERIES	TRAVELLED TO IMPACT, REMOVED AND REPLACED FAULTY BATTERIES, REPLACED LH ROOF WORKLIGHT DUE TO BEING RUSTED OUT, CHECKED LH WINDOW STUCK DOWN, TEST AND FOUND MOTOR TO BE FAULTY, REMOVED MOTOR AND FIXED REGULATOR IN CLOSED POSITION	315	425.63	0	27	767.63
160128-00: SVC00162	01/29/2016	1H0103	184_INT	R	Electrical	1ME645	14505	JUMP START & CHECK CHARGE RATE	TRAVEL TO IMPACT AND JUMP START UNIT CHECK CHARGE RATE	78.75	0	0	16.5	95.25
160118-00: SVC00162	01/18/2016	1H0103	121_INT	R	Tyres	1ME645	NOT SUPPL	FIT COP 23.5R25 AND O RINGS	FIT COP 23.5R25 HM300 AND O RINGS RUBAND DD 20936 AS PER PAUL KELLEHER	0	75	0	0	75
151218-00: SVC00161	01/15/2016	1H0103	186_INT	R	Hydraulic	1ME645	14361 HR	REPAIR HYDRAULIC OIL LEAKS, F/	REPAIR HYDRAULIC OIL LEAKS, FINAL DRIVE LEAKS, LIFT CAB AND REPLACE LEAKING HYD HOSES LOWER CAB AND TOP UP HYD OIL CLEAN WINDOWS AND REPAIR LIGHTS REMOVE LEFT AND RIGHT CENTRE AXLE PLANETARY COVERS PRESS APART AND REPLACE SEALING O RINGS REASSEMBLE AND REFIT TO MACHINE FILL PLANETARIES WITH OIL REMOVE OPERATOR DOOR FACIAL AND REMOVE ELECTRIC WINDOW MECHANISM SWAP WITH MOTOR FROM RIGHT HAND DOOR AND REASSEMBLE BOTH DOORS TEST OPERATION CHECK UNIT OVER AND RETURN TO WORK	1660.05	359.71	0	50	2069.76
151214-00: SVC00160	01/12/2016	1H0103	121_INT	R	Tyres	1ME645		4 X AEOLUS DUMP TYRES RUBAND	4 X AEOLUS DUMP TYRES PLUS FITTING RUBAND	0	9220	0	0	9220
151113-00: SVC00158	01/08/2015	1H0103	184_INT	S	Service	1ME645	14310	S1 D SERVICE	CARRIED OUT S1 D SERVICE AS PER SERVICE SHEET, REPLACED DIFF BREATHERS, CHANGED OVER FILTER HOUSING.	898.81	2805.17	0	50	3753.98
151127-00: SVC00160	01/30/2015	1H0103	184_INT	R	Electrical	1ME645	14310	REPAIR TAILLIGHTS & INDICATORS	CHECKED LH TAIL LIGHT NOT WORKING, REPAIRED WIRING LOOM UNDER TRAY PIVOT, REPLACED LHS INDICATOR ASSY DUE TO BEING SMASHED, TEST ALL OK, REPLACED REVERSE ALARM DUE TO BLOCKED WITH DIRT	341.25	178.35	0	17	536.6
151113-00: SVC00159	01/26/2015	1H0103	105	R	Engine	1ME645		INSPECT EXHAUST LEAK NHS WHARF	1ME645	68.25	0	0	0	68.25
									JOB CARRIED OUT - INSPECT AT WHARF. DIAGNOSE ENGINE EXHAUST LEAK, FOUND EXHAUST FLEX BROKEN FROM ENGINE PIPE, ORGANISE REPAIR.					
151113-00: SVC00158	01/24/2015	1H0103	184_INT	R	Exhaust	1ME645	14252	REPLACE U/S EXHAUST FLEX	TRAVEL TO NYRSTAR X 2 INSPECT FOR EXHAUST LEAK, REMOVED CAB SIDE COVERS AND EXHAUST FROM UNDER THE CAB, RETURN TO THE WORKSHOP AND CLEAN UP FLANGES, CUT FLEX TO LENGTH AND REFIT CAB COVERS, REMOVED BROKEN BOTLS AND REPLACED	791.18	169.03	0	61	1021.21
151112-00: SVC00154	01/13/2015	1H0103	121_INT	R	Tyres	1ME645		FIT COP + O-RING	FIT COP + O-RING CARRIED OUT BY RUBAND	0	0	0	0	0
151112-00: SVC00159	01/13/2015	1H0103	121_INT	R	Tyres	1ME645		FIT COP + O-RING	PUNCTURE REPAIR CARRIED OUT BY RUBAND	0	40.91	0	0	40.91
151109-00: SVC00159	01/12/2015	1H0103	105_HBGN	R	Sundries	1ME645		PMI - INSPECTION FOR NYRSTAR	1ME645	136.5	0	0	0	136.5
									JOB CARRIED OUT - COMPLETE PMI INSPECTION FOR SITE USE.					

151009-00	SVC001575	10/30/2015	1H0103	184_INT	R	Sundries	1ME645	13990	REPAIR SEAT ADJUSTER	TRAVEL TO IMPACT AND CHANGE OVER SEAT PANEL WIHT SPARE FROM BARN	78.75	0	0	11	89.75
151026-00	SVC001586	10/27/2015	1H0103	186_INT	R	Sundries	1ME645	14085HRS	PMI - LIST OF REPAIRS	Action fault sheet list of repairs reported by shane. Topped up the coolant. Damage to the tail gate couldn't fault. Repaired the revolving light group. Checked all oil levels.	136.5	253.46	0	6.5	396.46
151001-00	SVC001575	10/06/2015	1H0103	184_INT	R	Sundries	1ME645	13928	PRE OUTLOAD INSPECTION	TRAVEL TO IMPACT CHECK TRAY SEALS AND CHECK ALL FLUID LEVELS, GREASE UNIT, TOP UP COOLANT AND HYDRAULIC OIL	78.75	0	0	14.6	93.35
150903-00	SVC001565	09/24/2015	1H0103	184_INT	R	Hydraulic	1ME645	13857	REPAIR L/H LIFT CYL LOWER MOUN	Travel to MPWTS remove LHS lower lift cylinder pin for bush replacement, replaced pin and bush, grease unit and test operation, Temporary fit out old pin do machine can be moved as requested by Impact, repair hyraulic oil leak at rear of cab,	472.5	460.47	0	47	979.97
150825-00	SVC001554	09/10/2015	1H0103	184_INT	S	Service	1ME645	13888	S1 A SERVICE	TRAVELLED TO IMPACT AND COMPLETED THE REQUIRED SERVICE AND SAFETY CHECKS AS PER SERVICE SCHEDULE REPAIRED THE FAULTY WORK LIGHTS AND ADJUST THE BOLT, FOUND LOOSE LIFT CYLINDER BUSH, REPLACED FAULTY GREASE NIPPLE.	334.69	232.6	0	33	600.29
150831-00	SVC001557	08/31/2015	1H0103	184_INT	R	Electrical	1ME645	13846	Repair tray sensor fault	TRAVELED TO IMPACT FERTILIZERS TO CHECK WIRING ETC WENT FOR A RUN WITH DRIVER AND CHECK VOLTAGE ALL OK, FAULT HAD COME UP ON AN INTERMEDIATE BASIS	404.78	0	0	36.5	441.28
150806-00	SVC001546	08/27/2015	1H0103	184_INT	R	Sundries	1ME645	13763	PRE OUTLOAD INSPECTION & HEADL	TRAVELLED TO IMPACT AND INSPECET DUMPER FLUIDS, REPAIR LIGHTS, INSPECT TAIL GATE AND GREASE UNIT	598.5	31.2	0	44.5	674.2
150820-00	SVC001555	08/27/2015	1H0103	105_HBGN	R	Sundries	1ME645	13807HRS	COMPLETED PMI'S	1ME645	73.51	0	0	0	73.51
										ODOMETER - 13807 HOURS					
150722-00	SVC001535	07/29/2015	1H0103	105	R	Electrical	1ME645	13650	EO3 CODE- INSPECTION OF FAULT	JOB CARRIED OUT - COMPLETE PMI ON UNIT. 1ME645	102.38	0	0	0	102.38
										ODOMETER - 13650 KM					
										JOB CARRIED OUT - DIAGNOSE EO3 FAULTS. TRAY ALARM ELEC FAULT OCCURRED. CLEARED FAULTS AND TESTED OK.					
150721-00	SVC001537	07/28/2015	1H0103	184_INT	R	Brake	1ME645	13684	REPAIR BRAKE STUCK ON FAULT	TRAVELED TO IMPACT FERTILIZERS TO INSPECT DRIVERS COMPLAINT ABOUT BRAKE STICKING ON, FOUND PRODUCT BUILD UP UNDER PEDAL, CLEANED OUT UNDER PEDAL AND TESTED,ALL OK	39.38	0	0	11	50.38
150622-00	SVC001523	06/24/2015	1H0103	105	R	Hydraulic	1ME645		TRAY UP ALARM REPAIRS	1ME645	68.25	0	0	0	68.25
										JOB CARRIED OUT - INSPECT TRAY UP ALARM OPERATION. TESTED OK.					
150605-00	SVC001515	06/17/2015	1H0103	184_INT	S	Service	1ME645	13609	S1 B SERVICE	TRAVELED TO HBMI AND PERFORMED S1` B SERVICE	435.75	663.1	0	60	1158.85
150605-00	SVC001515	06/15/2015	1H0103	184_INT	R	Engine	1ME645	13580 HR	TOP UP ENGINE OIL		39.38	28.49	0	33	100.87
150604-00	SVC001514	06/05/2015	1H0103	184_INT	R	Electrical	1ME645	13573	INSPECT REPORTED EO3 CODE	travel to hbmi and remove and clear logged fault code not reaccluring, Top up coolant	78.75	0	0	43	121.75

150529-00	SVC00151	06/02/2015	1H0103	184_INT	R	Electrical	1ME645	13548	INSPECT TRAY ALARM FAULT	TRAVELLED TO MORNINGTON WASTE, ADJUSTED POTENTIOMETER FOR TRAY AND CHECKED -- STILL FLASHING CODE, CHECKED OVER WIRING, PLUGS, CONNECTIONS -- FAULT NOT ACTIVE	404.78	0	0	69.5	474.28
150602-00	SVC00151	06/02/2015	1H0103	121_INT	R	Tyres	1ME645		FIT COP + O-RING RUBAND 115867	FIT COP + O-RING RUBAND 115867	0	75	0	0	75
150311-00	SVC00146	05/21/2015	1H0103	184_INT	F	Hydraulic	1ME645	14434	FIT UP CAB TILT CYLINDER	LIFT UP CAB AND FIT UP NEW TILT CYLINDER, LOWER CAB	1299.38	1337.29	0	50	2686.67
150505-00	SVC00149	05/15/2015	1H0103	184_INT	R	Hydraulic	1ME645	13434 HR	REPAIR OIL LEAKS UNDER CAB	INSPECT OIL LEAKS UNDER CAB, REMOVED AND REPLACED LEAKING HOSES LOWER CAB, TOP UP HYD OIL AND TEST	590.63	188.44	0	29.5	808.57
150429-00	SVC00149	05/13/2015	1H0103	186_INT	R	Engine	1ME645	14434 HR	REMOVE RADIATOR AND RECORE	SET UP MACHINE IN WASH BAY, DRAINED COOLING SYSTEM, REMOVED COOLIGN FAN AND SHROUD, REMOVED INDUCTION HOSES AND COOLING SYSTEM HOSES TO COOLERS, LOWER FRONT BELLY PLAE TO REMOVE LOWER RAD HOSE, REMOVE ALL BOLTS AND STAYS SECURING RADIATOR AND INTERCOOLAER ASSYS, REMOVE ASSYS AND STRIP FOR REPAIR. NEW NORFOLK RADIATOR REPAIRS RECORED RADIATOR. REFIT RADIATOR, REFIT INTERCOOLER AND PIPING, RADIATOR HOSES ETC, FIT CONDENSER, REFITTED BELLY PLATE, TOPPED UP COOLANT, TEST RUN MACHINE	1501.51	372.89	2919	50	4843.4
150427-00	SVC00149	04/28/2015	1H0103	184_INT	R	Engine	1ME645	13413	TOP UP COOLANT & CHECK FOR LEA	TRAVELLED TO IMPACT, CHECKED FOR COOLANT LOSS, TOPPED UP COOLANT LEVEL	118.13	18.81	0	14.8	151.74
150409-00	SVC00148	04/27/2015	1H0103	121_INT	R	Tyres	1ME645	NOT SUPPL	PUNCTURE/MINOR REPAIR IND + TU	PUNCTURE/MINOR REPAIR IND + TUBELESS ORING E/MOVER + SVC CALL OUT AFTER HOURS / 15MIN BRIDGESTON SELECT MOONAH WORK ORDER 78744 CALL OUT AFTER HOURS TO REPAIR TYRE ON LHF OF M645 ARRANGED BY PAUL KELLEHER	0	436.36	0	0	436.36
150318-00	SVC00147	03/31/2015	1H0103	184_INT	R	Air Con	1ME645	13326	REPLACE EVAPORTOR & TX VALVE	TRAVELLED TO NYRSTAR, REPLACED EVAPORATOR AND TX VALVE, REGASSED AIR CON, TOPPED UP ENGINE OIL	1272.87	368.7	0	138	1779.57
150319-00	SVC00147	03/31/2015	1H0103	184_INT	S	Service	1ME645	13332	S1 A SERVICE	TRAVELLED TO NYRSTAR, CARRIED OUT S1 A SERVICE AS PER SCHEDULE	393.76	266.54	0	45	705.3
150325-00	SVC00147	03/27/2015	1H0103	105_HBGN	A	Bodywork	1ME645		TRUCK ROLLOVER - INSPECTION	1ME645	238.88	0	0	0	238.88
150326-00	SVC00147	03/27/2015	1H0103	105_HBGN	R	Sundries	1ME645		GREASE HM300	JOB CARRIED OUT - MEASURE LIFT CYLINDERS TO SEE IF ANY DAMAGE AFTER ROLL OVER. WELD UP CRACKED COLLAR TAIL GATE.	68.25	0	0	0	68.25
150310-00	SVC00146	03/17/2015	1H0103	186_INT	R	Air Con	1ME645	13263	SERVICE & REPAIR AIR CON SYSTE	JOB CARRIED OUT - GREASE ALL LUBRICATION POINTS.					
										SERVICE & REPAIR AIR CON SYSTEM CARRY OUT TEST ON AIR CON SYSTEM FOUND PRESSURES OK BUT FOUND EVAPORATOR CORE BLOCKED AND CONDENSOR RESTRICTED CLEANED CORES AND REPLACED CAB FILTERS TEMP RUNNING AT 10 DEGREES	170.63	224.57	0	20	415.2

150303-00	SVC001465	03/13/2015	1H0103	184_INT	R	Hydraulic	1ME645	13218	REPLACE LEAKING HYDRAULIC HOSE	TRAVELLED TO IMPACT, LIFT CAB TO GET ACCESS TO BLOWN HOSES, REPLACED LEAKING HYD HOSES AND LOWER CAB, TOPPED UP HYDRAULIC OIL TRAVELLED BACK TO SITE, LIFT CAB, STEAM CLEAN UNDER CAB AND ENGINE BAY, LOWER CAB AFTER ENZED REPLACED LEAKING HYD HOSES AGAIN	1113.55	394.66	329.87	88.5	1926.58
150306-00	SVC001465	03/13/2015	1H0103	184_INT	R	Sundries	1ME645	13221	PRE IMPACT INLOAD INSPECTION	TRAVELLED TO IMPACT, GREASED MACHINE, CHECKED TAILGATE SEAL, TOPPED UP FLUIDS, CHECKED LIGHTS ETC	118.13	100.5	0	17	235.63
150303-00	SVC001465	03/06/2015	1H0103	105	R	Hydraulic	1ME645		C/OUT- HYD LEAK REAR OF CAB	1ME645 JOB CARRIED OUT - CALL OUT - INSPECT HYDRAULIC LEAK AT REAR OF CAB, TOP UP HYDRAULIC OIL.	273	36.3	0	0	309.3
150302-00	SVC001465	03/04/2015	1H0103	184_INT	R	Engine	1ME645	13176	REPAIR OVERHEATING FAULT	TRAVELLED TO IMPACT, CHECKED OVERHEATING FAULT, CLEANED OUT RADIATOR, CHECKED BELTS ETC, TOPPED UP ENGINE OIL	118.13	12.18	0	22.5	152.81
150225-00	SVC001465	02/27/2015	1H0103	184_INT	R	Electrical	1ME645	13084	REPAIR HEADLIGHT WIRING	TRAVELLED TO IMPACT, FIND AND REPAIR FAULT IN HEADLIGHT WIRING.	78.75	0	0	11	89.75
150206-00	SVC001452	02/20/2015	1H0103	184_INT	R	Differential	1ME645	13041	CHANGE LHF F/DRIVE OIL BAD SAM	TRAVELLED TO IMPACT, CHANGE OUT LHF FINAL DRIVE OIL DUE TO BAD SAMPLE TAKEN AND COMPLETED INSPECTION	118.13	104.8	0	17	239.93
150210-00	SVC001452	02/17/2015	1H0103	184_INT	S	Service	1ME645	13045	S1 A SERVICE	TRAVELLED TO IMPACT, CARRIED OUT S1 A SERVICE AS PER SCHEDULE, FIXED WINDOW TO PREVENT IT DROPPING, CLEANED OUT AROUND POTENTIOMETER AT REAR	196.88	226.08	0	30	452.96
150129-00	SVC001445	01/30/2015	1H0103	184_INT	R	Differential	1ME645	13032	INSPECT LHF FINAL DRIVE BAD SA	TRAVELLED TO IMPACT, INSPECT LHF FINAL DRIVE BAD SAMPLE AS PER CAPPO, SEALS CHECKED FOR LEAKS, NO LEAKS FOUND, CHECKED BEARING MOVEMENT, NO MOVEMENT FOUND, CHECKED BREATHER, ALL GOOD.	78.75	0	0	5.5	84.25
150119-00	SVC001445	01/29/2015	1H0103	184_INT	R	Hydraulic	1ME645	13032	REPLACE SIGHT GUAGE ON HYD TAN	TRAVELLED TO IMPACT, REMOVED AND REPLACED LEAKING SIGHT GLASS IN HYD TANK	78.75	118.09	0	11	207.84
150114-00	SVC001445	01/20/2015	1H0103	184_INT	S	Service	1ME645	12997	S1 C SERVICE	CARRIED OUT S1 C SERVICE AS PER SCHEDULE, CLEANED OUT TRANSMISSION SCREEN ALL OK	616.35	1609.24	0	33.5	2259.09
150116-00	SVC001441	01/20/2015	1H0103	184_INT	R	Trays/Buck	1ME645	12997	RESEAL TAIL GATE	REPLACED BOTTOM SECTION OF TAILGATE RUBBER SEAL AFTER IT HAD BEEN TORN OFF, PUNCH HOLES IN PLATE, CUT RUBBER TO SUIT TAILGATE SEAL	436.8	421.09	0	22	879.89
141201-00	SVC001421	12/15/2014	1H0103	186_INT	R	Electrical	1ME645	79,477 km	REPAIRS TO HEAD LIGHTS	LOCATE AND REPAIR BROKEN WIRE IN LH LOW BEAM CIRCUIT	204.75	0	0	10	214.75
141128-00	SVC001415	12/03/2014	1H0103	184_INT	R	Trays/Buck	1ME645	12893	REPAIR TAILGATE SEAL	REPAIR TAILGATE SEAL, REPLACE REAR WORK LIGHT, REPLACE REAR WIPER BLADE AND CLEAN REAR WINDOW	750.76	77.55	0	37.5	865.81
141124-00	SVC001417	11/27/2014	1H0103	184_INT	R	Sundries	1ME645	12854	REFUEL AT SEIS PIPELINE	TRAVEL TO PIPELINE DAM SITE, REFUEL MACHINE AS PER KIM WOOLLEY	39.38	0	0	247	286.38
141124-00	SVC001414	11/26/2014	1H0103	184_INT	R	Trays/Buck	1ME645	16721	REMOVE DAMAGED TAILGATE SEAL	TRAVEL TO PIPELINE, CUT AND SHUT BENT TAIL GATE SEAL BRACKETS	78.75	0	0	33	111.75
141124-00	SVC001415	11/26/2014	1H0103	184_INT	R	Electrical	1ME645	16715	REPAIR REVERSE ALARM	TRAVEL TO SEIS, REPAIR FAULT WIRH REVERSE ALARM, LOCATE BROKEN WIRING IN CHASSIS HARNESS AND TEST	157.5	0	0	30	187.5

141117-00: SVC001411	11/18/2014	1H0103	184_INT	R	Electrical	1ME645	12803	INSPECT E03 FAULT CODE	TRAVELLED TO IMPACT AND CHECK UNIT FOR FAULT CODES, CAME UP WITH DK54KX, CLEANED PRODUCT BUILD UP OFF BACK TRAY SENSOR AREA AND CLEARED ALL CODES.	39.38	0	0	11	50.38
141106-00: SVC001406	11/17/2014	1H0103	186_INT	S	Service	1ME645	12754	S1 A SERVICE	CARRIED OUT S1 A SERVICE AS PER SCHEDULE AND FIT RECONDITIONED JACK SHAFT	313.43	247.12	0	19	579.55
141113-00: SVC001409	11/17/2014	1H0103	184_INT	R	Electrical	1ME645	12809	REPAIR REVERSE SELECTING FAULT	TRAVEL TO PIPELINE, INSPECT FOR REVERSE FAULT, CLEAN AROUND TRAY SENSOR, CLEAN BATTERY TERMINALS, PULL APART AND INSPECT WIRING HARNESS FROM CAB TO TRAY SENSOR, REPLACED BROKEN GREASE NIPPLED IN TRAY PIVOT, READ MANUALS FOR FURTHER FAULT DIAGNOSIS, TEST DRIVE UNIT	433.13	0	0	99	532.13
141106-00: SVC001406	11/13/2014	1H0103	184_INT	R	Drive Line	1ME645	12754	REPAIR DAMAGED JACK SHAFT	TRAVEL TO PIPELINE, REMOVE JACKSHAFT AND SEND TO HARDY SPICER FOR REPAIRS, PICK UP JACK SHAFT TRAVEL BACK TO SITE, REFIT JACK SHAFT TO UNIT AND GREASE MACHINE	479.85	0	960	90	1529.85
141110-00: SVC001407	11/13/2014	1H0103	184FIELDSIR		Engine	1ME645	12761	CALL OUT - OVERHEATING	CALL OUT TO IMPACT, BLOW OUT AIR CLEANER, BLOW OUT RADIATOR AND INTERCOOLER	105	0	0	16	121
141110-00: SVC001407	11/13/2014	1H0103	184_INT	R	Air Con	1ME645	12780	CALL OUT - AIR CON FAULT	TRAVEL TO IMPACT, INSPECT COMPRESSOR AND BELT, CLEAN OUT CAB FILTERS, CHECK CONDENSOR	105	0	0	16	121
141107-00: SVC001406	11/12/2014	1H0103	184_INT	R	Trays/Buck	1ME645	12754	REPLACE TAILGATE RUBBER	REMOVED OLD TAILGATE SEAL, CLEAN UP, REMOVE AND REPLACE SEIZED NUTS, REPLACED RUBBER ETC	830.55	180	0	33.5	1044.05
141022-00: SVC001398	10/31/2014	1H0103	184_INT	R	Electrical	1ME645	12689	INSPECT E03 FAULT CODE	TRAVEL TO PIPELINE, CHECK FAULT CODE AND CLEAR FAULTS TRAVEL BACK TO SITEM CARRY OUT FAULT FINDING, TEST VOLTAGE FROM SENSORS AND LOCATE INTERMITTANT TRAY SENSOR AND REPORT, SENSOR NOT TO BE REPLACED AT THIS STAGE	433.13	0	0	66	499.13
141022-00: SVC001398	10/22/2014	1H0103	184_INT	R	Electrical	1ME645	12675 HR	REPAIR AIR SEAT WIRING	TRAVELLED TO DAM SITE, REPAIR WIRING TO SEAT COMPRESSOR UNDER THE OPERATORS SEAT AS REQUIRED	196.88	0	0	42	238.88
141013-00: SVC001393	10/17/2014	1H0103	184_INT	R	Electrical	1ME645	12605	REPAIR SEAT SUSPENSION FAULT	TRAVELLED TO PIPELINE, REPAIRED SEAT WIRING AND CHECKED LOG BOOK REPAIRS	164.85	0	0	41	205.85
141002-00: SVC001388	10/08/2014	1H0103	184_INT	R	Sundries	1ME645	12582	REPLACE WIPER BLADES	ONSITE AT PIPELINE, REPLACED DAMAGED WIPER BLADES	39.38	17.4	0	0	56.78
140930-00: SVC001387	09/30/2014	1H0103	184_INT	R	Tyres	1ME645	12576	PUMP UP FLAT LHM TYRE	TRAVEL TO TEA TREE, PUMP UP FLAT TYRE AS REQUIRED	78.75	0	0	33	111.75
140919-00: SVC001381	09/24/2014	1H0103	184_INT	R	Differential	1ME645	12549	CHECK OIL LEAK CENTRE AXLE HUB	TRAVEL TO PIPELINE, CHECK OIL LEAK FROM BOTH HUBS ON MIDDLE AXLE, REPLACED BLOCKED DIFF BREATHER, CHECK OIL LEVEL IN DIFF	282.98	0	0	47	329.98
140919-00: SVC001382	09/23/2014	1H0103	184_INT	R	Electrical	1ME645	12552	REPLACE TAIL LIGHT & UHF AERIA	TRAVEL TO ORIELTON, FIT NEW TAIL LAMP, CHECK AND REPAIR WIRING HARNESS FOR BROKEN WIRES IN CHASSIS	315	91	0	82	488
140905-00: SVC001372	09/12/2014	1H0103	184_INT	R	Hydraulic	1ME645	12539	REPLACE DAMAGED HYD HOSE	TRAVEL TO ORIELTON, REMOVE AND REPLACE LEAKING HYD HOSE ON LHS TRAY LIFT HOSE	157.5	191.34	0	41	389.84
140904-00: SVC001372	09/10/2014	1H0103	184_INT	R	Differential	1ME645	12539	CHANGE F/DIFF OIL, BAD SAMPLE	TRAVEL TO ORIELTON, CHANGE F/DIFF OIL, DUE TO BAD SAMPLE AS PER CAPPO	157.5	102.2	0	41	300.7

140825-00: SVC001366	09/05/2014	1H0103	184_INT	R	Electrical	1ME645	12550	REPAIR TRAY LOWER FAULT	TRAVEL TO SEIS, CARRY OUT TESTS ON M645 COMPUTER AS REQUIRED AND COMPARE WITH TESTS ON M740, CHECK FOR HOIST CONTROL FAULT, ADJUST VOLTAGE SETTING ON TRAY/ POTENTIOMETER AND CORRECT SETTING, CALIBRATE AND CHECK WIRING AND SETTING	1023.75	0	0	94	1117.75
140822-00: SVC001366	09/03/2014	1H0103	184_INT	R	Hydraulic	1ME645	12508	REPLACE LIFT CYLINDER HOSE	TRAVEL TO ORIELTON / PIPELINE, REPLACE BLOWN LIFT CYL HOSE AS REQUIRED	125.48	101.32	0	50	276.8
140818-00: SVC001366	08/26/2014	1H0103	184_INT	R	Tyres	1ME645	12468	Pump up flat tyre	TRAVEL TO DAM SITE, PUMP UP FLAT REAR LEFT TYRE AS REQUIRED.	78.75	0	0	11	89.75
140818-00: SVC001366	08/26/2014	1H0103	184_INT	R	Electrical	1ME645	12471	REPAIR SEAT SUSPENSION FAULT	TRAVEL TO DAM SITE, REPAIRED SEAT WIRING FAULT - REFIT THE WIRE THAT HAD FALLEN OFF SEAT COMPRESSOR	78.76	0	0	11	89.76
140820-00: SVC001366	08/26/2014	1H0103	184_INT	S	Service	1ME645	12508 hr	S1 B SERVICE	TRAVELLED TO UNIT AT THE PIPELINE 21/08/2014 COMPLETED SERVICE AS PERS ERVICE SCHEDULE	284.55	660.15	0	50.5	995.2
140821-00: SVC001366	08/26/2014	1H0103	184_INT	R	Bodywork	1ME645	12472	REPOSITION DRIVERS WINDOW	PULL APART DOOR SKIN, REPOSITION WINDOW MANUALLY AS ELECTRIC MOTOR U/SM RE ASSEMBLE DOOR	164.85	19.21	0	8	192.06
140808-00: SVC001357	08/12/2014	1H0103	184_INT	R	Tyres	1ME645	12440	PUMP UP TYRES & CHECK LIGHTS	TRAVEL TO PIPELINE, PUMPED UP TYRES AND CHECKED ELECTRICAL FAULT WITH LIGHTS	161.18	0	0	52	213.18
140807-00: SVC001356	08/07/2014	1H0103	184_INT	R	Electrical	1ME645	12423	RESECURE ELECTRIC WINDOW	TRAVEL TO PIPELINE, RESECURED ELECTRIC WINDOW ON DRIVERS SIDE, DISCONNECTED SWITCH AND PUT STICKER UP, UNIT HAD INTERMITTANT FAULT WIRH ELECTRIC MOTOR	118.13	0	0	39	157.13
140717-00: SVC001344	07/30/2014	1H0103	184_INT	R	Electrical	1ME645	12376	INSPECT TRAY LOWER FAULT	TRAVEL TO PIPELINE SITE, CHECKED UNIT FOR TRAY FAULT, INSPECTED FOR BROKEN WIRE POTENTIONMETER ETC, TRAVELLED BACK TO PIPELINE SITE, SWAPPED COMPUTERS - SEEM TO BE WORKING BETTER, FURTHER TESTS WILL BE REQUIRED.	404.78	0	0	113.5	518.28
140723-00: SVC001356	07/30/2014	1H0103	184_INT	R	Transmissi	1ME645	12403 HR	SAMPLE TRANS & INSPECT 4 WATER	TRAVEL TO PIPELINE, TAKE SAMPLE OF TRANS OIL & INSPECT 4 WATER ENTRY, BLOW OUT RADIATOR	39.38	29	0	33	101.38
140710-00: SVC001341	07/14/2014	1H0103	184_INT	R	Hydraulic	1ME645	12356	INSPECT HYD/TRANS NOISE	TRAVEL TO DAM SITE PIPELINE, CHECK HYDRAULIC HILTER AND STRAINER, CHECKED BELTS FAN ETC. INSPECT FOR TRANSMISSION NOISE AS REPORTED BY OPERATOR. REMOVE TRANS FILTER AND INSPECT. PRESSURE TEST TRANS. NOISE FOUND TO BE COMING FROM ENGINE BAY. TIGHTEN LOOSE INTERCOOLER HOSE CLAMPS AND TEST OK.	354.38	0	0	73	427.38
140521-00: SVC001324	07/10/2014	1H0103	186_INT	R	Differential	1ME645	12330 HR	RESEAL LH FRONT HUB REPLACE BR	RESEAL LH FRONT HUB REPLACE BEARINGS IN TOP OFF LIFT CYLINDERS REMOVE LH FRONT WHEEL REMOVE BRAKE LINES AND STRIP OUT FINAL DRIVE AND DRIVE SHAFT HAVE AXLE SEAL AREA RECHROMED AND REASSEMBLE WITH NEW SEALS BLEED BRAKES AND REFIT WHEEL RESEAL LH CENTRE FINAL DRIVE COVER REPLACE WORN BEARINGS AND PINS IN TRAY LIFT CYLINDERS TOP UP HYDRAULIC OIL	4073.48	5922.5	175	50	10220.98
140617-00: SVC001325	06/19/2014	1H0103	184_INT	R	Electrical	1ME645	12329	REPLACE BROKEN REVOLVING LIGHT	TRAVEL TO BOYER, REPACE BROKEN REVOLVING LIGHT AS REQUIRED.	78.75	93.82	0	33.6	206.17

140417-00: SVC00129	05/29/2014	1H0103	121	ADMIN	R	Tyres	1ME645		REPLACE TWO TYRES	FIT TWO TYRES 23.5R 25 X SUPER TERRAIN AD E4T TL 185B SERIAL NUMBER FVX2275F9A AND FVX2284F0A FITTED BY RUBAND	0	6191.64	0	0	6191.64
140514-00: SVC00130	05/23/2014	1H0103	182	INT	R	Exhaust	1ME645		REPLACE MUFFLER FLEX PIPE	REPLACE MUFFLER FLEX PIPE AS REQUIRED	341.25	0	0	17	358.25
140509-00: SVC00131	05/21/2014	1H0103	186	INT	R	Sundries	1ME645	12228 hr	REPAIR OIL AND EXHAUST LEAKS	MACHINE SET UP, INSPECT OIL LEAKS, REMOVE LEFT FRONT WHEEL ASSEMBLY TO GAIN ACCESS, REPLACE SEAT CONTROL, REMOVE EXHAUST COVERS AND RAISE OPERATION CAB, REMOVE EXHAUST SYSTEM TO REPLACE EXHAUST FLEX, DRAIN HYD TANK, REMOVE STEERING SUCTION PIPE, REPLACE RUBBER JOINER HOSE AND REASSEMBLE, REMOVE HYD TANK SIGHT GLASS AND RESEAL, REFILL HYD OIL, JACK UP AND SUPPORT MACHINE, ROTATE WHEEL ASSEMBLIES FRONT TO REAR TENTION BOLTS TO SPEC, MAKE MUFFLER SUPPORT STRAPS, REFIT EXCHAUST SYSTEM, REPLACED BROKEN BOLTS ON MUFFLER SUPPORT, CLEAN UP WORK AREA.	2404.52	311.22	0	50	2765.74
140509-00: SVC00131	05/21/2014	1H0103	186	INT	R	Service	1ME645	12228 hr	S1 A SERVICE	CARRIED OUT 250 HR SERVICE, TOPPED UP TRANS OIL, GREASED ALL POINTS, REPLACED BLOWN GLOBE RH REAR WORKLIGHT AND LH PARK, REFASTENED OEPRATORS CAB, DOOR CORD REPLACED MISSING BOLTS ON DOOR HANDLE.	360.17	178.33	0	21.5	560
140515-00: SVC00130	05/20/2014	1H0103	184	INT	R	Hydraulic	1ME645	12228	REPLACE STEERING HOSE	REMOVE AND REPLACE LEAKING STEER HOSE	157.5	60.44	0	0	217.94
140331-00: SVC00128	04/10/2014	1H0103	184	INT	S	Steering	1ME645	12148	REMOVE RESEAL AND REFIT LH STE	TRAVEL TO NYRSTAR, REMOVE RESEAL AND REFIT LH STEERING CYLINDER	637.5	657.85	0	60.8	1356.15
140327-00: SVC00128	03/29/2014	1H0103	184	INT	R	Electrical	1ME645	12133	CALL OUT - SEAT FAULT & WINDOW	CALLOUT TRAVELLED TO IMPACT 27/03/2014 REPAIRED SEAT WIRING AND WINDOW MECHANISIM AS REQUIRED	400	0	0	39.2	439.2
140312-00: SVC00127	03/13/2014	1H0103	105		R	Electrical	1ME645	12145	TRAY ALARM REPAIRS	1ME645	227.5	0	0	0	227.5
ODOMETER - 12145 HOURS															
JOB CARRIED OUT - ASSESS TRAY ALARM FAULTS. CHECK WIRING TO TRAY SWITCH AND CLEANED. ADJUSTED TRAY LEVER ASSEMBLY AND TESTED OK. RE-SEARCH SYSTEM.															
140128-00: SVC00124	02/28/2014	1H0103	184	INT	R	Sundries	1ME645	11898	INSPECT E03 & AIR CON FAULTS	INSPECT E03 & AIR CON FAULTS AS REQUIRED.	100	0	0	0	100
140220-00: SVC00126	02/27/2014	1H0103	105	HBGN	R	Sundries	1ME645		SEAT SUSPENSION FAULTS	1ME645	97.5	0	0	0	97.5
JOB CARRIED OUT - SEAT SUSPENSION REPAIR, TEMPORARY REPAIR.															
140219-00: SVC00126	02/25/2014	1H0103	184	INT	R	Hydraulic	1ME645	12092	REPAIR STICKING HOIST LEVER	TRAVEL TO IMPACT, INSPECT LIFT CONTROL LEVER. NO FAULT FOUND. TRAVEL BACK TO SITE. CHECK FOR HOIST FAULT AND RESET CODES.	300	0	0	29.4	329.4
140221-00: SVC00126	02/24/2014	1H0103	184	INT	R	Electrical	1ME645	12107	REPAIR SEAT SUSPENSION FAULT	TRAVEL TO IMPACT, REPAIR SEAT SUSPENSION FAULT, FOUND AND REPAIRED BROKEN EARTH WIRE UNDER SEAT TO SEAT AIR BAG COMPRESSOR	194.5	0	0	19.6	214.1
140212-00: SVC00125	02/19/2014	1H0103	184	INT	R	Air Con	1ME645	12050	REPLACE AIR CON CONDENSOR	TRAVEL TO IMPACT, REPLACED AIR CON CONDENSOR AS REQUIRED.	300	518.97	0	82.2	901.17
140203-00: SVC00125	02/12/2014	1H0103	184	INT	S	Service	1ME645	12000	S1 D - 2000 HR SERVICE	TRAVEL TO IMPACT, CARRIED OUT S1 D - 2000 HR SERVICE AS PER SCHEDULE.	880	2747.49	0	57.1	3684.59

140128-00: SVC001245	02/04/2014	1H0103	184	FIELDSIR	Sundries	1ME645	11943	WEEKLY INSPECTION AND TIDY UP	TRAVEL TO IMPACT, CARRIED OUT WEEKLY INSPECTION AND TIDY UP AS REQUIRED.	112.5	0	0	15.6	128.1
140203-00: SVC001250	02/04/2014	1H0103	184	INT R	Sundries	1ME645	11943	WEEKLY INSPECTION AND TIDY UP	TRAVEL TO IMPACT, CARRIED OUT WEEKLY INSPECTION AND TIDY UP AS REQUIRED. INSPECTED UNIT AND CHECKED AIR CON - REQUIRES NEW CONDENSOR	187.5	0	0	19.6	207.1
140120-00: SVC001242	01/28/2014	1H0103	184	INT R	Sundries	1ME645	11829	WEEKLY INSPECTION AND TIDY UP	CARRIED OUT WEEKLY INSPECTION AND GENERAL TIDY UP OF UNIT AS REQUIRED	112.5	0	0	15.1	127.6
140113-00: SVC001235	01/20/2014	1H0103	184	INT R	Electrical	1ME645	11728	REPLACE U/S REVOLVING LIGHT	TRAVEL TO IMPACT, CARRIED OUT WEEKLY INSPECTION AND REPLACE U/S REVOLVING LIGHT AS REQUIRED.	112.5	137.01	0	19.4	268.91
131220-00: SVC001233	12/27/2013	1H0103	184	INT R	Sundries	1ME645	11740	WEEKLY INSPECTION AND TIDY UP	CARRY OUT WEEKLY INSPECTION OF LOADER AT IMPACT AS REQUIRED	37.5	0	0	9.6	47.1
131205-00: SVC001223	12/11/2013	1H0103	184	INT R	Electrical	1ME645	11640	REPLACE U/S RETARDER SWITCH	TRAVEL TO IMPACT, CHECK FOR RETARDER FAULT. COMPLETE ELECTRICAL TEST. LOCATE FAULTY RETARDER SWITCH. TRAVEL BACK TO IMPACT, FIT NEW SWITCH ASSY AND TEST OK.	562.5	1502.53	0	19.2	2084.23
131205-00: SVC001223	12/11/2013	1H0103	184	INT S	Service	1ME645	11640	S1 B - 500 HR SERVICE	TRAVEL TO IMPACT, CARRIED OUT S1 B - 500 HR SERVICE AS PER SCHEDULE.	225	657.37	0	13.1	895.47
131202-00: SVC001221	12/05/2013	1H0103	184	INT R	Sundries	1ME645	11564	WEEKLY INSPECTION AND TIDY UP	TRAVEL TO IMPACT, CARRIED OUT WEEKLY INSPECTION AND TIDY UP	75	0	0	14.6	89.6
131127-01: SVC001215	11/28/2013	1H0103	184	INT R	Trays/Buck	1ME645	11564	REPAIR TAIL GATE RUBBER	TRAVEL TO IMPACT, CLEAN OUT REAR OFF TRAY AND FIT NEW RUBBER.	375	0	0	14.4	389.4
131104-00: SVC001203	11/26/2013	1H0103	184	INT R	Electrical	1ME645	11530	INSPECT FAULT CODES	TRAVEL TO IMPACT, INSPECTED RETARDER FAULT CODE.	41	74.99	0	9.6	125.59
131125-00: SVC001216	11/26/2013	1H0103	184	INT R	Sundries	1ME645	11558	WEEKLY INSPECTION AND TIDY UP	TRAVEL TO IMPACT, CARRIED OUT WEEKLY INSPECTION AND TIDY UP	112.5	0	0	9.8	122.3
131125-00: SVC001216	11/26/2013	1H0103	184	INT R	Brake	1ME645	11553	INSPECT BRAKE FAULT	TRAVEL TO IMPACT, CHECKED BRAKE GRABBING FAULT. CLEANED BRAKE PEDAL AND CHECKED FLUIDS. CHECKED COOLANT LEVEL, TESTED OK.	61.5	0	0	14.6	76.1
131108-00: SVC001206	11/13/2013	1H0103	184	INT R	Sundries	1ME645	11545	WEEKLY INSPECTION AND TIDY UP	TRAVEL TO IMPACT, CARRY OUT WEEKLY INSPECTION AND TIDY UP. TOPPED UP HYDRAULIC OIL. CHECKED FAULT CODES ALL OK.	112.5	0	0	9.6	122.1
131104-00: SVC001203	11/05/2013	1H0103	184	INT R	Sundries	1ME645	11533	WEEKLY INSPECTION AND TIDY UP	TRAVEL TO IMPACT, CARRIED OUT WEEKLY INSPECTION AND TIDY UP AS REQUIRED. CHECKED FAULT CODES. CLEANED OUT RETARDER LEVER.	75	0	0	14.6	89.6
131007-00: SVC001193	10/21/2013	1H0103	184	INT R	Sundries	1ME645	11517 HR	WEEKLY INSPECTION AND TIDY UP	TRAVEL TO IMPACT, CARRY OUT WEEKLY INSPECTION AND TIDY UP	112.5	0	0	4.8	117.3
130923-00: SVC001175	09/24/2013	1H0103	184	INT R	Sundries	1ME645	11582	WEEKLY INSPECTION AND TIDY UP	TRAVEL TO IMPACT AND CARRY OUT WEEKLY INSPECTION AND TIDY UP	140	0	0	4.8	144.8
130910-00: SVC001170	09/20/2013	1H0103	184	INT R	Engine	1ME645	11434	REMOVE & CLEAN OUT RADIATOR	TRAVEL TO IMPACT, REMOVE & CLEAN OUT RADIATOR, REMOVE RADIATOR AND INTERCOOLER, SEND TO NEW NORFOLK RADIATORS TO HAVE IT FLUSHED OUT, PICK UP RADIATOR AND INTERCOOLER, REFIT TO MACHINE AND REFILL COOLANT, TEST FOR LEAKS	825	90.2	280	33.6	1228.8
130902-00: SVC001166	09/03/2013	1H0103	186	INT R	Engine	1ME645	70,650 km	OVER HEATING	CLEAN RADIATOR AND CHECK COOLANTLEVEL AND TEST DRIVE ALL GOOD	200	0	0	10	210

130822-00	SVC001156	08/29/2013	1H0103	184_INT	S	Service	1ME645	11332	S1 A - 250 HR SERVICE	TRAVEL TO IMPACT, ARRIVED ONSITE AT 7.00 AM TO CARRY OUT SERVICE (THIS TIME WAS PRE ARRANGED WITH PAUL KELLEHER AND IMPACT) WHEN ASKED FOR MACHINE WAS TOLD WE WERE EARLY AND FITTER HAD TO WAIT AN HOUR FOR THE MACHINE TO BE COME AVAILABLE, WHEN MACHINE BECAME AVAILABLE CARRIED OUT 250 HR SERVICE AS PER SERVICE SHEET, REPLACE BLOWN HEADLIGHT GLOBE, CLEAN UP AREA, RETURN TO WORKSHOP AND DISPOSE OF WASTE OIL AND FILTERS, PAPERWORK. PLEASE NOTE THAT THE TRAY HAS A HEAVY BUILD UP OF MATERIAL IN IT WHICH WILL REDUCE THE AMOUNT OF PAYLOAD THAT CAN BE CARRIED.	397.5	256.81	0	9.8	664.11
130826-00	SVC001156	08/27/2013	1H0103	184_INT	R	Sundries	1ME645	11300	WEEKLY INSPECTION AND TIDY UP	TRAVEL TO IMPACT, CARRY OUT WEEKLY INSPECTION AND TIDY UP	225	0	0	14.4	239.4
130819-00	SVC001156	08/23/2013	1H0103	184_INT	R	Sundries	1ME645	11293	WEEKLY INSPECTION AND TIDY UP	TRAVEL TO IMPACT, CARRY OUT WEEKLY INSPECTION AND TIDY UP	140	0	0	4.8	144.8
130807-00	SVC001146	08/14/2013	1H0103	184_INT	R	Transmissi	1ME645	12186	CALL OUT - TRANS FAULT CODE	CALL OUT TO IMPACT, TRANS FAULT CODE, CHECKED FOR FAULT CODES AND TESTED OPERATION COULD NOT FAULT, CHECKED PLUGS AND WIRING, TEST DRIVE AND ALSO HAD OPERATOR TEST DRIVE WHILE SITTING IN SPARE SEAT, MACHINE DID NOT PLAY UP, SUSPECT OPERATOR WAS SHIFTING TO QUICK FROM FORWARD TO REVERSE AND COMPUTER NOT READING CHANGE IN GEARS, PUT BACK TO WORK.	400	0	0	19.2	419.2
130806-00	SVC001146	08/06/2013	1H0103	121ADMIN	R	Tyres	1ME645	11,158H	PUNCTURE REPAIR LH REAR	PUNCTURE REPAIR LH REAR + O-RING RUBAND	00286	0	90	0	90
130719-00	SVC001147	08/05/2013	1H0103	184_INT	R	Electrical	1ME645	11123	REPLACE WORK LIGHTS WITH LEDS	TRAVEL TO IMPACT, REPLACE WORK LIGHTS WITH LEDS, REPAIR BROKEN WIRES IN HARNESS, CHECK FAULT CODES, TRAY BODY POSITION SENSOR FAULT, FOUND AND REPAIRED WIRING TO REAR PLUG.	412.5	214	0	9.6	636.1
130726-00	SVC001136	07/31/2013	1H0103	184_INT	R	Sundries	1ME645	11142	INSPECT TRAY ALARM FAULT	INSPECT TRAY ALARM FAULT, CHECK FAULT CODES, CHECK TRAY SENSORS, WIRING AND PLUGS, CLEAN SENSORS AND PLUGS, TESTED OK.	182.5	0	0	9.6	192.1
130712-00	SVC001136	07/30/2013	1H0103	182_INT	R	Trays/Buck	1ME645		FIT TAILGATE & REPAIRS GUARD E	FIT TAILGATE & REPAIRS GUARD ETC	1095	0	0	50	1145
130716-00	SVC001136	07/30/2013	1H0103	184_INT	R	Bodywork	1ME645	11091	REPLACE BROKEN LHS MIRROR	PICK UP MIRROR FROM CAT, TRAVEL TO IMPACT, REPLACE BROKEN LHS MIRROR	150	162.78	0	28.8	341.58
130719-00	SVC001136	07/30/2013	1H0103	184_INT	R	Sundries	1ME645	11099	WEEKLY INSPECTION AND TIDY UP	TRAVEL TO IMPACT, CARRY OUT WEEKLY INSPECTION AND TIDY UP	75	0	0	14.4	89.4
130718-00	SVC001136	07/19/2013	1H0103	184_INT	R	Tyres	1ME645	11080	PUMP LHR REAR TYRE	CALL OUT TO IMPACT, PUMP LHR REAR TYRE AS REQUIRED	100	0	0	14.4	114.4
130702-00	SVC001127	07/18/2013	1H0103	184_INT	R	Electrical	1ME645	11056	REPLACE PARK BRAKE SWITCH	TRAVEL TO PIPELINE, REPLACE PARK BRAKE SWITCH, INSPECT PARK BRAKE RELEASE FAULT, CHECKED PARK BRAKE FOR MATERIAL BUILD UP, CHECKED WIRING, SOLENOID, PLUGS AND SWITCHES, FOUND AND REPLACE FAULTY PARK BRAKE SWITCH, REPLACE NON SLIP TAPE ON STEPS, PUMP UP LHR TYRE	382	266.06	0	106	754.06
130708-00	SVC001136	07/17/2013	1H0103	184_INT	R	Electrical	1ME645	11063	REPAIR W/LIGHT & WIPER BLADE	TRAVEL TO PIPELINE, REPAIR WORK LIGHTS & WIPER BLADE	112.5	35.32	0	33.8	181.62

130711-00\	SVC001132\	07/17/2013	1H0103	184_INT	S	Service	1ME645	11079	S1 C - 1000 HR SERVICE	CARRIED OUT S1 C - 1000 HR SERVICE AS PER SCHEDULE	590	1845.73	0	0	2435.73
130614-00\	SVC001122\	06/26/2013	1H0103	184_INT	R	Electrical	1ME645	10978	REPAIR TAIL LIGHT MOUNT	TRAVEL TO PIPELINE, REPAIR TAIL LIGHT MOUNT, REPLACE BROKEN RUBBER MOUNTS	206.25	93.26	0	33.8	333.31
130624-00\	SVC001122\	06/26/2013	1H0103	182_INT	R	Trays/Buck	1ME645		REPAIRS TO TAILGATE TO ALLOW T	REPAIRS TO TAILGATE TO ALLOW TAILGATE TO SHUT FULLY TRUCK WASH & SPRAY BOTTLE - PAUL KELLEHER 103-7583	539	21.5	0	25	585.5
130624-00\	SVC001121\	06/25/2013	1H0103	184_INT	R	Engine	1ME645	10982 HR	CLEAN ALL FILTERS AIR		176.75	0	0	56.8	233.55
130624-00\	SVC001122\	06/25/2013	1H0103	184_INT	R	Electrical	1ME645	10989 HR	Repair Tail light wiring	TRAVELLED TO UNIT ASSES AND REPAIRED WIRING TO TAIL LIGHTS AS REQUIRED	244.82	0	0	24	268.82
130617-00\	SVC001111\	06/19/2013	1H0103	184_INT	R	Engine	1ME645	10980	TOP UP ENGINE OIL & CHECK OVER	TRAVEL TO PIPELINE, TOP UP ENGINE OIL & CHECK OVER	70	15.36	0	24	109.36
130604-00\	SVC001111\	06/12/2013	1H0103	186_INT	R	Trays/Buck	1ME645	10961 HRS	REMOVE TAILGATE	REMOVE TAILGATE	162.5	5.5	0	0	168
130520-00\	SVC001110\	05/30/2013	1H0103	184_INT	R	Hydraulic	1ME645	10944 HR	REMOVE RESEAL AND REPLACE STEE	TRAVEL TO IMPACT, REMOVE RESEAL AND REPLACE STEERING CYL RHS	675	1207.25	0	19.2	1901.45
130523-00\	SVC001110\	05/30/2013	1H0103	184_INT	R	Sundries	1ME645	10960	RESEAL TAIL BOARD	TRAVEL TO IMPACT, RESEAL AND REALIGN TAIL BOARD	678.5	0	0	14.4	692.9
130515-00\	SVC001110\	05/29/2013	1H0103	184_INT	R	Electrical	1ME645	10936 hr	REPAIR SEAT SUSPENSION	TRAVEL TO IMPACT, REPAIR SEAT SUSPENSION	220	0	0	14.4	234.4
130506-00\	SVC001066\	05/21/2013	1H0103	184_INT	S	Service	1ME645	10850	S1 A - 250 HR SERVICE	TRAVEL TO IMPACT, CARRIED OUT S1 A - 250 HR SERVICE AS PER SCHEDULE	278.25	249.99	0	14.4	542.64
130510-00\	SVC001096\	05/15/2013	1H0103	184FIELDSIR	R	Hydraulic	1ME645	10894 HRS	REPLACE CONTAMINATED HYD OIL	TRAVEL TO IMPACT, REPLACE CONTAMINATED HYD OIL DUE TO IMPACT OPERATOR FILLING UP HYDRAULIC TANK WITH DIESEL, CALLED OUT AT 6.00 AM, TO BE ON CHARGED TO IMPACT (PAUL KELLEHER TO ARRANGE ON CHARGE)	385.5	613.8	0	19.2	1018.5
130503-00\	SVC001096\	05/09/2013	1H0103	184_INT	R	Sundries	1ME645	10836	WEEKLY INSPECTION AND TIDY UP	ONSITE AT IMPACT. CARRIED OUT WEEKLY INSPECTION AND TIDY UP.	225	5	0	0	230
130404-00\	SVC001086\	04/30/2013	1H0103	184_INT	R	Steering	1ME645	10685	RESEAL LHS STEER CYLINDER	RESEAL LHS STEER CYLINDER AND REPLACE LEAKING GASKETS BEHIND TANK: CHECK AND CLEANED OFF CYLINDER TO TEST FOR LEAK, REMOVE CYLINDER, PULL APART, CLEAN UP AND FIT NEW SEALS, CHECK HYD OIL LEAKS BEHIND TANK, FIT LHS WHEEL, REFIT FRONT TYRE AS REQUIRED, REFILL HYD	2097	641.73	0	0	2738.73
130418-00\	SVC001090\	04/30/2013	1H0103	184_INT	R	Hydraulic	1ME645	10648	REPLACE LEAKING HYD TANK GUAGE	REPLACE LEAKING HYD TANK GUAGE REPLACE LEAKING HYD FLANGE GASKET	262.5	528.84	0	0	791.34
130315-00\	SVC001070\	04/19/2013	1H0103	184_INT	S	Service	1ME645	10586	S1 B - 500 HR SERVICE	TRAVEL TO HAZELL BROS, AND COLLECT PARTS REQUIRED FOR 500 HR SERVICE. TRAVEL TO IMPACT FERTILISERS, AND CARRY OUT 500HR SERVICE AS FOLLOWING: CHNAGED ENG OIL AND FILTER, CHANGE FUEL FILTER, CLEAN OUT AIR FILTER. START AND RUN MACHINE. CHECK ALL FLUID LEVELS AND TEST MACHINE - ALL OK. TAKE KOWA SAMPLES OF ALL FLUIDS. TRAVEL TO HAZELL BROS AND DROP OFF PAPERWORK AND KOWA SAMPLES. WORK COMPLETED BY KOMATSU	130	754.32	523.48	0	1407.8
130327-00\	SVC001070\	04/10/2013	1H0103	182_INT	R	Trays/Buck	1ME645	10618	REPLACE TAILGATE RETAINER	TRAVEL TO IMPACT, REPLACE TAILGATE PIVOT PIN RETAINER, DRILL OUT SIDE ARM TO TAILGATE HOLES AND FIT WITH BIGGER BOLTS TO RETAIN IN POSITION	500.5	27.36	0	9.6	537.46
130315-00\	SVC001066\	03/20/2013	1H0103	184_INT	R	Trays/Buck	1ME645	10495	CALL OUT - TAIL GATE RUBBER	TRAVEL TO IMPACT, CALL OUT - TAIL GATE RUBBER LEAKING DURING IMPACT INLOAD	737.5	0	0	19.2	756.7

130308-00	SVC001064	03/18/2013	1H0103	184_INT	R	Bodywork	1ME645	10446	ADJUST TAILGATE AND RUBBER	TRAVEL TO IMPACT, INSPECT TAIL GATE FOR SEAL, REPAIR AND ADJUST AS REQUIRED.	215	5	0	9.6	229.6
130305-00	SVC001064	03/15/2013	1H0103	184_INT	R	Electrical	1ME645	10446	INSPECT / REPAIR E03 FAULT	INSPECT / REPAIR E03 FAULT - TRAVEL TO AND FROM IMPACT INSPECT REPORTED ACTIVE FAULT CODE, ON INSPECTION NO CODES ACTIVE, DRIVE AND OPERATE MACHINE TO TRY AND GET CODES TO COME UP, STILL NO CODES. CALL OUT - FAULT CODES ACTIVE, DOWN LOAD ACTIVE FAULT CODE AND TROUBLE SHOOT, INSPECT WIRING AND SENSORS IN PROBLEM AREA WITH REVERSE SWITCH, FOUND TO HAVE FAULTY FILL SWITCH, ORDER PARTS, LIFT CAB OF MACHINE, REMOVE AND REPLACE FAULTY FILL SWITCH, LOWER CAB AND CHECK FOR ACTIVE CODES, NONE PRESENT, TEST DRIVE MACHINE	2082	135.39	0	76.8	2294.19
121109-00	SVC001013	03/04/2013	1H0103	184_INT	R	Trays/Buck	1ME645	10149	REPAIR CRACKS IN TRAY	TRAVEL TO SITE AND REPAIRED CRACKES AS REQUIRED	450	0	0	20	470
130206-00	SVC001045	02/26/2013	1H0103	186_INT	A	Electrical	1ME645		repairs after accident	CARRY OUT NECESSARY REPAIRS AFTER ACCIDENT	130	653.63	0	0	783.63
130201-00	SVC001047	02/20/2013	1H0103	182_INT	A	Bodywork	1ME645		REPAIRS TO ACCIDENT DAMAGE ON	REPAIRS TO ACCIDENT DAMAGE ON R/H FRONT CORNER - REMOVE GUARDS, FILTER ASSY & TANK ETC CARRY OUT REPAIRS AS REQUIRED, REMOVE EXHAUST PIPE FROM TURBO & REPLACE STEEL FLEX & RELAG	5953	122.65	0	0	6075.65
130201-00	SVC001047	02/13/2013	1H0103	105_HBGN	A	Bodywork	1ME645		BODY ACCIDENT REPAIRS - NYR	1ME645 JOB CARRIED OUT - ASSESS DAMAGE TO RH/F OF HAUL TRUCK. STRAIGHTEN TANK AND GUARD TO ALLOW UNIT TO BE RETURNED TO WORKSHOP FOR REPAIR.	260	0	0	0	260
130124-00	SVC001037	01/31/2013	1H0103	182_INT	R	Trays/Buck	1ME645		REMOVE & REPAIRS TO TAILGATE	FIELD SERVICE INSPECTED BENT TAILGATE AT IMPACT, SEND BACK TO WORKSHOP FOR REPAIR. REMOVE & REPAIRS TO TAILGATE, REINSTALL & CHECK SEALING	1041	50	0	0	1091
130125-00	SVC001041	01/30/2013	1H0103	184_INT	R	Bodywork	1ME645	10322	REPAIR LHS MIRROR	SIKAFLEX MIRROR TOGETHER. TAPE UP TO HOLD TOGETHER.	75	0	0	0	75
130114-00	SVC001035	01/29/2013	1H0103	184_INT	R	Engine	1ME645	10291	FUEL PUMP REPAIRS	TRAVEL TO IMPACT. FOUND BROKEN BOLT IN FUEL PUMP. DRILL AND GRIND TO REMOVE BROKEN STUD FROM FUEL PUMP. RETAP THREAD. WORK CARRIED OUT BY SOUTHERN THREAD REPAIRS. REPAIRED FUEL PUMP AS REQUIRED.	771	0	100	9.6	880.6
130104-00	SVC001031	01/15/2013	1H0103	184_INT	R	Sundries	1ME645	10257	WEEKLY INSPECTION AND TIDY UP	CARRY OUT WEEKLY INSPECTION AND TIDY UP, REPAIR WORK LIGHT WIRING	314	0	0	0	314
121123-00	SVC001013	12/17/2012	1H0103	184_INT	R	Trays/Buck	1ME645	10208	REPAIR TAILGATE	CARRY OUT REPAIRS TO TAILGATE AFTER BEING BENT	375	9.09	0	0	384.09
121203-00	SVC001015	12/17/2012	1H0103	184_INT	R	Engine	1ME645	10214	REPAIR OVERHEATING FAULT	TRAVEL TO NYRSTAR.CLEAN OUT RADIATOR ON DUMP TRUCK. REPLACE CONDENSOR AND INTERCOOLER. CLEAN OUT RADIATOR AND REASSEMBLED.	818.5	0	0	14.4	832.9
121125-00	SVC001007	12/05/2012	1H0103	184_INT	S	Service	1ME645	10208	S1 A - 250 HR SERVICE	CARRIED OUT 250 HR SERVICE AS PER SCHEDULE. REPAIRED WINDSCREEN WASHERS.	382	360.92	0	0	742.92
121102-00	SVC001006	11/29/2012	1H0103	184_INT	R	Sundries	1ME645		WEEKLY INSPECTION AND TIDY UP	TRAVELLED TO IMPACT. CARRIED OUT WEEKLY INSPECTION AND TIDY UP.	187.5	0	131.28	14.4	333.18

121119-00\	SVC001004	11/20/2012	1H0103	184_INT	R	Sundries	1ME645	10156 HRS	WEEKLY INSPECTION AND TIDY UP	TRAVELLED TO IMPACT. CARRIED OUT WEEKLY INSPECTION AND TIDY UP	187.5	0	0	9.6	197.1
121106-00\	SVC001002	11/19/2012	1H0103	184_INT	R	Sundries	1ME645	10129	REPLACE NON SLIP GRIP TAPE	TRAVELLED TO IMPACT. REMOVED OLD TAPE. CLEAN UP PAINT WORK AND FIT NEW TAPE.	225	40.6	0	19.2	284.8
121116-00\	SVC001003	11/19/2012	1H0103	184_INT	R	Hydraulic	1ME645	10153	REPLACE BLOWN PILOT HOSE	TRAVELLED TO IMPACT. MAKE NEW PILOT LINE. WELD UP CRACK IN PIVOT POINT.	225	13.14	0	9.6	247.74
121109-00\	SVC001001	11/14/2012	1H0103	184_INT	R	Sundries	1ME645	10137	WEEKLY INSPECTION AND TIDY UP	TRAVELLED TO IMPACT. CARRIED OUT WEEKLY INSPECTION AND TIDY UP AS REQUIRED.	187.5	0	0	4.8	192.3
121101-00\	SVC000998	11/12/2012	1H0103	184_INT	R	Bodywork	1ME645	10114	REPLACE BONNET LOCK ASSY	TRAVELLED TO IMPACT. REMOVE DAMAGED BONNET LATCH AND REPAIR AND REFIT.	150	282.82	0	9.6	442.42
121101-00\	SVC000998	11/12/2012	1H0103	184_INT	R	Bodywork	1ME645	10114	REPLACE BONNET LOCK ASSY	LABOUR OMITTED FROM SVC00099830 TRAVELLED TO IMPACT. REPLACED DAMAGED BONNET LATCH AND ADJUSTED.	112.5	0	0	6.72	119.22
121026-00\	SVC000994	10/31/2012	1H0103	184_INT	R	Sundries	1ME645	10096	WEEKLY INSPECTION AND TIDY UP	TRAVELLED TO IMPACT. CARRIED OUT WEEKLY INSPECTIONS AS REQUIRED.	150	0	0	14.4	164.4
120822-00\	SVC000954	10/30/2012	1H0103	184_INT	R	Drive Line	1ME645	9979	REPLACE REAR TAIL SHAFT	REMOVED BROKEN TAILSHAFT. COLLECT NEW ONE FROM HARDY SPICER AND FIT TO UNIT.	520.5	0	933.29	9.6	1463.39
121012-00\	SVC000982	10/16/2012	1H0103	184_INT	R	Trays/Buck	1ME645		REPAIR TAILGATE SEAL	TRAVELLED TO IMPACT. REPAIRED TAILGATE AND REFITTED TAILGATE RUBBER AS REQUIRED.	150	92.38	0	9.6	251.98
120927-00\	SVC000973	10/12/2012	1H0103	182_INT	A	Trays/Buck	1ME645		MAKE UP NEW TAILGATE SIDES	FABRICATE NEW TAILGATE ARMS PLUS FIT UP TO MACHINE	2538.5	1310.43	0	0	3848.93
120928-00\	SVC000977	10/05/2012	1H0103	181_INT	R	Sundries	1ME645		PAINT 2 NEW TAILGATE SIDES	PAINT 2 NEW TAILGATE SIDES	130	40.75	0	30	200.75
120911-00\	SVC000968	10/02/2012	1H0103	186_INT	R	Differential	1ME645	10037	REMOVE AND REFIT TAILBOARD	REMOVE FINAL DRIVES AND CLEAN. REPLACE O RINGS. REFIT FINAL DRIVES. REFILL WITH OIL. TILT CAB. REMOVE RETURN LINE TO HYD TANK. REPLACE O RINGS AND SEALS. REFIT PIPE. FILL UP HYD TANK. REMOVE BENT TAIL GATE AND REPAIR AND REFIT.	2697.5	667.15	0	0	3364.65
120921-00\	SVC000975	09/28/2012	1H0103	186_INT	R	Tyres	1ME645	10037 HRS	TYRES RUBAND D/D 69805 & 69800	TYRES RUBAND D/D 69805 2 X FIT CUSTOMER OWN PRODUCT 2 X O RINGS BRENT CLIFFORD RUBAND D/D 69800 4 X EARTHMOVER TYRE DISPOSAL BRENT CLIFFORD	0	780	0	0	780
120910-00\	SVC000964	09/11/2012	1H0103	184_INT	R	Sundries	1ME645		WEEKLY INSPECTION AND TIDY UP	TRAVELLED TO IMPACT. CARRIED OTU INSPECTION AND TIDIED UP.	187.5	0	0	4.8	192.3
120903-00\	SVC000961	09/04/2012	1H0103	184_INT	R	Sundries	1ME645	9993	WEEKLY INSPECTION AND TIDY UP	CARRIED OUT PRE START INSPECTIONS AS REQUIRED. INSPECTED HORN FAULT	241.5	0	0	0	241.5
120810-00\	SVC000958	08/30/2012	1H0103	186_INT	R	Sundries	1ME645		CONSUMABLES AUGUST	CONSUMABLES AUGUST REQ # 103-6611 PAUL KELLEHER	0	147.29	0	0	147.29
120815-00\	SVC000958	08/22/2012	1H0103	184_INT	S	Service	1ME645	9978	S1 D - 2000 HR SERVICE	TRAVELLED TO IMPACT. CARRIED OUT 2000 HR SERVICE AS PER SCHEDULE. CHECKED HORN FAULT.	1086	2820.49	0	9	3915.49
120807-00\	SVC000944	08/15/2012	1H0103	105_HBGN	R	Sundries	1ME645	9843	Flat Tyres	1ME645 ODOMETER - 9843 JOB CARRIED OUT - INSPECTED ALL TYRE PRESSURES PUMPED UP FLAT TYRE	29.5	0	0	0	29.5
120718-00\	SVC000934	07/31/2012	1H0103	184_INT	R	Bodywork	1ME645	9713	REPAIR STEP & TAILGATE RUBBER	TRAVELLED TO IMPACT. FITTED NEW RUBBER TO STEP AND REBOLT TAIL GATE RUBBER.	317.5	10	0	13.5	341
120719-00\	SVC000934	07/31/2012	1H0103	184_INT	R	Electrical	1ME645	9724	REPLACE U/S REVOLVING LIGHT	TRAVELLED TO IMPACT. REPLACE REVOLVING LIGHT AND INSPECT MACHINE AS REQUIRED.	172.5	110.01	0	13.5	296.01

120719-00\	SVC00093\	07/31/2012	1H0103	184_INT	S	Service	1ME645	9761	S1 A - 250 HR SERVICE	TRAVELLED TO IMPACT. CARRIED OUT SERVICE AS PER SCHEDULE.	369.5	256.01	0	9	634.51
120723-00\	SVC00093\	07/31/2012	1H0103	184_INT	R	Drive Line	1ME645	9761	REPLACE BOTH UNIVERSAL JOINTS	TRAVELLED TO IMPACT. JACKED UP UNIT AND REFITTED TAILSHAFT	236.5	758.94	0	9	1004.44
120716-00\	SVC00092\	07/17/2012	1H0103	184_INT	R	Sundries	1ME645	9710	WEEKLY INSPECTION AND TIDY UP	TRAVEL TO IMPACT. CHECK OVER FOR WEEKLY INSPECTION. PUMP UP TYRES.	172.5	0	0	9	181.5
120614-00\	SVC00092\	06/29/2012	1H0103	186_INT	R	Tyres	1ME645	9621 H	Puncture repair	PUNCTURE REPAIR B SELECT MOONAH 028560	0	221.8	0	0	221.8
120614-00\	SVC00091\	06/27/2012	1H0103	182_INT	R	Sundries	1ME645		STRAIGHTEN TAILGATE ARMS	STRAIGHTEN TAILGATE ARMS AS REQUIRED.	393	0	0	0	393
120618-00\	SVC00085\	06/27/2012	1H0103	184_INT	R	Trays/Buck	1ME645	9622	REPAIR TRAY HEADBOARD	JUMP START TRUCK. PULL DOWN BENT CAB HEADBOARD AND REBOLT.	241.5	3.5	0	0	245
120619-00\	SVC00091\	06/25/2012	1H0103	184_INT	R	Electrical	1ME645	9622	REPLACE U/S BATTERIES	JUMP START UNIT AND TEST CHARGE RATE. REPLACE FLAT BATTERIES. LOCATE SHORT TO TARP RELAYS. REPAIRED AND TESTED OK	266	437.14	0	0	703.14
120615-00\	SVC00091\	06/22/2012	1H0103	184_INT	R	Trays/Buck	1ME645	9620	CALL OUT - BENT TAILGATE	C/OUT TO IMPACT TO INSPECT TAIL GATE DAMAGE. TOOK PHOTOS OF DAMAGE. PARKED UNIT TO BE BROUGHT BACK TO HB WORKSHOP FOR REPAIRS.	368	18.5	0	18	404.5
120613-00\	SVC00091\	06/18/2012	1H0103	186_INT	R	Trays/Buck	1ME645		REMOVE TAIL BOARD	REMOVE TAIL BOARD REMOVE SIDE ARMS TO BE STRAIGHTENED REFIT TAIL BOARD AFTER REPAIRS CHECK AND REPAIR OIL LEAK ABOVE ENGINE BELLY PLATE CHECK COOLANT LEAK TOP OF RADIATOR	631.5	89.34	0	0	720.84
120525-00\	SVC00090\	06/05/2012	1H0103	184_INT	S	Service	1ME645	9500	S1 B SERVICE	SERVICE UNIT AS REQUIRED	441.5	744.13	0	3.5	1189.13
120514-00\	SVC00089\	05/23/2012	1H0103	186_INT	R	Sundries	1ME645		SUPPLY CTN OF GREASE TO OP	SUPPLY CTN OF GREASE TO OPERATOR 103-6207 BRENT CLIFFORD	0	48	0	0	48
120328-00\	SVC00086\	05/17/2012	1H0103	186_INT	R	Tyres	1ME645	9266.3 HRS	REPLACE TYRES -B/SELECT 59206	REPLACE TYRES -B/SELECT 59206	0	1149.04	0	0	1149.04
120418-00\	SVC00087\	04/26/2012	1H0103	184_INT	R	Trays/Buck	1ME645		REMOVE TAIL BOARD	REMOVED TAILGATE AND CLEANED OUT REAR OF TRAY	258.5	10	0	0	268.5
120322-00\	SVC00086\	03/30/2012	1H0103	184_INT	R	Hydraulic	1ME645	9319	REPLACE BLOWN HYDRAULIC HOSE	CARRIED OUT REPAIRS TO REPLACE BLOWN HYDRAULIC BRAKE HOSES	241.5	507.94	0	0	749.44
120322-00\	SVC00086\	03/27/2012	1H0103	184_INT	R	Engine	1ME645	9311	REPAIR FUEL LEAK	TRAVELLED TO IMPACT. INSPECT FUEL LEAK ON DUMP TRUCK. CLEANED OFF FUEL TANK AND CHECKED FITTINGS. SUSPECT TANK WAS OVER-FILLED	86.25	5	0	13.5	104.75
120201-00\	SVC00084\	03/15/2012	1H0103	186_INT	R	Tyres	1ME645		SUPPLY TYRES	SUPPLY TYRES AS REQUESTED BY BRIAN POLLEY	0	21924	0	0	21924
120224-00\	SVC00085\	02/29/2012	1H0103	184_INT	S	Service	1ME645	9251	S1 A - 250 HR SERVICE	TRAVELLED TO NYRSTAR. CARRIED OUT 250HR SERVICE AS PER SCHEDULE	203	259.54	0	13.8	476.34
120217-00\	SVC00084\	02/21/2012	1H0103	184_INT	R	Electrical	1ME645	9152	RECTIFY HOIST ALARM FAULT	TRAVELLED TO IMPACT. CHECK FOR HOIST ALARM FAULT. REMOVED COVERS AND DISCONNECTED MULTI PIN PLUGS. CARRIED OUT CONTINUITY TEST FROM REAR OF CAB TO REAR PIVOT SENSOR AND REPORT	378	0	0	9	387
111222-00\	SVC00082\	01/30/2012	1H0103	184_INT	R	Brake	1ME645	9084	REPLACE EXHAUST BRAKE CABLE	TRAVELLED TO NYRSTAR. INSPECT POWER FAULT AND REMOVE EXHAUST BRAKE CABLE. FIT NEW CABLE AND ADJUST	517.5	358.95	0	36	912.45
111217-00\	SVC00082\	01/05/2012	1H0103	184_INT	R	Sundries	1ME645	9068	WEEKLY INSPECTION AND TIDY UP	TRAVELLED TO IMPACT. WEEKLY INSPECTION AND TIDY UP	207	0	32.82	9	248.82
111125-00\	SVC00081\	12/14/2011	1H0103	184_INT	R	Electrical	1ME645	9015	REPLACE U/S HEADLIGHT LENSES	TRAVEL TO IMPACT. FIT NEW HEAD LIGHT LENSES.	167.5	158.78	0	9	335.28
111202-00\	SVC00080\	12/09/2011	1H0103	184_INT	R	Sundries	1ME645		WEEKLY INSPECTION AND TIDY UP	WEEKLY INSPECTION AND TIDY UP	85	180.38	0	0	265.38
111206-00\	SVC00080\	12/08/2011	1H0103	184_INT	R	Engine	1ME645	N/A	OIL MISSED OFF S/C 111111-0049	PARTS ONLY - OIL MISSED OFF S/C 111111-0049	0	164.4	0	0	164.4
111101-00\	SVC00073\	11/29/2011	1H0103	184_INT	R	Trimming	1ME645	8991	REPLACE U/S SEAT ASSEMBLY	TRAVELLED TO SITE AND ASSESS DRIVER SEAT AS REQUIRED RETURN TO SITE AND CHANGE OUT U/S SEAT	485	3644	0	27	4156

111111-00: SVC000796	11/29/2011	1H0103	184_INT	S	Service	1ME645	8991	S1 C - 1000 HR SERVICE	TRAVELLED TO SITE AND SERVICED UNIT AS REQUIRED FOR 1000 HOURS	794	1161.56	0	9	1964.56
111121-00: SVC000802	11/28/2011	1H0103	184_INT	R	Sundries	1ME645	8989 HRS	WEEKLY INSPECTION AND TIDY UP	CARRIED OUT WEEKLY INSPECTION AND TIDY UP.	157	0	0	0	157
111114-00: SVC000797	11/17/2011	1H0103	184_INT	R	Sundries	1ME645	8845	WEEKLY INSPECTION AND TIDY UP	WEEKLY INSPECTION AND TIDY UP	111	0	0	0	111
111031-00: SVC000779	11/07/2011	1H0103	186_INT	R	Tyres	1ME645		TYRE REPAIRS	SUPPLY AND FIT TYRES	0	410.44	0	0	410.44
111004-00: SVC000788	10/27/2011	1H0103	184_INT	R	Differential	1ME645	8755	CHECK LEAK AT CENTRE AXLE	TRAVEL TO HOBART TIP. CHECK LEAK FROM LEFT AND RIGHT CENTRE FINAL DRIVES. CLEAN OF, CHECK LEVELS AND MONITOR.	103.5	156.87	0	13.5	273.87
111017-00: SVC000782	10/25/2011	1H0103	182_INT	R	Sundries	1ME645		TAILGATE RESEAL	reseal tailgate as needed	678	0	0	0	678
111006-00: SVC000784	10/24/2011	1H0103	184_INT	R	Electrical	1ME645	8789	REPLACE U/S PARK BRAKE SWITCH	TRAVEL TO HOBART TIP. CHECK FOR PARK BRAKE FAULT. LOCATE FAULTY SWITCH AND TEMPORARY REPAIR. ORDER NEW SWITCH. PICK UP SWITCH AND MODIFY TO FIT. ADJUST PARK BRAKE AND TEST	305.5	4.45	0	27	336.95
110923-00: SVC000774	10/14/2011	1H0103	184_INT	S	Service	1ME645	8709	S1 B - 500 HR SERVICE	TRAVEL TO HOBART TIP. CARRY OUT 500 HR SERVICE AS PER SCHEDULE.	756	589.81	0	36	1381.81
110831-00: SVC000758	09/27/2011	1H0103	182_INT	R	Sundries	1ME645		RE SEAL AND REPAIR TAILGATE	reseal and repair tailgate	1148	82.3	0	0	1230.3
110916-00: SVC000770	09/26/2011	1H0103	184_INT	R	Sundries	1ME645	7641	WEEKLY INSPECTION AND TIDY UP	TRAVEL TO IMPACT. CHANGE AIR FILTERS, GREASE AND CHECK OVER	183	14.2	32.82	9	239.02
110912-00: SVC000770	09/23/2011	1H0103	184_INT	R	Sundries	1ME645	7589	WEEKLY INSPECTION AND TIDY UP	TRAVEL TO IMPACT. CHECK OVER AND GREASE UNIT, REPLACE BLOWN HEADLIGHT	129.5	0	32.82	9	171.32
110913-00: SVC000770	09/23/2011	1H0103	184_INT	R	Electrical	1ME645	7656	REPAIR LIGHTS & HORN OPERATION	TRAVEL TO IMPACT. CHECK HORN NOT WORKING. REMOVE STEERING WHEEL AND COLUMN. REPAIR SLIP RINGG WIRING. REPLACE HORN CONTACT. REASSEMBLE AND TEST	345	593.98	0	6.3	945.28
110831-00: SVC000762	09/09/2011	1H0103	184_INT	R	Differential	1ME645	7445	CHECK FRONT DIFF NOISE	TRAVEL TO IMPACT. CHECK OVER DIFF NOISE. PUT CAT DIFF OIL ADDITIVE IN	523	46.32	0	18	587.32
110905-00: SVC000740	09/06/2011	1H0103	184_INT	R	Steering	1ME645	7445	CHECK & REPAIR STEERING FAULT	TRAVEL TO IMPACT. DISMANTLE STEERING COLUMN AND RE ASSEMBLE SHAFT AND REFIT. TEST OK. CHECK OVER	241.5	0	0	9	250.5
110905-00: SVC000763	09/06/2011	1H0103	184_INT	R	Sundries	1ME645	7445	WEEKLY INSPECTION AND TIDY UP	CHECKED OVER UNIT AND CLEANED AS PER SCHEDULE. SUBLET FILTER RECYCLING TO CLEAN AIR FILTER ELEMENT.	101.5	87.89	32.82	0	222.21
110830-00: SVC000759	08/31/2011	1H0103	186_INT	R	Sundries	1ME645	8520 hrs	GENERAL CHECK OVER	GENERAL CHECK OVER. Checked over unit. Removed the steering wheel and freed up the horn contacts. Refitted the steering wheel and checked operation. Checked final drive oils on the centre axle.	383.5	0	0	0	383.5
110822-00: SVC000753	08/23/2011	1H0103	184_INT	R	Electrical	1ME645	8502	CHECK & REPAIR INDICATOR FAULT	TRAVEL TO HBMI. REPAIR FAULT WITH INDICATORS AS REQ'D.	172.5	0	0	27	199.5
110819-00: SVC000752	08/22/2011	1H0103	184_INT	R	Hydraulic	1ME645	8493	REPLACE STRUT GREASE NIPPLES	ON SITE AT HBMI. TOP UP COOLANT. REPLACE DAMAGED GREASE NIPPLES.	138	0	0	0	138
110801-00: SVC000742	08/16/2011	1H0103	184_INT	R	Electrical	1ME645	8487	REPLACE U/S TAILIGHT ASSEMBLY	ON SITE AT HBMI. REMOVE OLD TAIL IGH T ASSEMBLIES AND MOUNTING PLATES. MODIFIED MOUNTS TO TAKE NEW LED TAIL LIGHTS. REPLACE ELECTRICAL PLUGS AND REPAIR WIRING.	390	242.5	0	0	632.5
110726-00: SVC000741	08/04/2011	1H0103	184_INT	S	Service	1ME645	8484	S1 A - 250 HR SERVICE	TRAVEL TO HBMI. CARRIED OUT 250 HR SERVICE AS PER SCHEDULE.	380.75	232.27	0	0	613.02

110607-00	SVC00071	07/27/2011	1H0103	184_INT	R	Engine	1ME645	8376	CLEAN BLOCKED RADIATOR	TRAVELLED TO HBMI X3 REMOVE INTER COOLER AND RADIATOR FOR REPAIR, DIG OUT UNDER BELLY PLATE ON ENGINE TAKE INTERCOOLER AND RADIATOR TO NEW NORFOLK RADIATOR FOR REPAIR RETURN TO UNIT AND REPLACE REPAIRED INTERCOOLER AND RADIATOR, REPLACE FAN BELTS, FABRICATE AND FIT HOSES TO SUIT, FILL WITH COOLANT AND TEST OPERATION OK.	1304.5	1636.21	480	162	3582.71
110705-00	SVC00073	07/25/2011	1H0103	184_INT	R	Engine	1ME645	8457	CHECK NOISE IN TURBOCHARGER	04/07 - TRAVELLED TO HBMI AND REMOVED TURBOCHARGER INDUCTION HOSES TO CHECK AFTER NOISE WAS DETECTED. FOUND COMPRESSOR SHAFT HAD 2MM END FLOAT AND WHELL WAS SCRAPING IN HOUSING. REMOVED TURBOCHARGER AND SENT AWAY FOR SPECIALIST REPAIR/SERVICE. 07/07 - DRILLED OUT AND REMOVED AND REPLACED BROKEN BOLTS IN EXHAUST BRAKE ASSEMBLY. 11/07 - CLEANED UP SURFACES AND FITTED RECONDITIONED TURBOCHARGER. REFITTED ALL EXTERNAL COMPONENTS AND COVERS. CHECKED ENGINE OIL PRESSURE AND BOOST PRESSURE. OIL PRESSURE: 27 PSI AT IDLE 77 PSI AT HIGH IDLE(1500 RPM) BOOST: 14 PSI AT IDLE 16.7 PSI AT HIGH IDLE.	883.5	809.09	0	25.2	1717.79
110608-00	SVC00071	06/29/2011	1H0103	122_INT	R	Sundries	1ME645		TYRES FOR DUMPERS	TYRES FOR DUMPERS	0	14616	0	0	14616
110621-00	SVC00071	06/24/2011	1H0103	122_INT	R	Tyres	1ME645	N/A	TYRE REPAIR RUBANDS 58882	TYRE REPAIR RUBANDS 58882	0	42.5	0	0	42.5
110511-00	SVC00069	06/15/2011	1H0103	184_INT	S	Service	1ME645	8242	S1 D - 2000 HR SERVICE	TRAVELLED TO IMPACT. CARRIED OUT 2000HR SERVICE AS PER SCHEDULE	935	2843.41	0	13.5	3791.91
110523-00	SVC00069	05/31/2011	1H0103	184_INT	R	Trimming	1ME645	8311	REPAIR SEAT SUSPENSION FAULT	TRAVELLED TO IMPACT. REMOVE SEAT VALVE FROM M648 AND FIT TO M645. TAGGED OUT OTHER UNIT. FITTED NEW SEAT VALVE AND CHECKED OPERATION	241.5	0	0	21.6	263.1
110531-00	SVC00070	05/31/2011	1H0103	184_INT	R	Hydraulic	1ME645	8281	Repair hydraulic leak	INSPECT OIL LEAK AT HYDRAULIC TANK, REMOVE COVERS AND CLEAN DOWN, FOUND LEAKING FITTING BETWEEN TANK AND CHASSIS, RESEAL FITTINGS AND REPLACE COVERS.	290.75	0	0	13.5	304.25
110510-00	SVC00070	05/26/2011	1H0103	122_INT	R	Sundries	1ME645		REQ MAY 2011 M.OTTEN 4379	REQ MAY 2011 M.OTTEN 4379	0	11.95	0	0	11.95
110321-00	SVC00066	04/27/2011	1H0103	184_INT	R	Ancillary Ec	1ME645	7566	CHECK AIR CONDITIONING FAULT	TRAVELLED TO IMPACT. RECLAIMED AIR CON GAS, REMOVED CONDENSOR AND RECEIVER DRYER. FITTED NEW ONES AND RECHARGE SYSTEM TO SPECS. REPLACED REAR LIGHTS ASSEMBLIES, CHECKED STEERING PUMP PRESSURE AND ADJUSTED TRAY SENSOR TO SPEC	276	1121.98	0	10.8	1408.78

110413-00: SVC00068	04/26/2011	1H0103	184_INT	S	Service	1ME645	7861	S1 A - 250 HR SERVICE	TRAVELLED TO IMPACT. CARRIED OUT 250HR SERVICE AS PER SCHEDULE	345	229.19	0	19.8	593.99
									NOTE:- AUX BELTS ASAP, FRONT CENTRE DRIVE TYRES HAVE APPROX 30% WEAR LEFT AND REAR DRIVE TYRES HAVE APPROX 10% WEAR LEFT					
110316-00: SVC00066	03/30/2011	1H0103	184_INT	S	Service	1ME645	7530	S1 B - 500 HR SERVICE	TRAVELLED TO IMPACT. CARRIED OUT 500HR SERVICE AS PER SCHEDULE	552	727.36	0	10.8	1290.16
110329-00: SVC00066	03/30/2011	1H0103	184_INT	R	Electrical	1ME645	7566	Replace tail lights	REMOVED AND REPLACED TAIL LIGHT ASSEMBLIES. REPAIRED WIRING AND TESTED OK. PARTS SUPPLIED ON PREVIOUS S/C	172.5	0	0	0	172.5
110222-00: SVC00065	03/24/2011	1H0103	184_INT	R	Trimming	1ME645	7261	REPAIR SEAT SUSPENSION FAULT	22/2/11 - TRAVELLED TO IMPACT FERTILISER AND CHECKED SEAT SUSPENSION VALVE. COULD NOT REPAIR. REMOVED VALVE FROM 1ME648 AND FITTED TO UNIT. 28/2/11 - RETURNED TO 1ME648 AND FITTED NEW ADJUSTING VALVE	276	54.16	0	0	330.16
110303-00: SVC00065	03/24/2011	1H0103	184_INT	R	Electrical	1ME645	7468	REPAIR TRAY FAULT CODE	28/02 - TRAVELLED TO IMPACT FERTILISER AND CHECKED TRAY FAULT CODE. REPAIRED DAMAGED WIRING TO TRAY ANGLE SENSOR AND TESTED OK. 03/03 - TRAVELLED TO IMPACT FERTILISER AND CHECKED TRAY FAULT CODE AGAIN. FOUNT ANGLE SENSOR U/S AND IRREPAIRABLE. 04/03 - REMOVED TRAY ANGLE SENSOR FROM 1ME740 AT BREADALBANE AND FITTED TO UNIT. ADJUSTED AND TESTED OPERATION OK. ORDERED NEW PART. 07/03 - FITTED REPLACEMENT SENSOR TO 1ME740 IN LA WORKSHOP.	835.5	1252.09	0	49.5	2137.09
110222-00: SVC00065	03/23/2011	1H0103	184_INT	R	Bodywork	1ME645	7468	REPLACE L/H REAR VISION MIRROR	TRAVELLED TO NYRSTAR AND REMOVED REAR VISION MIRROR FROM 1ME648 AND FITTED TO UNIT. FITTED CAT TYPE MIRRORS TO 1ME648 AND KEPT 1 ORIGINAL MIRROR FOR SPARE.	248.5	350.58	0	0	599.08
110315-00: SVC00066	03/17/2011	1H0103	122_INT	R	Sundries	1ME645		STORE ISSUE MARCH PG 103-4088	STORE ISSUE MARCH PG 103-4088	0	46.15	0	0	46.15
110125-00: SVC00065	02/25/2011	1H0103	184_INT	R	Electrical	1ME645	7299	REPAIR U/S RETARDER OPERATION	TRAVELLED T SITE AT BREADALBANE AND CARRY OUT DIAGNOSTICS TEST TO DUMP TRUCK WHICH HAD BEEN GOING FROM 4TH GEAR TO 1ST GEAR. FOUND RETARDER STALK FAULTY	524.5	1319.41	609.82	0	2453.73
110218-00: SVC00065	02/25/2011	1H0103	184_INT	R	Engine	1ME645	7242	REPAIR OVERHEATING FAULT	TRAVELLED TO BREADALBANE AND CLEAN RADIATOR AND AFTR COOLER, CLEANED AIR CONDENSOR	14.75	0	217.51	0	232.26
110131-00: SVC00064	01/31/2011	1H0103	184_INT	R	Trays/Buck	1ME645	7196	CHECK TRAY FAULT CODE	TRAVELLED TO CAMBRIDGE. CHECK TRAY SENSOR. FOUND CONTROL HELD IN FLOAT MODE. RESET AND CHECKED OEPRATION.	241.5	0	0	31.5	273
101221-00: SVC00064	01/28/2011	1H0103	184_INT	R	Brake	1ME645	7184	CHECK NOISE IN BRAKE SYSTEM	CLEAN OUT AND ADJUST PARK BRAKE REF REVf001995	14.75	0	172.82	0	187.57
101221-00: SVC00064	01/27/2011	1H0103	186_INT	R	Trays/Buck	1ME645	7214	REFIT TAIL GATE	remove mud bucket from tray . lube up pins and install tailgate , test operation ok .	442.5	0	0	0	442.5
101217-00: SVC00062	12/20/2010	1H0103	184_INT	R	Suspensior	1ME645	7141	REPLACE TORQUE ROD BOLTS	ONSITE AT LAUNCESTON. CUT SIEZED DIFF LOCATOR BAR BOLTS OFF AND FITTED NEW BOLTS. TENSIONED TO SPECS	179.5	0	0	0	179.5
101123-00: SVC00060	12/10/2010	1H0103	182_INT	R	Trays/Buck	1ME645		REMOVE TAILGATE AS PER DAVE LA	REMOVE TAILGATE AS PER DAVE LANGDON	389.5	0	0	0	389.5

101123-00	SVC00061	12/06/2010	1H0103	184_INT	S	Service	1ME645	7124	S1 C - 1000 HR SERVICE	TRAVELLED (SHARED TRIP) FROM LAUNCESTON. CARRIED OUT 1000HR SERVICE AS PER SCHEDULE AND ADJUSTED BONNET CATCH	587	1614.52	0	171	2372.52
101104-00	SVC00060	12/03/2010	1H0103	184_INT	R	Bodywork	1ME645	7088	FIT CAT REAR VISION MIRRORS	REMOVED ORIGINAL MIRRORS AND FITTED ONE TO 1ME648 AND KEPT ONE FOR SPARE. RETROFITTED CAT TYPE MIRRORS P/N 5P-6879	207	182.56	0	0	389.56
101005-00	SVC00059	11/18/2010	1H0103	184_INT	R	Bodywork	1ME645		REPLACE HEATED MIRROR	REPLACE HEATED MIRROR	29.5	666.86	0	0	696.36
101116-00	SVC00060	11/17/2010	1H0103	122_INT	R	Tyres	1ME645	N/A	PUNCTURE REPAIR RUBAND 54264	PUNCTURE REPAIR RUBAND 54264	0	50	0	0	50
101007-00	SVC00059	11/04/2010	1H0103	186_INT	R	Steering	1ME645	7096 hrs	REPAIR STEERING CYLINDER	Clean unit and press off lhf wheel.Clean dirt from around steering cylinder. Removed steering cylinder and diseaasembe.Reseal,assemble and refit to unit. Refit wheel,operate and check for leaks. remove exhaust covers and chec for leaks. Top up hydraulic oil,repair coolant leak and top up coolant. Replace lhf mirror.	1569	381.91	0	0	1950.91
101013-00	SVC00058	10/15/2010	1H0103	182_INT	R	Lathe	1ME645		MACHINE BUSH FROM STEER CYLIND	MACHINE BUSH FROM STEER CYLINDER & MACHINE BUSH PRESS IN TOOL	94.5	0	0	0	94.5
101007-00	SVC00058	10/12/2010	1H0103	122_INT	R	Sundries	1ME645		STORE ISSUE OCT PG 103-3229	STORE ISSUE OCT PG 103-3229	0	56.4	0	0	56.4
101001-00	SVC00058	10/11/2010	1H0103	184_INT	R	Tyres	1ME645	7095	PUMP UP TYRE AND CHECK TRAY	TRAVELLED TO INPACT FERTILIZER AND DELIVER OIL TO UNIT. TRAVELLED TO NYRSTAR TO PUMP UP LEFT HAND FRONT WHEEL. TOOK PHOTOS OF EXHAUST SYSTEM M648 AND REPORTED BACK TO P STELFOX	276	5	0	25.2	306.2
101006-00	SVC00058	10/07/2010	1H0103	122_INT	R	Sundries	1ME645		PARTS REQ OCTOBER 103-3182	PARTS REQ OCTOBER 103-3182	0	118.24	0	0	118.24
100920-00	SVC00058	09/30/2010	1H0103	184_INT	R	Hydraulic	1ME645		REPAIR HYD LEAK UNDER CAB	TRAVELLED TO IMPACT. LIFT CAB AND LOCATE OIL LEAK. REMOVED PIPE AND HAD KAI REPAIR CRACK IN HYDRAULIC TUBE. REFIT PIPE AND TEST. LOWER CAB	797.5	173.86	0	18	989.36
100901-00	SVC00057	09/28/2010	1H0103	184_INT	R	Electrical	1ME645	6860	REPAIR HEADLIGHTS ETC	TRAVELLED TO IMPACT FERTILIZER. REPLACED LEFT HAND HEADLIGHT GLOBE AND CHECK OPERATION AND REPAIRED WOIRING TO LIGHTS. REPLACED DEFECTIVE FUEL CAP.	98.5	233.41	0	7.2	339.11
100908-00	SVC00057	09/15/2010	1H0103	186_INT	S	Service	1ME645	6891hr	CARRY OUT "A" SERVICE	Carry out the required "a:" service. Greased the drive line and repaired the tail lights.	236.25	242.44	0	2.7	481.39
100818-00	SVC00055	09/13/2010	1H0103	182_INT	R	Trays/Buck	1ME645		SEAL AROUND TAILGATE AS DISCUS	SEAL AROUND TAILGATE AS DISCUSSED WITH DAVID LANGDON	1593	69.54	0	0	1662.54
100906-00	SVC00057	09/10/2010	1H0103	182_INT	R	Hydraulic	1ME645		REPLACE PINS & BEARINGS IN LIF	REMOVE TOP LIFT CYLINDER PINS & CHECK PINS & BEARINGS, FOUND THAT PIN MOUNTING BRACKET BORES BADLY WORN WILL REQUIRE LINEBORING WHEN MACHINE AVAILABLE, REMOUNT CYL AS REQUESTED BY DAVID LANGDON	448	0	0	0	448
100816-00	SVC00055	08/25/2010	1H0103	184_INT	R	Electrical	1ME645	6825HRS	REPLACE U/S BATTERIES	TRAVELLED TO BASKERVILLE RD. CHECKED NO START FAULT. FOUND BATTERIES UNSERVICABLE. FIT NEW BATTERIES AND CHECK CHARGE RATE 28.3V	236.5	437.14	0	58.5	732.14
100415-00	SVC00048	08/16/2010	1H0103	184_INT	S	Service	1ME645	6150	S1 D - 2000 HR SERVICE	TRAVELLED TO BRIGHTON. CARRY OUT 2000HR SERVICE AS PER SCHEDULE. DRAIN AND REFILL DIFFS AND FINAL DRIVES. TAKE OIL SAMPLES	793	2035.1	0	22.5	2850.6

100729-00: SVC000550 07/30/2010	1H0103	184_INT	R	Trays/Buck	1ME645	6652	SEAL TAILGATE ON UNIT	TRAVELLED TO NYRSTAR AND SEALED OFF TAILGATE TO TRAY WITH RUBBER STRIP. RETURNED TO UNIT AND SEALED WITH PREFABRICATED CHUTEX STRIP. STRIP SUPPLIED AGAINST 1ME737.	369.5	0	0	22.5	392
100520-00: SVC000542 07/20/2010	1H0103	184_INT	R	Sundries	1ME645	6330	REPLACE WORN PINS AND BUSHES	TRAVELLED TO BRIGHTON. CHECKED BODY LIFT CYLINDER PIN FOR SECURITY. FOUND PINS AND SPHERICAL BEARINGS ON TOP CYLINDER MOUNTS UNSERVICABLE. REPLACE REVOLVING LIGHT ASSEMBY	98.5	995.26	0	0	1093.76
100629-01: SVC000532 07/12/2010	1H0103	184_INT	S	Service	1ME645	6611	S1 B - 500 HR SERVICE	TRAVELLED TO UNIT AND CARRIED OUT 500HR SERVICE AS PER SCHEDULE	380	893.59	0	0	1273.59
100527-00: SVC000515 06/11/2010	1H0103	184_INT	R	Sundries	1ME645	5879	REPLACE A/C FILTERS	TRAVELLED TO BRIGHTON AND REPLACE CAB FILTERS AND CLEAN AIR FILTER	60.5	272.74	0	0	333.24
100517-01: SVC000500 05/17/2010	1H0103	184_INT	R	Electrical	1ME645		REPLACE REVOLVING LIGHT	TRAVELLED TO UNIT AND REPLACED REVOLVING LIGHT GLOBE	33	9.5	0	0	42.5
091030-00: SVC000495 05/14/2010	1H0103	105	R	Electrical	1ME645		REPLACE FAULTY UHF RADIO	1ME645	0	300.5	0	0	300.5
100424-00: SVC000486 04/26/2010	1H0103	184_INT	R	Tyres	1ME645	5822	CHANGE OUT FLAT TYRE	REPLACE FAULTY UHF RADIO TRAVELLED TO BRIGHTON AND CHANGE OUT FLAT TYRE	237.5	0	0	13.5	251
100419-00: SVC000484 04/22/2010	1H0103	184_INT	R	Suspensior	1ME645	5892	REPLACE REAR STABILISER BOLTS	TRAVELLED TO BRIGHTON AND REPLACE BOLTS IN REAR STABILIZER BAR	192.5	0	0	23.4	215.9
100218-00: SVC000446 03/26/2010	1H0103	184_INT	S	Service	1ME645	5788	S1 A - 250 HR SERVICE	TRAVELLED TO BRIGHTON AND CARRIED OUT 250HR SERVICE AS PER SCHEDULE	66	291.61	200.45	0	558.06
091029-00: SVC000407 02/26/2010	1H0103	105	R	Engine	1ME645		FUEL SUPPLY FAULT, LIFT PUMP	UNIT 1ME645 KOMATSUE TO REPAIR LIFT PUMP REMOVE AND REPLACE FILTERS AS REQUIRED	632.5	305.39	726.3	0	1664.19
100205-00: SVC000440 02/09/2010	1H0103	184_INT	R	Engine	1ME645	5655	CHECK OVERHEATING FAULT	TRAVELLED TO BRIGHTON AND BLOW OUT RADIATOR AND AIR FILTER DUE TO DUE TO OVER HEATING	99.5	0	0	4.5	104
100115-00: SVC000426 01/29/2010	1H0103	122_INT	R	Sundries	1ME645		STORE ISSUE JAN.PG REQ.103-156	STORE ISSUE JAN.PG REQ.103-156	0	11.95	0	0	11.95
100114-00: SVC000425 01/27/2010	1H0103	184_INT	R	Sundries	1ME645	5584	CHECK OVER UNIT PRIOR TO WORK	TRAVELLED TO NYRSTAR. REPLACE DAMAGED GREASE NIPPLES AND CHANGE OUT AIR FILTERS AND AIR CON FILTERS	126.5	274.41	0	4.5	405.41
091126-00: SVC000408 12/24/2009	1H0103	105	R	Brake	1ME645	5360	STEEL BRAKE LINE LH/R AXLE	1ME645	357.5	0	0	0	357.5
								ODOMETER - 5360					
								DIAGNOSE OIL LEAK, CLEAN AROUND DAMAGED BRAKE PIPE. REMOVE BRAKE PIPE TAKE TO LA. WENT TO WELCO PICKED UP NEW BRAKES. TOOK TO LA FOR WELDERS. INSTALL REPAIRED BRAKE PIPE, BLEED BRAKE SYSTEM & TEST					
091209-00: SVC000416 12/22/2009	1H0103	184_INT	S	Service	1ME645	5528	S1 B - 500 HR SERVICE	CARRIED OUT 500HR SERVICE AS PER SCHEDULE	429	1305.54	0	0	1734.54
091126-00: SVC000400 12/21/2009	1H0103	182_INT	R	Hydraulic	1ME645		MAKE UP NEW BRAKE LINE PIPE		110	63.44	0	0	173.44
091104-00: SVC000402 11/27/2009	1H0103	105	R	Engine	1ME645		REPLACE A/C, ENG FILTERS	1ME645	55	295.21	0	0	350.21
091120-00: SVC000397 11/20/2009	1H0103	184_INT	R	Engine	1ME645	5284	Bleed fuel system	REPLACE ENGINE/AC FILTERS Assist Paul Riseley to bleed fuel system as required	66	0	0	13.5	79.5

090916-00	SVC000387	10/30/2009	1H0103	105	R	Hydraulic	1ME645	5065	REPLACE LIFT RAM PIN BUSHES	1ME645	385	10.86	0	0	395.86
										ODOMETER - 5065					
										RE BUSH TRAY LIFT CYL. CLEAN PRIOR TO REPAIRS					
091014-00	SVC000387	10/30/2009	1H0103	122_INT	R	Tyres	1ME645	N/A	TYRE REPAIRS B SELECT 43429	TYRE REPAIRS B SELECT 43429	0	30	0	0	30
091030-00	SVC000387	10/30/2009	1H0103	122_INT	R	Sundries	1ME645		STORE ISSUE OCT.PG REQ.1079,	STORE ISSUE OCT.PG REQ.1079,	0	308.6	0	0	308.6
091012-00	SVC000374	10/26/2009	1H0103	184_INT	S	Service	1ME645	5257	S1 A - 250 HR SERVICE	TRAVELLED TO NYRSTAR. CARRIED OUT 250HR SERVICE AS PER SCHEDULE	342	313.92	0	12.6	668.52
090910-00	SVC000361	10/08/2009	1H0103	105	R	Hydraulic	1ME645	5010	TRAY RAMS , POWER DOWN FAULT	UNIT: 1ME645	550	0	768.3	0	1318.3
										ODOMETER: 5010HRS					
										ASSESS TRAY LOWERING FAULT, INCREASE PILOT PRESSURE FOR POWER DOWN CYCLE. POSSIBLE FAULT WITH PRESURE REGULATOR. LIFT CAB TO ACCESS FAULTS AND COMPLETED TEST TO ASSESS WHY TRAY WAS STICKING TO AIR ETC. LOWER CAB. 8/09/2009 INVESTIGATED TRAY LOWERING FAULT, BROUGHT MACHINE UP TO OPERATING TEMPRATURE, LIFTED CAB AND CHECKED ALL PRESSURE AND ELECTRONIC CONTROLS, CAN NOT FAULT THE SYSTEM, LOWERED CAB AND PUT UNIT BACK TO WORK. 9/09/2009 LOOKED AT TRAY LOWERING FAULT, TESTED PPC PRESSURE AT SPOOL, WITHIN SPEC. BUT ON LOW SIDE 728KGCM. REMOVED SPOOL CAP AND CHECKED SPOOL NOT JAMMED ON OK. CHECKED SPRINGS ON, REFITTED, LIFTED CAB AND ADJUSTED PPC TO 40 KGCM. TESTED FAULT HAS NOW GONE. LOWERED CAB AND TESTED OPERATION OK.					
090825-00	SVC000361	09/23/2009	1H0102	105	R	Hydraulic	1ME645	4960	HOIST CYL. UPPER PINS & BUSHES	REMOVE LEFT HAND LIFT CYLINDER AND OLD BUSH. FIT NEW BUSH AND FIT CYLINDER BACK TO MACHINE. GREASE AND TOP UP WITH HYDRAULIC OIL. REPLACE RIGHT HAND LIFT CYLINDER AND UPPER BUSH. REPAIR DAMAGED BEARING HOUSING AND FIT NEW CIRCLIP	687.5	249.57	0	0	937.07
090825-00	SVC000347	09/03/2009	1H0102	182_INT	R	Lathe	1ME645		MAKE 2 TRAY LIFT CYLINDER PINS	PROFILE RETAINER PLATES & MAKE 2 TRAY LIFT CYLINDER PINS	275.25	49.9	0	0	325.15
090820-00	SVC000347	08/28/2009	1H0102	184_INT	S	Service	1ME645	4981	S1 C - 1000 HR SERVICE	TRAVELLED TO NYRSTAR. CARRIED OUT 1000HR SERVICE AS PER SCHEDULE	630	1549.37	0	18.9	2198.27
090806-00	SVC000345	08/27/2009	1H0102	105	R	Engine	1ME645	4863	ENGINE & AIR CON FILTERS	1ME645	55	179.42	0	0	234.42
										ODOMETER - 4863					
090623-00	SVC000311	06/30/2009	1H0102	184_INT	S	Service	1ME645	4750hours	S1 A - 250 HR SERVICE	REPLACE ENG AND AIRCON FILTERS SERVICE UNIT AS REQUIRED	286	285.41	0	16.2	587.61

090624-00: SVC000317	06/26/2009	1H0102	105	R	Ancillary Ec	1ME645	4596	REPLACE AIR CON FILTERS	1ME645	123.75	293.09	0	0	416.84
									ODOMETER - 4596					
									REPLACE AIR CON FILTERS & ENGINE AFTER AIR FILTER					
090624-00: SVC000317	06/26/2009	1H0102	105	R	Brake	1ME645	4601	DIAGNOSE FAULT WITH BRAKES	1ME645	165	0	0	0	165
									ODOMETER - 4601					
									DIAGNOSE FAULT WITH BRAKES. CLEAN UNDER FLOOR MAT TO ALLOW PEDAL TO RETURN					
090602-00: SVC000317	06/25/2009	1H0102	122_INT	R	Tyres	1ME645	4590 hrs	TYRE REPAIRS B-SELECT 40897	TYRE REPAIRS B-SELECT 40897	0	1590	0	0	1590
090506-00: SVC000287	06/18/2009	1H0102	184_INT	S	Service	1ME645		S1 B - 500 HR SERVICE	1ME645	495	723.25	0	0	1218.25
									SERVICE					
090519-00: SVC000297	06/15/2009	1H0102	105	R	Hydraulic	1ME645		REPAIR HOIST CNTRL OPERATION	REPAIR HOIST CONTROL OPERATION	357.5	849.59	100	0	1307.09
090529-00: SVC000307	06/05/2009	1H0102	105	R	Transmissi	1ME645	4530	CHECK TOP UP TRANS OIL	1ME645	55	67	0	0	122
									ODOMETER - 4530					
									CHECK TRANSMISSION OIL. TOOP UP & CHECK FOR LEAKS					
090420-00: SVC000307	05/29/2009	1H0102	182_INT	F	Bodywork	1ME645	4329	MAKE AND FIT LIGHT GUARDS- CAB		412.5	184.08	0	0	596.58
090429-00: SVC000297	05/26/2009	1H0102	186_INT	F	Sundries	1ME645		HEATED MIRRORS	supply heated mirror pads and fit them to the mirrors.	165	217.04	0	0	382.04
090506-00: SVC000297	05/22/2009	1H0102	186_INT	R	Electrical	1ME645	4040 hrs	WIRE UP HEATED MIRRORS	Wire up heated mirrors as required	324	50.3	0	0	374.3
090429-00: SVC000287	05/07/2009	1H0102	105	R	Hydraulic	1ME645	4226	TRAY LOWER FAULT DIAGNOSE	1ME645	110	0	311.89	0	421.89
									ODOMETER - 4226					
									INVESTIGATE CAUSE OF TRAY NOT LOWERING ON OCCASIONS. SUSPECT ELECTIC SOLENOID AT FAULT. WILL MONITOR FAULT RE-OCCURANCE					
090306-00: SVC000257	04/07/2009	1H0102	122_INT	R	Sundries	1ME645		REFER MARCH REQ.PG 26794	REFER MARCH REQ.PG 26794	0	119.05	0	0	119.05
090305-00: SVC000257	03/11/2009	1H0102	184_INT	S	Service	1ME645	4251	S1 A - 250 HR SERVICE	TRAVELLED TO NYRSTAR. CARRIED OUT 250HR SERVICE AS PER SCHEDULE	330	223.09	0	15.3	568.39
090129-00: SVC000247	02/27/2009	1H0102	105	R	Electrical	1ME645	4000	REPAIR TAIL LIGHTS & LENSES	1ME645	157.5	185	0	0	342.5
									ODOMETER - 4000					
									REPAIR SCREWS IN TAIL LIGHTS, REPLACE FROZEN BLOWN GLOBES. REPLACE DAMAGED TAIL LIGHT LENSES.					
090218-00: SVC000247	02/27/2009	1H0102	105	R	Electrical	1ME645	4000	REPLACE REVOLVING LIGHT ASSEM	1ME645	105	101.72	0	0	206.72
									ODOMETER - 4000					
									WHARF					
									REPLACE REVOLVING LIGHT ASSEMBLY					

090218-00: SVC00024	02/27/2009	1H0102	105	R	Engine	1ME645	4000	ATTEND TO OVERHEATING FAULT	1ME645	105	0	0	0	105
									ODOMETER - 4000					
081211-00: SVC00021	12/31/2008	1H0102	105	R	Hydraulic	1ME645	3998	TOP UP COOLANT & HYDRAULIC OIL	ATTEND TO OVERHEATING FAULT. CLEAN RADIATOR & OIL COOLERS 1ME645	50	6.97	0	0	56.97
									ODOMETER - 3998					
081230-00: SVC00022	12/30/2008	1H0102	184_INT	R	Engine	1ME645	4052	CLEAN OUT RADIATOR	TOP UP COOLANT AND HYDRAULIC OIL. TRAVELLED TO ROCKMOUNT RD. CLEAN OUT RADIATOR, COOLER AND CONDENSOR, TOP UP COOLANT LEVEL	90	0	0	40.5	130.5
081022-00: SVC00020	11/28/2008	1H0102	105	R	Electrical	1ME645	3886	TRAY POSITION SWITCH REPAIRS	1ME645	175	0	0	0	175
									ODOMETER - 3886					
									DIAGNOSE FAULT WOTH TRAY NOT COMING DOWN. REMOVING TRAY POSITIONING SENSOR. DISMANTLE & REPAIR VALVE. COLLECT SERVICE MANUAL FROM KOMATSU AND SET SWITCH VOLTAGE TO OPERATING SPECIFICATION. TEST OK.					
081111-00: SVC00020	11/27/2008	1H0102	184_INT	R	Bodywork	1ME645	3962	REPLACE R/H DOOR WINDOW.	TRAVELLED TO SOUTH HOBART. CHECK OVER MACHINE AFTER BEING VANDALISED, FIT RIGHT HAND SIDE DOOR.	395	0	0	27	422
081118-00: SVC00020	11/27/2008	1H0102	184_INT	R	Engine	1ME645	3991	REPAIR OVERHEATING FAULT.	TRAVELLED TO HBMI. DISMANTLE GRILL AND PANELS TO BLOW OUT BLOCKED RADIATOR, INTERCOOLER AND AIR CON CONDENSOR. DISMANTLE SEAT AND REMOVE SEAL STRUTS	410	100.52	0	53.1	563.62
081118-00: SVC00020	11/27/2008	1H0102	184_INT	S	Service	1ME645	3991 HRS	S1 D - 2000 HR SERVICE.	TRAVELLED TO HBMI. CARRIED OUT S1-D 2000HR SERVICE AS PER SCHEDULE AND FIT NEW FIRE EXTINGUISHER	1150	2183.84	0	193.5	3527.34
080925-00: SVC00019	11/13/2008	1H0102	122_INT	R	Sundries	1ME645		TRENT COLLECTED FROM STORE	TRENT COLLECTED FROM STORE	0	39.67	0	0	39.67
080930-00: SVC00019	11/13/2008	1H0102	122_INT	R	Tyres	1ME645		TYRE REPAIRS BRIDGESTONE	TYRE REPAIRS BRIDGESTONE	0	325.92	0	0	325.92
081020-00: SVC00018	10/22/2008	1H0102	105	R	Engine	1ME645	3780	CHECK AIR CON OPERATION	1ME645	62.5	191.8	0	0	254.3
									ODOMETER - 3780					
									CHECK OPERATION OF AIR CONDITIONING. CLEAN CONDESOR AND REPLACE FILTERS					
081015-00: SVC00018	10/15/2008	1H0102	184_INT	R	Tyres	1ME645	3819	C/OUT TYRE BLOW OUT	CALLOUT TO NYRSTAR. TYRE BLOWN OUT. RANG DUGGAN AND PARKER BUT THEY COULD NOT COME OUT UNTIL 11:00AM. UNLOAD CAT RENTAL DUMPER OFF FLOAT FROM LAMPTON AVE AND ESCORT PAUL OATES TO NYRSTAR AND TAKE PAUL BACK TO LAMPTON TO PICK UP UTE	300	0	0	49.5	349.5
080930-00: SVC00018	10/14/2008	1H0102	184_INT	R	Suspensior	1ME645	3823	REPLACE TORQUE ROD BOLTS.	TRAVELLED TO NYRSTAR. REPLACE TOUNGE ROB BOLTS FOR MIDDLE AXLE	200	0	0	9	209
080912-00: SVC00016	10/07/2008	1H0102	182_INT	R	Sundries	1ME645		MAKE UP 4 TAPPING BLOCKS	MAKE UP 4 TAPPING BARS FOR TAILGATE PIVOT ARMS AS REQUESTED BY FIELD SERVICE	397	0	0	0	397

080911-00: SVC000166	10/06/2008	1H0102	184_INT	F	Trays/Buck	1ME645	3795	FIT MODIFIED TRAY PIVOT ARMS.	TRAVEL TO NYRSTAR AND REMOVE BROKEN AND BENT TAILGATE CABLE PIVOT BRACKETS. BRING TO WORKSHOP AND REFABRICATE DAMAGED SECTIONS. STRENGTHEN AND GUSSET ALL AREAS. CUT OFF FRAME MOUNTS AFTER BOLTS WERE UNABLE TO BE REMOVED AND FABRICATE NEW MOUNTS. WELD ON MOUNTS AND FIT UP ALL BRACKETS ETC AND PAINT. TESTED OPERATION OK.	2858	714.97	85	117	3774.97
080829-00: SVC000167	09/25/2008	1H0102	184_INT	R	Trays/Buck	1ME645	3707 HRS	WELDING REPAIRS TO TRAY.	TRAVELLED TO NYRSTAR. CARRIED OUT WELDING REPAIRS TO CRACKS IN TAIL BOARD SYSTEM	260	84.5	0	27	371.5
080902-01: SVC000171	09/25/2008	1H0102	105	S	Service	1ME645	3704	CARRY OUT S1A 3750 HRS	1ME645	25	120.8	481.07	0	626.87
ODOMETER - 3704														
080922-00: SVC000172	09/25/2008	1H0102	122_INT	R	Tyres	1ME645		TYRE REPAIRS BRIDGESTONE	CARRY OUR S1A 3750 SERVICE	0	295.68	0	0	295.68
080717-00: SVC000165	09/19/2008	1H0102	105	R	Engine	1ME645		Replace air filters	TYRE REPAIRS BRIDGESTONE	12.5	285.34	0	0	297.84
ODOMETER - 3548														
080808-00: SVC000150	09/09/2008	1H0102	182_INT	R	Trays/Buck	1ME645		REPAIR TAILGATE PIVOT BRACKETS	CHANGE A/C FILTERS					
080730-00: SVC000145	08/07/2008	1H0102	105	R	Service	1ME645	3500	S1B CARRY OUT 3500HR SERVICE	REPAIR TAILGATE PIVOT BRACKETS	253.5	23.66	0	0	277.16
080728-00: SVC000143	08/01/2008	1H0102	182_INT	R	Trays/Buck	1ME645	3571.5 HRS	REPAIRED CRACKS IN TAILGATE LI	KOMATSU TO CARRY OUT 3500 HR SERVICE ON HM 300 1ME645 AT NYRSTAR	55	120.8	831.44	0	1007.24
080711-00: SVC000136	07/15/2008	1H0102	184_INT	R	Hydraulic	1ME645	3426	CHECK HOIST CONTROL	REPAIRS IN TAILGATE AS REQUIRED	282	0	0	0	282
080226-00: 8144	06/20/2008	1H0102	184_INT	S	Service	1ME645		S1 A - 250 HR SERVICE.	TRAVELLED TO NYRSTAR AND CHECKED OUT HOIST CONTROL AND TIMING OF HOIST. WRONG OPERATION OF HOIST WAS BEING USED	110	0	0	4.5	114.5
080226-00: SVC000062	06/20/2008	1H0102	184_INT	S	Service	1ME645		S1 A - 250 HR SERVICE.		0	0	0	0	0
080226-00: SVC000065	06/20/2008	1H0102	184_INT	S	Service	1ME645		S1 A - 250 HR SERVICE.	PERFORM 250HOUR SERVICE	0	0	554.7	0	554.7
080613-00: SVC000125	06/20/2008	1H0102	105	S	Service	1ME645	3250	S1 A 3250HR SERVICE		0	120.4	0	0	120.4
080602-00: SVC000116	06/03/2008	1H0102	189_INT	W	Differential	1ME645	3303 HRS	FINAL DRIVE - BAD OIL SAMPLES	SERVICE UNIT AS REQUIRED	0	0	544.14	0	544.14
080421-00: SVC000097	05/12/2008	1H0102	188_INT	S	Service	1ME645		CARRY OUT 3000HR SEVICE	FRONT RIGHT HAND SIDE FINAL DRIVE HIGH COPPER AND LEAD IN OIL SAMPLE RESULTS. OVER HAUL FINAL DRIVE, REPLACE AXLE SUPPORT BUSH AND DUO SEALS	0	0	0	0	0
080409-00: SVC000083	05/02/2008	1H0102	184_INT	R	Hydraulic	1ME645	3058	C/OUT TARP SYSTEM HOSE	SERVICE UNIT AS REQUIRED AT NYRSTAR	0	0	2305.43	0	2305.43
080409-00: SVC000083	04/09/2008	1H0102	184_INT	R	Hydraulic	1ME645	3084HRS	C/OUT REPLACE HYD HOSE	AFTER HOURS CALLOUT. TRAVELLED TO NYRSTAR, DISCONNECT TARP SYSTEM HOSE AND FABRICATE NEW HOSE FOR STEERING	280	71.69	0	8	359.69
080319-00: SVC000070	04/01/2008	1H0102	184_INT	R	Engine	1ME645	2921	Replace filters	ODOMETER: 3084HRS	280	39.8	0	28.8	348.6
080305-00: SVC000063	03/06/2008	1H0102	184_INT	R	Hydraulic	1ME645	2868	REMOVE DRIVE MOTOR	CALLOUT, TRAVEL TO NYRSTAR. FOUND OIL LEAK AT TARP CONTROL VALVE. LIFTED CAB AND REPLACED HOSE. TEST OPERATION OKAY.					
080123-00: SVC000045	02/07/2008	1H0102	122_INT	R	Sundries	1ME645		SUBLET- SERVICE AND CHECK AIR	REPLACE AIR CON AND ENGINE AIR FILTERS	22.5	0	0	0	22.5
TRAVEL TO NYRSTAR - FIT HOSE JOINER TO PRESSURE AND RETURN HOSES AND REMOVE DRIVE MOTOR FROM OBSOLETE TRAP SYSTEM. RETURN PARTS TO LAMPTON AVENE										125	21.8	0	16	162.8
080123-00: SVC000045	02/07/2008	1H0102	122_INT	R	Sundries	1ME645		SUBLET- SERVICE AND CHECK AIR		0	191.34	0	0	191.34

080207-00: SVC00004	02/07/2008	1H0102	184_INT	R	Trays/Buck	1ME645	2730	WELD CRACKS IN TAILGATE	TRAVELLED TO NYRSTAR. WELD UP CRACKS IN TAILGATE OUT-RIGGER ARMS ON HM300 DUMP TRUCK	163.75	0	0	8	171.75
080122-00: SVC00003	02/01/2008	1H0102	188_INT	R	Ancillary Ec	1ME645	2663	AIR CON NOT GETTING COLD	CHECK OVER AIR CONDITIONOR, NOT BLOWING COLD AIR, LOW ON GAS, SPECIALIST TO REGAS LOCATE LOW GAS CHARGE, DEGAS SYSTEM, REMOVE FRONT GRILL ASSEMBLY TO CLEAN CONDENSOR CORE. CECK ALL CABIN FILTERS. SERVIE AND CHECK AIRCONDITIONING SYSTEM AS REQUIRED	45	444.32	191.32	0	680.64
080124-00: SVC00004	01/24/2008	1H0102	188_INT	R	Ancillary Ec	1ME645	2457	CHECK AIR CON FILTERS	CHECK OVER AIR CONDITIONOR INTERIOR AND EXTERIOR FILTERS	22.5	0	0	0	22.5
071126-00: SVC00002	12/17/2007	1H0102	188_INT	S	Service	1ME645	2500	CARRY OUT S1 B SERVICE		0	116.4	1251.19	0	1367.59
071130-00: SVC00000	12/07/2007	1H0102	122_INT	R	Sundries	1ME645		TYRES, FITTED AT NYSTAR	M645 ODO - 2458HRS	0	330.96	0	0	330.96
071205-00: SVC00000	12/07/2007	1H0102	122_INT	R	Sundries	1ME645		TYRE REPAIRS NYSTAR POS 4	DUGGAN AND PARKER TYRE SERVICE CALL OUT TRAVEL TO NYRSTAR FIT NEW 23.5R25 VKT TO STEER ARRANGED BY MARK HAMPTON M645 ODO 2306HRS	0	198.68	0	0	198.68
071124-00: SVC00003	12/06/2007	1H0102	122_INT	R	Sundries	1ME645		TYRES @ DUGGAN & PARKER	DUGGAN AND PARKER TYRE SERVICE TRAVEL TO LA PICK CUSTOMERS OWN RUNOUT UP THEN TRAVEL TO NYRSTAR FIT TO POS:4 ARRANGED BY MARK HAMPTON M645 ODO - 2458 HRS	0	330.96	0	0	330.96
071128-00: SVC00002	12/05/2007	1H0102	188_INT	R	Engine	1ME645	2465	REPLACE AIR/CON AND ENG FILTER	DUGGAN AND PARKER TYRE SERVICE TRAVEL TO NYRSTAR FIT NEW 23.5R25 VKT TO STEER ARRANGED BY MARK - FIELD SERVICE REPLACE CAB AIR CONDITIONING AND EXTERIOR AIR CONDITIONING FILTERS, REPLACE ENGINE AIR FILTERS	22.5	278.68	0	0	301.18
071030-00: SVC00010	11/21/2007	1H0102	188_INT	R	Engine	1ME645	2261	REPLACE AIR CON AND ENG FILTER	REPLACED AIR FILTER AND AIR CONDITIONER INTERIOR / EXTERIOR AIR FILTER	45	278.68	0	0	323.68
071022-00: SVC00008	10/24/2007	1H0102	184_INT	R	Tyres	1ME645		"CALLOUT' FLAT TYRE	"CALLOUT' TRAVELLED TO NYRSTAR. ASSESS FLAT TYRE. TYRE FOUND TO BE BLOWN OUT. ARRANGE FOR BRIDGESTONE TO FIT NEW TYRE MONDAY MORNING. DRIVE TO LA WORKSHOP AND LOCATE SPARE TYRE.	560	0	0	19.2	579.2
071004-00: SVC00000	10/16/2007	1H0102	184_INT	S	Service	1ME645	2238	S1 A SERVICE	TRAVELLED TO NYSTAR. SERVICE UNIT AS REQUIRED.	210	210.62	0	8	428.62

Applied filters:Posted_Date is on or after 01/01/1900Equipment_ID is 1ME645