



DATE: Dec 08, 25

CELL#: [] -

OTHER#: [250] 789-3058

PAGE 1

W. O. NUMBER A059286

HOURLY LABOUR RATE	\$129.00	SERVICE ADVISOR	309, RYAN KOEHN
NAME:	[REDACTED] 020156		
ADDRESS:	[REDACTED]		
CITY:	[REDACTED]		
PROVINCE:	[REDACTED]		
POSTAL:	[REDACTED]		
H. & W. PHONE:	[REDACTED]		
SERIAL NUMBERS:	3JBUGAR24KK002419	DEF-HD5 DPS	8WKB

UNIT DETAILS	
BOMBARDIER	
DEF-8WKB	
HD5 DPS DEFENDER	
2019 Key:	
22135 SIDE BY SIDE	
GREEN	
GREEN	

TB
TRAILBLAZ'N
 POWER LTD
 10516 Alaska Road
 Fort St-John, British Columbia
 V1J 1B3
 T: 250.785.6675
 F: 250.785.1572
tnp@solarwinds.com

DATE IN	KM/HR IN	DATE OUT	KM/HR OUT
Oct 07, 25	0	Dec 08, 25	10,813

Sep 23, 20

APPT FOR OCT 7/25
JASON TSCHETTER: 250-719-9187

10813KMS [69H43M] ON UNIT
 CUST SAID UNIT STARTS AND RUNS FINE & CAN ALSO BE SHIFTED THROUGH ALL THE GEARS, BUT IT WONT ACTUALLY DRIVE AT ALL. IT MAY HAVE SOMETHING BROKEN INSIDE THE GEARBOX. CHECK OUT AND GIVE CUST AN ESTIMATE TO REPAIR UNIT IF IT NEEDS ANYTHING MAJOR.

**LIFTED UNIT ON HOIST. WHEELS TURN IN EVERY GEAR AT ** IDLE, BUT IF BRAKE IS HELD THEN THE WHEELS STOP, ** EVEN WITH THE THROTTLE APPLIED. COULD BE A CLUTCH ** PROBLEM.

**INSPECTED CLUTCHES: FOUND DRIVEN CLUTCH PLASTIC CAM IS ** CHEWED UP. SPRING IS TWISTED UP/DAMAGED. RAMPS ON ** INNER CLUTCH HALF ARE BADLY WORN.

**THE DRIVEN CLUTCH WAS SPINNING BUT NOT ACTUALLY ** TURNING THE GEARBOX INPUT SHAFT. CLUTCH ROLLERS HAVE ** FLAT SPOTS & RAMPS ARE WORN INTO THE SLIDING SHEAVE. ** BUSHING IS ALSO WORN BADLY.

**BOTH DRIVE CLUTCH & DRIVEN CLUTCH NEED REBUILDING. THE ** DRIVE BELT LOOKS LIKE NEW SO IT MUST HAVE BEEN ** CHANGED ALREADY BY CUSTOMER.

** PREPARED AN ESTIMATE & SENT TO JASON ON OCT 8TH
 **OCT 9TH- JASON APPROVED ESTIMATE
 **REBUILT THE DRIVE CLUTCH WITH NEW SLIDING SHEAVE
 **DRIVEN CLUTCH- REPLACED INNER AND OUTER SHEAVES AS ** WELL AS A NEW CAM AND SPRING
 **RE-INSTALLED CLUTCHES ON UNIT AND INSTALLED BELT COVER
 **TESTED & UNIT DRIVES WELL NOW

LABOR	Tech:315	3.50 hrs	\$129.00	451.50
420627586	PLATE	1.00 x	57.99	57.99
420238173	SPRING	1.00 x	63.99	63.99
417223257	ROLLER AXLE	4.00 x	8.09	32.36
417223767	ROLLER	4.00 x	14.49	57.96
420281296	SLIDER SHOE SET 1=12PCS	1.00 x	79.99	79.99

Dec 08,25

CELL# [] -

OTHER# [250] 789-3058

PAGE 2

W. O. NUMBER A059286

HOURLY LABOUR RATE \$129.00

SERVICE ADVISOR 309, RYAN KOEHN

020156

UNIT DETAILS

BOMBARDIER DEF-8WKB HD5 DPS DEFENDER 2019 Key: 22135 SIDE BY SIDE GREEN GREEN



POWER LTD 10516 Alaska Road Fort St-John, British Columbia V1J 1B3 T: 250.785.6675 F: 250.785.1572 tnp@solarwinds.com

DATE IN Oct 07,25

KM/HRS IN 0

DATE OUT Dec 08,25

KM/HRS OUT 10,813

Sep 23,20

Table with 4 columns: Part Number, Description, Quantity, Price. Lists various mechanical parts like BEARING-BALL, SLEEVE SPRING, CAM OULANDER 400, etc.

PARTS TOTAL 2,005.74

JOB TOTAL 2,457.24

^ No:00 ^

Summary table with 3 columns: Category, Amount, Total. Includes Labour, Parts, Shop Supplies, SHIPPING & HANDLE, G.S.T., Sales tax, Warranty, and TOTAL DUE.

I HEREBY DECLARE MY INDEBTEDNESS TO THE AMOUNT OF \$

2,791.94

DATE: Dec 08,25

SIGNATURE: