

Number	Type	Date Open	Date Closed	Kilometres	HoursClosed	Fuel Usage (Fault	Repairer / Notes	Cost / Invoice	
R-8964	Wipers	10/22/2025					11488 Internal Workshop - Field Service Window wiper doesn't engage at all	\$0.00	
R-8933	Grouser	10/15/2025					11444 Internal Workshop - Field Service Lose track plates	\$0.00	
R-8659	Lift RAM	06/25/2025					10664 rdw Right boom ram ram seal leak	\$0.00	
R-8571	Door seal	05/23/2025					10396 DOOR SEAL LOOSE.	\$0.00	
R-8524	REAR DOOR	05/02/2025					10250 Door to battery isolator bent and does not open properly	\$0.00	
R-8508	Radio	04/29/2025					10217 NEEDS NEW STERIO AEARIAL	\$0.00	
R-8060	Window washer	10/15/2024					9317 Internal Workshop - Field Service Washer squitter not working	\$0.00	
R-8920	Radiator cap	10/10/2025	10/10/2025	0	13,201	0	Internal Workshop - Field Service Replaced radiator cap, supplied by Brisvegas	\$0.00	
R-8858	1000 hr filter quote.	09/08/2025	09/10/2025		13,014	0	1000 HR FILTER QUOTE.	\$0.00	
R-8857	500 hr quote	09/08/2025	09/10/2025		13,014	0	500 HR KIT FILTER KIT QUOTE	\$0.00	
R-8221	Seat	01/09/2025	09/10/2025		13,014	0	10066, 10594, 9639 Internal Workshop - Field Service Removed seat and replaced with new one and came with new rails	\$0.00	
R-8149	Idler Pulley	11/22/2024	09/02/2025		13,014	0	Internal Workshop - Field Service Checked on service day when changing all belts is fine Panels need straightening	\$0.00	
S-7253	C - 1000 Hours	09/01/2025	09/02/2025	13,000	1,000	0	Grab hoses changed by hosepower	\$0.00	
R-8633	Windows	06/13/2025	07/16/2025		12,815	0	10570 MC glass Window replaced with correct one so latch lines up Not leaking slew oil its leaking hyd oil from way back when someone ran over a ripper and bent	\$0.00	
R-8577	Oil	05/29/2025	06/05/2025		12,682	0	10448 steel pipes Has been like this for years	\$0.00	
R-8574	Carrier rollers	05/27/2025	05/27/2025		12,679	0	Internal Workshop - Field Service	\$0.00	
R-8546	HYD Hose	05/16/2025	05/16/2025		12,607	0	Hosepowewr Main hyd feed hose to slew motor cracked and leaking found on service day. Got hosepower out to remove and replace Rear left door wont open properly due to operator hitting bumper and bending up. Will need boilyls to straighten up for door to work properly.	\$0.00	
							Hitch has cracks and lots of play in bushes , will need to remove grab/hitch and inspect components see what needs replacing and repairing.		
S-6911	B - 500 Hours	04/14/2025	05/16/2025	12,500	500	0	Changed bucket teeth whilst serviced	\$0.00	
R-8420	Cracks	03/19/2025	03/26/2025		12,368	0	10000 Cleaned down dipper and had brett come out to site to repair cracks	\$0.00	
R-8114	BOOM RAM	11/05/2024	03/26/2025		12,368	0	9437 Internal Workshop - Field Service Removed boom cylinder and sent to rd.'s for repair. Fitted back to machine and tested, adjusted oil level.	\$0.00	
R-8225	Welding Repair	01/07/2025	03/12/2025		12,351	0	9628 Internal Workshop - Fabrication SAFETY RAIL AT REAR CRACKED NEEDS WELDING.	\$0.00	
R-7930	Welding Repair	09/12/2024	03/12/2025		12,351	0	9093, 9375, 9715 Internal Workshop - Fabrication Railing around bonnet broken and cracked	\$0.00	
R-8391	A/c evaporator	01/09/2025	01/09/2025			0	A Grade Auto Repair Clean evaporator, replace TX valve and regas.	\$0.00	
R-8053	UHF	10/16/2024	12/03/2024		12,179	0	9297, 9316 A Grade Auto Repair A grade replaced with new under warranty	\$0.00	
R-8113	Bucket ram	11/05/2024	11/22/2024			0	Internal Workshop - Field Service Tom changed o ring on cylinder for steel pipe on service. 9439 Cleaned down and tested	\$0.00	
R-8115	TRACK MOTOR	11/04/2024	11/20/2024		12,114	0	9434 Internal Workshop - Field Service Tom removed cover plate and cleaned out inspected leak coming from steel hose. Loose fitting just tightened up all good.	\$0.00	
S-6652	C - 1000 Hours	11/13/2024	11/07/2024	0	12,000	994	0	Internal Workshop - Field Service Fan idler pulley bearing a bit stiff, may need replacing soon	\$0.00
R-7554	Quick Hitch	06/17/2024	09/20/2024		11,824	0	8407 Internal Workshop - Fabrication Removed hitch and sent to workshop for repairs. Will be coming off again for line boring and new bushed.	\$0.00	
R-7821	Grease Nipples	09/02/2024	09/11/2024		11,768	0	8966 Internal Workshop - Field Service Checked all grease nipples and replaced damaged ones.	\$0.00	
R-7794	Slew Oil	08/28/2024	08/28/2024		11,768	0	Internal Workshop - Field Service Oil leaking through centre joint into slew ring. Rd's came out with re built centre joint and swapped out. Topped up hyd oil.	\$0.00	
R-6714	Turbo Timer	10/26/2023	08/15/2024		11,644	0	Internal Workshop - Field Service Turbo timer fitted by a grade	\$0.00	
S-6357	B - 500 Hours	07/04/2024	07/12/2024	0	11,500	494	0	Internal Workshop - Field Service SERVICE REALLY DONE AT 11507HRS	\$0.00

R-7234	Grab adapter	02/28/2024	04/24/2024		11,187	0	7766	Internal Workshop - Fabrication	Removed grab from machine sent to workshop. Boilys welded broken adaptor back on. Also welded cracks on another adaptor. Added more wear blocks to grab as well. Fitted back to machine and greased.	\$0.00
R-7353	Bucket Teeth	04/05/2024	04/04/2024	0	11,115	0		Internal Workshop - Field Service	replaced bucket teeth, supplied by WPA	\$0.00
R-7281	Coolant	03/13/2024	03/13/2024		11,013	0		Internal Workshop - Field Service	Drained red coolant and filled with water. Ran machine up to temp then dumped water. Filled back up with green coolant.	\$0.00
R-7278	Belt tensioner	03/13/2024	03/13/2024		11,013	0		Internal Workshop - Field Service	On service day found belt tensioner pulley bearings have failed. Could not source new one so Bris Vegas supplied second hnd one from a machine to get us going.	\$0.00
R-7277	Quick Hitch	03/13/2024	03/13/2024		11,013	0		Internal Workshop - Field Service	Removed hitch Tounge and sent back to workshop to be welded up . Danny brought back to site and fitted to machine. They need to remember to grease machine . Pin was very dry.	\$0.00
S-6123	C - 1000 Hours	03/13/2024	03/11/2024	0	11,006	843	0			\$0.00
R-7203	Engine	02/29/2024	02/26/2024	0	10,861	0		rdw	RDW removed head and found corrosion in oil and coolant galleries to block. Replaced head. Replaced 6x injectors. Replaced water pump and thermostat. Replaced Engine oil and all engine filters changed. Replaced coolant. Invoice attached.	\$0.00
R-6805	Coolant Level Sensor	12/01/2023	12/01/2023	0	10,727	0		Internal Workshop - Field Service	replaced level sensor supplied by Brisvegas	\$0.00
R-6787	Bonnet Latch	11/17/2023	12/01/2023	0	10,727	0	7329	Internal Workshop - Field Service	replaced both bonnet latches	\$0.00
S-5862	B - 500 Hours	10/16/2023	10/16/2023	0	10,500	337	0			\$0.00
R-6911	Bucket ram	10/11/2023	10/11/2023		10,490	0		RD Willams	Replaced a bent rod and reseal ram.	\$0.00
R-6584	Seat	09/11/2023	09/21/2023	0	10,456	0	6901	Operator error with adjust seat	Seat raises and holds air , slight leak out of dump valve if you hit it but otherwise okay	\$0.00
R-6498	UHF	07/25/2023	09/01/2023	0	10,348	0	6708	A Grade Auto Repair	UHF Replaced by A Grade Auto	\$0.00
R-5077	Bucket	08/31/2022	09/01/2023	0	0	0	5270, 5868, 6168, 6821	Damaged. Check attachments for cracks & wear on bucket, rippers, & pick up pins. Go bucket cracks , sive bucket cracks Based on audit conducted by Jay on 1/9/23 this repair has been completed in the last 12 months.	\$0.00	
R-6554	Oil leak	08/29/2023	08/28/2023	0	10,321	0		Internal Workshop - Field Service	tightened hose fitting and washed down machine	\$0.00
R-6461	Cutting Edge	07/21/2023	08/28/2023	0	10,250	0		Internal Workshop - Field Service	re fit cutting edge with new bolts	\$0.00
R-6995	Electrical Fault	07/03/2023	07/13/2023		10,223	0		A Grade Auto Repair	Damaged connector on solenoid. Replaced solenoid connector.	\$0.00
R-6438	Valve sets	06/28/2023	06/28/2023		10,166	0		RD Willams	Adjusted valve and replaced tappet cover gasket.	\$0.00
R-6051	Tracks	03/24/2023	06/28/2023	0	10,166	0	6232	RD Willams	Rd's replaced all track gear. Invoice attached.	\$0.00
R-5306	Quick Hitch	10/10/2022	06/28/2023	0	10,153	0	5446, 5829	Internal Workshop - Fabrication	Cracks in quick hitch. Repaired by Craig as per attached. Other. Check attachments for cracks & wear on bucket, rippers, & pick up pins. Cracks in shaker bucket./ This machine does not have this bucket anymore.	\$0.00
R-4707	Bucket	07/13/2022	06/14/2023	0	8,753	0	4998, 5574, 5584, 563			\$0.00
R-4706	Quick Hitch	07/13/2022	05/31/2023	0		0	4999, 5618, 5648, 564	Nix Line Boring & Welding	Repairs to quick hitch and jaws. Line bore quick hitch to suit bushes provided. Rebuild line bore jaws to fit bushes. Done by Nix Line Boring & Welding	\$0.00
R-5981	A/C fan	03/06/2023	05/26/2023	0	10,153	0	6129	A Grade Auto Repair	Remove fan motor, retrieve last cut zip tie, refit and retest - OK.	\$0.00
R-4580	Hand rail	06/30/2022	05/26/2023		10,153	0	4908	Damaged. Rail come apart.		\$0.00
S-5418	C - 1000 Hours	04/12/2023	04/28/2023	0	10,163	1,037	0			\$0.00
R-5616	Windscreen	12/02/2022	03/02/2023		9,866	0	5741	Internal Workshop - Field Service	Damaged. Fly rock hit windscreen broke windscreen.	\$0.00
R-5490	Idler	11/25/2022	03/02/2023	0	9,866	0	5695, 5869, 5891, 590	RD Willams	IDLER WORN THROUGH. Invoice attached.	\$0.00
S-5163	B - 500 Hours	12/13/2022	12/16/2022	0	9,639	513	0	Internal Workshop - Field Service, Max Hayes		\$0.00
R-4939	Ripper	08/08/2022	11/30/2022	0	9,545	0	5145, 5206	Internal Workshop - Fabrication	Damaged. Check attachments for cracks & wear on bucket, rippers, & pick up pins. Ripper has crack. Craig repaired cracks in ripper.	\$0.00
R-5409	Fire extinguisher	11/14/2022	11/18/2022		9,470	0	5623			\$0.00
R-4756	Cutting Edge	07/15/2022	11/18/2022	0	9,470	0	5013	Other. Ground engaging gear: locks, pins, wear. Mud bucket due for cutting edge		\$0.00
R-5376	Quick Hitch	10/27/2022	11/07/2022		9,405	0	5535	Internal Workshop - Fabrication	DANNY WELDED RAM KNUCKLE BACK ON. WELDED CRACKS UP IN TOUNGE.	\$0.00

R-5082	Bolts	08/31/2022	11/07/2022		9,405	0	5275	Damaged. . Bolt broken , missing	\$0.00
R-5036	Quick Hitch	08/20/2022	11/07/2022	0	9,405	0	5204, 5337	Damaged. Quick hitch: safty pins & locks in place & working. Need bolt	\$0.00
R-5153	Teeth	09/14/2022	09/28/2022	0	9,191	0	5331	Not Working. Ground engaging gear: locks, pins, wear. Need new teeth for G P bucket IC - Service kit ordered on 25/8/2022, being delivered to workshop	\$0.00
								Sieve bucket has major cracks in it grab and ripper need hard facing rocker cover gasket not replaced because not leaking Rollers not replaced due to tracks being replaced soon	
S-4823	C - 1000	08/24/2022	09/16/2022	9,126	1,065	0		quick hitch tongue and quick hitch has stop in it, will monitor	\$0.00
R-4763	Fire extinguisher	07/21/2022	08/08/2022	0	8,899	0	5043	Other. Fire extinguisher charged & in date. Fire extinguisher out of date. Last done May 2022. Not Working. Quick hitch: all nippels taking grease. Grease nipple above lift point not holding	\$0.00
R-4755	Grease nipple	07/15/2022	08/08/2022	0	8,899	0	5014	grease, needs replacing	\$0.00
R-4754	Quick Hitch	07/15/2022	08/08/2022	0	8,899	0	5015	Other. Dipper: check cracks, pins, bushes & shims for wear. Needs to be re bushes and shimmed	\$0.00
R-4905	Bushes	08/01/2022	08/01/2022		8,860	0		Danny and Craig replaced dipper arm bushes and seals on quick hitch end.	\$0.00
R-4588	Bolts	06/30/2022	07/07/2022		8,719	0	4902	Other. . Bolt missing from hydraulic steel piping bracket. Max: replaced bolt	\$0.00
R-4584	Grab	06/30/2022	07/07/2022		8,719	0	4903	Damaged. . Grab needs repair Max: been repaired at work shop	\$0.00
R-4567	Bracket	06/25/2022	07/07/2022	0	8,719	0	4860, 4907	Damaged. Other : Major Concerns (Take pics) . Broken flashing light bracket Max: removed broken bracket fitted magnet beacon	\$0.00
R-4549	Grab adapter	06/23/2022	07/07/2022		8,719	0	4839	Damaged. . Grab adaptor broken Max: grab been removed and rep[aired at work shop	\$0.00
R-4519	Teeth	06/22/2022	06/30/2022		8,675	0	4824	Other. . Need new teeth for grab Max: teeth will be done when grab is removed and sent to workshop for repairs	\$0.00
R-4516	Tracks	06/23/2022	06/30/2022		8,675	0	4835	Other. . Pump up track , seems to come loose over time Max: inspected caznt find any leaks to cause loss of tension	\$0.00
R-4508	Trouser plate	06/20/2022	06/30/2022	0	8,675	0	4797	Other. Chain, sprocket and roller condition. Loose trouser plate Max: has been loose forever cant tighten anmd not coming any looser	\$0.00
R-4505	Hydraulic hose	06/17/2022	06/30/2022	0	8,675	0	4785	Other. Hydraulic hoses for leaks. Small leak in ram on quick hitch Max: inspected okay Damaged. Hydraulic hoses for leaks. Quick hitch ram has small leak Max: inspected all good to keep using.	\$0.00
R-4504	Quick Hitch	06/17/2022	06/30/2022	0	8,675	0	4782, 4904	Not Working. Other : Major Concerns (Take pics) . Machine will not start , Tom to look at soon Max:	\$0.00
R-4503	Engine	06/17/2022	06/30/2022	0	8,675	0	4781	inspected starting fine	\$0.00
R-4188	Bucket	04/20/2022	06/30/2022	0	8,675	0	4458, 4566	Damaged. Check attachments (if item failed - take photo). Sieve bucket cracks around hitch. Max: been repaired at workshop.	\$0.00
								track grouser plates getting thin and bending	
								Max completed all components of the B service, but as this service was initially created as a different type (A or C), the additional items from the B service have not updated on the electronic job card. They are visible on the printed job card, which Jay has completed on behalf of Max.	
S-4610	B - 500	06/08/2022	06/16/2022	0	8,591	530	0		\$0.00
R-4269	Pins	04/27/2022	06/10/2022	0	8,551	0	4507		\$0.00
R-4287	Windscreen	05/03/2022	05/12/2022	0	8,392	0	4513	Damaged. Check glass for damage (if damaged - take photo). Broken windscreen: windscreen replaced	\$0.00
R-4211	Bucket adaptors	04/22/2022	04/27/2022	0	8,324	0	4472	Damaged. Check attachments (if item failed - take photo). Cracked around left adapter on thumb: As per workshop meeting 12/05/2022 Jay said Danny repaired roughly two weeks ago.	\$0.00
R-4128	Grab	04/06/2022	04/27/2022	0	8,324	0	4424	Damaged. Check attachments. Grab: thin and cracked; needs building up. As per workshop meeting 12/05/2022 Jay said Danny repaired roughly two weeks ago.	\$0.00
R-3878	Hydraulic hose	02/09/2022	03/28/2022	0	8,200	0	4183, 4301		\$0.00
R-4011	Teeth	03/06/2022	03/23/2022	0	8,170	0	4309		\$0.00
R-3972	Sprockets	03/01/2022	03/23/2022	0	8,170	0	4300	Still okay to use, will monitor.	\$0.00

