



Vehicle History Summary

Fleet #	PM393
Registration	XQ14MJ
Make	Kenworth
Model	K200
VIN / Chassis #	6F5000000LA468440
Build Date	2020

Date	Reading / Units	Type / Repairer Notes	Repairer
		ENGINE OIL LEAK, FRONT MAIN SEAL R-5936	QLD WORKSHOP
09/06/2025	960,133 kms	B S-14248 B SERVICE CUSTOM AIR HRS ARE 4647 SER DUE AT 4767 HRS OIL LEAK FRONT OF ENGINE CUSTOM AIR MOTOR NEEDS REPLACING	QLD WORKSHOP
24/05/2025	949,824 kms	A S-14062 REPLACED PASSENGER SIDE STEER HUB CAP COVER WASTEGATE CIRCLIP REPLACED	QLD WORKSHOP
24/05/2025	903,211 kms	WASTEGATE ACTUATOR R-5861 REPLACED CIRCLIP ON WASTEGATE ACTUATOR, WASTEGATE ARM FELL OFF HOUSING CAUSING GATE TO STAY OPEN	QLD WORKSHOP
20/05/2025	948,545 kms	NEW STEERS T-3367 2 X NEW STEERS BRIDGESTONE R154 FITTED JOB COMPLETED THROUGH WINGMAN	DARREN BUDD'S TYRES PTY LTD
19/05/2025	947,169 kms	ROTATE DRIVES T-3347 ROTATE DRIVES SIDE TO SIDE ROTATE STEERS	QLD WORKSHOP
16/04/2025	930,011 kms	A S-13857 A SERVICE SERVICED CUSTOM AIR UNIT , NEXT DUE AT 4767 HRS SERVICED BY LEIGH AND SETH	QLD WORKSHOP
24/03/2025	914,393 kms	A S-13697 B SERVICE AND DOWNLOADED COMP	QLD WORKSHOP
10/03/2025	903,862 kms	BATTERY, WIPER BLADE R-5579 REPLACED ALL 4 BATTERIES AND WIPER BLADES	QLD WORKSHOP
03/03/2025	899,891 kms	ROTATE DRIVES, ROTATE STEER T-3150 ROTATE DRIVES DIAGONAL ROTATE STEER TYRES	QLD WORKSHOP
03/03/2025	899,891 kms	B S-13561 4140 HOURS SERVICED NOW DUE 4400 HOURS TURNTABLE ADJUSTED	QLD WORKSHOP
19/02/2025	892,227 kms	STRIP/FIT RUNOUT T-3204 1 X M866 NEW BRIDGESTONE (NOT REPAIRABLE)	DARREN BUDD'S TYRES PTY LTD
19/02/2025	890,563 kms	NOx SENSOR R-5524 INSTALLED 2ND HAND NOX SENSOR FROM XB15AO TAKEN FOR TEST DRIVE AND RAN HIGH NOX RESET, ALL WORKING CORRECTLY SENT BACK INTO SERVICE	QLD WORKSHOP
07/02/2025	884,734 kms	A S-13399 A SERVICE	QLD WORKSHOP
16/01/2025	870,020 kms	C S-13161	QLD WORKSHOP
16/01/2025	870,022 kms	WINDSCREEN R-5360	THE FIXER CORPORATION PTY LTD

Date	Reading / Units	Type / Repairer Notes	Repairer
		CALLED OUT THE FIXER GROUP TO REMOVE AND REPLACE DRIVERS SIDE WINDSCREEN ALL OK	
16/01/2025	870,022 kms	A S-13157	QLD WORKSHOP
10/01/2025	870,020 kms	Heavy Vehicle Inspection Checklist - Truck I-659	QLD WORKSHOP
18/12/2024	856,557 kms	A S-13005	QLD WORKSHOP
		CUSTOM AIR SEVICED, REMOVED AND REPLACED WATER TEMP SENDER	
27/11/2024	839,863 kms	B S-12829	QLD WORKSHOP
		CUSTOM AIR 3470HRS DUE 3660HRS	
14/11/2024	832,362 kms	OVER HEATING R-5152	QLD WORKSHOP
		inspect for heating issue, driver overfilling radiator and operating fan manually . informed the driver to let the truck computer operate the cooling system and fan operation. checked fan , came on at 99 degrees and worked fine .no fault codes recorded on insite . cleaned radiator with pressure hose and air . also checked for liner drop with radiator return line in water but no bubbles were seen.	
21/10/2024	825,574 kms	NEW DRIVE TYRES, ROTATE STEER T-2917	DARREN BUDD'S TYRES PTY LTD
		8 NEW BRIDGESTONE M866 FITTED 2 X ROTATE STEERS SIDE/SIDE POS 1,2	
21/10/2024	825,573 kms	A S-12449	QLD WORKSHOP
		ADDED 12L OF COOLANT, BUBBLE TESTED ENGINE, NO BUBBLE FOUND, CHECK NEXT SERVICE	
25/09/2024	810,571 kms	BREAK DOWN R-4995	TWIN CITY TRUCK CENTRE PTY LTD
		* Organised parts for breakdown. * Travelled from TCTC Wodonga to BP Barni at breakdown site. * Carried over check over on truck and attempted to start engine, All started fine. * No issues found with starting, No faults found testing. * Driver advised will keep driving to Melbourne workshop and get checked over or repairs if required. * Travelled back to TCTC Wodonga Workshop and returned parts. * Inspection completed.	
19/09/2024	808,980 kms	A S-12226	QLD WORKSHOP
		SERVICED ICE PACK @ 3358hrs Due @ 3660hrs NEEDS REVERSE SWITCH IN GEARBOX REPLACED SUN VIZER CLIP	
03/09/2024	801,423 kms	ALTERNATOR ON KLMS, STARTER MOTOR R-4916	QLD WORKSHOP
		DISCONNECTED BATTERIES, REPLACED ALTERNATOR WITH NEW ALTERNATOR TOOK OF PULLEY FROM OLD ALTERNATOR AND INSPECTED PULLEY FOR ANY DAMAGE AND CHECKED EVERYTHING FOR ANY DAMAGE DONE BY BRODIE. REMOVED EARTH AND POWER LEADS AND EXCITER PLUG REMOVED MOUNTING BOLTS REMOVED STARTER AND REMOVED PLUG HARNESS INSTALLED ON TO NEW STARTER REFITTED CHECKED TIGHTNESS ALL GOOD TESTED 3 TIMES ALL OPERATIONAL SENT BACK TO SERVICE, LUKE .L	
21/08/2024	793,982 kms	ROTATE DRIVES, ROTATE STEER T-2768	QLD WORKSHOP
		ROTATING TIRES DIAGONALLY ROTATED STEERS SIDE TO SIDE	
21/08/2024	793,982 kms	A S-11958	QLD WORKSHOP
		ICE PACK 3312hrs Due @ 3450hrs MONITOR GEARBOX MOUNTS	
31/07/2024	779,104 kms	B S-11750	QLD WORKSHOP
		B-SERVICE REPLACED DECK BOLT CLAMP	
12/07/2024	767,146 kms	A S-11593	QLD WORKSHOP
		A-SERVICE FITTED SECONDARY FRIDGE SOCKET REPLACED MUFFLER AFM GASKET	
18/06/2024	753,963 kms	TIMING COVER BOLTS R-4627	QLD WORKSHOP
		REMOVED AND REPLACED 3 REQUIRED FRONT TIMING COVER BOLTS, TORQUED TO SPEC OF 30FTLB , ALL OKAY.	
11/06/2024	751,245 kms	DIFF LEAK R-4593	QLD WORKSHOP
		REPLACED DIFF CENTER GASKET REMOVE DECK PLATE AND CLEAN ALL AROUND 1ST DIFF, DRAIN 1ST DRIVE AXLE DIFF OIL. INSPECTED DIFF SCREEN FOR TRACES OF THRUST WASHER, NO TRACES OF THRUST WASHER FOUND. CLEAN ALL SURFACE AREAS AND REPLACED DIFF GASKET WITH NEW. RE-INSTALLED 1ST DIFF MAKING SURE TO NOT DAMAGE GASKET. FILLED DIFF WITH OLD OIL AS IT WAS CHANGED ON THE C SERVICE 3 MONTHS PRIOR.	

Date	Reading / Units	Type / Repairer Notes	Repairer
07/06/2024	749,870 kms	R154 BRIDGESTONE, ROTATE TYRES, TURN TYRE ON RIM T-2629 2 X NEW R154 POS 1,2 4 X DRIVE ROTATE 2 X T.O.R POS 6,10	DARREN BUDD'S TYRES PTY LTD
06/06/2024		DRIVERS WINDOW R-4592 THE FIXER REPLACED DRIVERS WINDSCREEN	THE FIXER CORPORATION PTY LTD
06/06/2024	749,864 kms	A S-11287 CLUTCH ADJUSTED WINDSCREEN REPLACED DRIVERS SIDE REPLACED GUAGE LIGHTS REPLACED MONKEY LIGHTS CLEANED UP SUZI LEADS AND LIGHTS WIRING UP AS IT WAS DONE INCORECTLY THE FIRST TIME MOVED WIRES OUT OF DAYLITE DOOR VIEW TIGHTENED ALL LOOSE HOSE CLAMPS	QLD WORKSHOP
09/05/2024	732,731 kms	A S-10975 Custom air at 3150hrs, serviced next due 3450hrs Clutch adjusted 1st diff leaking oil from top of diff gasket Rocker cover gasket leaking from the back, removed cover cleaned surface and inspected the seal, bit of Boris on head cleaned and put back together Degreased The truck to see if any more leaks are present	QLD WORKSHOP
02/05/2024	728,902 kms	ebs plug R-4413 REMOVE AND REPLACED BROKEN EBS PLUG, REPLACED BLOWN FUSES TESTED, WORKING CORRECTLY SENT BACK INTO SERVICE	QLD WORKSHOP
12/04/2024	719,495 kms	DRIVERS WINDOW, PASSENGERS DOOR REMOTE R-4335 REMOVED AND REPLACED DRIVERS SIDE WINDOW FELT AS WAS WORN, CHECKED ALL OPERATIONS ALL WORKING AS REQUIRED. REMOVED AND REPLACED PASSENGERS SIDE DOOR LOCK MOTOR AS WAS U/S, ALL OKAY.	QLD WORKSHOP
12/04/2024	719,495 kms	B S-10803 B-SERVICE	QLD WORKSHOP
12/04/2024	791,495 kms	ROTATE DRIVES, ROTATE TYRES T-2432 ROTATE DRIVES DIAGONAL STEERS AS REQUIRED	DARREN BUDD'S TYRES PTY LTD
18/03/2024	706,088 kms	A S-10584 1ST DIFF IS LEAKING ICE PACK SERVICED AT 2871 NOW DUE AT 3171 HOURS ICE PACK HAS SLOW LEAK SOMEWHERE CLEANED OFF CHECK NEXT SERVICE	QLD WORKSHOP
01/03/2024	696,350 kms	AIRCON R-4159 FOUND SMALL HOLE IN A/C HOSE, HOOKED UP A/C RECOVERY SYSTEM TO CAPTURE REMANING GASSED IN SYSTEM. REMOVE WASHER BOTTLE TO GET ACCESS TO REMOVE REAR FITTING FOR COLD SIDE A/C HOSE REMOVE BOTH A/C HOSES AND RECIVER DRYER, REPLACED ALL HOSES AND RECIVER DRYER, REPLACED ALL O-RINGS WITH NEW, TOPPED UP OIL IN COMPRESSOR. VACCUMED DOWN A/C SYSTEM FOR APPROX 1HOUR. GASSED UP A/C SYSTEM AND CHECKED SYSTEM FOR LEAKS (NO LEAKS FOUND) A/C SYSTEM IN COLD AND ALL WORKING CORRECTLY	QLD WORKSHOP
20/02/2024	689,596 kms	A S-10367 A/C NEEDS ATTENTION FOUND LEAK BEFORE HIGH PRESSURE CRIMP A/C SIDE LEAK ON REAR ENGINE GASKET BEFORE GEARBOX. CLEANED REAR OF ROCKER COVER, INSPECT FOR LEAKS NEXT SERVICE	QLD WORKSHOP
07/02/2024	672,437 kms	Heavy Vehicle Inspection Checklist - Truck I-408	QLD WORKSHOP
25/01/2024	672,444 kms	ABS PLUG, AIR LINE, LIGHT PLUG R-3989 TOOK OFF DECK PLATE FROM TRUCK LOOKED FOR AIR LINES MARKED ONE THAT WAS SUPPLY AIR AND ONE THAT IS RETURN AIR THEN TOOK OFF AIR LINES FROM PUSH PULL FITTING AND THEN PULLED OUT AIR LINES TOOK OF AIR FITTING ON ONE AS THE OTHER SNAPPED, TOOK OFF EBS PLUG AND REPLACED EBS PLUG, TOOK APART LIGHT PLUG AND PUT ALL WIRES IN CORRECT SPOT ON NEW LIGHT PLUG	QLD WORKSHOP
25/01/2024	672,437 kms	A S-10160	QLD WORKSHOP
23/01/2024	672,437 kms	C S-10047 SERVICED AT 2280 HOURS NOW DUE 2580 HOURS 1ST AND 2ND DRIVE AT 6MM REQUIRED BRAKE RELINE	QLD WORKSHOP
23/01/2024	672,437 kms	BRAKE RELINE R-3983	QLD WORKSHOP

Date	Reading / Units	Type / Repairer Notes	Repairer
		REMOVED ALL TYRES ANDS RELEASED PARK BRAKE,REMOVE ALL BRAKE SHOES AND DRUMS,CHECKED ALL S-CAM TUBES AND S-CAMS FOR MOVEMENT ALL IN GOOD CONDITION, REPLACED ALL BRAKE SHOES AND DRUMS, MAKING SURE ALL SPRINGS ARE ON CORRECTLY MOUNT ALL TYRES AND TORQUED ALL WHEEL NUTS SENT BACK INTO SERVICE	
23/01/2024	672,437 kms	GEAR BOX OIL ON KLMS R-4026 Removed all gearbox oil and refilled gearbox with new oil as required. Filled to correct level all okay.	QLD WORKSHOP
19/12/2023	659,081 kms	B S-9810 B-SERVICE REPLACED DRIVER SEAT COVER REPLACED WHIPER BLADES	QLD WORKSHOP
27/11/2023	645,679 kms	A S-9603 ICE-PACK SERVICED AT 1864HRS 1ST DIFF TOP LEAKING MOVEMENT IN 1ST UNI	QLD WORKSHOP
30/10/2023	627,029 kms	A S-9386 3RD AXEL BREAKS LOW FRONT OF SUMP GASKET LEAKING SLIGHT MOVMENT IN THE 2ND UNI REPLACED LATCH CORD ON TURN TABLE	QLD WORKSHOP
07/10/2023	613,729 kms	GUSSET R-3776 REMOVED AND REPLACED GUSSIT ALL OK SENT TRUCK BACK INTO SERVICE	QLD WORKSHOP
07/10/2023	613,729 kms	A S-9167 POSSIBLE FRONT MAINLEAKING DRIVE BRAKES AT 7MM REPLACED BLOWN DASH BULBS	QLD WORKSHOP
09/09/2023	597,223 kms	B S-8850 POSSIBLE FRONT MAIN LEAKING DRIVE BRAKES AT 8MM	QLD WORKSHOP
08/09/2023	597,223 kms	PUNCTURE REPAIR, ROTATE DRIVES, ROTATE STEER T-1955 ROTATED DRIVES SIDE TO SIDE ROTATED STEERS SIDE TO SIDE PUNCTURE REPAIR	DARREN BUDD'S TYRES PTY LTD
07/09/2023	597,130 kms	STEER RUN OUT T-1965 1X STRIP AND FIT RUNOUT TO POS 9	DARREN BUDD'S TYRES PTY LTD
03/08/2023	585,982 kms	COMPRESSOR, FAN HUB R-3329 REMOVED HORTON HUB FAN AND REKITTED WITH ALL NEW PARTS AND REFITTED TO TRUCK, ALL SECURED INTO PLACE AND AR LINE FITTED AS NEEDED, REFITTED DRIVE BELT AND FAN AND STUDS, SECURED AND TESTED ALL OKAY. SPLIT POWER STEER PUMP OFF BACK OF COMPRESSOR AND REMOVED ALL COOLANT HOSES AND CHARGE LINE, REMOVED COMPRESSOR AND CLEANED ALL SURFACES ALL NEW GASKETS AND O RINGS FITTED TO COMPRESSOR FITTINGS, REFITTED NEW COMPRESSOR INTO PLACE AND REFITTED ALL COMPONENTS THAT WERE REMOVED PRIOR, NEW GOVENOR VALVE FITTED,COOLANT FILLED BACK UP AS NEEDED AND TRUCK RAN, BUILT FULL AIR, DRAINED ALL TANKS AND LET THEM BUILD UP TO FULL AIR AGAIN, CHECKED FOR LEAKS NONE PRESENT, ALL OKAY.	QLD WORKSHOP
02/08/2023	585,981 kms	A S-8617 POSSIBLE FRONT MAIN LEAKING	QLD WORKSHOP
30/06/2023	568,869 kms	A S-8361	QLD WORKSHOP
02/06/2023	551,572 kms	NEW STEERS, ROTATE DRIVES T-1764 2 X NEW BRIDGSTONE STEER TYRES FITTED UP ALL OK ROTATED DRIVES DIAGONAL	QLD WORKSHOP
02/06/2023	551,572 kms	A S-8160	QLD WORKSHOP
12/05/2023	538,375 kms	B S-7942	QLD WORKSHOP
31/03/2023	521,207 kms	A S-7649 ICE PACK SERVICED AT 1490HRS INSTALLED REVERSE BUZZER	QLD WORKSHOP
31/03/2023	521,207 kms	ICE PACK SERVICE, REVERSE BUZZER R-2980 REMOVE REVERSE ALARM, INSTALLED REVERSE BUZZER ICE PACK SERVICED AT 1490HRS	QLD WORKSHOP
27/03/2023	517,657 kms	TURBO ON KLMS R-2957	QLD WORKSHOP

Date	Reading / Units	Type / Repairer Notes	Repairer
		REMOVE TURBO AND EXHAUST MANIFOLD CLEAN ALL AREAS FOR NEW GASKETS, SPLIT TURBO FROM MANIFOLD AND CLEAN AREA INBETWEEN, REMOVE AND REPLACE ALL TURBO STUDS. MOUNT NEW TURBO TO MANIFOLD, REPALCED OLD NUTS WITH NEW AND TORQUE TO 65FT lbs, REPLACED ALL O-RINGS FOR OIL FEED LINES. REPLACED ALL MANIFOLD GASKETS, MOUNT TURBO AND MANIFOLD TO ENGINE TORQUE MANIFOLD BOLTS TO 44FT lbs. FINISHED INSTALLING ALL OTHER PIPEING FOR TUBRO, TEST RUN ALL WORKING CORRECTLY.	
27/03/2023	517,617 kms	STEER RUN OUT T-1693 1 X STEER RUN OUT FITTED TO POS # 1	DARREN BUDD'S TYRES PTY LTD
03/03/2023	507,388 kms	A S-7381	QLD WORKSHOP
10/02/2023	496,017 kms	NEW DRIVE TYRES T-1586 ALL NEW BRIDGESTONE DRIVE TYRE FITTED UP ALL OK	DARREN BUDD'S TYRES PTY LTD
08/02/2023		Heavy Vehicle Inspection Checklist - Truck I-45	
03/02/2023	492,243 kms	FLIP ON RIM, ROTATE STEER T-1560 ROTATED STEERS FLIPPED POS # 1 ON RIM	DARREN BUDD'S TYRES PTY LTD
03/02/2023	492,243 kms	A S-7098	QLD WORKSHOP
03/02/2023	492,243 kms	C S-7104 FITTED 45* FITTINGS TO AIR LINES	QLD WORKSHOP
03/01/2023	476,859 kms	B S-6874 ICE PACK SERVICED AT 1119 HOURS	QLD WORKSHOP
02/12/2022	461,236 kms	ROTATE/BALANCE STEER, ROTATE DRIVES T-1457 ROTATED ALL DRIVES DIAGONAL ROTATED STEERS SIDE TO SIDE	DARREN BUDD'S TYRES PTY LTD
02/12/2022	461,236 kms	A S-6636 REPLACED TV ANTENNA	QLD WORKSHOP
04/11/2022	445,469 kms	A S-6404	QLD WORKSHOP
04/11/2022	445,480 kms	KENWORTH RECALL R-2516 REMOVED AND REPLACE BREAK VALAVE UNDER RE-CALL FROM KENWORTH.	BROWN & HURLEY GROUP
12/10/2022	430,703 kms	A S-6233 ICE PACK DUE 1070HRS	QLD WORKSHOP
16/09/2022	416,452 kms	B S-6059 MOVEMENT IN 1ST UNI OUT OF GEARBOX	QLD WORKSHOP
16/09/2022	416,245 kms	ROTATE DRIVES, ROTATE STEER T-1285 ROTATED ALL DRIVES SIDE TO SIDE ROTATED STEERS SIDE TO SIDE FLIPPED POS # 1 ON RIM	DARREN BUDD'S TYRES PTY LTD
16/09/2022	339,377 kms	FANBELT IDLER, GUSSET R-2291 FIND ON SERVICE THAT FANBELT IDLER PLANT BOLTS LOSS REMOVED AND FOLLOWED CUMMINS INSTRUCTIONS TO TIGHTEN	QLD WORKSHOP
26/08/2022	399,377 kms	A S-5910 FIND LOSS CAPSCREWS REMOVED AND TIGHTEN AS CUMMINS INSTRUCTIONS	QLD WORKSHOP
09/08/2022	384,413 kms	A S-5791 CRACKED GUSSET P/S ABOVE GEARBOX	QLD WORKSHOP
21/07/2022	371,289 kms	A S-5651 REPLACED MISSING E CLIP	QLD WORKSHOP
01/07/2022	356,392 kms	B S-5473	QLD WORKSHOP

Date	Reading / Units	Type / Repairer Notes	Repairer
30/06/2022	356,392 kms	ROTATE/BALANCE STEER, ROTATE DRIVES T-1244 ROTATED ALL DRIVES CROSS TO CROSS ROTATED STEERS SIDE TO SIDE	DARREN BUDD'S TYRES PTY LTD
11/06/2022	342,248 kms	ROCKER COVER GASKET R-2196 REMOVED AND REPLACED ROCKER COVER GASKET ALL OK. TEST DROVE AND NO LEAKS	QLD WORKSHOP
09/06/2022	342,248 kms	BATTERY S R-2060 LOAD TEST ON BATTERY'S DURING SERVICE COME BACK AS FAIL-- REPLACE ALL 4 BATTERY'S WITH NEW	QLD WORKSHOP
09/06/2022	342,248 kms	A S-5342	QLD WORKSHOP
11/05/2022	326,673 kms	A S-5145	MELBOURNE VIC WORKSHOP
06/05/2022	324,791 kms	DUMP TYRE, R154 BRIDGESTONE T-1129 DARREN DBUD TRAVELED TO RICHLANDS TO REPLACE U/S STEER TYRES ALL OK	DARREN BUDD'S TYRES PTY LTD
19/04/2022	310,131 kms	BALANCE RINGS R-1886 FITTED UP BALANCE RINGS WITH NEW STEER TYRES	QLD WORKSHOP
19/04/2022	312,431 kms	NEW STEERS, ROTATE DRIVES T-1054 NEW BRIDGESTONE STEER TYRES FITTED UP ALL OK BALANCE RINGS FITTED UP ALL OK QLD WORKSHOP ROTATED ALL DRIVES SIDE TO SIDE	DARREN BUDD'S TYRES PTY LTD, QLD WORKSHOP
19/04/2022	312,431 kms	A S-5008 OIL LEAK COMING FROM TAPER COVER TIGHTEN HOSE CLAMP ON OIL LINE	QLD WORKSHOP
01/04/2022	297,494 kms	B S-4916 OIL LEAKING FROM TAPPER COVER REMOVER AND REPLACED HIGH BEAM LIGHT	QLD WORKSHOP
14/02/2022	280,751 kms	A S-4523 ice pack service at 470hrs tighten u bolts on steer axel	QLD WORKSHOP
31/01/2022	250,231 kms	BALANCE STEERS T-957 ROTATED AND BALANCED STEER TYRES FLIPPED POS 1 ON RIM	DARREN BUDD'S TYRES PTY LTD
28/01/2022	268,471 kms	A S-4433 FOUND MISSING BOLT ON FRONT COVER CAUSING OIL LEAK DOWN D/S OF ENGINE	QLD WORKSHOP
04/01/2022	250,231 kms	ROTATE/BALANCE STEER, ROTATE DRIVES T-856 rotated and balanced steers rotated drives cross to cross	TREADCARE PTY LTD
04/01/2022	250,231 kms	C S-4158	MELBOURNE VIC WORKSHOP
04/01/2022	250,231 kms	A S-4157	MELBOURNE VIC WORKSHOP
06/12/2021	236,314 kms	B S-4033 REPLACED WHIPER BLADES	MELBOURNE VIC WORKSHOP
22/11/2021	224,974 kms	ROTATE DRIVES T-787 rotated drives side to side dave workshop	MELBOURNE VIC WORKSHOP
22/11/2021	224,974 kms	A S-3948	MELBOURNE VIC WORKSHOP
03/11/2021	210,930 kms	A S-3767	QLD WORKSHOP
17/10/2021	195,613 kms	A S-3620 r/h cab ram leaking	MELBOURNE VIC WORKSHOP
17/10/2021	195,613 kms	ROTATE/BALANCE STEER T-702 steers rotated and balanced - treadcare	TREADCARE PTY LTD

Date	Reading / Units	Type / Repairer Notes	Repairer
27/09/2021	179,767 kms	ROTATE/BALANCE STEER, ROTATE DRIVES T-664 Rotate drive tires diagonal done by srv workshop	QLD WORKSHOP
27/09/2021	179,767 kms	B S-3446	QLD WORKSHOP
01/09/2021	164,784 kms	A S-3292	MELBOURNE VIC WORKSHOP
09/08/2021	147,640 kms	A S-3143	MELBOURNE VIC WORKSHOP
19/07/2021	130,782 kms	BALANCE STEERS, NEW STEERS T-536 replaced steer tyres	TREADCARE PTY LTD
19/07/2021	130,782 kms	A S-2946	MELBOURNE VIC WORKSHOP
01/07/2021	118,900 kms	ESOC FITTINGS R-848 fitted esoc fittings to truck	MELBOURNE VIC WORKSHOP
01/07/2021	118,900 kms	B S-2790	MELBOURNE VIC WORKSHOP
10/06/2021	104,256 kms	A S-2643 + Engine Tune completed + Tyre Rotation done	QLD WORKSHOP
10/06/2021	104,256 kms	ROTATE/BALANCE STEER, ROTATE DRIVES T-436 ROTATED ALL DRIVES FRONT TO BACK FLIPED POS # 1 ON RIM BALANCED BOTH STEER TYRES	DARREN BUDD'S TYRES PTY LTD
28/05/2021	99,568 kms	WINDSCREEN R-735 REPLACE WINDSCREEN	
21/05/2021	92,290 kms	A S-2511 kilometres are wrong in gearbox driver advises due now	QLD WORKSHOP
29/04/2021	75,624 kms	A S-2199	QLD WORKSHOP
28/03/2021	59,508 kms	B S-2052	MELBOURNE VIC WORKSHOP
11/03/2021	44,508 kms	ROTATE STEER T-240 ROTATED AND BALANCED STEER TYRES ROTATED ALL DRIVE TYRES	
10/03/2021	44,508 kms	A S-1759	QLD WORKSHOP
08/03/2021	40,988 kms	ELECTRICAL PLUG R-425 REMOVED AND REPLACED ELECTRICAL PLUG AND TEST ALL OK	QLD WORKSHOP
09/02/2021	28,489 kms	A S-1515	QLD WORKSHOP
31/12/2020		FIRST SERVICE R-215 REPLACED BOTH DIFF OILS AND FIRST DIFF FILTER	BROWN & HURLEY GROUP, QLD WORKSHOP
01/12/2020		C S-1706	

Signed: _____

Name: _____

Date: _____