



## Vehicle History Summary

Fleet #	PM389
Registration	XQ87MI
Make	Kenworth
Model	K200
VIN / Chassis #	6F5000000LA467768
Build Date	2020

Date	Reading / Units	Type / Repairer Notes	Repairer
		<b>B S-14435</b>	QLD WORKSHOP
		<b>ROTATE DRIVES, ROTATE STEER T-3424</b>	QLD WORKSHOP
		<b>A S-14354</b>	
04/06/2025	1,093,961 kms	<b>HORTON FAN R-5874</b>	QLD WORKSHOP
04/06/2025	1,093,961 kms	<b>A S-14208</b>	QLD WORKSHOP
13/05/2025	1,058,840 kms	<b>A S-14019</b> CUSTOM AIR SYSTEM @3706HRS NEXT DUE @3830HRS BATTERY'S LOAD TESTED AND GOOD NEW HORTON FAN SOLENOID AIR FITTING SUMP LEAKING OIL	QLD WORKSHOP
05/05/2025	1,052,061 kms	<b>DOOR MODULE R-5999</b> REPLACE DOOR MODULE AND PLUG	WARREGO TRANSPORT REPAIRS
16/04/2025	1,041,012 kms	<b>ROTATE DRIVES, ROTATE STEER T-3287</b> ROTATE DRIVES SIDE TO SIDE	QLD WORKSHOP
16/04/2025	1,043,939 kms	<b>B S-13847</b> B SERICE	QLD WORKSHOP
04/04/2025	1,032,508 kms	<b>NEW STEERS T-3277</b> 2 X NEW R154 STEERS FITTED	TREADCARE PTY LTD
25/03/2025	1,029,330 kms	<b>A S-13686</b> CUSTOM AIR 3660HRS DUE 3830HRS BOTH CAB SHOCKS LEAKING, FRONT OF SUMP LEAKING, CHECKED SUMP BOLTS, ALL TIGHT	QLD WORKSHOP
27/02/2025	1,014,294 kms	<b>A S-13550</b> A SERVICE CUSTOM AIR HRS ,3575 NEXT DUE AT 3830 HRS	QLD WORKSHOP
11/02/2025	1,002,828 kms	<b>NOx SENSOR R-5491</b> FOUND FAULTY NOX SENSOR CAUSING CODE 1887, REPLACED NOX SENSOR AND TOOK TRUCK FOR HIGH NOX RESET, CLEARED ALL ACTIVE ECM CODES, ALL OKAY.	QLD WORKSHOP
05/02/2025	999,136 kms	<b>A S-13332</b> A-SERVICE REPLACED 1ST AXLE P/S TORQUE ROD BUSHES SERVICED CUSTOM AIR SYSTEMS AT 3530HRS	QLD WORKSHOP
05/02/2025	999,136 kms	<b>ROTATE DRIVES, ROTATE STEER T-3131</b> DRIVES ROTATED DIAGONAL STEERS ROTATED SIDE/SIDE	DARREN BUDD'S TYRES PTY LTD
08/01/2025	982,355 kms	<b>DRIVERS SEAT, GUSSET R-5132</b> REMOVED AND REPLACED BROKEN GUSSET ALL OK SENT BACK INTO SERVICE	QLD WORKSHOP
08/01/2025	982,355 kms	<b>B S-13091</b>	QLD WORKSHOP

Date	Reading / Units	Type / Repairer Notes	Repairer
		B SERVICE	
18/12/2024	969,886 kms	<b>A S-12989</b>  CUSTOM AIR 3403HRS DUE 3530HRS, 2ND DIFF INPUT SEAL FLUFFY, REAR SUMP LEAKING, REPLACED MISSING BOLT AND CLEANED AREA, BOTH CAB SHOCKS HAD BEEN LEAKING	QLD WORKSHOP
19/11/2024	952,495 kms	<b>ROTATE DRIVES, ROTATE STEER T-2978</b>  ROTATE CARRIED OUT BY QLD WORKSHOP	QLD WORKSHOP
19/11/2024	952,495 kms	<b>A S-12716</b>  A-SERVICE CUSTOM AIR SERVICED AT 3280HRS D-S TOP GUSSET CRACKED	QLD WORKSHOP
26/10/2024	939,172 kms	<b>A S-12482</b>  BOTH CAB SHOCKS LEAKING, MOVEMENT IN 1ST UNI, D/S TOP GUSSET CRACKED	QLD WORKSHOP
03/10/2024	923,070 kms	<b>B S-12336</b>  B-SERVICE REPLACED BLIND SPOT MIRROR	QLD WORKSHOP
27/08/2024	904,493 kms	<b>DIFF RESEAL R-4897</b>  DE-GREASED AND GURNIED DOWN DIFFS, REMOVED 1ST DIFF DRIVE AXLES. REMOVED FRONT SECTION OF DIFF. SCRAPED OFF OLD DIFF HOUSING GASKETS AND FINAL CLEAN WITH WIZZER WHEEL TO MAKE SURE ALL EXISTING GASKET WAS REMOVED. FIT NEW DIFF HOUSING GASKET AND INSTALL FRONT SETION OF DIFF MAKING SURE THE GASKET WASN'T TORN WHILE INSTALLING. CLEAN UP OLD DRIVE AXLE GASKETS AND REPLACED WITH NEW, FILL DIFF TO CORRECT LEVELS.	QLD WORKSHOP
27/08/2024	904,493 kms	<b>Heavy Vehicle Inspection Checklist - Truck I-551</b>	QLD WORKSHOP
26/08/2024	904,493 kms	<b>C S-11832</b>  C-SERVICE DIFF RESEAL	QLD WORKSHOP
09/08/2024	894,357 kms	<b>ICE PACK ALTERNATOR R-4835</b>  REMOVED AND REPLACED ALTERNATOR AS REQUIRED, TENSIONER BELTS AS NEEDED AND CHECKED CHARGE RATE 14.0 VOLTS, ALL OKAY	QLD WORKSHOP
09/08/2024	894,357 kms	<b>A S-11833</b>  REPLACED CUSTOM AIR ALTERNATOR AS WASNT CHARGING 1ST CENTRE GASKET LEAKING TORQUED ROD BUSHES WORN	QLD WORKSHOP
02/08/2024	888,855 kms	<b>DRIVE RUN OUTS T-2750</b>  8 X DRIVES SWAPPED OFF XQ09JT 2 X T.O.R POS 5,6	DARREN BUDD'S TYRES PTY LTD
15/07/2024	879,546 kms	<b>A S-11598</b>  A-SERVICE CAB SHOCKS LEAKING FRONT DIFF LEAKING	QLD WORKSHOP
03/07/2024	870,965 kms	<b>GOVERNOR VALVE R-4704</b>  REMOVED AND REPLACED GOVERNOR VALVE AS NEEDD	QLD WORKSHOP
21/06/2024	863,004 kms	<b>ALTERNATOR ON KLMS, STARTER MOTOR R-4623</b>  REPLACED STARTER MOTOR AS IT WAS DUE ON KLMS, DISCONNECTED BATTERY, REMOVED STARTER MOTOR, PLACED NEW ON IN REPLACED ALTERNATOR AS IT WAS DUE ON KLMS, REMOVED LEADS OFF ALTERNATOR, REMOVED AND REFITTED NEW ALTERNATOR, RECONNECTED BATTERY AND LEADS, ALL WERE GOOD	QLD WORKSHOP
21/06/2024	863,004 kms	<b>B S-11384</b>  STRAIGHTENED STEERING WHEEL REPLACED STARTER AND ALTERNATOR, SEE REPAIR SERVICED CUSTOM AIR 1ST DIFF CENTER LEAK BOTH CAB SHOCKS BLOWN SEALS OUT	QLD WORKSHOP
21/06/2024	863,004 kms	<b>NEW STEERS, ROTATE DRIVES T-2555</b>  ROTATE DRIVES SIDE/SIDE 2 X NEW STEER TYRES R154 POS 1,2	DARREN BUDD'S TYRES PTY LTD
31/05/2024	849,423 kms	<b>A S-11172</b>  ICEPAK AT 2823HRS DUE AT 2880HRS	QLD WORKSHOP

Date	Reading / Units	Type / Repairer Notes	Repairer
09/05/2024	834,284 kms	<b>STEER RUN OUT</b> T-2564 STRIP/FIT RUNOUT TO POS 2	DARREN BUDD'S TYRES PTY LTD
07/05/2024	832,372 kms	<b>A S-10990</b> 1ST DRIVE DIFF CENTRE LEAKING HEAVILY, LEAKING FROM CENTRE GASKET NEEDS TO BE REPAIRED. BOTH CAB SHOCKS LEAKING NEW WIPER BLADES FITTED AS NEEDED	QLD WORKSHOP
01/05/2024	828,481 kms	<b>ICE PACK NOT RUNNING</b> R-4410 FOUND ALTERNATOR POWER WIRE SNAPPED RECRIMPED AND CONNECTED STIIL NOT WORKING TESTED FOR POWER NOTHING, FOUND 200AMP MAIN FUSE BLOWN REPLACED AND STARTED ALL WORKING SENT BACK TO SERVICE.	QLD WORKSHOP
12/04/2024	817,173 kms	<b>LIGHT PLUG</b> R-4337 REMOVED AND REPLACED LIGHT PLUG	QLD WORKSHOP
12/04/2024	817,183 kms	<b>A S-10789</b> A-SERVICE CLUTCH ADJUSTED REPLACED LIGHT PLUG	QLD WORKSHOP
04/04/2024	811,557 kms	<b>STRIP/FIT RUNOUT</b> T-2488 STRIP\FIT RUNOUT POS 7	DARREN BUDD'S TYRES PTY LTD
02/04/2024	809,784 kms	<b>BATTERY</b> S R-4278 LOAD TESTED ALL BATTERIES 2 COME BACK AND REPLACE , REMOVED AND REPLACE ALL 4 BATTERIES TEST ALL OK CHARGING AT 12.8V	QLD WORKSHOP
13/03/2024	802,193 kms	<b>B S-10558</b> B-SERVICE ICE PACK SERVICED AT 2560 HRS REPLACED FUEL PRO COLLAR D/S AIRTANK FRONT SECTION FULL OF WATER REMOVED FITTING AND DRAINED. KING PINS HAS PLAY	QLD WORKSHOP
07/03/2024	796,519 kms	<b>NOT REIVING PAST 1500RPM</b> R-4192 REMOVED SPEED SENSORS AND CHECKED FOR DAMAGE, NO DAMAGE FOUND INSPECTED LOOM FOR RUBBED OR BROKEN WIRE, NO DAMAGE FOUND. INSPECTED ALL PINS AND PLUGS, NO DAMAGE FOUND PINNED OUT FROM ECU PLUG TO SENSOR NO BROKEN WIRES FOUND. REMOVED AND REPLACED WHEEL SPEED/ GEARBOX SENSOR HARNESS TEST DIRVE, PASSED TEST CLEARED ALL CODES AND TRUCK WILL NOW DRIVE CORRECTLY SENT BACK INTO SERVICE	QLD WORKSHOP
21/02/2024	785,035 kms	<b>A S-10362</b> TOP OF FIRST DIFF HAS LEAK CHANGED TIMING BOLTS AS OLD ONES WERE TOO SHORT CHANGED AIR DYRER	QLD WORKSHOP
21/02/2024	785,038 kms	<b>ROTATE DRIVES</b> T-2279 ROTATED DRIVES DIAGONAL ONLY	DARREN BUDD'S TYRES PTY LTD
21/02/2024	785,035 kms	<b>AIR DRYER , TIMING COVER BOLTS</b> R-4118 REPLACED 3X TIMING COVER BOLTS WITH LONGER BOLTS, REPLACED AIR DRYER UINT AS OLD ONE HAD WATER IN IT AND SOMETING STUCK IN IT, TOOK OFF OLD AIR DRYER AND TOOK ALL AIR FITTINGS OFF WITH MARKS WHERE AIR FITTINGS WERE POINTING, PUT NEW AIR DRYER UNIT ON AND PUT ALL AIR FITTINGS TO CORRECT PLACES AND TIGHTENED UP AND THEN PUT NEW SILENCER ON AIR DRYER AND THEN TESTED TO SEE IF ITLL PURGE AND THEN SENT BACK INTO SERVICE	QLD WORKSHOP
31/01/2024	770,306 kms	<b>A S-10116</b> CAB SHOCK LEAKING DRIVER SIDE IS THE WORSE FUEL PUMP HAS LITTLE LEAK	QLD WORKSHOP
10/01/2024	757,284 kms	<b>A/C BLOWER FAN</b> R-3760 REMOVED AND REPLACED BLOWER FAN MOTOR AS REQUIRED, TESTED ALL OKAY.	QLD WORKSHOP
10/01/2024	757,284 kms	<b>A S-9948</b> ICE PACK SERVICED AT 2232 HOURS NOW DUE 2532 HOURS	QLD WORKSHOP
08/01/2024	757,284 kms	<b>PASSENGER WINDOW</b> R-3876 CALLED IN THE FIXER GROUP TO REMOVE AND REPLACE PASENGER SIDE WINDSCREEN ALL OK	THE FIXER CORPORATION PTY LTD
15/12/2023	740,114 kms	<b>FUEL PRO COLLAR, STEER SHOCKS, WIPER BLADE</b> R-3825	QLD WORKSHOP

Date	Reading / Units	Type / Repairer Notes	Repairer
		REMOVED FUEL PRO COLLAR WHILE DOING B-SERVICE AND FOUND FUEL PRO COLLAR TO BE WARPED, REPLACED WITH NEW REMOVED AND REPLACED WIPER BLADES REMOVE AND REPLACED BOTH STEER SHOCKS PARTS BOOKED TO SERVICE	
13/12/2023	740,112 kms	<b>B S-9737</b>	QLD WORKSHOP
		SLIGHT PLAY IN KING PINS MOVEMENT IN 1ST UNI, FUEL PUMP WEEP FROM REAR ICE-PACK HRS CURRENTLY 2108HRS DUE 2180HRS REPLACED LEAKING BOOS PIPE O-RING	
20/11/2023	723,263 kms	<b>A S-9516</b>	QLD WORKSHOP
		1992 HOURS DUE AT 2180 HOURS REPLACED MISSING HUB CAP COVER	
02/11/2023	711,906 kms	<b>BALANCE RINGS, HUB COVER, STEER WHEEL BEARINGS R-3704</b>	QLD WORKSHOP
		UPON INSPECTION, ALL KINGPINS, STEERING COMPONENTS WERE GOOD REMOVED THE HUB INSPECTION COVERS OFF DRIVERS AND PASSENGER SIDE HUBS NOTICED THERE WAS BURNT GREASE IN THE PASSENGER SIDE HUB, REMOVED NUTS SPACER AND WASHER TO REVEAL THE BEARING REALISED THE BEARING WAS PITTED AND WARPED PULLED THE BEARINGS OUT, SMACKED THE RACES OUT AND REMOVED ALL GREASE PLACED NEW RACES IN PASSENGER SIDE AND DRIVERS SIDE, EATED THEM, FILLED THE HUBS WITH GREASE, PACKED THE BEARINGS WITH GREASE AND PUT THE NEW HUB SEAL IN PLACED HUBS ONTO THE SPINDLES AND ADJUSTED THE BEARINGS, CHECKED FOR PLAY AND MOVMENT ALL GOOD PLACED THE HUB COVERS ON, BREAK DRUMS ON, BALANCE RINGS AND TYRES ON, TORQUED THE TYRES REPLACED THE PASSENGER SIDE HUB COVER AS IT WAS WARPED TRUCK GOOD SENT BACK INTO SERVICE FITTED BALANCE RINGS TO STEER AXLE JACK PASSENGER SIDE BRODIE DRIVERS SIDE	
27/10/2023	708,131 kms	<b>ROTATE DRIVES, ROTATE STEER T-2056</b>	QLD WORKSHOP
		ROTATED STEERS SIDE TO SIDE ROTATED DRIVES SIDE TO SIDE AS REQUIRED.	
27/10/2023	708,131 kms	<b>ADBLUE LEAK R-3687</b>	QLD WORKSHOP
		REMOVED AND REPLACED AFM GASKET AFTER AD-BLUE INJECTOR (PARTS BOOKED TO SERVICE)	
27/10/2023	708,131 kms	<b>A S-9358</b>	QLD WORKSHOP
		ICE-PACK SERVICED AT 1880HRS	
09/10/2023	693,053 kms	<b>A S-9211</b>	QLD WORKSHOP
		HEADLIGHTS ADJUSTED AS REQUIRED	
09/10/2023	693,053 kms	<b>UNLOADER VALVE R-3616</b>	QLD WORKSHOP
		REMOVED AIR FEED LINE, REMOVED 2 BOLTS AND CAP AND HOUSING, REMOVED AND FITTED 3 NEW O-RINGS TO CAP, FITTED NEW VALVE AND O-RING REINSTALLED TIGHTENED, TESTED WORKING AS REQUIRED SENT BACK TO WORK.	
06/10/2023	690,124 kms	<b>DOSER PUMP R-3607</b>	MELBOURNE VIC WORKSHOP
		REMOVED ALL LINES AND FLUSHED FLUSHED OUT PUMP WITH DOSER PUMP CLICK TEST TRIED DOING OVER RIDE TEST BUT COULDNT DUE TO ACTIVE FAULTS.. PUMP HAS BEEN GETTING FLUSHED OUT TWICE A WEEK. REPLACED PUMP AND PRIMED ALL CODES WENT INACTIVE, CLEARD AND DONE OVER RIDE TEST ALL OK WHILE TESTING DOSER PUMP NOTICED UNLOADER VALVE BLOWING OFF FOR AGES AND WATER DRIPPING OUT OF IT, UNLOADER VALVE IS STICKY AND RECOMMEND REPLACING TO AVOID A BREAK DOWN - I DONT HAVE 1 INSTOCK OR HAVE TIME	
28/09/2023	647,457 kms	<b>REVERSE BUZZER R-3569</b>	QLD WORKSHOP
		REMOVED NON-OPERATIONAL REVERSE BEEPER FITTED NEW REVERSE SQUAWKER MOUNTED IN ORIGINAL POSITION TESTED OPERATION WIRED IN CORRECTLY RETESTED IN WORKING ORDER AND SENT BACK IN TO SERVICE	
27/09/2023	685,710 kms	<b>FRIDGE R-3557</b>	QLD WORKSHOP
		REMOVED BED AND FLAT PLATE FOUND SECONDARY FRIDGE PLUG REMOVED FACTORY PLUG, FED WIRES THROUGH FITTED NEW CIGARETTE SOCKET COVERED WIRES IN CORRUGATED TUBING REPLACED BED BASE AND MATTRESS TESTED FOR POWER ALL GOOD, READY FOR SERVICE	
15/09/2023	678,177 kms	<b>B S-9001</b>	QLD WORKSHOP
		CARRIED OUT B-SERVICE REPLACED FUEL PRO COLLAR REPLACED WHIPER BLADES	
01/09/2023	668,710 kms	<b>GEAR BOX OIL AND FILTER ON KLMS R-3427</b>	QLD WORKSHOP
		DRAINED AND REFILLED GEARBOX OIL AND REPLACED FILTER AS REQUIRED.	
01/09/2023	668,710 kms	<b>NEW STEERS, ROTATE DRIVES T-1906</b>	QLD WORKSHOP

Date	Reading / Units	Type / Repairer Notes	Repairer
		FITTED 2 X BRIDGESTONE STEER TYRES ROTATED DRIVES DIAGONAL	
01/09/2023	668,710 kms	<b>Heavy Vehicle Inspection Checklist - Truck I-330</b>	
01/09/2023	668,710 kms	<b>C S-8881</b>	QLD WORKSHOP
26/08/2023	664,800 kms	<b>A S-8792</b>	QLD WORKSHOP
08/08/2023	649,767 kms	<b>A S-8680</b>	QLD WORKSHOP
21/07/2023	636,900 kms	<b>A S-8515</b>	QLD WORKSHOP
		ICEPACK SERVICED AT 1580HRS	
04/07/2023	622,522 kms	<b>TORQUE ROD BOLTS R-3246</b> found spacers sitting in chassis rail, fitted new bolts to left hand rear torque rod of front diff	MELBOURNE VIC WORKSHOP
26/06/2023	620,672 kms	<b>B S-8298</b> REPLACED 7PIN TRAILER PLUG REPLACED TORQUE ROD BUSHES 1ST AXLE P/S BACK OF FUEL PUMP WEeping MOVEMENT IN 1ST UNI JOIN	QLD WORKSHOP
19/06/2023	620,672 kms	<b>REKIT HORTON FAN HUB, REPLACE COMP ON KLMS, TORQUE ROD BUSHES, TRAILER PLUG R-3209</b>  REMOVED AND REPLACED 2X TORQUE ROD BUSHES 1ST AXLE P/S REPLACED 7PIN MALE LIGHT PLUG REMOVED AND REKITTED HORTON HUB FAN, ALL SECURED INTO PLACED WITH ALL MOUNTING BOLTS AIR LINE REFITTED WITH FAN,STUDS AND MOUNTING HARDWARE. TESTED ALL OKAY. REMOVED CHARGE LINE, VACCUM HOSE AND COOLANT HOSES FROM COMPRESSOR, SPLIT POWER STEER PUMP OFF BACK OF COMPRESSOR AND MOVED OUT OF WAY TO GAIN FURTHER ACCESS, REMOVED REAR COMPRESSOR MOUNTING PLATE AS WELL AS FRONT MOUNTING BOLTS,REMOVED COMPRESSOR AND CHANGED OVER ALL NECESSARY FITTING WITH NEW O RINGS. CLEANED UP MOUNTING SURFACE AT REAR OF TIMING COVER AND CLEANED POWER STEER PUMP ON GASKET,NEW COMPRESSOR FITTED WITH NEW GASKET AND SECURED INTO PLACE, POWER STEER PUMP REFITTED WITH NEW GASKET AND SECURED, ALL COOLANT,VACCUM AND CHARGE LINES FITTED BACK INTO PLACE, NEW GOVENER FITTED TO COMPRESSOR ALL LINES SECURED,FILLED TRUCK BACK UP WITH COOLANT AND RAN COOLANT LEVEL GOOD.	QLD WORKSHOP
30/05/2023	603,705 kms	<b>A S-8129</b>	MELBOURNE VIC WORKSHOP
29/05/2023	603,705 kms	<b>NEW DRIVE TYRES, ROTATE/BALANCE STEER T-1758</b> rotated and balance steers fitted new drive tyres	TREADCARE PTY LTD
16/05/2023	591,132 kms	<b>BRAKE RELINE R-3102</b> REMOVED BRAKE SHOES AND DRUMS, NEW BRAKE SHOES, HARDWARE AND DRUMS FITTED REFITTED WHEELS AND TORQUED ALL WHEEL NUTS, ADJUSTED BRAKES.	QLD WORKSHOP
13/05/2023		<b>SIDE MARKER LIGHT R-3093</b> REMOVED AND REPLACED MARKER LIGHT INSULATED WIRING AND SECURED ALL OKAY	QLD WORKSHOP
10/05/2023	592,156 kms	<b>A S-7951</b>	QLD WORKSHOP
13/04/2023	574,538 kms	<b>TURN TABLE JAWS R-3021</b> REMOVE TURNABLE FROM TRUCK AND FULLY INSPECT ALL PARTS OF UNIT. DISSASSEMBLE UNIT AND REPAIR MAIN BODY OF TURN TABLE WHERE PIN HAS DAMAGED. RE INSTALL NEW WEARING RING AND JAW, SPRING AND PIVOT PIN. ADJUST JAWS AND CHECK TO SEE IFF ALL WORKING CORRECTLEY, ALL PASS. REINSTALL TO TRUCK REPLACING 2 OF THE BOLTS TO CLAMP TURNABLE TO FEET ON TRUCK.	QLD WORKSHOP
06/04/2023	574,537 kms	<b>A S-7735</b>	QLD WORKSHOP
24/03/2023	563,327 kms	<b>ICE PACK, REVERSE BUZZER R-2956</b>	QLD WORKSHOP
06/03/2023	559,339 kms 72,065 hrs	<b>ENGINE REBUILD, TURBO ON KLMS R-2901</b>	CUMMINS SOUTH PACIFIC PTY LTD

Date	Reading / Units	Type / Repairer Notes	Repairer
		CUMMINS INSPECTED ENGINE, FOUND BYPASSING WATER THROUGH CYLINDER 5, REMOVED AND REPLACED ALL LINERS AND PISTON RINGS, INSPECTED ALL PARTS ALL COME BACK GOOD TO GO BACK INTO SERVICE. REFITTED ALL PARTS AND DYNO RUN UP, ALL OK. TRUCK SENT BACK INTO SERVICE. TURBO WAS ALSO REPLACED ON KLMS. ALL COVERED UNDER WARRANTY	
06/03/2023	559,295 kms	<b>B S-7398</b>  TRUCK HAS DROPPED LINNER WILL GO TO CUMMINS AFTER SERVICE	QLD WORKSHOP
03/03/2023	559,295 kms	<b>ROTATE/BALANCE STEER, ROTATE DRIVES</b> T-1631  ROTATED ALL DRIVES DIAGONAL ROTATED STEERS SIDE TO SIDE AND BALANCED	DARREN BUDD'S TYRES PTY LTD
03/02/2023	538,691 kms	<b>A S-7134</b>	QLD WORKSHOP
09/01/2023	521,361 kms	<b>A S-6927</b>	QLD WORKSHOP
15/12/2022	509,019 kms	<b>A S-6780</b>	QLD WORKSHOP
23/11/2022	496,080 kms	<b>ADBLUE FAULT</b> R-2589  PLUGGED COMPUTER IN FOUND CODE RETURN LINE BLOCKED FLUSHED ADBLUE PUMP AND ALL LINES FROM TANK TO INJECTOR WENT FOR TEST DRIVE CODE DIDNT CLEAR. FOUND ADBLUE FILTER MISSED ON C-SERVICE, REPLACED ADBLUE FILTER AND FOUND THAT IT WAS CASUING TO SYSTEM TO BE RESTRICTED JUST ENOUGH TO CAUSE ADBLUE FAULT	QLD WORKSHOP
11/11/2022	488,126 kms	<b>B S-6459</b>  REPLACED FUEL PRO COLLAR	QLD WORKSHOP
12/10/2022	467,734 kms	<b>ROTATE DRIVES, ROTATE STEER</b> T-1349  ROTATE ALL STEERS SIDE TO SIDE ROTATE STEERS SIDE TO SIDE	QLD WORKSHOP
12/10/2022	467,734 kms	<b>A S-6234</b>	QLD WORKSHOP
06/09/2022		<b>Heavy Vehicle Inspection Checklist - Truck</b> I-134	
06/09/2022	448,542 kms	<b>C S-6022</b>	QLD WORKSHOP
06/09/2022	448,542 kms	<b>A S-6023</b>	QLD WORKSHOP
17/08/2022	431,629 kms	<b>NEW STEERS</b> T-1347  fitted new steer tyres	TREADCARE PTY LTD
11/08/2022	434,250 kms	<b>B S-5829</b>	MELBOURNE VIC WORKSHOP
25/07/2022	423,080 kms	<b>AIR HORN</b> R-2243  Have removed the broken L/H roof air horn and refitted a brand new air horn with stable mounts	MELBOURNE VIC WORKSHOP
20/07/2022	419,450 kms	<b>ROTATE/BALANCE STEER, ROTATE DRIVES</b> T-1242  rotated drives cross to cross rotated and balanced steer tyres	TREADCARE PTY LTD
20/07/2022	419,450 kms	<b>A S-5662</b>	MELBOURNE VIC WORKSHOP
30/06/2022	405,184 kms	<b>A S-5512</b>	QLD WORKSHOP
09/06/2022	392,762 kms	<b>A S-5362</b>  REPLACED BOTH WHIPPER BLADES	MELBOURNE VIC WORKSHOP
21/05/2022	379,045 kms	<b>cummins campaign</b> R-2004  re-torque backwound ide plant	CUMMINS SOUTH PACIFIC PTY LTD
18/05/2022	377,385 kms	<b>INTAKE BRACKET, MARKER LIGHTS</b> R-1985  Replaced 2x marker light r/H Straighten left intake	MELBOURNE VIC WORKSHOP
14/05/2022	375,479 kms	<b>B S-5149</b>	QLD WORKSHOP

Date	Reading / Units	Type / Repairer Notes	Repairer
05/04/2022	358,000 kms	<b>A S-4934</b> SERVICED ICE PACK @ 1204HRS	MELBOURNE VIC WORKSHOP
30/03/2022	356,659 kms	<b>ebs plug, INDICATOR LIGHT</b> R-1821 fitted new ebs plug l/h indicator wire ripped out refitted wire to plug incident report done by rory report number 00644	MELBOURNE VIC WORKSHOP
08/03/2022	342,798 kms	<b>A S-4716</b> REPALCED ALL BATTERY'S MOVEMENT IN 1ST,2ND UNI JOINTS	QLD WORKSHOP
08/03/2022	342,798 kms	<b>BATTERY'S, CHECK BATTERIES</b> R-1709 LOAD TEST BATTERY'S ALL FAILED REMOVE AND REAPLCE ALL BATTERY'S CHECK ALTERNATOR CHARGE RATE (PASSED) ICEPACK ALTERNATOR BROKEN WIRE REPAIRED	QLD WORKSHOP
04/03/2022	340,934 kms	<b>NEW DRIVE TYRES, ROTATE/BALANCE STEER</b> T-1041 ALL NEW DRIVE TYRES FITTED UP BALANCED AND ROTATED STEER TYRES ALL OK	DARREN BUDD'S TYRES PTY LTD
14/02/2022	328,200 kms	<b>A S-4524</b> TIGHTEN U LOOP BAR	QLD WORKSHOP
20/01/2022	313,000 kms	<b>NEW STEERS</b> T-965 NEW BRIDGESTONE R154 TYRES BALANCED AND FITTED UP ALL OK	DARREN BUDD'S TYRES PTY LTD
18/01/2022	313,000 kms	<b>B S-4321</b>	QLD WORKSHOP
23/12/2021	305,687 kms	<b>WINDSCREEN</b> R-1458 BROWN AND HURLEY REMOVED BOTH WINDSCREENS AND RUBBERMOULDING, REGULED AND RESET BOTH WINDSCREENS. LET SIT FOR 24HRS ALL OK COVERED UNDER WARRENTY	BROWN & HURLEY GROUP
08/12/2021	296,400 kms	<b>A S-4052</b> SERVICED ICE PACK @ 850hrs	QLD WORKSHOP
16/11/2021	280,300 kms	<b>ROTATE/BALANCE STEER, ROTATE DRIVES, TURN TYRE ON RIM</b> T-773 ROTATED DRIVES DIAGONALLY TUNRED X6 TYRES ON RIMS ROTATED AND BALANCED 2 STEERS	DARREN BUDD'S TYRES PTY LTD
15/11/2021	280,300 kms	<b>A S-3889</b>	QLD WORKSHOP
27/10/2021	267,025 kms	<b>A S-3715</b>	QLD WORKSHOP
29/09/2021	255,369 kms	<b>wheel alignment</b> R-1183 CALLED IN BRETT STEELS TO CARRY OUT WHEEL ALIGMNET ALL OK	BRETT STEELE LASER ALIGNMENTS PTY LTD
24/09/2021	252,111 kms	<b>C S-3506</b>	QLD WORKSHOP
24/09/2021	252,111 kms	<b>B S-3507</b>	QLD WORKSHOP
30/08/2021	235,120 kms	<b>A S-3285</b> Matt C did service not tony fitted up all new hub covers and nuts	QLD WORKSHOP
30/08/2021	235,120 kms	<b>ROTATE/BALANCE STEER, ROTATE DRIVES</b> T-619 Side to side steer tyres Side to side back to front drive tyres Kms 235120 W/O 1666 Done by Qld workshop	DARREN BUDD'S TYRES PTY LTD, QLD WORKSHOP
02/08/2021	219,976 kms	<b>A S-3077</b>	QLD WORKSHOP
15/07/2021	205,100 kms	<b>A S-2947</b>	QLD WORKSHOP
24/06/2021	190,183 kms	<b>ROTATE DRIVES</b> T-490 ROTATED ALL DRIVES SIDE TO SIDE	DARREN BUDD'S TYRES PTY LTD

Date	Reading / Units	Type / Repairer Notes	Repairer
24/06/2021	190,826 kms	<b>B S-2770</b>	QLD WORKSHOP
27/05/2021	178,950 kms	<b>A S-2568</b>	QLD WORKSHOP
17/05/2021	160,059 kms	<b>A S-2438</b>	QLD WORKSHOP
12/05/2021	162,230 kms	<b>NEW STEERS T-417</b> 2 X NEW STEER TYRES BALANCED AND FITTED UP	DARREN BUDD'S TYRES PTY LTD
19/04/2021	147,280 kms	<b>A S-2269</b>	QLD WORKSHOP
19/04/2021	147,280 kms	<b>ROTATE DRIVES T-327</b> ROTATE ALL DRIVE TYRES (FRONT TO BACK)	DARREN BUDD'S TYRES PTY LTD
11/03/2021	134,500 kms	<b>A S-1861</b>	QLD WORKSHOP
08/03/2021	119,800 kms	<b>100,000KLM ENGINE TUNE] R-420</b> Carry out 100k top tune on motor	QLD WORKSHOP
02/03/2021	119,800 kms	<b>B S-1680</b>	QLD WORKSHOP
10/02/2021	109,832 kms	<b>FLIP ON RIM, ROTATE/BALANCE STEER, ROTATE DRIVES T-218</b> ROTATED ALL DRIVE TYRES ROTATED FLIP 1 TYRE ON RIM AND BALANCED STEER TYRES	DARREN BUDD'S TYRES PTY LTD
10/02/2021	104,832 kms	<b>A S-1480</b>	QLD WORKSHOP
27/01/2021	95,411 kms	<b>A S-1364</b>	QLD WORKSHOP
06/01/2021	75,180 kms	<b>A S-1194</b>	QLD WORKSHOP
30/11/2020	60,213 kms	<b>B S-788</b> OIL SAMPLE TO BE TAKEN	
11/11/2020	47,250 kms	<b>ROTATE/BALANCE STEER, ROTATE DRIVES T-81</b>	DARREN BUDD'S TYRES PTY LTD
11/11/2020	47,250 kms	<b>A S-596</b>	
11/11/2020	47,250 kms	<b>DIFF OILS R-78</b> REPLACED BOTH DIFF OILS AND FIRST DIFF OIL FILTER ALL OK	
16/10/2020	31,779 kms	<b>A S-407</b>	
01/09/2020		<b>C S-1701</b>	

Signed: \_\_\_\_\_

Name: \_\_\_\_\_

Date: \_\_\_\_\_