

EQUIPMENT SALES AND SERVICES  
1030 MARTIN GROVE RD  
ETOBICOKE ON

1030 Martin Grove Road  
Toronto, ON M9W 4W3  
Tel: 416-249-8141 Fax: 416-249-8912  
Toll Free: 800-268-0679 www.essltd.com  
BEST MANAGED COMPANIES  
Platinum member

CARD \*\*\*\*\*5465  
CARD TYPE VISA  
DATE 2023/07/26  
TIME 0170 11:19:23  
RECEIPT NUMBER  
C84053139-001-001-107-0  
PURCHASE TOTAL  
**\$5,930.87**

SERVICE LIMITED

WORK SAFE

|                   |                |             |              |                          |
|-------------------|----------------|-------------|--------------|--------------------------|
| Branch            |                | Toronto     |              | Page                     |
| Date              | 07/26/23       | Time        | 11:17:15 (O) | 01                       |
| Account No.       | DRAIN010       | Phone No.   | 4169386824   | Work Order No.<br>W45759 |
| Ship Via          | Purchase Order |             |              |                          |
| Hours to Complete |                | Salesperson |              |                          |
| Date              |                |             | DBE          |                          |

Road  
4

SERVICE WORK ORDER

| STK#/FLEET# |                         | HRS  | PIN/EIN  | WARRANTY DATE | HRS |
|-------------|-------------------------|------|----------|---------------|-----|
| 007537      | EXCAVATOR<br>TXC225LC-2 | 6465 | 80040066 |               |     |
|             |                         | 2    |          |               |     |

SEGMENT# 1 5 INTER . 06/23/23 06/26/23 06/28/23 4.00

Check Wear in Bucket Linkage  
CORRECTION:

Customer brought the excavator into the yard and asked ESS to repair the wear in the bucket radius links and pins. AG25: Brought the machine down to the shop, identified the areas requiring attention. Removed both bucket radius links and both pins. Sent the two radius links and the two pins out for evaluation. Links can be restored to the correct fit but the pins are beyond economical repair. Customer will supply seals, bushings and one 71 mm pin and ESS will supply one 80 mm pin. Removed the worn bushings, cleaned the bores and pressed in the replacement bushings and seals. Lined up the links with the arm and added shims so that as much play as possible is eliminated. Installed and secured new retaining bolts. Put all panels back on and washed the machine. Tightened one loose engine mounting.

|               |                 |   |         |         |
|---------------|-----------------|---|---------|---------|
| SUBLETL       | LINE BORING/MAC | 1 | 1560.00 | 1560.00 |
| SUBLETP       | Misc. pin       | 1 | 300.00  | 300.00  |
| 203-70-11210A | SHIM            | 8 | 19.04   | 152.32  |
| 203-70-11220A | SHIM            | 8 | 22.77   | 182.16  |
|               | PARTS           |   |         | 334.48  |
|               | LABOR           |   |         | 2521.95 |
|               | SUBLET          |   |         | 1860.00 |

CONTINUED ON PAGE 02

CONFIRMATION OF WORK PERFORMED

Correction: \_\_\_\_\_

Customer Signature: \_\_\_\_\_

Details describing the cause and correction as well as all other related charges for labour, mileage, sundries and taxes will be included on the Service Invoice. If nobody is available for signature, this report will be emailed or faxed to the customer. E. & O.E