



EQUIPMENT SALES & SERVICE LIMITED

Toronto, ON M9W 4V9
Tel: 416-249-8141 Fax: 416-249-8912
Toll Free: 800-268-0679 www.essltd.com

MANAGED COMPANIES
Part of the member

WORK SAFE

Ship to:
Drainville Ltd
1 Hickory Tree Road
Suite #1510
York ON M9N 3W4

Invoice to:
Drainville Ltd
1 Hickory Tree Road
Suite #1510
York ON M9N 3W4

Branch	Toronto	Time	12:15:35 (O)	Page	01
Date	04/05/21	Phone No.	4169386824	Work Order No.	W36847
Account No.	DRAIN010	Purchase Order			
Ship Via	PICK UP	DENIS			
Hours to Complete				Salesperson	APA
Date					

SERVICE WORK ORDER

STK#/FLEET# HRS PIN/EIN WARRANTY DATE HRS

007537 EXCAVATOR 1 80040066

TXC225LC-2 2

SEGMENT# 1 5 JV07 TXC225LC2 01/05/21 01/05/21 01/29/21 .01

TRANSFER SHOES TRACK SHOES TO NEW CHAINS

LABOUR TO TRANSFER CUSTOMER

FT2111	TRACK NUT	392	.75	294.00
KM2561/49J	S&G T/CHAIN	2	2195.00	4390.00
ST431	T/BOLT WTH/MSR	392	1.50	588.00
01010-61645A	m16x45x2	60	2.50	150.00
	PARTS			5422.00
	LABOR			800.00
				6222.00

SEGMENT TOTAL==>

SEGMENT# 2 5 SY90 Undercarriage Overhaul 01/05/21 01/05/21 02/28/21 25.00

CORRECTION:
Pressure washed excavator.
Brought into the shop and relieved the track tension. Put machine on stands and separated the tracks.
Replaced both sprocket assemblies and torqued bolts.
Removed track rollers, tapped out threads, cleaned up mating surfaces and fitted new track rollers and torqued new bolts.
Replaced both LH carrier rollers and the RHR carrier roller. The RHR roller has been welded on and the roller pedestal will need to be repaired or replaced. Installed new roller after its replacement.
Both idler shafts are worn and will need to be replaced. Both recoil springs were broken and had to be cut to get them

CONFIRMATION OF WORK PERFORMED

Correction:

CONTINUED ON PAGE 02

Customer Signature:

All other related charges for labour, mileage, sundries and taxes will be included on the F & O F