

| Number | Type | Date Open | Date Closed | Kilometres Closed | Hours Closed | Fuel Usage Clo | Fault | Repairer / Notes | Cost / Invoice |
|--------|----------------------|------------|-------------|-------------------|--------------|----------------|-------|---|----------------|
| R-9182 | Fault | 04/02/2026 | | | | | 12311 | Internal Workshop - Night Shift Neither of the door lock. This is a security issue. | \$0.00 |
| S-7428 | B - 250 Hours | 10/31/2025 | 11/11/2025 | 0 | 9,690 | 395 | 0 | Internal Workshop - Night Shift REPLACED FRONT WHHEL BEARINGS AND SEALS AND OIL. REPAIRED WIRING TO NUMBER PLATE LIGHT. REPLACED WINDSCREN WIPERS. REPAIRED PUNTURES ON DRIVES. TIGHTNED LOSE U-BOLTS ON DRIVES. | \$0.00 |
| R-8831 | Machinery Defects | 08/27/2025 | 08/21/2025 | 465,242 | | | 0 | Internal Workshop - Night Shift NEEDLE GUNNED WHOLE CROSSMEMBER AND PRIMED AND PAINTED. | \$0.00 |
| R-8830 | Machinery inspection | 08/27/2025 | 08/21/2025 | 456,342 | | | 0 | PASSED MACHINERY | \$0.00 |
| R-8334 | Shocks | 02/14/2025 | 08/20/2025 | | | | 9,504 | 0 Internal Workshop - Night Shift REPLACED ALL 4 DRIVE SHOCKS. | \$0.00 |
| R-8333 | Unis | 02/14/2025 | 08/20/2025 | | | | 9,504 | 0 Internal Workshop - Night Shift REPLACED OUTPUT UNI AT TRANS. REPLACED INPUT UNI FRONT DIFF. REPLACED BOTH PENARD RODS ON DIFFS. FITTED 2X CAB AIR BAGS AND SHOCKS. REPLACED P/S SEATBELT. REPLACED STEERING UNI NEAR BOX. FITTED REVERSE BEEPER. | \$0.00 |
| R-8605 | Battery | 06/04/2025 | 06/03/2025 | | | | 0 | Internal Workshop - Night Shift REPLACED BATTERY SUPPLIED BY BATTERY POWER CENTRE. | \$0.00 |
| S-6917 | A - 21 Days | 04/16/2025 | 02/06/2025 | 465,342 | | 0 | 0 | Internal Workshop - Night Shift TIGHTNED DRIVE SHAFT BOLTS OUTPUT TRANS. REPLACED OIL IN PETROL PUMP. REPLACED 2ND AXLE RHS Z BEAM AND U-BOLTS. | \$0.00 |
| S-6801 | C - 365 Days | 02/06/2025 | 10/02/2025 | 465,342 | | 9,295 | 0 | Internal Workshop - Night Shift SERVICE COMPLETED BY IZAAK H. REPLACED GEARBOX OIL. REPLACED BOTH OILS. REPLACED FRONT WHEEL BEARING OIL. | \$0.00 |
| R-8127 | fuel line | 11/12/2024 | 11/12/2024 | 465,342 | | 0 | 0 | Internal Workshop - Field Service REPLACED NUMBER ONE INJECTOR KINE. | \$0.00 |
| I-43 | Machinery Inspection | 09/16/2024 | 09/22/2024 | | | | 0 | Passed Machinery. | \$0.00 |
| R-7942 | Machinery Defects | 09/16/2024 | 09/16/2024 | 465,401 | | 0 | 0 | Internal Workshop - Night Shift Pulled seatbelt out and sprayed silicone spray on. Now retracts. | \$0.00 |
| R-7846 | Slack adjusters | 09/05/2024 | 09/11/2024 | 465,342 | | | 0 | Internal Workshop - Night Shift REPLACED ALL 3 STEERING UNI'S. REPLACED ALL 4 SLACK ADJUSTERS ON DRIVE. | \$0.00 |
| S-6504 | A - 21 Days | 09/04/2024 | 04/09/2024 | 465,342 | | 9,064 | 0 | Internal Workshop - Night Shift SERVICE COMPLETED BY TYSON E. ADJUSTED CLUTCH. REPLACED BOTH REAR MUDFLAPS. CHANGED OIL ON PETROL PUMP. | \$0.00 |

| | | | | | | | | |
|--------|----------------------|------------|------------|---------|--------|---|---|--------|
| S-6341 | B - 250 Hours | 07/01/2024 | 07/03/2024 | 8,935 | 235 | 0 | SERVICE COMPLETED BY JARROD H. TIGHTEN ALL COOLANT HOSE CLAMPS. REPLACED FRONT CAB MOUNTS. REPLACED MISSING PENARD ROD ON REAR OFF CAB. BLEW OUT AIR FILTER ON WATER PUMP AND CHANGED THE OIL. Internal Workshop - Night Shift Serviced Honda water pump and blew out the air cleaner | \$0.00 |
| S-6138 | A - 21 Days | 03/18/2024 | 18/03/2024 | 465,342 | 0 | 0 | Repaired switches for the water spray bars Internal Workshop - Night Shift Replaced 3rd axle panhard rod supplied by Mack. | \$0.00 |
| R-7160 | penard rod | 02/16/2024 | 02/20/2024 | 465,342 | 28,824 | 0 | Internal Workshop - Night Shift Removed and replaced 3rd axle LHS Z Beam Cut seized U Bolts out Cut seized Air Bag Bridge Bolts out Fit New Z Beam and New U Bolts with new nuts and washers | \$0.00 |
| R-6870 | Trailing Arm | 01/10/2024 | 01/08/2024 | | 8,824 | 0 | | \$0.00 |
| S-5987 | A - 21 Days | 12/21/2023 | 08/01/2024 | 48 | | 0 | | \$0.00 |
| R-7025 | Air switches | 12/05/2023 | 12/05/2023 | 0 | 8,687 | 0 | Internal Workshop - Night Shift Fit new control box for external water pump. Fit new switches/air lines/ air fittings. Fit Honda remote start into box Test all switches and water pump. | \$0.00 |
| R-7043 | Engine Rebuild | 11/21/2023 | 11/21/2023 | 465,342 | 8,687 | 0 | Internal Workshop - Night Shift Engine rebuild as per attached service sheet. Remove bonnet and radiator assembly. Pressure wash out intercooler. Clean and inspect all parts for damage. R&R main bearings and thrust washers and torque. R&R no5 sleeve R&R big end bearings and torque to spec. Fit new parts as per service sheet attached. | \$0.00 |
| R-6890 | Air Conditioning | 01/11/2024 | 11/21/2023 | 465,342 | | 0 | A Grade Auto Repair Repair a/c system after engine rebuild. Invoice attached. | \$0.00 |
| S-5936 | C - 365 Days | 11/20/2023 | 21/11/2023 | 445 | 8,700 | 0 | Tighten leaking air fitting on maxi brake valve behind dash Fit joiner to 1/8 air line behind dash Degrease engine bay Relay valve leaking above front drive R&R leaking relay valve, replaced relay valve | \$0.00 |
| I-5 | Machinery Inspection | 09/07/2023 | 09/07/2023 | | | 0 | Replaced coolant with Castrol Coolplus 50 Diesel injector pump rebuilt by Rocklea Diesel. Defect Notice - As per attached - self clearing. | \$0.00 |
| R-6562 | Machinery Defects | 09/04/2023 | 09/05/2023 | 465,342 | 0 | 0 | Internal Workshop - Night Shift All lights working R&R rear marker signs & fit reflectors Tighten front body mounts R&R shock absorbers *needs brake relay valve for air leak* Replaced brake relay valve | \$0.00 |
| R-6454 | Brakes | 07/10/2023 | 08/25/2023 | 465,342 | | 0 | Internal Workshop - Night Shift 25/8 Done prior | \$0.00 |
| R-6453 | Injector | 07/10/2023 | 08/25/2023 | 465,342 | | 0 | Internal Workshop - Night Shift 25/8/ - done prior | \$0.00 |

| | | | | | | | | | | |
|--------|----------------|------------|------------|---------|-------|-----|---|--|--|--------|
| R-6355 | Exhaust | 06/23/2023 | 08/25/2023 | 465,342 | 0 | 0 | Internal Workshop - Night Shift Exhaust rusting out bottom of stack - 25/8 done prior. | \$0.00 | | |
| R-6354 | UHF | 06/13/2023 | 08/25/2023 | 465,342 | 0 | 0 | UHF aerial snapped off roof - repaired. Aerial did not fix problem. Replaced by A grade on 9/11/23. Invoice attached. | \$0.00 | | |
| R-6352 | Sump gasket | 06/13/2023 | 08/25/2023 | 465,342 | 0 | 0 | Internal Workshop - Night Shift Oil leak at sump gasket - fixed 24/8/23 | \$0.00 | | |
| R-6351 | Indicators | 06/13/2023 | 08/25/2023 | 465,342 | 0 | 0 | Internal Workshop - Night Shift Left hand indicator repeater under cab u/s - R&R Light | \$0.00 | | |
| R-6056 | Muffler | 03/25/2023 | 08/25/2023 | 465,342 | | 0 | 6239 Muffler leaking and broken 25/8 Service - Repaired prior. | \$0.00 | | |
| S-5757 | B - 250 Hours | 08/22/2023 | 08/25/2023 | 8,523 | 8,523 | 240 | 0 | As per service sheet: Manifold exhaust gaskets and studs, turbno mount gasket andd studs. Coolant filter, reseal housing. All drive belts. Indicator. New aerial and bracket for UHF, new turbo feed oil hose. No1 injector line, windscreen washer hoses, axle brakes shoes and drums, 3rd axle bearings c seals, s-cam bushes on 3rd axle, exhaust muffler and elbow and clamps. | \$0.00 | |
| R-6617 | Fuel | 08/02/2023 | 08/02/2023 | 465,342 | 0 | 0 | Internal Workshop Remove fuel pick up line out of tank and found pick up pipe not connected to fitting. Tried to fit o-ring between fitting and pipe to see if would seal. Problem still existed. Replaced injector timing sensor. Rectified problem. | \$0.00 | | |
| R-6254 | Steering Shaft | 06/01/2023 | 07/10/2023 | | 8,421 | | 0 | Replaced all 3 steering uni's | \$0.00 | |
| R-6055 | Tailshaft | 03/25/2023 | 07/10/2023 | | 8,421 | | 0 | 6238 Replaced tail shaft. | \$0.00 | |
| R-5414 | Coolant leak | 11/14/2022 | 07/10/2023 | | 8,421 | | 0 | 5587, 5 Replaced | \$0.00 | |
| S-5634 | A - 21 Days | 07/10/2023 | 10/07/2023 | | | 27 | 8,421 | 0 | Degreased engine - recheck leaks. Service honda pump engine. Diesel leak - JC Rear axle brakes next service - JC Air leak from control switches in console pics sent to Jay. Left hand indicator repeater under cab u/s - JC Oil leak top of steering box Oil leak at sump gasket - JC Top radiator mounts worn allowing radiators to flex back and forward and impact intercooler mounts - JC UHF aerial snapped off roof JC | \$0.00 |
| S-5563 | A - 21 Days | 06/13/2023 | 13/06/2023 | 465,342 | 8,360 | | | 0 | Exhaust rusting out bottom of stack - JC. | \$0.00 |
| S-5519 | A - 21 Days | 05/22/2023 | 22/05/2023 | | 8,326 | 25 | | 0 | Done by Tyson | \$0.00 |

| | | | | | | | | | |
|--------|----------------|------------|------------|---------|-------|-------|---|--|--------|
| | | | | | | | | Internal Workshop - Night Shift Completed by Tyson. Engine mounts worn, especially front. Tail shaft and yoke very worn - front half from gearbox to center bearing. Cleaned up splines and applied bearing retainer. Tensioned yoke and tightened all tail shaft bolts. Engine oil leaking from fuel pump mount and adapter plates. R&R steer hub oils. R&R engine oil in water pump - Honda. | |
| S-5470 | B - 250 Hours | 04/27/2023 | 04/27/2023 | 465,342 | 8,283 | 307 | 0 | Windscreen washer switch playing up. | \$0.00 |
| T-115 | Drive Tyres | 04/15/2023 | 04/15/2023 | 289,944 | | 0 | 0 | Bridgestone Wacol Replaced all 8 x drive tyres on site | \$0.00 |
| | | | | | | | | Internal Workshop - Night Shift Completed by Garth. Adjusted clutch. Replaced grease nipples on s'cam tubes. Engine will need a degrease. Replaced engine oil | |
| S-5272 | A - 21 Days | 02/10/2023 | 10/02/2023 | 0 | | 0 | 0 | | \$0.00 |
| | | | | | | | | Internal Workshop - Night Shift Damaged. Engine fails to start first up hand primer has to pumped up to 200times to get it going not good it is getting worse. Izaak; replaced lift pump and primer. Suspect fault in fuel pump with | |
| R-5417 | Fuel | 11/16/2022 | 11/28/2022 | | | 7,976 | 0 | 5640 fuel running back to tank. Oil spinner drain hose replaced. | \$0.00 |
| | | | | | | | | Internal Workshop - Night Shift flashing light not working Izaak; checked power at beacon. Pulled dash apart ad found wire for switch had fallen out/off. | |
| R-5368 | Flashing light | 10/31/2022 | 11/28/2022 | | | 7,976 | 0 | 5549, 5 Refit, all working now. | \$0.00 |
| S-5121 | B - 250 | 11/28/2022 | 11/28/2022 | 0 | 7,976 | 305 | 0 | Internal Workshop - Night Shift Completed by Izaak. | \$0.00 |
| | | | | | | | | Damaged. Check Belts for wear or damage. Belts are ready to fly off Izaak; | |
| R-5337 | Belts | 10/19/2022 | 10/25/2022 | 465,342 | | | 0 | 5496 replaced all engine belts. | \$0.00 |
| | | | | | | | | Other. Check for coolant or fluid leaks. Leak around power steering hose. 02/09/22 - Tyson - new power steering hose leaking at reservoir. 25/10/22 - Jay - | |
| R-4526 | Power Steering | 06/17/2022 | 10/25/2022 | 465,342 | | | 0 | 4779 hose has been repaired in the past and not noted. Completed by Izaak. Removed and replaced all drive air bags; all good. Adjusted clutch in box and cable; all good. | \$0.00 |
| S-5021 | A - 21days | 10/24/2022 | 25/10/2022 | 465,342 | | 0 | 0 | Replaced all engine belts. | \$0.00 |
| | | | | | | | | Tyson - oil leaks at fuel pump - engine oil. Oil leaks at power steering pump - engine oil. Sump gasket leaking. Power steering hose leaking at reservoir. Will need oil canister drain hose next service. Oil canister is also dented, may need replacing too. | |
| S-4845 | D - 1000 | 08/30/2022 | 09/02/2022 | 0 | 7,671 | 7,67 | 0 | | \$0.00 |

| | | | | | | | | | |
|--------|----------------------------------|------------|------------|---------|-------|-------|---|---|--------|
| | | | | | | | | Garth - remove front steer axle springs LHS and RHS. Knock out LH hanger bush and fit new bush. Fit new springs with new pins and u-bolts. Grease and torque to spec. Repair seat belt. Repair LHS mud guard bracket and rubber around fuel tank. Fit reverse beeper. Replace blown clearance lights on roof. | |
| R-5052 | Brakes, Clearance Lights, Mud | 08/29/2022 | 08/29/2022 | 465,342 | | | 0 | Fit new spring rollers x 4 Repair rubber on RHS door. Adjust all brakes. | \$0.00 |
| S-4541 | B - 250 | 05/17/2022 | 05/26/2022 | 0 | 7,438 | 1,03 | 0 | Replaced all power steering hoses and fluid. | \$0.00 |
| R-4220 | Tyres | 04/27/2022 | 04/28/2022 | 33,673 | | 605 | 0 | 4490 Bridgestone Wacol replaced 4 x tyres 3rd axle on site at Redbank. | \$0.00 |
| R-4027 | Height control valve, Seat bel | 03/07/2022 | 03/07/2022 | 465,342 | | 0 | 0 | Remove steer axle shockies and replaced with new. Removes cab shockies x 2 and replaced with new. Re-fit height control valve for cab and make new punch rod. Replaced treadle valve with new. Straightened drivers side seat belt. | \$0.00 |
| R-4028 | Brake booster, Control arm, T | 02/22/2022 | 02/22/2022 | 465,342 | | 0 | 0 | Replaced top torque rod with new on 2nd axle. Replaced LH control arm with new on 2nd axle. Replaced RH 3rd axle brake booster with new. Wash and degrease engine. | \$0.00 |
| R-3531 | Suspension | 08/31/2021 | 08/31/2021 | 465,342 | | 6,702 | 0 | Internal Workshop Garth. Remove springs from first drive. Remove broken panhard rod. Fit two new springs. Waiting on parts. Fit new seat belt - tested okay. | |
| R-3215 | Flashing light | 08/23/2021 | 08/30/2021 | 0 | | 0 | 0 | 3455 Internal Workshop Check and repair or replace flashing light. A Grade Auto Electric replaced switch. | \$0.00 |
| R-3533 | Lights, Suspension | 08/27/2021 | 08/27/2021 | 465,342 | | 0 | 0 | Internal Workshop Garth. Remove panhard rods, make tool to press out and in new bushes replacing 4 x bushes. Refit panhard rods - tested all okay. Found broken LHS first drive spring, remove spring. Repair wiring for reverse lights. | |
| R-3534 | Air vents, Oil leak, Power Steer | 08/26/2021 | 08/26/2021 | 465,342 | | 0 | 0 | Internal Workshop Garth. Replace 1 x power steer hose with new. Top up power steering - tested okay. Fit UHF hand piece - tested okay. Repair air vents - tested okay. Degrease engine to find oil leaks. | |
| R-3532 | Brakes | 08/25/2021 | 08/25/2021 | 465,342 | | 0 | 0 | Internal Workshop Remove first drive wheels, drums and brakes and replace with new - all torqued to spec adjusted - tested okay. Repair wiring for revolving light. Fit top clearance light - tested okay. | |
| R-3101 | Oil sample | 07/23/2021 | 07/27/2021 | 478,300 | | | 0 | KOWA Engine oil sample done - slip nr 478300 Oil sample back at CAUTION | |

| | | | | | | | | |
|--------|---------------|------------|------------|---------|-------|-------|---|--|
| S-3722 | B - 250 Hours | 07/16/2021 | 07/19/2021 | 465,342 | 6,405 | 6,40 | 0 | <p>Internal Workshop Service done by Garth</p> <p>Fit new brake switch</p> <p>Fit new windscreen washer motor</p> <p>Fit new horn</p> <p>Replaced wiper blades with new and replaced washer hose</p> <p>Fit 4 x shockies to 2nd & 3rd drive axles</p> <p>Fit new fuel primer</p> <p>Fit window winder handle</p> <p>Degreased and washed down engine</p> <p>Fit new seal on power steer tank</p> <p>Internal Workshop Service done by Garth,</p> <p>Fitted new cab ride height valve,</p> <p>Changed oil in Honda water pump,</p> <p>Replaced RH 1st drive brake booster,</p> <p>Tightened lock nuts on 2 x brake boosters,</p> <p>Repaired air leaks,</p> <p>DEFECTS: Missing RH top amber clearance cover,</p> <p>Universal joint on steering (x2) u/s,</p> <p>1st drive torque rod bush u/s,</p> <p>Control arm bush u/s,</p> <p>Universal joint on tail shaft u/s,</p> <p>1st drive brake re-line due,</p> <p>Injector pump leaking,</p> <p>RHS Fuel tank straps u/s,</p> <p>Cab shockies u/s,</p> |
| S-3455 | A - 21 Days | 04/15/2021 | 04/15/2021 | 465,342 | | 6,167 | 0 | <p>Power steer leak,</p> |