

| Number | Type | Date Open | Date Closed | Kilometres Closed | Hours Closed | Fuel Usage | Fault | Repairer / Notes | Cost / Invoice |
|--------|----------------|------------|-------------|-------------------|--------------|------------|---------|--|----------------|
| S-7682 | A | 03/12/2026 | 13/03/2026 | 676,563 | 0 | 0 | | Internal Workshop - Night Shift Internal Workshop - Night Shift REPLACED D/S SEATBELT. REPLACED FRONT INDERCATOR BULBS. REPLACED | \$0.00 |
| R-9112 | Seatbelt | 02/27/2026 | 03/11/2026 | 675,967 | | | 0 12102 | FAULTY SERVICE BRAKE RELAY. REPLACED ALL RUBBER BRAKE LINES ON 2ND AXLE. | \$0.00 |
| S-7623 | B - 15k | 02/18/2026 | 18/02/2026 | 675,000 | 15,0 | 0 | 0 | Internal Workshop - Night Shift REPLACED 3RD AXLE BRAKE SHOES AND DRUMS. | \$0.00 |
| R-8811 | ABS valve | 08/18/2025 | 01/20/2026 | 667,084 | | | 0 | Internal Workshop - Night Shift REPLACED LHS AND RHS STEER ABS VALVES | \$0.00 |
| S-7566 | C - 30k | 01/20/2026 | 01/20/2026 | 660,000 | 30,0 | 0 | 0 | Internal Workshop - Night Shift REPLACED LEKING COOLANT FITTINGS ON HEADER TANK. Internal Workshop - Night Shift REPLACED CENTRE ROOF LIGHT BULB. REPAIRED TOOLBOX LID. REPLACED RHS BOLT ON STEER GUARD. ADJUSTED CLAMPS ON EXHAUST SO HITTING CHASSIS. | \$0.00 |
| S-7512 | A | 12/12/2025 | 12/12/2025 | 661,698 | 0 | 0 | | REPLACED BOTH TARP CABLES. Internal Workshop - Night Shift RE-PHASED DRIVE SHAFT. | \$0.00 |
| S-7452 | A | 11/11/2025 | 13/11/2025 | 654,755 | 0 | 0 | | REPLACED MISSING BOLTS ON DRUVE SHAFT. | \$0.00 |
| R-8971 | cabin filter | 10/30/2025 | 10/23/2025 | 649,917 | | | 0 | REPLACED DIRTY CABIN FILTER, | \$0.00 |
| S-7396 | A | 10/21/2025 | 21/10/2025 | 649,415 | 0 | 0 | | | \$0.00 |
| R-8726 | Belt tensioner | 07/17/2025 | 10/13/2025 | 647,803 | | | 0 | Internal Workshop - Night Shift REPLACED BELT TENSIONERS AND BELTS | \$0.00 |
| S-7329 | B - 15k | 10/01/2025 | 01/10/2025 | 645,000 | 15,0 | 0 | 0 | Internal Workshop - Night Shift Internal Workshop - Night Shift REPLACED HEIGHT CONTROL VALVE. | \$0.00 |
| S-7268 | A | 09/03/2025 | 03/09/2025 | 543,217 | 0 | 0 | | TIGHTNED DRIVE SHAFT BOLTS. Internal Workshop - Night Shift REPLACED WINDOW WASHER JETS. | \$0.00 |
| S-7198 | A | 08/12/2025 | 13/08/2025 | 640,181 | 0 | 0 | | TIGHTNED DRIVE SHAFT BOLT. Internal Workshop - Night Shift REPLACED MISSING BOLT ON TAIL SHAFT. TIGHTENED INPUT NUT ON FRONT DIFF. REPAIRED BATTERY HOLD DOWNS. | \$0.00 |
| S-7122 | A | 07/15/2025 | 15/07/2025 | 638,512 | 0 | 0 | | REPAIRED AIR LEAK LHS STEER SERVICE LINE. Internal Workshop - Night Shift REPLACED LHS PARK LIGHT. REPLACED ALL PLASTIC TARP ENDS. REPLACED MODUELER VALVE ON THE SIDE OFF TRANS. REPLACED RHS ROOF LIGHT. CLEANED WINDSCREEN WASHER JETS. REPLACED WINDSCREEN WIPERS. TIGHTNED BOTTOM RADIATER HOSE. REPLACED RHS INTERCOOLER BOLT. REPLACED AIR PREASURE SWITCH ON FRONT OFF CAB. | \$0.00 |
| S-7046 | D - 90k | 06/18/2025 | 06/19/2025 | 630,000 | 90,0 | 0 | 0 | ACTUALLY COMPLETED AT 632314 KM | \$0.00 |
| R-8201 | Ring Fedder | 12/11/2024 | 05/16/2025 | 622,621 | | | 0 | Internal Workshop - Night Shift REPLACED RINGFEDER. Internal Workshop - Night Shift REPLACED EXHAUST Y PIECE AND 2X FLEX. REPLACED WHOLE MUFFLER. REPLACED NOX SENSOR. REPLACED ENGINE SPINNER BREATHER. | \$0.00 |
| S-6945 | A | 05/13/2025 | 16/05/2025 | 622,621 | 0 | 0 | | REPLACED 2ND AXLE LHS AIRBAG. | \$0.00 |
| R-8489 | Boost Pressure | 04/28/2025 | 04/23/2025 | 614,188 | | | 0 | SAY AUTO ELETRICAL @ Crestmead Inspect, connect Techtool, find multiple inactive codes, 1x active for boost sensor. Inspect/test - wiring OK. Check sensor connector, tighten loose sockets, reassemble and test - OK. Clear SERVICE COMPLETED BY COREY/TOM/ FINAL CHECKOVER WAS RITCHIE. | \$0.00 |
| S-6891 | B - 15k | 04/01/2025 | 04/02/2025 | 615,000 | 14,0 | 0 | 0 | ACTUALLY DONE AT | \$0.00 |
| R-8472 | Alternator | 04/10/2025 | 03/23/2025 | 610,165 | | | 0 | FOUND ISO SWITCH AND LUGS FAILED. ALL REPLACED . | \$0.00 |
| R-8385 | Stickers | 02/26/2025 | 03/11/2025 | 608,860 | | | 0 9925 | Internal Workshop - Night Shift REPLACED STICKER. | \$0.00 |
| R-8338 | Air valve | 02/19/2025 | 02/17/2025 | 603,206 | 0 | 0 | | Internal Workshop - Night Shift REPLACED VALVE SUPPLIED BY VCV. | \$0.00 |
| R-8339 | air bag | 02/19/2025 | 02/14/2025 | 602,863 | | | 0 | Internal Workshop - Night Shift REPLACED AIRBAG ON 3RD AXLE LHS. | \$0.00 |
| R-8390 | Gearbox | 02/07/2025 | 02/07/2025 | 600,351 | | | 0 | VCV Checked fault codes and found data faults. Harness and sensor faulty. Replaced sensor and lid harness. | \$0.00 |

| | | | | | | | | | |
|--------|-------------------|------------|------------|---------|--------|---|---------------------------------|---|--------|
| R-7701 | Exhaust | 07/19/2024 | 02/05/2025 | 600,146 | 0 | 0 | Internal Workshop - Night Shift | REPLACED RHS EXHAUST ELBOW TO STACK AND CLAMPS. | \$0.00 |
| R-7653 | Diff | 07/08/2024 | 02/05/2025 | 600,146 | | 0 | Internal Workshop - Night Shift | REPLACED ORING. | \$0.00 |
| S-6795 | C - 30k | 02/05/2025 | 02/05/2025 | 600,146 | 30,000 | 0 | Internal Workshop - Night Shift | SERVICE COMPLETED BY IZAAK H. ACTUALLY DONE AT 600146 KM. | \$0.00 |
| R-8323 | PTO | 02/07/2025 | 01/30/2025 | 599,894 | | 0 | Internal Workshop - Night Shift | FOUND CIRCLIP COME OFF IN GEARBOX MACK REPLACED UNDER WARRANTY. | \$0.00 |
| R-8289 | DPF | 01/23/2025 | 01/12/2025 | 592,809 | | 0 | Internal Workshop - Night Shift | REMOVED AND GOT EXHAUST CLEAN BEENLEIGH TO FLUSH OUT AND RE-FITTED. | \$0.00 |
| R-8187 | Park Brake Valve | 12/09/2024 | 12/09/2024 | 592,559 | | 0 | Internal Workshop - Night Shift | REPLACED WHOLE PARK BRAKE VALVE IN CAB. REPAIRED AIR LEAK IN CHASSIS NEXT TO TURBO | \$0.00 |
| R-7098 | Window Tinting | 02/01/2024 | 12/05/2024 | 592,299 | | 0 | Southside Window Tinting | TINTMART REPLACED D/S TINT. | \$0.00 |
| S-6699 | A | 12/05/2024 | 05/12/2024 | 592,299 | | 0 | Internal Workshop - Night Shift | SERVICE COMPLETED BY TYSON E. Self clearing defect notice #D103367539 issued for: 1. Auto coupler lower bush has excessive movement 2. Axle 3 brakes over stroking ensure all brakes fitted are adjusted to manufacturers specifications. Repairs completed by Izaak on R#8171. | \$0.00 |
| I-56 | Machinery Inspec | 12/05/2024 | 12/05/2024 | | | 0 | Internal Workshop - Night Shift | Defect Notice cleared. | \$0.00 |
| R-8171 | Machinery Defect | 12/03/2024 | 12/04/2024 | 592,220 | | 0 | Internal Workshop - Night Shift | REPLACED WHOLE RINGFEDER. REPLACED SLACK ADJUSTERS ON 2ND AXLE AND RE-ADJUSTED BRAKES. | \$0.00 |
| R-6953 | Trailing arm bush | 01/12/2024 | 11/19/2024 | 588,856 | | 0 | Internal Workshop - Night Shift | D&L ALIGNMENT REPLACED ALL TRAILING ARM BUSHES AND QUICK ALIGN BOLTS AND D BUSHES. | \$0.00 |
| S-6645 | B - 15k | 11/08/2024 | 11/12/2024 | 585,000 | 15,000 | 0 | Internal Workshop - Night Shift | SERVICE COMPLETED BY IZAAK H. ACTUALLY DONE AT 587516 KM. | \$0.00 |
| R-8124 | Exhaust clamp | 11/08/2024 | 10/28/2024 | 582,715 | | 0 | Internal Workshop - Night Shift | REPLACED CLAMP ON INLET OFF DPF. REPLACED BLOWN ORING ON INTERCOOLER PIPE. | \$0.00 |
| R-7946 | Bump stop | 09/17/2024 | 10/14/2024 | 578,999 | | 0 | Internal Workshop - Night Shift | REPLACED FRONT CAB BUMP STOPS AND CAB SHOCKS. | \$0.00 |
| S-6589 | A | 10/14/2024 | 14/10/2024 | 578,999 | | 0 | Internal Workshop - Night Shift | SERVICE COMPLETED BY IZAAK H. DRIVE SHAFT BOLT NEARLY FALLING OUT/REPLACE AND RETENSIONED. R/R 2X PARK LIGHT GLOBES. | \$0.00 |
| R-7980 | air bag | 09/24/2024 | 09/23/2024 | 573,928 | | 0 | Internal Workshop - Night Shift | REPLACE RIDE HEIGHT VALVE ON D/S SEAT. REPLACE AIR BAG ON 2ND AXLE RHS. | \$0.00 |
| S-6529 | C - 30k | 09/16/2024 | 09/16/2024 | 570,000 | 30,000 | 0 | Internal Workshop - Night Shift | SERVICE COMPLETED BY JARROD H. ACTUALLY DONE AT 571813 KM. | \$0.00 |
| R-7652 | BATTERY COVER | 07/08/2024 | 09/02/2024 | 567,572 | | 0 | Internal Workshop - Night Shift | REPLACED MISSING BATTERY COVER. REPLACED ALL BATTERY HOLD DOWNS. REPLACED ALL 4 BATTERY | \$0.00 |
| R-7860 | Air valve | 09/09/2024 | 08/30/2024 | 567,265 | | 0 | Internal Workshop - Night Shift | REPALCED LEAKING FITTING AT FIRWALL. REPLACED LEAKING HOSES AT RINGFEDER. REPLACED LEAKING AIRVALVE ON FIREWALL NEAR STEERING COLUM. REPLACED FRONT STEER LHS BRAKE HOSE. | \$0.00 |
| S-6486 | A | 08/29/2024 | 29/08/2024 | 567,242 | | 0 | Internal Workshop - Night Shift | SERVICE COMPLETED BY JARROD H. | \$0.00 |
| R-7766 | Water Leak | 07/30/2024 | 07/30/2024 | 558,954 | | 0 | Internal Workshop - Night Shift | Replaced plastic fitting for radiator water Return back into header tank. Internal Workshop - Night Shift SERVICE COMPLETED BY TYSON E. BOTTOM OF EXHAUST STACK PERISHED -ALL CRACKED TIGHTEN RHS TERP CABLE. | \$0.00 |
| S-6419 | B - 15k | 07/18/2024 | 07/18/2024 | 555,000 | 15,000 | 0 | Internal Workshop - Night Shift | ACTUALLY DONE AT 555486KM | \$0.00 |
| R-6674 | Air Fitting | 10/13/2023 | 07/01/2024 | 550,945 | | 0 | Internal Workshop - Night Shift | REPLACED FITTING Internal Workshop - Night Shift SERVICE COMPLETED BY TYSON E. FIT NEW PTO DRIVE AND REPLACED TRANS OIL. MISSING BATTERY BOX COVER. NEEDS BATTERY TIE DOWN BOLTS. | \$0.00 |
| S-6339 | A | 07/01/2024 | 01/07/2024 | 550,945 | | 0 | Internal Workshop - Night Shift | DIFF FILTER MOUNT ASSEMBLY LEAKING - NEEDS ORING BEHIND DIFF FILTER MOUNT. | \$0.00 |
| S-6318 | A | 06/20/2024 | 20/06/2024 | 547,666 | | 0 | Internal Workshop - Night Shift | SERVICE COMPLETED BY JARROD H. | \$0.00 |

| | | | | | | | | |
|--------|--------------------|------------|------------|---------|------|---|---|--------|
| R-7751 | Valve set | 08/06/2024 | 06/19/2024 | 553,627 | 0 | 0 | VCV MACK FOUND ROCKER CUPS STUCK REPLACED THE ONES IT NEEDED. VALVE SET CARRIEWD OUT. REPLACED ONE INJECTOR. INVOICE ATTACHED. | \$0.00 |
| R-7670 | Mirror, Steering w | 06/13/2024 | 06/13/2024 | 545,794 | 0 | 0 | Internal Workshop Fit new spotter mirror to bonnet Fit wheel balance bags into steer tyres Fit new hub caps to steer Realign steering wheel | \$0.00 |
| R-7657 | Steering wheel | 05/20/2024 | 05/20/2024 | 540,552 | 0 | 0 | Fit new steering wheel Oil thermostat solenoid Back pressure sensor and plug Fit bolt in back of turbo R&R horn pad Plugged in computer and truck isn't reading exhaust back pressure Test drive & read 200 + KPA | \$0.00 |
| R-7170 | Power Steering Le | 02/20/2024 | 05/20/2024 | 539,706 | 0 | 0 | Internal Workshop - Night Shift Oil and filter changed etc. and res lid gasket. | \$0.00 |
| S-6239 | E - 270k | 05/15/2024 | 05/20/2024 | 539,706 | 319 | 0 | Steering wheel stuffed. Replaced. | \$0.00 |
| R-7403 | Turbo | 04/11/2024 | 04/10/2024 | 531,521 | 0 | 0 | Internal Workshop - Night Shift Removed turbo and found cold side impellor nut come loose so got it replaced under warranty. Replaced turbo and gaskets/seals. Cleaned out intercooler. Replaced air filters. Remove front diff yoke and re-sealed and fitted tail shaft. All work carried out buy Tyson. | \$0.00 |
| R-7302 | Tarp | 03/15/2024 | 04/04/2024 | 530,947 | | 0 | Internal Workshop - Night Shift Both plastic ends replaced. | \$0.00 |
| R-7256 | Tarp bearing | 03/06/2024 | 04/04/2024 | 530,947 | | 0 | 7807 Internal Workshop - Night Shift Replaced broken bearing housing on passenger side tarp roller shaft | \$0.00 |
| S-6176 | A | 04/04/2024 | 04/04/2024 | 530,947 | 0 | 0 | 2nd axle tyres need replacing. Low tread. | \$0.00 |
| R-7400 | Air Leak | 04/03/2024 | 04/03/2024 | 530,637 | 0 | 0 | Internal Workshop - Night Shift Sourced parts from Mack Replace steer axle LH brake booster Flexible hose to booster Brass 90 into Booster | \$0.00 |
| R-7369 | Transmission | 04/10/2024 | 03/28/2024 | 529,588 | 0 | 0 | VCV VCV found it wasn't viable to rebuild transmission so replaced with new one and in this the clutch and actuator got replaced as well. Replaced faulty oil thermostat control valve. Replaced NOX sender. Full details attached on invoice. | \$0.00 |
| R-7368 | Aircon | 04/10/2024 | 03/27/2024 | 529,658 | 0 | 0 | A Grade Auto Repair Found leaking high side hose and replaced also replaced dryer and tx valve. Full details attached. | \$0.00 |
| R-7251 | Compressor | 03/07/2024 | 03/14/2024 | 529,563 | 0 | 0 | Internal Workshop - Night Shift Replaced main supply line from compressor to air dryer. due to it being full off carbon. Replaced broken signal line from the compressor to the air dryer. Removed purge valve and cleaned + refit. | \$0.00 |
| S-6129 | A | 03/14/2024 | 14/03/2024 | 529,563 | 0 | 0 | Internal Workshop - Night Shift | \$0.00 |
| R-7242 | Number plate ligh | 03/04/2024 | 03/04/2024 | 526,422 | 0 | 0 | Repair broke number plate light wiring. | \$0.00 |
| R-6675 | Sensor | 10/13/2023 | 02/19/2024 | 522,585 | 0 | 0 | Internal Workshop - Night Shift sensor at rear off oil filter housing cleaned at last service, no longer leaking (as at 19/2/24. | \$0.00 |
| S-6068 | A | 02/19/2024 | 19/02/2024 | 522,585 | 0 | 0 | | \$0.00 |
| R-7117 | Cruise Control | 02/05/2024 | 02/05/2024 | 518,457 | | 0 | Internal Workshop - Night Shift Replaced cruise control set switch | \$0.00 |
| R-7081 | Purge valve | 01/23/2024 | 01/23/2024 | 515,414 | 0 | 0 | Internal Workshop - Night Shift Replaced purge valve Found damaged braided hose from compressor. Got hose from Mack and replaced. | \$0.00 |
| S-5993 | B - 30K | 01/08/2024 | 01/09/2024 | 512,347 | 33,4 | 0 | Internal Workshop - Night Shift Removed and replaced LSH tarp cable | \$0.00 |
| R-7038 | Compressor | 12/15/2023 | 12/15/2023 | 510,465 | 0 | 0 | Internal Workshop - Night Shift Repair signal hose to compressor. Replace fitting and broken section of hose. | \$0.00 |
| R-6811 | Exhaust | 11/25/2023 | 12/14/2023 | 510,538 | | 0 | 7361 Internal Workshop - Night Shift Replaced rusted exhaust Y piece and joiners and also LHS exhaust elbow to stack and joiner. | \$0.00 |
| S-5930 | A | 11/16/2023 | 20/11/2023 | 502,373 | 0 | 0 | | \$0.00 |
| R-6759 | Check valve | 10/26/2023 | 10/26/2023 | 495,783 | 0 | 0 | Internal Workshop - Night Shift R&R Check Valve. QR Valve. | \$0.00 |
| R-6758 | Air Leak | 10/23/2023 | 10/23/2023 | 494,373 | 0 | 0 | Internal Workshop - Night Shift remove and replace williams valve. Had to go to mack to get one. | \$0.00 |
| R-6635 | Bump stop | 09/21/2023 | 10/12/2023 | 490,988 | | 0 | Internal Workshop - Night Shift Replaced cab bump stops and cab shock. | \$0.00 |
| R-6633 | Machinery Defect | 09/27/2023 | 10/12/2023 | 490,988 | 0 | 0 | top D/S cab clearance light in op. 1st axle P/S brake chamber leaking air leak from rear off cab area push rod over stroke 3rd axle D/S tyre deflated 3rd axle innner on P/S. All been done - see service sheet attached. | \$0.00 |
| S-5852 | A | 10/12/2023 | 12/10/2023 | 490,988 | 0 | 0 | 1/2 45 10mm elbow at air dryer leaking bad - JC done. | \$0.00 |
| I-13 | Machinery Inspec | 10/03/2023 | 10/03/2023 | | | 0 | Sensor at rear of oil filter housing starting to leak. JC done. Self clearing defects issued. Cleared by Jay as per attached. | \$0.00 |

| | | | | | | | | | |
|--------|----------------------|------------|------------|---------|--------|---|---------------------------------|--|--------|
| R-6575 | Tailshaft | 09/08/2023 | 09/21/2023 | 485,976 | 0 | 0 | Internal Workshop - Night Shift | Loose tailshaft bolts and nuts replaced. | \$0.00 |
| R-6574 | Fuel tank rubbers | 08/28/2023 | 09/21/2023 | 485,976 | 0 | 0 | Internal Workshop - Night Shift | Replaced tank strap rubbers. | \$0.00 |
| R-5143 | Trailing arm bush | 09/13/2022 | 09/21/2023 | 485,976 | | 0 | | Rear trailing arm bushes excessive play - worn. 21/9 - These are in serviceable condition, jacked up and checked with crow bar. No repair required. Service sheet attached. | \$0.00 |
| S-5802 | A | 09/08/2023 | 21/09/2023 | 485,976 | 0 | 0 | Internal Workshop - Night Shift | Front cab bump stops perishing - JC Trailer/Truck Coupling leaking - awaiting air coupling Replaced as per Jay Audit 8/9/23 | \$0.00 |
| R-6473 | Coupling | 07/26/2023 | 09/08/2023 | | | 0 | Internal Workshop - Night Shift | Park brake valve leaking. Replaced as per Jay Audit 8/9/23 | \$0.00 |
| R-6472 | Park Brake Valve | 07/17/2023 | 09/08/2023 | | | 0 | Internal Workshop - Night Shift | Removed and replaced faulty tailshaft bolts. | \$0.00 |
| R-6558 | Tail shaft | 08/30/2023 | 08/30/2023 | 479,768 | 0 | 0 | Internal Workshop - Night Shift | Tank rubbers need replacing - will need tanks almost empty (JC) Air fitting on air dryer leaking Top up diff oils | \$0.00 |
| S-5764 | B - 30K | 08/28/2023 | 08/28/2023 | 478,914 | 25,000 | 0 | Internal Workshop - Night Shift | Tighten loose tailshaft bolts - recommend replacing bolts and nuts - JC | \$0.00 |
| R-5841 | Air Leak | 02/06/2023 | 08/07/2023 | 472,288 | | 0 | Internal Workshop - Night Shift | Air leak on foot valve fixed. | \$0.00 |
| S-5714 | A | 08/04/2023 | 07/08/2023 | 472,288 | | 0 | | Cab bump stops need doing. | \$0.00 |
| R-6610 | Air Fitting | 08/04/2023 | 08/04/2023 | 0 | | 0 | Internal Workshop - Night Shift | R&R leaking air fitting. Internal Workshop - Night Shift | \$0.00 |
| R-6606 | Air Fitting, Brake S | 08/03/2023 | 08/03/2023 | 471,209 | 0 | 0 | Internal Workshop - Night Shift | Fit new exhaust brake valve. R&R all drive wheel bearings R&R all drive s-cam bushes and seals. R&R all slack adjusters on drive. R&R all brakes shoes and drums. Adjust wheel bearings and brakes. R&R air fitting Repair EBS wiring. | \$0.00 |
| R-6607 | Brakes, S-Cam, Sl | 08/02/2023 | 08/02/2023 | 470,766 | 0 | 0 | Internal Workshop - Night Shift | Remove 3rd axle wheels and brakes Remove hub and bearings Remove s-cam and slack adjuster R&R s-cam bushes and seals. Fit new slack adjuster and s-cam R&R wheel bearings and hub seals Fit brake shoes etc. Adjust wheel bearings and brakes Tension wheel nuts | \$0.00 |
| R-6292 | Cab Ride Height V | 06/06/2023 | 08/02/2023 | 470,766 | 0 | 0 | Internal Workshop - Night Shift | R&R Cabin ride height valve - was leaking. | \$0.00 |
| R-6464 | Slack adjusters | 07/21/2023 | 07/17/2023 | 466,157 | 0 | 0 | Internal Workshop - Night Shift | Replaced all slack adjusters R&R LH Tarp cable | \$0.00 |
| S-5659 | A | 07/17/2023 | 17/07/2023 | 466,157 | 0 | 0 | Internal Workshop - Night Shift | Park brake valve leaking - first cross member above 2nd axle - JC Trailer/truck coupling leaking - JC | \$0.00 |
| R-6394 | Electrical | 06/28/2023 | 06/28/2023 | 462,006 | 0 | 0 | Internal Workshop - Night Shift | Fitted new flasher cam RH tarp cable frayed - replaced Short flex exhaust leaking | \$0.00 |
| S-5612 | A | 06/26/2023 | 26/06/2023 | 461,270 | 0 | 0 | Internal Workshop - Night Shift | Cab bump stops worn | \$0.00 |
| T-117 | Steer Tyre | 06/08/2023 | 06/08/2023 | 456,357 | 0 | 0 | Carroll's Tyres | 2 new steer tyres | \$0.00 |
| R-5954 | Drag link | 03/06/2023 | 06/06/2023 | 456,309 | | 0 | Internal Workshop - Night Shift | Drag link U/S. Replaced drag link supplied by VCV Daytime running lights inop. Fixed plug was off. Oil leak back LHS corner rocker cover. Fixed reset gasket. Cabin ride height valve leaking. JC. Rotated drive tyres. Fitted 2 x new steer tyres supplied by Carol Tyres R&R Rh side exhaust elbow & flex at stack | \$0.00 |
| S-5548 | A | 06/06/2023 | 06/06/2023 | 456,309 | 0 | 0 | | Replaced 6 injectors & valve set done by Knights diesel. | \$0.00 |
| R-5955 | Emergency Valve | 03/08/2023 | 03/08/2023 | 453,531 | | 0 | Internal Workshop - Night Shift | Everything from front of engine onwards replaced due to crash. All done by PJ's. Invoice pending. Replaced emergency valve on top of compressor. Jay completed on site. Completed by Garth - drag link U/S (R-5954). | \$0.00 |
| S-5338 | C - 90K | 03/06/2023 | 03/06/2023 | 453,174 | 92,000 | 0 | | Fire extinguisher out of date. Fan shroud U/S - pics sent to Jay. | \$0.00 |
| R-5936 | Brake booster | 02/10/2023 | 02/10/2023 | 445,426 | | 0 | Internal Workshop - Night Shift | Tyson - R&R leaking brake booster on RHS 2nd drive. Adjusted brakes. | \$0.00 |

| | | | | | | | | | | | | | | | |
|--------|----------------|------------|------------|---------|------|---|---------------------------------|---|--|---|---|---|---|--|--------|
| R-5609 | Turbo | 12/06/2022 | 02/06/2023 | 443,499 | 0 | 0 | Internal Workshop - Night Shift | Replace turbo as preventative maintenance. VCV invoice attached. Completed on service 5142. | \$0.00 | | | | | | |
| R-5038 | Air Leak | 08/22/2022 | 02/06/2023 | 443,499 | 0 | 0 | 5215 | Damaged. . Air leak under cab. Jay - leak has taking up. | \$0.00 | | | | | | |
| R-5032 | Hydraulic hose | 08/19/2022 | 02/06/2023 | 443,499 | 0 | 0 | 5199, 5 | Other. Inspect Hydraulic Hosing (Visual). Leaking. 13/09/22 - Izaak - hoist cylinder; have to monitor. 06/02/2023 - Tyson - has been done previously. | \$0.00 | | | | | | |
| S-5252 | A | 02/06/2023 | 06/02/2023 | 443,499 | 0 | 0 | 0 | Internal Workshop - Night Shift | Completed by Tyson. | | | | | | |
| R-5774 | Guard | 01/17/2023 | 01/17/2023 | 437,100 | 0 | 0 | 0 | Re-secure LHS batteries & brackets. | \$0.00 | | | | | | |
| R-5142 | O'rings | 09/13/2022 | 01/16/2023 | 437,100 | 0 | 0 | 0 | Need 3/8 BSP - 3/8 airline 90 degree air fitting. Air leak on foot valve (R-5841). | \$0.00 | | | | | | |
| R-4955 | Engine | 08/15/2022 | 01/16/2023 | 437,100 | 0 | 0 | 0 | 5176 | Internal Workshop - Night Shift | Garry - removed LHS rear guard and fit new guard. | | | | | |
| S-5204 | A | 01/16/2023 | 16/01/2023 | 437,100 | 0 | 0 | 0 | 0 | Next B service will need to replace oil fill o'rings on engine and dip stick o'ring on engine. Tyson replaced o'ring. Izaak replaced dip stick at a previous date. | \$0.00 | | | | | |
| R-5713 | Purge valve | 01/13/2023 | 01/13/2023 | 437,100 | 0 | 0 | 0 | 0 | Other. Other : Major Concerns (Take pics). Engine not running on all cylinders at warm up, jay is aware of problem. Jay - this has stopped. No repairs required, | \$0.00 | | | | | |
| R-5595 | Oil leak | 12/05/2022 | 12/14/2022 | 432,865 | 0 | 0 | 0 | 5746 | Internal Workshop - Night Shift | Completed by Tyson. | | | | | |
| R-5610 | Tyre | 12/09/2022 | 12/09/2022 | 428,966 | 0 | 0 | 0 | 0 | Repaired tailgate switch. | \$0.00 | | | | | |
| S-5142 | A | 12/06/2022 | 06/12/2022 | 429,840 | 0 | 0 | 0 | 0 | Fitted aluminum cap to passenger side steps. | \$0.00 | | | | | |
| S-5082 | B - 30K | 11/14/2022 | 11/15/2022 | 422,944 | 31,7 | 0 | 0 | 0 | Straightened bottom step. | \$0.00 | | | | | |
| R-5344 | Dipstick | 10/21/2022 | 11/03/2022 | 418,863 | 0 | 0 | 0 | 0 | Garth - Pressure tested cooling system; all okay, holding pressure at 15 bar. No leaks and no signs of leak at water pump. | \$0.00 | | | | | |
| R-5141 | Hose | 09/13/2022 | 11/03/2022 | 418,863 | 0 | 0 | 0 | 0 | Internal Workshop - Night Shift | EMERGENCY VALVE BLOWING OFF ON COMPRESSOR Garth - R&R pressure valve on compressor. Found A/C compressor U/S; replaced with new. Re-gas; tested okay. | | | | | |
| S-5057 | A | 11/03/2022 | 03/11/2022 | 418,863 | 0 | 0 | 0 | 0 | Internal Workshop - Night Shift | Other. Check for any coolant or oil leaks - visual. Oil leak, not sure where from Tyson - degreased engine and underside of truck. Leak was already repaired. | | | | | |
| R-5260 | Maxi Brakes | 10/09/2022 | 11/02/2022 | 417,982 | 0 | 0 | 0 | 0 | Bridgestone Wacol | Replaced 3rd and 4th drive axle tyres. Invoice attached. | | | | | |
| R-4949 | Solenoid | 08/12/2022 | 11/02/2022 | 417,982 | 0 | 0 | 0 | 0 | 5168, 5 | Internal Workshop - Night Shift | Completed by Tyson. | | | | |
| R-5402 | Exhaust seal | 10/27/2022 | 10/27/2022 | 422,882 | 0 | 0 | 0 | 0 | 0 | R&R turbo and all gaskets/bolts | R&R dipstick & drain engine oil to correct level. | | | | |
| S-4979 | A | 10/10/2022 | 09/10/2022 | 410,844 | 0 | 0 | 0 | 0 | 0 | 0 | Completed by Izaak. | | | | |
| R-5171 | Mud Flaps | 09/20/2022 | 09/27/2022 | 406,719 | 0 | 0 | 0 | 0 | 5362 | Damaged. Check oil level. End has fallen off dipstick | \$0.00 | | | | |
| T-64 | Tyre | 09/16/2022 | 09/16/2022 | 405,085 | 0 | 0 | 0 | 0 | 0 | 0 | Internal Workshop - Night Shift | Needs new heater hoses. Izaak - replaced at last B service. | | | |
| R-4868 | Brake Reline | 07/28/2022 | 09/13/2022 | 404,109 | 0 | 0 | 0 | 0 | 0 | 0 | Internal Workshop - Night Shift | Completed by Izaak. | | | |
| | | | | | | | | | | | | Internal Workshop - Night Shift | Garth - Replaced exhaust seal from bend to muffler due to machinery defect. | \$0.00 | |
| | | | | | | | | | | | | | Izaak - maxi brake relay valve leaking out exhaust; will need to replace when we get valve in stock. Picture taken. | \$0.00 | |
| | | | | | | | | | | | | | Both tarp cables replaced. | \$0.00 | |
| | | | | | | | | | | | | | Damaged. Mud flap needs to be put back on. Garry - replaced mud flap. | \$0.00 | |
| | | | | | | | | | | | | | Internal Workshop - Night Shift | Garth - Repair LH inner 3rd axle tyre. | \$0.00 |
| | | | | | | | | | | | | | Brake reline due 1st steer axle next week. Izaak - brake reline done; all good. | \$0.00 | |

| | | | | | | | | | |
|--------|-------------------|------------|------------|---------|-------|---|---|--|--------|
| R-4867 | Shocks | 07/28/2022 | 09/13/2022 | 404,109 | 0 | 0 | Izaak - all drive shocks replaced. Izaak - replaced all drive shockies. Relined steer axle new shoes, new drums. Replaced exhaust clamp at turbo and realign to miss chassis. Needs new heater hoses (R-5141). Needs 1 x air fitting on air dryer - got photo. Next B service will need to replace oil fill o'rings on engine and dip stick o'ring on engine (R5142). | \$0.00 | |
| S-4891 | A | 09/13/2022 | 13/09/2022 | 404,109 | 0 | 0 | Rear trailing arm bushes excessive play - worn (R-5143). | \$0.00 | |
| R-5149 | A/con fan | 09/12/2022 | 09/12/2022 | 404,109 | 0 | 0 | Fit new a/c fan motor. Tyson - Replaced fan motor. | \$0.00 | |
| T-61 | Rotation | 09/05/2022 | 09/05/2022 | 403,054 | 0 | 0 | Internal Workshop - Night Shift Izaak tyres have been rotated and tensioned to spec; all good. Other. . Plate needs to be refitted as it had to be removed so I could take dog off, plate was refitted at some point incorrectly, please make sure plate is fitted in correct position. Plate is on passenger side floor in cab. Izaak - refit | \$0.00 | |
| R-5074 | Guard | 08/30/2022 | 09/01/2022 | 402,116 | 0 | 0 | 5267 aluminium plate. | \$0.00 | |
| R-5073 | Mud Flaps | 08/30/2022 | 09/01/2022 | 402,116 | 0 | 0 | 5266 Damaged. . Mud flap needs to be refitted Izaak - refit mud flap. | \$0.00 | |
| R-5055 | Windscreen | 08/31/2022 | 08/31/2022 | 402,116 | 0 | 0 | REPLACE WINDSCREEN WIPER MOTOR Garth - fit new wiper motor and 2 x wiper blades. | \$0.00 | |
| S-4812 | A | 08/23/2022 | 23/08/2022 | 400,305 | 0 | 0 | Tyson - rotated loose exhaust dump pipe around and tightened loose clamp. | \$0.00 | |
| R-4946 | Tarp cable | 08/11/2022 | 08/11/2022 | 397,334 | 0 | 0 | 5164 Other. Inspect Tarp condition & operation. Cable loose on driver's side (sagging). Garry - re-tensioned tarp cable. Garth - 2nd and 3rd axle shockies U/S (R-4867). Brake reline due 1st steer axle next week (R-4868). Tarp cables need to be replaced. | \$0.00 | |
| S-4747 | A | 07/28/2022 | 28/07/2022 | 394,608 | 0 | 0 | Has a few air leak; have repaired a couple - still needs attention. Damaged. Inspect Wipers and blades operate smoothly. Windscreen wipers need replacing one blade has broken off | \$0.00 | |
| R-4762 | Wipers | 07/21/2022 | 07/26/2022 | 394,212 | 0 | 0 | 5040 the bracket Garth - replaced wiper blades with new. Steer axle reline due next service. 24/05/22 Tyson - Not needed yet. 21/07/22 Jay - Paul the fitter made a mistake and do not need to be done. | \$0.00 | |
| R-3778 | Axle re-line | 01/26/2022 | 07/21/2022 | | 0 | 0 | Driver is complaining there is a banging noise coming from rear when loaded and unloaded. Garth: checked under truck and couldn't fault. Took for test drive and couldn't fault. Need more info. Jay said to close as the driver has not made further comment. | \$0.00 | |
| R-4689 | Suspension | 07/11/2022 | 07/11/2022 | 392,345 | 0 | 0 | Garth - LH parker blown; replaced globe. | \$0.00 | |
| S-4676 | B - 30K | 07/06/2022 | 07/07/2022 | 391,199 | 30,4 | 0 | 0 | Fire extinguisher out of date. Garth - replaced a/c tensioner and belt with new. Fix air leaks. Tighten loose ground poles. Tighten up bolts on PTO. Check water pump - all okay with no leaks. | \$0.00 |
| S-4644 | A | 06/15/2022 | 22/06/2022 | 387,375 | 0 | 0 | Fit missing reflectors. | \$0.00 | |
| R-4459 | Tyres | 05/27/2022 | 05/27/2022 | 379,304 | 0 | 0 | Paul: rotated drive tyres. | \$0.00 | |
| R-3641 | Ring Feeder | 11/22/2021 | 05/24/2022 | 379,313 | 0 | 0 | Internal Workshop Ring feeder need re-kit asap. Rekitted ring feeder. | \$0.00 | |
| R-3640 | Shocky | 11/22/2021 | 05/24/2022 | 379,313 | 0 | 0 | Internal Workshop RH steer shocky needs replacing (leaking bad). Replaced both steer shockies. | \$0.00 | |
| R-2914 | Lights | 06/08/2021 | 05/24/2022 | 379,313 | 0 | 0 | Internal Workshop Light under RH door not working. Wiring pulled out of light - needs new stirp light. Replaced LED light. RH number plate light N/W - replaced broken wires. Replaced both steer shockies. Replaced LHR mud flap. Replaced feeder. | \$0.00 | |
| S-4558 | A | 05/24/2022 | 24/05/2022 | 379,313 | 0 | 0 | Replaced DS LED step light. | \$0.00 | |
| R-4363 | A/c filter | 05/18/2022 | 05/18/2022 | 378,103 | 0 | 0 | Fit new a/c filter. | \$0.00 | |
| R-6927 | Clutch, Clutch Ac | 06/25/2021 | 05/05/2022 | 279,947 | 6,769 | 0 | VCV Removed and replaced the air valve spool Replaced clutch. Replaced clutch actuator. Invoice attached. | \$0.00 | |

| | | | | | | | | |
|--------|-------------------|------------|------------|---------|----|---|---|--------|
| R-4257 | Engine Fan, Exha | 05/03/2022 | 05/03/2022 | 374,914 | 0 | 0 | Flipped both steer tyres on rims and fit with balancing bags. Make sure inside tyre is dry. Removed exhaust brake valve and fit to U516 and fit new one to this truck. Replaced engine fan wiring. Replaced indicator stalk. | \$0.00 |
| S-4482 | A | 04/21/2022 | 21/04/2022 | 374,615 | 0 | 0 | 2 drive shocks leaking. 1 steer shock leaking. Steer brakes 30% next service maybe. Air leak 3/8 BSP to 1/2 airline straight. R&R leaking air fitting on gearbox. Indicator stalk needs replacing (no hazards). | \$0.00 |
| S-4416 | A | 03/31/2022 | 30/03/2022 | 372,608 | 0 | 0 | Horten fan wiring damaged; may be repairable. Air fitting top LH gearbox leaking. SPN 4225. SPN 647. SPN 3226. Both RH drive shocks leaking. RH steer shock leaking. | \$0.00 |
| S-4311 | A | 03/02/2022 | 01/03/2022 | 370,192 | 0 | 0 | Swapped AC switches from 5415 - made no difference; fan hub still engaged. Air leak at air dryer (fitting at back). Air leak at gearbox LHS top. RH steer shock absorber leaking. | \$0.00 |
| R-3974 | Clamps, Solenoid | 02/21/2022 | 02/21/2022 | 370,192 | 0 | 0 | Ring feeder worn. | \$0.00 |
| R-3918 | Mudguard poles | 02/11/2022 | 02/11/2022 | 368,212 | | | Fit new exhaust turbo clamp. Fit new exhaust brake solenoid. | \$0.00 |
| R-3915 | Compressor | 02/09/2022 | 02/09/2022 | 367,874 | 0 | 0 | Tightened mud flap pole and fitted 2 x mud flaps to rear. | \$0.00 |
| R-3827 | Fan Hub | 02/03/2022 | 02/06/2022 | 367,270 | 0 | 0 | Travel to Wacol and pick up parts. Removed and replaced compressor. Removed and replaced air dryer. Replaced air cooler under cab. Test and check - all good. | \$0.00 |
| R-3765 | Exhaust sensor, H | 01/30/2022 | 01/30/2022 | 365,083 | 0 | 0 | Replaced fan blade set up. | \$0.00 |
| R-3761 | Water pump | 01/26/2022 | 01/26/2022 | 364,739 | 0 | 0 | Jay replaced coolant header tank and exhaust back pressure sensor. No paperwork as Jay completed the job at 530am Monday due to a fault from Saturday. | \$0.00 |
| S-4206 | A | 01/26/2022 | 26/01/2022 | 364,739 | 0 | 0 | Drain coolant, remove water pump, replace rubber gasket, re-fit pump, refill coolant. LH front parker U/S. Missing RH rear mud flap. Toolbox hinge U/S. Front shockies U/S. Air line leaking in behind air tank. Drive shockies U/S. Oil leak from PTO. Steer axle reline due next service. Replace RHS rear plastic guard. Rotate drive tyres. | \$0.00 |
| R-3717 | Coolant Sensor | 01/11/2022 | 01/11/2022 | 361,133 | 0 | 0 | Fit 5 x wheel nut indicators to LHS steer. | \$0.00 |
| R-3488 | Brakes | 10/20/2021 | 01/10/2022 | 360,711 | 0 | 0 | 3831 Internal Workshop Replaced low coolant level sensor. | \$0.00 |
| S-4165 | C - 90K | 01/10/2022 | 01/10/2022 | 360,711 | 90 | 0 | RH front steer shock leaking. LH rear drive shock leak. Slight leak at water pump - has new pump, could replace gasket only. Fitted ring feeder pad. | \$0.00 |
| R-3677 | Air blower | 12/09/2021 | 12/15/2021 | 358,219 | 0 | 0 | NOTE: Service was originally a B. Once changed to C there were additional items that required completion. There were completed on 06/02 (Jay back dated sheet to 10/01). All is good in the hood. | \$0.00 |
| | | | | | | | Replaced by Garth. | \$0.00 |

| | | | | | | | | | |
|--------|--------------------|------------|------------|---------|--------|------|------------------------|---|--------|
| S-4141 | A | 12/14/2021 | 15/12/2021 | 357,831 | 0 | 0 | Internal Workshop | Replace brake air line with new at front of draw bar fitting x 4 hose clamps. Tested all okay. Repair | \$0.00 |
| R-3719 | Brake Air Line, Wi | 12/06/2021 | 12/06/2021 | 355,327 | 0 | 0 | Internal Workshop | Replace brake air line with new at front of draw bar fitting x 4 hose clamps. Tested all okay. Repair | \$0.00 |
| R-3580 | Starter motor | 11/16/2021 | 11/22/2021 | 352,891 | 0 | 0 | Internal Workshop | Done. | \$0.00 |
| S-4069 | A | 11/22/2021 | 22/11/2021 | 352,891 | 0 | 0 | Internal Workshop | RH steer shocky needs replacing (leaking bad). Ring feeder need rehit asap. | \$0.00 |
| R-3631 | Starter motor | 11/10/2021 | 11/10/2021 | 349,828 | 0 | 0 | Internal Workshop | Water pump pissing out - replaced. Fit new starter motor solenoid. | \$0.00 |
| S-3982 | A | 10/20/2021 | 20/10/2021 | 345,133 | 0 | 0 | Internal Workshop | Jack. RH steer shocky leaking. Repaired number plate holder rear. | \$0.00 |
| R-3552 | Wheel nuts | 10/18/2021 | 10/18/2021 | 344,608 | 0 | 0 | Internal Workshop | Replace LH front wheel stud and nut. Need chrome caps and indicators to suite new wheel nuts. | \$0.00 |
| R-3195 | Brakes | 08/10/2021 | 09/30/2021 | 343,706 | 0 | 0 | Internal Workshop | Drive brakes low - need doing. Garth. Remove 1st and 2nd drive wheels, brake drums and brake shoes and replace with new drums and shoes. Refit wheels - all torqued to spec. Adjusted brakes - tested okay. | \$0.00 |
| R-3194 | Tyre | 08/10/2021 | 09/28/2021 | 343,706 | 0 | 0 | Internal Workshop | Jack. Replaced seal. | \$0.00 |
| R-2781 | Gearbox mounts | 05/05/2021 | 09/28/2021 | 343,706 | 0 | 0 | Internal Workshop | Jack. Replaced both mounts. | \$0.00 |
| S-3880 | A | 09/28/2021 | 28/09/2021 | 343,706 | 0 | 0 | Internal Workshop | Done by Jack. Need seals for oil fill and dipstick tube. Fitted 2 x runouts to rear axle RHS. Fit side marker ear bin RHS. | \$0.00 |
| R-3277 | Gearbox mounts | 09/22/2021 | 09/27/2021 | 343,706 | 0 | 0 | Internal Workshop | Garth. Replaced both mounts. | \$0.00 |
| R-3196 | Drag link | 08/10/2021 | 09/27/2021 | 343,706 | 0 | 0 | Internal Workshop | Play in drag link. Done by Garth. Replaced draglink. | \$0.00 |
| R-3172 | Tarp cable | 08/10/2021 | 08/10/2021 | 339,158 | 0 | 0 | Internal Workshop | Replace tarp cables truck and trailer Done by Jarrod. | \$0.00 |
| R-3143 | Wiper blades | 08/09/2021 | 08/10/2021 | 339,158 | 0 | 0 | 3352 Internal Workshop | Wiper blades need replacing Done by Jarrod. | \$0.00 |
| R-3110 | Mudguard | 07/28/2021 | 08/10/2021 | 339,158 | 0 | 0 | 3295 Internal Workshop | Done by Jarrod. | \$0.00 |
| R-2919 | Tarp cable | 06/09/2021 | 08/10/2021 | 339,158 | 0 | 0 | Internal Workshop | Done by Jarrod. | \$0.00 |
| R-2691 | Cab mounts, Cab | 04/12/2021 | 08/10/2021 | 339,158 | 0 | 0 | Internal Workshop | Replaced by Jarrod. Done by Jarrod. 1st drive input leak. PTO fitting leak Front cab mounts done. Gearbox mounts. Drive brakes low - need doing. Play in drag link. | \$0.00 |
| S-3777 | A | 08/10/2021 | 10/08/2021 | 339,158 | 0 | 0 | Internal Workshop | Replaced carb cables. | \$0.00 |
| R-3122 | Tyres | 08/02/2021 | 08/02/2021 | 336,233 | 0 | 0 | Carroll's Tyres | 3rd axle replaced by Carroll Tyres. | \$0.00 |
| R-2943 | Turbo | 05/27/2021 | 07/23/2021 | 334,394 | 0 | 2813 | Internal Workshop | Same boost issue appeared 23/7 - replaced faulty AVU valve | \$0.00 |
| R-3028 | Air leaks | 07/05/2021 | 07/15/2021 | 332,417 | 0 | 0 | Internal Workshop | Jarrod inspected air leak on 6/7 - leaking at valve exhaust LH lower engine block Garth replaced valve - 14/7 | \$0.00 |
| S-3697 | B - 15k | 07/09/2021 | 07/15/2021 | 332,417 | 32,468 | 0 | Internal Workshop | Service done by Jarrod | \$0.00 |
| S-3657 | A | 06/29/2021 | 29/06/2021 | 328,434 | 0 | 0 | Internal Workshop | Repaired air leak under cab | \$0.00 |
| R-2957 | Window Switch | 06/21/2021 | 06/21/2021 | 325,971 | 0 | 0 | Internal Workshop | Service done by Garth Switched over DS window switch PS window switch - job done by Jay | \$0.00 |

| | | | | | | | | | | |
|--------|--------------------|------------|------------|---------|-------|---|------|---|---|--|
| | | | | | | | | | Internal Workshop | Service done by Jarrod |
| | | | | | | | | | Replaced air dryer filter | |
| | | | | | | | | | Replaced purge valve & emergency valve on compressor | |
| | | | | | | | | | Defects: Fresh damage RHF bumper | |
| | | | | | | | | | Fan shroud cracked | |
| | | | | | | | | | Cam cover rear of cyl head leaking | |
| | | | | | | | | | Ringfeder need rekit | |
| | | | | | | | | | Exhaust repairs required | |
| | | | | | | | | | Gearbox mounts needs doing ASAP | |
| S-3582 | A | 06/02/2021 | 02/06/2021 | 321,566 | | | | 0 | Steering wheel struts loose | |
| R-2890 | Mudflaps | 06/01/2021 | 06/01/2021 | 321,365 | | | | 0 | Internal Workshop | Replaced 2 x mudflaps |
| R-2880 | Accident damage | 05/20/2021 | 05/20/2021 | | | | | 0 | Fixer Windscreens | Supply & install half screen RH - accident damaged |
| R-2859 | Accident damage | 05/20/2021 | 05/20/2021 | 317,558 | | | | 0 | Internal Workshop | Fit new bull bar Repaired broken wiring for lights RHS Job done by Garth |
| | | | | | | | | | Internal Workshop | Service done by Jarrod |
| | | | | | | | | | Tightened RHR guard post | |
| | | | | | | | | | Replace Williams valve | |
| | | | | | | | | | Defects: PTO Leaking | |
| | | | | | | | | | Gearbox mounts need replacing | |
| S-3497 | A | 04/27/2021 | 28/04/2021 | 312,541 | 0 | 0 | | 0 | Transmission fault - air leak fitting top of g/box | |
| R-2718 | Central Locking, V | 04/20/2021 | 04/20/2021 | 310,016 | 0 | 0 | 2451 | 0 | Internal Workshop | |
| | | | | | | | | | Internal Workshop | Tightened PTO hydraulic lines and check over pump - cleaned off oil - test - all ok Grease and checked under truck Job done by Garth |
| R-2695 | Hydraulic Line | 04/08/2021 | 04/08/2021 | 307,001 | | | | 0 | Internal Workshop | Service done |
| | | | | | | | | | Puncture repair 3rd left outer | |
| | | | | | | | | | DEFECTS: 3rd axle RH shock leaking | |
| | | | | | | | | | Cab mounts worn | |
| | | | | | | | | | Multiple fault codes | |
| S-3426 | A | 04/06/2021 | 06/04/2021 | 307,001 | 7,985 | 0 | | 0 | RH Windscreen chipped | |
| R-2586 | Hydraulic fitting | 03/15/2021 | 03/15/2021 | 0 | 0 | 0 | | 0 | Shephards | Replaced 3 x hydraulic fittings & 20L of hydraulic oil |
| | | | | | | | | | Internal Workshop | Service done by Jarrod |
| | | | | | | | | | Defects: 2nd axle RH shock leaking | |
| | | | | | | | | | 3rd axle shock soft | |
| S-3336 | B - 15k | 02/18/2021 | 03/04/2021 | 299,949 | 16,1 | 0 | | 0 | Cab mounts worn | |
| | | | | | | | | | Internal Workshop | D SERVICE DONE AT 299949 ON THE 4/03/2021. CHANGED BACK TO 270000KMS IN GEARBOX TO MAKE THE SERVICE SHEDULE REALIGN. THIS WILL HAVE NO EFFECT ON DRAIN INTERVAL. BRAD TURNER - 1/02/2022 |
| S-3337 | D - 90k | 02/17/2021 | 03/03/2021 | 270,000 | 17,1 | 0 | | 0 | Job done by Jarrod - changed transmission oil & changed coolant | |
| | | | | | | | | | Internal Workshop | Checked for punctures - could not find any leaks Checked tyre pressures - all ok DEFECT |
| R-2542 | Tyres | 02/24/2021 | 02/24/2021 | 297,560 | 0 | 0 | 1785 | 0 | NOTICED: Engine light on - Code MID130 PSID27 FMI8 (unusual pulse width frequency) - trans system fault | |
| | | | | | | | | | Internal Workshop | Normal engine oil sample received Normal rear diff oil sample received Normal front diff oil sample received |
| R-2522 | Oil sample | 02/22/2021 | 02/22/2021 | | | | | 0 | | |
| R-2512 | Tyres | 02/04/2021 | 02/04/2021 | 279,040 | | | | 0 | Millards | Went to Millards - done truck drive tyre rotation - front to back |
| | | | | | | | | | Internal Workshop | Service done by Laine |
| S-3274 | A | 02/02/2021 | 02/02/2021 | 291,498 | 7,558 | 0 | | 0 | Transmission fault code : "Check trans at next stop" | |
| R-2387 | Fitting | 01/25/2021 | 01/25/2021 | 289,386 | 7,501 | 0 | | 0 | Internal Workshop | Travel to Maxi parts for fitting - replaced RHR airbag fitting Job done by Laine & Jarrod |
| | | | | | | | | | Internal workshop | Secured wiring to blinker V-clamp behind exhaust flap section was extremely loose - repositioned clamp & tightened |
| R-2209 | Exhaust leak, Ligh | 12/02/2020 | 12/02/2020 | 280,048 | 0 | 0 | | 0 | | |
| R-1694 | Battery | 11/19/2020 | 11/19/2020 | 277,618 | 0 | 0 | | 0 | internal workshop | Replaced 4 x batteries supplied by Maxiparts |
| R-1690 | Air leaks | 11/18/2020 | 11/18/2020 | 277,616 | 0 | 0 | | 0 | Internal Workshop | Repaired air leak |

| | | | | | | | | |
|--------|--------------------|------------|------------|---------|-------|-------|---|--------|
| R-1208 | Exhaust | 11/11/2020 | 11/13/2020 | 275,565 | 0 | 0 | Internal Workshop Replaced exhaust manifold gasket together with A service on 13/11/2020 Internal workshop A service done Pre-machinery check over done Replaced exhaust manifold gasket Degreased & cleaned PTO & air dryer & slack adjusters RHR guard & loop kit damaged - replaced loop kit | |
| S-1633 | A | 11/13/2020 | 13/11/2020 | 275,565 | 0 | 0 | Replaced LH guard & post | |
| R-1207 | Mudguards | 11/11/2020 | 11/11/2020 | 0 | 0 | 0 | Internal Workshop Tightened mudguard | |
| R-774 | Tyres | 10/27/2020 | 10/27/2020 | 273,114 | 0 | 0 | Internal Workshop Tyre rotation done | |
| R-688 | Bolts | 10/27/2020 | 10/27/2020 | 0 | 0 | 0 | Internal Workshop Cleaned up thread & replaced bolt Internal Workshop A service done Rotated drive tyres Repaired puncture Tightened both rear guard posts | |
| S-911 | A | 10/27/2020 | 27/10/2020 | 273,114 | 7,061 | 0 | DEFECTS: Pressure fitting in hydraulic pump leaking oil Internal Workshop C SERVICE COMPLETED AT 283096 ON THE 20/10/2020. ADJUSTED IN GEARBOX BACK TO 270000. THIS WILL HAVE NO EFFECT ON THE NEXT SERVICE AS IT WILL ACTUALLY BE BOUGHT FORWARD BY 13000KMS. BRAD TURNER - 1/02/2022 Oil weep at engine breather Drivers window tint poor Fan shroud cracked Cab mounts & cab shocks worn Oil leak at PTO fitting 2nd axle shock leaking | |
| S-2940 | C - 30k | 10/19/2020 | 10/19/2020 | 270,000 | 17,1 | 0 | 3rd & 2nd axle shocks worn | \$0.00 |
| R-431 | Solenoid Valve | 10/16/2020 | 10/16/2020 | 270,579 | 0 | 0 | Internal Workshop Replaced starter motor relay solenoid | |
| R-415 | Tarp motor | 10/12/2020 | 10/13/2020 | 269,473 | | 0 | Internal Workshop Checked & adjusted tarp cable - checked operation - all ok | |
| S-564 | A | 10/06/2020 | 06/10/2020 | 267,550 | 6,907 | 0 | Internal Workshop A service done Internal Workshop Replaced RHF tarp pulley - checked operation - tested ok - no need to replace tarp control box | |
| R-384 | Mirror, Tarp cable | 10/01/2020 | 10/01/2020 | 266,785 | 0 | 0 | Removed & tightened blind spot mirror Internal Workshop Found: replaced 2 x tarp cables on trailer Replaced 1 x tarp cable on truck Tarp motor auto shut off not working - have to stop motor manually - new motor to be ordered | |
| R-380 | Tarp cable | 09/30/2020 | 09/30/2020 | 266,433 | 0 | 0 | Replaced missing wheel nut cover & indicator | |
| R-352 | Wheel nut cover | 09/21/2020 | 09/21/2020 | 262,880 | 0 | 0 | Internal workshop checked trailer & truck up and down alarm and visual indicator working for both - could not fault operation - could not get fault to occur - replaced body up switch | |
| R-891 | Body up alarm | 09/15/2020 | 09/15/2020 | 261,812 | | 0 | Millards All drive tyres replaced by Millards A service done Re-positioned RHR guard post & tightened post Nip up fitting at PTO - was weeping DEFECTS: 3rd axle LH outer sidewall damaged | |
| R-890 | Tyres | 09/04/2020 | 09/04/2020 | 258,185 | | 0 | 2nd axle LH inner bald - need replacing | |
| S-489 | A | 09/03/2020 | 03/09/2020 | 258,165 | 0 | 0 | Replaced mudflap & chain for ringfeder | |
| R-265 | Mudflaps | 08/25/2020 | 08/25/2020 | 255,150 | 6,591 | 0 | Found hole in line behind airtank & chassis LHR of cab - removed all cable ties & loosened clamps - moved airtank cut hole out & reroute hose - travel to Mack for fittings & hose - repaired hole - reassembled | |
| R-240 | Air leaks | 08/12/2020 | 08/12/2020 | 252,385 | 6,515 | 0 | Replaced power steering filter | |
| S-429 | D - 90k | 08/11/2020 | 08/11/2020 | 252,105 | 647 | 6,504 | Done valve set Service done | |
| S-431 | D - 90k | 08/07/2020 | 08/07/2020 | 251,458 | 301 | 0 | Replaced tailgate switches Power steering filter on back order | |
| S-414 | D - 90k | 08/06/2020 | 08/06/2020 | 251,157 | 251 | 6,479 | Engine oil sample done | |

| | | | | | | | | |
|-------|-------------------|------------|------------|---------|-------|---|--|-------------------------------------|
| R-194 | Lights | 07/23/2020 | 07/23/2020 | 246,909 | 6,382 | 0 | Replaced blown globe Service done | |
| S-358 | A | 07/17/2020 | 07/17/2020 | 245,273 | 6,437 | 0 | Tightened fitting on hydraulic pump | |
| R-163 | Ringfeder | 07/16/2020 | 07/16/2020 | 244,834 | 0 | 0 | Rotated drive tyres Straightened bent aluminium checker plate both sides of ringfeder | |
| R-170 | Mudflaps, Mudgu: | 07/15/2020 | 07/15/2020 | 244,511 | 0 | 0 | Replaced RHR mudguard Replaced LHR mudflap | |
| R-151 | Tyre repairs | 07/10/2020 | 07/10/2020 | 243,950 | 0 | 0 | Repaired LHS inside puncture Internal Workshop A service done | |
| S-294 | A | 06/29/2020 | 29/06/2020 | 240,288 | 6,230 | 0 | Repaired 3rd axle RHS mudguard | |
| R-92 | Brakes | 06/10/2020 | 06/10/2020 | 235,076 | 0 | 0 | Fitted new brake drums & shoes to drive Fitted new treadle valve Replaced brake relay valve Internal Workshop Service done DEFECTS: needs loop kit between 2nd & 3rd LH axle Hydraulic pump leaking oil from pressure fitting - needs o'ring Maxi relay valve leaking with brakes released | |
| S-230 | A | 06/08/2020 | 06/08/2020 | 234,668 | 0 | 0 | Drive brakes need re-lining ASAP | |
| R-84 | Hydraulics | 06/05/2020 | 06/05/2020 | 234,326 | 0 | 0 | Replaced hydro fitting Replaced exhaust pressure sensor & wiring - road tested - code remained until operating temp was reached - light remained off for 10 - 15 mins of driving but came back on when parking up | |
| R-70 | Engine codes | 05/29/2020 | 05/29/2020 | 232,145 | 0 | 0 | Internal Workshop Replaced LH hub cap | |
| R-41 | Hub Cap | 05/19/2020 | 05/19/2020 | 230,575 | 0 | 0 | Fitted 2 x new steer tyres with Yokohama & did balancing - Millards Tyres Service done | |
| R-95 | Tyres | 05/13/2020 | 05/13/2020 | 228,233 | 0 | 0 | Replaced 3rd axle LHS inside tyre with runout DEFECTS: Hydraulic pump leaking oil from pressure fitting - needs o'ring | |
| S-146 | A | 05/12/2020 | 12/05/2020 | 227,828 | 0 | 0 | Needs loop kit between 2nd & 3rd LH axle | |
| R-531 | Lights, Mirror | 05/06/2020 | 05/06/2020 | 225,965 | 0 | 0 | Internal Workshop Rectified RHS daylight as required Tightened LHS mirror and adjusted Internal Workshop B service ONLY, no G&C, DEFECTS: monitor minor movement LHS steer bearing - suspect kingpin Minor oil leak at PTO Fan shroud cracked at join RHS | |
| S-707 | E - 270k | 04/16/2020 | 04/16/2020 | 220,300 | 118 | 0 | 0 | 3rd axle LHS trailing arm bush worn |
| R-530 | Ride height valve | 04/07/2020 | 04/07/2020 | 218,439 | 0 | 0 | Internal Workshop Fitted new ride height valve in seat Internal Workshop A service done Checked all trailing arm bolts Adjusted brakes on truck & trailer Repaired top hoist pin Replaced air dryer purge valve Replaced Williams Valve DEFECTS: Monitor minor movement LHS steer bearing Minor oil leak at PTO Fan shroud cracked at join RHS 3rd axle LHS trailing arm bush worn | |
| S-706 | A | 04/06/2020 | 06/04/2020 | 217,985 | 0 | 0 | Seat height control valve not working goes to Max height | |
| R-529 | Hoist pin | 04/03/2020 | 04/03/2020 | 217,073 | 0 | 0 | Inspected hoist pins truck & trailer - Truck roll pin needs centralizing - trailer pin ok | |
| R-528 | | 04/01/2020 | 04/01/2020 | 217,073 | 0 | 0 | Internal Workshop Spray cab with air freshner Had to fit new filter - old one had a hole in | |
| R-527 | Mudflaps | 03/31/2020 | 03/31/2020 | | | 0 | Internal Workshop Mudflap above ringfeeder can't chain up - fitted new chain to ringfeeder mudflap Missing LHS apron mudflap - replaced mudflap Hard to undo hydro line - collar stuck - cleaned dirt out of hydro fitting lock ring Internal Workshop A service done Replaced both tarp cables DEFECTS: monitor minor movement LHS steer bearing - suspect kingpin Fan shroud cracked at join RHS | |
| S-704 | A | 03/16/2020 | 16/03/2020 | 212,014 | 0 | 0 | Minor oil leak at PTO | |

| | | | | | | | |
|-------|------------------|------------|------------|---------|------|---|---|
| R-526 | Tailshaft, Tyres | 03/09/2020 | 03/09/2020 | 210,073 | | 0 | Replaced LHS steer rim & tyre Fit tailshaft back Fit pressure relieve valve Internal Workshop A service done Missing air dryer muffler Monitor minor oil weep at oil filter housing Monitor minor oil leak at PTO |
| S-703 | A | 02/10/2020 | 10/02/2020 | 203,957 | | 0 | Fan shroud cracked at join RHS |
| R-525 | Tyres | 02/06/2020 | 02/06/2020 | 203,171 | | 0 | Rotated drive tyres |
| R-524 | Header tank | 01/24/2020 | 01/24/2020 | 200,081 | | 0 | Internal Workshop Replaced leaking header tank Internal Workshop A service done Changed both diff oils & sampled DEFECTS: monitor slight movement LHS steer bearing (suspect kingpin Missing air dryer muffler Monitor minor oil weep at oil filter housing between block Monitor minor oil leak at PTO |
| S-702 | A | 01/20/2020 | 20/01/2020 | 198,477 | | 0 | Fan shroud cracked at join RHS |
| R-523 | Tyres | 01/17/2020 | 01/17/2020 | 195,083 | | 0 | Internal Workshop Fitted runout to RHS steer & fitted flap rear of trailer RHS |
| R-522 | Air line | 01/10/2020 | 01/10/2020 | | | 0 | Adjusted airlines |
| R-521 | Tyres | 01/06/2020 | 01/06/2020 | 194,645 | | 0 | Fitted runout to 2nd axle RHS outside |
| R-520 | Tyres | 12/17/2019 | 12/17/2019 | | | 0 | Internal Workshop LHF drive tyre (inner) flat - could not find a fault in tyre or valve extension Internal Workshop A service done Tightened 2nd body mount bolts RHS Adjusted Williams valve DEFECTS: monitor slight movement LHS steer bearing - suspect kingpin - even with brakes applied Missing air dryer muffler Monitor oil leak at PTO Fan shroud cracked at join RHS |
| S-701 | A | 12/10/2019 | 10/12/2019 | 191,222 | | 0 | Oil weep at oil filter housing between block Internal Workshop B service only - no G&C Replaced Williams valve due to air leak Power steer filter replaced Ad Blue filters replaced DEFECTS: monitor slight movement LHS steer bearing Missing air dryer muffler Minor oil leak at PTO |
| S-700 | B - 15k | 12/04/2019 | 12/04/2019 | 189,784 | 29,1 | 0 | Fan shroud cracked at joint RH side |
| R-519 | Mudflaps | 11/22/2019 | 11/22/2019 | 185,886 | | 0 | Internal Workshop Removed ALL BWC stickers & replaced mudflaps with Holcim ones Internal Workshop A service done Replaced ad blue filter & strainer Replaced missing wheel nut indicators DEFECTS: monitor slight movement LHS steer bearing Missing air dryer muffler Minor oil leak at PTO |
| S-699 | A | 11/18/2019 | 18/11/2019 | 184,532 | | 0 | Fan shroud cracked at join RH side |
| R-518 | Pre-machinery ch | 11/06/2019 | 11/06/2019 | 182,442 | | 0 | Internal Workshop Pre-machinery check done DEFECTS: missing air dryer muffler Monitor slight movement LHS steer bearing |
| R-517 | Mudguards | 10/31/2019 | 10/31/2019 | | | 0 | Internal Workshop Removed LH mudguard & brackets - straightened & repaired damaged brackets - trim damaged mudguard & flip its position to hide worn edge - straightened guard bracket mount on trailer - repaired cracks in guards bracket mount & guards bracket & refit - replaced 1 x red stick on reflector LHR of dolly |

| | | | | | | | | |
|-------|----------------------|------------|------------|---------|------|---|--|---|
| S-698 | A | 10/28/2019 | 28/10/2019 | 179,820 | 0 | 0 | Internal Workshop A service done DEFECTS: fan shroud cracked RHS Monitor slight movement LHS steer bearing | |
| R-516 | Tarp motor | 10/22/2019 | 10/22/2019 | 178,321 | | 0 | Internal Workshop Replaced cracked tarp motor with new & wires are in reverse Trailer (Unit 511) tarp motor also cracked | |
| R-515 | Seatbelt | 10/18/2019 | 10/18/2019 | 177,813 | | 0 | Inspected - seatbelt is retracting - seems to have lost some spring tension though Internal Workshop A service done Tightened clamp at DPF Replaced missing bolt in compressor x-over pipe Replaced 5 x fuel tank x-over bolts Repaired air leak at fill port under bonnet DEFECTS: fan shroud cracked RHS, Monitor slight LHS steer bearing - slight movement Tarp motor housing cracked | |
| S-697 | A | 10/08/2019 | 08/10/2019 | 176,107 | 0 | 0 | INSIDE OF TRUCK FILTHY & FULL OF RUBBISH A service done Rectified exhaust was sitting on chassis under cab Serviced cabin filter Repaired air leak at test port under bonnet LHS Tightened bolts on fuel tank crossover Tightened all trailer arm eye bolt DEFECTS: 4 x bolts missing from fuel tank crossover Tipper body hoist fitted back to front - can't get grease nipple Fan shroud cracked RHS Monitor slight weep 1st diff RHS shocky | |
| S-696 | A | 09/13/2019 | 13/09/2019 | 169,743 | 0 | 0 | Monitor LHS steer bearing - slight movement Internal Workshop Fitted purge valve to air dryer - Peter Morgan also fitted a new governor valve & new check valve at hotline near the compressor - done roadside at Oxley | |
| R-514 | Governor valve, Pi | 09/03/2019 | 09/03/2019 | 166,192 | | 0 | | |
| R-513 | Tyres | 09/03/2019 | 09/03/2019 | 166,192 | | 0 | Internal Workshop 8 x New drive tyres fitted | |
| R-512 | Grill, Lights, Mudfl | 09/02/2019 | 09/02/2019 | 165,852 | | 0 | Tightened grill Fitted new screws Fitted new mudflap | |
| R-511 | Mudflaps, Mudgu: | 08/27/2019 | 08/27/2019 | | | 0 | Straightened LHR guard & fit missing flap | |
| R-510 | Wheel nuts | 08/22/2019 | 08/22/2019 | 162,397 | | 0 | Found damaged wheel nut & multiple loose ones - replaced nut & tensioned up all nuts on steer Internal Workshop B service done Replaced ringfeder wear pad Rear diff head bolts were loose - tightened up Tighten up exhaust clamps DEFECTS: tipper body hoist fitted back to front - can't get to grease nipple Monitor slight weep 1st diff RHS shocky Air dryer missing muffler | |
| S-695 | D - 90k | 08/15/2019 | 08/15/2019 | 160,553 | 29,! | 0 | 0 | Monitor LHS steer bearing - slight movement Internal Workshop A service done Rotated drive tyres P-clamp a/c line bolt replaced Ringfeder clocked back around DEFECTS: tipper body hoist fitted back to front - can't get to grease nipple Monitor slight weep 2nd diff centre Monitor slight weep 1st diff RHS shocky Fan shroud cracked RHS |
| S-694 | A | 07/17/2019 | 17/07/2019 | 151,824 | | 0 | 0 | Air dryer missing muffler Internal Workshop Adjusted valves, injectors & engine brakes Degreased & washed engine - road test - ok DEFECT: engine oil overfull - has fuel dilution - Sample taken |
| R-509 | Valve set | 06/27/2019 | 06/27/2019 | 147,385 | | | 0 | |

| | | | | | | | |
|-------|----------------|------------|------------|---------|------|---|---|
| R-508 | Checker plates | 06/24/2019 | 06/24/2019 | 146,872 | 0 | 0 | Internal Workshop Removed & repaired checker plate panels at ringfeder A service done DEFECTS: tipper body hoist fitted back to front Monitor LHS steer bearing - slight movement Fan shroud cracked RHS P-clamp a/c line LHS engine bolt missing |
| S-693 | A | 06/21/2019 | 21/06/2019 | 146,572 | 0 | 0 | Ringfeder need clocking back around Output seal leak on 1st diff & 2nd diff centre - WAS INSPECTED BY MACK - THEY COULD NOT FAULT THE DIFF OR FIND A LEAK |
| R-507 | Output seal | 06/12/2019 | 06/12/2019 | | | 0 | Check air dryer - needs a new governor valve - compressor pumping up past 800 causing pressure safety valve to trigger - removed & replaced governor valve & clean pressure safety valve - test ok |
| R-506 | Governor valve | 06/03/2019 | 06/03/2019 | 141,343 | | 0 | Internal Workshop A service done Repaired number plate DEFECTS: tipper body hoist fitted back to front - can't get to grease nipple |
| S-692 | A | 05/31/2019 | 31/05/2019 | 141,342 | 0 | 0 | Monitor LHS steer bearing - slight movement |
| R-505 | Air dryer | 05/07/2019 | 05/07/2019 | 134,466 | | 0 | Internal Workshop Re-kit air dryer Replaced all 4 clamps on RHS intercooler line Internal Workshop A service done Serviced batteries (dry) Repaired RHS intercooler hose - removed crimp clamp & replaced with boost clamp DEFECTS: output seal leak 1st diff & 2nd diff centre weeping 1st diff RH shocky weeping |
| S-691 | A | 05/03/2019 | 03/05/2019 | 134,464 | 0 | 0 | BRAD EMAILED MACK TO SEE IF WE CAN CLAIM WARRANTY FOR THESE DEFECTS |
| R-889 | Tyres | 04/12/2019 | 04/12/2019 | 131,037 | | 0 | Internal workshop Repaired rear axle RHS outside tyre Internal Workshop B Service done Puncture repaired - RHR outer tyre Tightened exhaust clamps DEFECTS: monitor PTO weeping slightly Tipper body hoist fitted back to front |
| S-690 | D - 90k | 04/11/2019 | 04/11/2019 | 131,037 | 29,4 | 0 | Power steer filter was done Internal Workshop Removed wheels & old brakes - fit new shoes & drums - fitted wheels & tension wheel nuts & fit nut indicators - adjusted brakes NOT DONE: air dryer |
| R-504 | Brake Re-line | 03/22/2019 | 03/22/2019 | 106,477 | | 0 | Internal Workshop A service done CHANGED GEARBOX OIL TO CASTROL SYNTHETIC & changed gearbox filter Changed a/c filter & cleaned system Rotated drive tyres front to back DEFECTS: PTO leaking Tipper body hoist fitted back to front |
| S-689 | A | 03/21/2019 | 21/03/2019 | 106,062 | | 0 | Truck having boosting issues Internal Workshop A service done DEFECTS: PTO leaking Tipper body hoist fitted back to front - can't get to grease nipple |
| S-688 | A | 02/25/2019 | 25/02/2019 | 119,853 | | 0 | Truck having boost issues Internal Workshop A service done' Tyre rotation - no need for rotation DEFECTS: PTO leaking Tipper body hoist fitted back to front - can't get to grease nipple |
| S-687 | A | 01/25/2019 | 25/01/2019 | 111,259 | | 0 | Truck having boost issues |
| S-686 | A | 12/20/2018 | 20/12/2018 | 105,668 | | 0 | Internal Workshop A service done |
| R-503 | Mudflaps | 12/19/2018 | 12/19/2018 | 102,440 | | 0 | Internal Workshop Replaced missing mudflap LHR & tightened mudguard bracket LHR |

| | | | | | | | | |
|-------|-------------------|------------|------------|---------|--------|---|---|---|
| | | | | | | | | Internal Workshop Service done |
| | | | | | | | | Belts were replaced |
| | | | | | | | | Ad blue filters done |
| | | | | | | | | Diff oils were replaced |
| | | | | | | | | Topped up gearbox oil |
| S-685 | E - 270k | 12/04/2018 | 12/04/2018 | 101,635 | 101 | 0 | 0 | DEFECT: needs drive brake re-line |
| R-502 | Wheel nut indicat | 11/23/2018 | 11/23/2018 | | 98,140 | | 0 | Changed LH steer wheel nut & fit missing wheel nut covers & wheel indicators |
| R-501 | Reflectors | 11/21/2018 | 11/21/2018 | | | | 0 | Internal Workshop Fitted red & white reflectors to truck & trailer |
| R-500 | Hoist Valve, Mach | 11/16/2018 | 11/16/2018 | | 96,320 | | 0 | Took truck & trailer for machinery inspection - take trailer (#511) to Shephard trailers for crack tests Took truck to Shephards for them to check oil leak at hoist valve body - they replaced valve |
| | | | | | | | | Internal Workshop Service done |
| | | | | | | | | Fit missing steer nut covers & wheel nut indicators |
| | | | | | | | | Fit 2 x clear reflectors to front of body |
| | | | | | | | | Fit 2 x red reflectors to rear of body |
| S-684 | A | 11/15/2018 | 15/11/2018 | | 96,310 | 0 | 0 | DEFECTS: leaking oil from hydraulic block on hoist, tipper body hoist fitted back to front - can't get grease nipple |
| R-499 | Engine brake | 10/30/2018 | 10/30/2018 | | 91,314 | | 0 | PTO leaking - warranty - to go to Shephards |
| | | | | | | | | Mack Brisbane Replaced air valve Replaced exhaust clamp Replaced air dryer |
| | | | | | | | | Internal Workshop Service done |
| | | | | | | | | Couldn't lift bin - truck was loaded |
| S-682 | A | 10/24/2018 | 24/10/2018 | | 90,415 | 0 | 0 | DEFECTS: PTO leaking - WARRANTY JOB |
| R-498 | Oil sample | 10/02/2018 | 10/02/2018 | | 84,576 | | 0 | Internal Workshop Done oil sample |
| R-497 | Tyres | 09/28/2018 | 09/28/2018 | | | | 0 | Carroll's Tyres Replaced 2 x steer tyres |
| | | | | | | | | Internal Workshop Service done |
| | | | | | | | | Replaced wear pad on ringfeeder |
| S-681 | A | 09/26/2018 | 26/09/2018 | | 83,539 | 0 | 0 | Bolts for RHF bin rail to chassis mounting plate loose - removed & cleaned bolts on wire buff cover & refit bolts |
| | | | | | | | | Need to carry out oil sample on engine as it is making oil |
| | | | | | | | | Internal Workshop A service done |
| | | | | | | | | DEFECT: Drivers side steer shocky weeping |
| | | | | | | | | A lot of movement input 1st diff |
| | | | | | | | | PTO valve bank leaking |
| S-680 | A | 09/04/2018 | 04/09/2018 | | 76,190 | 0 | 0 | Monitor slight movement passenger side steer wheel bearing |
| R-496 | Tyres | 08/16/2018 | 08/16/2018 | | 70,110 | | 0 | Millards Replaced drive tyres at Millard's |
| | | | | | | | | Internal Workshop C service done |
| | | | | | | | | DEFECTS: All tyres need replacing |
| S-678 | C - 30k | 08/14/2018 | 08/14/2018 | 70,022 | 70,022 | 0 | 0 | Hoist valve block leaking |
| S-677 | A | 07/17/2018 | 17/07/2018 | | 61,035 | 0 | 0 | Internal Workshop A service done |
| S-676 | A | 06/27/2018 | 27/06/2018 | | 55,377 | 0 | 0 | Internal Workshop Service done |
| S-675 | A | 06/06/2018 | 06/06/2018 | | 48,734 | 0 | 0 | Internal Workshop Service done |
| R-495 | Tyres | 05/28/2018 | 05/28/2018 | | 44,953 | | 0 | Rotated drive tyres |
| | | | | | | | | Internal Workshop Service was done |
| | | | | | | | | Air dryer filters were changed - Air dryer filter was cracked |
| | | | | | | | | Straightened left post on truck bin and centred tailgate |
| S-674 | B - 15k | 05/14/2018 | 05/14/2018 | 40,715 | 40,715 | 0 | 0 | Defect: Hoist valve block on chassis rail has a slight leak |
| S-673 | A | 04/04/2018 | 04/04/2018 | | 28,343 | 0 | 0 | Internal Workshop A service done |
| R-494 | Injector | 03/21/2018 | 03/21/2018 | | 26,246 | | 0 | #1 Injector replaced by Mack under warranty Engine oil & Oil filters changed by Mack under warranty |
| | | | | | | | | Internal Workshop A service done |
| S-672 | A | 03/13/2018 | 13/03/2018 | | 23,922 | 0 | 0 | Topped up coolant |
| | | | | | | | | Internal Workshop A service done |
| S-671 | A | 02/06/2018 | 02/06/2018 | | 14,395 | 0 | 0 | Checked ringfeder - all work ok |