

15:38:4112-JUN-2025PAGE: 2 (92102.0m)Murray Engineering Maintenance System

OLYMPIC DAM									
Job History Report									
Branch Date	Engine Hours	Left Perc Hours	Right Perc Hours	Job Type	Work Order	Labour Hours	Downtime	Comments	
GM051 - 12M									
MORO 06-APR-2025	14183	0	0	SERVICE - 2 WEEKLY	00000688	8.00	6.00	SERVICE VEHICLE - 2 WEEKLY SERVICE 2 WEEKLY SERVICE DONE, CAB EXT FILTER CHANGED DAILY SERVICE - MACHINE DOWN	
MORO 03-APR-2025	14176	0	0	Service Day Shift Breakdown	00000685	0.50	0.50	DP FILTERS Breakdown	
MORO 02-APR-2025	14167	0	0			1.00	1.00	LOW REGEN TEMP FAULT - RESETED FAULT AND RAN A DPF REGEN SERVICE	
MORO 01-APR-2025	14164	0	0	Breakdown	00000678	1.00	1.00	G.E.T Breakdown MISSING BOTTOM MOLDBOARD SLIDE RETAINER PLATE - FITTED PLATE	
MORO 01-APR-2025	14164	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 30-MAR-2025	14140	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 29-MAR-2025	14125	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 28-MAR-2025	14117	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 27-MAR-2025	14110	0	0	Breakdown	00000674	2.00	3.00	DRIVERS CHASSIS DAMAGE LOW REGEN TEMP FAULT - REPLACED LH LEAN PIN AND SECURING WASHERS	
MORO 27-MAR-2025	14110	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 26-MAR-2025	14104	0	0	Service Day Shift		1.00	1.00	DAILY SERVICE	
MORO 25-MAR-2025	14090	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 24-MAR-2025	14075	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 23-MAR-2025	14061	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 22-MAR-2025	14055	0	0	SERVICE - 2 WEEKLY	00000641	8.00	0.00	SERVICE VEHICLE - 2 WEEKLY SERVICE COMPLETED EMISSIONS TEST	
MORO 21-MAR-2025	14047	0	0	Service Day Shift		1.50	1.50	DAILY SERVICE	
MORO 20-MAR-2025	14042	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 19-MAR-2025	14028	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 18-MAR-2025	14014	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 17-MAR-2025	14011	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 16-MAR-2025	14005	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 15-MAR-2025	13999	0	0	Breakdown	00000625	1.00	1.00	DP FILTERS Breakdown LOW REGEN TEMP FAULT - RESET FAULT AND RAN A DPF REGEN SERVICE	
MORO 12-MAR-2025	13994	0	0	Breakdown	00000622	17.00	56.00	HYDRAULICS Breakdown HYD BRAKE ACCUMULATOR HOSE BLOWN - CHANGED HOSE	
MORO 09-MAR-2025	13992	0	0	SERVICE - 1000 HOUR	00000616	10.00	10.00	SERVICE VEHICLE - 1000 HOUR SERVICE - REPLACED BOTH TANDEM BRAKE HOSES - REPLACED X1 CIRCLE SIDE SHIF CYLINDER HYD HOSE - TANDEM CILS NOT REPLACED	
MORO 08-MAR-2025	13982	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 07-MAR-2025	13970	0	0	DAMAGE	00000612	0.50	0.50	CHASSIS DAMAGE LH CAB STEP BENT - REPLACED CENTER LH STEP AND COMPLETED	
PRINTED: 15:38:42 12-JUN-2025 PAGE: 2 (92102.0m) Murray Engineering Maintenance System									
OLYMPIC DAM									
Job History Report									
Branch Date	Engine Hours	Left Perc Hours	Right Perc Hours	Job Type	Work Order	Labour Hours	Downtime	Comments	
MORO 07-MAR-2025	13970	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 06-MAR-2025	13958	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 05-MAR-2025	13950	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 04-MAR-2025	13943	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 03-MAR-2025	13936	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 02-MAR-2025	13928	0	0	DAMAGE	00000599	31.00	242.00	CHASSIS DAMAGE BENT CIRCLE FRAME, BROKEN MOLDBOARD PINS - REPLACED CIRCLE, REPAIRED CRACKS ON MOLDBOARD, REPLACED MOLDBOARD WELDING - WEAR STRIPS TOP AND BOTTOM SERVICE VEHICLE - 2 WEEKLY SERVICE CHANGED CUTTING EDGES CHANGED WORK BOTTOM CIRCLE WEAR PIECE SHIMMED TOP CIRCLE WEAR PIECES	
MORO 10-FEB-2025	13925	0	0	SERVICE - 2 WEEKLY	00000591	8.00	12.00	2 WEEKLY SERVICE HYDRAULICS Breakdown REPLACED CUTTING EDGES CHANGED WORK BOTTOM CIRCLE WEAR PIECE SHIMMED TOP CIRCLE WEAR PIECES	
MORO 17-FEB-2025	13916	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 16-FEB-2025	13906	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 15-FEB-2025	13892	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 14-FEB-2025	13877	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 13-FEB-2025	13865	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 12-FEB-2025	13852	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 11-FEB-2025	13840	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 10-FEB-2025	13832	0	0	Breakdown	00000579	3.00	3.00	ELECTRICS Breakdown MACHINE STALLING AFTER START UP - PLUG AND WIRING TO IGNITION RELAY NOT SECURE, REPAIRED AND CHANGED PLUG. DAILY SERVICE	
MORO 09-FEB-2025	13824	0	0	Service Day Shift		2.00	2.00	DAILY SERVICE	
MORO 07-FEB-2025	13814	0	0	Breakdown	00000576	6.00	6.00	AIR COND Breakdown - REPLACED RECEIVER DRYER AIR CUTTING IN AND OUT - HIGH SIDE PRESSURE HIGH, SUSPECTED BLOCKAGE IN ACCUMULATOR DUE TO TEMP DROP ACROSS ACCUMULATOR. PIPES TO AND FROM ACCUMULATOR SIZED, REPLACED BOTH PIPES TO AND FROM ACCUMULATOR WITH ACCUMULATOR. REMOVED 1.300KGS OF GAS AND REFILLED WITH 1.300KS	
MORO 07-FEB-2025	13812	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 06-FEB-2025	13799	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 05-FEB-2025	13791	0	0	Breakdown	00000574	8.00	8.00	AIR COND Breakdown AC NOT WORKING - LOW ON GAS, SUSPECTED LEAK, REMOVED 1.300KGS OF GAS AND PRESSURE TESTED WITH NITROGEN, HELD 150PSI FOR 1 HOUR, REFILLED SYSTEM WITH 1.300KGS OF GAS, NOTICED HIGH SIDE PRESSURE WERE HIGH, BLEW 11.5% OF THE VENTS SUSPECT BLOCKAGE IN ACCUMULATOR. SERVICE VEHICLE - 2 WEEKLY SERVICE 2 WEEKLY SERVICE DONE AUTO RE CENTRE NOT CENTERING - TO CHECK LHS MOLDBOARD SLIDES AND PLATE CHANGED	
MORO 03-FEB-2025	13779	0	0	SERVICE - 2 WEEKLY	00000565	16.00	12.00	SERVICE VEHICLE - 2 WEEKLY SERVICE 2 WEEKLY SERVICE DONE AUTO RE CENTRE NOT CENTERING - TO CHECK LHS MOLDBOARD SLIDES AND PLATE CHANGED	
PRINTED: 15:38:42 12-JUN-2025 PAGE: 3 (92102.0m) Murray Engineering Maintenance System									
OLYMPIC DAM									
Job History Report									
Branch Date	Engine Hours	Left Perc Hours	Right Perc Hours	Job Type	Work Order	Labour Hours	Downtime	Comments	
MORO 02-FEB-2025	13770	0	0	Service Day Shift		0.50	0.50	SEAT TRAVEL NOT LOCKING - LUBRICATED LINKAGES FLOGGED MOLDBOARD BOSSES - CHANGED MOLDBOARD BUSHES AND RE SHIMMED	
MORO 01-FEB-2025	13754	0	0	Breakdown	00000563	2.00	3.00	AIR COND Breakdown REPLACED 2 BROKEN SLIDE ADJUSTERS	
MORO 01-FEB-2025	13754	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 30-JAN-2025	13749	0	0	Breakdown	00000559	53.00	156.00	AIR CONDITIONER NOT WORKING - CHANGED LP PRESSURE SENSOR DAILY SERVICE HYDRAULICS Breakdown ACCUMULATOR BRAKE PRESSURE LOW / BRAKE LININGS - CHANGED RIGHT TANDEM (POS 486) FRICTION PLATES DRIVES Planned REPAIR AXLE HUB BUSHES - CHANGED HUB BUSHES AND SEALS SERVICE VEHICLE - 250 HOUR SERVICE 250 HR SERVICE DONE MOLDBOARD PIN BUSHES WORN BRAKE ACCUMULATOR PRESSURE FAULT COMING ON	
MORO 27-JAN-2025	13747	0	0	Planned	00000560	16.00	24.00	AIR COND Breakdown - AC BLOWING HOT AIR - HIGH SIDE PRESSURE EXCEEDING 300 PSI, BLEW AND WASHED OUT BLOCKED RADIATOR CONDENSER. - REPLACED IX RIPPER BOOT - REPLACED CUTTING EDGE	
MORO 25-JAN-2025	13740	0	0	SERVICE - 250 HOUR	00000527	10.00	12.00	DAILY SERVICE - REPLACED LH RADIATOR TO FUEL CAP - REPLACED WORN SEAT BACKREST COVER - INSULATED ALL EARTH AND POSITIVE CABLES - MOLDBOARD PIN BUSHES HAVE PLAY	
MORO 21-JAN-2025	13744	0	0	Breakdown	00000552	1.00	1.00	DAILY SERVICE	
MORO 21-JAN-2025	13737	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 20-JAN-2025	13726	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 19-JAN-2025	13720	0	0	Service Day Shift		1.50	1.50	DAILY SERVICE	
MORO 18-JAN-2025	13706	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 15-JAN-2025	13693	0	0	SERVICE - 2 WEEKLY	00000542	5.00	5.00	DAILY SERVICE - REGEN FAULT ON DASH, SOOT LOADING AT 83%. CLEARED CODES AND COMPLETED MANUAL REGEN SERVICE VEHICLE - 2 WEEKLY SERVICE - REPLACED LH DOOR SEAL, DOOR ALSO RUSTED BADLY - REPLACED LH DOOR SEAL TO FUEL CAP AND NEEDS ADJUSTING - RH KINGPIN HAS PLAY - FITTED LANYARD TO DRAWBAR - REPLACED WORN SEAT BACKREST COVER - INSULATED ALL EARTH AND POSITIVE CABLES - MOLDBOARD PIN BUSHES HAVE PLAY	
MORO 14-JAN-2025	13686	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 13-JAN-2025	13673	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 12-JAN-2025	13661	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 11-JAN-2025	13647	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 10-JAN-2025	13634	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 09-JAN-2025	13619	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 08-JAN-2025	13605	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 07-JAN-2025	13600	0	0	Breakdown	00000538	0.50	1.00	DAILY SERVICE DP FILTERS Breakdown	
PRINTED: 15:38:42 12-JUN-2025 PAGE: 4 (92102.0m) Murray Engineering Maintenance System									
OLYMPIC DAM									
Job History Report									
Branch Date	Engine Hours	Left Perc Hours	Right Perc Hours	Job Type	Work Order	Labour Hours	Downtime	Comments	
MORO 07-JAN-2025	13595	0	0	Service Day Shift		0.50	0.50	LOW REGEN TEMP FAULT - RESET FAULT WITH ET	
MORO 06-JAN-2025	13583	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 03-JAN-2025	13578	0	0	SERVICE - 2 WEEKLY	00000536	16.00	10.00	SERVICE VEHICLE - 2 WEEKLY SERVICE 2 WEEKLY SERVICE REPLACE BOTH CUP BUSHES ON LHS LIFT CYLINDER, ADJUSTED CIRCLE SIZES, TO MONITOR MOLDBOARD CRACKS STARTING	
MORO 02-JAN-2025	13572	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 30-DEC-2024	13552	0	0	Planned	00000488	0.00	0.00	HYDRA HOSE Planned FIT MISSING, BRAKE HOSE SLEEVES - REPLACED BRAKE HOSE SUPPORT RUBBERS	
MORO 30-DEC-2024	13552	0	0	DAMAGE	00000506	18.00	30.00	G.E.T DAMAGE RIPPER H LINK BENT - REPLACED RIPPER H LINK AND BOTH UPPER LINK ARMS, REPLACED ALL ASSEMBLY PINS AND SEALS.	
MORO 28-DEC-2024	13546	0	0	Breakdown	00000505	3.00	8.00	HYDRAULICS Breakdown BLOWN HYD STEERING HOSE - REPLACED STEERING HOSE FROM CIRCLE DRIVE TO FRONT OF GOOSE NECK, FITTING ON CIRCLE DRIVE HAD SNAPPED.	
MORO 27-DEC-2024	13535	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 26-DEC-2024	13528	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 25-DEC-2024	13522	0	0	Breakdown	00000502	1.00	1.00	DAILY SERVICE LOW REGEN TEMP ON DASH - CLEARED FAULTS AND REN MANUAL REGEN	
MORO 24-DEC-2024	13512	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 23-DEC-2024	13497	0	0	3 Month Inspection	00000520	0.00	0.00	ATF SERVICE AND REPAIRS - COMPLETED BY SANDVIK	
MORO 22-DEC-2024	13487	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 21-DEC-2024	13481	0	0	Breakdown	00000494	1.00	1.00	AIR COND Breakdown AIR CONDITIONER NOT COOLING - CLEANED ELECTRICAL PLUGS	
MORO 20-DEC-2024	13480	0	0	Service Day Shift		1.50	1.50	DAILY SERVICE	
MORO 20-DEC-2024	13480	0	0	SERVICE - 500 HOUR	00000498	12.00	12.00	SERVICE - 500 HOUR SERVICE - REPLACED LH CYLINDER BUSHES - CHANGED CUTTING EDGES	
MORO 19-DEC-2024	13475	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 18-DEC-2024	13473	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 17-DEC-2024	13465	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 16-DEC-2024	13449	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 15-DEC-2024	13446	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 14-DEC-2024	13433	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 12-DEC-2024	13426	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 11-DEC-2024	13418	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 10-DEC-2024	13411	0	0	Breakdown	00000491	8.00	11.00	HYDRAULICS Breakdown BLOW HYD BRAKE HOSE IN ARTICULATION AREA - REPLACED HOSE FROM ACCUMULATOR BEHIND CAB TO BRAKE VALVE AT REAR OF MACHINE. SERVICE VEHICLE - 2 WEEKLY SERVICE - REPLACED LH LIFT CYLINDER YOKE BUSHES	
MORO 08-DEC-2024	13405	0	0	SERVICE - 2 WEEKLY	00000478	10.00	10.00	SERVICE VEHICLE - 2 WEEKLY SERVICE - REPLACED LH LIFT CYLINDER YOKE BUSHES	
PRINTED: 15:38:42 12-JUN-2025 PAGE: 5 (92102.0m) Murray Engineering Maintenance System									
OLYMPIC DAM									
Job History Report									
Branch Date	Engine Hours	Left Perc Hours	Right Perc Hours	Job Type	Work Order	Labour Hours	Downtime	Comments	
MORO 06-DEC-2024	13374	0	0	Service Day Shift		0.50	0.50	- REPLACED ALL RIPPER BOOTS - RE-FLYVITED FRONT LOCKS, NECK COVER - RE-FITTED INTERCOOLER HOSE AND CHANGED CLAMP - REPLACED BOTTOM MOLDBOARD SLIDE BUSHES & XI ADJUSTER SCREW - REPLACED QUICK FILL FUEL CAP - MOLDBOARD PIN BUSHES WORK **NEED TO BOOK IN FOR REPLACEMENT**	
MORO 05-DEC-2024	13356	0	0	Service Day Shift Breakdown	00000475	0.50	0.50	G.E.T Breakdown	
MORO 05-DEC-2024	13356	0	0	Service Day Shift		0.50	0.50	RIP MOLDBOARD PIN SNAPPED - REPLACED PIN AND COLLAR	
MORO 04-DEC-2024	13342	0	0	1 Month Inspection	00000584	0.50	0.50	DAILY SERVICE MONTHLY GAS TEST RECORD RESULTS MIN IDLE - NOX: MIN IDLE - CO: MAX IDLE - NOX: MAX IDLE - CO: MAX IDLE - CO: 115	
MORO 04-DEC-2024	13342	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 03-DEC-2024	13331	0	0	Service Day Shift		1.00	1.00	DAILY SERVICE - REPLACED CUTTING EDGE	
MORO 02-DEC-2024	13318	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE - MOLDBOARD PIN COLLAR	
MORO 01-DEC-2024	13304	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 30-NOV-2024	13289	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 29-NOV-2024	13282	0	0	Breakdown	00000466	1.00	1.00	AIR COND Breakdown AIR CONDITIONER INTERMITTENTLY CUTTING OFF - CHECKED SENSORS AND PRESSURES, CHANGED AIR CON RELAY.	
MORO 29-NOV-2024	13276	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 28-NOV-2024	13259	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 27-NOV-2024	13245	0	0	DAMAGE	00000465	1.00	1.00	CHASSIS DAMAGE BENT STEPS AND STEP BRACKETS - CHANGED BENT STEPS AND BRACKETS	
MORO 27-NOV-2024	13245	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 26-NOV-2024	13231	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 25-NOV-2024	13220	0	0	Breakdown	00000462	1.00	2.00	AIR COND Breakdown AC BLOWING HOT AIR - FOUND MACHINE INFORMATION HANDBOOK COVERING THE RETURN AIR FILTER, RESECURED IN DRIVERS SEAT	
MORO 25-NOV-2024	13218	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 24-NOV-2024	13208	0	0	Service Day Shift		0.50	0.50	DAILY SERVICE	
MORO 13-NOV-2024	13202	0	0	SERVICE - 2 WEEKLY	00000458	12.00	26.00	SERVICE VEHICLE - 2 WEEKLY SERVICE - AC BLOWING WARM AIR, PRESSURES OK, WASHED OUT BLOCKED RADIATOR AND ALL COILERS - DEF QUALITY SENSOR FAULT, SWAPPED DEF	