| Unit | Model | Date | Work Order Details |
|-------|-----------|------------|---|
| 70017 | D71PXI-24 | 6/6/2023 | Pin walked out for blade angle. Reinstall pin. |
| 70017 | D71PXI-24 | 7/5/2023 | Repair 2 Way not working |
| 70017 | D71PXI-24 | 9/13/2023 | Quick Check over and inspect edges still some life left |
| 70017 | D71PXI-24 | 9/29/2023 | Check out Fault DDNLKA w/e lockout switch open circuit, check power , good. Order and replace hydraulic |
| | | | lockout switch |
| 70017 | D71PXI-24 | 11/7/2023 | 2380hours CA1682 CA3559 faults , DEF I prime failed and def pump low voltage , check over connectors - |
| | | | good run machine started priming with good voltage , faults cleared , force regen for service |
| | | | |
| 70017 | D71PXI-24 | 11/20/2023 | Check out front left idler heating up , rock stuck in the frame , check and order edges , ord parts for door |
| | | | hinge pin |
| 70017 | D71PXI-24 | 11/22/2023 | Replace cutting edges |
| 70017 | D71PXI-24 | 11/30/2023 | Checkout overheating complaint, lose coolant no leaks visible , plugged air filter , blow out filter and top up |
| | | | oil run unit up to temp |
| 70017 | D71PXI-24 | 12/5/2023 | Replace broken park brake switch |
| 70017 | D71PXI-24 | 3/15/2024 | Replace seat switch |
| 70017 | D71PXI-24 | 3/20/2024 | Install left upper door hinge pin and new retainers |
| 70017 | D71PXI-24 | 6/23/2024 | Lube service at 2730hr |
| 70017 | D71PXI-24 | 7/4/2024 | 2795hours Check out fault code fault is for work Equipment lockout switch ordered new switch |
| | | | |
| | D71PXI-24 | 7/5/2024 | Replace hydraulic lockout switch |
| 70017 | D71PXI-24 | 7/5/2024 | Replace hyd lock out switch. |
| 70017 | D71PXI-24 | 7/15/2024 | Drove to site removed guards and removed tilt hose to bring to shop. Cleaned up around area |
| | | | |
| 70017 | D71PXI-24 | 8/9/2024 | Service bumped to a 2000 to change hyd oil to txm Pick kit Switch into 78140 for txm Drive to unit |
| | | | |
| | D71PXI-24 | 8/9/2024 | Check out leak from hyd filters. Need to go grab parts first time to repair leak. |
| - | D71PXI-24 | 8/10/2024 | Track down parts and Reseal filter assembly. |
| 70017 | D71PXI-24 | 8/27/2024 | Troubleshoot DXJ4KA fault for work equipment system abnormality, check over wiring and check solenoid |
| | | | spec 20-60 ohms actual 44.3ohms but no current fault by the time I got to machine |
| 70017 | D71PXI-24 | 8/30/2024 | Troubleshoot fault DBUSKR for GNSS connection , check fuses good do system restart and fault cleared , |
| | | | run machine and try blade auto control to make sure system worked |

| 70017 | D71PXI-24 | 9/30/2024 | Troubleshoot CA1682 injector priming fault do pressure test good fault cleared and do manual |
|-------|-----------|------------|--|
| | | | regeneration-passed |
| 70017 | D71PXI-24 | 10/9/2024 | Pull steering joystick, came back later in the day and installed joystick from 70018 for testing. Calibrate. |
| 70017 | D71PXI-24 | 10/18/2024 | 3349hours Check out DEF priming fault and level 5 derate , clean pump and tank area blow back lines and pump -clean do pressure test -passed and cleared faults do forced regeneration |
| 70017 | D71PXI-24 | 10/21/2024 | Install original steer lever control unit and adjust lever positions |
| 70017 | D71PXI-24 | 12/23/2024 | 3352 hours check over machine , complete forced regen |
| 70017 | D71PXI-24 | 3/12/2025 | Filled coolant . Filled hydrolic . Checked unit over found hydrolic leak . Loose hose clamps . Check over |
| | | | unit for possible coolant leak did not find one |
| 70017 | D71PXI-24 | 5/27/2025 | Flip edges |
| 70017 | D71PXI-24 | 6/5/2025 | Pull console apart to see if we can tighten up play in hydraulic joystick |
| 70017 | D71PXI-24 | 6/6/2025 | Fabricate ripper plow |
| 70017 | D71PXI-24 | 6/9/2025 | Fabricate ripper plow |
| 70017 | D71PXI-24 | 6/9/2025 | Check out blower motor quit working, replace lace blown fuse |
| 70017 | D71PXI-24 | 6/9/2025 | Changed out ripper teeth had to cut old teeth off to get pins out |
| 70017 | D71PXI-24 | 6/14/2025 | Grab parts at SMS |
| 70017 | D71PXI-24 | 6/17/2025 | Travel to site. Change out blower motor. Left and had to return for same issue. Diag electrical and order |
| | | | parts. Instructed to reassemble machine and rts until parts arrive. Travel to shop. |
| 70017 | D71PXI-24 | 6/18/2025 | Headed to replace compressor. Called off of job for move machine. |
| 70017 | D71PXI-24 | 6/19/2025 | 3768hours Grab parts from shop , go to machine when rain stopped, remove AC compressor, new |
| | | | compressor port was broken , get new compressor sent out , install new , draw vacuum , put 1 oz oil in , charge with 1.2kg |