

Unit	Model	Date	Work Order Details
1633	460E II	7/19/2023	Checked all levels. Started. Checked all functions and checked for leaks/ damage
1633	460E II	7/28/2023	Travel to unit and setup work area. Inspected unit and found 4 ways are acting as marker lights. Checked monitor and saw the option was enabled. Lights are operating as intended.
1633	460E II	7/29/2023	Wiper arm stripped out. Needs replaced. Ordered part
1633	460E II	8/2/2023	Drove to machine. Removed damaged wiper arm. Installed new arm was in a rush and i set it up wrong. When I checked operation the arm hit the cab roof and bent arm and wedged on drive. Had to cut to get off. Order new arm
1633	460E II	9/10/2023	Found boost leak in turbo inlet pipe, hold down clamp had broken off causing boot to pull out from spring clamp, secured inlet pipe and reinstalled turbo boot
1633	460E II	11/25/2023	Retorque to 450lbs on left front dual tire
1633	460E II	1/4/2024	Drive to yard pick up alternator go to unit got called away as I got there
1633	460E II	1/4/2024	Change alternator and start up to check with cold start and charge. Charging at 28volts
1633	460E II	4/1/2024	Cracked air filter cover, order
1633	460E II	4/9/2024	Find unit & get truck moved to 14 laydown, clean engine bay. Remove valve covers, add dye to fuel system & run up. Found leaking injector orings. Order parts. Valve covers only have 2 bolts in them, bag of hardware in cab
1633	460E II	4/13/2024	Clear mud around unit, remove valve covers & reinstall. 2 Timing pins needed for newer generation engine. Tools ordered
1633	460E II	4/26/2024	Disassemble valve train , remove injectors ? Install new seals , install injectors? Assemble valve train start unit check for leakd
1633	460E II	4/26/2024	Strip and Reseal injectors, torque to spec and reassemble. Run test, working good. Needs oil changed from having an open engine
1633	460E II	5/30/2024	Check all the level start unit. Works fine front window right side bottom corner crack. Door shock absorber shot. Emergency break window hammer missing. Left side window. Have a wrong bolt on a latch instead. Have is the roll beam. A wouldn't a loc properly replace rol pin works good.
1633	460E II	6/1/2024	Seat complaint of shifting noticed operator had it unlocked on float mode locked it and it stayed in its place
1633	460E II	6/22/2024	Run checks on unit, checking over components- good
1633	460E II	10/30/2024	Severe grinding only when turning. Checked both hubs ok and front diff. Oil levels correct on each component and no flakes or chunk but wheels binding and grinding when turning

1633	460E II	10/30/2024	Severe grinding only when turning. Checked both hubs ok and front diff. Oil levels correct on each component and no flakes or chunk but wheels binding and grinding when turning
1633	460E II	11/1/2024	Start unit ,test drive unit , no noise, get fluid level top up put to work,no complaint all day
1633	460E II	11/26/2024	Service
1633	460E II	12/19/2024	Demob inspection with travel
1633	460E II	6/24/2025	Fixing broken bracket - grind,weld and painted
1633	460E II	7/7/2025	Complete 250 hr service ordered oil filter for service
1633	460E II	7/8/2025	Change engine oil and filter due to brandt working on eng.
1633	460E II	7/8/2025	1000 hr pm Check brake accumulator pressure 1500 psi Check all lights. Grease machine. Clean battery's Clean tank breather Calibrate tranni Misc checks off the check list. Check all levels
1633	460E II	7/9/2025	cut wheel lock off and straintened
1633	460E II	7/9/2025	Drain def tank. Replace filter. Finish 1000hr inspection