

K37-1

DATE	HOUR METER		SEG.	BR.	PERIODIC INSPECTION & REPAIR RECORD	EMPLOYEE #
	UPPER	LOWER				
					Fix All Axl up. when an outrigger. fix front drive Engagment. fix horn & wipers Kwa	
July 10	2220					095820
Aug 12	1652	2222			095820 1 Year S4.6 Repaired back Steps New Reflectors on DS Dolly 3rd Axl Seal and New brake pads on dolly PS 3rd Axl New Slack Adjuster 3 S Cam PS C Service on crane New back air tank & fittings checked all tire pressures, filled to loops replaced transverse torque rod on axle 2 Washed crane A Service on dolly B Service on dolly	095822
Sept 30/00	2236				2 updated fire extinguishers put into crane, 1 in lower and 1 in upper	
Oct 13/00	2270				Bent horse cock pins back to straight installed truck chargers in upper & lower Replaced hyd hose in back left outrigger	095820
Oct 22/00	2272				Replaced back DS outrigger hyd hose Replaced hyd steel line by Axl 2 passenger side	095820

STERLING CRANE

DATE	HOUR METER		SEG.	BR.	PERIODIC INSPECTION & REPAIR RECORD	EMPLOYEE #
	UPPER	LOWER				
12/29/05			2272		Fixed ps outrigger float	2575820
12/29/05			2289		Diag & Repair neutral safety switch	2520026
Dec 31/05	16729	2308			A Service (upper) Checked lights S.4.6 insp	2575820
01/25/2006	16870				DRIVER SIDE WHEEL LIGHT OUT	261763
Mar 6	16989				LMT	2575820
27 March 04	2312				A Service lower Fixed marker lights Replaced DS low beam headlights Put wheel mudders on crane & dolly A Service dolly Fixed back up lights & back up alarm, turned out to be melted wires going to auto greaser, fixed lower auto greaser too Crane wouldn't move, diagnosed problem, the tow valve by the air dryer got bumped and crane was in tow mode	2575820 321576
March 24	2392				B-Service On Dolly. - Grease - check tires - light - hubs.	
Apr 1					Ordered new - Ignition switch - Neutral safety switch	
4/13/2006	2419	50	800		Installed new lower ignition-relay-switch found defective	267428
"		"	"		Neutral switch back orderd	

STERLING CRANE

DATE	HOUR METER		SEG.	BR.	PERIODIC INSPECTION & REPAIR RECORD	EMPLOYEE #
	UPPER	LOWER				
Nov 13	17180	24164			Diagnosed and replaced neutral safety switch and replaced harness going to switch A Service upper	295822
July 24		2468			Replaced right side centering ring (counterweight holder) Fixed ps Step Fixed back DS Steps	295822
Aug 10	17681	2633			B Service upper Replaced lower wipers.	295822
Aug 27		2637			Work on dolly Replaced 3rd axle torque strut	295822
9/16	2627				- IGNITION ISSUE. CAN START LOWER ONLY BY BUTTON ON ENGINE AFTER FRONT ENGINE COVER WAS TAKEN OFF - (Repaired Nov 12 th)	269763
					- UPPER WHEN START RUNNING AT FULL THROTTLE ENGINE DIES AND THEN RESUMES AT FULL THROTTLE DOES THIS REGARDLESS OF FUNCTION	
					- REAR SWAMPER SIDE MUFFLER DAMAGED	
					- DRIVERS SIDE REAR LAGGING BOX DOOR POPS OPEN HAD TO BUNKER CLOSED	
					- ADDED OIL TO UPPER AND LOWER - TOPPED UP COOLANT ON LOWER	