



MAINTENANCE LOG

Issuing Department: Maintenance

V 1.0

Sept 13, 2023

Appr: Operations Manager

UNIT #: P702

DATE	WORK COMPLETED	KM	HRS	TECH
Jan 8	- Diagnose Complaint of Main winch not holding load.	187,136	13,891	cl
	- Remove Winch Motor and Brake Pack. * Found 1/2 Springs Broken and friction Discs worn out.			cl
	- Order Parts for Repair			cl
Jan 9	- Replace all 12 springs, all 7 friction Discs and all 8 stator plates.			cl
	- Reassemble brake pack and reinstall.			cl
	- Reinstall winch motor			cl
	- Drain and Refill Main Winch Gear oil			GT
	- Drain and Refill Aux Winch Gear oil			GT
	- Yellowhead replace Driver's side Windshield.			YH
	Diag C.E.I. for Exhaust pressure = 255kPa Data Erratic from Exhaust pressure sensor.			
	- unplug Sensor Code # 2373 did not become active = wiring issue in harness. Remove Ecm Connector to check for opens and shorts			cl
	- Repair the Boosted air leak on turbo (o-ring) on the Discharge line.			cl
	- Repair Exhaust leak immediately after turbo (loose clamp)			GT
	- C.E.I. cleared and did not come back on			cl

NOTES:

779016253 - Overnight Exp.



MAINTENANCE LOG

Issuing Department: Maintenance

V 1.0

Sept 13, 2023

Appr: Operations Manager

RECEIVED

By Fay Cardinal at 8:11 am, Dec 03, 2025

UNIT #: P202

DATE	WORK COMPLETED	KM	HRS	TECH
Dec 1	-Service	225,476	16,043	BT, BO
	-Replace swing cab heater			cl
	-Diag A/B Cable Reel. Found issue was because of being in improper quadrant passed 85.5'			cl
	Issue went away when in proper load chart.			
	-repair all D-side gear pin on a/p-side front pin on lead Springs			GT
	-repaired p-side gear out-trigger hub			GT
	-Replace washer Bez old on crane			PO
	hate way up			
	-leak air fitting of comp unbed signal line Replace Air Fitting			
	-4th Axle left Side Air Bag cracked Remove and Replace Air Bag			
	-Retired Bolt's around front left engine to stop small oil leak. Rear engine no leak Returned.			
	-Test Swivel for leak large amount of oil under unit			

NOTES:



MAINTENANCE LOG

Issuing Department: Maintenance

V 1.0

Sept 13, 2023

Appr: Operations Manager

UNIT #: P-202

RECEIVED
By Fay Cardinal at 11:57 am, May 02, 2025

DATE	WORK COMPLETED	KM	HRS	TECH
April 29	- Replace the broken taillights on top of cab. install led lights from W-106	199643	14595	PO
	- coolant leak found lower Red hose leaking. Tighten clamp and Add 2nd line clamp. pressure test			PO
	- poor start on unit Found cables loose on Master Switch Remove all cables clean cables and Rewire			TK
	- Remove D-side Rear outrigger Outer Beam and Cylinder. Remove hose track and Replace all hoses inside Outrigger. Reassemble.			cl/at
	- Replace Both winches Drum oil			at.

NOTES:



MAINTENANCE LOG

Issuing Department: Maintenance
V 1.0 | Sept 13, 2023 | Appr: Operations Manager

UNIT #: R-202

DATE	WORK COMPLETED	KM	HRS	TECH
March 28	- Service Truck Fill out Service sheet			GT/BG
	- Clean trailer plug end			BG
	- Remove clock cover inspect clock and set Release Bearing back to spec			BG
	- Cut out leak from Tank Replace Hose clamp on 1" Hose and Retest for leak			BG
	- Replace 5th Axle left side ABS Sensor			GT/BG
	- Adjust the contacts on the ABS Reed			GT
	- C			

NOTES:



MAINTENANCE LOG

Issuing Department: Maintenance

V 1.0 | Sept 13, 2023

Appr: Operations Manager

RECEIVED

By Fay Cardinal at 8:11 am, Mar 20, 2025

UNIT #: P-202

DATE	WORK COMPLETED	KM	HRS	TECH
March 14	Fan Hub will not shut off, Test system lots of Air supply to hub but will not Release Part's ordered.	194658	14285	Bo
	-Pass side wiper failed, Replace wiper blade			Bo
	-Test Swing Cab Heater, Function test 3 times and turned on and Real Fine			Bo
March 17	-Remove and Replace Fan Hub Refill cooling system, test New Fan Hub			Bo
	Fan Hub was Replaced because it would not Release,			Bo

NOTES:



MAINTENANCE LOG

Page 1

Issuing Department: Maintenance

V 1.0 | Sept 13, 2023

Appr: Operations Manager

UNIT #: P202

RECEIVED

By Fay Cardinal at 9:16 am, Feb 21, 2025

DATE	WORK COMPLETED	KM	HRS	TECH
Feb 6	- Replace P-side high beam bulbs - Repair Pig tail to P-side low beam bulbs - Drag leaking hydraulic cylinder, Order new cylinder from NWL. - Replace air switch Outrigger / crane switches - Repair outrigger stopper plate front D-side - Order radiator after	190,950	14,082	cl cl cl cl GT
Feb 7	- Pressure test coolant, confirm leaks from radiator. Order new radiator - Drag cel for exhaust pressure. Test wiring from ECM. All wiring test good.			cl cl
Feb 10	- Service - Remove Exhaust pressure sensing tube, clean and Reinstall - NDT Inspection Done			GT GT Rebel
Feb 11	- Order Sheave parts for NDT Repairs. Replace 5th Axle DIS wheel seal Set Bearing a .002 New gaskets - CVP Inspection Replace 1st Axle P/S wheel seal set Bearing .002 New gasket Fill with oil			cl BO BO BO
	Replace Brake Shoes on the 5th Axle - Replace P-side Rear Vertical outrigger cylinder.			BO cl/GT
Feb 11	- Remove All Tires and drums Inspect unit for CVP Reinstall Drums and tires			BO
Feb 12	Replace the engine Fan Belt's Replace boom sheaves 4/6			BO cl
NOTES:	Reinstall 2-way Radios			GT



MAINTENANCE LOG

Issuing Department: Maintenance

V 1.0

Sept 13, 2023

Appr: Operations Manager

16344 hrs.

UNIT #: 202

231 315 Kms.

DATE	WORK COMPLETED	KM	HRS	TECH
01/31	- oil / Fuel Service - INSPECTION STARTED	231 315	16344	CS
Feb/01	-> change ax 3 & 5 Brake pots -> make List -> Napa Run. to get needed parts. -> change clevis on Ax 2. -> Tap new hole for transmission inspection plate. -> Look for origin of multiple leaks.			CS
Feb 02	Repair/Replace Service air line. Space out out Riggers on Rear by edeling skins confirm service ability. Repair latch on aux hook winch line. Prep for cuip			CS
Feb 03	continue on cuip inspection, compile list of defects go over with Foreman, Find source of hydraulic leaks, Remove Replace Tie Rod End, Remove ujoint From transmission Trouble with removal			CS
Feb 04	Replace 3rd Axle wheel Seal's Both Sides, install pro torque on both, set wheel bearing play -002. - Replace both sets of Brake shoes Both oil damaged.			CS

NOTES: