

R14-21
SEP

DIVERSE

-TRUCK & EQUIPMENT-

DATE July 27 / 26

KM _____ HRS N/A

UNIT NUMBER SB340

COMPLAINT: Axle beam do for service

CAUSE: _____

CORRECTION: 1 RAS Axle beam broke off
replaced a new one on, greased unit
replaced 1 RAS brake pad, replaced
Axle 1 RAS dust shield


Stocked Parts:

HAB-8-32C-SW X1
FS-6606-18X1
190-3x6
D-34056-1X2
WD-40X1
85938X1
S241862x1 axle beam

Repairs done by Gomez B

Date: July 27 / 26

Authorized by: _____

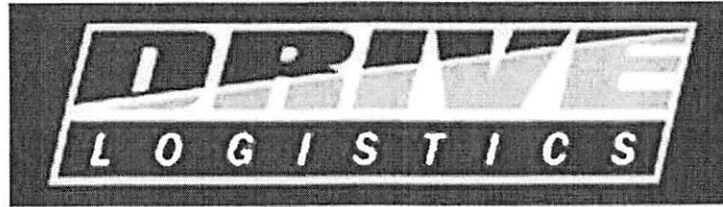

DATE July 25 2026
BECAUSE THE ODOMETER WAS SHOT.
KM 0 HRS

UNIT NUMBER SB 340A

COMPLAINT: 1ST AXLE ARM IS BROKEN. P-SIDE

CAUSE: _____

CORRECTION: I DROVE FROM PR SHOP NEAR TO PEAVINE SITE. I WAS ABOUT TO CHECK THE HUB METER AND FOUND OUT THAT THE HUB ON 2ND AXLE HAS A BIG HOLE, I REMOVE THE HUB CAP (BROKEN) AND SWAP IT ON THE 1ST AXLE BECAUSE I KNOW THAT I WILL LIFT THE 1ST AXLE. AFTER REPAIRING THAT, I PROCEED ON REMOVING THE AIR LINES FOR THE 1ST AXLE AIR BAGS. ~~BECAUSE~~ I HAD TO MAKE AN AIR LINE FROM THE LEVELING VALVE GOING TO 2ND AXLE AIR BAG BECAUSE IT DID RUN THRU AT THE 1ST AXLE BEFORE IT GOES TO THE 2ND AXLE. AFTER FIXING THAT I STARTED TO LIFT THE AXLE AND CHAIN IT. AIR UP THE AIR BAGS AND NOW IT IS OK TO

Stocked Parts: TRAVEL. (I HAD TO WAIT FOR THE DRIVER TO UNLOAD BECAUSE HE WAS USING THE AIR).

Repairs done by John, MAFU

Date: July 25, 2026

Authorized by: _____




Maintenance Details

Priority

Requested Action

Description Of Repairs

Wishlist

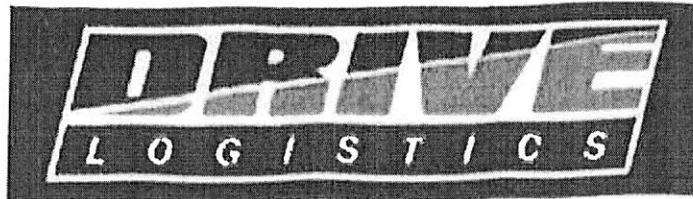

DATE Jun 15th

KM 264126

HRS _____

UNIT NUMBER

SB 340

COMPLAINT:

List, air leaks, Service

CAUSE: _____

CORRECTION:

New air valve on pup 2nd axle
New light back of pup middle brake light
New signal light lead left side - 2 new tires middle
axle LHS of Lead - Ground - New slack adjuster p.h 3rd
axle LHS

Stocked Parts:

x115-C x4 SR2238AP

x107-C x2

PC1468-6C

PC1469SW-8C

1469-6C x2

BH110700

-24.5 x2

-LEP2238-24RP

PT9530 x2

Repairs done by

Morgan

Date: _____

Authorized by:

[Signature]



Retorque Notice

Tag # 2719

Date: Dec 11 2015

Unit #: 533144 Odometer: 34126

Issued By: COOPER

Initial Completed	(X) Install	Axle	Axle	(X) Install	Initial Completed
		1	1		
	X	2	2		
		3	3		
		4	4		
		5	5		

Comments: rebranded

hccf11b

Retorque Completed

Valley Motors # 26630

Date: _____ Odometer: _____

Name: _____ Signature: _____

Note: Retorque must be completed within 150 km or at the first available outside facility.
Initial each wheel for which retorque was done.