

repairs and maintenance						
SN - 1FDUF4HYXFED33461			2015 Ford F450			
Date	Repaired By	Repair Form# / Inv.	KMS	Description of Problem	Repair Completed	Parts Used
Dec 12/02/2025	Choice Auto Electric	137639				1x Starter 12V CCW D/D
Dec 12/02/2025	Bumper to Bumper	1686-128364				1x fuel injector.gas li(412)
Dec 12/29/2023	Lube Stop	00001-1050856	163476		oil change, oil filter, air filter	supreme synthetic 5W-20
	Bumper to Bumper	169838				9-49883 Air filter
12.28.2023	Greg Resendiz	23	163474	air hose broken, park lights out, marker lights out, mirror lights out, need shocks on body doors, remote starter not working	fixed air hose, replaced bulbs on park lights, replaced bulbs and 1 light, replaced bulbs on mirror lights, installed new shock absorbent on body doors, fixed remote starter	bulbs, lights, shocks
	Bumper to Bumper	1686-89512				2x led lamp clear marker(47092), 2x led lamp clear marker(47093), 1x lifelong mini bulb(3157NALLB2), 10x standard mini bulb (194CP)
Dec 12/14/2023	Bumper to Bumper	1686-88955				1x - 48007 Forg shank comb pl, 1x - 48006 forg shank combo pl, 2x - 5/8 hitch pin super
Dec 12/12/2023	Gallant Mechanical	2769	162201	fuel pump not working, one connector melted, main fuse on compressor blown	cut out and installed new connectors, replaced fuse, installed key switch, adjusted idle, also need carb kit	
Dec 12/5/2022	Kaltire	689122977	156057		4 new tires, 24.5"/22.5"/19.5" truck tire changeover, wheels have been torqued	4x - 225/70R19.5 G14 MIC XDS 2 3PMS
Nov 11/29/2022	Ford	279842	155772	harness touched exhaust pipe and melted wires	removed and repaired transmission wiring harness	
Oct 10/25/2022	Ford	279119	155284		replaced transmission, replaced seal and oil slinger because the crank shaft rear main seal was leaking	1x - 9C3Z*7000*JARM automatic transmission, 1x - F65Z*6310*A slinger, 1x - F4AZ*6701*A Seal ASY - crankshaft
Oct 10/17/2022	Gallant Mechanical	2512	154784	found 02 sensor code, trans pressure code and evap canister code, removed bank2 sensor 1 02 sensor, found bad wiring	replaced transmission bank2 sensor 1 02 sensor, replaced evap canister, replaced solenoid	ordered harness
Oct 10/13/2022	Ford	418253				1x 2 B4 sensor(DY*(1185), 1x 1 SN cannist (BU5Z*9C985*B), 1x SN solenoi (4C3Z*7G383*AA), 1x 1 B1 Cap asy (RS*345*)
April 4/21/2022	Gallant Mechanical	2391	152858		replaced #2 and #7 coils, replaced tires, changed engine oil and filter	
April 4/8/2022	Ford	409355				1x (FL*820*S) 46 E1 filter, 10x 64 FL motorcr enoil(CXO*0W20*LFS6)
Dec 12/19/2021	Gallant Mechanical	2322	142909		finished install of new engine, bolted on intake, installed water pump, pulley fan, alternator and A/C comprsor, installed new oil cooler, rads front clip bumper, filled with coolant	
Dec 12/16/2021	MPL	4595	289171	check for no 4WD, verify transfer case switches, vaccume switch under hood has a votage change(does not switch),	vaccume tested both front hubs, replaced switch, removed and replaced old running boards supplied by us	
Nov 11/28/2021	Gallant Mechanical	2313			Installed oil filter tube and motor mounts, extracted broken bolts on manifold	
	Gallant Mechanical	2308			pulled off front clip, removed rads and pulled engine out, started swaping out engine parts	
Nov 11/12/2021	Ford	399984		engine		1x 1 sn service core deposit (8C3Z*6006*BARM), 10x 10 sn gasket (7R3Z*9439*AA), 1x 1 C2 gasket (3L3Z*8C387*AC), 1x 1 C2 gasket (3L3Z*8C388*AC), 1x 1 sn thermos (RT*1195*), 1x 1 B1 seal(RG*571*), 1x 1 C2 gasket(F1VY*8507*A), 2x 2 sn gasket (CC3Z*9448*A), 2x 2 sn gasket (CC3Z*9448*B), 2x 2 sn heater (3L3Z*6A051*BA), 8x us bolt (F1AZ*6379*A), 1x 3 C4 gasket (F65Z*6840*B)
Oct 10/24/2021	Gallant Mechanical	2294		hooked up computer found #3 and #10 cylinder misfire, cleared codes but #3 still shows, when started banging sound in engine shut off and had it towed, pulled coils and spark plugs, did compression test and found 0 psi compression on cylinder #3, pulled valve covers and found valve has dropped, cam and lifter are bad		
July 7/27/2021	MPL	4475	140600	starter spins freely from time to time needs replacing, radiator badly plugged with debris	Change engine oil and filter, Change trasmission fluid and filters, Replace air filter, Replace starter, recharge A/C, pressure washed radiator to remove debris	5W20 engine oil, Mercon LV, Gasket

Feb 2/14/2021	Gallant Mechanical	2117	133595	tested steering pump is going to need replacing later on, air compressor low on oil	replaced upper rad hose seal, topped up air compressor oil and coolant	
Oct 10/2/2020	MPL	4268	132978	transfer case fluid in bad shape, no heat in cab	General inspection of truck, check all brakes front and rear 80% left, Transfer case service, reroute coolant lines to rear of vehicle heat works in cab, install timbern bumpers in rear, ride height increased by about 3"	Amsoil Low Viscosity ATF-9.46L, Timbern Spring enhancer