

WO: 219083 - Clean cab					Open
	Item: 240479 - Clean cab				
	7/4/2026	12	EBORA, WENCESLAO	Clean cab	
WO: 218753 - (250) SERVICE - CAT 336F EXCAVATOR PROGRAM					Open
	Item: 240149 - (250) SERVICE - CAT 336F EXCAVATOR PROGRAM				
WO: 218559 - Assemble quick attach and thumb					Open
	Item: 239959 - Assemble quick attach and thumb				
	7/2/2026	6	GOLOS, SCOTT	Finish thumb and quick change Make new hoses Make retainer pins	
	7/2/2026	4	GOLOS, SHAWN	Assemble qc. Make new hoses and install. Repair codes	
	7/1/2026	4	GOLOS, SCOTT	Assemble quik attatch and thumb	
	6/25/2026	12	HOLTZ, AUSTIN	Search for thumb and search for components of the stick nose assembly.	
WO: 218562 - 4000 hr PM					Open
	Item: 239962 - 4000 hr PM				
	7/4/2026	1	DENTITH, RYAN	Top up and check fluids	
	6/29/2026	0.5	DENTITH, RYAN	Change hydraulic filter	
	6/28/2026	4	DENTITH, RYAN	Change swing drive oil, hydraulic oil and filters, blow out radiator, engine oil and filter, finish service	
	6/27/2026	2	DENTITH, RYAN	Pick up kit, warm up engine oil, change engine oil/filter, change fuel water separator and fuel filters, change engine air filters, change cab air filters	
	6/25/2026	6	DENTITH, RYAN	Sample fluids and enter/send, change final drives, boost unit 3 times, tighten tracks, check over unit, measure ice lugs, assist with other repairs	
WO: 218563 - Change batteries					Open
	Item: 239963 - Change batteries				
	6/25/2026	3	DENTITH, RYAN	Get new batteries from warehouse, Remove old batteries that won't hold a charge, clean up terminals, clean out trays, install new batteries, reinstall hold down brackets and terminals	
WO: 217934 - Quick Change					Open
	Item: 239332 - Quick Change				
	7/1/2026	6	GOLOS, SHAWN	Rebuild quickly change. Troubleshoot and repair emissions and engine codes	
	6/14/2026	4	GOLOS, SHAWN	Rebuild hydraulic QC, install track pads	

Equipment History From January 1, 2001 to September 16, 2026

	6/14/2026	3	GOLOS, SCOTT	Quick change install and assembly	
WO: <u>217870</u> - Fluid top ups					Open
	Item: 239271 - Fluid top ups				
	6/12/2026	4	DENTITH, RYAN	Change hydraulic oil, change pump drive oil, assist travel motor install	
WO: <u>216985</u> - Repair bent connecting rod					Open
	Item: 238388 - Repair bent connecting rod				
	6/13/2026	12	GOLOS, SCOTT	Install all other parts from engine and final install	
	6/12/2026	12	GOLOS, SCOTT	Finish engine and counterweight Start and check for problems Install finals and travel motors	
	6/11/2026	9	GOLOS, SHAWN	Finish engine install	
	6/11/2026	9	GOLOS, SCOTT	Cont installing engine	
	6/10/2026	8	MEGLEY, KYLE	Setup crane, hoist engine back into place, start reassembling unit.	
	6/10/2026	12	GOLOS, SCOTT	Install engine in machine and start to Reassemble	
	5/31/2026	12	GOLOS, SCOTT	Torque and install all parts and finish engine reassembly	
	5/31/2026	12	MACLEOD, CONNOR	Assisted Scott with re assemble of engine, torqued all head bolts to spec, installed rocker arm assembly and bridges, torqued to spec, re installed oil pan with new gasket, and all remaining hookups	
	5/30/2026	12	GOLOS, SCOTT	Disassemble engine Remove number 3 liner and piston Start to Reassemble	
	5/30/2026	7	MACLEOD, CONNOR	Assisted Scott installing new liner and piston	
	5/29/2026	7	HOLTZ, AUSTIN	Removed engine and set the engine up on a stand.	
	5/29/2026	12	GOLOS, SCOTT	Remove engine from machine and put on stand Get engine washed Move to shop and start disassembling	
	5/28/2026	12	GOLOS, SCOTT	Cont to pull engine	
	5/27/2026	7	GOLOS, SCOTT	Start to remove paneling and railings for engine removal	
WO: <u>206470</u> - Check wrist pin					Open
	Item: 227732 - Check wrist pin				
	6/14/2026	9	PETERS, MICHAEL	Weld up track links and pins. Template final drive covers and fab. Installed covers	
	6/14/2026	6	MERESKA, THOMAS	Fabbed new cover pans	
	6/13/2026	12	GOLOS, SHAWN	Install tracks, handrails, rad supports, guarding and panels. Install belly pans and two speed hoses	
	6/12/2026	12	GOLOS, SHAWN	Install counterweight and final drives	
	5/31/2026	4	GOLOS, SHAWN	Install oil pan, insulation and egr cooler and piping	

	1/5/2026	1	PETERS, MICHAEL	Dig out, check main wrist pin for play. Move to up line	
WO: <u>195934</u> - rebuild final drive (8968 HR)					Closed
	Item: 216601 - rebuild final drive				
	8/11/2025	9.5	SMITH, DOUGLAS	start assembly on second final drive travel motor	
	8/7/2025	9.5	SMITH, DOUGLAS	finished off second final drive assembly	
	8/6/2025	9.5	SMITH, DOUGLAS	start assembly onn second final	
	8/5/2025	9.5	SMITH, DOUGLAS	finish assembly on first final drive	
	7/29/2025	4	SMITH, DOUGLAS	disassemble second final drive and order parts	
	7/28/2025	9.5	SMITH, DOUGLAS	work on final drive	
	Item: 215514 - Final drives				
	9/4/2025	1	COOK, CHAD	Split track and set to remove final drive	
	9/2/2025	12	GOODMAN, NORMAN	Install both final drives. Wrap and pin both tracks	
	9/2/2025	12	COOK, CHAD	Install both final drives, connect hoses Fill case with oil Wrap and pin tracks, install left pads Rhs pads to be installed after link is welded	
	7/15/2025	6	MACLEOD, CONNOR	Split tracks, dealt with seized pins, removed both left and right final drive and motors to be sent to fort hills, capped lines cleaned up work area	
	7/15/2025	6	BRACE, AARON	Split track removed finals and sent to parts to send away	
	7/15/2025	6	GOLOS, SCOTT	Remove both finals	
WO: <u>188474</u> - Cab Cage (8968 HR)					Closed
	Item: 208460 - Cab Cage				
	4/27/2025	2	SHEARER, KEELAN	Put cab cage back on 1506	
	4/26/2025	3	SHEARER, KEELAN	Removed cab cage to install on 1550, did not fit.	
WO: <u>188157</u> - Quick Attachment (8968 HR)					Closed
	Item: 208135 - Quick Attachment				
	4/23/2025	4	SHEARER, KEELAN	Parked up next to 1550. Removed bucket. repaired broken bolts on gps module on bucket. Removed pins on quick attachment.	
WO: <u>184802</u> - Check over (8968 HR)					Closed
	Item: 204807 - Check over				
	3/15/2025	5	GOLOS, SCOTT	Check over before engine purchase Check all levels and check over machine Cut case drain and return filters for hyd Has bent con rod on 3 so couldn't check pressure and such	

WO: 184112 - DEMOB (8968 HR)					Closed
Notes: SMS -> PCY					
	Item: 204075 - DEMOB				
	250307-1506-DEMOB.pdf				
WO: 183788 - #3 misfire (8968 HR)					Closed
	Item: 203740 - #3 misfire				
	3/6/2025	6	WIPF, JACOB	Number 3 connecting rig is bent, installed 3 and 4 injectors and put valve cover back on	
	3/5/2025	5	WIPF, JACOB	Measure piston height on number three and number four and found number three reconnecting Rod bent	
WO: 183083 - Air-air and emissions (8916 HR)					Closed
	Item: 202860 - Air-air and emissions				
	2/26/2025	5.5	TYSHYNSKI, KYLE	Travel, waited for parts to be delivered, installed cleaned air-air, installed all removed components, unit locked out for emissions, tried doing tests or service procedures no luck	
WO: 182556 - Turbo and DPF (8916 HR)					Closed
	Item: 202335 - Turbo and DPF				
	250222-1506-COMPONENT CHANGE.pdf				
	2/23/2025	7	TYSHYNSKI, KYLE	Travel, replace DPF filter, remove components to remove air-air, remove air-air for cleaning	
	2/21/2025	5	TYSHYNSKI, KYLE	Travel, remove and replace turbo and hardware, start removing DPF filter	
WO: 180977 - Codes (8916 HR)					Closed
	Item: 200699 - Codes				
	2/5/2025	2	TYSHYNSKI, KYLE	Got to unit and filling location with smoke, shut unit off, oil coming from exhaust, crankcase completely froze off, pulled piping on turbo, intake and exhaust full of oil and turbo faulty	
	2/5/2025	2	HANSON, JORDAN	Assist mechanic in pulling piping. Turbo faulty	
	2/4/2025	1	LITTLE, JAMES (MIKE)	Start unit check codes	
WO: 180537 - Swap bucket (8916 HR)					Closed
	Item: 200180 - Swap bucket				
	2/4/2025	10	HANSON, JORDAN	Sent to swap bucket. Opps shut off machine. Heat and boost machine to start. Machine shut itself	



Equipment History From January 1, 2001 to September 16, 2026

			off after 5 min with low fuel pressure code. Get machine running again. Swap bucket to right twist wrist. Load old bucket and ripper attachment onto picker truck. Machine lost all power and shut off. Let supervisor know. Assist mechanic in troubleshooting no power issue.	
2/3/2025	1	HOSPERS, FOLKERT	Drive to line 14 and load up bucket needed for 1506	
2/1/2025	3	HANSON, JORDAN	Install lines on bucket. Boost machine to start. Once machine warm check run checks on bucket. Bucket moves L and R.	
1/30/2025	3	LITTLE, JAMES (MIKE)	Get unit running ,no power added conditioner and method hydrate let it work through system, remove ripper, unload bucket from truck , install on unit ,remove lines bring back to yard	
WO: 179947 - Broken grease line (8916 HR)				Closed
Item: 199571 - Broken grease line				
1/23/2025	4	LITTLE, JAMES (MIKE)	Try to remove broken fitting,would not come out ,dried out piece recapped hole , drove to parts find fitting ,return and install	
WO: 178788 - Ripper tip (8912 HR)				Closed
Item: 198374 - Ripper tip				
1/10/2025	2	MOCKE, SEAN	D8 ripper tip wouldn't fit. Grind down and hammer on.with travel	
WO: 176276 - Doesn't stay running. (8916 HR)				Closed
Item: 195596 - Doesn't stay running.				
2/4/2025	5	RANTA, CLAYTON	Codes intake manifold pressure code data drift low. 1785-2 and E1045(2) for low intake manifold pressure Check wiring. Swap sensor with ard #2 pressure sensor code went away. Steal sensor from 1499. Ran good for about an hour. Started coding again. Hyd slow. Order stolen parts for 1499.	
12/9/2024	3	LUPU, ION	Been complains Doesn't stay running died with no codes doesn't run more than 10 minutes. Replace water separator and one filter. Clean up a hose between water separator and filters. Add conditioner and Fix the problem ran good.	
WO: 173107 - (250) SERVICE - CAT 336F EXCAVATOR PROGRAM (8968 HR)				Closed
Notes: CHANGED BATTERIES DURING SERVICE				
Item: 191806 - (250) SERVICE - EXCAVATOR CAT PROGRAM				
260625 - 1506 - 4000HR.pdf				
WO: 172843 - Mulcher head (8809 HR)				Closed
Item: 191498 - Mulcher head				

Equipment History From January 1, 2001 to September 16, 2026

	12/21/2024	4	HANSON, JORDAN	Wait for ripper shank to show up at unit. Chip off mud. Remove bucket. Install ripper shank. Take pictures of machine and hour meter.	
	10/28/2024	4	MOCKE, SEAN	Remove mulching head and all hoses and wiring. Cap lines and load mulching head on stand and on truck. Install bucket and top up oils	
	10/28/2024	4	WIPF, JACOB	Drive to unit to troubleshoot leak, found shaft seal on motor for mulcher head leaking, checked in monitor to see what flow setting it was on. Machine is set on 200 litres per minute setting.	
	10/24/2024	8	MOCKE, SEAN	Complete attached mulch head. Remove windows for plexy glass fit. Get gate opening and closing	
	10/23/2024	12	MOCKE, SEAN	Remove twist wrist bucket and attach mulching head, Change all fittings to accommodate new attachment. Run wire from cab to foot pedal and to mulching head.	
	10/23/2024	7	HANSON, JORDAN	Make spacer for bucket pin. Clean up threads for pin retaining cap. Assist mechanic with fit up of hoses and running wires.	
WO: 172661 - Squeal (8864 HR)					Closed
	Item: 191265 - Squeal				
	12/28/2024	3	FENTON, GARNET	Noise coming from the front of the engine. Check tensioner/pulley / alternator/air conditioner. It was the belt put a dab of white grease on it. Noise went away..	
	12/1/2024	2	HANSON, JORDAN	Boost unit to start. Warm up. Walk machine out of way. Machine lost all power. Has a fueling issue. Filters were just changed.	
	11/30/2024	2	HANSON, JORDAN	Charge and boost to start. Let unit run to charge batteries. Try to move unit but no power like its starving for fuel. Need to change filters and put heat on unit.	
	11/6/2024	4	LITTLE, JAMES (MIKE)	Listen to code wait till they finished job ,checked boost side of intake for leaks , checked fan hub and bearing remove guards from under machine noise went away ,installed guard with all the bolts required noise gone	
	11/6/2024	3	TYSHYNSKI, KYLE	Travel, help diagnose squeal nose	
	10/20/2024	2.5	MOCKE, BRUCE	Travel out to unit and front squeal, present removed guards and belts and check pulleys couldn't really find much so I ran unit and used the temp gun from the tensioner pulley and idler pulley on the alternator Drive side we're running 15° to 20° hotter ordered pulley an tensioner	
WO: 169280 - Overheat/belt (8574 HR)					Closed
	Item: 187636 - Overheat/belt				
	8/26/2024	3	MOCKE, BRUCE	Replace belt	
	8/23/2024	2	MOCKE, BRUCE	Travel to units trouble shoot overheat found fan belt snapped checked pulleys to ensure that they are not seized ordered belt	
WO: 169171 - Rpr hyd leak (8565 HR)					Closed
	Item: 187521 - Rpr hyd leak				

Equipment History From January 1, 2001 to September 16, 2026

	8/22/2024	1	MEGLEY, KYLE	Complaint of hyd leak by bucket. Travel back to unit, inspect and found loose JIC fitting at aux line block. Tightened and ran to verify repair - no leak. Checked hyd level - ok.	
WO: 168855 - No start (8545 HR)				Closed	
	Item: 187212 - No start				
	8/16/2024	3	MOCKE, SEAN	Troubleshoot no start with travel, failed relay	
WO: 168576 - (500) SERVICE - EXCAVATOR CAT PROGRAM (8699 HR)				Closed	
	Item: 186922 - (500) SERVICE - EXCAVATOR CAT PROGRAM				
	241026-1506-500H.pdf				
WO: 168204 - T/S & rpr emissions fault (8447 HR)				Closed	
	Item: 186501 - T/S & rpr emissions fault				
	8/4/2024	6	MEGLEY, KYLE	Travel to unit. Complaint of check engine warning - inspected and found active code for NOX inlet sensor failure. Inspected wiring - no obvious issue, no other codes. Lookup and order sensor, tagged out unit. Travel back to line 14 to continue work on 1571, got called back to rush unit up. Travel to warehouse and wait for sensor to arrive, travel back to unit. Installed new sensor, ran emissions functionality test, code went inactive. Built bracket to fit updated module and reassembled machine.	
WO: 168056 - Gps (8429 HR)				Closed	
	Item: 186347 - Gps				
	8/1/2024	6	TYSHYNSKI, KYLE	Travel, diagnosing no power to gps, checking wiring and components, found a relay that is faulty	
WO: 166979 - Bucket swop (8427 HR)				Closed	
	Item: 185166 - Bucket swop				
	7/12/2024	4	MOCKE, SEAN	Bucket swop knuckle Bucket in the middle of dyke 13. Load Bucket on wiggle and transport to line 14 welding bay for repair	
WO: 166850 - UNDERCARRIAGE REPORT (28 PCNT)				Closed	
	Item: 185039 - UNDERCARRIAGE REPORT				
	SUNCOR 336F #1506.pdf				
WO: 165117 - (4000) PM - SMALL EXCAVATOR				Open	
	Item: 187569 - UNDERCARRIAGE PLUGGED				



Equipment History From January 1, 2001 to September 16, 2026

	12/11/2024	3	LUPU, ION	Battery low charger install heater maker start	
	Item: 186793 - LEAKS - HYDRAULIC / HOSE ON PUMP / TILT CYLINDERS ON BUCKET				
	Item: 186728 - HYDRAULIC LEAKING UNDER PAN				
	Item: 185106 - FRONT WINDOW CRACKED				
	10/26/2024	2	FENTON, GARNET	Replace front glass with Lexan	
	Item: 183006 - (4000) PM - SMALL EXCAVATOR				
	10/3/2025	3	YULO, FRANCIS ALBERT	Steam	
	10/23/2024	1.5	RANTA, CLAYTON	Install new dipstick and tube	
WO: 163303 - Boom-stick cylinder (8318 HR)					Closed
	Item: 181342 - Boom-stick cylinder				
	240607-1506-Component Change.pdf				
	6/7/2024	3.5	FENTON, GARNET	Installed stick boom cyl and hoses	
	6/7/2024	3	WIPF, JACOB	Install stick cylinder	
	5/13/2024	0.5	ULRIKSEN, CONRAD	Lift off cylinder	
WO: 162852 - (250) EXCAVATOR CAT PROGRAM (8498 HR)					Closed
	Item: 177792 - (250) EXCAVATOR CAT PROGRAM				
	240811-1506-250H.pdf				
	8/11/2024	1	JUAN, JOHN	250 HR Service	
	8/11/2024	1	DAYAP, FERNANDO	Service	
WO: 162853 - (3000) PM - SMALL EXCAVATOR (8320 HR)					Closed
	Item: 180415 - (3000) PM - SMALL EXCAVATOR				
	240609-1506-3000H PM.pdf				
	6/9/2024	4	MOCKE, SEAN	3000 pm inspection	
WO: 159246 - Emission codes (8226 HR)					Closed
	Item: 177954 - Emission codes				

Equipment History From January 1, 2001 to September 16, 2026

	3/31/2024	12	LITTLE, JAMES (MIKE)	Troubleshoot system repair broken wires , still codes continue troubleshooting , got codes to erase , assembly unit	
	3/30/2024	8.5	LITTLE, JAMES (MIKE)	Troubleshoot blow out lines , change def pump code still continue troubleshooting	
WO: 159084 - (2000) EXCAVATOR CAT PROGRAM (8226 HR)				Closed	
	Item: 168004 - (2000) EXCAVATOR CAT PROGRAM				
	240328-1506-2000H.pdf				
WO: 153265 - Hydraulic hose leak (8380 HR)				Closed	
	Item: 171921 - Hydraulic hose leak				
	7/2/2024	3	HOSPERS, FOLKERT	Drive to the dyke 13 get a wiggle to drive far end of the dyke remove broke hyd line on articulation bucket go to shop make hose and install back on unit got hyd fluid topped up good to go	
	1/27/2024	4	ULRIKSEN, CONRAD	Drive to unit. Look for a bucket to swap out. Removed line from bucket. Drive back to the yard to build a hose. Drive out to machine put on new hose and test for further leak's. drive back to yard.	
WO: 151352 - Loose track (8086 HR)				Closed	
	Item: 170025 - Loose track				
	1/3/2024	1	HOSPERS, FOLKERT	Complaint of track being loose checked unit tracks did not need tightening sent back to work	
WO: 151107 - Hydraulic oil lick. (8318 HR)				Closed	
	Item: 169777 - Hydraulic oil lick.				
	5/11/2024	4	HOSPERS, FOLKERT	Drive to gypson pond find the stick cylinder is leaking let supervisor know start removing cylinder when it got to main laydown	
	1/10/2024	2	NOHR, CORY	Repair hydraulic leaks on bucket	
	12/30/2023	3	LUPU, ION	Drive to RT86 Check Unit and Around. Find out both Hose from the pump. Shock absorbers leaking from krimp. Pull them out. Cap lines, bring Hose to them warehouse. Tag unit	
	12/30/2023	2	HANSON, JORDAN	Install new hoses and o rings	
	12/30/2023	2	MALANOWICH, CRAIG	Build hydraulic line	
WO: 150910 - Emissions fault (8226 HR)				Closed	
	Item: 169585 - Emissions fault				
	3/30/2024	1	MOCKE, SEAN	Swop def controller and do regen	
	12/26/2023	2	MALANOWICH, CRAIG	Troubleshooting def pressure sensor, did an def efficiency test failed check connection and re-did test passed and code went away.	



WO: 150475 - Lights (7994 HR)					Closed
	Item: 169151 - Lights				
	12/18/2023	1	HOSPERS, FOLKERT	Replace 2 light bulbs all lights working	
WO: 150112 - (FLUSH) EXCAVATOR CAT PROGRAM (7989 HR)					Closed
	Item: 168787 - (FLUSH) EXCAVATOR CAT PROGRAM				
	231213-1506-FLUSH.pdf				
WO: 149294 - Track pin (7935 HR)					Closed
	Item: 167964 - Track pin				
	12/3/2023	2	HANSON, JORDAN	Called to unit for track pin walking out. Hammer pin back into ear. T pin missing keeper. Fab and install new keeper.	
WO: 149335 - (250) EXCAVATOR CAT PROGRAM (7935 HR)					Closed
	Item: 163997 - (250) EXCAVATOR CAT PROGRAM				
	231203-1506-250H.pdf				
WO: 147491 - Work needed to bucket (8207 HR)					Closed
	Item: 166126 - Work needed to bucket				
	1/24/2024	3	HANSON, JORDAN	Try to swap twist wrist for digging bucket. Digging bucket sent was too small to but machine. Reinstall twist wrist. Check hyd lines for leaks.	
	11/24/2023	1	HOSPERS, FOLKERT	Tighten down bucket wedge	
	11/6/2023	1	SPARKS, BRADLEY	Checked for cracks. Needs lateral bars , needs corner blocks. Frog protector, and wing guards good for corks	
WO: 145351 - Boost (8213 HR)					Closed
	Item: 163972 - Boost				
	3/27/2024	1	MANARY, DANIEL	Boost and prime unit to get on a float	
	10/10/2023	2	MCCUTCHEON, CHAD	Boost unit and get running	
WO: 145372 - (500) EXCAVATOR CAT PROGRAM (7713 HR)					Closed
	Item: 146840 - (500) EXCAVATOR CAT PROGRAM				
	231009-1506-				

500H.pdf					
WO: 145199 - 500hr pm (7935 HR)					Closed
	Item: 163824 - 500hr pm				
	12/3/2023	3	NOHR, CORY	Remove pads repair pin walking out weld and install pads	
	10/9/2023	4	ANSTEY, BRANDON	Changed Eng and final oil Changed Eng, fuel and air filter	
WO: 140010 - Dull knocking under load (8213 HR)					Closed
	Item: 158508 - Dull knocking under load				
WO: 134308 - Hydraulic leaks (7636 HR)					Closed
	Item: 152887 - Hydraulic leaks				
	6/18/2023	5	MACDOUGALL, KENTON	Cleaned hydraulic lines by pump and seen 2 lines leaking at fittings. Removed lines and replaced the orings. Dropped belly pan and cleaned lines. Couldn't locate the leak could be coming from the other 2 lines inside the side door. Unit was low in hydraulic oil	
WO: 131585 - Overheat (7572 HR)					Closed
	Item: 150187 - Overheat				
	5/28/2023	2	TYSHYNSKI, KYLE	Travel to Dirch job, installed new water pump belt and tested-good	
	5/25/2023	2	TYSHYNSKI, KYLE	Travel to Plant 300, diagnosed overheating issue water pump belt faulty	
WO: 130426 - Def manifold (7560 HR)					Closed
	Item: 149040 - Def manifold				
	5/16/2023	2	PARENTEAU, LAYNE	Swapped in new def manifold and fired unit up. Investigated ac issue and found plugged cab filters. Replaced and issue is resolved. Ran the unit through a regen and function tests. Units up	
WO: 130288 - Bucket (7560 HR)					Closed
	Item: 148901 - Bucket				
	5/23/2023	1.5	LUPU, ION	Switch wiggle backup with g p s	
	5/15/2023	2	SPARKS, BRADLEY	Cut corner blocks for bottom of bucket	
WO: 129958 - No start (7553 HR)					Closed
	Item: 148573 - No start				
	5/13/2023	3.5	MOORE, JOHN B	Drive to work area, wait for permit to be issued to start work. Unit started with no issues. Left running and diagnosed engine code for high DEF concentration, troubleshooting leads to requiring new DEF manifold. Has been replaced on March 8th already. No verification of part number installed. Advised supervision and ordered part. Unit to be floated back to yard for further	

Equipment History From January 1, 2001 to September 16, 2026

				repair and diagnosis upon completion of dirt job.	
	5/12/2023	3	MASON, JONATHAN	Find unit, at pond 2/3, told batteries dead, found batteries good, have key power, implement lock good and engine kill swith not activated, more diagnosing needed to find no start issues	
WO: 128357 - Bucket swap (7478 HR)				Closed	
	Item: 146993 - Bucket swap				
	4/27/2023	3	TYSHYNSKI, KYLE	Travel to 2E ditch Removed digging bucket and installed wrist-a-twist bucket, tested and all works	
WO: 128205 - (250) EXCAVATOR CAT PROGRAM (7472 HR)				Closed	
	Item: 141248 - (250) EXCAVATOR CAT PROGRAM				
	230425-1506-250H.pdf				
WO: 128058 - Teeth (7472 HR)				Closed	
	Item: 146693 - Teeth				
	4/24/2023	2	HANSON, JORDAN	Change teeth	
WO: 127778 - Bucket inspection (7449 HR)				Closed	
	Item: 146413 - Bucket inspection				
	4/22/2023	1	COCHLIN, RYAN	While still in the area, cleaned and inspected. Record all findings on file through app.	
	4/22/2023	1	DORT, THOMAS	Complete bucket inspection.	
WO: 125656 - No start (7376 HR)				Closed	
	Item: 144291 - No start				
	4/3/2023	1	MASON, JONATHAN	Called to unit would not start, arrived at unit, unit was running	
WO: 125579 - Undercarriage Report (32 PCNT)				Closed	
	Item: 144214 - Undercarriage Report				
	336F #1506.pdf				
WO: 122970 - Inspection (7289 HR)				Closed	
	Item: 141584 - Inspection				
	3/24/2023	3	HANSON, JORDAN	Called out to unit from Stp. Repair gps bracket	
	3/13/2023	1	HANSON, JORDAN	Bucket inspection. Check pins and bushings in stick to boom, h link and boom cylinders	
	3/13/2023	1	MASON, JONATHAN	Pin and bucket Inspection	

WO: 122636 - (1000) EXCAVATOR CAT PROGRAM (7225 HR)					Closed
	Item: 137164 - (1000) EXCAVATOR CAT PROGRAM				
	2023-03-10_1506_1000H.pdf				
WO: 121841 - Replaced 5 tiger teeth (7336 HR)					Closed
	Item: 140438 - Replaced 5 tiger teeth				
	3/29/2023	1	MOCKE, SEAN	5 new tigers installed	
	3/9/2023	1	MOCKE, BRUCE	Replace five tiger teeth	
	3/4/2023	2	MASON, JONATHAN	Replaced 5 tiger teeth, all pins where frozen in	
WO: 121912 - Emissions code (7225 HR)					Closed
	Item: 140511 - Emissions code				
	3/8/2023	3	TYSHYNSKI, KYLE	Replaced DEF manifold sock, emptied DEF tank and got refilled Travel back to yard	
	3/5/2023	1	MOCKE, SEAN	Emissions codes troubleshoot	
WO: 120651 - Hydraulic leak (7129 HR)					Closed
	Item: 139258 - Hydraulic leak				
	2/23/2023	1	HOSPERS, FOLKERT	Hydraulic leak o ring no good	
WO: 119843 - R & R bucket teeth (7075 HR)					Closed
	Item: 138444 - R & R bucket teeth				
	2/16/2023	3	COCHLIN, RYAN	Get to unit and replace teeth on bucket. One was difficult to remove and tighten the bucket wedge bolts.	
	2/16/2023	2	HOSPERS, FOLKERT	Remove and replace bucket teeth	
WO: 118570 - (250) EXCAVATOR CAT PROGRAM (7002 HR)					Closed
	Item: 133801 - (250) EXCAVATOR CAT PROGRAM				
	230206-1506-250H.pdf				
WO: 118429 - DEF quality (7183 HR)					Closed
	Item: 137022 - DEF quality				
	2/26/2023	2	MOCKE, SEAN	Emissions lock out, needs finning to unlock, plugged in and tried to generate password but unit not supported nlby software	

Equipment History From January 1, 2001 to September 16, 2026

	2/8/2023	1	SMITH, JAMES D	Ran unit. Checked codes. E1365 still active. Informed team lead. May need new head unit. PN 5280550	
	2/7/2023	6.5	SMITH, JAMES D	Check engine light. Code for def quality. Checked tank. Sand in tank. Removed tank. Returned to shop. Cleaned out tank. Returned to unit. Installed tank. Ordered new sock. Called for def.	
	2/5/2023	4	TYSHYNSKI, KYLE	Removed spout filter from DEF tank, inspected tank seen sand, removed manifold- sock clean, wiped out tank, cleaned spout filter, reassembled, couldn't get DEF brought to unit Travel back to yard	
WO: 116627 - Bucket teeth (6926 HR)				Closed	
	Item: 135211 - Bucket teeth				
	1/31/2023	2	HOSPERS, FOLKERT	Changed out bucket teeth	
	1/25/2023	0.5	HANSON, JORDAN	Tighten keeper bolts on h link pin	
	1/21/2023	2	TYSHYNSKI, KYLE	Travel to RT86 corridor Replaced bucket teeth and hardware	
WO: 116585 - Tarp up rad (6824 HR)				Closed	
	Item: 135168 - Tarp up rad				
	1/21/2023	2	MOCKE, SEAN	Tarp up rad, clear code and do regen	
WO: 116244 - Emissions code (6984 HR)				Closed	
	Item: 134828 - Emissions code				
	2/5/2023	2	SMITH, JAMES D	Ran function test. Aftertreatment working. Code for def quality sensor. 3100-11	
	1/22/2023	1	MOCKE, SEAN	Clear def high concentration code, soet level 0%.	
	1/20/2023	2	MOCKE, SEAN	Plug in and force regen, needs tarped	
	1/19/2023	2	MOCKE, SEAN	Heat unit with heat trailer and do regen by plugging in with ET	
	1/18/2023	2	MOCKE, SEAN	Not getting hot enough for a burn, needs tarp and heat and do burn	
WO: 115283 - Cab lights (6736 HR)				Closed	
	Item: 133866 - Cab lights				
	1/9/2023	1.5	COCHLIN, RYAN	Reposition the one light & installed a new light. Both on cab.	
WO: 115220 - (500) EXCAVATOR CAT PROGRAM (6725 HR)				Closed	
	Item: 131282 - (500) EXCAVATOR CAT PROGRAM				
	230107-1506-500H.pdf				
WO: 114731 - New tiger teeth (6689 HR)				Closed	

Equipment History From January 1, 2001 to September 16, 2026

	Item: 133308 - New tiger teeth				
	1/4/2023	3	MASON, JONATHAN	Drove to unit to make which teeth, drove to yard to pick up teeth pins and retainers, drove back to unit replaced	
WO: 113376 - Change out teeth (6456 HR)				Closed	
	Item: 131910 - Change out teeth				
	12/19/2022	1	MACELHERON, GEORGE	Change out teeth, with travel	
WO: 113148 - Repair cab and boom lights (6416 HR)				Closed	
	Item: 131687 - Repair cab and boom lights				
	12/17/2022	1.5	MACELHERON, GEORGE	Repair cab and boom lights , troubleshoot short in harness , with travel	
WO: 112754 - (250) EXCAVATOR CAT PROGRAM (6384 HR)				Closed	
	Item: 116406 - (250) EXCAVATOR CAT PROGRAM				
	2022-12-13_1506_250H.pdf				
WO: 112621 - Low fuel pressure (6367 HR)				Closed	
	Item: 131150 - Low fuel pressure				
	12/12/2022	4	SMITH, JAMES D	Cleared low fuel pressure code. Ran unit. Unit would stall but start after. Changed fuel filters. No change. Defrosted fuel cap. No change. Found quick fill not connected at the top. Will need to drain tank and repair.	
WO: 112011 - Boost (6337 HR)				Closed	
	Item: 130544 - Boost				
	12/8/2022	3	MACDONALD, JAMES C	Computer hook up for engine registration	
	12/7/2022	1.5	SMITH, JAMES D	Charged unit. Started unit	
WO: 111493 - Install gps (6308 HR)				Closed	
	Item: 129975 - Install gps				
	12/3/2022	2	SMITH, JAMES D	Installed GPS. Boosted unit	
WO: 105249 - OP - Engine fault check engine on (6293 HR)				Closed	
	Item: 123619 - OP - Engine fault check engine on				
	10/31/2022	0.5	MACDONALD, MATTHEW	Hook up Lap top no codes active , run aftertreatment function test passes ran for bit no issues at this time	
WO: 103282 - 2022 October - Running Repairs (6293 HR)				Closed	



Equipment History From January 1, 2001 to September 16, 2026

Notes: null					
	Item: 124632 - GPS				
	10/23/2022	3	MOCKE, SEAN	Remove GPS control box in battery compartment and hand to survey for repair. With travel	
	Item: 121746 - GPS Mast				
	10/3/2022	1	MOORE, JOHN B	Secure loose GPS mast, trim hold downs to clamp mounting plate.	
	Item: 121745 - Fuel Manifold				
	10/3/2022	1	MOORE, JOHN B	Replace aftertreatment fuel manifold, re-oring all sensors and fittings. Run and check for leaks, OK.	
	Item: 121743 - DPF Replacement				
	10/3/2022	4	MOORE, JOHN B	Replace DPF filter as required, run regen as part of replacement procedure. No issues.	
WO: 107524 - Ice Lugging (6198 HR)			Closed		
	Item: 121498 - Ice lugging				
	10/2/2022	3	ROBSON, TYLER	Waiting for steamers to done Moved off pad into welding Strung out Chipped lay out Welded half one side Pulled off to go to md9 Came back pulled for another job	
	10/2/2022	6	CARTER, DUSTIN T	Finish ice lugging machine	
	10/2/2022	4	REIN-GATES, HARLEY	Cork unit	
WO: 98585 - Undercarriage Report			Closed		
Notes: No reading on report. All new undercarriage.					
	Item: 116650 - Undercarriage Report				
	082222-1506-UC.pdf				
WO: 98345 - (2000) EXCAVATOR CAT PROGRAM (6127 HR)			Closed		
	Item: 107892 - (1000) EXCAVATOR CAT PROGRAM				
	1506 (2000HR) 08-18-22.pdf				
WO: 96295 - Undercarriage (6127 HR)			Closed		
Notes: null					
	Item: 117243 - Inspect hardbar				
	8/29/2022	2	HUSSAIN, ABDULLAH	Inspect bucke my pins Come off area Warm up machine	

Equipment History From January 1, 2001 to September 16, 2026

	Item: 114376 - Undercarriage				
	8/25/2022	4	BENNETT, SHEA	Drive from MD9 to TBCL. Install left side cotter pin on masterlink pin, instal 4 track pads on the left side. Finish wrapping right side tracks and masterlink pin install 2 right side track pads	
	8/24/2022	3	DOBOS, MICHAEL	Wrap tracks pin lh track	
	8/21/2022	3	HOSPERS, FOLKERT	tourqued rollor bolts, put right idler in, put rock guards up	
	8/20/2022	2	DOBOS, MICHAEL	Install rollers	
	8/20/2022	1	HOSPERS, FOLKERT	put the 2 rollors remaining up	
	8/19/2022	2	COCHLIN, RYAN	Set up work area, get bottom rollers from warehouse. Start to assemble older wheel and got called to other unit.	
	8/12/2022	5	ROBSON, TYLER	No crane By myself Cleaned rollers Greased bolts Tried few things that weren't working Ending using pickle with comealong made picking point around steel rack on top of roof of cab had to reset every time Installed Did not have Torque wrecnch wrote NT in yellow on ones that aren't Put guide up but did not have shallow socket to get in there Call to md through way	
	8/6/2022	3	TYSHYNSKI, KYLE	Installed LH idler	
	8/6/2022	1	CARTER, DUSTIN T	Assist mechanic in installing idler	
	8/3/2022	10	TYSHYNSKI, KYLE	Split LH track Removed undercarriage and hardware Installed sprockets and torqued to specifications	
	8/3/2022	10	MCCONNELL, KANE	Split LH track Removed undercarriage and hardware Installed sprockets and torqued to specifications	
	8/3/2022	12	ROBSON, TYLER	Cleaned up all old rollers and bolts put in bin Lifted machine pulled tracks Block machine Lates card board down Made two taps Tapped all holes wd40 Clean surface blew with air Cleaned rollers Anti seize all bolts Put rollers up and top 5 rollers on one bottom side shop looked in warehouse around warehouse none Torqued bolts Hung track guides on one side Put idlers on pallet beside old tracks Cleaned all garbage up	
	8/3/2022	12	MOCKE, BRUCE	Installed an torqued bottom rollers and tracks slides still missing five bottom rollers installed and talked top carrier rollers cleaned up area	
	8/2/2022	2	SCHOENING, DAKOTA	Remove track pads and remove 1.5 pins	
8/2/2022	3	ROBSON, TYLER	Waiting for steamers to finish washing Went got gear ready set Move machine Find master pins Chipped tracks Removed pads One pin removed Other 1-4 way out		
WO: 95519 - 2022 July - Running Repairs (6107 HR)				Closed	
Notes: null					
	Item: 113523 - Def codes				
	7/25/2022	4	MACDONALD, MATTHEW	Travel Diag unit throwing def quality codes drain tank will get nights for flush and refill try and	

				clear codes in morning	
WO: <u>90718</u> - 2022 June - Running Repairs (6070 HR)					Closed
Notes: null					
	Item: 109780 - Repair Track Fallen Off				
	6/21/2022	2.5	MOORE, JOHN B	Reinstall track fallen off of sprocket. Replaced faulty track valve, set track tension.	
	Item: 108554 - Hyd leak				
	6/10/2022	2	SCHOENING, DAKOTA	Drive to unit, work boom to find hyd leak find a leak between two hard line flanges take apart find o ring chewed up change o ring reasmble test no leak from that location raining to hard to verify no other leaks	
WO: <u>90109</u> - (250) EXCAVATOR CAT PROGRAM (5963 HR)					Closed
	Item: 103092 - (250) EXCAVATOR CAT PROGRAM				
	2022-06-04_1506_250H.pdf				
WO: <u>88202</u> - Undercarriage Report (79 PCNT)					Closed
	Item: 105753 - Undercarriage Report				
	051622-1506-UC.pdf				
WO: <u>86454</u> - 2022 May - Running Repairs (5936 HR)					Closed
Notes: null					
	Item: 105123 - Carrier rollers				
	5/14/2022	12	MACDONALD, JAMES C	Replace. R/ F. Idler. Put track together Replace. L/S. top. Rollers Install new track adjuster.	
	5/13/2022	2	MACELHERON, GEORGE	Shoveling track frames for carrier roller change out	
	Item: 104626 - Repair Damaged Track				
	5/14/2022	3	CARTER, DUSTIN T	Weld pin in track, assist mechanic, help load old idler	
	5/8/2022	4	MOORE, JOHN B	Disassemble and repair link pin backing out as required, upon closer inspection idler has failed, separate track and remove idler, clean out idler bore and prep hardware for reinstallation.	
	Item: 104564 - Inspection				
	5/8/2022	0.5	ROBSON, TYLER	Looked over bucket along corners for cracks buckets good Fixed bent in grading stair	
	5/8/2022	0.5	ZAGO, TYLER	Weld inspection	
	5/8/2022	3	MACLEOD, CHRISTIAN	Inspection of hoses on unit	



	Item: 103821 - Bucket swap, edge flip				
	5/8/2022	3.5	CARTER, DUSTIN T	Assist mechanic to line track rail back up so the pin could be put back in. Upon further instructions pulled the track back apart and removed idler from track as the idler was wore out	
	5/2/2022	3	MASON, JONATHAN	Bucket swap, edge flip	
	5/2/2022	4	GUO, SHAO CHUAN	Made hoes. Install hoses	
WO: 85814 - (500) EXCAVATOR CAT PROGRAM (5741 HR)					Closed
	Item: 99509 - (500) EXCAVATOR CAT PROGRAM				
	2022-04-26_1506_500H.pdf				
WO: 83910 - 2022 April Repairs (5759 HR)					Closed
Notes: null					
	Item: 101081 - Track won't stay tight				
	4/9/2022	1	MACDONALD, MATTHEW	Adjust up far as we could idlers coming out end of frame rails worn	
WO: 82428 - (250) EXCAVATOR CAT PROGRAM (5530 HR)					Closed
	Item: 96848 - (250) EXCAVATOR CAT PROGRAM				
	2022-03-26_1506_250H.pdf				
WO: 79934 - (2000) EXCAVATOR CAT PROGRAM (5298 HR)					Closed
	Item: 94161 - (2000) EXCAVATOR CAT PROGRAM				
	030322-1506--2000hr.pdf				
WO: 79896 - 2022 March Repairs (5564 HR)					Closed
Notes: null					
	Item: 99818 - Teeth				
	3/29/2022	1.5	SCHOENING, DAKOTA	Drive to unit change teeth	
	Item: 98478 - Track fell off				
	3/18/2022	4	MACELHERON, GEORGE	Install track and move out on flat for service to tighten	
	3/18/2022	4	MASON, JONATHAN	Installed right track, fell off	



Equipment History From January 1, 2001 to September 16, 2026

	3/17/2022	4	MOCKE, BRUCE	Travel to unit from MD9 get track straightened out and levelled attempts to get track over sprockets but needed a second person crossed over today shift	
	Item: 96810 - Light falling off				
	3/3/2022	2	RIEHL, NATHAN	Go to unit repair light mounting return to yard and clean up.	
WO: 77453 - (250) EXCAVATOR CAT PROGRAM (5070 HR)				Closed	
	Item: 90787 - (250) EXCAVATOR CAT PROGRAM				
	020922-1506-250hr.pdf				
WO: 77249 - 2022 February Repairs (5265 HR)				Closed	
Notes: null					
	Item: 96091 - Bucket loose				
	2/25/2022	1	RIEHL, NATHAN	Go to unit wedge loose poll and clean Bolts and coupler retighten wedge	
	Item: 94674 - Charge batteries				
	2/22/2022	3	WIPF, JACOB	Charge batteries and heat and start unit	
	2/14/2022	1.5	RANTA, CLAYTON	Charge batteries and cold start	
	Item: 94354 - Lights				
	2/11/2022	3	MACELHERON, GEORGE	Replace lights	
	Item: 94274 - Install cab guard				
	2/10/2022	3	RIEHL, NATHAN	Go find guard take to unit and install look for cause of lights out. Needs light housing replaced on guard due to shorting out.	
	Item: 93954 - Lights out				
	2/8/2022	1	MASON, JONATHAN	Fixed right track light, both top cab lights missing	
WO: 76657 - Bucket teeth (5355 HR)				Closed	
Notes: null					
	Item: 94384 - Teeth				
	2/11/2022	1	RANTA, CLAYTON	R&R teeth	
	Item: 93298 - Bucket teeth				
	3/10/2022	4	SCHINDEL, BRIAN	Weld name plate on bucket	
	3/10/2022	2	LITTLE, JAMES (MIKE)	Drive to unit change bucket teeth	
	2/10/2022	0.5	RANTA, CLAYTON	Gather teeth and retainers.	

Equipment History From January 1, 2001 to September 16, 2026

	2/4/2022	2	CHAPMAN, BRENDAN	Removed and replaced the bucket teeth, pins and retainers	
WO: 75133 - Bucket Teeth (4793 HR)				Closed	
	Item: 91627 - Bucket Teeth				
	1/22/2022	1	REIN-GATES, HARLEY	Change teeth	
	1/22/2022	1.5	MACELHERON, GEORGE	Search for machine at several sites, find machine and change out bucket teeth with new pins and keepers , with travel	
WO: 74894 - Removed the front rop rock guard (4782 HR)				Closed	
	Item: 91383 - Removed the front rop rock guard				
	1/20/2022	2	CHAPMAN, BRENDAN	Removed the rock guard from front window and put it in the yard	
WO: 74325 - (500) EXCAVATOR CAT PROGRAM (4779 HR)				Closed	
	Item: 80153 - (500) EXCAVATOR CAT PROGRAM				
	2022-01-15_1506_500H.pdf				
WO: 72516 - Leaks (4819 HR)				Closed	
	Item: 88906 - Leaks				
	1/27/2022	1	MOCKE, BRUCE	Removed and replaced oring with travel	
	12/29/2021	2	WIPF, JACOB	Fix hyd leaks	
WO: 72215 - Swap bucket (4573 HR)				Closed	
	Item: 88583 - Swap bucket				
	12/26/2021	1.5	IONESCU, MATEI (THEO)	Took out wrist a trist bucket installed digging bucket removed bucket gps	
WO: 68792 - Overheating (4569 HR)				Closed	
	Item: 85009 - Overheating				
	12/18/2021	1.5	MACELHERON, GEORGE	Fill with coolant, start and warm cycle hydraulics and move machine so ready for transport.with travel	
	11/30/2021	3	WIPF, JACOB	Engine overheating under load. Checked EGR cooler (looks ok) shot temp at thermostat housing and top of rad , housing was 126 degrees and top of rad was 36- could be a stuck thermostat. Coolant blows out of tank with cap off with engine under load and hot, could put pressure gauge in coolant tap and run at idle to see what the pressure builds to -see if head gasket is gone	
	11/29/2021	4	WIPF, JACOB	Troubleshoot overheating, coolant blowing out of tank when under load. Check EGR cooler and head gasket	

Equipment History From January 1, 2001 to September 16, 2026

	11/28/2021	2	PARENTEAU, LAYNE	Travel to unit and setup work area. Reported overheating. Radiator was packed with dust, blew out radiator and coolers and returned unit to work	
	11/28/2021	2	MASON, JONATHAN	Drove to unit set up work area blew rads and coolers out	
WO: <u>68490</u> - Bucket/GPS install (4548 HR)					Closed
	Item: 84697 - Bucket/GPS install				
	11/25/2021	6	RIDLAND, JADEN	-Setup work area, bring bucket and pivot attachment, install assembly onto unit, connect hydraulic hoses, test unit, various hydraulic leaks on coupler/pivot assembly, remove fittings clean re-seal and install, tighten various JIC lines, re-test unit -go to install GPS harness and box, harness end is broken off box and harness itself is damaged at the plug, parts identification and order - Clesn up work area	
WO: <u>64442</u> - Buckets pins/bushings (4541 HR)					Closed
	Item: 80574 - Buckets pins/bushings				
	10/18/2021	2	BELANKO, DAVID	Clean up area Put bucket and coupler on pallets For shipping	
	10/15/2021	8	RIDLAND, JADEN	-Setup work area, update FLHA -Check for pin play, remove bucket assembly, remove coupler assembly, clean pins and bores, inspect for wear and access. Unit looks to need line bore, as well as pins and bushings, advise Aaron. -Clean up work area, review FLHA	
	10/15/2021	7	BELANKO, DAVID	Set up area Warm up machine Remove hyd lines and electrical harness for gps Remove bucked from machine Remove coupler from machine clean off parts with steamer Check wear bucket needs line boring and bushings	
WO: <u>63971</u> - Track chain repairs (4541 HR)					Closed
	Item: 80101 - Track chain repairs				
	10/16/2021	6	BELANKO, DAVID	Install pad bolts on all pads that were removed Replaced one bent pad with new one and new bolts Torqued bolts to 500+120'	
	10/14/2021	6	SMEARS, MARK	Lance pins, install pins, install pads	
	10/14/2021	6	BELANKO, DAVID	Drive back to yard Set up by unit Get welder lance pins out Clean bores up on chain and new links Grind pins done to fit Install new link Install new pins Connect track had pins welded	
	10/10/2021	3	BELANKO, DAVID	Remove two more pads Updated parts list found a small crack on right side track link Cleaned up chain need a track press to continue	
WO: <u>63909</u> - Check over (4541 HR)					Closed
	Item: 80042 - Check over				
	10/14/2021	9	RIDLAND, JADEN	-Setup work area, update FLHA -Checkover unit, replace lights and repair as required, check for boom and bucket pin wear, parts ID, help with track assembly. -Clean up work area	
	10/9/2021	11	BELANKO, DAVID	Right side master link is coming apart Replaced light on cab of machine Check all fluids Replaced	

Equipment History From January 1, 2001 to September 16, 2026

				orings on leaking hoses by bucket Pulled pads off where master link is for repairs Remove and replaced carrier rollers torqued to 700 flbs as per sis	
WO: 64022 - (250) EXCAVATOR CAT PROGRAM (4541 HR)				Closed	
	Item: 74527 - (250) EXCAVATOR CAT PROGRAM				
	2021-10-08_1506_250H.pdf				
WO: 58647 - Undercarriage Report (4329 HR)				Closed	
	Item: 74614 - Undercarriage Report				
	336F #1506.pdf				
WO: 58910 - (FLUSH) EXCAVATOR CAT PROGRAM (4329 HR)				Closed	
	Item: 74809 - (FLUSH) EXCAVATOR CAT PROGRAM				
	2021-08-08_1506_FLUSH.pdf				
WO: 58914 - (1000) EXCAVATOR CAT PROGRAM (4329 HR)				Closed	
	Item: 63123 - (1000) EXCAVATOR CAT PROGRAM				
	210808 - 1506 - 1000h.pdf				
WO: 58324 - No power to gps (4329 HR)				Closed	
	Item: 74270 - No power to gps				
	8/6/2021	4	FENTON, GARNET	Testing and checking wiring for gps system... Need more information on system..	
WO: 53654 - Flip edge (4290 HR)				Closed	
	Item: 69325 - Flip edge				
	6/11/2021	1	MOCKE, SEAN	Flip cutting edge	
WO: 50172 - Undercarriage inspection (4239 HR)				Closed	
	Item: 65660 - Undercarriage inspection				
	5/10/2021	2	NEALE, DONAVAN	Travelled to unit, inspected track carriers ordered to be exchanged	
WO: 49178 - Leaking hydraulic line on twist bucket (4175 HR)				Closed	
	Item: 64542 - Leaking hydraulic line on twist bucket				

Equipment History From January 1, 2001 to September 16, 2026

	4/29/2021	2	RANTA, CLAYTON	Make hose,travel to unit and install hose.	
	4/28/2021	3	FRANKLIN, SCOTT	Travel to unit set up work area, removed leaking line travelled back to yard made line and travelled back to unit installed new line checked fluids and started up checking for leaking none found , installed new mic for 2 way unit up..	
WO: 47973 - 250h Service (4128 HR)				Closed	
	Item: 63122 - 250h Service				
	210408 - 1506 - 250h.pdf				
WO: 47101 - Fuel leaking from under machine (4100 HR)				Closed	
	Item: 62157 - Fuel leaking from under machine				
	3/28/2021	3	RHUDE, JORDON	Get permit, drive to poly pad. Set up machine so I could remove panels, remove panel dig out mud grease dirt branches from round fuel lines and inside of machine belly. Fire up machine check for leak, ran machine over relief while checking for leak. Inspected inside def compartment. Determined that the fuel on the ground and tracks as from over fueling the machine reinstall panels and release machine to operator	
	3/27/2021	1.5	RHUDE, JORDON	Drive to poly pad job get job put on permit, wait for operator to show where it was coming from as they were setting up ditching. Leak coming from under fuel tank. Under guarding was struck with a rock and pushed the pan into fittings and lines on bottom of tank. Permit needed to be updated in order to remove body panels pack up and wait for next day	
WO: 46475 - Install twist bucket (4082 HR)				Closed	
Notes: null					
	Item: 61605 - Line worn out on twist bucket				
	3/23/2021	1	RHUDE, JORDON	Wait for machine to walk up from ditch, turn valves to relieve line pressure. Remove and replace worn hose. Open valves test functions and check for possible wear points. Release machine	
	3/22/2021	2	RHUDE, JORDON	Update permit, wait for machine to walk up from its hole, inspect line measure drive to shop make line, drive back out wait for machine. Operator busy working with survey near my end of shift had to pack up and head to yard	
	Item: 61423 - Install twist bucket				
	3/21/2021	2	RHUDE, JORDON	Drive to rays job, set up area remove old bucket set aside install new twist bucket. Hook up hyd lines turn valves to correct positions and test function. Operator said gps screen was rolling around in cab removed from unit to get new mounting hardware bring to office	
WO: 41533 - Bucket tooth fell off (3845 HR)				Closed	
	Item: 57324 - bucket teeth				



Equipment History From January 1, 2001 to September 16, 2026

	2/6/2021	5.5	FENTON, COLBY	travel to permit center, pick permit and travel to unit. wait for escort, return to shop for correct teeth, return and wait for escort. remove and replace teeth. return to permit center and sign permit out, clean up and return	
	Item: 55341 - Bucket tooth fell off				
	1/16/2021	4	MURRAY, ANDREW	(Up) Unit being rented by Suncor; working in NSE. Got permit for job, and drove to Gate 1 on far east side of NSE to meet 686 for signature and escort. Waited about half hour for area authority to come to gate. Didn't have right teeth or pin on hand, but was able to modify a pin and retainer I had in my truck to make tooth that had fallen off work. Waited for 686 for a bit to get an escort back out. Signed out permit after job was completed.	
WO: 40940 - B Service (3845 HR)					Closed
	Item: 54631 - B Service				
	210105 - 1506 - 500h Service.pdf				
WO: 40943 - De mob inspection (3845 HR)					Closed
	Item: 54633 - De mob inspection				
	2021-01-06_40943_DEMOB.pdf				
	1/6/2021	2	TKACH, KENDAL	De Mob inspection	
WO: 40856 - Thumb valves (3845 HR)					Closed
	Item: 54543 - Thumb valves				
	1/5/2021	1	TKACH, KENDAL	Check over and fire up. Cap aux fittings. Open thumb valves.	
WO: 38439 - Swap bucket (3833 HR)					Closed
	Item: 51563 - Swap bucket				
	2020-11-27_38439_WO.pdf 2021-01-02_38439_WO.pdf				
	1/2/2021	1	FRANKLIN, SCOTT	Swap Buckets	
	12/6/2020	2	MOCKE, BRUCE	Changed bucket	
	11/27/2020	2	RHUDE, JORDON	Remove bucket and cap lines, install new bucket	

WO: 38368 - Ice Lugging (3703 HR)				Closed	
	Item: 51476 - Ice Lugging				
	11/26/2020	7	SMEARS, MARK	Ice Lug	
WO: 34381 - up/ replace insinuator hose with travel to and from (3606 HR)				Closed	
	Item: 46879 - up/ replace insinuator hose with travel to and from				
	9/13/2020	5	MOCKE, SEAN	up/ replace insinuator hose with travel to and from	
WO: 34104 - A Service (3597 HR)				Closed	
	Item: 46557 - A Service				
	200830 - 1506 - A Service.pdf				
WO: 33881 - up/ fast fill inspection, pressuring up (3606 HR)				Closed	
	Item: 46320 - up/ fast fill inspection, pressuring up				
	9/4/2020	0.5	MOCKE, SEAN	up/ fast fill inspection, pressuring up	
WO: 32845 - check over and repair (3339 HR)				Closed	
	Item: 45019 - check over and repair				
	8/11/2020	6	MUROWCHUK, MEL	replace lh top carrier rollers install clamps on aux pipeing repair and secure wiring for topcon	
	8/10/2020	3	MUROWCHUK, MEL	replace rh top carrier rollers	
	8/8/2020	8	MUROWCHUK, MEL	install thumb install window gaurd install wiggens reciever	
	8/7/2020	4	MUROWCHUK, MEL	bring in shop remove bucket clean up for thumb install make up parts list	
WO: 32259 - window install (3339 HR)				Closed	
	Item: 44309 - window install				
	Notes:				
WO: 31824 - Lights, water in fuel sensor, hydraulic pilot filter (3336 HR)				Closed	
	Item: 43737 - Lights, water in fuel sensor, hydraulic pilot filter				
	7/8/2020	2	MILLER, JASON	def code fuel filter restriction	
	7/1/2020	2	MURRAY, ANDREW	(Up) Replaced light bulb/Deutz connector on right side light above cab. Change hydraulic pilot	

Equipment History From January 1, 2001 to September 16, 2026

				filter that was missed on oil change. Installed Water in Fuel sensor on water separator bowl	
WO: 31809 - D Service (3332 HR)					Closed
	Item: 43714 - D Service				
	200630 - 1506 - D Service.pdf				
	7/22/2020	6	MILLER, JASON	window replace	
	7/7/2020	13	MILLER, JASON	def system service will be warranty remove thumb	
	6/30/2020	3	MURRAY, ANDREW	(Up) Completed D service on unit, except right side final	
WO: 31258 - get permit,repair right side track (3321 HR)					Closed
	Item: 43024 - get permit,repair right side track				
	5/19/2020	6	WIPF, JACOB	get permit,repair right side track	
WO: 30875 - travel/ track broke on right side. order parts (3286 HR)					Closed
	Item: 42537 - travel/ track broke on right side. order parts				
	4/11/2020	2	WIPF, JACOB	travel/ track broke on right side. order parts	
WO: 30759 - Inspection (3286 HR)					Closed
	Item: 42359 - Inspection				
	3/25/2020	2	MURRAY, ANDREW	(Up) Travelled to unit at far end of Eagle to inspect a report of broken grease lines on unit. Noted bad grease lines, ordered parts. Inspected rest of unit while there. No other issues found	
WO: 30658 - Lights (3246 HR)					Closed
	Item: 31224 - Cab/boom lights out				
	3/22/2020	1	KELL, KELSEY	repaired cab light	
WO: 29222 - Ripper tooth and Shank Guard (3286 HR)					Closed
	Item: 42428 - RR Ripper Tooth, add shank protector				
	4/1/2020	1	TRUDEL, GUY	look over machine, fire up, replaced ripper tooth and shank guard	
	Item: 40029 - Up/ new edges installed with travel				
	2/27/2020	2	MOCKE, SEAN	Up/ new edges installed with travel	
WO: 27716 - B - Service (3002 HR)					Closed
	Item: 37402 - B - Service				

	2020-02-02_27716_B.pdf				
WO: 26495 - Start Unit (2738 HR)				Closed	
	Item: 35521 - Start Unit				
	1/15/2020	2	REIN-GATES, HARLEY	Boosting hoe.	
	1/15/2020	2	SNIDER, ALAN	Charge batteries, heat block heater, start.	
WO: 26063 - Hydraulic leaks (2702 HR)				Closed	
	Item: 34835 - Hydraulic leak				
	1/1/2020	4	WIPF, JACOB	Fix hydraulic leaks	
WO: 25387 - A - Service (2663 HR)				Closed	
	Item: 33944 - A - Service				
	2019-12-27_25387_A.pdf				
WO: 26064 - Edges (2623 HR)				Closed	
	Item: 34836 - Edges				
	12/25/2019	2	KELL, KELSEY	Flipped edges	
WO: 24880 - Up/ lights repaired with travel , needs edge flipped (2623 HR)				Closed	
	Item: 33214 - Up/ lights repaired with travel				
	12/21/2019	1	MOCKE, SEAN	Up/ lights repaired with travel	
WO: 23666 - Changed bucket (2464 HR)				Closed	
	Item: 31722 - Changed bucket				
	12/4/2019	2	FENTON, GARNET	Changed bucket	
WO: 22636 - D Service (2351 HR)				Closed	
	Item: 30370 - D Service				
	2019-11-20_22636_D.pdf				
WO: 21585 - Replace twist bucket lines and fittings (2342 HR)				Closed	
	Item: 30414 - Top grease nipple on twist bucket wrist pin not taking grease				

Equipment History From January 1, 2001 to September 16, 2026

Notes: Tap grease nipple port, install new nipple, grease still spills out near nipple, suspected micro crack near nipple					
11/20/2019	1	SMITH, KIRK	Tap grease nipple port, install new nipple, grease still spills out near nipple, suspected micro crack near nipple		
Item: 30407 - Wrist pin not taking grease, hydleak					
11/20/2019	3	FIFE, ANDREW	Tested for leaks, removed hose, removed fitting, changed oring, tested, changed grease nipple, grease port is cracked, travel		
Item: 29795 - Hyd leak at wrist twist					
11/12/2019	5	DAELMAN, BRENT	Troubleshoot leak, chip out frozen material on bucket, remove hose and drive back to yard with sample, build hose and travel to install, test for leaks		
Item: 28970 - Replace twist bucket lines and quick couplers					
11/15/2019	1	SMITH, KIRK	Make up hyd lines		
11/5/2019	0.5	SMITH, KIRK	Order parts		
11/3/2019	1	SMITH, KIRK	Measure lines and fittings for replacement		
WO: 21540 - Replace bucket with twist bucket (2185 HR)					Closed
Item: 28895 - Replace bucket with twist bucket					
11/1/2019	2	SMITH, KIRK	Replace bucket with twist bucket		
WO: 19449 - C - Service (1971 HR)					Closed
Item: 26366 - C - Service					
2019-09-21_19449_C.pdf					
WO: 17962 - B - Service (1690 HR)					Closed
Item: 24318 - B - Service					
2019-08-18_17962_B.pdf					
WO: 15354 - 2 way radio not working, track pad loose (1453 HR)					Closed
Item: 20598 - Replace 2 way radio					
6/30/2019	1.5	SMITH, KIRK	Replace radio		
Item: 20597 - Track pad loose					
6/30/2019	2.5	SMITH, KIRK	Removed pad cleaned and installed temp bolts		

	Item: 20596 - Loose gps wiring on stick				
	6/30/2019	0.5	SMITH, KIRK	Repair loose wiring on stick	
WO: 15137 - MOB Unit (1444 HR)					Closed
	Item: 20312 - MOB Unit				
	2019-06-22_15137_MOB IN.pdf				
WO: 14805 - DeMob (1427 HR)					Closed
	Item: 19914 - DeMob				
	6/20/2019	3	SAUNDERS, AUSTIN	DeMob	
WO: 16188 - Undercarriage Report (1441 HR)					Closed
	Item: 21689 - Undercarriage Report				
	190525 - 1506 - UC Report.pdf				
WO: 13253 - Replace broken side panel door (1427 HR)					Closed
	Item: 12823 - Both doors damaged - cab mirror broken				
	Notes:				
	5/21/2019	3	SAUNDERS, AUSTIN	Replace lhs door (pumps)	
WO: 11527 - Repaired lights (1356 HR)					Closed
	Item: 15504 - Repaired lights				
	Notes: Replaced right cab flood light bulb and battery box flood light bulb				
	4/20/2019	2	MASON, JONATHAN	Repaired lights	
WO: 11643 - A - Service (1356 HR)					Closed
	Item: 15637 - A - Service				
WO: 11099 - No power to gps (1233 HR)					Closed
	Item: 14936 - GPS no power				
	4/12/2019	3	HANSON, KELSEY	No power for gps	
WO: 10425 - Install bucket and replaced mirror (1147 HR)					Closed
	Item: 14060 - Install bucket And replaced mirror				

Equipment History From January 1, 2001 to September 16, 2026

	4/2/2019	2	ESSIAMBRE, CHAD	Install bucket And replaced mirror	
WO: 10392 - Install window (1147 HR)					Closed
	Item: 14022 - Install window				
	4/1/2019	6	ESSIAMBRE, CHAD	Install window	
WO: 10329 - Remove broken window (1147 HR)					Closed
	Item: 13942 - Remove broken window				
	3/31/2019	4	ESSIAMBRE, CHAD	Remove broken window	
WO: 10276 - D - Service (1147 HR)					Closed
	Item: 13880 - D - Service				
WO: 10123 - Track pad loose, tighten and replace bolts (1136 HR)					Closed
	Item: 13699 - Track pad loose/warped				
	3/27/2019	1	SAUNDERS, AUSTIN	Replace and tighten track pad bolts	
	3/27/2019	1	MACRAE-GARDNER, CONNOR	Track pad loose, tighten and replace bolts	
WO: 9863 - Change and adjust lights (1038 HR)					Closed
	Item: 13390 - Change and adjust lights				
	Notes: Drive out to pond 17 Wait for unit to walk up from brush Boom light out Lights loose and in need for adjustments Change bulb Adjust lights to operator preference, tighten				
	3/22/2019	1.5	MACRAE-GARDNER, CONNOR	Change and adjust lights	
WO: 9773 - Hydraulic Leak (996 HR)					Closed
	Item: 13272 - Hydraulic Leak under pumps				
	Notes: Unit out at pond 18				
	3/21/2019	4.5	NEMETZ, STACY	Hydraulic Leak	
WO: 9409 - C - Service (875 HR)					Closed
	Item: 12816 - C - Service				
WO: 9352 - Repair gps wiring (873 HR)					Closed
	Item: 12749 - Repair gps wiring				
	3/14/2019	1	HANSON, KELSEY	Repair gps wiring	
WO: 9821 - Running Repairs (806 HR)					Closed

Equipment History From January 1, 2001 to September 16, 2026

	Item: 12579 - Replace burned out work lights and repaired hydraulic leak				
	3/10/2019	3	GARDNER, HARLEY	Replace burned out work lights and repaired hydraulic leak on bucket cyl	
WO: 9151 - C- Service (740 HR)					Closed
	Item: 12517 - C - Service				
WO: 8988 - Replace missing track pads (713 HR)					Closed
	Item: 12328 - Replace missing track pad				
	3/5/2019	2	HOLDEN, JOSHUA	Replace missing track pad	
WO: 8911 - Repair light and adjust tracks (672 HR)					Closed
	Item: 12239 - Repair light and adjust tracks				
	3/4/2019	3	HOLDEN, JOSHUA	Replace light and adjust track	
	3/3/2019	2.5	MACRAE-GARDNER, CONNOR	Repair light and adjust tracks	
WO: 15545 - Undercarriage Report (584 HR)					Closed
	Item: 20861 - Undercarriage Report				
	190301 - 1506 - UC Report.pdf				
WO: 8636 - Mobin (563 HR)					Closed
Notes: Pond 18					
	Item: 12000 - Mobin				
	Item: 11999 - Mobin				
	Item: 11898 - Mob in				
	2/26/2019	2	WAKELAM, PARKER	Mob in	
WO: 8579 - Install brush blade (564 HR)					Closed
	Item: 11828 - Install brush blade				
	2/25/2019	1	BATTEN, WILLIAM	Install brush rake	
WO: 8514 - Pull gps monitors off (559 HR)					Closed
Notes: Pond 18					
	Item: 11698 - Pull gps monitors off				
WO: 11569 - Hydro Leak (294 HR)					Closed
	Item: 15543 - Repair Bucket Twist Cylinder				

WO: 12877 - Hydraulic Leak (294 HR)					Closed
	Item: 17305 - Repair Hyd. Leak L/S Bucket Twist Cylinder Leaking				
WO: 15546 - Undercarriage Report (416 HR)					Closed
	Item: 20862 - Undercarriage Report				
	190109 - 1506 - UC Report.pdf				
WO: 4474 - Demob (294 HR)					Closed
	Item: 6077 - Demob				
	Notes: Demob - returning to main site				
WO: 4035 - Hyd leak (130 HR)					Closed
	Item: 5509 - Hyd leak				
	Notes: Clean up run unit replace oring				
	11/11/2018	2	LITTLE, JAMES (MIKE)	Repair hyd leak	
WO: 3986 - Mobin (109 HR)					Closed
	Item: 5444 - Mobin				
WO: 3147 - Install Bucket (109 HR)					Closed
	Item: 4322 - remove pipping from arm.				
	10/18/2018	4.5	LESLIE, HUGH	install hand rails	
	10/18/2018	9.5	LEPAGE, MARTY	modify and install hand rails & GPS bracket	
	10/17/2018	1.5	LESLIE, HUGH	install twist bucket.	
	10/17/2018	7	LEPAGE, MARTY	welding on bucket	
	10/16/2018	2	LEPAGE, MARTY	welding on bucket	
	10/11/2018	6.5	LESLIE, HUGH	install grease lines on arm. rap harness and clamp.	
	10/11/2018	5	LEPAGE, MARTY	tap grease blocks and install / install weld on threded lugs	
	10/10/2018	2	LESLIE, HUGH	re-rout wire harness and fab grease lines.	
	10/10/2018	2	LEPAGE, MARTY	build grease blocks	
	10/9/2018	5	LESLIE, HUGH	rerout electrical. fab grease lines for arm.	
	10/5/2018	2.5	LESLIE, HUGH	remove pipping from arm.	