



J22-1
NOV

Mechanic Work Order

Information

 HL750-10 [GPS - EQP]

 Foster Creek

 Friday, March 13th 2026, 3:14 PM [MDT -06:00]

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number  HL750-10 [GPS - EQP]

General Information

Date  March 13, 2026

Tech Name  Brandon German

Last service done @ [HR/KM]:  No Response

Next service due @ [HR/KM]:  No Response

Odometer:  0

Hours:  6159

Repair

Repair Description  disappearing coolant, operator had low coolant warning yesterday added 1L, today low coolant alarm came on today again, he added 1L. checked under engine its dry besides oil leaking out of oil fill, operator said cap was half on cross threaded when he got unit. removed floor pans, dont see any coolant leaking in center pan or from webasto. sent unit to work will monitor. RH door latch mounting screws backed out, tightened. operator was complaining GPS is acting up. talked with dayna shes sending me some parts.

Location  N53

Hours  2

Parts

Signatures

Brandon German, *Mechanic LC*

 March 13th 2026, 3:14 PM [MDT -06:00]

B.G

Steven Orcutt, *Project Manager*

 Approved

 March 14th 2026, 5:44 AM [MDT -06:00]

 53.689182, -113.219254





Mechanic Work Order

Information

 HL750-10 [GPS - EQP]

 Foster Creek

 Thursday, March 12th 2026, 1:27 PM [MDT -06:00]

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 HL750-10 [GPS - EQP]

General Information

Date

 March 11, 2026

Tech Name

 Mitchell Teer

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 6143

Repair

Repair Description

 Travel to unit, assisted Dayna in gps troubleshooting, removing and installing guards and replacing cables.

Location

 Foster creek

Hours

 6

Parts

Signatures

Mitchell Teer, HL Contract Mechanic



March 12th 2026, 1:27 PM (MDT -06:00)



55.060629, -110.529145

A handwritten signature in black ink, appearing to read 'M. Teer'.



Mechanic Work Order

Information

 HL750-10 [GPS - EQP]

 Foster Creek

 Tuesday, March 10th 2026, 9:08 PM [MDT -06:00]

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number  HL750-10 [GPS - EQP]

General Information

Date  March 10, 2026

Tech Name  Brandon German

Last service done @ [HR/KM]:  No Response

Next service due @ [HR/KM]:  No Response

Odometer:  0

Hours:  6141

Repair

Repair Description  go threw harness on unit for dayna looking for reason of can Bus 2 code. discovered broken wire inside control module plug, depinned and crimped new pin on to wire. unit is acting properly now and auto is working.

Location  n50

Hours  4

Parts

Signatures

Brandon German, *Mechanic LC*

 March 10th 2026, 9:08 PM [MDT -06:00]

B.G

Steven Orcutt, *Project Manager*

 Approved

 March 11th 2026, 6:00 AM [MDT -06:00]





Mechanic Work Order

Information

 HL750-10 [GPS - EQP]

 Foster Creek

 Friday, March 6th 2026, 10:10 PM [MST -07:00]

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 HL750-10 [GPS - EQP]

General Information

Date

 March 6, 2026

Tech Name

 Brandon German

Last service done @ {HR/KM}:

 No Response

Next service due @ {HR/KM}:

 No Response

Odometer:

 0

Hours:

 6124

Repair

Repair Description

 install GPS GNSS receivers, positions sensor mount badly damaged on C-frame, removed snapped bolts, install blade and c-frame positions sensors, fire gps up its reading, gouge crack on c-frame out found its a previous repair, drill hole in end of crack weld up.

Location

 N50

Hours

 6

Parts

Signatures

Brandon German, *Mechanic LC*

 March 6th 2026, 10:10 PM [MST -07:00]

B.G

Steven Orcutt, *Project Manager*

 Approved

 March 7th 2026, 5:57 AM [MST -07:00]

 54.470093, -110.439819





Mechanic Work Order

Information

 HL750-10 (GPS - EQP)

 Foster Creek

 Friday, March 6th 2026, 7:19 AM (MST -07:00)

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 HL750-10 (GPS - EQP)

General Information

Date

 March 5, 2026

Tech Name

 Mitchell Teer

Last service done @ (HR/KM):

 No Response

Next service due @ (HR/KM):

 No Response

Odometer:

 0

Hours:

 6119

Repair

Repair Description

 Travel to unit m, went to change cutting edges as per equipment inspections, edges do not need change, an Inch all the way across

Location

 West work zone

Hours

 1

Parts

Signatures

Mitchell Teer, *HL Contract Mechanic*



March 6th 2026, 7:19 AM (MST -07:00)



55.1736598, -110.6306861

A handwritten signature in black ink, appearing to read 'MT' followed by a stylized flourish.



Mechanic Work Order

Information

 HL750-10 (GPS - EQP)

 Foster Creek

 Thursday, February 12th 2026, 8:47 PM (MST -07:00)

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 HL750-10 (GPS - EQP)

General Information

Date

 February 12, 2026

Tech Name

 Mitchell Teer

Last service done @ (HR/KM):

6000

Next service due @ (HR/KM):

6500

Odometer:

0

Hours:

6057

Repair

Repair Description

== Travel to unit t/s hyd leak, found leak from blade angle cylinder removed hose travel to shop build hose and travel back installed hose and guards, installed missing track pad bolts

Location

== North zone

Hours

4

Parts

Signatures

Mitchell Teer, *HL Contract Mechanic*



February 12th 2026, 8:47 PM [MST -07:00]



55.0556673, -110.4901489



Steven Orcutt, *Project Manager*



Approved



February 13th 2026, 8:45 AM [MST -07:00]





Mechanic Work Order

Information

 HL750-10 [GPS - EQP]

 Foster Creek

 Saturday, January 3rd 2026, 3:11 PM [MST -07:00]

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 HL750-10 [GPS - EQP]

General Information

Date

 January 2, 2026

Tech Name

 Brandon German

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 5751

Repair

Repair Description

 replaced ripper teeth used 2x HL ripper teeth, 2x pins, 2 keepers

Location

 A9-4-70-3

Hours

 1

Parts

Description

 2x HL ripper teeth, 2x pins, 2 keepers

Parts #

No Response

Qty.

No Response

Attachment

No Response

Signatures

Brandon German, *Mechanic LC*

January 3rd 2026, 3:11 PM [MST -07:00]

51.0447331, -114.0718831

B.G

Admin Foster Creek, *Admin*

January 4th 2026, 1:24 PM [MST -07:00]

A

Admin Foster Creek, *Admin*

January 4th 2026, 1:25 PM [MST -07:00]

AF

Steven Orcutt, *Project Manager*

Approved

January 5th 2026, 12:06 PM [MST -07:00]

50.3555952, -113.9898079

S



Mechanic Work Order

Information

 HL750-10 [GPS - EQP]

 Foster Creek

 Monday, November 24th 2025, 5:28 PM [MST -07:00]

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 HL750-10 [GPS - EQP]

General Information

Date

 November 24, 2025

Tech Name

 Brandon German

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 0

Repair

Repair Description

 run out east replace missing track pad bolts, all bolts on that pad loose, spin tack to look for other loose or missing bolts

Location

 east pit 13

Hours

 2

Parts

Signatures

Brandon German, *Mechanic LC*



November 24th 2025, 5:28 PM (MST -07:00)



55.0606329, -110.5287644

B.G

Steven Orcutt, *Project Manager*



Approved



November 25th 2025, 10:10 AM (MST -07:00)



51.8491944, -113.6333076

SO



Mechanic Work Order

Information

 HL750-10 [GPS - EQP]

 Foster Creek

 Sunday, November 23rd 2025, 7:07 AM [MST -07:00]

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 HL750-10 [GPS - EQP]

General Information

Date

 November 22, 2025

Tech Name

 Brandon German

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 0

Repair

Repair Description

 removed GPS equipment unit heading to push trees down and brush, welded front right step back on to unit.

Location

 HLC laydown yard

Hours

 2

Parts

Signatures

Brandon German, *Mechanic LC*



November 23rd 2025, 7:07 AM [MST -07:00]



55.0607117, -110.5286968

B.G

Steven Orcutt, *Project Manager*



Approved



November 24th 2025, 8:07 AM [MST -07:00]



51.1716168, -113.935855





Mechanic Work Order

Information

 HL750-10 (GPS - EQP)

 Foster Creek

 Wednesday, September 10th 2025, 7:04 AM (MDT -06:00)

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 HL750-10 (GPS - EQP)

General Information

Date

 September 9, 2025

Tech Name

 Brandon German

Last service done @ (HR/KM):

 No Response

Next service due @ (HR/KM):

 No Response

Odometer:

 0

Hours:

 0

Repair

Repair Description

 inspect unit for wear, blade roll cyl bushings both need replaced
Pitch link needs rebushinged
Blade ball has play all shims have been removed to tighten up already needs new ball and socket
LH blade angle cyl bushings on both ends loose need rebushinged.
RH blade angle cyl good
Hard bar good will replace outter pivot bushings on hard bar when under carriage gets done.
C-Frame pivot bushings worn C-frame twisting side to side

Location

 WTR

Hours

 2

Parts

Signatures

Brandon German, *Mechanic*

 September 10th 2025, 7:04 AM [MDT -06:00]

 55.0606843, -110.5286902



Steven Orcutt, *Project Manager*

 Approved

 September 10th 2025, 7:58 AM [MDT -06:00]

 51.0532503, -113.9707531





Mechanic Work Order

Information

 HL750-10 [GPS - EQP]

 Foster Creek

 Thursday, August 7th 2025, 6:11 AM [MDT -06:00]

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 HL750-10 [GPS - EQP]

General Information

Date

 August 6, 2025

Tech Name

 Brandon German

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 0

Repair

Repair Description

 unit blowing black smoke, Run to shop grab air filters, run out to unit install filter, test unit no smoke and full power

Location

 WTR

Hours

 2

Parts

Signatures

Brandon German, *Mechanic*

 August 7th 2025, 6:11 AM [MDT -06:00]

 55.0606054, -110.5288089



Steven Orcutt, *Project Manager*

 Approved

 August 7th 2025, 10:10 AM [MDT -06:00]

 51.067252, -114.1350027





Mechanic Work Order

Information

 HL750-10 [GPS - EQP]

 Foster Creek

 Monday, July 28th 2025, 5:52 PM [MDT -06:00]

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 HL750-10 [GPS - EQP]

General Information

Date

 July 27, 2025

Tech Name

 Brandon German

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 0

Repair

Repair Description

 Escort welder to unit and get set up to reskin blade

Location

 W42

Hours

 1

Parts

Signatures

Brandon German, *Mechanic*

 July 28th 2025, 5:52 PM (MDT -06:00)

 55.0608158, -110.5286682

B.G

Steven Orcutt, *Project Manager*

 Approved

 July 29th 2025, 7:27 AM (MDT -06:00)

 54.8235292, -111.4816163





Mechanic Work Order

Information

 HL750-10 [GPS - EQP]

 Foster Creek

 Saturday, July 26th 2025, 7:42 AM [MDT -06:00]

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 HL750-10 [GPS - EQP]

General Information

Date

 July 25, 2025

Tech Name

 Brandon German

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 0

Repair

Repair Description

 Drive out to unit drain and refill final drive oils, clean up, drive back to laydown empty oil evac tank.

Location

 W44

Hours

 3

Parts

Signatures

Brandon German, *Mechanic*

 July 26th 2025, 7:42 AM (MDT -06:00)

 55.0605826, -110.5288221

B.G

Steven Orcutt, *Project Manager*

 Approved

 July 29th 2025, 7:25 AM (MDT -06:00)

 54.8235292, -111.4816163





Mechanic Work Order

Information

 HL750-10 [GPS - EQP]

 Foster Creek

 Wednesday, July 23rd 2025, 6:59 AM [MDT -06:00]

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number  HL750-10 [GPS - EQP]

General Information

Date  July 22, 2025

Tech Name  Brandon German

Last service done @ [HR/KM]:  No Response

Next service due @ [HR/KM]:  No Response

Odometer:  0

Hours:  0

Repair

Repair Description  Report of missing pad and multiple loose bolts, ran to unit counted how many bolts are needed, ran to shop grabbed bolts, ran back to unit installed pad and replaced missing bolts

Location  W25

Hours  2

Parts

Signatures

Brandon German, *Mechanic*

 July 23rd 2025, 6:59 AM (MDT -06:00)

 55.0605721, -110.5288183

B.G.

Steven Orcutt, *Project Manager*

 Approved

 July 23rd 2025, 1:24 PM (MDT -06:00)

 50.3555952, -113.9898079





Mechanic Work Order

Information

 HL750-10 [GPS - EQP]

 Foster Creek

 Saturday, July 19th 2025, 6:49 AM [MDT -06:00]

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number  HL750-10 [GPS - EQP]

General Information

Date  July 18, 2025

Tech Name  Brandon German

Last service done @ [HR/KM]:  No Response

Next service due @ [HR/KM]:  No Response

Odometer:  0

Hours:  0

Repair

Repair Description  Tighten tracks, RH step on c-frame has broken off track contacted it from c-frame wear. Install top con module. Foreman set unit up. Unit not seeing body position sensor, was told it was under cab dropped belly pan found sensor light wasn't blinking on it. Swapped blade with body sensor. Body sensor bad, harness good. stole sensor off HLD850-02. installed on 750 sensor lit up tried to go into top con computer and assign module didn't see sensor. Phoned dayna again looked into it more and sensor is located behind LH battery compartment door. Sensor is lit up. Went threw and recorded all sensor serial numbers for blade, c-frame, body. Assigned sensors to their position in machine configuration screen lit up green and can see machine on virtual job file now. On foreman to shoot corner bits and test unit. Joystick controls not working and unit is out. Need to research unit more.

Location  WTR

Parts

Signatures

Brandon German, *Mechanic* July 19th 2025, 6:49 AM [MDT -06:00] 55.0605686, -110.5287893

B.G

Steven Orcutt, *Project Manager* Approved July 19th 2025, 6:45 PM [MDT -06:00] 54.4702407, -110.4454354

So



Mechanic Work Order

Information

 ADT-0862

 Foster Creek

 Friday, July 18th 2025, 3:05 PM [MDT -06:00]

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 ADT-0862

General Information

Date

 July 17, 2025

Tech Name

 Brandon German

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 0

Repair

Repair Description

 Park unit on level ground, measure strut heights, recharge LH strut to equal extension height on both side, check ac blows cold, then warms up line seems to be freezing up just after receiver dryer, recover AC charge, evacuate system can see water vapor coming out of system, held under vacuum for 30 min vapor stopped and held vacuum for 10 min. Recharged system with 2.1kg of refrigerant. AC blows cold line after dryer is now warm and lines after evaporator are cold like they should be.

Location

 W44

Hours

 3

Parts

Signatures

Brandon German, *Mechanic*

 July 18th 2025, 3:05 PM [MDT -06:00]

 55.0421473, -110.8224964



Steven Orcutt, *Project Manager*

 Approved

 July 18th 2025, 3:30 PM [MDT -06:00]

 53.5691264, -114.1014528





Mechanic Work Order

Information

 HL750-10 (GPS - EQP)

 Foster Creek

 Monday, June 30th 2025, 6:02 AM (MDT -06:00)

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 HL750-10 (GPS - EQP)

General Information

Date

 June 29, 2025

Tech Name

 Brandon German

Last service done @ {HR/KM}:

 No Response

Next service due @ {HR/KM}:

 No Response

Odometer:

 0

Hours:

 0

Repair

Repair Description

 Tighten tracks

Location

 WTR

Hours

 1

Parts

Signatures

Brandon German, *Mechanic*

 June 30th 2025, 6:02 AM [MDT -06:00]

 55.0605834, -110.5288051



Steven Orcutt, *Project Manager*

 Approved

 July 4th 2025, 8:25 AM [MDT -06:00]

 53.4268254, -113.7754245





Mechanic Work Order

Information

 HL750-10 (GPS - EQP)

 Foster Creek

 Friday, June 27th 2025, 7:05 AM (MDT -06:00)

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number



HL750-10 (GPS - EQP)

General Information

Date



June 26, 2025

Tech Name



Brandon German

Last service done @ (HR/KM):



No Response

Next service due @ (HR/KM):



No Response

Odometer:



0

Hours:



0

Repair

Repair Description



500hr engine service, will catch final drives another day

Location



W43 entrance

Hours



2

Parts

Signatures

Brandon German, *Mechanic*

 June 27th 2025, 7:05 AM [MDT -06:00]

 55.0605766, -110.5288039

B.G.

Steven Orcutt, *Project Manager*

 Approved

 July 3rd 2025, 2:10 PM [MDT -06:00]

 53.5363584, -113.5181824





Mechanic Work Order

Information

 HL750-10 [GPS - EQP]

 Foster Creek

 Saturday, June 21st 2025, 6:53 AM (MDT -06:00)

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 HL750-10 [GPS - EQP]

General Information

Date

 June 20, 2025

Tech Name

 Brandon German

Last service done @ (HR/KM):

 No Response

Next service due @ (HR/KM):

 No Response

Odometer:

 0

Hours:

 4985

Repair

Repair Description

 @4985hrs segments swapped, due again at 5985hrs.
Release tension on tracks, split tracks, remove old segments, wire wheel final drive flanges, install new segments use red lock tight and torque to 627ft/lbs, reassemble tracks, torque master links to 200ft/lbs plus half a turn, tension tracks. Send unit to work, clean up work area

Location

 WTR laydown

Hours

 7

Parts

Signatures

Brandon German, *Mechanic*

 June 21st 2025, 6:53 AM [MDT -06:00]

 55.0605993, -110.5287864

B.G

Steven Orcutt, *Project Manager*

 Approved

 June 21st 2025, 7:57 AM [MDT -06:00]

 51.1790499, -114.4083963





Mechanic Work Order

Information



HL750-10 [GPS - EQP]



Foster Creek



Tuesday, June 10th 2025, 7:25 AM [MDT -06:00]

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number



HL750-10 [GPS - EQP]

General Information

Date



June 9, 2025

Tech Name



Brandon German

Last service done @ [HR/KM]:



No Response

Next service due @ [HR/KM]:



No Response

Odometer:



0

Hours:



0

Repair

Repair Description



Tighten tracks

Location



WTR

Hours



1

Parts

Signatures

Brandon German, *Mechanic*

 June 10th 2025, 7:25 AM [MDT -06:00]

 55.0606819, -110.5287465

B.G

Steven Orcutt, *Project Manager*

 Approved

 June 10th 2025, 7:33 AM [MDT -06:00]

 55.0607445, -110.5292059





Mechanic Work Order

Information

 HL750-10 (GPS - EQP)

 Foster Creek

 Monday, May 26th 2025, 7:25 AM [MDT -06:00]

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 HL750-10 (GPS - EQP)

General Information

Date

 May 25, 2025

Tech Name

 Brandon German

Last service done @ (HR/KM):

 No Response

Next service due @ (HR/KM):

 No Response

Odometer:

 0

Hours:

 0

Repair

Repair Description

 Loosen track off, lift rear machine up and block up, read lower roller bolts stripped drill out, tap and hell coil inner 2 threads, chase outter 2 threads. Install roller with red lock tight and torque to spec. Lower machine tighten track

Location

 WTR laydown

Hours

 5

Parts

Signatures

Brandon German, *Mechanic*

 May 26th 2025, 7:25 AM (MDT -06:00)

 55.0748627, -110.3648884

B.G

Steven Orcutt, *Project Manager*

 Approved

 May 26th 2025, 8:35 AM (MDT -06:00)

 51.8491944, -113.6333076





Mechanic Work Order

Information

 HL750-10 (GPS - EQP)

 Foster Creek

 Sunday, May 18th 2025, 7:13 AM (MDT -06:00)

Equipment and Maintenance Tracking

Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 HL750-10 (GPS - EQP)

General Information

Date

 May 17, 2025

Tech Name

 Lane Peters

Last service done @ (HR/KM):

 No Response

Next service due @ (HR/KM):

 No Response

Odometer:

 0

Hours:

 0

Repair

Repair Description

 Drive to unit, remove rear window cage
Cut off broken bullet hinge from machine and from cage
Weld new hinge halves on both sides
Install cage onto machine and adjust latch.
Take apart gps connections, find internia sensor on front of blade won't light up green.
Check all connections going back and all ok, have to get gps tech out to replace
Later in day, head back out to unit to replace broken pin for angle cylinder
Have to hammer pin up and torch out as much as possible, hammer back down, torch off another chunk, and pound out pin.
Install new pin with keeper

Location

 Foster

Hours

5

Parts

Signatures

Lane Peters, *Mechanic*

 May 18th 2025, 7:13 AM [MDT -06:00]



Barrett Norman, *Project Manager*

 May 18th 2025, 4:09 PM [MDT -06:00]



 51.067252, -114.1350027



Mechanic Work Order

Information

 HL750-10 [GPS - EQP]

 Foster Creek

 Tuesday, April 8th 2025, 7:18 AM (MDT -06:00)

Equipment and Maintenance Tracking

This is a new equipment tracking feature. Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 HL750-10 [GPS - EQP]

General Information

Date

 April 7, 2025

Tech Name

 Brandon German

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 0

Repair

Repair Description

 Coolant leak, drain coolant, removed EGR steel coolant pipe. O-ring cracked, matched with o-ring that was close. Refill coolant.
Install emissions module, fire unit up check for exhaust leak. Exhaust leak from emissions module, fix leak check for leaks again. Let unit run for 10 min, white some cleared up no smoke now once unit was warm.
Install hood, engine side pannels front ROPS. Remove blade pitch link, rebushing link, reinstalled.
Noticed blade tilt cyl rod eye bushing blown. Bushings ball completely out of Bushing. Parts ordered for HLD850-02 will fit unit. Remove blade tilt cyl, cylinder rod eye damaged clean up with die grinder, install new bushing. Cylinders barrel eye bushing worn grease solidified, clean out bushing get it taking grease. Flip bushing so it wear in a different spot, removed most of play from bushing. Mounting surface for cyl bushings damaged cleaned up with grinder.
Reinstalled blade tilt cyl. Greased unit and moved blade around trying to get grease threw bushings. Low bed took unit. While unit was on trailer quickly looked at window cages rattling,

rear window cage needs adjustment, LH cage upper hinge broken. Unit not inspected from winter season and top con antenna's not installed.

Location

HLC laydown yard

Hours

12

Parts

Signatures

Brandon German, *Mechanic*

📅 April 8th 2025, 7:18 AM [MDT -06:00]

📍 55.0605162, -110.5291056

B.G



Mechanic Work Order

Information

 HL750-10 [GPS - EQP]

 Foster Creek

 Monday, April 7th 2025, 7:29 AM [MDT -06:00]

Equipment and Maintenance Tracking

This is a new equipment tracking feature. Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 HL750-10 [GPS - EQP]

General Information

Date

 April 6, 2025

Tech Name

 Brandon German

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 0

Repair

Repair Description

 Reassemble emissions module, install EGR block off plates

Location

 HLC laydown yard

Hours

 4

Parts

Signatures

Brandon German, *Mechanic*



April 7th 2025, 7:29 AM (MDT -06:00)



55.0506422, -110.5287479

B.G.



Mechanic Work Order

Information

 HL750-10 [GPS - EQP]

 Foster Creek

 Sunday, April 6th 2025, 6:57 AM [MDT -06:00]

Equipment and Maintenance Tracking

This is a new equipment tracking feature. Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number  HL750-10 [GPS - EQP]

General Information

Date  April 5, 2025

Tech Name  Brandon German

Last service done @ [HR/KM]:  No Response

Next service due @ [HR/KM]:  No Response

Odometer:  0

Hours:  0

Repair

Repair Description  Remove ROPS, hood, engine side pannels, remove emissions module, extract DPF/DOC/SCR from module to send to town to get cleaned out

Location  HLC laydown yard

Hours  4

Parts

Signatures

Brandon German, *Mechanic*



April 6th 2025, 6:57 AM (MDT -06:00)



55.0606419, -110.5287485

B.G



Mechanic Work Order

Information

 HL750-10 [GPS - EQP]

 Foster Creek

 Saturday, April 5th 2025, 7:13 AM [MDT -06:00]

Equipment and Maintenance Tracking

This is a new equipment tracking feature. Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 HL750-10 [GPS - EQP]

General Information

Date

 April 4, 2025

Tech Name

 Brandon German

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 0

Repair

Repair Description

 Run delete guy out to unit to download ECM program.

Location

 D-pad in plant site

Hours

 1

Parts

Signatures

Brandon German, *Mechanic*



April 5th 2025, 7:13 AM (MDT -06:00)



55.0606419, -110.5287471

B.G



Mechanic Work Order

Information

 HL750-10 [GPS - EQP]

 Foster Creek

 Saturday, March 29th 2025, 7:14 AM [MDT -06:00]

Equipment and Maintenance Tracking

This is a new equipment tracking feature. Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number  HL750-10 [GPS - EQP]

General Information

Date  March 28, 2025

Tech Name  Brandon German

Last service done @ [HR/KM]:  No Response

Next service due @ [HR/KM]:  No Response

Odometer:  0

Hours:  0

Repair

Repair Description  Replace full cutting edge set, noticed keeper missing for blade angle cyl and pin walking out. Reinstalled pin. Removed keeper from other side to use as guide to build new one. Fabricate pin keeper. Extract broken bolt. Installed keeper.

Location  NTR

Hours  4

Parts

Signatures

Brandon German, *Mechanic*

 March 29th 2025, 7:14 AM (MDT -06:00)

 55.0606497, -110.5287604

Barrett Norman, *Project Manager*

 March 31st 2025, 8:50 AM (MDT -06:00)

 51.0447331, -114.0718831

B.G

BN



Mechanic Work Order

Information

 HL750-10 [GPS - EQP]

 Foster Creek

 Tuesday, March 25th 2025, 3:17 PM [MDT -06:00]

Equipment and Maintenance Tracking

This is a new equipment tracking feature. Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number  HL750-10 [GPS - EQP]

General Information

Date  March 24, 2025

Tech Name  Alexander Auger

Last service done @ [HR/KM]:  No Response

Next service due @ [HR/KM]:  No Response

Odometer:  0

Hours:  0

Repair

Repair Description  Tension tracks

Location  Foster creek

Hours  1

Parts

Signatures

Alexander Auger, Noble Mechanic

 March 25th 2025, 3:17 PM (MDT -06:00)



Barrett Norman, Project Manager

 March 25th 2025, 4:12 PM (MDT -06:00)

BN

 55.0606966, -110.5291515



Mechanic Work Order

Information

 HL750-10 [GPS - EQP]

 Foster Creek

 Tuesday, March 25th 2025, 3:10 PM [MDT -06:00]

Equipment and Maintenance Tracking

This is a new equipment tracking feature. Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 HL750-10 [GPS - EQP]

General Information

Date

 March 23, 2025

Tech Name

 Alexander Auger

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 0

Repair

Repair Description

 Replace ripper teeth

Location

 Foster creek

Hours

 1

Parts

Signatures

Alexander Auger, Noble Mechanic

March 25th 2025, 3:10 PM (MDT -06:00)



Barrett Norman, Project Manager

March 25th 2025, 3:11 PM (MDT -06:00)

51.0447331, -114.0718831





Mechanic Work Order

Information

 HL750-10 [GPS - EQP]

 Foster Creek

 Saturday, March 22nd 2025, 5:57 PM [MDT -06:00]

Equipment and Maintenance Tracking

This is a new equipment tracking feature. Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 HL750-10 [GPS - EQP]

General Information

Date

 March 20, 2025

Tech Name

 Alexander Auger

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 0

Repair

Repair Description

 Drive out to unit, chip out tracks, tension both tracks

Location

 Foster creek

Hours

 2

Parts

Signatures

Alexander Auger, *Noble Mechanic*

 March 22nd 2025, 5:57 PM (MDT -06:00)



Barrett Norman, *Project Manager*

 March 24th 2025, 9:18 AM (MDT -06:00)

 55.0608153, -110.5291927





Mechanic Work Order

Information

 HL750-10 [GPS - EQP]

 Foster Creek

 Monday, March 17th 2025, 5:59 AM (MDT -06:00)

Equipment and Maintenance Tracking

This is a new equipment tracking feature. Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 HL750-10 [GPS - EQP]

General Information

Date

 March 16, 2025

Tech Name

 Brandon German

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 0

Repair

Repair Description

 Research parts needed for when we delete unit

Location

 HLC laydown yard

Hours

 1

Parts

Signatures

Brandon German, *Mechanic*

 March 17th 2025, 5:59 AM (MDT -06:00)

 55.0606658, -110.5287608

B.G

Steven Orcutt, *Project Manager*

 March 17th 2025, 7:11 AM (MDT -06:00)

 54.4756317, -110.2055562





Mechanic Work Order

Information

- HL750-10 (GPS - EOP)
- Foster Creek
- Saturday, March 15th 2025, 3:54 PM [MDT -06:00]

Equipment and Maintenance Tracking

This is a new equipment tracking feature. Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number HL750-10 (GPS - EOP)

General Information

Date March 14, 2025

Tech Name Alexander Auger

Last service done @ (HR/KM):

No Response

Next service due @ (HR/KM):

No Response

Odometer:

0

Hours:

0

Repair

Repair Description

= Drive out to unit. removed damaged section of rock guard left bolted on the track frame.

Location

= Foster creek

Hours

1

Parts

Signatures

Alexander Auger, Noble Mechanic

 March 15th 2025, 3:54 PM (MDT -06:00)





Mechanic Work Order

Information

 HL750-10 [GPS - EQP]

 Foster Creek

 Tuesday, March 4th 2025, 8:16 PM [MST -07:00]

Equipment and Maintenance Tracking

This is a new equipment tracking feature. Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 HL750-10 [GPS - EQP]

General Information

Date

 March 3, 2025

Tech Name

 Wyatt Feland

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 0

Repair

Repair Description

 Drove out to unit. Tightened tracks and found loose roller bolts so tightened bolts.

Location

 Foster

Hours

 2

Parts

Signatures

Wyatt Feland, *Mechanic*



March 4th 2025, 8:16 PM [MST -07:00]



54.2110697, -111.3623146

A handwritten signature in black ink, appearing to be 'W. Feland'.



Mechanic Work Order

Information

 HL750-10 [GPS - EQP]

 Foster Creek

 Sunday, March 2nd 2025, 7:12 PM [MST -07:00]

Equipment and Maintenance Tracking

This is a new equipment tracking feature. Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 HL750-10 [GPS - EQP]

General Information

Date

 March 1, 2025

Tech Name

 Wyatt Feland

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 0

Repair

Repair Description

 Drove out to unit. Lifted unit in the air and checked all roller bolt holes. Found two broken bolts in the holes. Attempted to extract broken bolts but couldn't get them out because the roller mangled the track frame too much. Drilled bolt holes right out to re tap the hole and make new threads but ran out of time and needed to order a new tap to do the job.

Location

 Foster

Hours

 3

Parts

Signatures

Wyatt Feland, *Mechanic*



March 2nd 2025, 7:12 PM (MST -07:00)



55.0606061, -110.5288417

A handwritten signature in black ink, appearing to be 'W. Feland'.



Mechanic Work Order

Information

 HL750-10 (GPS - EQP)

 Foster Creek

 Saturday, February 22nd 2025, 5:52 PM [MST -07:00]

Equipment and Maintenance Tracking

This is a new equipment tracking feature. Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 HL750-10 (GPS - EQP)

General Information

Date

 February 22, 2025

Tech Name

 Alexander Auger

Last service done @ (HR/KM):

 No Response

Next service due @ (HR/KM):

 No Response

Odometer:

 0

Hours:

 0

Repair

Repair Description

 Drive to unit, replace ripper teeth, straightened out pin keeper mounts. Reinstall pins. Install cotter pins

Location

 Foster creek

Hours

 2

Parts

Signatures

Alexander Auger, *Noble Mechanic*

 February 22nd 2025, 5:52 PM (MST -07:00)





Mechanic Work Order

Information

 HL750-10 [GPS - EQP]

 Foster Creek

 Monday, February 17th 2025, 6:01 PM [MST -07:00]

Equipment and Maintenance Tracking

This is a new equipment tracking feature. Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 HL750-10 [GPS - EQP]

General Information

Date

 February 14, 2025

Tech Name

 Alexander Auger

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 0

Repair

Repair Description

 Drive to pad, boost unit, tighten oil filter

Location

 Foster creek

Hours

 1

Parts

Signatures

Alexander Auger, *Noble Mechanic*

 February 17th 2025, 6:01 PM (MST -07:00)





Mechanic Work Order

Information

 HL750-10 [GPS - EQP]

 Foster Creek

 Tuesday, February 11th 2025, 6:11 PM [MST -07:00]

Equipment and Maintenance Tracking

This is a new equipment tracking feature. Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 HL750-10 [GPS - EQP]

General Information

Date

 February 10, 2025

Tech Name

 Wyatt Feland

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 0

Repair

Repair Description

 Drove out to unit. changed teeth.

Location

 Foster

Hours

 2

Parts

Signatures

Wyatt Feland, *Mechanic*

 February 11th 2025, 6:11 PM (MST -07:00)

 54.2109133, -111.3623297





Mechanic Work Order

Information

 HL750-10 [GPS - EQP]

 Foster Creek

 Monday, January 6th 2025, 7:30 PM [MST -07:00]

Equipment and Maintenance Tracking

This is a new equipment tracking feature. Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 HL750-10 [GPS - EQP]

General Information

Date

 January 5, 2025

Tech Name

 Brandon German

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Odometer:

 0

Hours:

 0

Repair

Repair Description

 fix broken grease nipple, weld pitch cyl guard

Location

 EAST

Hours

 2

Parts

Signatures

Brandon German, *Mechanic*

 January 6th 2025, 7:30 PM [MST -07:00]

 55.0605916, -110.52877

B.G



Mechanic Work Order

Information

 Dozers > HL750-10 [GPS - EQP]

 Foster Creek

 Tuesday, December 31st 2024, 8:58 PM [MST -07:00]

Equipment and Maintenance Tracking

This is a new equipment tracking feature. Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 HL750-10 [GPS - EQP]

General Information

Date

 December 30, 2024

Tech Name

 Brandon German

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Unit Number

 Dozers • HL750-10 [GPS - EQP]

Odometer:

 0

Hours:

 0

Repair

Repair Description

 Replace segments

Location

 HLC laydown yard

Hours

 5

Parts

Signatures

Brandon German, *Mechanic*

 December 31st 2024, 8:58 PM (MST -07:00)

 55.1292765, -110.5655011

Brandon German, *Mechanic*

 December 31st 2024, 8:58 PM (MST -07:00)

 55.1292765, -110.5655011

Steven Orcutt, *Project Manager*

 January 1st 2025, 2:52 PM (MST -07:00)

 51.0447331, -114.0718831

B.G

B.G





Mechanic Work Order

Information

 Dozers > HL750-10 [GPS - EQP]

 Foster Creek

 Sunday, November 24th 2024, 6:16 AM [MST -07:00]

Equipment and Maintenance Tracking

This is a new equipment tracking feature. Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 HL750-10 [GPS - EQP]

General Information

Date

 November 23, 2024

Tech Name

 Wyatt Feland

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Unit Number

 Dozers > HL750-10 [GPS - EQP]

Odometer:

 0

Hours:

 0

Repair

Repair Description

 Removed three bad ripper hoses and labelled. Built three new hydraulic hoses and re installed new hoses with new o-rings.

Location

 Foster

Hours

 2

Parts

Signatures

Wyatt Feland, *Mechanic*

 November 24th 2024, 6:16 AM (MST -07:00)

 55.0606575, -110.5288467

Cory Dunlop, *Manager*

 December 1st 2024, 7:36 AM (MST -07:00)





Mechanic Work Order

Information

 Dozers > HL750-10 [GPS - EQP]

 Foster Creek

 Saturday, November 23rd 2024, 7:06 PM [MST -07:00]

Equipment and Maintenance Tracking

This is a new equipment tracking feature. Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 HL750-10 [GPS - EQP]

General Information

Date

 November 22, 2024

Tech Name

 Brandon German

Last service done @ [HR/KM]:

 No Response

Next service due @ [HR/KM]:

 No Response

Unit Number

 Dozers > HL750-10 [GPS - EQP]

Odometer:

 0

Hours:

 0

Repair

Repair Description

 Retorqued undercarriage, pulled shims out of blade ball, install weather fronts

Location

 HLC laydown yard

Hours

 6

Parts

Signatures

Brandon German, *Mechanic*

 November 23rd 2024, 7:06 PM [MST -07:00]

 55.0605679, -110.5287418

Cory Dunlop, *Manager*

 December 1st 2024, 7:37 AM [MST -07:00]

B.G





Third Party Equipment Repair & Maintenance Tracker

Information

 HL750-10 (GPS - EQP)

 Head Office

 Wednesday, February 26th 2025, 11:41 AM (MST -07:00)

Equipment and Maintenance Tracking

This is a new equipment tracking feature. Please follow the drop downs to add your equipment. This will allow all documents filled out for a unit to be linked to the unit number. Thank you.

Equipment Unit Number

 HL750-10 (GPS - EQP)

Basic Information

Date of Repair

 February 21, 2025

Company or Name of Third Party Doing Maintenance or Repair

 location cats

Provide a quick description of what was done to the unit

 inspection and oil change

 
Attach a PDF Copy of the Work Order or Invoice

 20250226115100207.pdf View

	CAT Track Type Tractor Maintenance Record	LC-107
NSD-4980		

V P P Full Fuel Reapplied N/A Not Applicable

UNIT #	ODOMETER	ENGINE HOURS	DATE	TIME
HL	750-10	4480	8-21	N/A
1	LOCKOUT IN PLACE	✓		
2	WHEEL CHECKS IN PLACE	✓		
3	Ripper Cylinder Damage, Wear, Leaks	✓		
4	Track Assembly Tightness	✓		
5	Dryer Ignition Wires, Damage, Loose Bolts	✓		
6	Rollers in Motion Leaks, Damage, Wear	✓		
7	Blade Cutting Edge, Moldboard Excessive Wear Or Damage	✓		
8	Blade Tire Cylinders Excessive Wear, Damage, Leaks	✓		
9	Pushers, Turnbolls Damage, Loose Bolts, Crankpins	✓		
10	Undercarriage Rollers	✓		
11	Final Drive Teeth Damage	✓		
12	Overall Undercarriage Pusher/Dozer Bulging	✓		
13	Upper Shank, SET Wear Or Damage	✓		
14	WPP And Hydraulic Condition And Clearance	✓		
15	Overall Machine Loose Or Missing Pins & Bolts, Loose Guards, Standings	✓		
16	Bolters & Hold Down Clearance, Loose Bolts & Nuts	✓		
17	Engine Oil Field Level and Condition	✓		
18	Transmission Oil Field Level	✓		
19	Engine Coolant Field Level and Strength	✓		
20	Air Filter Restriction Indicator	✓		
21	AJ Belts	✓		
22	Tightness, Worn Cracks	✓		
23	Exhauster	✓		
24	Debris, Damage, Leaks	✓		
25	AI Hoses	✓		
26	Cables, Wire Splice Leaks	✓		
27	Overall Engine Compartment	✓		
28	Track Or DHT Bolting, Leaks	✓		
29	Roll Over Protection System	✓		
30	Damage	✓		
31	Suit	✓		
32	Adjustment, Brake Travel	✓		
33	Suit Belt & Mounting	✓		
34	Damage, Wear, Adjustment	✓		
35	Body, Backup alarm, Lights	✓		
36	Proper Function	✓		
37	Overall Cab Interior	✓		
38	Clearance	✓		
39	Pivot Shift	✓		
40	Oil Level	✓		
41	Windshield Wipers & Wipers	✓		
42	Wiper Damage, Fluid Level	✓		
43	Hydraulic Oil Filter	✓		
44	Fluid Level, Damage, Leaks	✓		
45	Coal Tank	✓		
46	Coal Level, Damage, Leaks	✓		
47	Fire EXT. CONNECTION, DATE, TAG, LOCK, MOUNT	✓		
48	INSPECTION TAG DATE	✓		
49	FRS EXHAUSTER IN	✓		
50	FULL NOT PROVIDED	✓		
51	Heating Operation	✓		
52	Air Conditioning Operation	✓		
53	Air Filter	✓		
54	AJ Belts	✓		
55	Tightness, Worn Cracks	✓		



CAT Track Type Tractor Maintenance Record

LC-107

FLUIDS	CHECKED	CHANGED	QUANTITY ADDED & GRADE	SOS SAMPLE
Engine Oil		✓	Q1240 30wt	✓
Transmission Oil	✓			
Hydraulic Oil	✓			
Final Drive L.H.	✓			
Final Drive R.H.	✓			
Winch Oil	N/A			
Coolant	✓			

FILTERS	CHECKED	CHANGED	PART #
Engine Oil		✓	K1229219
Fuel		✓	DZ15892/DZ122545
Transmission	✓		
Hydraulic	✓		
Water Seperator		✓	AT 315957
Inner Air		✓	AT 300 487
Outer Air		✓	AT 314583
Cab Filter		✓	AT 191102

AT 315957

COMMENTS

--

Technician (Print Name) Richard Wilson (Signature) _____

Rev'd September 15, 2015

Page 2 of 2

Signatures

Richard Wilson, *Parts Manager*

 February 26th 2025, 11:41 AM (MST -07:00)

 55.0084243, -111.7149818

RL



Your OEM Alternative

Remit To:
3750 13 Street
Nisku, AB T9E 1C6
Phone: (780) 979-8502
www.uniontractor.com

Union Tractor Ltd.
3750 13 Street
Nisku, AB T9E 1C6
(780) 979-8502 FAX (780) 979-8571

INVOICE
001-579897

Bill To	Customer No.	Ship To	Customer No.	
	147325	RSS	147325	RSS
HEART LAKE CONSTRUCTION BOX 228 LAC LA BICHE, AB T0A 2C0 CANADA		HEART LAKE CONSTRUCTION BOX 228 LAC LA BICHE, AB T0A 2C0 CANADA (780) 623-2935		PG 1 OF 2
Branch Nisku		GST Number 105448161		Reference Number 001-579897
Month/Day/Year 9/24/24	Writer MIM	Order No. 9/11/24 26726	Customer P.O. HLD750-10	Terms NET 30 DAYS
				Ship Via JED
Quantity Ordered	Quantity Shipped	Back Ordered	Part Number and Description	Code Price Net Amount
WILL CALL. PHONE BRAD @ 306-441-0844 WHEN COMPLETE ** SOME/ALL ITEMS ON THIS QUOTE/ORDER ARE NON-RETURNABLE ** ** SOME/ALL ITEMS ON THIS QUOTE/ORDER ARE NON-CANCELLABLE **				
2	2		JD 750L LGP 1T0750LXKPF450164	
			UTS CR5465/45 LINK ASSY	TG 2819.532 EA 5639.06
			- JD750J	
88	88		MTW 1061605 TRACK SHOE	TG 71.873 EA 6324.82
			- 3/4" HOLE, 34" MODERATE	
2	2		MTW 1061616 MASTER SHOE	TG 74.802 EA 149.60
			- 34" MODERATE, D5H HD 3/4 H	
352	352		UTS 6V1792 BOLT, TRACK	TG 2.520 EA 887.04
			- D6H/D7H/D5H-HD 3/4X2.401 I	
352	352		UTS 1S1860 NUT	TG 1.003 EA 353.06
			- TRACK, 3/4 SQUARE	
4	4		UTS 6Y3908 T/C ROLLER	TG 121.418 EA 485.67
			- D5H, D6M,N	
8	8		BRA 1D4614 CAP SCREW	TG 9.470 EA 75.76
			- D5H IDLER	
8	8		BRA 5P8248 WASHER, HARDENED	TG 1.039 EA 8.31
			- D6H/963 RLR/IDLER, 3/4"	
8	8		BRA GR834NC NUT-HEX	TG 1.135 EA 9.08
			- B325	
10	10		UTS 1210824 ROLLER GRP, SF	TG 192.750 EA 1927.50
			- D5H, D6M,N	
6	6		UTS 1210827 ROLLER GRP, DF	TG 213.685 EA 1282.11
			- D5H, D6M,N	
64	64		BRA 6V3303 CAPSCREW	TG 3.199 EA 204.74
			- M16X2.0X60MM	
64	64		BRA 5P8247 WASHER, HARDENED	TG 0.882 EA 56.45
			- 5/8", D5H/D6M ROLLER IDLER	
2	2		SEL T349113GROUP SEGMENT GROUP	TG 460.314 EA 920.63
			- 650K, 750K,L	
50	50		BRA T354545 SEGMENT BOLT	TG 7.040 EA 352.00
50	50		BRA T354546 NUT-SEGMENT	TG 5.430 EA 271.50
			- M20X1.5 HEX	
2	2		AMP ID3134 IDLER A.	TG 2095.192 EA 4190.38
Goods Recieved By: Please Print Name		Signature X		SUBTOTAL TAX
Comment: Terms: Positively no goods accepted for credit without our prior authorization and invoice number. Goods returned subject to restocking charges when supplied as ordered.			Time Prepared	TOTAL
				Continued





Your OEM Alternative

Remit To:
3750 13 Street
Nisku, AB T9E 1C6
Phone: (780) 979-8502
www.uniontractor.com

Union Tractor Ltd.
3750 13 Street
Nisku, AB T9E 1C6
(780) 979-8502 FAX (780) 979-8571

INVOICE
001-579897

Bill To	Customer No.	Ship To	Customer No.		
	147325	RSS	147325	RSS	PG 2 OF 2
HEART LAKE CONSTRUCTION BOX 228 LAC LA BICHE, AB T0A 2C0 CANADA		HEART LAKE CONSTRUCTION BOX 228 LAC LA BICHE, AB T0A 2C0 CANADA (780) 623-2935			
Branch Nisku			GST Number 105448161		Reference Number 001-579897
Month/Day/Year 9/24/24	Writer MIM	Order No. 9/11/24 26726	Customer P.O. HLD750-10	Terms NET 30 DAYS	Ship Via JED
Quantity Ordered	Quantity Shipped	Back Ordered	Part Number and Description	Code	Price
			- JD 750		
8	8		BRA 8T0362 CAPSCREW	TG	6.340 EA 50.72
			- M20X2.5X110MM, GRADE 10.9		
8	8		BRA 5P8248 WASHER, HARDENED	TG	1.039 EA 8.31
			- D6H/963 RLR/IDLER, 3/4"		
			6 SKIDS 8 BOXES OF HARDWARE		
			GOODS & SERVICES TAX (CODE G)		\$1159.84
PART TOTAL		CORE TOTAL	LABOUR TOTAL	SPECIAL TOTAL	KIT TOTAL
23196.74		0.00	0.00	0.00	0.00
Goods Received By: Please Print Name			Signature X		SUBTOTAL 23196.74
					TAX 1159.84
Comment: Terms: Positively no goods accepted for credit without our prior authorization and invoice number. Goods returned subject to restocking charges when supplied as ordered.			Time Prepared 8:04		TOTAL 24356.58





Brandt Tractor Ltd.
#5, 360 MacKenzie Blvd.
Fort McMurray, AB
T9H 4C4
(780) 791-6635

Service Invoice



JOHN DEERE

SOLD TO:

HEART LAKE FIRST NATIONS
STK # 01852547
G/L # 105-00-0008
S/N # 1T0750LXCNF430912

PAGE
1
SALE TYPE
WARRANTY
CUSTOMER NO.

INVOICE DATE	BRANCH	INVOICE NO.
30APR24	08	1852547

SHIP TO
HEART LAKE FIRST NATIONS
CONSTRUCTION LTD 1666340
BOX 2228
LAC LA BICHE, AB T0A 2C0

PURCHASE ORDER NO.	PHONE NUMBER	WORK ORDER NO.	SEG.	DATE OPENED	SALESPRN
HLD750-10		1852547	05	07APR24	
MAKE	MODEL	SERIAL NO.	EQUIP. NO.	METER	AUTHORIZED BY
JD	750L	1T0750LXCNF430912	HLD750-1	2563	DARCY 780-623-1508

DESCRIPTION	AMOUNT
REPLACE LEAKING RIGHT FRONT BOTTOM ROLLER COMPLAINT: REPLACE LEAKING RHS FRONT BOTTOM ROLLER CAUSE: WEAK MATERIAL - LEAKING CORRECTION: DURING MACHINE CARE INSPECTION FOUND FRONT RHS BOTTOM ROLLER LEAKING Removed damaged roller & H/W. Installed new roller with H/W. Verified no longer leaking & proper operation.MMAGTIBAY 1 AT322789 BOTTOM RCY 4 R73290 WASHER 4 19M7759 CAP SCRE ** TOTAL LABOR ** CARBON TAX SURCHARGE >>--> SEG# 05 PRT LAB MSC TOTAL	

PAST DUE INTEREST 1 1/2% PER MONTH (18% ANNUUM). MINIMUM CHARGE OF \$1.50.

I hereby authorize the above repair work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount for repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sales, repair or while field testing.

X _____
SIGNATURE

DATE

QST # 1128957110

DESCRIPTION	AMOUNT
TOTAL PARTS	
TOTAL LABOR	
MISC. CHARGES SALES TAX	
PLEASE PAY THIS TOTAL	



Brandt Tractor Ltd.
#5, 360 MacKenzie Blvd.
Fort McMurray, AB
T9H 4C4
(780) 791-6635

Service
Invoice



JOHN DEERE

SOLD TO:

HEART LAKE FIRST NATIONS
STK # 01852547
G/L # 105-00-0008
S/N # 1T0750LXCNF430912

PAGE
2
SALE TYPE
WARRANTY
CUSTOMER NO.

INVOICE DATE	BRANCH	INVOICE NO.
30APR24	08	1852547

HEART LAKE FIRST NATIONS
CONSTRUCTION LTD 1666340
BOX 2228
LAC LA BICHE, AB T0A 2C0

PURCHASE ORDER NO.	PHONE NUMBER	WORK ORDER NO.	SEG.	DATE ORDERED	SALESPRN
HLD750-10		1852547	03	02APR24	
MAKE	MODEL	SERIAL NO.	EQUIP. NO.	METER	AUTHORIZED BY
JD	750L	1T0750LXCNF430912	HLD750-1	2563	DARCY 780-623-1508

DESCRIPTION	AMOUNT
verified track tension.." " Removing bolts from final drive gear was difficult due to nuts welded to the bolts on drive gear, had to cut with torch."MMAGTIBAY	
10 N T354545 SCREW XY	
10 N T354546 NUT	
1 N T175823 RING	
1 N T175824 SEAL	
2 N T49337 RETAINER	
2 N T189217 MASTER T	
2 N T189218 MASTER T	
1 N N102025 PLUG	
** TOTAL LABOR **	
CARBON TAX SURCHARGE	
>>---> SEG# 03 PRT LAB MSC TOTAL	

PAST DUE INTEREST 1 1/2% PER MONTH (18% ANNUUM), MINIMUM CHARGE OF \$1.50.		QST # 12695 7740	DESCRIPTION	AMOUNT
I hereby authorize the above repair work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount for repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sales, repair or while field testing.			TOTAL PARTS	
			TOTAL LABOR	
			MISC. CHARGES - SALES TAX	
			PLEASE PAY THIS TOTAL	
X _____ SIGNATURE		_____ DATE		

Brandt

Brandt Tractor Ltd.
#5, 360 Mackenzie Blvd.
Fort McMurray, AB
T9H 4C4
(780) 791-6635

Service
Invoice



JOHN DEERE

SOLD TO:

HEART LAKE FIRST NATIONS
STK # 01852547
G/L # 105-00-0008
S/N # 1T0750LXCNEF430912

PAGE	1
SAL TYPE	WARRANTY
CUSTOMER NO.	

INVOICE DATE	30 APR 24	08	1852547
BRANCH			
INVOICE NO.			

PURCHASE ORDER NO.	10750-10	MODEL	750L	JD
PHONE NUMBER		SERIAL NO.	110750LXCNEF430912	
WORK ORDER NO.		SEG.	03	
DATE OPENED	02 APR 24	SALSPRN		
EQUIP. NO.	1852547	METER		
AUTHORIZED BY	DARCY 780-623-1508			

REPAIR LEAK AT RIGHT SIDE PIVOT SHAFT

COMPLAINT:

COMPLAINT ON LEAK AT RHS PIVOT SHAFT

CAUSE:

WEAK MATERIAL - PREMATURELY WORN SEAL

CORRECTION:

DURING MACHINE CARE INSPECTION FOUND

PIVOT SHAFT LEAKING FROM SEAL.

"Lifted unit up with loader and blocked

in the air. Removed tracks from track

frame. Removed pins from equalizer bar,

removing pins from equalizer was very

difficult. Removed rear guards from

inside of track frames."

"Removed 2 sections of gear teeth &

locks on track frames. Used fork lift

to remove track frames & set on blocks.

Inspected & cleaned sealing surfaces.

Installed new backing plate & seal on

shafts."

"Cleaned & prepped sealing surfaces for

track frame installation."

"Lift track frame & installed onto

unit. Installed locks, final drive

gears & equalizer beam pins & set on

"Installed tracks on unit & tightened,

I hereby authorize the above repair work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount for repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sales, repair or while field testing.

PAST DUE INTEREST 1 1/2% PER MONTH (18% ANNUUM), MINIMUM CHARGE OF \$1.50.

QST # 1218957340

SIGNATURE _____		DATE _____
TOTAL PARTS	TOTAL LABOR	MISC. CHARGES
SALES TAX		PLEASE PAY THIS TOTAL
AMOUNT		***CONTINUED**

BRANCH COPY

LF-1132C



Brandt Tractor Ltd.
#5, 360 MacKenzie Blvd.
Fort McMurray, AB
T9H 4C4
(780) 791-6635

Service Invoice



JOHN DEERE

SOLD TO:

HEART LAKE FIRST NATIONS
STK # 01852547
G/L # 105-00-0008
S/N # 1T0750LXCNF430912

PAGE
1
SALE TYPE
WARRANTY
CUSTOMER NO.

INVOICE DATE	BRANCH	INVOICE NO.
30APR24	08	1852547

S
H
I
P

T
O

HEART LAKE FIRST NATIONS
CONSTRUCTION LTD 1666340
BOX 2228
LAC LA BICHE, AB T0A 2C0

PURCHASE ORDER NO.	PHONE NUMBER	WORK ORDER NO.	SEG.	DATE OPENED	SALESPER
HLD750-10		1852547	02	02APR24	
MAKE	MODEL	SERIAL NO.	EQUIP. NO.	METER	AUTHORIZED BY
JD	750L	1T0750LXCNF430912	HLD750-1	2563	DARCY 780-623-1508

DESCRIPTION	AMOUNT
REPLACE LEAKING HYDRAULIC TUBE FOUND ON INSPECTION COMPLAINT: COMPLAINT ON LEAKING HYDRAULIC TUBE CAUSE: WEAK MATERIAL - CRACKED CORRECTION: DURING MACHINE CARE INSPECTION FOUND HYDRAULIC TUBE LEAKING, INSPECT TUBE FOUND IT IS CRACKED. CONNECT TRANSDUCER ON HYDRAULIC TANK. REMOVE DAMAGED PIPE & H/W. CLEAN AREA/DURFACES FOR REPAIR. INSTALL NEW PIPE WITH NEW O-RINGS & H/W. REASSEMBLED & TEST OPERATION, NO LONGER LEAKING. MMAGTIBAY 1 N AT532022 OIL TUBECY 2 N T76938 O-RING 1 19M7809 SCREW ** TOTAL LABOR ** CARBON TAX SURCHARGE >>--> SEG# 02 PRT LAB MSC TOTAL	

PAST DUE INTEREST 1 1/2% PER MONTH (18% ANNUM), MINIMUM CHARGE OF \$1.50.

QST # 1216957240

I hereby authorize the above repair work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount for repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sales, repair or while field testing.

X _____
SIGNATURE

DATE

DESCRIPTION	AMOUNT
TOTAL PARTS	
TOTAL LABOR	
MISC. CHARGES	
SALES TAX	
PLEASE PAY THIS TOTAL	

Brandt Tractor Ltd.
#5, 360 MacKenzie Blvd.
Fort McMurray, AB
T9H 4C4
(780) 791-6635

Service
Invoice



SOLD TO:

HEART LAKE FIRST NATIONS
CONSTRUCTION LTD 1666340
BOX 2228
LAC LA BICHE, AB T0A 2C0

PAGE
1
SALE TYPE
CHARGE
CUSTOMER NO.

INVOICE DATE	BRANCH	INVOICE NO.
30APR24	08	1852547

S
H
I
P
T
O

PURCHASE ORDER NO.	PHONE NUMBER	WORK ORDER NO.	SEG.	DATE OPENED	SALESPRN
HLD750-10		1852547	01	02APR24	
MAKE	MODEL	SERIAL NO.	EQUIP. NO.	METER	AUTHORIZED BY
JD	750L	1T0750LXCNF430912	HLD750-1	2563	DARCY 780-623-1508

DESCRIPTION	AMOUNT
PERFORM MACHINE CARE INSPECTION CORRECTION: Perform Inspection: -operators station panels loose & missing H/W -cabin air filter is dirty -engine air filter needs to be changed -missing inlet cover -oil leak under cab -oil leak off main pump feed tube -RHS track final drive inner overfull by 1.5L -LHS track final inner overfull by 1.5L -HYD oil needs to be topped up after leak repaired -rock guard missing back inner LH -track frame panels bent -cutting edge needs to be replaced -middle ripper missing tooth on shank -normal operation play for blades/buckets/bins -3 bolts missing on back of blade -pins & bushings normal operation wear -starting to have play (barely 1/8" on all) -RH/LH pivot shaft leaking, recommend doing eyelet bushing at same time -stored codes 521274.09, 1856.01, 111.01, 1569.31 & 1075.05	

PAST DUE INTEREST 1 1/2% PER MONTH (18% ANNUUM). MINIMUM CHARGE OF \$1.50.

QST # 1228957260

I hereby authorize the above repair work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount for repairs thereto.
It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sales, repair or while field testing.

X

SIGNATURE

DATE

DESCRIPTION	AMOUNT
TOTAL PARTS	
TOTAL LABOR	
MISC. CHARGES SALESTAX	
PLEASE PAY THIS TOTAL	**CONTINUED**

Brandt Tractor Ltd.
#5, 360 MacKenzie Blvd.
Fort McMurray, AB
T9H 4C4
(780) 791-6635

Service
Invoice



JOHN DEERE

SOLD TO:

HEART LAKE FIRST NATIONS
CONSTRUCTION LTD 1666340
BOX 2228
LAC LA BICHE, AB T0A 2C0

INVOICE DATE	BRANCH	INVOICE NO.
30APR24	08	1852547

PAGE	2
SALE TYPE	
CHARGE	
CUSTOMER NO.	

S
H
I
P

T
O

PURCHASE ORDER NO.	PHONE NUMBER	WORK ORDER NO.	SEG.	DATE OPENED	SALES PRN
HLD750-10		1852547	01	02APR24	
MAKE	MODEL	SERIAL NO.	EQUIP. NO.	METER	AUTHORIZED BY
JD	750L	1T0750LXCNE430912	HLD750-1	2563	DARCY 780-623-1508

DESCRIPTION					AMOUNT	
-PDU software needs to be updated						
-under carriage has normal wear, recommend to monitor						
-recommend changing engine oil & filter						
-cab mounts are worn						
-1 front RH bottom roller is leaking						
1	TY27787	SCAN TES		121.76		109.58
7	AT346594	FLUID KI		34.20		215.46
12	TY26349	TUBE		.53		5.72
	* LABOR *					1,450.00
	CARBON TAX SURCHARGE			29.00		29.00
-->--> SEG# 01 PRT 330.76 LAB 1,450.00 MSC 29.00 TOTAL						1,809.76
* GST/HST *						90.49
REPLACE DAMAGED LEFT INNER TRACK GUARDS						
CORRECTION:						
Removed guards from track frame. Buffed & cleaned surfaces. Installed new guards with new H/W.						
1	T202903	GUIDE CY		954.89		859.40
1	T200276	GUARD CY		718.55		646.70
8	24M7241	WASHER		6.26		45.07
8	19M7488	CAP SCRE		9.06		65.23
6	19M7597	CAP SCRE		12.14		65.56
	* LABOR *					312.50
1	SERVICE ACCESSORIES			37.50		33.75
	CARBON TAX SURCHARGE			6.25		6.25
>>--> SEG# 06 PRT 1,681.96 LAB 312.50 MSC 40.00 TOTAL						2,034.46

PAST DUE INTEREST 1 1/2% PER MONTH (18% ANNUUM). MINIMUM CHARGE OF \$1.50.

I hereby authorize the above repair work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount for repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sales, repair or while field testing.

X

SIGNATURE

DATE

TOTAL PARTS

TOTAL LABOR

MISC. CHARGES
SALES TAX

PLEASE PAY
THIS TOTAL

***CONTINUED**

CUSTOMER COPY

Brandt Tractor Ltd.
#5, 360 MacKenzie Blvd.
Fort McMurray, AB
T9H 4G4
(780) 791-6635

Service
Invoice



JOHN DEERE

SOLD TO:

HEART LAKE FIRST NATIONS
CONSTRUCTION LTD 1666340
BOX 2228
LAC LA BICHE, AB T0A 2C0

INVOICE DATE	BRANCH	INVOICE NO.
30APR24	08	1852547

PAGE
3
SAL TYPE
CHARGE
CUSTOMER NO.

S
H
I
P

T
O

PURCHASE ORDER NO.	PHONE NUMBER	WORK ORDER NO.	SEQ.	DATE OPENED	SALESPRN
HLD750-10		1852547	06	07APR24	
MAKE	MODEL	SERIAL NO.	EQUIP. NO.	METER	AUTHORIZED BY
JD	750L	1T0750LXCNE430912	HLD750-1	2563	DARCY 780-623-1508

DESCRIPTION					AMOUNT
* GST/HST *					101.72
REPLACE CUTTING EDGES					
CORRECTION:					
Removed ol H/W & cutting edges. Removed imperfections & sanded down mating surfaces. Installed new cutting edges with new H/W.					
Tightened all H/W with 1/2" air impact until tight & marked bolts.					
32	PB750250ITR	KIT, HDW	3.03		87.26
2	T204083X	END BIT	194.44		349.99
1	T204080X	END BIT	110.18		99.16
1	T204081X	DURA MAX	110.18		99.16
1	T204082X	EDGE	172.05		154.85
* LABOR *					500.00
1	SERVICE ACCESSORIES		60.00		54.00
	CARBON TAX SURCHARGE		10.00		10.00
>>--> SEG# 07 PRT 790.42 LAB 500.00 MSC 64.00 TOTAL 1,354.42					
* GST/HST *					67.72
REPLACE MISSING COVER ON HOOD					
CORRECTION:					
Installed new cover on hood.					
1	T411322	PLATE CY	180.02		162.02
4	24M7664	WASHER	7.91		28.48
4	19M10314	CAP SCRE	7.96		28.66
1	14M7151	NUT	.96		.86

PAST DUE INTEREST 1 1/2% PER MONTH (18% ANNUM). MINIMUM CHARGE OF \$1.50.

I hereby authorize the above repair work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount for repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sales, repair or while field testing.

X _____
SIGNATURE

DATE

TOTAL PARTS

TOTAL LABOR

MISC. CHARGES
SALES TAX

PLEASE PAY
THIS TOTAL

➔ **CONTINUED**

CUSTOMER COPY

Brandt Tractor Ltd.
#5, 360 MacKenzie Blvd.
Fort McMurray, AB
T9H 4C4
(780) 791-6635

Service
Invoice



JOHN DEERE

INVOICE DATE	BRANCH	INVOICE NO.
30APR24	08	1852547

SOLD TO:

HEART LAKE FIRST NATIONS
CONSTRUCTION LTD 1666340
BOX 2228
LAC LA BICHE, AB T0A 2C0

PAGE	4
SALE TYPE	
CHARGE	
CUSTOMER NO.	

S
H
I
P

T
O

PURCHASE ORDER NO.	PHONE NUMBER	WORK ORDER NO.	SEG.	DATE OPENED	SALESPRN
HLD750-10		1852547	08	07APR24	
MAKE	MODEL	SERIAL NO.	EQUIP. NO.	METER	AUTHORIZED BY
JD	750L	1T0750LXCNE430912	HLD750-1	2563	DARCY 780-623-1508

DESCRIPTION						AMOUNT
1	AT356899	BUMPER	CY	78.11		70.30
	* LABOR *					250.00
1	SERVICE ACCESSORIES			30.00		27.00
	CARBON TAX SURCHARGE			5.00		5.00
>>--> SEG# 08 PRT 290.32 LAB 250.00 MSC 32.00 TOTAL						572.32
* GST/HST *						28.62
REPLACE CAB MOUNTS						
CORRECTION:						
Removed all cab mounting H/W.						
Disconnected electrical lines & window washer lines. Removed floor pan, front ROPS connection.						
Recovered A/C refrigerant. Disconnect A/C lines, heater hoses & prep to lift cab.						
Set picker truck in place & lift cab, set aside on blocks.						
Inspected mounting surfaces for further damaged, good. Installed 4 new cab mounts. Lift cab back in place & secure. Reconnect all lines. Flush system & replace receiver drier.						
Recharge A/C. Reconnect all cab wiring & lines. Reinstall FOPS, heater & floor pans. Install GPS cable. Test operation, verify no leaks present, good.						
2	AT527662	ISOLATOR		511.05		919.89

PAST DUE INTEREST 1 1/2% PER MONTH (18% ANNUM). MINIMUM CHARGE OF \$1.50.

I hereby authorize the above repair work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount for repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sales, repair or while field testing.

X _____
SIGNATURE

DATE

DESCRIPTION	AMOUNT
TOTAL PARTS	
TOTAL LABOR	
MISC. CHARGES	
SALES TAX	
PLEASE PAY THIS TOTAL	***CONTINUED**

Brandt Tractor Ltd.
#5, 360 MacKenzie Blvd.
Fort McMurray, AB
T9H 4C4
(780) 791-6635

Service
Invoice



SOLD TO:

HEART LAKE FIRST NATIONS
CONSTRUCTION LTD 1666340
BOX 2228
LAC LA BICHE, AB T0A 2C0

INVOICE DATE	BRANCH	INVOICE NO.
30APR24	08	1852547

PAGE
5
SALE TYPE
CHARGE
CUSTOMER NO.

S
H
I
P

T
O

PURCHASE ORDER NO.	PHONE NUMBER	WORK ORDER NO.	SEG.	DATE OPENED	SALESPRN
HLD750-10		1852547	09	07APR24	
MAKE	MODEL	SERIAL NO.	EQUIP. NO.	METER	AUTHORIZED BY
JD	750L	1T0750LXCNF430912	HLD750-1	2563	DARCY 780-623-1508

	DESCRIPTION	AMOUNT
8	19M7786 SCREW	5.83 41.98
2	H84374 BUSHING CY	36.73 66.11
4	19M7759 CAP SCRE	7.55 27.18
2	AT489997 ISOLATORCY	157.95 284.31
8	19M8320 SCREW	6.42 46.22
2	24M7653 WASHER CY	9.79 17.62
1	AT162848 RECEIVER	139.79 125.81
2	R10093 O-RING	3.40 6.12
1	R183410 O-RING	4.12 3.71
1	R183411 O-RING	4.29 3.86
1	TY26575 COOL-GAR	23.36 21.02
4	WDF WASTE DI	.10 .36
	* LABOR *	7,500.00
1	SERVICE ACCESSORIES	900.00 810.00
	CARBON TAX SURCHARGE	150.00 150.00

>>---> SEG# 09 PRT 1,564.19 LAB 7,500.00 MSC 960.00 TOTAL 10,024.19
* GST/HST * 501.21

REPLACE PINS AND BUSHINGS AT HARD BAR

CORRECTION:

Jacked unit up on blocks securing in place. Removed track tension, track bolts & tracks. Removed pins from equalizer bar, rear track frame & sprockets from final drives. Nuts had welded bolts, had to torch to remove. Removed bushings from hardbar & installed new ones. Reassembled hardbar & installed. Replace pins. Reinstall

PAST DUE INTEREST 1 1/2% PER MONTH (18% ANNUM). MINIMUM CHARGE OF \$1.50.

I hereby authorize the above repair work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount for repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sales, repair or while field testing.

X

SIGNATURE

DATE

DESCRIPTION	AMOUNT
TOTAL PARTS	
TOTAL LABOR	
MISC. CHARGES	
SALES TAX	
PLEASE PAY THIS TOTAL	***CONTINUED**

CUSTOMER COPY

Brandt Tractor Ltd.
#5, 360 MacKenzie Blvd.
Fort McMurray, AB
T9H 4C4
(780) 791-6635

**Service
Invoice**



JOHN DEERE

INVOICE DATE	BRANCH	INVOICE NO.
30APR24	08	1852547

SOLD TO:

HEART LAKE FIRST NATIONS
CONSTRUCTION LTD 1666340
BOX 2228
LAC LA BICHE, AB T0A 2C0

PAGE	6
SALE TYPE	
CHARGE	
CUSTOMER NO.	

S
H
I
P

T
O

PURCHASE ORDER NO.	PHONE NUMBER	WORK ORDER NO.	SEG.	DATE OPENED	SALESPRN
HLD750-10		1852547	10	07APR24	
MAKE	MODEL	SERIAL NO.	EQUIP. NO.	METER	AUTHORIZED BY
JD	750L	1T0750LXCNF430912	HLD750-1	2563	DARCY 780-623-1508

DESCRIPTION					AMOUNT
tracks. tension tracks & adjust sag. Lower to ground & test to verify proper operation.					
1	T204740	BUSHING	408.90		368.01
2	T102207	SEAL	44.99		80.98
4	40M1873	SNAP RIN	26.06		93.82
2	AT128774	SELF-ALI	129.69		233.44
4	AT184799	SEAL	186.59		671.72
2	24M7349	WASHER	5.96		10.73
1	19M7907	SCREW	27.49		24.74
2	AT455569	PINPIN	559.19		1,006.54
	* LABOR *				1,875.00
1	SERVICE ACCESSORIES		225.00		202.50
	CARBON TAX SURCHARGE		37.50		37.50
>>---> SEG# 10 PRT 2,489.98 LAB 1,875.00 MSC 240.00 TOTAL					4,604.98
* GST/HST *					230.25
CHANGE ENGINE OIL AND FILTER					
CORRECTION: Drain engine oil & refill with new oil. Replace engine oil filter.					
1	RE539279	OIL FILT	42.05		37.85
1	R502513	SEAL	10.06		9.05
1	2666420L	20L - 36	262.81		236.53
44	WDF	WASTE DI	.10		3.96
3	TY26664	PLUS-50	66.68		180.04
2	TY27318	HYDRAULI	252.44		454.39
1	TY22000	LOW VISC	39.38		35.44
	* LABOR *				375.00

PAST DUE INTEREST 1 1/2% PER MONTH (18% ANNUUM). MINIMUM CHARGE OF \$1.50.

QST # 1226957240

I hereby authorize the above repair work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount for repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sales, repair or while field testing.

X

SIGNATURE

DATE

DESCRIPTION	AMOUNT
TOTAL PARTS	
TOTAL LABOR	
MISC. CHARGES	
SALES TAX	
PLEASE PAY THIS TOTAL	***CONTINUED**

Brandt Tractor Ltd.
#5, 360 MacKenzie Blvd.
Fort McMurray, AB
T9H 4C4
(780) 791-6635

Service Invoice



JOHN DEERE

SOLD TO:

HEART LAKE FIRST NATIONS
CONSTRUCTION LTD 1666340
BOX 2228
LAC LA BICHE, AB T0A 2C0

INVOICE DATE	BRANCH	INVOICE NO.
30APR24	08	1852547

PAGE
7
SALE TYPE
CHARGE
CUSTOMER NO.

S
H
I
P

T
O

PURCHASE ORDER NO.	PHONE NUMBER	WORK ORDER NO.	SEG.	DATE OPENED	SALESPRN
HLD750-10		1852547	11	10APR24	
MAKE	MODEL	SERIAL NO.	EQUIP. NO.	METER	AUTHORIZED BY
JD	750L	1T0750LXCNF430912	HLD750-1	2563	DARCY 780-623-1508

DESCRIPTION						AMOUNT
1	SERVICE ACCESSORIES					45.00
	CARBON TAX SURCHARGE					7.50
>>--> SEG# 11 PRT 957.26 LAB 375.00 MSC 48.00 TOTAL						1,380.26
* GST/HST *						69.01
* TOTAL GST/HST * - GST No. 899544779						1,089.02

PAST DUE INTEREST 1 1/2% PER MONTH (18% ANNUM). MINIMUM CHARGE OF \$1.50.

I hereby authorize the above repair work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount for repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sales, repair or while field testing.

X _____
SIGNATURE

DATE

QST # 1226957240

DESCRIPTION	AMOUNT
TOTAL PARTS	8,104.89
TOTAL LABOR	12,262.50
MISC. CHARGES	1,413.00
SALES TAX	0.00
PLEASE PAY THIS TOTAL	22,869.41